*File Name: TRANSMT.PRJ





3315 Almaden Expressway, Suite 34

San Jose, CA 95118 Phone: (408) 264-7723 Fax: (408) 264-2435

TRANSMITTAL

TO:	MS. SUSAN HUGO ACHCSA-DRH			: 5/29/9			
	80 SWAN WAY, R	OOM 200	PROJECT NUMBER: 69028.06				
	OAKLAND, CALIF		SUBJECT: ARCO STATION 6113 AT 785 EAST STANLEY BOULEVARD, LIVERMORE, CA				
FROM	W. Fb. ch. none com-						
TITLE	PROJECT	GEOLOGIST					
WE AR	E SENDING YOU	料 Attached	[] Under separa	te cover via _	the following items:		
	[] Shop drawings	[] Prints	[] Reports	[] Specification	ons		
	[] Letters	[] Change On	ders []		-		
COPII	ES DATED	NO.		DESCR	IPTION		
1	5/29/92	1			UR TELEPHONE CONVERSAT		
		1			RNING THE PROPOSED WOR	K	
					D SAFETY PLAN FOR THE		
			ABOVE SUBJEC	CT SITE.	· · · · · · · · · · · · · · · · · · ·		
					<u>-</u>		
THESE	ARE TRANSMITT	ED as checked belo	w:				
[] F	For review and comm	nent [] Approved	as submitted	[] Resubmit	copies for approval		
[] A	As requested	[] Approved	as noted	[] Submit	copies for distribution		
[] F	For approval	[] Return for	corrections	[] Return _	_ corrected prints		
[] F	For your files						
REMA	RKS:cc:						
		CHRIS WINSON					
		EDDY SO, RWQ	CB O-LEGAL DIVIS	LOM			
			FANI, CITY OF		בוסף אפסי		
		DAMILEUME SIE	PANT, UIII OF	TI A PREIORE	LIND DULL.		
Copies:	1 to project file no	69028.06		52 <u>-</u>			
-					*Revision Date: 11/21/91		



A RESNA Company



3315 Almaden Expressway, Suite 34 San Jose, CA 95118

Phone: (408) 264-7723 Fax: (408) 264-2435

> May 29, 1992 69028.06 0529shgo

Ms. Susan Hugo Alameda County Health Care Services Agency Department of Environmental Health 80 Swan Way, Room 200 Oakland, California 94621

Subject:

Follow-up Letter to our telephone conversation of May 11, 1992 concerning the proposed work and copy of Health and Safety Plan for ARCO Station 6113, 785 East Stanley Boulevard, Livermore, California.

Dear Ms. Hugo:

This letter is submitted as follow-up to our telephone conversation referenced above concerning work proposed in the recently submitted Work Plan (RESNA, October 17, 1992) for Additional Subsurface Investigation and Vapor Extraction Test and Addendum to Work Plan (RESNA, March 3, 1992) at the subject site. As requested, a copy of our health and safety plan is included for your records. As discussed, the proposed boring B-9, located near the former waste-oil storage tank, will be used for installation of a groundwater monitoring well and soil and groundwater samples from the boring/well will be analyzed for total petroleum hydrocarbons as gasoline (TPHg), total petroleum hydrocarbons as diesel (TPHd), total oil and grease (TOG), halogenated volatile organic compounds (VOCs), and the metals Cadmium (Cd), Chromium (Cr), Lead (Pb), Zinc (Zn), and Nickel (Ni) using The boring/well B-11/VW-9 included in the Tri-Regional Board recommendations. proposed work section of the above-referenced addendum to work plan will not be drilled and installed, as we discussed.

It is anticipated that work will begin at the site the week of June 8, 1992. If you have any questions or comments, please call us at (408) 264-7723. Thank you.

Sincerely, RESNA

Voel Coffman //
Project Geologist

cc: Michael Whelan, ARCO Products Company
Chris Winsor, ARCO Products Company
Eddy So, Regional Water Quality Control Board
J.P. Meck, ARCO Products Company, Legal Division
Danielle Stefani, City of Livermore Fire Department





3315 Almaden Expressway, Suite 34 San Jose, CA 95118

Phone: (408) 264-7723 Fax: (408) 264-2435 69028.06S

for the
ARCO Station 6113
785 East Stanley Boulevard
Livermore, California

1.0 General

1.1 Background

RESNA Industries (RESNA) has been retained by ARCO Products Company (ARCO) to perform a site assessment/investigation at ARCO Station 6113, 785 East Stanley Boulevard, Livermore, California. Accordingly, this Site Safety Plan was prepared in conformance with RESNA's Health and Safety Program, and is intended to meet the requirements of 29 CFR 1910.120. As such, this Site Safety Plan addresses the activities associated with field operations conducted at this site. Compliance with the Site Safety Plan is required of all RESNA personnel, contractors, or a third party that enters the site. Field activities are planned to begin on May 26, 1992, with the duration estimated at approximately 1 week after the start date.

1.2 Purpose

This Site Safety Plan describes basic safety requirements for the subsurface environmental investigation. The provisions set forth in this Plan apply to the employees of RESNA and its subcontractors working on this phase of the project.

This Site Safety Plan will address the expected potential chemical and physical hazards that may exist, or be encountered on the worksite for this project. Secondarily, the information contained herein will define the safety precautions necessary to respond to such hazards should they occur. If changes in site or working conditions occur as activities progress, addenda to this plan will be provided by RESNA.

1.3 Objective

The primary objective is to ensure the well-being of all field personnel and the community surrounding this gasoline service station. In order to accomplish This, project staff and approved subcontractors shall acknowledge and adhere to the policies and procedures established herein. Accordingly, all personnel assigned to this project shall read and sign the Agreement and Acknowledgement Statement (Appendix A) to certify that they have read, understood, and agreed to abide by its provisions.

1.4 Amendments

Any changes in the scope of this project and/or site conditions must be amended in writing on the Site Safety Plan Amendment Sheet (Appendix B) and approved by the Health and Safety Manager. The subcontractors may elect to modify these provisions, but only to upgrade or increase the safety requirements, and only with the concurrence of RESNA, as designated and accepted in writing.

1.5 Medical Monitoring Program

All RESNA field personnel and subcontractors engaged in project activities must participate in a medical surveillance program and must be cleared by the examining physician(s) to wear respiratory protection devices and protective clothing for working with hazardous materials. The applicable requirements of Title 8, Section 5216, of the <u>California Administrative Code</u> will be observed. The applicable requirements under 29 CFR 1910.120 of the Federal Administrative Code will also be observed.

1.6 Employee Training

All personnel working on this site, who may be potentially exposed to toxic substances or hazardous materials, must initially participate in a 40 hour training program (29 CFR 1910.120 [4]) designed towards the recognition, evaluation, and control of worksite hazards.

1.7 Tailgate Meetings

Job site tailgate meetings shall be conducted by the Site Safety Officer at the beginning of each shift for each job and whenever new employees arrive at the job site. For construction activities, tailgate meetings must be held at least once every ten working days. The initial site meeting shall include a discussion of site work plans, monitoring protective equipment, site rules, site hazards, and this site safety plan. In addition, fit-testing of respiratory protective devices will be conducted as part of the safety orientation meeting when the use of a respirator may be required.

2.0 Project Personnel

The RESNA personnel responsible for project safety are the Project Manager and the Staff Geologist or Engineer. The Project Manager will be responsible for implementing the project and obtaining any necessary personnel or resources for the completion of the project, for providing a copy of this Plan to the Staff Geologist or Engineer, and for advising the Staff Geologist or Engineer on health and safety matters. The Health and Safety Coordinator is responsible for the overall RESNA Health and Safety Program and may



choose to audit the site for compliance and take appropriate action to correct deficiencies. The Project Manager and Staff Geologist or Engineer have the authority to audit site activities for compliance with the provisions of this Plan. They may suspend or modify work practices or dismiss subcontractors whose conduct does not meet the requirements specified in this Plan. All field personnel shall be responsible for acting in compliance with all safety procedures outlined in this site safety plan.

The Staff Geologist or Engineer is responsible for communicating the information contained in this Plan to the RESNA personnel assigned to the project and to the responsible representative of each subcontractor working for RESNA on the project.

The Staff Geologist or Engineer will also act as the Site Safety Officer. As such, the Staff Geologist or Engineer is responsible for addressing the following items:

- o Implementing the Site Safety Plan, Company policy, and procedures
- o Requiring and maintaining adequate safety supplies and equipment inventory onsite
- o Conducting daily safety meetings and advising workers regarding hazards
- o Site control, decontamination, and contamination-reduction procedures
- o Reporting accidents or incidents

The Staff Geologist or Engineer has the authority to suspend work any time he or she finds that the provisions of the Plan are inadequate for worker safety. The Staff Geologist or Engineer will inform the Project Manager and the Health and Safety Coordinator promptly of deficiencies within the Plan or individuals or subcontractors whose conduct is not consistent with the requirements of this Plan.

3.0 Hazard Assessment

3.1 General

The major contaminants expected to be encountered on the project are gasoline and its hydrocarbon constituents. The anticipated contaminants and their exposure standards are listed in Table 1. Potential effects of any exposure are dependant on several factors, such as: toxicity of substance, timeframe of exposure, concentration of substance producing exposure, general health of person exposed, and individual use of hazard reduction methods. It is not anticipated that the potential levels of exposure will reach the permissible exposure



limits (PEL) or threshold limit values (TLV). Inhalation and dermal contact are the potential exposure pathways. Protective clothing will be mandatory for field personnel specified in this Plan. In addition, respiratory protective devices are required to be worn by each person onsite or to be within easy reach should irritating odors be detected or irritation of the respiratory tract occur.

TABLE 1 EXPOSURE LIMITS OF ANTICIPATED CHEMICAL CONTAMINANTS ARCO Station 6113 785 East Stanley Boulevard Livermore, California (page 1 of 2)

Contaminant	PEL	EL	ED	CL	TWA	STEL
Benzene ¹ [skin] & [carc]	1*				10*	5*
Ethylbenzene	100*	_			100*	125*
Toluene [skin]	100*	200*	10 min per 8 hours	500*	100*	150*
Xylene (o,m, & p isomers) [skin]	100*	200₹	30 min per 8 hrs	300*	100*	150*
Gasoline ²	300*	_		_	300*	500*
Diesel	-			5		

See notes on page 2 of 2.



TABLE 1 EXPOSURE LIMITS OF ANTICIPATED CHEMICAL CONTAMINANTS ARCO Station 6113 785 East Stanley Boulevard Livermore, California (page 2 of 2)

PEL	-	permissible exposure limit: 8 hour, time-weighted average, California Occupational Safety and Healt Administration Standard (CAL-OSHA)
EL	-	excursion limit: maximum concentration of an airborne contaminant to which an employee may be exposed without regard to duration provided the 8 hour time-weighted average for PEL is not exceeded (CAL OSHA)
ED	-	excursion duration: maximum time period permitted for an exposure above the excursion limit but no exceeding the ceiling limit (CAL-OSHA)
CL	-	ceiling limit: maximum concentration of airborne contaminant which employees may be exposed permitter (CAL-OSHA)
TWA	•	time-weighted average: 8 hour, [(same as threshold limit value (TLV)], American Conference of Governmental Industrial Hygienists (ACGIH)
STEL	-	short-term exposure limit: 15 minute time-weighted average (ACGIH)
#	•	milligrams of substance per cubic meter of air (mg/m ³)
*	-	parts of gas or vapor per million parts air
[carc]	-	substance identified as a suspected or confirmed carcinogen
skin	-	substance may be absorbed into the bloodstream through the skin, mucous membranes, or eyes
1	-	Federal OSHA benzene limits given for PEL and STEL; STEL has a 50 minute duration limit
2	-	Federal OSHA gasoline limit given for PEL; STEL is the same for FED-OSHA and ACGIH

A brief description of the physical characteristics, incompatibilities, toxic effects, routes of entry, and target organs has been summarized from the NIOSH Pocket Guide to Chemical Hazards for the contaminants anticipated to be encountered. This information is used in onsite safety meetings to alert personnel to the hazards associated with the expected contaminants.

3.2 Hazardous Chemicals

3.2.1 Benzene

Benzene is a colorless, aromatic liquid. Benzene may create an explosion hazard. Benzene is incompatible with strong oxidizers, chlorine, and bromine with iron. Benzene is irritating to the eyes, nose, and respiratory system. Prolonged exposure may result in giddiness, headache, nausea, staggering gait, fatigue, bone marrow depression, or abdominal pain. Routes of entry include inhalation, absorption, ingestion, and skin or eye contact. The target organs are blood, the central nervous system (CNS), skin, bone marrow, eyes, and respiratory system. Benzene is carcinogenic.



3.2.2 Ethylbenzene

Ethylbenzene is a colorless, aromatic liquid. Ethylbenzene may create an explosion hazard. Ethylbenzene is incompatible with strong oxidizers. Ethylbenzene is irritating to the eyes and mucous membranes. Prolonged exposure may result in headache, dermatitis, narcosis, or coma. Routes of entry include inhalation, ingestion, and skin or eye contact. The target organs are the eyes, upper respiratory system, skin, and the CNS.

3.2.3 Toluene

Toluene is a colorless, aromatic liquid. Toluene may create an explosion hazard. Toluene is incompatible with strong oxidizers. Prolonged exposure may result in fatigue, confusion, euphoria, dizziness, headache, dilation of pupils, lacrimation, insomnia, dermatitis, or photophobia. Routes of entry are inhalation, absorption, ingestion, and skin or eye contact. The target organs are the CNS, liver, kidneys, and skin.

3.2.4 Xylene Isomers

Xylene is a colorless, aromatic liquid. Xylene may create an explosion hazard. Xylene is incompatible with strong oxidizers. Xylene is irritating to the eyes, nose, and throat. Prolonged exposure may result in dizziness, excitement, drowsiness, staggering gait, corneal vacuolization, vomiting, abdominal pain, or dermatitis. Routes of entry are inhalation, absorption, ingestion, and skin or eye contact. The target organs are the CNS, eyes, gastrointestinal tract, blood, liver, kidneys, and skin.

3.2.5 Gasoline

Gasoline is a complex mixture of hydrocarbons and additives. Chronic exposures or exposures to a high concentration of gasoline vapor may cause unconsciousness, coma, and possibly death from respiratory failure. Exposure to low concentrations of gasoline vapor may produce flushing of the face, slurred speech, and mental confusion.

3.2.6 Diesel

Diesel fuel is a complex mixture of paraffinis, olefinic, naphthenic, and aromatic hydrocarbons. Diesel is a clear, bright liquid with a mild petroleum odor. Inhalation of excessive concentrations of vapor or mist can be irratating to the respiratory passages and can cause the following symptoms: headache, dizziness, nausea, vomiting, andfthe loss of coordination. Prolonged or repeated skin contact may cause irritation of the hair follicles and block the sebaceous glands. This produces a rash of acne pimples and spots, usually on the arms and legs.



3.3 Initial Level of Protection

The minimum acceptable level of protection at this site is Level D, as described in the section entitled "Work Practices and Personal Protective Equipment".

3.4 Initial Air Monitoring

Potentially explosive and flammable atmospheres and the possibility of exposure to benzene, gasoline, and other organic vapors, as well as the potential for oxygen-enriched or oxygen-deficient atmospheres, represent the greatest potential hazard for safety and health at this site. Ongoing air monitoring will provide data to ensure that vapor concentrations are within acceptable ranges to provide adequate selection criteria for respiratory and dermal protection. The following monitoring procedures will be routinely undertaken.

Prior to the initiation of activity at the site, and periodically throughout site operations, ambient air level for toxic vapors, potentially explosive atmospheres, and oxygen deficiency will be determined utilizing a Organic Vapor Meter (OVM). Measurements will be taken at the start of each task and at anytime during the process when it is suspected that air concentrations have changed as suggested by appropriate warning properties, including odor threshold, irritation, employee stress, or as otherwise noted.

3.5 Confined Space Monitoring

OVM readings will be taken at the top, middle, and bottom of a vault, shed, or other confined space to ensure that vapors do not exceed acceptable levels.

If OVM readings exceed 100 ppm, a respirator with organic vapor cartridges must be worn by all site workers within ani area where monitoring results exceed 100 ppm.

If OVM readings are between 100 ppm and 750 ppm, cartridges should be exchanged immediately if any odor is detected or when breathing becomes difficult. Because the warning properties of the contaminants are good, breakthrough detection will be noted at levels below the TLV.

If OVM readings exceed 750 ppm, personnel shall leave site immediately and contact the site safety officer of the Branch Safety Officer for further instructions.

The results of vapor monitoring should be recorded on the Results of Vapor Monitoring Form included within this Site Safety Plan (Appendix I).



Before entering a confined space or below grade vault, the following two monitoring procedures will be completed with the OVM:

- 1) Because of the high vapor density of the contaminants, there is a high probability that the vapors in the enclosed spaces or vaults will replace the oxygen that is present, even if the space is open to air. Therefore, oxygen level monitoring will be done at the top, middle, and the bottom of the enclosed space to determine if there is a minimum acceptable oxygen level of 19.5% prior to entry.
 - a) If oxygen levels are below the 19.5%, personnel must wear as air-supplied respirator. Contact the Site Safety Officer or Branch Safety Officer prior to entering the confined space for further instructions.
 - b) If oxygen levels exceed 23%, personnel must leave the site immediately. Oxygen levels over 23% present a fire hazard. Notify the Fire Department.
- Because vapors can collect in spaces and in low area, sampling shall be done to determine whether the vapor concentrations exceed 20% of the Lower Explosive Limit (LEL). If readings exceed 20% LEL, personnel shall shut off accessible equipment, leave the site immediately, and contact the Fire Department.

All monitoring equipment shall be calibrated and maintained according to manufacture's recommendation. A calibration/maintenance form is included within this Site Safety Plan (Appendix J).

4.0 SITE CONTROL

The site itself will normally be divided into three zones: the majority of the work will be conducted within the exclusion zone, with a limited area serving as the Support Zone, and a area for decontamination titled the Contamination Reduction Zone. In many sites, the zones will be mobile, such as a site with many monitoring wells in which the work moves from one well to another.

Each of the areas where the borings will be drilled will be designated as Exclusion Zones. Only essential personnel will be allowed into an Exclusion Zone. When it is practical and local topography allows, approximately 25 to 75 feet of space surrounding those Exclusion Zones will be designated as Contamination Reduction Zones.



Cones, wooden barricades, or a suitable alternative will be used to deny public access to these Contamination Reduction Zones. The general public will not be allowed close to the work area under any conditions. If for any reason the safety of a member of the public (e.g., motorist or pedestrian) may be endangered, work will cease until the situation is remedied. Cones and warning signs will be used when necessary to redirect motorists or pedestrians.

5.0 WORK PRACTICES AND PERSONAL PROTECTIVE EQUIPMENT

5.1 Work Practices

The Project Manager will call Underground Services Alert (USA) and the utilities will be marked before any drilling is conducted onsite and the borings will be drilled at safe distances from the utilities. The client will also be advised to have a representative onsite to advise us in selecting locations of borings with respect to utilities or underground structures. RESNA assumes no responsibility for utilities not so located. The first 5 feet will be hand augured before any drilling equipment is operated.

Project activities will be conducted in accordance with the following minimum safety requirements:

- o Eating, drinking, and smoking will be restricted to a designated area.
- o Gross decontamination and removal of all personal protective equipment will be performed before leaving the site. Contaminated clothing will be removed and collected in a drum for disposal.
- o Shaking or blowing dust or other materials off potentially contaminated clothing or equipment to remove dust or other materials is not permitted.
- o The Staff Geologist will be responsible for taking steps to protect employees from physical hazards including
 - * Falling objects, such as tools or equipment
 - * Falls from elevations
 - * Tripping over hoses, pipes, tools, or equipment
 - * Slipping on wet or oily surfaces
 - * Insufficient or faulty protective equipment
 - * Insufficient or faulty equipment or tools



- o All personnel will be required to wash hands and faces before eating, drinking, or smoking in the afore mentioned designated areas.
- o Field personnel will be cautioned to inform each other of the nonvisual effects of the presence of toxics, such as
 - Headaches
 - Dizziness
 - * Nausea
 - Blurred vision
 - Cramps
 - * Irritation of eyes, skin, or respiratory tract
 - * Changes in complexion or skin discoloration
 - * Changes in apparent motor coordination
 - * Changes in personality or demeanor
 - * Excessive salivation or changes in pupillary response
 - * Changes in speech ability or pattern

5.2 Personal Protective Equipment

Level D is the minimum acceptable level for this site. Field personnel and visitors are required to wear the following protective clothing and equipment, as a minimum, while in the work area at the site:

- o Hard hat
- o Safety glasses
- o Steel-toed chemical resistant boots (rubber, neoprene, or polyvinyl chloride [PVC])
- o Gloves (rubber, neoprene, PVC, or nitrile)
- Orange or red safety vest (if equipment or motor vehicles are operating onsite or nearby)
- o Standard Tyvek coveralls (when required by Staff Geologist or Engineer)
- o Respirator with organic vapor and acid gas cartridge (if lowest PEL or TLV is exceeded in the breathing zone or Staff Geologist or Engineer decides respirators should be worn)

5.3 Respiratory Protection Program

This section summarizes RESNA Respiratory Protection Program. RESNA subcontractors must have company medical surveillance and respiratory protection programs including adequate training of their employees. Subcontractors must provide personal protective



equipment as required in this Site Safety Plan for their employees. RESNA will attempt to verify worker training but does not assume the responsibility of the employer in any way. The following sections outline the RESNA Respiratory Protection Program.

Respirators are not issued to employees until the Company physician conducts a complete physical and decides the employee can 1) wear personal protective equipment and 2) wear a respirator. After the physician has issued written approval to RESNA, the Health and Safety Coordinator conducts the required training including these basic topics:

- o Applicable OSHA regulations 1910.134 and 1910.120
- o Nature of respiratory hazards to be encountered in the work environment and how to select proper respiratory equipment
- o Use of respirators and proper fitting
- o Functions and limitations of respirators
- o Cleaning, disinfection, inspection, maintenance, and storage of respirators

5.3.1 Functions and Limitations of Respirators

Respirators are not intended for and may not be used in atmospheres which are, or may become, immediately dangerous to life or health (IDLH) or in atmospheres where the identity or concentration of the contaminant(s) is unknown. Respirators may not be used in atmospheres containing less than 19.5 percent oxygen.

Cartridges or canisters for respirators are selected and supplied to employees by the Health and Safety Coordinator or Branch Safety Officer. The failure to choose or use a respirator equipped with cartridges or filters suitable for the contaminant(s) in the atmosphere or likely to be released in the atmosphere may result in the respirator providing little or no protection against the contaminated atmosphere. The Site Safety Plan specifies the contaminant(s) to be encountered and type of cartridge or canister appropriate for personal protection.

Assuming that the respirator is properly fitted, in good condition, free from leaks, and has the proper cartridges for the contaminant(s) present, the length of time the respirator will provide protection also depends on the conditions of use.



The conditions of use include but are not limited to the following:

- o The concentration of contaminant(s) in the atmosphere
- o The temperature and humidity of the ambient atmosphere
- o Any previous use of the cartridges and filters
- o The elapsed time since the removal of the cartridges or filters from their protective packaging
- o The emotional state of the wearer
- o The level of physical activity of the wearer

Cartridges designed and specified to protect the wearer against airborne particles are not appropriate for protection against gases and vapors. Cartridges designed and specified for protection against specific gases and vapors are not appropriate for protection against airborne particles or other gases or vapors beyond the scope of that type of cartridge. Every cartridge is labeled with specific instructions defining the use and limitations of that particular type of cartridge. If the label is missing or the type of cartridge is inappropriate then it may not be used under any circumstances; it will provide little or no protection to the wearer.

5.3.2 Danger Signals Indicating Possible Respirator Failure

If any of the danger signals in the following list are experienced while wearing a respirator, immediately return to a fresh air environment. The cartridges or filters may be inappropriate or used up or abnormal conditions may be creating vapor concentrations which are beyond the limits of the cartridges or filters. Danger is indicated when the individual subject to exposure:

- o Smells or tastes chemicals, or if eyes, nose, or throat become irritated;
- o Has difficulty breathing;
- o Notices that the breathing air becomes uncomfortably warm;
- Experiences headaches, dizziness, cramps, nausea, or blurred vision;
- o Experiences changes in complexion or skin discoloration;



- o Experiences changes in motor coordination, personality, or demeanor;
- o Experiences changes in speech ability or pattern;
- o Experiences excessive salivation or changes in pupillary response.

5.3.3 Qualitative Respirator Fit Test

Qualitative fit testing of each respirator must be conducted before the respirator may be used to check that a good fit is still obtained. The following steps should be taken in qualitative fit test of the respirator.

- 1. Don the facepiece with cartridge or filters in place. Pull straps together and equally to avoid distorting the mask.
- 2. Adjust the facepiece. Do not overtighten it.
- 3. Negative Pressure Leak Check: Close off both inlet connections with palms of hands, inhale slowly, and hold breath momentarily. No leakage should be detected and the facepiece should be drawn slightly to the face.
- 4. Positive Pressure Leak Check: Close opening in the exhalation valve guard by placing palm of one hand over face of guard; exhale slowly maintaining slight positive pressure. No leakage should be detected between the face seal and the face.
- 5. Should any leakage be noted:
 - a) Adjust the headstraps and facepiece slightly; recheck for leakage.
 - b) Check condition of exhalation valve and seat. Check that both inlet gaskets are present and in proper condition.
 - c) In the event the facepiece cannot be adjusted so there is no leakage, DO NOT ENTER THE AREA REQUIRING PROTECTION. Due to your particular facial features, a different style or size facepiece may be required to obtain a proper facial fit.

Note: Failure to perform a qualitative fit test of the respirator each time the respirator is donned may result in little or no respiratory protection.



5.3.4 Inspection, Cleaning, and Storage

The respirator should be inspected, cleaned, and properly stored after use each day. The following steps are the basic elements of each procedure:

A. Inspection

- 1. Examine faceseal for rips, tears, holes, deformation, or stiffness.
- 2. Examine facepiece plastic center shell for cracks, missing components, or damaged threads.
- 3. Examine harness for breaks, cuts, frays, tears, and missing or damaged hardware.
- 4. Examine inhalation and exhalation valves and valve seats for cuts, cracks, or foreign matter which may not allow the valve to close completely. Check that valves are properly installed and are not distorted.
- 5. Examine cartridges for signs of abuse or damage. Discard damaged items.
- 6. Any respirator malfunction or deficiencies noted must be reported to the Health and Safety Coordinator or Branch Safety Officer who will issue a new respirator or correct the deficiencies using only approved spare parts from the manufacturer of the specific model in need of repair. Spare parts from any other manufacturer may not be used under any conditions. Instructions in the manual provided by the manufacturer should be followed when the respirator needs repairing or replacing.

B. Cleaning

- 1. Unthread cartridges or filters.
- 2. Wash the facepiece after use, with warm water and a mild detergent.
- 3. Disinfect the facepiece if it was used by another person. The mask should routinely (once per month) be disinfected even if respirator is used solely by one individual. A hypochlorite solution may be used (i.e., 2 tablespoons chlorine bleach per gallon of water for an acceptable solution).



4. After cleaning and air-drying, check that the facepiece is not damaged and that components removed prior to cleaning have been installed properly.

C. Storage

- 1. Place the respirator in its storage box in a heat-sealed or resealable plastic bag. Store flat, with the facepiece and exhalation valve in an approximately normal position, to prevent the faceseal from taking a permanent "set."
- 2. Replacement components should be stored in sealed packages in a cool, clean, low-humidity location until ready for use.

The Health and Safety Coordinator or Branch Safety Officer will explain RESNA' Respiratory Protection Program to each new employee who must wear a respirator. The employee will be asked whether or not he or she understands the information provided. If the Company physician has cleared the employee for respirator use and the Health and Safety Coordinator or Branch Safety Officer has checked the fit of the respirator then the employee will be issued a respirator. A written record is signed and dated by the employee and Health and Safety Coordinator or Branch Safety Officer and kept in the new employee's Safety Record.

6.0 AIR MONITORING PLAN

It is not anticipated that project personnel exposure will exceed the TLVs or PELs of the materials; however, proper personal protective equipment will be worn while working at the site. In addition, the work area will monitored using a direct-reading combustible gas analyzer or an organic vapor meter to detect the concentration of the volatile hydrocarbons in the ambient atmosphere.

If the lowest TLV or PEL is consistently being exceeded in the breathing zone, then a respirator must be worn. If the concentration exceeds 1,000 parts per million (ppm), the use of a respirator is inappropriate and personnel must withdraw from the site.



Gasoline has a flammable range from approximately 1.4 to 7.6 percent in air. One percent in air is equivalent to 10,000 ppm; thus the lower explosive limit (LEL) is 14,000 ppm. Normally explosive levels may be reached in tanks, pits, or other confined spaces. Any area suspected of containing potentially explosive levels of gasoline will be evaluated with an intrinsically safe or explosion-proof combustible gas indicator (CGI). Personnel response will be based on the following action levels from CGI readings:

-	Less than 10 percent of LEL*	then	Continue activities and monitoring
-	10 to 25 percent of LEL	then	Continue monitoring with extreme caution as higher levels are encountered
-	Greater than 25 percent of LEL	then	Explosion hazard. Cease activities and vacate area immediately

^{*} CGI readings in percent of lower explosive limit

If an explosion potential is present onsite beyond 25 percent of the LEL then all RESNA' personnel and subcontractors must immediately withdraw from the site. The hazard potential will be evaluated by RESNA' management and a plan of action will be assessed.

7.0 DECONTAMINATION PROCEDURES

All drilling equipment and personal protective equipment leaving the contaminated site will undergo gross decontamination onsite. This gross decontamination will include washing contaminated equipment with a trisodium phosphate (TSP) solution. Steam-cleaning is an acceptable alternative.

8.0 EMERGENCY RESPONSE PROCEDURES

8.1 Lines of Authority

The Site Safety Officer is the primary authority for directing site operations under emergency conditions. All communications both on and off-site will be directed through the Health and Safety Manager.



In the event of a fire, explosion, or property damage, the nearest RESNA Branch and the Administrative Office will be immediately notified. If necessary, local fire or response agencies will be called.

In the event of an accident resulting in physical injury, first aid will be administered and the injured worker will be transported to the nearest hospital or emergency medical clinic for emergency treatment. A physician's attention is required regardless of the severity of the injury.

8.2 Overt Personnel Exposure

If overt personnel exposure occurs during the project, typical responses should include the following:

Skin or Eye Contact:

Wash and rinse affected area thoroughly with copious amounts of soap and water, then provide appropriate medical attention. Eyes and skin should be rinsed for a minimum of 15 minutes upon chemical

contamination.

Inhalation:

Move to fresh air and, if necessary, decontaminate and transport to

emergency hospital.

Ingestion:

Decontaminate and transport to emergency hospital.

Puncture Wound

Decontaminate and transport to emergency

or Laceration:

hospital.



 
EMERGENCY TELEPHONE NUMBERS

Fire and Police	11
Ambulance	11
Valley Memorial Hospital	<u>)0</u>


1111 East Stanley Boulevard Livermore, California

Directions to Hospital: Go east on East Stanley Boulevard. Valley Memorial Hospital will be on the right. Distance is approximately 1 mile.

Map:



N

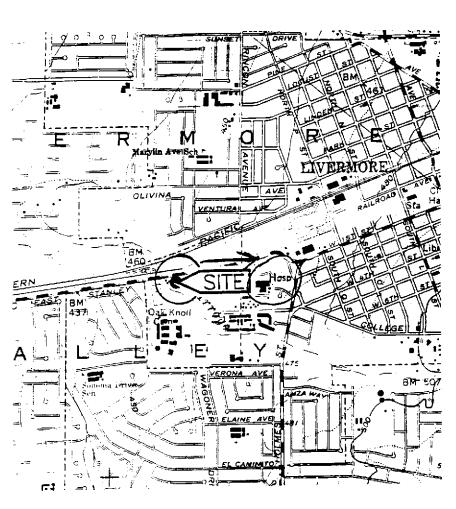



Additional Contingency Telephone Numbers

Livermore Fire Department	(510) 373-5400
Poison Control Center	(800) 523-2222
Applied GeoSystems, San Jose Branch	(408) 264-7723
Applied GeoSystems, Administrative Office	<u>(415) 291-9926</u>
CHEMTREC	(800) 424-9300

Note:

Only call CHEMTREC in an emergency. CHEMTREC stands for Chemical Transportation Emergency Center, a public service of the Chemical Manufacturer's Association. CHEMTREC can usually provide hazard information, warnings, and guidance when given the identification number or the name of the product and the nature of the problem. CHEMTREC can also contact the appropriate experts.

This Site Safety Plan has been reviewed by the following persons:

Project Manager:

Health and Safety Coordinator:

Amendments or modifications to this Plan may be written on a separate page and attached to this Plan. Any amendments or modifications must be reviewed and approved by the personnel named above.



Agreement and Acknowledgement Statement

Site Safety Plan Agreement

All RESNA/Applied GeoSystems project personnel and subcontractor personnel are required to sign the following agreement prior to conducting work at the site.

1. I have read and fully understand the Site Safety Plan and my individual responsibilities.

I agree to abide by the provisions of the Site Safety Plan.

Name	Signature
Company	Date
Name	Signature
Company	Date
Name	Signature
Company	Date
Name	Signature
Company	Date



ADDENDUMS



Site Safety Plan Amendment Sheet

Project Name:	
Project Number:	
Location:	
Changes in field activities or hazards:	
Proposed Amendment:	
Proposed by:	_Date:
Approved by:	_Date:
Declined by:	_Date:
Amendment Number:	
Amendment Effective Date:	

APPENDIX C

Explanation of Hazard Evaluation Guidelines

Explanation of Hazard Evaluation Guidelines

Hazard: Airborne Contaminants

Guideline

Threshold Limit Value Time-Weighted Average (TLV-TWA)

Permissible Exposure Limit (PEL)

Immediately Dangerous to Life or Health

Hazard: Explosion

Guideline

Lower Explosive Limit (LEL)

Upper Explosive Limit (UEL)

Explanation

The time-weighted average concentration for a normal 8-hour work day and a 40-hour work week, to which nearly all workers may be repeatedly exposed without adverse effect.

Time-weighted average concentration similar to (and in many cases derived from) TLV values.

"IDLH" or "Immediately dangerous to life or health" means any atmospheric condition that poses an immediate threat to life, or which is likely to result in acute or immediate severe health effects. This includes oxygen deficiency conditions.

Explanation

The minimum concentration of vapor in air below which the propagation of a flame will not occur in the presence of an ignition source.

The maximum concentration of vapor in air above which propagation of a flame will not occur in the presence of an ignition source.


<u>Hazard</u>: Fire

Guideline

Flash Point

Explanation

The lowest temperature at which the vapor of a combustible liquid can be made to ignite momentarily in air.

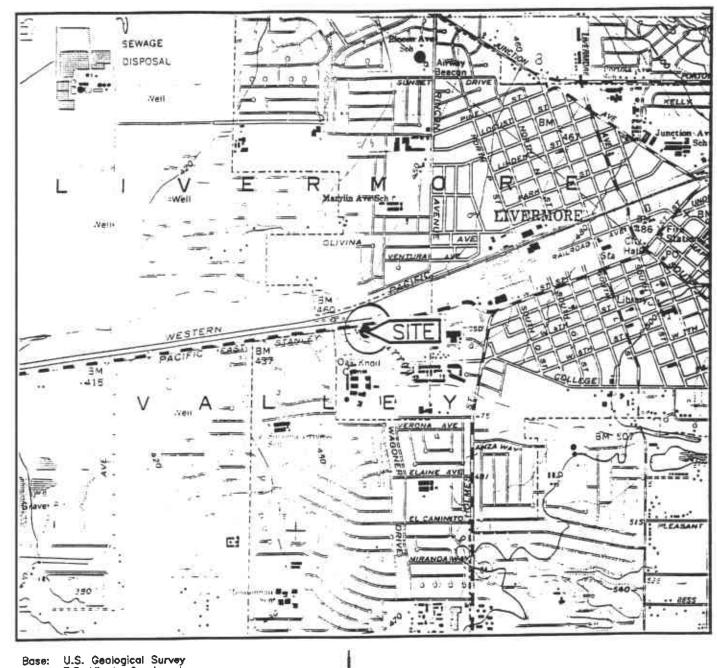


Base: U.S. Geological Survey 7.5-Minute Quadrangle Livermore, California Photorevised 1980

LEGEND

PROJECT

Site Location

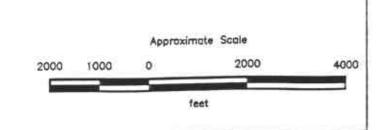


RESNA

69028.06

SITE VICINITY MAP ARCO Service Station 6113 785 East Stanley Boulevard Livermore, California PLATE

1

EAST STANLEY BOULEVARD

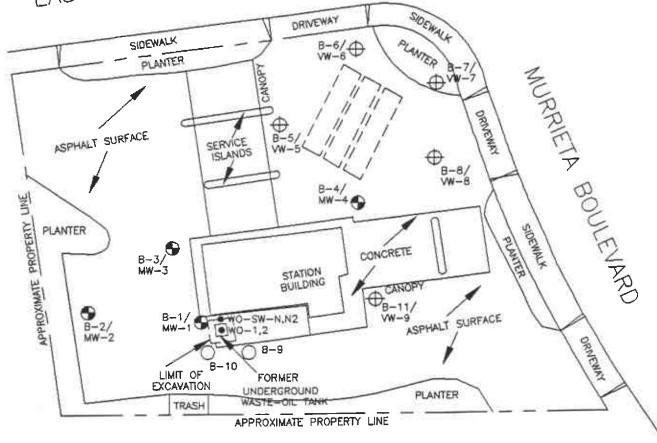

EXPLANATION

B-11/
WW-9


= Proposed boring/monitoring well

B-10 = Proposed boring

WO-SW-N,N2
= Soil sample collected by Pacific (1989)

B-4/MW-4

= Boring/monitoring well
(Applied GeoSystems, September 1989 and February 1991)

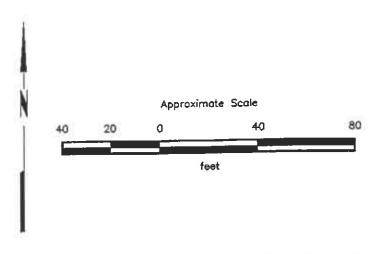

Source: Modified from plan supplied by Ron Archer, Civil Engineer Inc., October 1988.

RESNA

PROJECT:

69028.06

PROPOSED BORING/
MONITORING WELL LOCATIONS
ARCO Service Station 6113
785 East Stanley Boulevard
Livermore, California

PLATE

2

APPENDIX E

Material Safety Data Sheets (MSDS)

GASOLINE

MATERIAL SAFETY DATA SHEET

Prepared by Envirologic Data Portland, ME (207) 773-3020 May 1985

EMERGENCY TELEPHONE NUMBER: Massachusetts Poison Information Center 80ston, MA 1-800-682-9211

SECTION I. IDENTIFICATION

Material Name: Gasoline

Synonyms: Petrol, motor spirits, benzin.

CAS No.: 8006--61-9

Molecular Formula: C5H12 to C9H20

SECTION II. FIRST AID PROCEDURES AND EMERGENCY TREATMENT

In all cases of poisoning, follow standard procedures for poison management, first aid, and cardiopulmonary resuscitation. Whenever transporting a poisoned person to a hospital, bring the container, label, or other information concerning the product (without delaying transport) to assist medical personnel with diagnosis and treatment. Four different routes of exposure and their respective first aid/poison managements are outlined below:

Ingestion: .

- o Dilute the poison by offering and encouraging the person to drink one or two glassfuls of water or milk. Do not use carbonated fluids. Do not attempt to make the person vomit.
- o dall the Massachusetts Poison Information Center (1-800-682-9211). If you cannot reach the Poison Information Center, call or take the person to the nearest hospital emergency department.
- o Notify your supervisor or health and safety officer of this or any poison exposure.

Inhalation:

- o Stop exposure by moving person from contaminated area to clean air area.
- o Call the Massachusetts Poison Information Center (1-800-682-9211).
- o Have someone call a rescue unit or medical professional.
- o If necessary, transport person to an emergency medical facility promotiv.

Converget 1985 by Envirologic Data, Inc.

Skin:

- o Wash off skin immediately with a large amount of water; use soap if available.
- o Remove any contaminated clothing and rewash skin.
- o Call the Massachusetts Poison Information Center (1-800-682-9211).

o Transport person to a medical facility as necessary.

Eyes:

- o Gently rinse eye immediately, using large amounts of water, for fifteen minutes, if possible, with eyelids held open.
- o If possible, have person remove contact lenses if worn; never permit the eyes to be rubbed.
- o Call the Massachusetts Poison Information Center (1-800-682-9211).
- o Transport person to an emergency medical facility promptly as necessary.

SECTION III. ACUTE TOXICITY

ELD Rating

(Oral Toxicity): 2 Toxic Effect Levels:

Inhalation man LC_{LO} 900 ppm (for 1 h) Inhalation mammal LC_{LO} 30,000 ppm (for 5 min)

Signs and Symptoms

Ingestion: Burning of mouth, throat and stomach, inebriation, vomiting, dizziness, fever, drowsiness, confusion. Aspiration during vomiting may cause accumulation of fluid in the lungs, rapid breatning or death.

Inhalation: Burning of nose and throat, drowsiness, dizziness, nausea, numbness, headache, inebriation, central nervous system depression.

Skin: Itching, burning, irritation, blistering.

Eyes: Irritation.

Exposure Limits

OSHA Standard(s): None

NIOSH Recommended Limit(s): None

ACGIH Recommended Limit(s): 300 ppm, 8-h TLV-TWA

500 ppm, STEL

SECTION IV. LONG-TERM ORGANISM THREAT POTENTIAL

Carcinogenicity

IARC, NTP/NCI, CAG, RTECS: No indication of carcinogenic effects was found in standard references.

Mutagenicity

IARC, RTECS: No indication of mutagenic effects was found in standard references.

Teratogenicity

IARC. RIECS: No indication of teratogenic effects was found in standard references.

Copyright 1985 by Envirologic Data, Inc.

Reproductive Effects

IARC, RTECS: No indication of reproductive effects was found in standard references.

SECTION V. CHRONIC TOXICITY

Repeated or prolonged exposure may cause drying, dermatitis, and allergenic sensitivity.

SECTION VI. PHYSICAL DATA

Molecular weight: Not available

Boiling Point (at 760 mm Hg): 38-204°C (100-400°F) Melting Point (at 760 mm Hg): Not available

Vapor Pressure (mm Hg) [at -12.6°C (9.32°F)]: 100

Vapor Density (Air=1): 3-4

Specific Gravity (water=1): 0.8

Percent Volatile By Volume: - 100

Evaporation Rate (butyl acetate =1): 1.1+

Solubility in Water: Insoluble 🕢

Solvent Solubility: Soluble in absolute alcohol, ether, chloroform,

benzene.

Appearance and Odor: Clear volatile liquid with characteristic odor.

SECTION VII. FIRE AND EXPLOSION HAZARD DATA

Flash Point (Method Used): -43 to -38°C (-45 to -36°F) (Closed cup)

Extinguisher Media: Dry chemical, carbon dioxide, foam.

Lower Upper

Flammable Limits in Air, percent by vol.: 1.4

Autoignition Temperature: 280-456 C (536-853 F)

NFPA Fire Hazard: 3

Special Fire Fighting Procedures: Firefighters self-contained breathing apparatus with full facepiece operated in positive pressure mode and full protective clothing.

Unusual Fire and Explosion Hazards: HIGHLY FLAMMABLE. Fumes may travel great distances to source or ignition and flash back.

SECTION VIII. REACTIVITY DATA

Stability: Stable in closed containers at room temperature under normal

storage conditions. NFPA Reactivity: 0

Incompatibilities (Materials to Avoid): Strong oxidizing agents.

Hazaradus Decomposition Products: When heated to decomposition may release texts vapors and dases of hydrocarbons, carbon monoxide, and caroon dioxide.

mazardous Polymerization: Joes not occur.

SECTION IX. SPILL, LEAK OR DISPOSAL PROCEDURES

Actions To Take in Case of Spills or Leaks: Restrict from areas of spills or leaks persons not wearing protective equipment and clothing. Eliminate sources of ignition. Ventilate area. Inform supervisor or health and safety officer of any spill or leak. While protecting against eye and skin contact and inhalation of vapors, contain spill. Prevent leakage into confined spaces or sewer drains. Where feasible, absorb liquid with vermiculite, sand, or other non-combustible absorbent material. Collect in suitable container and cover.

Disposal Methods: Federal laws and regulations impose highly specific requirements for disposal of toxic and otherwise hazardous materials. Consult with your supervisor or health and safety officer regarding the proper, legal disposal procedures for this substance. Do not dispose of potentially toxic or otherwise hazardous substances without appropriate authorization. Prior to receiving institutional authorization, it may be necessary to store spilled materials. To do so safely, carefully label containers of materials, store in a cool, dry location, and maintain security of the storage area until official guidance is obtained.

SECTION X. SPECIAL PROTECTION INFORMATION

Respiratory Protection: Only NIOSH or MSHA approved equipment should be used.

>300 ppm: Organic vapor canister gas mask or supplied air or self-contained respirator with full facepiece.

Ventilation: Provide adequate explosion-proof general ventilation and local exnaust ventilation to meet TLV recommendations.

Protective Clothing or Equipment:

- o To prevent repeated or prolonged skin contact with liquid chemicals, use impervious clothing, gloves, face shields (eight-inch minimum), splash-proof safety goggles, and other appropriate protective clothing.
- o Place clothing contaminated with liquids in closed containers for storage until clothing can be discarded or decontaminated. If the clothing is to be laundered or otherwise cleaned to remove the chemical, the person(s) performing the operation should be informed of the chemical's hazardous properties and of ways to minimize exposure.
- A safety shower should be provided within the immediate work area for emergency use where liquids may contact the employee's body.
- a An eyewash fountain should be provided within the immediate work area for emergency use where liquids may contact the employee's eyes.

SECTION XI SPECIAL PROCEDURES AND PRECAUTIONS

Procedures and Precautions to be Taken in Handling and Storing: Store in closed containers in cool, dry, well-ventilated area away from heat,

Copyright 1985 by Envirologic Data, Inc.

Gasoline MSDS-1143 Page 5

sources of ignition, and oxidizing agents. Do not smoke in areas of handling and storage. Electrically bond and ground containers for transfers to prevent sparks.

Other Precautions: Wash hands before eating, smoking or using toilet facilities. Contact lenses should not be worn when working with this chemical.

DISCLAIMER: This document is based upon information obtained from numerous sources. Every reasonable effort has been made to provide reliable data and information; however, Envirologic Data cannot assume responsibility for the quality or validity of laboratory studies or other data reported in the literature or for the consequences of their use.

Copyright 1985 by Envirologic Dava, Inc.



MATERIAL SAFETY DATA SHEET

GENIUM PUBLISHING CORPORATION 1145 CATALYN STREET SCHENECTADY, NY 12303-1836 USA (518) 377-8855



470 NC. ___

DIESEL FUEL OIL NO. 2-D

Date October 1981

SECTION I. MATERIAL IDENTIFICATION

DESCRIPTION: Mixture of petroleum hydrocarbons; a distillate oil of low sulfur content MATERIAL NAME: DIESEL FUEL OIL NO. 2-D

OTHER DESIGNATIONS: ASTM D975, CAS # 068 476 346 MANUFACTURER: Available from many suppliers

	x	HAZARO DATA
SECTION 11. INGREDIENTS AND HAZARDS	1	
Diesel Fuel Oil No. 2-D Complex mixture of paraffinic, olefinic, naphthenic	>95	B-hr TWA 5mg/m ³ * (mineral oil mist)
and aromatic hydrocarbons**	<0.5	
Sulfur content	<100 pp	TIT.
Benzene*** *Current OSHA standard and ACCIH (1981) TLV *Current OSHA standard and ACCIH (1981) TLV	1	
	[1
**Diesel fuels tend to be low in of 40 is required paraffinics. A min. Cetane No. of 40 is required		
(ASTM D613). ***A low benzene level reduces carcinogenic risk. ***A low benzene level reduces carcinogenic risk. Fuel oils can be exempted under the benzene stands Fuel oils can be exempted under the benzene stands	rd	

SECTION III. PHYSICAL DATA Boiling point range, deg F, ------ Ca 340-675 Specific gravity (H_Z0=1) ----Solubility in water ---- negligible Cloud point (wax), deg C --- Ca O Viscosity at 40 C, cSt 1.9-4.1

Appearance and Odor: Clear, bright liquid with a mild persoleum odor.

·		LOWER	UPPER
SECTION IV. FIRE AND	EXPLOSION DATA		7.5
rlash Point and Method 125F min (PM)	>500F % by volume		er spray
1255 WILL (11.)	dioxide foam, water spray.	USE A WOL	

Extinguishing Media: Dry chemical, carbon dioxide, foam, water spray. Use a water spray to cool fire exposed containers. Use a smothering technique for extinguishing fire of this combustible liquid. Do not use a forced water stream directly on oil fire as this will only scatter the fire. Material is a OSHA Class II combustible liquid. Firefighters should wear self-contained breathing apparatus and full protective clothing.

SECTION V. REACTIVITY DATA

This is a scable material in closed containers at room temperature under normal storage and handling conditions. It does not undergo hazardous polymenization. Incompatible with strong oxidizing agents: heating greatly increases fire hazard. Thermal -oxidative degradation may yield various hydrocarbons and hydrocarbon derivatives (partial exidation products), CO, and CO and SO,

470 Na. TLV 5 mg/m (mist) HEALTH HAZARD INFORMATION (See Sect II) SECTION VI. Inhalation of excessive concentrations of vapor or mist can be irritating to the respiratory passages and can cause the following symptoms: headache, dizziness, nausea, vomiting, and loss of coordination. Prolonged or repeated skin contact may cause irritacion of the hair follicles and block the senaceous glands. This produces a rash of acne pimples and spots, usually on the arms and legs. (Good personal hygiene will pre-Chemical pneumonitis may result when ingestion occurs and oil is aspirated in the lungs. Eye Contact: Flush thoroughly with running water for 15 min. including under cyalids. FIRST AID: Skin Contact: Remove contaminated clothing. Wipe excess oil off with a dry cloth. Wash affected area well with soap and water. Inhalation: Remove to fresh air. Restore and/or support breathing as required. Incestion: Do not induce vomiting. Seek medical assistance for further treatment, observation and support. SPILL, LEAK, AND DISPOSAL PROCEDURES SECTION VII. Notify safety personnel of leaks or spills. Remove sources of heat or ignition. Provide adequate ventilation. Clean-up personnel to use protection against liquid contact and vapor or mist inhalation. Contain spill by diking. Small spills can be contained by using absorbants, such as rags, straw, polyurethane foam, activated carbon, and sand. Clean up spills promptly to reduce fire or vapor hazards. DISPOSAL: May be disposed of by a licensed waste disposal company, or by controlled incineration or burial in an approved landfill. Follow Federal. State and Local regulations. Report large oil spills. SPECIAL PROTECTION INFORMATION SECTION VIII. Provide adequate ventilation where operating conditions (heating or spraying) may create excessive vapors or mists. Use explosion-proof equipment. Provide approved respiratory apparatus for nomrouting or emergency use. Use an approved filter & vapor respirat: r when vapor/mist concentrations are high. Wear protective rubber gloves and chemic: I safety glasses where contact with liquid or high mist conc. may occur. Additional suitable protective clothing may be required depending on working conditions. An eyewash fountain and washing facilities to be readily available near handling and use Launder soiled or contaminated clothing before reuse (at least weekly laundering of work clothes is recommended) . SPECIAL PRECAUTIONS AND COMMENTS SECTION IX. Store in closed containers in a cool, dry, well-ventilated area away from sources of open flame, heat, strong oxidizing agents, and ignition. Protect containers from physical damage. Use non sparking cools and explosion-proof electrical equipment. Prevent static electric sparks. Avoid prolonged skin contact and breathing of vapors or mists. No smoking in areas of use. Follow good hygienic practice in the use of this material. Do not wear oil contaminated clothing. Do not put oily rags into pockets. Wash exposed skin areas several times a day with soap and warm water when working with this material. DOT Classification: COMBUSTIBLE TIMES

Luddin, 8 - Leannighy gringsted in the recurrence of six has been a pricel systemation and integral systematics and integral control of the second systems of the systematics and integral systems of the systems of the

DATA SOURCE(S) CODE: 1,6,7,12

APPROVALS: CRD Industrial Hygiene

and Safety

MIS

21 October 1981 MEDICAL REVIEW:

MOBIL MOIL CORPORATION EWIRCHEMIAL AFFAIRS AND TOXICOLOGY DERT. / DIESEL FUELS ESLIH DHEROENCY TELEPHONE: (212)883-4411 TRANSPORT EMERGENCY TELEPHONE: (800) AZ4-9300 (CHEMTREC) SUPPLICA: MOBIL OIL CORP. UHEHICAL NAMES AND SYNONYMS: HYDROCARBONS AND ADDITIVES USE OR DESCRIPTION: FUEL DIL (FOR ADDITIONAL INFORMATION PLEASE CONTACT YOUR LOCAL HARKETING OFFICE.) VISCOSITY: AT 100 F, SUS AT 40 C, CST APPEARANCE: 1.3-4.1 31.6-40.0 CLEAR LIGUID BOILING RANGE: NO. 1 300-550F SOLUBILITY IN WATER: NEGLIGIBLE ODOR: HYDROCARBON NO. 2 350-700F RELATIVE DENSITY: 15/4C FLASH POINT: F(C) (ASTM D-93) VAPOR PRESSURE: MM HG 20C NO. 1: 100(40) NO. 2: 125(52) 0.82-0.87 ······ INGREDIENTS EXPOSURE LIMIT EXPOSURE LIHII (TWA): HI PCI HG/H3 (APPROX) HAZARDOUS INGREDIENTS MOBIL 100 575 100 PETROLEUM DISTILLATES RECCYMENDED NOTE: EXPOSURE LIMITS SHOWN ARE FOR GUIDANCE ONLY. FOLLOW APPLICABLE REGULATIONS. FIRE AND EXPLOSION HAZARD DATA NFPA COOES: FLAMMABLE LIMITS: FLASH POINT: F(C) (ASTM 0-93) HEALTH LEL: NE UEL: NE NQ.1: 100(40) NO 2: 125(-52) FLAMMABILITY 2 EXTINGUISHING MEDIA: REACTIVITY 0 CO2, FOAM, DRY CHEMICAL OR WATER FOG. SPECIAL FIRE FIGHTING PROCEDURES: FIREFIGHTERS MUST USE SELF-CONTAINED BREATHING APPARATUS. UNUSUAL FIRE AND EXPLOSION HAZARDS: HEALTH HAZARD SUMMARY THRESHOLD LIMIT VALUE (IF ESTABLISHED): NO TLY ESTABLISHED. MOBIL RECOMMENOS A TWA EXPOSURE LIMIT OF 100 EFFECTS OF OVEREXPOSURE: SLIGHT SKIN IRRITATION. RESPIRATORY IRRITATION, DIZINESS, NAUSEA, LOSS OF CONSCIOUSNESS. THIS PRODUCT MAY CONTAIN TRACE QUANTITIES OF POLYCYCLIC AROMATIC HYDROCARBONS (PCAH). UNDER CONDITIONS OF POOR PERSONAL HYGIENE AND PROLONGED, REPEATED CONTACT, SCHE POAH HAVE BEEN SUSPECTED AS A CAUSE OF SKIN CANCER IN HUMANS. EMERGENCY AND FIRST AID PROCEDURES EYE CONTACT: FLUSH WITH WATER. SKIN CONTACT: WASH CONTACT AREAS WITH SOAP AND WATER. INHALATION: REMOVE FROM FURTHER EXPOSURE. IF UNCONSCIOUSNESS OCCURS, SEEK IMMEDIATE MEDICAL ASSISTANCE AND CALL A PHYSICIAN. IF BREATHING HAS STOPPED, USE MOUTH TO HOUTH RESUSCITATION. INGESTION: DO NOT INDUCE YOMITING. ADMINISTER VEGETABLE OIL. GET MEDICAL ASSISTANCE. PHYSICIAN: MATERIAL IF ASPIRATED INTO THE LUNGS HAY CAUSE CHEMICAL PNEUMONITIS. TREAT APPROPRIATELY) REACTIVITY DATA STABILITY: STABLE CONDITIONS TO AVOID: HEAT, SPARKS, FLAME AND BUILD UP OF STATIC ELECTRICITY. INCOMPATIBILITY (MATERIALS TO AVOID): STRONG OXIDIZERS HAZARDOUS DECOMPOSITION PRODUCTS: CARBON HONOXIDE (CO) FROM INCOMPLETE COMBUSTION. HAZARDOUS POLYMERIZATION: WILL NOT OCCUR CONDITIONS TO AVOID: NA INFORMATION GIVEN HEREIN IS OFFERED IN GOOD FAITH AS ACCURATE, BUT WITHOUT GUARANTEE. CONDITIONS OF USE AND

INFORMATION GIVEN HEREIN IS OFFERED IN GOOD FAITH AS ACCURATE, BUT WITHOUT GUARANTEE. LUNDITIONS OF USE OF THE PRODUCT ARE SUITABILITY OF THE PRODUCT FOR PARTICULAR USES ARE BEYOND OUR CONTROL; ALL RISKS OF USE OF THE PRODUCT ARE THEREFORE ASSUMED BY THE USER AND HE EXPRESSLY DISCLAIM ALL MARRANTIES OF EVERY KIND AND NATURE, INCLUDING WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE IN RESPECT TO THE USE OR SUITABILITY OF WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE IN RESPECT TO THE USE OR SUITABILITY OF THE PRODUCT. NOTHING IS INTENDED AS A RECOMMENDATION FOR USES WHICH INFRINGE VALID PATENTS. APPROPRIATE WARNINGS AND SAFE MANOLING PROCEDURES SHOULD BE PROVIDED TO MANOLERS AND USERS.

Unitall fulls	
 SPILL OR LEAK PROCEDURES	,,,

ENVIRONMENTAL IMPACTI

REPORT SKILLS AS REQUIRED TO ARROPHIATE AUTHORITIES. IN CASE OF ACCIDENT OR ROAD SMILL NOTIFY HEMIREC (800) 424-9300. U.S. COAST CHARD RECOLATIONS REQUIRE IMMEDIATE REPORTING OF SPILLS THAT COULD REACH ANY WATERWAY INCLUDING INTERMITTENT DRY CREEKS. COAST GUARD TOLL FREE NUMBER 800-424-8802. PROCEDURES IF MATERIAL IS RELEASED OR SPILLED:

ADSORS ON FIRE RETARDANT TREATED SANDUST, DIATOMACEDUS EARTH, ETC. SHOVEL UP AND DISPOSE OF AT AN APPROPRIATE WASTE DISPOSAL FACILITY IN ACCORDANCE WITH CURRENT APPLICABLE LAWS AND PEGULATIONS, AND PRODUCT CHARACTERISTICS AT TIME OF DISPOSAL.

WASTE HANAGEMENT:

DISPUSE OF WASTE BY SUPERVISED INCINERATION IN COMPLIANCE WITH APPLICABLE LAWS AND REGULATIONS. SPECIAL PROTECTION INFORMATION

EYE PROTECTION: NO SPECIAL EQUIPMENT REQUIRED.

SKIN PROTECTION: IF PROLONGED OR REPEATED SKIN CONTACT IS LIKELY, OIL IMPERVIOUS GLOVES SHOULD BE WORN. GOOD PERSONAL HYGIENE PRACTICES SHOULD ALWAYS BE FOLLOWED.

RESPIRATORY PROTECTION: NO SPECIAL REQUIREMENTS UNDER CROINARY CONDITIONS OF USE AND WITH ADEQUATE

VENTILATION: VENTILATION DESIRABLE AND EQUIPMENT SHOULD BE EXPLOSION PROOF. USE IN WELL VENTILATED AREA.

STORED MATERIAL MUST BE LABELED AS: COMBUSTIBLE.

STORAGE: STORE IN A COOL AREA.

ACUTE

ORAL TOXICITY: (RATS) SLIGHTLY TOXIC (ESTIMATED) -- BASED ON TESTING OF SIMILAR PRODUCTS AND/OR THE COMPONENTS.

DERMAL TOXICITY: (RASSITS)

NONTOXIC (ESTIMATED) -- BASED ON TESTING OF SIMILAR PRODUCTS AND/OR THE COMPONENTS.

(NHALATION TOXICITY: (RATS)

SLIGHTLY TOXIC (ESTIMATED) -- BASED ON TESTING OF SIMILAR PRODUCTS AND/OR THE COMPONENTS.

EYE IRRITATION: (RABBITS)

EXPECTED TO BE NON-IRRITATING -- BASED ON TESTING OF SIMILAR PRODUCTS AND/OR THE COMPONENTS.

SKIN IRRITATION: (RABBITS)

MAY CAUSE SLIGHT IRRITATION ON PROLONGED OR REPEATED CONTACT.

-- BASED ON TESTING OF SIMILAR PRODUCTS AND/OR THE COMPONENTS.

SUBACUTE AND MUTAGENICITY (SUMMARY) NO INFORMATION AVAILABLE

CHRONIC OR SPECIALIZED (SUMMARY)

THIS PRODUCT MAY CONTAIN TRACE QUANTITIES OF POLYCYCLIC AROMATIC HYDROCARBONS, SOME OF WHICH HAVE BEEN SHOWN TO CAUSE SKIN CANCER IN LABORATORY ANIHALS AFTER PROLONGED, REPEATED SKIN CONTACT.

OTHER DATA

NA

ENVIRONMENTAL AFFAIRS AND TOXICOLOGY DEPT. MANAGER OF PRODUCT SAFETY INFORMATION, PHONE: 609-737-5596 REVISED:

9/1/84

BENZENE

MATERIAL SAFETY DATA SHEET

Prepared by Envirologic Data Portland, ME (207) 773-3020 September 1984

EMERGENCY TELEPHONE NUMBER: Massachusetts Poison Information Center

Boston, MA 1-800-682-9211

SECTION I. IDENTIFICATION

Material Name: Benzene

Synonyms: Benzol; phenyl hydride; cyclohexatrine

CAS No.: 71-43-2

Molecular Formula: C6H6

SECTION II. FIRST AID PROCEDURES AND EMERGENCY TREATMENT

In all cases of poisoning, follow standard procedures for poison management, first aid, and cardiopulmonary resuscitation. Whenever transporting a poisoned person to a hospital, bring the container, label, or other information concerning the product (without delaying transport) to assist medical personnel with diagnosis and treatment. Four different routes of exposure and their respective first aid/poison managements are outlined below:

Indestion:

- o dilute the poison by offering and encouraging the person to drink one or two glassfuls of water or milk. Do not use carbonated fluids. Do not attempt to make the person vomit.
- o Call the Massachusetts Poison Information Center (1-800-632-9211). If you cannot reach the Poison Information Center, call or take the person to the nearest hospital emergency department.

o Notify your supervisor or health and safety officer of this on any poison exposure.

Copyright 1984 by Envirologic Data, Inc.

TOLUENE

MATERIAL SAFETY DATA SHEET

Prepared by Envirologic Data Portland, ME (207) 773-3020 Revised September 1986

EMERGENCY TELEPHONE NUMBER: Pittsburgh Poison Information Center

Children's Hospital of Pittsburgh Pittsburgh, PA (1-412--581-6669)

SECTION I. IDENTIFICATION

Material Name: Toluene

CAS No.: 108-88-3

Synonyms: Toluol; methylbenzene; methacide; phenylmethane; methylbenzol

Molecular Formula: C6H5CH3

SECTION II. FIRST AID PROCEDURES AND EMERGENCY TREATMENT

In all cases of poisoning, follow standard procedures for poisoning, first aid, and cardiopulmonary resuscitation. Whenever transporting a poisoned person to a hospital, bring the container, label, or other information concerning the product (without delaying transport) to assist medical personnel with diagnosis and treatment. Four different routes of exposure and their respective first aid/poison managements are outlined below:

Ingestion:

- o Dilute the poison by offering and encouraging the person to drink one or two glassfuls of water or milk. Do not use carbonated fluids. Do not attempt to make the person vomit.
- o Call the Pittsburgh Poison Information Center (1-412-681-6669). If you cannot reach the Poison Information Center, call or take the person to the nearest hospital emergency department.
- o Notify your supervisor or health and safety officer of this or any poison exposure.

Inhalation:

o Stop exposure by moving person from contaminated area to clean air area.

Copyright 1986 by Envirologic Data, Inc. 1019

Inhalation:

- o Stop exposure by moving person from contaminated area to clean air area.
- o Call the Massachusetts Poison Information Center (1-800-682-9211).
- o Have someone call a rescue unit or medical professional.
- o If necessary, transport person to an emergency medical facility promptly.

Skin:

- O If material is a powder, brush away using a cloth.
- o Wash off skin immediately with a large amount of water; use soap if available.
- o Remove any contaminated clothing and rewash skin.
- o Call the Massachusetts Poison Information Center (1-800-682-9211).
- o Transport person to a medical facility as necessary.

Eyes:

- O Gently rinse eye immediately, using large amounts of water, for fifteen minutes, if possible, with eyelids held open.
- o If possible, have person remove contact lenses if worn; never permit the eyes to be rubbed.
- o Call the Massachusetts Poison Information Center (1-800-682-9211).
- o Transport person to an emergency medical facility promptly as necessary.

SECTION III. ACUTE TOXICITY

ELD Rating (Orai Toxicity):	2	Oral human TDLO Inhalation human LCLO Inhalation human TCLO Unknown* man LDLO Oral rat LD50	20,000 100 194 4,894	mg/kg ppm for 5 min ppm mg/kg mg/kg
		Oral mouse LD ₅₀	4,700	mg/kg

*Exposure route not reported

Signs and Symptoms

<u>Ingestion</u>: Irritation of mouth, throat, and stomach. See inhalation for other symptoms.

Inhalation: Lethargy, headaches, decreased cell counts, bronchitis, pneumonia, and collapse.

Skin: Irritation Eyes: Irritation

Exposure Limits

OSHA Standard(s): 10 ppm, 8-h TWA 25 ppm, Ceiling

50 ppm, Peak 10 min in any 8 h

NIOSH Recommended Limit(s): 10 ppm, Ceiling in 1 h ACGIH Recommended Limit(s): 10 ppm, 8-h TLV-TWA

.25 ppm, STEL

Copyright 1984 by Envirologic Data, Inc.

SECTION IV. LONG-TERM ORGANISM THREAT POTENTIAL

Carcinogenicity

IARC: Limited evidence of carcinogenic effects in animals. Sufficient evidence of carcinogenic effects in humans.

NTP/NCI: NTP/NCI has reported carcinogenic effects.

CAG: CAG has reported carcinogenic effects.

RTECS: Carcinogenic by RTECs criteria based on cases of leukemia in humans and rats. Carcinogenic by RTECs criteria in mice.

Mutagenicity

IARC: Not mutagenic in bacteria, yeast, insects, or mouse lymphoma cells. Chromosomal anomalies in humans, rats, and mice were observed.

RTECS: Positive mutagenic responses in bacteria, mice, rats, and rabbits were observed. DNA damage and chromosomal breaks in humans were observed.

Teratogenicity

IARC: Tail abnormalities, cleft palate, and absence of the lower jaw were defects observed in mice. Brain and skeletal defects in rats were observed. Other studies did not show teratogenic effects.

RTECS: Abnormalities of the musculoskeletal system and other effects

on the newborn were observed in rats and mice.

Reproductive Effects

IARC: Alteration of estrus cycles in rats was observed. Increased testicular weight and degeneration of the seminiferous tubules in rats, guinea pigs, and rabbits were observed. Fetotoxicity in rats and mice were observed.

RTECS: Fetotoxicity, post-implantation mortality, and extra embryonic structures in rats and mice were observed. Pre-implantation mortality, fetal death, and other fetal effects in mice were observed.

SECTION V. CHRONIC TOXICITY

Appetite loss, weight loss, fatigue, muscle weakness, headaches, dizziness, nervousness, irritability, anemia, irreversible blood changes, and damage to the heart and liver.

SECTION VI. PHYSICAL DATA

Molecular weight: 78.12

Boiling Point (at 760 mm Hg): 80°C (176°F)
Melting Point (at 760 mm Hg): 5.5°C (42°F)
Vapor Pressure (mm Hg) [at 20°C (68°F)]: 74.6

Vapor Density (Air=1): 2.77

Specific Gravity (water=1): 0.879
Percent Volatile By Volume: 100
Evaporation Rate (butyl acetate =1):

Solubility in Water: Soluble

Solvent Solubility: Miscible with alcohol, chloroform, ether, carbon districted, carbon tetrachloride, glacial acetic acid, acetone, oils. Appearance and Odor: Clear, colorless, flammable liquid with an odor threshold of 5 ppm.

SECTION VII. FIRE AND EXPLOSION HAZARD DATA

Flash Point (Method Used): -11°C (12°F) (closed cup)

Extinguisher Media: Water fog, carbon dioxide, dry chemical, foam

Lower Upper

Flammable Limits in Air, percent by vol.: 1.3 7.1

Autoignition Temperature: 80 C (176 F)

NFPA Fire Hazard: 3

Special fire Fighting Procedures: Use blanketing technique to smother fire. Water stream will scatter fire. Water spray may be used to cool fire-exposed containers. Firefighters should wear self-contained breathing apparatus and protective clothing.

Unusual Fire and Explosion Hazards: Explosive and flammable mixtures with air may be formed at room temperature. In a fire situation it is a severe explosion hazard. Vapors may flow a distance along surfaces to ignition sources and flash back.

SECTION VIII. REACTIVITY DATA

Stability: Stable under normal conditions of handling and storage.

NFPA Reactivity: 0

Incompatibilities (Materials to Avoid): Strong oxidizers such as ozone, permanganate, sulfuric or nitric acids, potassium peroxide, and sodium peroxide.

Hazardous Decomposition Products: Oxides of carbon and nitrogen

Hazardous Polymerization: Does not occur

SECTION IX. SPILL, LEAK OR DISPOSAL PROCEDURES

Actions To Take in Case of Spills or Leaks: Restrict from areas of spills or leaks persons not wearing protective equipment and clothing. Eliminater sources of ignition. Ventilate area. Inform supervisor or health and safety officer of any spill or leak. While protecting against eye and skin contact and inhalation of vapors, take the following steps:

o Solid: Shovel or sweep solid into suitable container, and cover.

o <u>Liquid</u>: Contain spill. Prevent leakage into confined spaces or sewer drains. Where feasible, absorb liquid with paper towels, vermiculite, sand, or other non-combustible absorbent material. Collect in suitable container and cover.

o Gas: Ventilate area to keep gas concentration below flammability limit. Stop the gas flow. If leak cannot be stopped, move

container to safe place in open air and allow to empty.

Disposal Methods: Federal laws and regulations impose highly specific requirements for disposal of toxic and otherwise hazardous materials. Consult with your supervisor or health and safety officer regarding the proper, legal disposal procedures for this substance. Do not dispose of potentially toxic or otherwise hazardous substances without appropriate

Copyright 1984 by Envirologic Data, Inc.

authorization. Prior to receiving institutional authorization, it may be necessary to store spilled materials. To do so safely, carefully label containers of materials, store in a cool, dry location, and maintain security of the storage area until official guidance is obtained.

SECTION X. SPECIAL PROTECTION INFORMATION

Respiratory Protection: Only NIOSH or MSHA approved equipment should be used. Minimum respiratory equipment required for vapor:

 \leq 50 ppm: For short periods, canister or cartridge type respirators with full facepiece.

For emergencies or when concentration is unknown, self-contained breathing apparatus should be used.

Ventilation: Provide general and local exhaust ventilation to comply with TLV requirements.

Protective Clothing or Equipment:

o to prevent repeated or prolonged skin contact with liquid and solid chemicals, use impervious clothing, gloves, face shields (eight-inch minimum), splash-proof safety goggles, and other appropriate protective clothing.

o Place clothing contaminated with liquids or solids in closed containers for storage until clothing can be discarded or decontaminated. If the clothing is to be laundered or otherwise cleaned to remove the chemical, the person(s) performing the operation should be informed of the chemical's hazardous properties and of ways to minimize exposure.

o A safety shower should be provided within the immediate work area for emergency use where liquids may contact the employee's body.

o An eyewash fountain should be provided within the immediate work area for emergency use where liquids or solids may contact the employee's eyes.

SECTION XL. SPECIAL PROCEDURES AND PRECAUTIONS

Procedures and Precautions to be Taken in Handling and Storing: Store in well-ventilated area away from oxidizing agents and sources of heat and ignition.

Other Precautions: Use extreme caution when handling this chemical. It has been shown to cause cancer in humans. Do not smoke in areas of use.

DISCLAIMER: This document is based upon information obtained from numerous sources. Every reasonable effort has been made to provide reliable data and information; however, Envirologic Data cannot assume responsibility for the quality or validity of laboratory studies or other data reported in the literature or for the consequences of their use.

Copyright 1984 by Envirologic Data, Inc.

MATERIAL SAFETY DATA SHEET

GENUM PULLISHING COMPORATION THAS CATALORS SINEET SCHENECTADY NY 12303-1836 USA (5:8) 377 6855



STRYL BENZENE

Date August 1978

SECTION 1. MATERIAL IDENTIFICATION

MATERIAL NAME: ETHYL RENZEME

OTHER DESIGNATIONS: Phenylechane, Ethylbenzol, C2H5C6H3, CAS# 600 100 414

MANUFACTURER: Available from several suppliers.

SECTION II. INGREDIENTS AND HAZARDS	*	ATAD CANSAH
Echyl Benzene	ca 100	S-hr TWA 100 ppm [*]
*Current OSHA permissable exposure level. A Scandard was proposed by OSHA in October 1975 which includes an <u>action level</u> of 50 ppm, and detailed requirements of monitoring, medical surveillance, employee training, etc., when exposure exceeds 50 ppm. It has not yet issued as a legal requirement.		Human, inhalation TCLo 100 ppm for 8 hr (irrication) Rat, Oral 1050 3500 mg/kg

SECTION III. PHYSICAL DATA

Boiling point at 1 atm, deg C	136	Specific gravity 20/40	0.56/
	10	Volatiles, %	ca 199
	3 66	Evaporation rate (SuAc=1)	<1
Water solubility at 20 C Wt. % -	0.015	Mailing point, des c	
Mater - Attached		Molecular weight	105.16

Appearance & Odor: Clear, colorless liquid with an aromatic hydrocarbon odor.

	SECTION IV. FIRE AND	EXPLOSION DATA		LOWER	م∋ددر
į		210 7 ((22 6)	Flammability Limits in Alz Volume X	1.0	6.7

Extinguishing media: Carbon dioxide, dry chemical or "alcohol" foam. A water spray may be ineffective to put our fire, but may be used to cool fire-exposed containers.

A stream of water can spread fire of burning liquid. This is a flammable liquid (OSHA Class IE) which can readily form explosive mixtures with air, especially when heated. Heavier-than-air vapors can flow along surfaces to reach distant ignition sources, and then flash back. Firefighters should use self-contained breatning equipment and eye protection to fight fires in enclosed places.

SECTION V. REACTIVITY DATA

This material is stable in storage in closed containers at room temperature. does not polymerize.

This flammable material should be kept separated from oxidizing agents, strong acids and bases and ammonia. Thermal-oxidative degradation can produce toxic products, Including carbon monoxide.

Catrocate Hedişç<u>a</u>] Start

77. VI

Toluene MSDS - 1019 Page 2

- o Call the Pittsburgh Poison Information Center (I-412-681-6669).
- o Have someone call a rescue unit or medical professional.
- o If necessary, transport person to an emergency medical facility promptly.

Skin:

- o Wash off skin immediately with a large amount of water; use soap
- o Remove any contaminated clothing and rewash skin.
- o Call the Pittsburgh Poison Information Center (1-412-681-6669).
- o Transport person to a medical facility as necessary.

Eyes:

- o Gently rinse eye immediately, using large amounts of water, for fifteen minutes, if possible, with eyelids held open.
- o If possible, have person remove contact lenses if worn; never permit the eyes to be rubbed.
- o Call the Pittsburgh Poison Information Center (1-412-681-6669).
- o Transport person to an emergency medical facility promptly as necessary.

SECTION III. ACUTE TOXICITY

Exposure Routes: Primary routes of exposure are via inhalation of vapors

and contact with liquid in skin and eyes.

Toxic Effect Levels:

Inhalation human TCLO 200 ppm 100 ppm Inhalation human TC₁₀ 5,000 mg/kgOral rat LD Kn

4,000 ppm (for 4 h) Inhalation rat LC₁₀ Inhalation mouse $\widetilde{\text{LC}}_{50}$ 5,320 ppm (for 8 h)

Signs and Symptoms:

Ingestion: Irritation of the digestive tract; central nervous system depression, headache, dizziness, fatigue, muscular weakness,

incoordination, collapse and coma.

Inhalation: Headache and slight drowsiness at 100 ppm, fatigue, nausea and itching skin at 100-200 ppm, anesthetic effects and

respiratory tract and eye irritation above 200 ppm.

Skin: Irritation.

Eyes: Irritation, reversible corneal burns.

Exposure Limits:

200 ppm, 8-h TWA OSHA standard(s):

300 ppm, Ceiling

500 ppm, Peak for 10 min

100 ppm, TWA NIOSH recommended limit(s):

200 ppm, Ceiling for 10 min

100 ppm, 8-h TLV-TWA ACGIH recommended limit(s):

150 ppm, STEL

SECTION IV. LONG-TERM ORGANISM THREAT POTENTIAL

Carcinogenicity No indication of carcinogenicity was found TARC, NIP/NCI. CAG. RTECS: in standard references.

Mutagenicity

IARC: IARC Monographs have not reported mutagenic effects.

RTECS: Positive mutagenic reponses were observed in bacteria and in

rat cells

Tera togenicity

IARC: IARC Monographs have not reported teratogenic effects.

RTECS: Developmental abnormalities in the musculoskeletal system of

rats and in the craniofacial region of mice have been observed.

Reproductive Effects

IARC: IARC Monographs have not reported reproductive effects.

RTECS: Fetotoxicity was observed in rats and mice, and fetal death was

observed in mice.

SECTION V. CHRONIC TOXICITY

Possible dermatitis, drying, and cracking of the skin may result from repeated or prolonged skin contact. Liver and kidney injury may occur after prolonged exposure.

SECTION VI. PHYSICAL DATA

Molecular weight: 92.1

(231°F) Boiling Point (at 760 mm Hg): 110.6°C Melting Point (at 760 mm Hg): -95°C (~139°F)

Vapor Pressure (mm Hg) [at 20 °C (68°F)]:

Vapor Density (Air=1):

Specific Gravity (water=1): 0.866

Percent Volatile By Volume: 100

Evaporation Rate (buty) acetate =1): 2.24

Solubility in Water: 0.05 g/100g of water, at 20°C (68°F)
Solvent Solubility: Soluble in acetone, miscible in absolute alcohol,

ether, and chioroform.

Appearance and Odor: Water white liquid with a characteristic aromatic odor, whose recognition threshold (unfatigued) is 2-5 ppm (100 percent of test panel). Odor detection is unsatisfactory for safety because of fatigue.

SECTION VII. FIRE AND EXPLOSION HAZARD DATA

4°C (40°F) (closed cup) Flash Point (Method Used): Extinguisher Media: CO2, dry chemical, foam, water fog.

Lower

Flammable Limits in Air, percent by vol.: 1.27

Autoignition Temperature: 480 C (896 F)

NFPA Fire Hazard: 3

Self-contained breathing apparatus Special Fire Fighting Procedures:

and eye protection should be worn.

Unusual Fire and Explosion Hazards: At room temperature toluene emits vapors that can form flammable mixtures with air. When exposed to heat and flame it is a dangerous fire hazard and a moderate explosion hazard. Vapors can flow along surfaces to distant ignition sources, then flash back.

SECTION VIII. REACTIVITY DATA

Stability: Stable under normal storage conditions and handling.

NFPA Reactivity: 0

Incompatibility (Materials to Avoid): Strong oxidizing agents, sparks or open flames. Nitric acid and toluene, especially when combined with sulfuric acid, will produce nitrated compounds which are dangerously explosive.

Hazardous Decomposition Products: Oxides of carbon and nitrogen.

Hazardous Polymerization: Does not occur.

SECTION IX. SPILL, LEAK OR DISPOSAL PROCEDURES

Actions To Take in Case of Spills, or Leaks:

Restrict from areas of spills or leaks persons not wearing protective equipment and clothing. Eliminate sources of ignition. VEntilate area. Inform supervisor or health and safety officer of any spill or leak. While protecting against eye and skinn contact and inhalation of vapors, take the following steps:

o Liquid: Contain spill. Prevent leakage into confined spaces or sewer drains. Where feasible, absorb liquid with vermiculite, sand, or other non-combustible absorbent material. Contaminated absorbent material should be stored away from sources of heat and

ignition.

o Vapor: Ventilate area to keep vapor concentration below lower flammability limit.

Disposal Methods:

o Small quantities: dispose of absorbed material, i.e. vermiculite, dry sand, earth or a similar material in a secured sanitary landfill or atomize in a suitable combustion chamber.

o Large quantities: dispose via a licensed waste disposal company.

Follow federal, state and local regulations.

SECTION X. SPECIAL PROTECTION INFORMATION

Respiratory Protection: Only NIOSH or MSHA approved equipment should be

used. Minimum respiratory protection required for vapor:

> 200 and <500 ppm: Chemical cartridge respirator with organic vapor cartridge(s); or supplied air respirator; or self-contained breathing apparatus.

1000 ppm: Chemical cartridge respirator with full face-piece and

organic vapor cartridge(s).

≤2000 ppm: Gas mask with chin-style or front- or back-mounted organic vapor canister; or supplied-air respirator with full facepiece, helmet or hood; or self-contained breathing apparatus with full facepiece.

>2000 ppm or entry and escape from unknown concentrations: Self contained breathing apparatus with full facepiece operated in

ENVIROLOGIC DATA

Toluene MSDS - 10 19 Page 5

pressure demandor other positive pressure mode; or combination respirator which includes Type C supplied-air respirator with full facepiece operated in pressure-demand or other positive pressure or continuous-flow mode and auxiliary self-contained breathing apparatus operated in pressure-demand or other positive pressure mode. Ventilation: Provide general dilution or local exhaust ventilation to comply with OSHA Standards. Ventilation fans and other electrical service must be nonsparking and explosion proof. Exhaust hoods should have >100 LFM face velocity and be designed to capture heavy vapors. Protective Clothing or Equipment:

o To prevent repeated or prolonged skin contact with the liquid, use impervious clothing, gloves, face shields, (eight-inch minimum), splash-proof safety goggles, and other appropriate protective

clothing.

o Place clothing contaminated with the liquid in closed containers for storage until it can be discarded or until provision is made for the removal of the chemical from the clothing. If the clothing is to be laundered or otherwise cleaned to remove the chemical, the person performing the operation should be informed of the chemical's hazardous properties and ways to minimize exposure.

o A safety shower should be provided within the immediate work area for emergency use where liquid may contact the employees body.

o An eyewash fountain should be provided within the immediate work area for emergency use where the liquid may contact the employee's eyes.

SECTION XI. SPECIAL PROCEDURES AND PRECAUTIONS

Procedures and Precautions to be Taken in Handling and Storing: Store in cool, clean, well-ventilated area away from sources of heat and ignition and away from oxidizing agents. Use nonsparking tools and safety cans for handling small amounts. Use ground and bond metal containers for liquid transfers to prevent static sparks and protect contaniers from physical damage.

Other Precautions: Do not wear contact lenses or smoke in areas of storage or use. Avoid contact with skin and eyes. Alcohol use may

aggravate the narcotic and blood effects.

DISCLAIMER: This document is based upon information obtained from numerous sources. Every reasonable effort has been made to provide reliable data and information; however, Envirologic Data cannot assume responsibility for the quality or validity of laboratory studies or other data reported in the literature or for the consequences of their use.

0066X

XYLENE

MATERIAL SAFETY DATA SHEET

Prepared by Envirologic Data Portland, ME (207) 773-3020 Revised January 1986

EMERGENCY TELEPHONE NUMBER: Pittsburgh Poison Information Center

Children's Hospital of Pittsburgh Pittsburgh, PA 1-412-681-6669

SECTION I. IDENTIFICATION

Material Name: Xylene

Synonyms: Dimethylbenzene: xylol

CAS No.: 1330-20-7

Molecular Formula: C6H4(CH3)2

SECTION II. FIRST AID PROCEDURES AND EMERGENCY TREATMENT

In all cases of poisoning, follow standard procedures for poison management, first aid, and cardiopulmonary resuscitation. Whenever transporting a poisoned person to a hospital, bring the container, label, or other information concerning the product (without delaying transport) to assist medical personnel with diagnosis and treatment. Four different routes of exposure and their respective first aid/poison managements are outlined below:

Indestion:

- o Dilute the poison by offering and encouraging the person to drink one or two glassfuls of water or milk. Do not use carbonated fluids. Do not attempt to make the person vomit.
- o Call the Pittsburgh Poison Information Center (1-412-681-6669). If you cannot reach the Poison Information Center, call or take the person to the nearest hospital emergency department.
- o Notify your supervisor or health and safety officer of this or any poison exposure.

Inhalation:

- Stop exposure by moving person from contaminated area to clean air area.
- o Call the Pittsburgh Poison Information Center (1-412-681-6669).
- o Have someone call a rescue unit or medical professional.
- o If necessary, transport person to an emergency medical facility promptly.

Copyright 1986 by Envirologic Data, Inc.

Sk in:

o If material is a powder, brush away using a cloth.

Wash off skin immediately with a large amount of water: use soap if available.

o Remove any contaminated clothing and rewash skin.

o Call the Pittsburgh Poison Information Center (1-412-681-6669).

o Transport person to a medical facility as necessary.

Eyes:

- o Gently rinse eye immediately, using large amounts of water, for fifteen minutes, if possible, with eyelids held open.
- o If possible, have person remove contact lenses if worn: never permit the eyes to be rubbed.
- o Call the Pittsburgh Poison Information Center (1-412-681-6669).
- o Transport person to an emergency medical facility promptly as necessary.

SECTION III. ACUTE TOXICITY

Exposure Routes: The primary routes of exposure are inhalation of vapor and direct skin or eye contact with the liquid.

Toxic Effect Levels:

Inhalation human TCLO 200 ppm

Inhalation man $LC_{LO} = 10,000$ ppm (for 6 h)

Oral rat LC50 4,300 mg/kg

Inhalation rat LCsn 5,000 ppm (for 4 h)

Signs and Symptoms

Ingestion: Burning sensation in the mouth and throat. Other symptoms are the same as those for inhalation (see below), except that lung congestion will not usually develop.

Inhalation: Irritation of the eyes, nose, and throat. At concentrations above 200 ppm nausea, vomiting, abdominal pain, dizziness, staggering, drowsiness, severe breathing difficulties, and unconsciousness may occur. Vapor levels above 200 ppm may have an anesthetic effect.

Skin: Irritation and defatting.

Eyes: Irritation at concentrations of 200 ppm.

Exposure Limits.

OSHA Standard(s): 100 ppm, 8-h TWA (skin)* NIOSH Recommended Limit(s): 100 ppm, 8-h TWA

200 ppm, Ceiling (for 10 min)

ACGIH Recommended Limit(s): 100 ppm, 8-h TLV-TWA

150 ppm, STEL

*Skin absorption may contribute to overall exposure.

SECTION IV. LONG-TERM ORGANISM THREAT POTENTIAL

Carcinogenicity

IARC, NTP/NCI, CAG, RTECS: No indication of carcinogenic effects was found in standard references.

Copyright 1986 by Envirologic Data, Inc.

Mutagenicity

IARC: IARC Monographs have not reported mutagenic effects.

RTECS: Mutagenic response in yeast.

Teratogenicity

IARC: IARC Monographs have not reported teratogenic effects.

RTECS: Teratogenic effects in mice and rats.

Reproductive Effects

IARC: IARC Monographs have not reported reproductive effects.

RTECS: Reproductive effects in mice.

SECTION V. CHRONIC TOXICITY

Reversible damage to the kidneys and liver may occur from exposure to high concentrations.

SECTION VI. PHYSICAL DATA

Molecular weight: 106.2

Boiling Point (at 760 mm Hg): 144.4°C (292°F) (0)*

138.9°C (282°F) (m)*

138,3°C (281°F) (p)*

Melting Point (at 760 mm Hg): -25°C (-12°F) (0)

-48°C (-54°F) (m) 13°C (55°F) (ρ)

Vapor Pressure (mm Hg) [at 20°C $(68^{\circ}F)$]: 7(0), 9(m), 9(p)

Vapor Density (Air=1): 3.7

Specific Gravity (water=1): 0.88(o), 0.86(m), 0.86(p), mixture about 0.86

Percent Volatile By Volume: - 100

Fyaporation Rate (butyl acetate =1): 0.7 (o, m, p)

Solubility in Water: 0.00003 g/100 g of H₂O, at 20°C (68°F) (o, m, p).

Solvent Solubility: Misciple with absolute alconol, ether, and other

organic liquids.

Appearance and Odor: Colorless or light colored aromatic liquid with an unfatigued odor threshold of 0.3 ppm in air. Para-xylene may be a

crystal at low temperatures.

 $\star_{\mathcal{O}}$ = ortho isomer, m = meta isomer, p = para isomer

SECTION VII. FIRE AND EXPLOSION HAZARD DATA

Flash Point (Method Used): 27.2 to 32°C (81 to 90°F) (closed cup)

Extinguisher Media: Foam, carbon dioxide, dry chemical.

Lower Upper

Flammanle Limits in Air, percent by vol.: 1.0 to 1.1 6 to 7

Autoignition Temperature: 465 to 530 C (869 to 986°F)

NFPA Fire Hazard: 3

Special Fire Fighting Procedures: Firefighters should use self-contained breathing apparatus with a full facepiece operated in pressure-demand or

positive-pressure mode.
Unusual Fire and Explosion Hazards: When exposed to heat or flame,
xylene is a significant fire and explosion hazard. Vapors may travel a
distance along surfaces to ignition sources and then flash back.

SECTION VIII. REACTIVITY DATA

Stability: Stable in closed containers at room temprature.

NFPA Reactivity: 0

Incompatibilities (Materials to Avoid): Can form explosive mixtures with Xylene should be kept away from sources of heat and ignition and strong oxidizing agents.

Hazardous Decomposition Products: Degradation in air due to heat may yield toxic vapors and gases, including carbon monoxide and oxides of nitrogen.

Hazardous Polymerization: Does not occur.

SECTION IX. SPILL, LEAK OR DISPOSAL PROCEDURES

Actions To Take in Case of Spills or Leaks: Restrict from areas of spills or leaks persons not wearing protective equipment and clothing. Eliminate sources of ignition. Ventilate area. Inform supervisor or health and safety officer of any spill or leak. While protecting against eye and skin contact and inhalation of vapors, take the following steps:

o Solid: Shovel or sweep solid into suitable container, and cover. o Liquid: Contain spill. Prevent leakage into confined spaces or sewer drains. Where feasible, absorb liquid with paper towels, vermiculite, sand, or other non-combustible absorbent material. Collect in suitable container and cover.

Disposal Methods: Federal laws and regulations impose highly specific requirements for disposal of toxic and otherwise hazardous materials. Consult with your supervisor or health and safety officer regarding the proper, legal disposal procedures for this substance. Do not dispose of potentially toxic or otherwise hazardous substances without appropriate authorization. Prior to receiving institutional authorization, it may be necessary to store spilled materials. To do so safely, carefully label containers of materials, store in a cool, dry location, and maintain security of the storage area until official guidance is obtained.

SECTION X. SPECIAL PROTECTION INFORMATION

Respiratory Protection: Only NIOSH or MSHA approved equipment should be used. Minimum respiratory equipment required for vapor:

>100 and ≤1,000 ppm: Chemical cartridge respirator with full

facepiece and organic vapor cartridge(s).

<5,000 ppm: Gas mask with chin-style or front- or back-mounted</p> organic vapor canister: or supplied-air respirator with full facepiece, helmet, or hood; or self-contained breathing apparatus with full facepiece.

<10,000 ppm: Type C supplied—air respirator with full facepeice</p> operated in pressure-demand or other positive pressure mode or with full facepiece, helmet or hood operated in continous-flow mode.

Copyright 1986 by Envirologic Data, Inc.

>10,000 ppm or entry and escape from unknown concentrations:
Self-contained breathing apparatus with full facepiece operated in pressure-demand or other positive pressure mode: or combination respirator including Type C supplied-air respirator with full facepiece operated in pressure-demand or other positive pressure or continuous-flow mode and auxiliary self-contained breathing apparatus operated in pressure-demand or other positive pressure mode.

Ventilation: Provide general and local exhaust ventilation to comply with OSHA standards. For exhaust hood, use >100 lfm face velocity.

Protective Clothing or Equipment:

o To prevent repeated or prolonged skin contact with liquid and solid chemicals, use impervious clothing, gloves, face shields (eight-inch minimum), splash-proof safety goggles, and other appropriate protective clothing.

o Place clothing contaminated with liquids or solids in closed containers for storage until clothing can be discarded or decontaminated. If the clothing is to be laundered or otherwise cleaned to remove the chemical, the person(s) performing the operation should be informed of the chemical's hazardous properties and of ways to minimize exposure.

o A safety shower should be provided within the immediate work area for emergency use where liquids may contact the employee's body.

o An eyewash fountain should be provided within the immediate work area for emergency use where liquids or solids may contact the employee's eyes.

SECTION XI. SPECIAL PROCEDURES AND PRECAUTIONS

Procedures and Precautions to be Taken in Handling and Storing: Store in a well-ventilated area in closed containers away from sources of heat and ignition and strong oxidizing agents. Protect containers from physical damage. Electrically ground metal containers when transferring liquid. Detached storage is preferable.

Other Precautions: Do not smoke in areas of use or storage. Wash hands before eating, smoking, or using toilet facilities.

<u>DISCLAIMER</u>: This document is based upon information obtained from numerous sources. Every reasonable effort has been made to provide reliable data and information; however, Envirologic Data cannot assume responsibility for the quality or validity of laboratory studies or other data reported in the literature or for the consequences of their use.

0733X

Copyright 1986 by Envirologic Data, Inc.

APPENDIX F Safety Equipment Checklist

Job Last: Groundwater Sampling

SAFETY EQUIPMENT CHECKLIST
(Check equipment needed, indicated number needed at left)

PERSONAL PROTECTION

SCBA	mir-line system	5 min. bott	le half-face	respirator full-face re-
	(dust exesent)	RESPIRATOR acid/base	CARTRIDGE(S)	
X organic vapor	organic/HEPA	acid/base	organic/acid	dust pre-filterother
(dust present)		COVERALLS		
X tyvek	chem-tuff	chemrel1	chem-max (level A)	PV-tyvek Saranex
		GLOVES		
X vinyl	neoprene	solvent (NBR)	acid	Viton Silver sheil
boots/rubbers	(H ₂ D/X/POSUMS) safety goggles	safety glasses	hard hat	splash shield steel toed t
		MONITORING & SURVEILLANCE		
LEL/02	OVA (FID)	HNu (PID)	colorometric tubes	radiation meter
	1H sampling pump	dust sampler	other	
		HISCELANEOUS	•	
	fire extinguisher	eye wash capacity	drinking water	barricades
escape pack	cascade system	traffic cones	reflective vest	spare air bottle
		DECONTAMINATION EQUIPMENT		
wash tub	5 gallon pail	scrub brush	water sprayer	rinsate container steam cleane
garbage bags	drum/can		hygienic soap	

Job task: Willing

SAFETY EQUIPMENT CHECKLIST

(Check equipment needed, indicated number needed at left)

PERSONAL PROTECTION

SCBA	air-line system	5 min. bott	te half-face respirator	full-face resp
	// / /l	RESPIRATOR		
X organic vapor	× (dust prosent) × organic/HEPA	acid/base	organic/acid dust pre-fil	terother
	(1/0 1)	COVERALLS		J
× tyvek	(Myor Had expesses)	chemrell	chem-max (level A) PV-tyvek	Saranex
		GLOVES	_	
X vinyl	ncoprene	solvent (NBR)	acid Viton	Silver sheild
boots/rubbers	(Hz D exposur) x safety goggles	X safety glasses	X hard hat splash shie	id X steel toed boo
	M -	ONITORING & SURVEILLANCE		
X LEL/02		X HNU (PID)	colorometric tubes ra	diation meter
	IH sampling pump _	(dust present) X dust sampler	other	
	M -	11 SCELANEOUS		
<u>≭</u> first mid kit	_X fire extinguisher _	eye wash capacity	🗶 drinking water <u>K</u> ba	rricades
escape pack	cascade system	X traffic cones	X reflective vest sp	are air bottle
		DECONTAMINATION EQUIPMENT		
wash tub	5 gallon pail	× scrub brush	X water sprayer X rinsate cor	thiner X steam cleaner
garbage bags	∠ drum/can	X visquen sheeting	X hygienic soap detergent	

APPENDIX G Accident Reporting Form

Accident/Incident (near miss) Report

Employee's Name:			D.O.B
Address:			D.O.H
			SS#
Ioh Title:		Supervisor's Na	me:
Office Location:			
	nt:		
Describe clearly how	v the accident occurred:		
Was incident:	Physical	C	hemical
Parts of body affects	:db:	Exposure	: Dermai
right	left		nalation
			gestion
Wimesses: 1)		2)	
Managers must con Explain specifically	the corrective action you		prevent a recurrence:
Did injured go to do	ctor:\	Where:	
		When:	
Oid injured go to ho			
	\\		
	:=====================================		
Signatures:			
			Health & Safety Manage
Employee	Reporting A	vlanager	Health & Sately Man-6-
			Date
Date	Date		
This form must be c	ompleted and returned t	to Heath and S	afety Manager within 5 working
lays.			

APPENDIX H

OSHA Inspection Procedures

Applied GeoSystems is committed to providing a safe environment on all work sites. Every Applied GeoSystems employee represents the company and as such, will adhere to all regulations and company policies, and treat every OSHA inspector with respect for their authority.

Inspection Process:

- 1) Identify the inspector
 - Ask to see credentials
 - Write down the relevant information, including the inspector's name, agency affiliation, address, telephone number and the statutory authority under which the inspection is being conducted.
 - If inspection occurs at a project site, ask for written verification of the inspectors certification of completion of 40 hour hazardous materials training and health monitoring.

 Remember, no one may venture out of the clean zone without proper certification. Double check it with his/her office if in doubt.
- Notify the Health and Safety Manager and Project Manager immediately: one or both must be present for the opening meeting and inspection.
- 3) Determine the scope of the inspection:
 - Ask the inspector what company activities are of interest and the reason for the inspection.
 - Discover what triggered the inspection
 - If complaints initiated the inspection, find out specifically what they are.
- 4) If the inspection occurs on site, carefully review the Site Safety Plan with the inspector <u>before</u> site entry.
- 5) Take notes on:
 - What is said.
 - What is seen.
 - Who spoke to whom.
 - What the issues are.
 - What recommendations and/or corrective actions were discussed/taken.
 - What the inspector actually inspected.
 - Any other activity/occurrence, even if minor (include where, when, who, and what) was observed

- 6) If the inspector asks for copies of anything, reassure him/her of our full intent to cooperate but remember your primary responsibility is to obtain clearance from the Project Manager, Health and Safety Manager, or other appropriate Manager.
- 7) When in doubt on any questions, do not bluff an answer. Ask the inspector to put the question in writing, addressed to company counsel. Never lie, even by omission; jail can be the penalty.
- 8) If the inspection occurs at the office, be sure the OSHA 200 logs are available for inspection. Always make sure the OSHA poster is visible and the Health and Safety Manager and/or appropriate Manager is present.

APPENDIX I Vapor Monitoring Form

R MONITORING		
	CONTAMINANTS	
	DATE OF SAMPLING	
	PROJECT NUMBER	
	PROJECT NAME	

RESULTS OF VAPOR MONITORING

IONIZ	ATION DETE	CTOR	EXPLOS REAL		RADIATION MONITOR READING	LOCATION	PURPOSE	INITIALS
FID	10.2eV PID	11.7eV PID	% LEL	% O ₂	mR/hr			
								:
<u> </u>								
								-
								ļ
	1					·		
		FID 10.2eV PID	FID 10.2eV PID 11.7eV PID	READING READ FID 10.2eV PID 11.7eV PID % LEL.	FID 10.2eV PID 11.7eV PID % LEL % O ₂	READING FID 10.2eV PID 11.7eV PID % LEL % O2 mR/hr	READING READING READING READING READING READING READING LOCATION LOCATION LOCATION READING REA	FID 10.2eV PID 11.7eV PID % LEL % O, mR/hr PURPOSE FID 10.2eV PID 11.7eV PID % LEL % O, mR/hr

APPENDIX J Equipment Calibration Log

INSTRUMENT CALIBRATION LOG

DATE	INSTRUMENT	TEST GAS	ppm	READING	ADJUSTED?		SIGNATURE
					YES	NO -	
					VEC	NO	
					YES	ИО	1
					YES	ОИ	
					YES	ИО	
					YES	NO	
					YES	NO	
				,			
· · · · · · · · · · · · · · · · · · ·					YES	NO	<u>'</u>
					YES	ИО	
					YES	МО	
					YES	МО	
1				- 	1	110	
	1				YES	ИО	
							PAGE

APPENDIX K

Construction Safety

Definitions - Excavation, Trenches, Earthwork

Bank- a mass of soil rising above a digging level.

Bell Hole- an additional excavation made into the sides or bottom of a trench to provide additional work space.

Belled Excavation - a part of a shaft or footing excavation, usually near the bottom and bell-shaped, that makes the cross-sectional area at that point larger than that above.

Benching- a method of excavation whereby the faces of an excavation or trench are widened progressively outward with respect to the bottom by a specific series of horizontal and vertical cuts to provide protection against the hazard of moving ground.

<u>Braces for excavations</u>— the horizontal members of the shoring system the ends of which bear against the uprights or stringers.

<u>Earthwork</u>- the process of excavating, moving, storing, placing, and working any type of earth materials.

Excavation— a man-made cavity or depression in the earth's surface, including its sides, walls, or faces formed by the removal of materials and producing unsupported earth conditions by reason of such removal. If installed forms or similar structures reduce the depth to width relationship, and excavation may become a trench.

Exploration shaft- a shaft created and used for the purpose of obtaining subsurface data.

Geotechnical Specialist (GTS) - a person registered by the State as a Certified Engineering Geologist, or a Registered Civil Engineer trained in soil mechanics, or an engineering geologist or civil engineer with a minimum of 3 years applicable experience working under the direct supervision of either a Certified Engineering Geologist or Registered Civil Engineer.

Hard Compact- all earth material not classified as running
soil.

<u>Hydraulic Shoring</u>- a shoring system using hydraulic cylinders, planks, rails, plywood or steel beams to support the excavated wall of trenches.

<u>Lagging-</u> boards which are joined, side-by-side, lining and excavation.

Running Soil- earth material where the angle of repose is approximately zero, as in the case of soil in a nearly liquid state, or dry, unpacked sand which flows freely under slight pressure. Running material also includes loose or disturbed earth that can only be contained with solid sheeting.

<u>Shaft</u>- an excavation under the earth's surface in which the depth, is much greater than its cross-sectional dimensions such as those formed to serve as wells, cesspools, certain foundation footings, and under streets, railroads, buildings, etc.

<u>Shore</u>- a supporting member that resists a compressive force imposed by a load.

Shoring System- a temporary structure for the support of earth surfaces formed as a result of excavation work.

<u>Sides. Walls. and Faces</u>- the vertical or inclined earth surfaces formed as a result of excavation work.

<u>Sloping</u>- a method of excavation whereby the faces of an excavation or trench are laid back to provide protection from moving ground.

<u>Spoil</u> - the earth material that is removed in the formation of an excavation.

<u>Stringers</u>- the horizontal members of th shoring system whose sides bear against the uprights. Stringers are sometimes called whalers.

<u>Strut</u>- a structural member designed to resist forces in either tension or compression.

Trench- an excavation made below the surface of the ground. In general, the depth is greater than the width at the bottom, but the width of a trench at the bottom is not greater than 15 feet.

Trench Jack- screw or hydraulic type jacks used as cross bracing in a trench shoring system.

Trench Shield- a protective device which shields workers from the effect of ground movement and which can be moved along as work progresses.

Uprights- the vertical members of the shoring system.

<u>Whaler</u>- a structural member in a horizontal or nearly horizontal position used for stiffening or securing other components of concrete forms, excavation sheeting, or similar temporary structures.

EXCAVATION PROCEDURES

(also trenches, shafts and other earthwork)

- 1. Prior to beginning an excavation, the location of all underground utilities and other underground hazards shall be determined.
- 2. A hazard assessment shall be conducted by a qualified person to evaluate the potential exposure to employees who may work in or around the excavation.
- 3. The excavation shall also be inspected by a qualified person after each rain or other hazard increasing event to evaluate the potential hazard from slides or caveins.
- 4. Anytime an employee enters an excavation 5 feet or greater in depth, that employee must be protected by a system of shoring, sloping, benching, or alternative means addressed in #15 below. Excavations less than 5 feet deep with soft or unstable soils shall also be protected when hazardous ground movement may be expected.
- 5. When an employee enters an excavation 5 feet or deeper in depth, the employer is required to obtain the necessary excavation permit and/or notification procedures with Cal-OSHA.
- 6. Excavated materials shall be prevented from falling back into the excavation. Spoils should be placed no closer than 2 feet from the edge of the excavation.
- 7. Work which is conducted within the excavation should be under the direct supervision of a qualified person who is capable of modifying the shoring or sloping system.
- 8. A convenient and safe means of egress shall be provided for employees working within an excavation 4 feet deep or greater. This may consist of a stairway, ladder, or ramp located within 25 feet of lateral travel. If a ladder is utilized, it shall be placed on a substantial base and extend a minimum of 36 inches above the landing and secured against movement.

- 9. Any employee working in the vicinity of an excavator shall not be in a position where that employee might fall into or contact the moving parts of that excavator. These employees shall also be wearing a reflective vest.
- 10. An adequate means of water drainage shall be implemented to reduce the likelihood of run-off entering the excavation. This shall hold true during the rainy season. If the accumulation of water might pose a hazard to employees, the situation should be controlled prior to resumption of operations.
- 11. All shoring systems shall incorporate the soil specifications and conditions for that particular site. The installation of shoring systems shall be conducted such that the employee is properly protected from the potential of cave-ins. Additionally, the removal of the system shall follow the same requirement.
- 12. If the excavation exceeds 20 feet or if an alternative shoring, sloping, or benching system is utilized, a civil engineer currently registered in California shall prepare detailed plans showing the materials and methods to be utilized.
- 13. The detailed plans in #12 above, shall be available for inspection at the site.
- 14. Shoring shall be installed in accordance with Table 1-6 or as detailed in plans and specifications prepared by State registered civil engineer in accordance with the appropriate engineering criteria.
- 15. If protective shields (i.e. trench shields) are to be utilized for the protection of employees within an excavation, a civil engineer registered in California must prepare the necessary calculations and designs prior to the use of such equipment.

16. When sloping or benching are utilized in lieu of a shoring system, the slope shall be at least 3/4 horizontal to 1 vertical for excavations up to 8 feet, unless the instability of the soil requires a slope flatter than 3/4:1. For excavations greater than 8 but less than 12 feet, a slope of 1:1 shall be utilized.

APPENDIX L

Drilling Safety

PERSONAL PROTECTIVE EQUIPMENT

All workers at or near drilling operations require the use of personal protective equipment (PPE) to protect against injuries and potentially hazardous exposures. The following measures must be taken by workers at or near a drilling operation:

- PPE should (or must if company policy requires so) be worn at Level D drilling operations consisting or: hard hat (ANSI Z89.1 approved), steel toed and shank boots (ANSI Z41.1 approved), safety glasses (ANSI Z87.1 approved), close fitting gloves, close fitting clothing, and hearing protection (optional, but required in most cases due to high noise levels).
- PPE that must be worn during Level C, B, or A sites will include respiratory protection and chemical resistant clothing, gloves, and boots in addition to the equipment listed above. The specific requirements will be stated within the site specific site safety plan (SSP).
- Clothing worn at or around drilling operations must be close-fitting to prevent loose parts from catching on rotating or translating components of the drill rig. Rings and jewelry should not be worn because they may also get caught in drill-rig components.
- Drilling personnel must wear gloves to protect against cuts and abrasions that may occur while handling wires or cables. Gloves should also be worn to prevent contact with sharp edges and burrs on drill rods and other drilling or sampling tools.

HOUSEKEEPING DUTIES DURING DRILLING

The drill rig must be cleaned and properly maintained prior to the start of work operations. Tools used during drilling operations must be well lubricated. The on-site drilling supervisor is responsible for ensuring that the drill reg and the site are in proper order and ready for safe work conditions. He/she is responsible for ensuring that procedures are followed:

- All tools, materials, and supplies must be stored in a suitable location on the rig where they won't fall or hit workers during drilling operations.
- Tools, materials, or supplies should not be stored or transported within or on the mast (derrick) or the drill rig.
- All drilling materials such as pipe, drill rods, casing, augers, and similar drilling tools should be orderly stacked on racks or sills to prevent spreading, rolling or sliding.
- Driving hammers and other similar pieces of equipment must be placed at a safe location off the ground or be secured to prevent movement when not in use.
- All work areas, platforms, walkways, scaffolding and other access ways should be kept free of materials, debris, obstructions and substances such as ice, grease, or oil that could cause a surface to become slick or otherwise hazardous.
- Gasoline should not be stored in an approved storage container rated for gasoline.
- All controls, control linkages, warning and operational lights and lenses must be kept free from oil, grease, and/or ice.

MAINTENANCE SAFETY

Proper and routine maintenance of the drill rig well installation equipment allows for much safer drilling operations. The on-site drilling supervisor must ensure that his/her work crew adhere to the following proper maintenance procedures:

- The drill rig engine must be shut down prior to making repairs, adjustments, or lubrication. Precautions should be taken to prevent accidental starting of an engine during maintenance by removing or tagging the ignition key and following lockout/tagout procedures.
- The engine or the exhaust system of an engine should not be touched following its operation until the systems have had adequate time to cool.
- Prior to the performance of maintenance techniques, and when possible and appropriate, all pressure on the hydraulic systems, the drilling fluid systems and the air pressure systems of the rig should be released.
- Cutting or welding should not be performed on or near a fuel tank or other direct sources of flammable vapors.
- Gasoline or other volatile or flammable liquids must not be used as cleaning agents on or around the rig.
- All caps, filler plugs, protective pressure hose clamps, chains or cables should be replaced after maintenance has been conducted.
- Hook and heel jaws must be replaced when they become visible worn.
- All pipe wrenches must be kept clean and in good repair. If they are not cleaned frequently, the jaws could collect dust and grease and may cause slippage.
- When breaking tool joints on the ground or on a drilling platform, position hands such that fingers will not be smashed between the wrench handle and the ground or the platform. This precaution is necessary because the wrench could suddenly slip or the joint may suddenly let go.

OVERHEAD/BURIED UTILITIES

Before drilling on-site, it is necessary to contact the area utility locater to determine the location of all suspected utility lines on site. The use of a drill rig in the vicinity of electrical power lines, either overhead or buried, requires that special precautionary measures be taken by all involved in site work operations. Electricity can shock, burn, and cause death. It there are any questions concerning safety of drilling in the vicinity of power lines, contact the power company. They can provide expert advice at the drilling site as a public service and at no cost. For the safety of all working on-site, the following precautions must be adhered to:

- All located lines on-site should be noted and emphasized on all boring plans, location plans, and boring assignment plans.
- Consider all electrical wires to be alive and dangerous.
- Maintain at least 20 feet of clearance from overhead lines. The clearance can be reduced to 10 feet if the lines are padded. Do not attempt to raise the mast unless this distance is achieved. Additionally, do not attempt to move the rig until the mast is down.
- Insulate all the handles that are used to operate the rig. This should be done with rubber grips or heavy wrapping of electrical tape. This reduces the severity of the accident when gripping the controls.

CONTACT WITH ELECTRICITY

If a drill rig comes in contact with electrical wires, it may or may not be insulated from the ground by the tires or the carrier. If the human body simultaneously comes in contact with the drill rig and the ground, it will provide an conductor of the electricity to the ground. In this case, death or serious injury may result. If a rig or carrier comes in contact overhead or underground electrical lines, the following safety protocol should be adhered to:

- The victim in contact with the electrical lines must not attempt to touch any part of the equipment or attempt to enter or leave it. All other personnel on-site must be kept away from the rig.
- The victim in contact <u>must not</u> move or touch any part of the drill rig, particularly any metallic parts.
- Inform someone to call 9-1-1 and the local power company immediately.
- Under most circumstances, the operator and other personnel on the seat of the vehicle should remain seated and do not attempt to leave the vehicle. It it is determined that the drill rig should be vacated, then all personnel should jump clear and as far as possible from the rig. They should not step off, jump off, and should not hang on to the vehicle or any part of the rig while jumping.
- Rescuers <u>should not</u> attempt to touch any person who may be in contact with the electrical current.
- If the victim is not in contact with the electrical current and is unconscious, inform someone to contact 9-1-1 while a qualified persons begins CPR.

WIRE ROPE SAFETY

Rope which is worn or misused is one of the most potentially dangerous pieces of equipment on a drill rig. If a wire rope breaks, it is usually under the stress of a heavy load. As a result, it tends to "snap back" like a rubber band. To avoid this from occurring, the following precautionary measures should be taken:

- Inspect all wire ropes and fittings during use and at least once a week for wear, abrasion, broken wires, reduction in rope diameter, corrosion, damage from heat, improper reeving, jamming, crushing, kinking, core protrusion, and damage to lifting hardware. Wire ropes should be replaced when inspection indicates excessive damage.
- Manufactured end fittings and connections should be installed according to the manufacturer's instructions and loaded according to the manufacturer's specifications.
- When ball-bearing type hoisting swivels are used, swivel bearing should be inspected and lubricated daily to assure that the swivel freely rotates under load.
- When a rod slipping device is used to hoist drill rods, do not drill through or rotate drill rods through the slipping device, do not hoist more than 1 foot of the drill rod column with loose tool joints; do not make up, tighten or loosen tool joints while the rod column is being supported by a rod slipping device. If drill rods should slip back into the borehole, do not attempt to brake the fall of rods with your hands or by tensioning the slipping device.
- The number of parts of line on exploration drill rigs should never be increase without first consulting with the manufacturer of the drill rig.
- Each wire rope must be properly matched with each sheave.
- Use tool handling hoists for vertical lifting of tools only. Do not use tool handling hoist to pull on objects away form the drill rig. However, drills may be moved using the main hoist if the wire rope is spoiled through proper sheaves according to manufacturer's recommendations.

USE OF CATHEAD & ROPE HOISTS

During the use of a cathead hoist the following safety procedures should be adhered to on-site:

- The cathead should be kept clean and free from rust, oil, and/or grease.
- The cathead must be periodically checked when the engine is not running for rope wear grooves. Rope grooves should not form to a depth greater than 1/8 inch.
- Use dry, clean, sound rope at all times.
- If the rope "grabs" the cathead and becomes tangled in the drum, all personnel should stand back and stay clear form the area.
- Protect the rope from contact with all chemicals, since deterioration of the rope can sometimes be visibly undetectable.
- Do not wrap any rope, wire rope, or cable on the drilling rig or from the cathead around a hand or around any other body part.
- Maintain a minimum clearance of 18 inches between the operating hand and the cathead drum when driving samplers, casing or other tools with the cathead and rope method.
- Do not use a rope which is longer than necessary or more ropes than are required to hoist a load.
- Do not leave a cathead unattended with the rope wrapped on the drum.
- Position all other hoist lines to prevent contact with the operating cathead rope.
- When using the cathead and rope for driving or back-driving, make certain that all threaded connections are tight and stay as far away as possible from the hammer impact point.
- The cathead operator must be able to operate the cathead standing on a level surface with good, firm footing conditions and without distraction or disturbance.

SAFE USE OF AUGERS

When continuous flight or hollow-stem augers are used during drilling procedures, the following safety protocol should be followed:

- Prior to starting an auger boring, the clutch or hydraulic rotation control should be disengaged, and the transmission should be in low gear.
- An adequate amount of pressure should be applied prior to rotation to seat the auger head below the ground surface.
- Stay clear of the auger while engaging the clutch or rotation control.
- Keep one hand on the clutch or the rotation control at all times until the auger has penetrated about one foot or more below grade.
- If the auger head slides out of alignment, disengage the clutch or hydraulic rotation control and repeat the hole start8ing process.
- When securing the auger to the power coupling, use only the manufacturer's recommended methods.
- Use tool hoists whenever possible to handle auger sections.
- Never allow hands, fingers, feet, or other parts of the body to get below the auger sections and never reach behind or around a rotating auger.
- Long handled shovels should be used to move auger cuttings away from the auger.

ROTARY & CORE DRILLING SAFETY

Rotary drilling tools should be safety checked prior to drilling. A checklist should include:

- Lubricate all water swivels and hoisting plugs prior to use. Also, check for "frozen" bearings.
- Periodically check rod chucks jaws and replace when necessary.
- Check the capacities of hoists and sheaves against the anticipated weight to the drill rod string, and against other expected hoisting loads.

- When such tools or similar loads can not be raise with a hoist, disconnect the hoist line and connect the stuck tools directly to the feed mechanism of the drill.
- When attempting to pull out a mired down vehicle or drill reg carrier, use a winch on the front or rear of the vehicle and stay as far away as possible from the wire rope. Do not attempt to use tool hoists to pull out a mired down vehicle or drill rig carrier.
- Minimize shock of a wire rope by applying loads smoothly and steadily.
- Avoid sudden loading in cold weather, and never use ropes which are frozen.
- Protect wire rope from sharp corners and edges.
- Replace worn sheaves, worn sheave bearings, and damaged safety latches on safety hooks before using.
- Never exceed the limit of the safe working load of equipment.
- Periodically inspect and t4est the clutches and brakes of hoists.
- Do not exceed the rated capacity of hooks, rings, links, swivels, shackles and other lifting aids.
- When handling wire ropes, always wear gloves.
- When installing a new wire rope, allow it to adjust by lifting a light load first.
- Do not carry out hoisting operations when the weather conditions may be hazardous to personnel.
- Do not leave suspended loads in the air when the hoist is unattended.
- Never hoist the load over the head, body, or feet of personnel.
- Never use a hoist to "ride" up the mast of a drill rig.
- Wires which are replaced should conform to the drill rig manufacturer's specifications.