ANDMITICAL RESULTS REJECTS

RESULTS FROM
LAB.

WILLIAM LAB.

QUARTERLY GROUNDWATER MONITORING AND SAMPLING AT THE PROPERTY LOCATED AT 400 SAN PABLO AVENUE ALBANY, CALIFORNIA JUNE 3, 1999

PREPARED FOR:
MR. MURRAY STEVENS
KAMUR INDUSTRIES, INC.
2351 SHORELINE DRIVE
ALAMEDA, CALIFORNIA 94501

BY: ENVIRO SOIL TECH CONSULTANTS 131 TULLY ROAD SAN JOSE, CALIFORNIA 95111

## **LIST OF TABLES**

**TABLE 1** ... Groundwater Monitoring Data and Analytical Results

## **LIST OF FIGURES**

FIGURE 1 ... Site Vicinity Map showing 400 San Pablo Avenue, Albany, California

FIGURE 2 ... Site Plan showing Location of Buildings, Creek, Former UST Excavation Areas, Monitoring Wells and Groundwater Flow Direction

## LIST OF APPENDICES

APPENDIX "A" ... Table 1 and Table 2

APPENDIX "B" ... Figure 1 and Figure 2

APPENDIX "C" ... Standard Operating Procedures

**APPENDIX "D"** ... Laboratory Report and Chain-of-Custody Documentation

TABLE OF CONTENTS	Page Number
A FIRMED OF THE ANGLES	
LETTER OF TRANSMITTAL	1-2
PURPOSE	3
SITE DESCRIPTION	3
BACKGROUND	
SITE HISTORY	3-4
SITE INVESTIGATION	4-6
SUMMARY OF RESULTS OF PREVISOU INVESTIGATION	ON 6
SCOPE OF PRESENT WORKS	7
FIELD ACTIVITIES	7
GROUNDWATER MONITORING	8
GROUNDWATER SAMPLING	8
GROUNDWATER FLOW DIRECTION	9
ANALYTICAL RESULTS	9
DISCUSSION	10
LIMITATIONS	10
APPENDIX "A"	
TABLE 1 - GROUNDWATER MONITORING DATA AND ANALYTICAL RESULTS	T1- <b>T</b> 10
APPENDIX "B"	
FIGURE 1 - VICINITY MAP	M1
FIGURE 2 - SITE MAP	M2

TABLE OF CONTENTS CONT'D

Page Number

APPENDIX "C"

GROUNDWATER SAMPLING

SOP1

APPENDIX "D"

PRIORITY ENVIRONMENTAL LABS REPORT & CHAIN-OF-CUSTODY



Environmental & Geotechnical Consultants

131 TULLY ROAD, SAN JOSE, CALIFORNIA 95111

Tel: (408) 297-1500 Fax: (408) 292-2116

June 3, 1999

File No. 8-90-421-SI

Mr. Murray Stevens Kamur Industries, Inc. 2351 Shoreline Drive Alameda, California 94501

## SUBJECT: QUARTERLY GROUNDWATER MONITORING AND SAMPLING AT THE PROPERTY

Located at 400 San Pablo Avenue, in Albany, California

Dear Mr. Stevens:

This report summarizes the results of quarterly groundwater monitoring and sampling conducted by Enviro Soil Tech Consultants (ESTC), on April 12, 1999, at the subject site (Figure 1).

Seven monitoring wells (STMW-1 through STMW-5, MW-2 and MW-3) located on- and off-site were monitored for presence of floating products and/or any distinctive odor. Groundwater samples were collected from these monitoring wells and submitted to state-certified laboratory for analyses.

Per your request, this report will be submitted to Alameda County Health Care Services Agency-Department of Environmental Health (ACHCSA-DEH).

Should you have any questions or require additional information, please feel free to contact our office at (408) 297-1500.

Sincerely,

ENVIRO SOIL TECH CONSULTANTS

FRANK HAMEDI-FARD

GENERAL MANAGER

LAWRENCE KOO, P. E.

C. E. #34928

#### **PURPOSE:**

The purpose of this quarterly monitoring and sampling investigation was to determine the direction of groundwater flow and the extent of subsurface hydrocarbons contamination at the site.

### SITE DESCRIPTION:

The site is located at 400 San Pablo Avenue, in Albany, California, approximately one mile east of San Francisco Bay (Figure 1). The site is bordered by El Cerrito Creek to the north, San Pablo Avenue to the east and Adams Street to the west. The surrounding area comprises primarily light commercial and residential buildings (Figure 2).

#### BACKGROUND:

### SITE HISTORY:

The site was vacant until the late 1950's when Plaza Car Wash and the adjacent Norge Dry Cleaner buildings were constructed. The three underground fuel storage tanks were installed on the site in 1970.

Observation of petroleum free-floating product in the adjacent El Cerrito Creek, on July 3, 1989, prompted the Albany Fire Department to install absorbent materials and a boom as a temporary containment measure. A storm drain, which borders the site on the west, was found to be the source of petroleum products discharged into El Cerrito Creek.

The inventory reconciliation records for Plaza Car Wash, reviewed by Kamur Industries in July 1989, showed discrepancies in the unleaded gasoline inventory. A product line test, conducted in mid-July 1989, confirmed a small leak in the unleaded gasoline fuel lines beneath the pump island. The leak was repaired and approximately five to ten cubic yards of gasoline contaminated soil was removed from beneath the line. Analytical results of a composite sample of the excavated soil revealed Total Petroleum Hydrocarbon (TPH) concentration of 7,500 parts per million (ppm).

#### SITE INVESTIGATION:

Subsurface Consultants, Inc. (SCI) was retained by Kamur Industries to perform a site assessment. In August 1989, SCI drilled five soil borings and obtained soil samples for laboratory analysis. Four of the soil borings were converted to monitoring wells. Laboratory analysis showed the presence of gasoline contaminants in all soil and groundwater samples.

Per California Regional Water Quality Control Board (CRWQCB) staff request, water samples were also obtained from El Cerrito Creek and the storm drain outlet on August 3, 1989. Laboratory analysis revealed high levels of dissolved hydrocarbons at the storm drain outlet and low levels approximately 20 feet down-stream.

A soil vapor study (SVS), conducted by SCI in the area of the Plaza Car Wash and adjacent properties, revealed the presence of hydrocarbon contamination in the soil.

On September 19, 1989, Pacific Pipeline Survey conducted a video inspection of the Adams Street storm drain. The inspection revealed excess concrete along the pipe bottom, a bent area across the pipe section and large cracks in the pipe. The bent area was considered to be the most likely location for petroleum products to enter the storm drain pipe and eventually discharge into El Cerrito Creek.

Storm drain pipe joints exposed during sump installation procedures were sealed with mortar. All excavated soils found to be contaminated (when screened with organic vapor analyzer) were removed and stored on-site pending proper disposal. Stockpiled soils from the product line repair and sump installation areas were treated on-site and transported to the West Contra Costa Sanitary Landfill for disposal.

In December 1989, Kamur industries retained International Technology Environmental Services (ITES) to conduct monitoring and sampling of on-site monitoring wells, the Adams Street sump and El Cerrito Creek. Monitoring and sampling was conducted on a monthly basis from December 1989 through May 1990. All on-site wells showed high levels of dissolved hydrocarbons, and one well showed traces of floating product. The sump also indicated high levels of dissolved hydrocarbons. The El Cerrito Creek samples, taken after each significant rainstorm, showed non-detectable levels in the upstream station; the storm drain outlet samples showed moderate levels of dissolved hydrocarbons and the down-stream station showed fairly low to non-detectable levels.

In September 1990, Kamur Industries, Inc. retained Alpha Geo Services, Inc. (AGS) and STE to remove three underground tanks, conduct soil sampling and excavate, characterize and dispose of contaminated soil. In addition, STE conducted water sampling of El Cerrito Creek during rainy months per Regional Water Quality control Board (RWQCB) requirements and installed additional monitoring wells as requested by Alameda County Health Department (ACHD).

The details of tank removal, soil sampling and excavation of contaminated soil are described in AGS and STE reports titled "Removal of 3 Underground Storage Tanks" dated January 9, 1991 and "Underground Tank Soil Sampling and Excavation Report" dated January 15, 1991. The report on soil treatment and disposal is included in STE's report titled "Report on Soil Remediation at the Plaza Car Wash" dated May 13, 1991.

In February 1991, STE installed two on-site monitoring wells (STMW-1 and STMW-2). In addition, the on-site wells MW-1 and MW-4 were abandoned during soil excavation of the former underground tank area. The investigation detected no free-floating product in the wells. Dissolved hydrocarbons were detected in all on-site and off-site wells. The details of this subsurface investigation are described in STE's report titled "Report of Supplemental Subsurface Investigation for Kamur Industries, Inc. at the Plaza Car Wash" dated May 14, 1991.

### SUMMARY OF RESULTS OF PREVIOUS INVESTIGATION:

The soil material beneath the site consists of an irregular layer of clayey silt and sandy clay with some lenses of gravel.

Results of previous subsurface investigation indicated that the shallow groundwater at the site is impacted with the dissolved petroleum hydrocarbons; namely TPHg and BTEX. Dissolved hydrocarbons in groundwater are yet to be delineated off-site northeast and west of the site.

Groundwater was encountered at the site at an average depth of 5 to 6.5 feet below grade. The direction of groundwater flow was approximately north to northwest. The groundwater appears to be in unconfined condition. The highest concentration of dissolved TPHg was detected in groundwater from the northern and eastern part of the site.

### **SCOPE OF PRESENT WORKS:**

During this quarter's reporting period, the following scope of present works were performed:

- Monitored depth-to-static groundwater for monitoring wells STMW-1 through STMW-5, MW-2 and MW-3.
- Purged monitoring wells (STMW-1 through STMW-5, MW-2 and MW-3) prior to sampling.
- Submitted water samples to a state-certified laboratory to be analyzed for Total Petroleum Hydrocarbons as gasoline (TPHg), Benzene, Toluene, Ethylbenzene, Total Xylenes (BTEX) and Methyl Tertiary Butyl Ether (MTBE).
- Reviewed results and prepared a report of the investigation.

### FIELD ACTIVITIES:

The seven monitoring wells (STMW-1 through STMW-5, MW-2 and MW-3) were monitored for presence of floating product(s) and/or any distinctive odor. Groundwater samples were collected and submitted to state-certified laboratory for analysis of TPHg, BTEX and MTBE.

#### GROUNDATER MONITORING:

On April 12, 1999, ESTC's staff monitored the seven wells to measure water depth and check for the presence of sheen and/or odor. No sheen or odor were detected in monitoring wells STMW-3, STMW-4 and MW-2. Rainbow sheen and strong petroleum odor were noted in monitoring wells STMW-1 and STMW-2. Light sewerage odor was noted in monitoring well STMW-5. Strong sewerage odor was noted in monitoring well MW-3.

The static shallow groundwater levels ranged from 4.62 feet to 7.16 feet below ground surface during the recent quarterly sampling event. Table 1 summarizes the depth-to-groundwater and observations made.

### GROUNDWATER SAMPLING:

Following groundwater monitoring, the wells were purged at least four to five well volumes and sampled in accordance with ESTC's Standard Operation Procedure (SOP) (Appendix "C"), which follows State and Local guidelines for sampling and monitoring wells.

A stainless steel bailer was used for sample collection. Water sampling equipments were decontaminated before and after each well sampling, using Tri-sodium Phosphate (TSP) and water wash, followed by double rinsing. Groundwater samples were contained in 40 millimeter glass vials with Teflon-lined caps, labeled and placed in an ice-cooled chest for transportation to a state-certified laboratory with proper chain-of-custody record.

### GROUNDWATER FLOW DIRECTION:

Water elevation data were used to determine groundwater direction. Table 1 summarizes the groundwater elevations. The groundwater flow beneath the site was in a northeasterly direction as of April 12, 1999 (Figure 1).

### **ANALYTICAL RESULTS:**

Groundwater samples from the seven monitoring wells were analyzed for TPHg, BTEX and MTBE concentrations.

Water sample from monitoring well STMW-1 detected low levels of TPHg concentration at 2.8 milligrams per liter (mg/L) and BTEX at (0.023 mg/L; 0.019 mg/L; 0.029 mg/L and 0.054 mg/L). Water sample from monitoring well STMW-2 detected low levels TPHg at 1.5 mg/L and BTEX at (0.019 mg/L; 0.012 mg/L; 0.021 mg/L and 0.037 mg/L), respectively. Groundwater samples from monitoring wells STMW-3, STMW-4, STMW-5, MW-2 and MW-3 detected TPHg and BTEX concentrations below laboratory detection limit. All seven monitoring wells detected MTBE concentrations below laboratory detection limit.

Laboratory analytical results are summarized in Table 1. Chain-of-custody documentation and certified laboratory reports are included in Appendix "D".

#### **DISCUSSION:**

A comparison of the recent analytical results, with results from the previous quarter (January 12, 1998), indicates a decrease of TPHg and BTEX concentrations in monitoring wells STMW-1, STMW-2 and MW-3. Monitoring wells STMW-3, STMW-4. STMW-5 and MW-2 continue to detected TPHg and BTEX below laboratory detection limit. MTBE concentrations still remain below laboratory detection limit in all seven monitoring wells.

#### LIMITATIONS:

This report and the associated work have been provided in accordance with the general principles and practices currently employed in the environmental consulting profession. The contents of this report reflect the conditions of the site at this particular time. The findings of this report are based on:

- 1) The observations of field personnel.
- 2) The results of laboratory analyses performed by a state-certified laboratory.

It is possible that variations in the soil and groundwater could exist beyond the points explored in this investigation. Also, changes in groundwater conditions of a property can occur with the passage of time due to variations in rainfall, temperature, regional water usage and other natural processes or the works of man on this property or adjacent properties.

The services that ESTC provided have been in accordance with generally accepted environmental professional practices for the nature and conditions of the work completed in the same or similar localities, at the time the work was performed.

## APPENDIX "A"

TABLE 1
GROUNDWATER MONITORING DATA (feet)
AND ANALYTICAL RESULTS (mg/L)

Date	Well No./ Elevation	Depth of Well	Depth to Perf.	Depth to Water	GW Elev.	Well Observation	TPHg	В	T	E	X	МТВЕ	VOCs
12/10/92	STMW-1 (100.62)	14	4	6.61	94.01	Light sheen Mild petroleum odor	35	0.054	0.079	0.083	0.22	NA	ÑA
3/18/93				6.68	93.94	Light rainbow sheen Mild petroleum odor	19	0.049	0.052	0.055	0.18	NA	NA
7/13/93				7.13	93.49	NMFP Strong petroleum odor	17	0.034	0.043	0.017	NA	NA	NA
10/11/93				7.26	93.36	NMFP Strong petroleum odor	51	2.1	2.4	0.53	2.6	NA	NA
1/07/94				7.15	93.47	NMFP Strong petroleum odor	29	1.5	1.6	0.45	2.5	NA	NA
4/06/94				7.10	93.52	NMFP Strong petroleum odor	20	1.1	0.56	0.30	1.6	NA	NA
8/03/94				5.70	94.92	NMFP Strong petroleum odor	43	1.0	1.7	0.64	4.7	NA	NA
11/08/94				6.47	94.15	Brown NMFP Strong petroleum odor	92	9.0	12.0	1.6	9.1	NA	NA
2/16/95				6.96	93.66	Rainbow sheen/NMFP Strong petroleum odor	150	0.85	0.54	0.40	1.2	NA	NA
5/19/95				6.84	93.78	Brown NMFP Strong petroleum odor	59	0.4	0.33	0.17	0.61	NA	NA
8/18/95	(96.81) resurveyed			4.64	92.17	Brown NMFP Strong petroleum odor	300	0.88	0.78	0.54	1.7	NA	NA
11/30/95				7.34	89.47	Thick brown sheen spots/Mild petroleum odor	67	0.8	0.91	0.39	1.5	NA	NA

Date	Well No./ Elevation	Depth of Well	Depth to Perf.	Depth to Water	GW Elev.	Well Observation	ТРНд	В	Т	E	X	MTBE	VOCs
2/29/96	STMW-1 (96.81)	14	4	7.83	88.98	NMFP Strong petroleum odor	71	0.12	0.095	0.018	0.26	NA	ND
6/07/96				7.10	89.71	NMFP Strong petroleum odor	36	0.21	0.14	0.081	0.21	NA	ND
11/14/96				7.29	89.52	Brown NMFP Mild petroleum odor	140	0.48	0.49	0.42	1.2	ND	NA
2/12/97				6.96	89.85	Rainbow sheen spots Strong petroleum odor	42	0.21	0.19	0.06	0.19	ND	NA
5/15/97				7.33	89.48	Brown sheen spots Mild petroleum odor	15	0.083	0.027	0.045	0.13	NA	NA
8/27/97				7.46	89.35	NMFP Strong petroleum odor	82	0.11	0.052	0.066	0.4	ND	NA
12/24/97				6.94	89.87	Rainbow sheen Strong petroleum odor	3.7	0.043	0.018	0.0091	0.025	ND	NA
3/24/98				6.36	90.45	Rainbow sheen Strong petroleum odor	10	0.065	0.068	0.009	0.12	ND	NA
6/25/98				6.94	89.87	Rainbow sheen Strong petroleum odor	0.57	0.0019	0.0006	0.0013	0.0071	ND	NA
10/12/98				7.18	89.63	Rainbow sheen Strong petroleum odor	1	0.0024	0.0021	0.0032	0.0069	ND	NA
1/12/99				6.68	90.13	Rainbow sheen Strong petroleum odor	6.4	0.039	0.021	0.032	0.083	ND	ND
4/12/99				7.16	89.65	Rainbow sheen Strong petroleum odor	2.8	0.023	0.019	0.029	0.054	ND	NA

Date	Well No./ Elevation	Depth of Well	Depth to Perf.	Depth to Water	GW Elev.	Well Observation	TPHg	В	Т	E	X	МТВЕ	VOCs
12/10/92	STMW-2 (100.63)	14	4	6.39	94.24	Light rainbow sheen Mild petroleum odor	44	0.084	0.096	0.12	0.35	NA	NA
3/18/93				6.50	94.13	Light Rainbow sheen Mild petroleum odor	9.2	0.022	0.031	0.04	0.11	NA	NA
7/13/93				6.95	93.10	No sheen Light sewerage odor	9.3	0.018	0.024	0.026	0.089	NA	NA
10/11/93				7.09	93.54	NMFP Strong petroleum odor	62	2.8	3.9	0.67	4.4	NA	NA
1/07/94				6.93	93.70	Rainbow sheen Mild petroleum odor	22	1.1	1	0.28	1.8	NA	NA
4/06/94				6.84	93.79	NMFP Strong petroleum odor	6.6	0.49	0.14	0.33	0.062	NA	NA
8/03/94				7.10	93.53	NMFP Mild petroleum odor	4	0.25	0.052	0.055	0.24	NA	NA
11/08/94				6.19	94.44	Brown NMFP Strong petroleum odor	10	0.73	0.79	0.2	13	NA	NA
2/16/95	STMW-2 (96.79) Resurveyed			6.72	93.91	Rainbow sheen/NMFP Strong petroleum odor	37	0.23	0.088	0.092	0.32	NA	NA
5/19/95				6.61	94.02	Brown sheen spots Light petroleum odor	9.3	0.04	0.016	0.022	0.068	NA	NA
8/18/95				7.09	89.70	Brown NMFP Light petroleum odor	210	0.72	0.55	0.52	1.4	NA	NA

Date	Well No./ Elevation	Depth of Well	Depth to Perf.	Depth to Water	GW Elev.	Well Observation	ТРНд	В	Т	E	X	МТВЕ	VOCs
11/30/95	STMW-2 (96.79)	14	4	7.07	89.72	Rainbow sheen spots Light petroleum odor	66	0.66	0.51	0.37	1.5	NA	NA
2/29/96				7.57	89.22	Rainbow sheen Light petroleum	33	0.075	0.055	0.052	0.15	NA	ND
6/07/96				6.74	90.05	Rainbow sheen Light petroleum odor	92	0.25	0.075	0.018	0.47	NA	ND
11/14/96				6.96	89.83	Rainbow sheen spots Light petroleum odor	39	0.38	0.23	0.27	0.72	ND	NA
-2/12/97				6.71	90.08	Rainbow sheen spots Mild petroleum odor	23	0.11	0.028	0.048	0.14	ND	NA
5/15/97				7.06	89.73	Light rainbow sheen spots/Very light petroleum odor	30	0.32	0.048	0.094	0.2	NA	NA
8/27/97				7.20	89.59	No sheen/Very light petroleum odor	19	0.082	0.0091	0.018	0.027	ND	NA
12/24/97				6.72	90.07	Rainbow sheen Strong petroleum odor	4.1	0.077	0.0089	0.015	0.034	ND	NA
3/24/98				6.10	90.69	Rainbow Sheen Strong petroleum odor	3.3	0.031	0.0042	0.016	0.026	ND	NA
6/25/98				5.52	91.27	Rainbow sheen Light petroleum odor	2.2	0.02	0.0054	0.012	0.021	ND	NA
10/12/98				6.92	89.87	Rainbow sheen Light petroleum odor	ND	ND	ND	ND	ND	ND	NA

Date	Well No./ Elevation	Depth of Well	Depth to Perf.	Depth to Water	GW Elev.	Well Observation	ТРНд	В	T	E	X	MTBE	VOCs
1/12/99	STMW-2 (96.79)	14	4	6.90	89.89	Rainbow sheen Strong petroleum odor	4.5	0.024	0.014	0.015	0.049	ND	ND
4/12/99				6.98	89.81	Rainbow sheen Strong petroleum odor	1.5	0.019	0.012	0.021	0.037	ND	NA
11/18/96	STMW-3 (95.24)	15	2.5	5.34	89.90	No sheen or odor	0.24	0.0091	0.0028	0.0047	0.013	ND	ND
2/12/97	_			5.14	90.10	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
5/15/97				5.42	89.82	No sheen or odor	ND	ND	ND	ND	ND	NA	NA
8/27/97	····			5.58	89.66	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
12/24/97				5.14	90.10	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
3/24/98				4.54	90.70	No sheen or odor	13	0.087	0.023	0.08	0.13	ND	NA
6/25/98				5.06	90.18	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
10/12/98				5.3	89.94	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
1/12/99				5.04	90.20	No sheen or odor	ND	ND	ND	ND	ND	ND	ND
4/12/99				5.28	89.97	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
11/14/96	STMW-4 (94.41)	15	2	4.67	89.74	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
2/12/97				4.45	89.96	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
5/15/97				4.75	89.66	No sheen or odor	ND	ND	ND	ND	ND	ND	NA

Date	Well No./ Elevation	Depth of Well	Depth to Perf.	Depth to Water	GW Elev.	Well Observation	ТРНд	В	Т	E	X	MTBE	VOCs
8/27/97	STMW-4 (94.41)	15	2	4.87	89.54	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
12/24/97				4.44	89.97	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
3/24/98			-	3.88	90.53	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
6/25/98				4.40	90.01	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
10/12/98				4.68	89.73	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
1/12/99				4.38	90.03	No sheen or odor	ND	ND	ND	ND	ND	ND	ND
4/12/99				4.62	89.79	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
11/14/96	STMW-5 (94.49)	15	2	5.20	89.29	No sheen or odor	ND	ND	ND	ND	ND	ND	ND
2/12/97				4.99	89.50	No sheen or odor	ND	ND	ND	ND	ND	ND	ND
5/15/97		-		5.30	89.19	No sheen or odor	ND	ND	ND	ND	ND	NA NA	NA NA
8/27/97				5.33	89.16	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
12/24/97				4.94	89.55	No sheen or odor	ND	ND	ND	ND	ND	ND	ND
3/24/98				4.52	89.97	No sheen Slight sewerage odor	ND	ND	ND	ND	ND	ND	ND
6/25/98	<u> </u>			5.00	89.49	No sheen or odor	ND	ND	ND	ND	ND	ND	ND
10/12/98				5.18	89.31	No sheen or odor	ND	ND	ND	ND	ND	ND	ND
1/12/99				5.02	89.47	No sheen or odor	ND	ND	ND	ND	ND	ND	ND

Date	Well No./ Elevation	Depth of Well	Depth to Perf.	Depth to Water	GW Elev.	Well Observation	TPHg	В	Т	E	X	MTBE	VOCs
4/12/99	STMW-5 (94.49)	15	2	5.38	89.11	No sheen Light sewerage odor	ND	ND	ND	ND	ND	ND	NA
12/10/92	MW-2 (99.39)	11.50	5	4.94	94.45	No sheen Mild petroleum odor	7.2	0.015	0.023	0.032	0.082	NA	NA
3/18/93				5.11	94.28	No sheen Light sewerage odor	1.4	0.0083	0.011	0.013	0.048	NA	NA
7/13/93				5.53	93.86	Rainbow sheen Light petroleum odor	2.4	0.0047	0.0062	0.0068	0.025	NA	NA
:10/11/93				5.64	93.75	No sheen or odor	0.41	0.043	0.0026	0.0045	0.012	NA	NA .
1/07/94	·			5.52	93.87	No sheen or odor	0.24	0.025	0.0031	ND	0.02	NA	NA
4/06/94				5.82	93.57	No sheen or odor	3	0.12	0.023	0.022	0.19	NA	NA
8/03/94				7.47	91.92	No sheen or odor	0.5	0.057	0.001	0.017	0.025	NA	NA
11/08/94				4.69	94.70	No sheen or odor	8	0.65	0.085	0.5	1	NA	NA
2/16/95				5.31	94.08	No sheen or odor	0.66	0.0064	0.001	0.0056	0.0089	NA	NA
5/19/95				5.17	94.22	No sheen Mild sewerage odor	1.9	0.11	0.01	0.023	0.026	NA	NA
8/18/95	(95.22) Resurveyed			5.65	89.57	No sheen Light sewerage odor	1.8	0.015	0.0016	0.015	0.02	NA	NA
11/30/95				5.64	89.58	No sheen or odor	0.12	0.0093	ND	0.0005	0.0035	NA	NA NA
2/29/96				4.61	90.61	No sheen Light sewerage odor	1.2	0.0061	0.0012	0.0062	0.0087	NA	ND

Date	Well No./ Elevation	Depth of Well	Depth to	Depth to Water	GW Elev.	Well Observation	TPHg	В	Т	E	X	MTBE	VOCs
6/07/96	MW-2 (95.22)	11.50	5	5.37	89.85	No sheen or odor	ND	ND	ND	ND	ND	NA	ND
11/14/96				5.55	89.67	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
2/12/97				5.14	90.08	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
5/15/97				5.63	89.59	No sheen or odor	ND	ND	ND	ND	ND	NA	NA
8/27/97				5.73	89.49	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
12/27/97				5.30	89.91	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
3/24/98				4.76	90.46	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
6/25/98				5.28	89.94	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
10/12/98				5.28	89.94	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
1/12/99				5.28	89.94	No sheen or odor	ND	ND	ND	ND	ND	ND	ND
4/12/99				5.54	89.68	No sheen or odor	ND	ND	ND	ND	ND	ND	NA
12/10/92	MW-3 (100.09)	12	5	4.42	95.67	Light sheen Strong pet. odor	94	0.4	0.41	0.43	1.1	NA	NA
3/18/93				5.39	94.70	Thick NMFP Mild petroleum odor	51	0.092	0.13	0.16	0.59	NA	NA
7/13/93				6.07	94.02	L. rainbow sheen spots Strong petroleum odor	80	0.16	0.21	0.23	0.82	NA	NA
10/11/93				6.34	93.75	NMFP Strong petroleum odor	180	14	8.8	0.32	9.4	NA	NA

Date	Well No./ Elevation	Depth of Well	Depth to Perf.	Depth to Water	GW Elev.	Well Observation	TPHg	В	T	E	X	MTBE	VOCs
1/07/94	MW-3 (100.19)	12	5	6.34	93.75	NMFP Strong petroleum odor	120	9.5	4.6	7.8	0.23	NA	NA
4/06/94				6.14	93.95	No sheen or odor	3,0	0.12	0.023	0.022	0.19	NA	NA
8/3/94				6.34	93.75	Few sheen spots Mild petroleum odor	0.2	6.5	5.7	1.5	18	NA	NA
11/08/94				3.89	96.20	Brown NMFP Strong petroleum odor	86	7.4	8.5	2.2	12.0	NA	NA
2/16/95				5.90	94.19	Brown NMFP Strong petroleum odor	59	0.28	0.12	0.12	0.57	NA	NA
5/19/95				4.15	95.94	Brown NMFP Strong petroleum odor	12	0.15	0.068	0.069	0.16	NA	NA
8/18/95	(95.62) Resurveyed			6.08	89.54	Brown NMFP Mild petroleum odor	33	0.074	0.028	0.038	0.1	NA	NA
11/30/95				6.26	89.36	Rainbow sheen spots Light petroleum odor	100	1.3	0.51	0.25	2.4	NA	NA
2/29/96				4.37	91.25	Rainbow sheen spots Mild petroleum odor	15	0.012	0.0038	0.01	0.024	NA	Det.
6/07/96				5.90	89.72	Rainbow sheen spots Mild petroleum odor	5.2	0.023	0.0069	0.014	0.034	NA	Det.
11/14/96				6.14	89,48	Rainbow sheen Light petroleum odor	33	0.32	0.13	0.25	0.62	ND	ND
2/12/97			*	4.45	91.17	No sheen or odor	15	0.043	0.009	0.02	0.041	ND ND	ND
5/15/97	,,,,,,			5.77	89.85	No sheen or odor	15	0.068	0.03	0.06	0.11	NA	ND
8/27/97				5.98	89.64	No sheen Mild sewerage odor	15	0.022	0.052	0.0097	0.018	ND	ND

Date	Well No./ Elevation	Depth of Well	Depth to Perf.	Depth to Water	GW Elev.	Well Observation	TPHg	В	Т	E	X	MTBE	VOCs
12/24/97	MW-3 (95.62)	12	5	5.70	89.92	Rainbow sheen Strong petroteum odor	15	.15	0.01	0.081	0.11	ND	ND
3/24/98				5.06	90.56	No sheen or odor	15	0.15	0.01	0.081	0.11	ND	ND
6/25/98				5.66	89.96	Light sheen spots Light sewerage odor	23	0.1	0.022	0.086	0.13	ND	ND
10/12/98				5.18	90.44	Rainbow sheen Light petroleum odor	23	0.026	0.021	0.48	0.1	ND	ND
1/12/99				5.42	90.20	Rainbow sheen Sewerage odor	7.2	0.048	0.032	0.044	0.099	ND	ND
4/12/99				6.02	89.60	No sheen Strong sewerage odor	ND	ND	ND	ND	ND	ND	NA

TPHg - Total Petroleum Hydrocarbons as gasoline

VOC's - Volatile Organic Compounds

NMFP - Non-Measurable Floating Product

Perf. - Perforation

ND - Not Detected (Below Laboratory Detection Limit)

MTBE - Methyl Tertiary Butyl Ether

BTEX - Benzene, Toluene, Ethylbenzene, Total Xylenes

GW Elev. - Groundwater Elevation

Det. - Detected

NA - Not Analyzed

## APPENDIX "B"


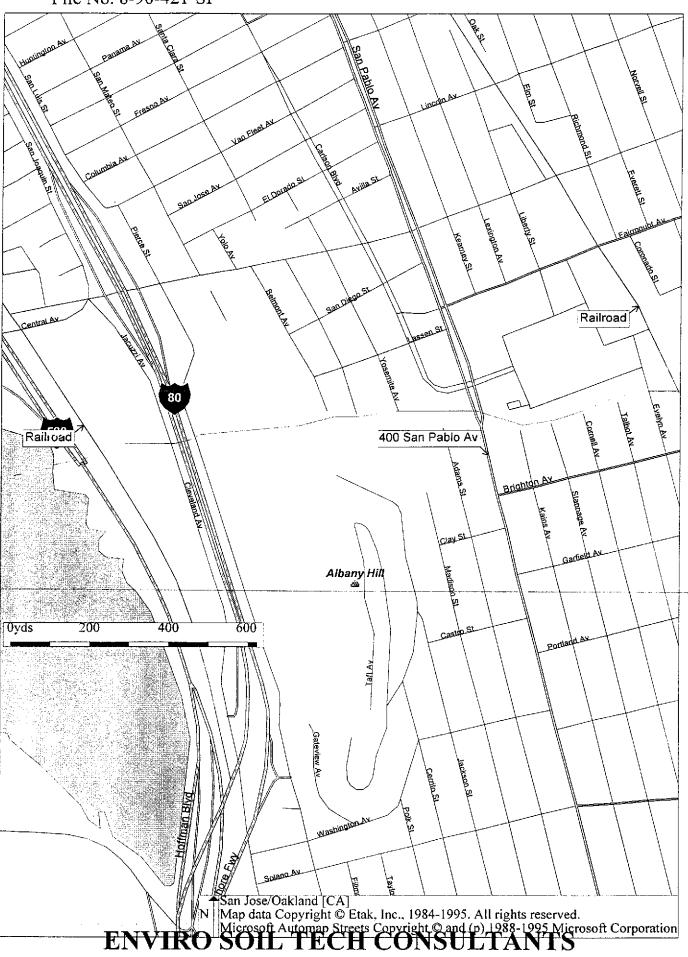


Figure 1

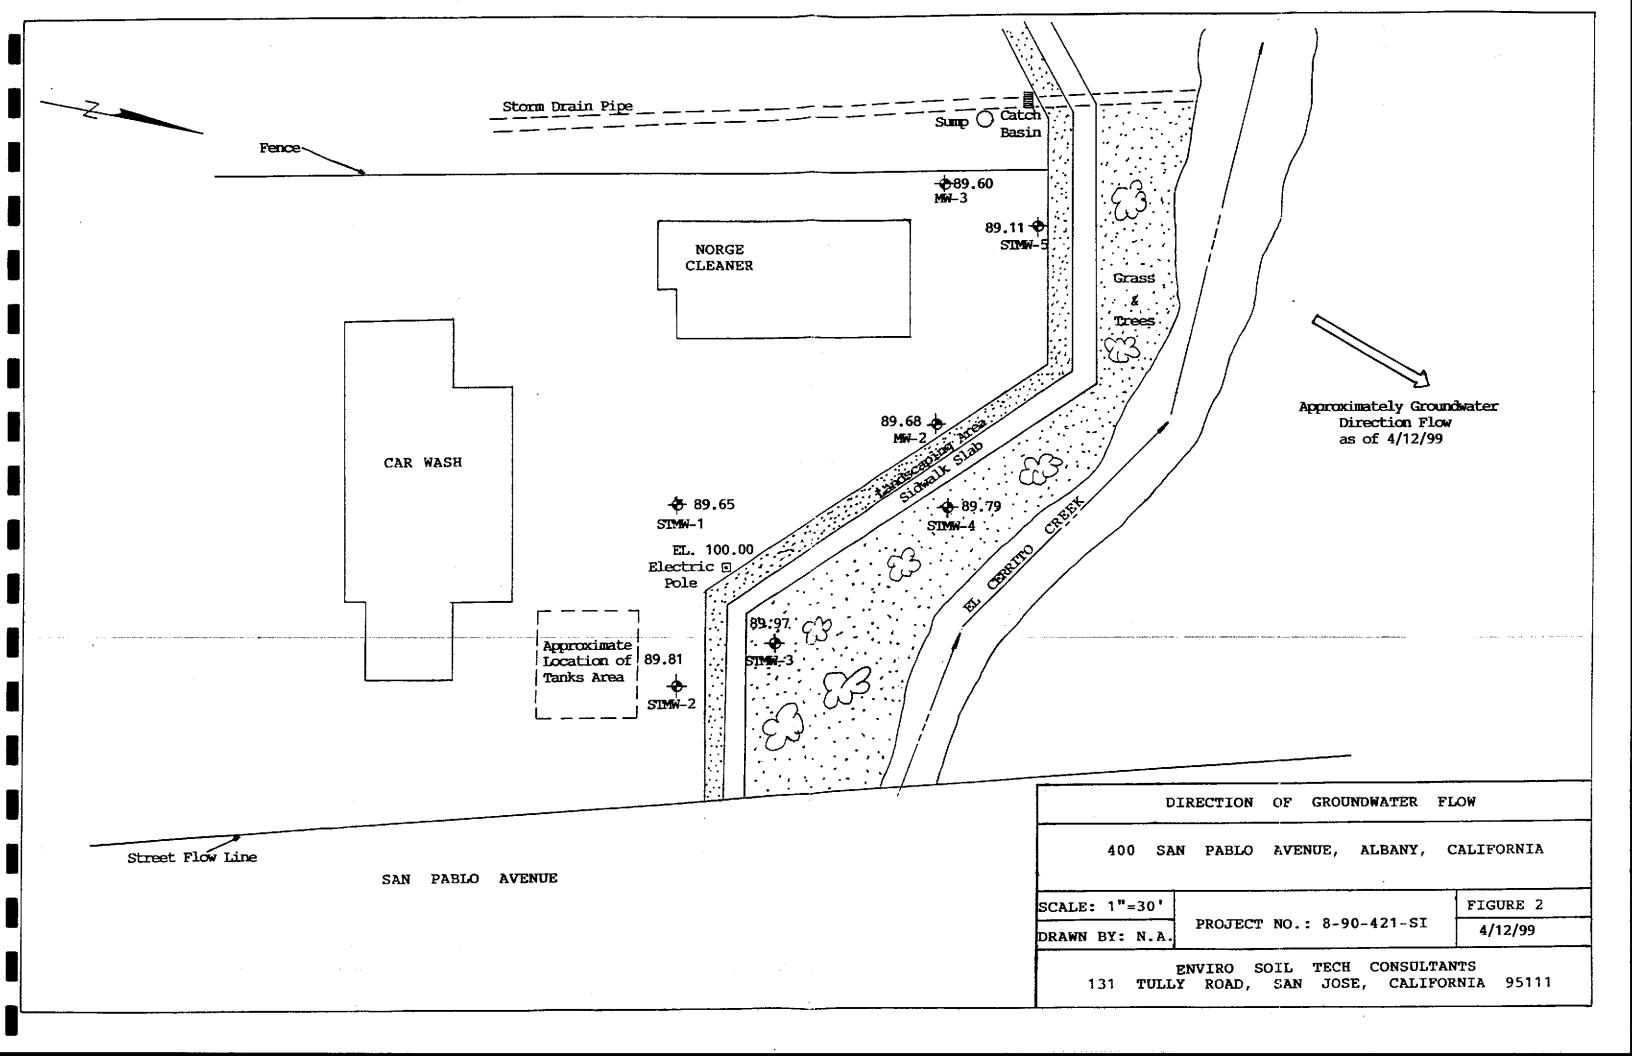

## APPENDIX "C"

### **GROUNDWATER SAMPLING**

Prior to collection of groundwater samples, all of the sampling equipment (i.e. bailer, cables, bladder pump, discharge lines and etc.) was cleaned by pumping TSP water solution followed by distilled water.

Prior to purging, the well "Water Sampling Field Survey Forms" were filled out (depth to water and total depth of water column were measured and recorded). The well was then bailed or pumped to remove four to ten well volumes or until the discharged water temperature, conductivity and pH stabilized. "Stabilized" is defined as three consecutive readings within 15% of one another.

The groundwater sample was collected when the water level in the well recovered to 80% of its static level.

Forty milliliter (ml.), glass volatile organic analysis (VOA) vials with Teflon septa were used as sample containers. The groundwater sample was decanted into each VOA vial in such a manner that there was a meniscus at the top. The cap was quickly placed over the top of the vial and securely tightened. The VOA vial was then inverted and tapped to see if air bubbles were present. If none were present, the sample was labeled and refrigerated for delivery under chain-of-custody to the laboratory. The label information would include a sample identification number, job identification number, date, time, type of analysis requested, and the sampler's name.

## APPENDIX "D"



## PRIORITY ENVIRONMENTAL LABS

Commence of Analytical Court of the

April 18, 1999

PEL # 9905013

SOIL TECH ENGINEERING

Attn: Frank Hamedi

Re: Seven water samples for Gasoline/BTEX with MTBE analyses.

Project number: 8-90-421-SI

Date sampled: Apr 12, 1999

Date extracted: Apr 13-14, 1999

Date analyzed: Apr 13-14, 1999

#### RESULTS:

SAMPLE I.D.	MTBE	Gasoline	Benzene	Toluene	Ethyl Benzene	Total Xylene
	(ug/L)	(ug/L)	(ug/L)	(ug/L)	(ug/L)	(ug/L)
STMW-1	N.D.	2800	23	19	29	54
STMW-2	N.D.	1500	19	12	21	37
STMW-3	N.D.	N.D.	N.D.	N.D.	N.D.	N.D.
STMW-4	N.D.	N.D.	N.D.	N.D.	N.D.	N.D.
STMW-5	N.D.	N.D.	N.D.	N.D.	N.D.	N.D.
MW-2	N.D.	N.D.	N.D.	N.D.	N.D.	N.D.
MW-3	N.D.	N.D.	N.D.	N.D.	N.D.	N.D.
Blank	N.D.	N.D.	N.D.	N.D.	N.D.	N.D.
Spiked Recovery		93.8%	89.2%	91.0%	83.3%	97.6%
Detection limit	0.5	50	0.5	0.5	0.5	0.5
Method of Analysis	602	5030/ 8015	602	602	602	602

David Duong Laboratory Director

1764 Houret Court Milpitas, CA. 95035

Tel: 408-946-9636

Fax: 408-946-9663

PROJ. (	NO. (1)	1.5	NA Sur	ME +; /	31. yardi	and Alexander	¥ 1 <del>7,1</del> (7.5					7/	<u> </u>
SAMPLERS: (Signature) Manley							CON-						REMARKS
NO.	DATE	TIME	S01L.	WATER		LOCATION	TAINER	9		Z			
!	1,2197	932		V	7-	MINI	ئ						
		1040	<u> </u>	1.1			1						
		1200	<u> </u>	100		( ;	,	-					
		1315	<u></u>	12		Ġ	N	10				PEL # 9905013	
æ,		1420		1c	,	<u></u>	,	1	-			INIV # 28800.	
(0)		150		1		1W-2	1	)	*				INV # <sup>28800</sup>
7	37	16°5		1.		(Ŵ-3	· ·	\	-/.				1
											- 1		
		<u> </u>											
	<u>.</u>								-	_			
		-				<u>'</u>							
Relinquished by: (Signature)  Date / Time Received by: (Signature)  1/13/99						Relinquished by: (Signature)					Date / Time Receive by: (Signature)		
Relinquished by: (Signature)					Date / Time	Received by: (Signature)		Relinquished by: (Signal				natura)	Date / Time Received by: (Signature)
1 .					Date / Time //3/4/1/13/ N	Received for Laboratory (Signature)	/ by:	by: Da			16	Remar	rks
	ENVI	RO S	ОП	, TE	CH CONSU	LTANTS		<u>.                                    </u>		<u></u>	1	<u> </u>	

| Environmental & Geotechnical Consultants | 137 TFLL F ROAD, S. IN JOSE, C 114F-ORNIA 95111 | Tel: (408) 297-(500 Fax: (408) 292-2416