

MAY 1 6 2014

Chevron #21-1283/Express Auto Clinic Attn: Ms. Kelly Esters 6101 Bollinger Canyon Rd., Room 5323 San Ramon, CA 94583



UNDERGROUND STORAGE TANK (UST) CASE, REMEDIAL ACTION COMPLETION CERTIFICATION: CASE RO0000056/CLAIM NO. 10630 CHEVRON #21-1283 EXPRESS AUTO CLINIC, 3810 BROADWAY, OAKLAND

Dear Ms. Kelly Esters:

This letter confirms the completion of site investigation and corrective action for the underground storage tank(s) located at the above-described location. Thank you for your cooperation throughout this investigation. Your willingness and promptness in responding to our inquiries concerning the underground storage tank(s) are greatly appreciated.

Based on information in the above-referenced file and with the provision that the information provided to this Agency was accurate and representative of site conditions, this Agency finds that the site investigation and corrective action carried out at your underground storage tank(s) site is in compliance with the requirements of subdivisions (a) and (b) of Section 25296.10 of the Health and Safety Code and with corrective action regulations adopted pursuant to Section 25299.3 of the Health and Safety Code and that no further action related to the petroleum release(s) at the site is required. This notice is issued pursuant to subdivision (h) of Section 25296.10 of the Health and Safety Code.

Claims for reimbursement of corrective action costs submitted to the Underground Storage Tank Cleanup Fund more than 365 days after the date of this letter of issuance or activation of the Fund's Letter of Commitment, whichever occurs later, will not be reimbursed unless one of the following exceptions applies:

 Claims are submitted pursuant to Section 25299.57, subdivision (k) (reopened UST case); or, Submission within the timeframe was beyond the claimant's reasonable control, ongoing work is required for closure that will result in the submission of claims beyond that time period, or that under the circumstances of the case, it would be unreasonable or inequitable to impose the 365-day time period.

Please contact Robert Trommer at (916) 341-5684 if you have any questions regarding this matter.

Sincerely,

John Russell, Acting Deputy Director Division of Financial Assistance

John Russell

Attachment: Case Closure Summary

cc: Attn: Mr. Gerald Friedkin 300 Grand Avenue Oakland, CA 94611

> Express Auto Clinic Attn: Mr. Joe Zadik 8255 San Leandro Street Oakland, CA 94621

Cherie McCaulou San Francisco Bay RWQCB 1515 Clay Street, Suite 1400 Oakland, CA 94612

Mark Detterman Alameda County LOP 1131 Harbor Bay Parkway Alameda, CA 94502





MAY 1 6 2014

Chevron #21-1283/Express Auto Clinic Attn: Mr. Gerald Friedkin 300 Grand Avenue Oakland, CA 94610

UNDERGROUND STORAGE TANK (UST) CASE, REMEDIAL ACTION COMPLETION CERTIFICATION: CASE RO0000056/CLAIM NO. 10630 CHEVRON #21-1283 EXPRESS AUTO CLINIC, 3810 BROADWAY, OAKLAND

Dear Mr. Gerald Friedkin:

This letter confirms the completion of site investigation and corrective action for the underground storage tank(s) located at the above-described location. Thank you for your cooperation throughout this investigation. Your willingness and promptness in responding to our inquiries concerning the underground storage tank(s) are greatly appreciated.

Based on information in the above-referenced file and with the provision that the information provided to this Agency was accurate and representative of site conditions, this Agency finds that the site investigation and corrective action carried out at your underground storage tank(s) site is in compliance with the requirements of subdivisions (a) and (b) of Section 25296.10 of the Health and Safety Code and with corrective action regulations adopted pursuant to Section 25299.3 of the Health and Safety Code and that no further action related to the petroleum release(s) at the site is required. This notice is issued pursuant to subdivision (h) of Section 25296.10 of the Health and Safety Code.

Claims for reimbursement of corrective action costs submitted to the Underground Storage Tank Cleanup Fund more than 365 days after the date of this letter of issuance or activation of the Fund's Letter of Commitment, whichever occurs later, will not be reimbursed unless one of the following exceptions applies:

 Claims are submitted pursuant to Section 25299.57, subdivision (k) (reopened UST case); or, Submission within the timeframe was beyond the claimant's reasonable control, ongoing work is required for closure that will result in the submission of claims beyond that time period, or that under the circumstances of the case, it would be unreasonable or inequitable to impose the 365-day time period.

. Please contact Robert Trommer at (916) 341-5684 if you have any questions regarding this matter.

Sincerely,

John Russell, Acting Deputy Director Division of Financial Assistance

Attachment: Case Closure Summary

cc: Chevron EMC

Attn: Ms. Kelly Esters 6101 Bollinger Canyon Rd., Room 532

San Ramon, CA 94583

Express Auto Clinic Attn: Mr. Joe Zadik 8255 San Leandro Street Oakland, CA 94621

Cherie McCaulou San Francisco Bay RWQCB 1515 Clay Street, Suite 1400 Oakland, CA 94612

Mark Detterman Alameda County LOP 1131 Harbor Bay Parkway Alameda, CA 94502



Chevron #21-1283/Express Auto Clinic Attn: Mr. Joe Zadik 8255 San Leandro Street Oakland, CA 94621

UNDERGROUND STORAGE TANK (UST) CASE, REMEDIAL ACTION COMPLETION CERTIFICATION: CASE RO0000056/CLAIM NO. 10630 CHEVRON #21-1283 EXPRESS AUTO CLINIC, 3810 BROADWAY, OAKLAND

Dear Mr. Joe Zadik:

This letter confirms the completion of site investigation and corrective action for the underground storage tank(s) located at the above-described location. Thank you for your cooperation throughout this investigation. Your willingness and promptness in responding to our inquiries concerning the underground storage tank(s) are greatly appreciated.

Based on information in the above-referenced file and with the provision that the information provided to this Agency was accurate and representative of site conditions, this Agency finds that the site investigation and corrective action carried out at your underground storage tank(s) site is in compliance with the requirements of subdivisions (a) and (b) of Section 25296.10 of the Health and Safety Code and with corrective action regulations adopted pursuant to Section 25299.3 of the Health and Safety Code and that no further action related to the petroleum release(s) at the site is required. This notice is issued pursuant to subdivision (h) of Section 25296.10 of the Health and Safety Code.

Claims for reimbursement of corrective action costs submitted to the Underground Storage Tank Cleanup Fund more than 365 days after the date of this letter of issuance or activation of the Fund's Letter of Commitment, whichever occurs later, will not be reimbursed unless one of the following exceptions applies:

 Claims are submitted pursuant to Section 25299.57, subdivision (k) (reopened UST case); or, Submission within the timeframe was beyond the claimant's reasonable control, ongoing work is required for closure that will result in the submission of claims beyond that time period, or that under the circumstances of the case, it would be unreasonable or inequitable to impose the 365-day time period.

Please contact Robert Trommer at (916) 341-5684 if you have any questions regarding this matter.

Sincerely,

John Russell, Acting Deputy Director Division of Financial Assistance

Joh Russell

Attachment: Case Closure Summary

cc: Chevron #21-1283/Express Auto Clinic Attn: Mr. Gerald Friedkin 300 Grand Avenue Oakland, CA 94611

> Chevron EMC Attn: Ms. Kelly Esters 6101 Bollinger Canyon Rd., Room 5323 San Ramon, CA 94583

Cherie McCaulou San Francisco Bay RWQCB 1515 Clay Street, Suite 1400 Oakland, CA 94612

Mark Detterman Alameda County LOP 1131 Harbor Bay Parkway Alameda, CA 94502





UST CASE CLOSURE REVIEW SUMMARY REPORT REVISED JUNE 2013 AS THE RESULT OF PUBLIC COMMENTS

Agency Information

Agency Name: Alameda County Environmental Health Department (County)	Address: 1131 Harbor Bay Parkway Alameda, CA 94502
Agency Caseworker: Mark Detterman	Case No.: RO0000056

Case Information

USTCF Claim No.: 10630	Global ID: T0600101108
Site Name: Chevron #21-1283/Express Auto	Site Address: 3810 Broadway Oakland, CA 94611
Responsible Party #1: Gerald Friedkin	Address: 300 Grand Avenue Oakland, CA 94610
Responsible Party #2: Chevron EMC Attn: Ms. Kelly Esters	Address: 6101 Bollinger Canyon Rd., Room 5323, San Ramon, CA 94583
Responsible Party #3: Express Auto Clinic Attn: Mr. Joe Zadik	Address: 8255 San Leandro Street Oakland, CA 94621
USTCF Expenditures to Date: \$76,151	Number of Years Case Open: 21

URL: http://geotracker.waterboards.ca.gov/profile report.asp?global id=T0600101108

Summary

The Low-Threat Underground Storage Tank (UST) Case Closure Policy (Policy) contains general and media-specific criteria, and cases that meet those criteria are appropriate for closure pursuant to the Policy. This case meets all of the required criteria of the Policy. A summary evaluation of compliance with the Policy is shown in **Attachment 1: Compliance with State Water Board Policies and State Law**. The Conceptual Site Model upon which the evaluation of the case has been made is described in **Attachment 2: Summary of Basic Case Information (Conceptual Site Model)**. Highlights of the case follow:

The Site is an active commercial petroleum fueling and automobile repair facility. A 550-gallon waste oil UST was removed and an unauthorized leak was reported in May 1991. An unknown volume of impacted soil was excavated during the removal of the UST. Additional excavation of approximately 1,400 cubic yards of impacted soil was performed in February to March 2000. The excavation in the source area extended to a depth of 22 feet below ground surface (bgs) and was backfilled with clean fill (approximately 800 pounds of oxygen release compound mixed with soil was placed in the bottom of the excavation). According to groundwater data, water quality objectives have been achieved or nearly achieved for all constituents except for benzene and methyl tert-butyl ether (MTBE).

The petroleum release is limited to the shallow soil and groundwater. According to data available in GeoTracker, there are no supply wells regulated by the California Department of Public Health within 1,000 feet of the defined plume boundary. No other water supply wells have been identified



Claim No: 10630

within 1,000 feet of the defined plume boundary in files reviewed. An east west concrete culvert (creek) is present on approximately 300 feet downgradient of the Site. This concrete culvert is below grade for at least 1,000 feet east and west of the Site. Water is provided to water users near the Site by East Bay Municipal Utilities District.

The affected groundwater is not currently being used as a source of drinking water, and it is highly unlikely that the affected groundwater will be used as a source of drinking water in the foreseeable future. Other designated beneficial uses of impacted groundwater are not threatened, and it is highly unlikely that they will be, considering these factors in the context of the site setting. Remaining petroleum hydrocarbon constituents are limited, stable and concentrations declining. Corrective actions have been implemented and additional corrective actions are not necessary. Any remaining petroleum hydrocarbon constituents do not pose a significant risk to human health, safety or the environment.

Rationale for Closure under the Policy

General Criteria: The case meets all eight Policy general criteria.

Groundwater Specific Criteria: The case meets Policy Criterion 1 by Class 5. An earlier unidentified creek is located 300 feet from the Site in a concrete culvert. That concrete culvert extends at least 1,000 feet northeast and southwest of the hospital and parking structure on the northwest side of the Kaiser Permanente property and was not seen during our evaluation. If not for the creek the case would meet Policy Class 2. The contaminant plume that exceeds water quality objectives is less than 250 feet in length. There is no free product. The nearest water supply well is greater than 1,000 feet from the defined plume boundary. The dissolved concentration of benzene is less than 3,000 µg/L, and the dissolved concentration of MTBE is less than 1,000 µg/L.

Vapor Intrusion to Indoor Air: Policy Exclusion for Active Station. Soil vapor evaluation is not required because the Site is an active commercial petroleum fueling facility.

Direct Contact and Outdoor Air Exposure: The case meets Policy Criterion 3a. Maximum concentrations in soil are less than those in Policy Table 1 for Commercial/Industrial use, and the concentration limits for a Utility Worker are not exceeded. There are no soil sample results in the case record for naphthalene. However, the relative concentration of naphthalene in soil can be conservatively estimated using the published relative concentrations of naphthalene and benzene in gasoline. Taken from Potter and Simmons (1998), gasoline mixtures contain approximately 2 percent benzene and 0.25 percent naphthalene. Therefore, benzene can be directly substituted for naphthalene concentrations with a safety factor of eight. Benzene concentrations from the Site are below the naphthalene thresholds in Policy Table 1. Therefore, the estimated naphthalene concentrations meet the thresholds in Table 1 and the Policy criteria for direct contact by a factor of eight. It is highly unlikely that naphthalene concentrations in the soil, if any, exceed the threshold.

Objections to Closure and Responses

The County, as documented in the Closure Review located on the 09-42 Case Review page in GeoTracker (dated 4/15/2010) objects to UST case closure for this case because:

Site characterization is not complete and contamination is not defined. RESPONSE: Concentrations in soil and groundwater are defined to low to non-detect levels.

 Source control is feasible and needed to reduce offsite migration and reduce source mass. RESPONSE: No free product has been documented in site wells since 2000. The

secondary source has been removed to the extent practicable. The petroleum hydrocarbon plume is stable or decreasing.

- Soil vapor risks are not identified.

 <u>RESPONSE:</u> The Site is an active commercial petroleum fueling facility. Remaining maximum concentrations in soil are less than those in Policy Table 1 for both Commercial/Industrial and Residential land uses. Remaining petroleum hydrocarbon constituents do not pose a significant risk to human health.
- Designated beneficial uses of groundwater at the Site (municipal and domestic supply)
 need to be protected.
 RESPONSE: Water is provided to water users near the Site by East Bay Municipal Utilities
 District. The affected groundwater is not currently being used as a source of drinking water,
 and it is highly unlikely that the affected groundwater will be used as a source of drinking
- water in the foreseeable future.
 Comment received during Public comment period: The County identified a creek 300 feet downgradient of the Site that was not visible using aerial photography. RESPONSE: The creek is in an underground concrete culvert that extends at least 1,000 feet northeast and southwest of the hospital and parking structure. It is located on the northwest side of the KP property and was not seen during our evaluation. The RSR has been revised as the result of this new information. After further evaluation, instead of using Class 2 the Site meets the Policy criteria for Class 5.

The bottom of the culvert (creek) is located at 12 feet bgs (Oakland Public Works, 2013) and groundwater is at 19 feet bgs prior to the dewatering associated with the parking structure that maintains groundwater at a depth in excess of 30 feet bgs. The minimum historical groundwater depth was 14 feet bgs. Groundwater dewatering beneath the parking structure has to be maintained or the lower levels of the structure will flood. Therefore the contaminated groundwater and the surface water body and the will never come into hydraulic contact.

Determination

Based on the review performed in accordance with Health & Safety Code Section 25299.39.2 subdivision (a), the Fund Manager has determined that closure of the case is appropriate.

Recommendation for Closure

Based on available information, residual petroleum hydrocarbons at the Site do not pose a significant risk to human health, safety, or the environment, and the case meets the requirements of the Policy. Accordingly, the Fund Manager recommends that the case be closed. The State Water Board is conducting public notification as required by the Policy. Alameda County has the regulatory responsibility to supervise the abandonment of monitoring wells.

Lisa Babcock, P.G. 3939, C.E.G. 1235

Prepared by: Roger Hoffmore, P.G. 7660

ATTACHMENT 1: COMPLIANCE WITH STATE WATER BOARD POLICIES AND STATE LAW

The case complies with the State Water Resources Control Board policies and state law. Section 25296.10 of the Health and Safety Code requires that sites be cleaned up to protect human health, safety, and the environment. Based on available information, any residual petroleum constituents at the site do not pose significant risk to human health, safety, or the environment.

The case complies with the requirements of the Low-Threat Underground Storage Tank (UST) Case Closure Policy as described below.¹

Is corrective action consistent with Chapter 6.7 of the Health and Safety Code and implementing regulations? The corrective action provisions contained in Chapter 6.7 of the Health and Safety Code and the implementing regulations govern the entire corrective action process at leaking UST sites. If it is determined, at any stage in the corrective action process, that UST site closure is appropriate, further compliance with corrective action requirements is not necessary. Corrective action at this site has been consistent with Chapter 6.7 of the Health and Safety Code and implementing regulations and, since this case meets applicable case-closure requirements, further corrective action is not necessary, unless the activity is	☑ Yes □ No
necessary for case closure. Have waste discharge requirements or any other orders issued pursuant to Division 7 of the Water Code been issued at this case?	□ Yes ☒ No
If so, was the corrective action performed consistent with any order?	□ Yes □ No ☒ NA
General Criteria General criteria that must be satisfied by all candidate sites:	
Is the unauthorized release located within the service area of a public water system?	☑ Yes □ No
Does the unauthorized release consist only of petroleum?	☑ Yes □ No
Has the unauthorized ("primary") release from the UST system been stopped?	☑ Yes □ No
Has free product been removed to the maximum extent practicable?	☑ Yes □ No □ NA
Has a conceptual site model that assesses the nature, extent, and mobility of the release been developed?	☑ Yes □ No

¹ Refer to the Low-Threat Underground Storage Tank Case Closure Policy for closure criteria for low-threat petroleum UST sites. http://www.waterboards.ca.gov/board_decisions/adopted_orders/resolutions/2012/rs2012_0016atta.pdf

Has secondary source been removed to the extent practicable?	☑ Yes □ No
Una nell'anno di la company de	□ 163 □ 140
Has soil or groundwater been tested for MTBE and results reported in accordance with Health and Safety Code Section 25296.15?	☑ Yes □ No
Nuisance as defined by Water Code section 13050 does not exist at the site?	☑ Yes □ No
Are there unique site attributes or site-specific conditions that demonstrably increase the risk associated with residual petroleum constituents?	□ Yes ☑ No
Media-Specific Criteria	s for July
Candidate sites must satisfy all three of these media-specific criteria:	
1. Groundwater:	Fewers, as *
To satisfy the media-specific criteria for groundwater, the contaminant plume that exceeds water quality objectives must be stable or decreasing in areal extent, and meet all of the additional characteristics of one of the five classes of sites:	
and additional critical control of the five classes of sites:	
Is the contaminant plume that exceeds water quality objectives stable or decreasing in areal extent?	☑ Yes □ No □ NA
Does the contaminant plume that exceeds water quality objectives meet all of the additional characteristics of one of the five classes of sites?	☑ Yes □ No □ NA
If YES, check applicable class: □1 □2 □3 □4 ⊠5	Case his - in-
For sites with releases that have not affected groundwater do mobile	100 52 Th
constituents (leachate, vapors, or light non-aqueous phase liquids) contain sufficient mobile constituents to cause groundwater to exceed the groundwater criteria?	□ Yes □ No 図 NA
2. Petroleum Vapor Intrusion to Indoor Air:	6
The site is considered low-threat for vapor intrusion to indoor air if site-specific conditions satisfy all of the characteristics of one of the three classes of sites (a	*
through c) or if the exception for active commercial fueling facilities applies.	
	* * *
Is the site an active commercial petroleum fueling facility? Exception: Satisfaction of the media-specific criteria for petroleum vapor intrusion to indoor air is not required at active commercial petroleum fueling facilities,	☑ Yes □ No
except in cases where release characteristics can be reasonably believed to pose an unacceptable health risk.	ne e e
	9.
	n v
	-

Claim No: 10630

a.	Do site-specific conditions at the release site satisfy all of the applicable characteristics and criteria of scenarios 1 through 3 or all of the applicable characteristics and criteria of scenario 4?	□Yes □ No 図 NA
	If YES, check applicable scenarios: □1□2□3□4	
b.		□ Yes □ No ☒ NA
C.	As a result of controlling exposure through the use of mitigation measures or through the use of institutional or engineering controls, has the regulatory agency determined that petroleum vapors migrating from soil or groundwater will have no significant risk of adversely affecting human health?	☐ Yes ☐ No ☒ NA
	Direct Contact and Outdoor Air Exposure: ne site is considered low-threat for direct contact and outdoor air exposure if ne-specific conditions satisfy one of the three classes of sites (a through c).	
a.	Are maximum concentrations of petroleum constituents in soil less than or equal to those listed in Table 1 for the specified depth below	☑ Yes ☐ No ☐ NA
	ground surface (bgs)?	inter a track of
		☐ Yes ☐ No ☑ NA
b.	Are maximum concentrations of petroleum constituents in soil less than levels that a site specific risk assessment demonstrates will than levels that a site specific risk assessment demonstrates will be a second to the second than the second to the secon	
	have no significant risk of adversely affecting human health?	
c.	As a result of controlling exposure through the use of mitigation measures or through the use of institutional or engineering	☐ Yes ☐ No ☒ NA
4	has the regulatory agency determined that the	
	controls, has the regulatory agency concentrations of petroleum constituents in soil will have no significant risk of adversely affecting human health?	

The state of the s

the arrange to the entire and color decided by the entire the entire that is a self-of

and the second s

e greene griffing angles was transmission of switch

ga a sanggalasang a sahijan sa tanggalasa da sahijan da sahijan generalise in the company of the com and the proof of the proof of the contract of the same of the same

ATTACHMENT 2: SUMMARY OF BASIC CASE INFORMATION (Conceptual Site Model)

Site Location/History

 The Site is located at the northeast corner of the intersection of Broadway and 38th Street in Oakland and is an active commercial petroleum fueling and automobile repair facility.

Current site features include a station building, automobile repair building, fuel dispenser include a station building, automobile repair building, fuel dispenser.

islands, and a UST complex.

- The Site is bounded on the northwest by Broadway, to the southwest by 38th Street, to the southeast by residential apartments, and to the northeast by commercial and residential buildings. On the far side of Broadway and 38th Streets is the Kaiser Hospital complex.
- Site maps showing the location of the USTs, monitoring wells, groundwater level contours, and contaminant concentrations are provided at the end of this closure review summary (ARCADIS, 2013).
- Nature of Contaminants of Concern: Petroleum hydrocarbons only.

Source: UST system.

Date reported: May 1991.

Status of Release: USTs removed.

 Free Product: Free product was last reported in monitoring well MW-2, MW-3 and MW-8 in 2000.

Tank Information

Tank No.	Size in Gallons	Contents	Closed in Place/ Removed/Active	Date
1	6,000	Unknown	Removed	February 1980
2	6,000	Unknown	Removed	February 1980
3	6,000	Unknown	Removed	February 1980
4	6,000	Unknown	Removed	February 1980
5	550	Waste Oil	Removed	May 1991

Receptors

- GW Basin: Santa Clara Valley East Bay Plain.
- Beneficial Uses: The San Francisco Regional Water Quality Control Board (Regional Water Board) Basin Plan lists Municipal and Domestic Supply.

Land Use Designation: Commercial.

Public Water System: East Bay Municipal Water District.

- Distance to Nearest Supply Well: According to data available in GeoTracker, there are no
 public supply wells regulated by California Department of Public Health within 1,000 feet of
 the defined plume. No other water supply wells were identified within 1,000 feet of the
 defined plume boundary in the files reviewed.
- Distance to Nearest Surface Water: During the Public Notice period a concrete lined subgrade culvert (creek) that runs generally northeast to southwest was identified approximately 300 feet northwest of the Site. The bottom of the culvert is approximately 12 feet bgs and groundwater ranges 14 to 19 feet bgs. A major continuously operated dewatering system is present in the hospital parking structure that lowers the local groundwater elevations to below 30 feet bgs. This structure is located between the Site and the culvert. Hydraulic communication between groundwater and the bottom of the culvert is believed to be unlikely.

Claim No: 10630

Geology/Hydrogeology

- Stratigraphy: The Site is underlain primarily by unconsolidated fill material overlying sandy silts and clays, interbedded with well sorted sands and silty sands (ARCADIS, 2012).
- Maximum Sample Depth: 35 feet below ground surface (bgs).
- Minimum Groundwater Depth: 14.00 feet bgs at monitoring well MW-9.
- Maximum Groundwater Depth: 34.24 feet bgs at monitoring well MW-11.
- Current Average Depth to Groundwater: Approximately 19 feet bgs.
- Saturated Zones(s) Studied: Approximately 14 40 feet bgs.
- Appropriate Screen Interval: Yes.
- Groundwater Flow Direction: Groundwater flow direction varies considerably, ranging among north, west and south. Groundwater mounding and groundwater depressions related to offsite dewatering (on the Kaiser property during construction) have also been observed (ARCADIS, 2012). Predominant groundwater flow direction is currently to the west (ARCADIS, 2013).

Monitoring Well Information

nitoring Well Information Well Designation	Date Installed	Screen Interval (feet bgs)	Depth to Water (feet bgs) (12/28/2012)
MW-1	October 1991	24-34	NM
The second secon	October 1995	26-36	19.30
MW-4	May 2002	10-30	20.52
MW-5B	September 1996	10-35	21.39
MW-6	September 1996	10-35	19.18
MW-7	September 1996	10-35	17.37
MW-9		10-35	19.19
MW-10	September 1996	15-40	25.55
MVV-11	August 2000	10-30	19.60
MW-12	May 2002	A V A V A V A	

NM: Not measured

- Remediation Summary Free Product: Free product was last reported in monitoring well MW-2, MW-3, and MW-8 in 2000.
 - Soil Excavation: An unknown volume of impacted soil was excavated during the removal of the waste oil UST in 1991. Additional excavation of approximately 1,400 cubic yards of petroleum hydrocarbon impacted soil was performed at the Site in February to March 2000 and extended in the source area to a depth of 22 feet bgs and was backfilled with clean fill. Approximately 800 pounds of oxygen release compound mixed with soil was placed in the bottom of the excavation.

the Mark was transfer and the state of the s The section of the se

In-Situ Soil/Groundwater Remediation: None reported.

Claim No: 10630

Most Recent Concentrations of Petroleum Constituents in Soil

Constituent	Maximum 0-5 feet bgs [mg/kg and (date)]	Maximum 5-10 feet bgs [mg/kg and (date)]		
Benzene	<0.002 (06/29/12)	<2 (07/02/12)		
Ethylbenzene	<0.002 (06/29/12)	0.57 (07/02/12)		
Naphthalene	NA			
PAHs	NA	NA NA		

NA: Not Analyzed, Not Applicable or Data Not Available mg/kg: Milligrams per kilogram, parts per million <: Not detected at or above stated reporting limit PAHs: Polycyclic aromatic hydrocarbons

Most Recent Concentrations of Petroleum Constituents in Group

Sample	Sample Date	TPHg (µg/L)	TPHd (µg/L)	Benzene (µg/L)	Ethyl- Benzene (µg/L)	Xylenes (µg/L)	MTBE (µg/L)	TBA (µg/L)
MW-4	12/28/12	<50	90	<0.5	<0.5	<1.0	0.55	<10
MW-5B	12/28/12	72	61	<0.5	<0.5	<1.0	14	<10
MW-6	12/28/12	2,100	100	460	. 13	9.9	<2.5	58
MW-7	12/28/12	<50	<48	<0.5	<0.5	<1.0	<0.5	<10
MW-9	12/28/12	<50	<48	<0.5	<0.5	<1.0	43	16
MW-10	12/28/12	340	100	<0.5	<0.5	<1.0	<0.5	<10
MW-11	12/28/12	<50	<48	<0.5	<0.5	<1.0	<0.5	
MW-12	12/28/12	3,900	120	850	34	29		<10
WQOs			- 120	2 1 1	700	1,750	<5.0 5 ^a	<100 1,200 ^b

NA: Not Analyzed, Not Applicable or Data Not Available

μg/L: Micrograms per liter, parts per billion

<: Not detected at or above stated reporting limit TPHg: Total petroleum hydrocarbons as gasoline TPHd: Total petroleum hydrocarbons as diesel w/ silica gel clean-up

MTBE: Methyl tert-butyl ether

TBA: Tert-butyl alcohol

WQOs: Water Quality Objectives, Regional Water Board except where indicated --: Regional Water Board Basin Plan has no numeric WQO for TPHg and TPHd

^a: Secondary maximum contaminant level (MCL)


b: California Department of Public Health, Response Level

Claim No: 10630


Groundwater Trends


There are 21 years of groundwater monitoring data for this case. Benzene trends remain high and decreasing in the source area (MW-5B and MW-12). MTBE exceeds water quality objectives and are decreasing north of the plume (MW-5B and MW-7). Site shows effects of groundwater mounding northeast of Site. Benzene trends are shown below:


Source Area Well

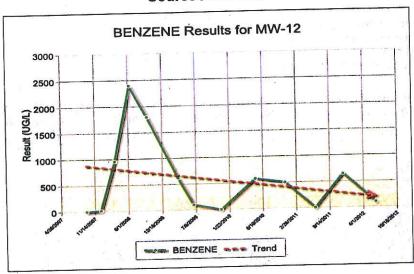

Downgradient Well

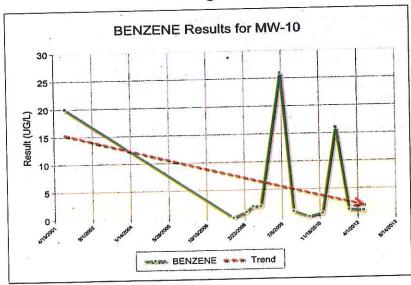

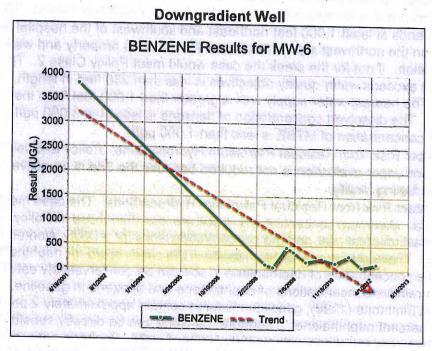

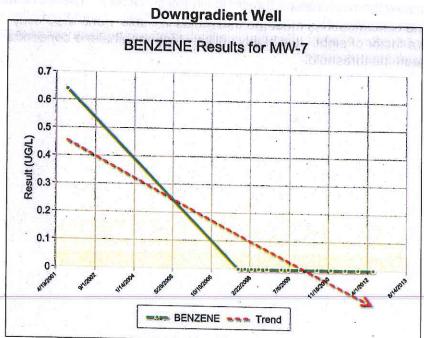

Evaluation of Current Risk

- Estimate of Hydrocarbon Mass in Soil: None reported.
- Soil/ Groundwater tested for MTBE: Yes, see table above.
- Oxygen Concentrations in Soil Vapor: None reported.
- Plume Length: <250 feet long.
- Plume Stable or Degrading: Yes.

Contaminated Zone(s) Used for Drinking Water: No.

Groundwater Specific Criteria: The case meets Policy Criterion 1 by Class 5. An earlier unidentified creek is located 300 feet from the Site in a concrete culvert. That concrete culvert extends at least 1,000 feet northeast and southwest of the hospital and parking structure on the northwest side of the Kaiser Permanente property and was not seen during our evaluation. If not for the creek the case would meet Policy Class 2. The contaminant plume that exceeds water quality objectives is less than 250 feet in length. There is no free product. The nearest water supply well is greater than 1,000 feet from the defined plume boundary. The dissolved concentration of benzene is less than 3,000 μg/L, and the dissolved concentration of MTBE is less than 1,000 μg/L.

Indoor Vapor Risk from Residual Petroleum Hydrocarbons: Policy Exclusion for Active Station. Soil vapor evaluation is not required because the Site is an active commercial

petroleum fueling facility.

Direct Contact Risk from Residual Petroleum Hydrocarbons: The case meets Policy Criterion 3a. Maximum concentrations in soil are less than those in Policy Table 1 for Commercial/Industrial use, and the concentration limits for a Utility Worker are not exceeded. There are no soil sample results in the case record for naphthalene. However, the relative concentration of naphthalene in soil can be conservatively estimated using the published relative concentrations of naphthalene and benzene in gasoline. Taken from Potter and Simmons (1998), gasoline mixtures contain approximately 2 percent benzene and 0.25 percent naphthalene. Therefore, benzene can be directly substituted for naphthalene concentrations with a safety factor of eight. Benzene concentrations from the Site are below the naphthalene thresholds in Policy Table 1. Therefore, the estimated naphthalene concentrations meet the thresholds in Table 1 and the Policy criteria for direct contact by a factor of eight. It is highly unlikely that naphthalene concentrations in the soil, if any, exceed the threshold.

The stage the probability of the probability and

align, on the stress white our place are solded early

and providing providing the second

