

ENVIRONMENTAL
PROTECTION

99 APR 13 PM 2:58

**QUARTERLY GROUNDWATER
MONITORING AND SAMPLING
AT THE PROPERTY
LOCATED AT 5175 BROADWAY STREET
OAKLAND, CALIFORNIA
DECEMBER 3, 1998**

**PREPARED FOR:
MR. MOHAMMAD MEHDIZADEH
678 LA CORSO DRIVE
WALNUT CREEK, CALIFORNIA 94598**

**BY:
ENVIRO SOIL TECH CONSULTANTS
131 TULLY ROAD
SAN JOSE, CALIFORNIA 95111**

ENVIRO SOIL TECH CONSULTANTS

LIST OF TABLE

TABLE 1 ... GROUNDWATER MONITORING DATA AND ANALYTICAL RESULTS.

TABLE 2 ... GROUNDWATER SAMPLES ANALYZED FOR TOTAL LEAD.

LIST OF FIGURES

FIGURE 1 ... VICINITY MAP SHOWING 5175 BROADWAY STREET, OAKLAND, CALIFORNIA.

FIGURE 2 ... SITE PLAN SHOWING BUILDING, FORMER UST AREAS AND MONITORING WELLS.

LIST OF APPENDICES

APPENDIX "A" ... TABLE 1 AND TABLE 2

APPENDIX "B" ... FIGURE 1 AND FIGURE 2

APPENDIX "C" ... STANDARD OPERATION PROCEDURES

APPENDIX "D" ... ANALYTICAL LABORATORY RESULTS AND CHAIN-OF-CUSTODY DOCUMENTATION

ENVIRO SOIL TECH CONSULTANTS

TABLE OF CONTENTS

PAGE NO.

LETTER OF TRANSMITTAL	1-2
SITE DESCRIPTION AND BACKGROUND	3-5
SCOPE OF PRESENT WORK	5
CURRENT FIELD WORK	5
<i>Groundwater Monitoring</i>	6
<i>Groundwater Sampling</i>	6
GROUNDWATER FLOW DIRECTION	6
LABORATORY ANALYTICAL RESULTS	6-7
RECOMMENDATIONS	7
LIMITATIONS	7

APPENDIX "A"

TABLE 1 - GROUNDWATER MONITORING DATA AND ANALYTICAL RESULTS	T1-T8
TABLE 2 - GROUNDWATER SAMPLES ANALYZED FOR LEAD	T9-T10

APPENDIX "B"

FIGURE 1 - VICINITY MAP	M1
FIGURE 2 - SITE PLAN	M2

APPENDIX "C"

GROUNDWATER SAMPLING PROCEDURE	SOP1
--------------------------------	------

APPENDIX "D"

PRIORITY ENVIRONMENTAL LABS REPORT AND CHAIN-OF-CUSTODY	
---	--

2/6/99

ENVIRONMENTAL
PROTECTION

99 APR -8 PM 2:55

Mr Don Hwang
1131 Harbor Bay Parkway, Suite 250
Alameda, Ca, 94502

Re: Former Exxon Station, 5175 Broadway, Oakland, CA, 94611

Dear Mr Hwang:

ATTach please find copies of reports for the under ground water investigation of the subject property. This is in follow up of your letter dated Feb 17th 1999, stating that the health services files did not show any reports ~~on~~ the subject site since end of 1996. As a result I am forwarding additional copies to your attention.


Also please note that my address has changed.

My new address is:
M. H. MEHDIZADEH
678 LA CORSO DR,
WALNUT CREEK, CA, 94598

Please make the proper corrections for your files.

Also I am looking forward to talk to you in regards to the subject site & possible closure of the case.

Thank you and sincerely yours,
M. Mehdizadeh

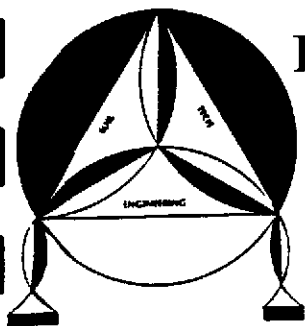

ENVIRO SOIL TECH CONSULTANTS

Environmental & Geotechnical Consultants
131 TULLY ROAD, SAN JOSE, CALIFORNIA 95111
Tel. (408) 297-1500 Fax: (408) 292-2116

December 3, 1997

File No. 8-90-420-GI

Mr. Mohammad Mehdizadeh
678 La Corso Drive
Walnut Creek, California 94598

**SUBJECT: QUARTERLY GROUNDWATER MONITORING
AND SAMPLING AT THE PROPERTY**

Located at 5175 Broadway Street, in
Oakland, California

Dear Mr. Mehdizadeh:

This report presents the results of quarterly groundwater monitoring and sampling conducted on November 16, 1998, by Enviro Soil Tech Consultants (ESTC), at the subject site located at 5175 Broadway Street, in Oakland, California (Figure 1).

Five monitoring wells (MW-1 through MW-3, STMW-4 and STMW-5) located on-site (Figure 2) were monitored for presence of floating product and/or odor and sampled and analyzed for the presence of Total Petroleum Hydrocarbons as diesel and gasoline (TPHd and TPHg), Benzene, Toluene, Ethylbenzene, Total Xylenes (BTEX), Methyl Tertiary Butyl Ether (MTBE) and Total Lead (Pb).


This quarterly monitoring and sampling was conducted in accordance with STE's work plan dated October 5, 1994 and October 10, 1996 letter from Alameda County Health Department requesting immediate initiation of quarterly monitoring program.

File No. 8-90-420-GI

If you have any questions or require additional information, please feel free to contact our office at (408) 297-1500 at your convenience.

Sincerely,

ENVIRO SOIL TECH CONSULTANTS

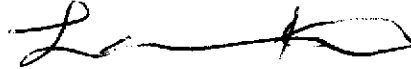

LAWRENCE KOO, P. E.
C. E. #34928

FRANK HAMEDI-FARD
GENERAL MANAGER

SITE DESCRIPTION AND BACKGROUND:

The site is located at 5175 Broadway Street, in Oakland, California. The area in the vicinity of the site consists mainly of residential and light commercial (Figure 1).

In January 1990, Tank Protect Engineering, Inc. (TPE), was retained to supervise the removal of underground fuel tanks and to conduct soil sampling, soil excavation, soil treatment and disposal. In addition, TPE installed three monitoring wells on-site.

Initial analytical results of soil samples collected from the tank excavation area showed moderate levels of Total Petroleum Hydrocarbons as gasoline (TPHg) in two locations. The rest of the samples showed TPHg ranging from non-detected to less than 120 parts per million (ppm). Due to the presence of elevated levels of TPHg detected in the excavation, TPE installed three on-site monitoring wells (MW-1 to MW-3), as required by state and local regulatory agencies (Figure 2). TPE's preliminary groundwater assessment also indicated that the shallow groundwater had been impacted.

The Alameda County Health Department (ACHD) requested the property owner to conduct further investigation in order to define the extent of dissolved hydrocarbon contamination in the groundwater.

Soil Tech Engineering, Inc. (STE), was retained in September 1990 to conduct monitoring and sampling of the on-site monitoring wells. The objective of the quarterly groundwater sampling program was to monitor seasonal and long-term variations in the conditions of the shallow aquifer beneath the site and to assess the direction of groundwater flow for further investigation.

STE sampled the three on-site groundwater monitoring wells (MW-1 to MW-3) on September 26, 1990, and January 14, 1991. The sampling was conducted in accordance with ACHD and California Regional Water Quality Control Board (CRWQCB) guidelines and STE's Standard Operating Procedures (SOP) included in Appendix "C".

The three on-site wells contained moderate to high levels of dissolved hydrocarbons. A comparison of the September 1990 sampling with TPE's analytical results of April 1990 showed an increase in dissolved hydrocarbons in wells MW-1 and MW-2. In well MW-3 (the down-gradient well), TPHg and Toluene levels decreased, whereas Benzene, Ethylbenzene and Total Xylenes increased slightly.

The analytical results for groundwater samples collected on January 14, 1991, showed an increase in TPH and BTEX levels in well MW-2 compared to those reported in September 1990. Well MW-1 also showed a slight increase in TPH and Benzene, but showed a decrease in Toluene, Ethylbenzene and Total Xylenes levels. Well MW-3 showed a substantial decrease in TPH and BTEX.

The Alameda County Health Department (ACHD) in a letter dated March 29, 1991, requested additional investigation to define the extent of dissolved hydrocarbon plume. STE installed two additional monitoring wells STMW-1 (STMW-4) and STMW-2 (STMW-5) on June 21, 1991. The July 3, 1991, water sampling results showed low levels of dissolved Total Petroleum Hydrocarbons as gasoline (TPHg) and Benzene, Toluene, Ethylbenzene and Total Xylenes (BTEX) in all five wells. The presence of low levels of TPHg and BTEX in the up-gradient well, STMW-1 (STMW-4), (located on the east corner of the property) indicated a potential off-site source. Based on the water level data, the groundwater direction was west to southwest on July 3, 1991. The detail of this investigation is summarized in STE's report dated July 23, 1991. STE recommended a quarterly monitoring and sampling of five on-site wells for at least a year.

The second quarterly sampling was conducted in November 1991. The detail of the sampling is described in STE's report dated November 22, 1991. The quarterly monitoring and samplings conducted by STE are described in STE's report dated March 10, 1992, June 1992, October 1992 and January 1993.

The last quarterly monitoring and sampling was conducted by STE on August 15, 1994, details in STE report dated September 20, 1994. STE prepared a work plan proposal for additional soil and groundwater investigation of the property dated October 5, 1994 but no further activity on the subject site was authorized by the owner. Hence, there was a discontinuation of quarterly monitoring and sampling activity.

SCOPE OF PRESENT WORK:

The scope of work for this sampling was to:

- 1) Measure the depth-to-groundwater and monitor the presence of dissolved petroleum hydrocarbons in the five on-site wells
- 2) Collect groundwater samples from the on-site wells for analyses of Total Petroleum Hydrocarbons as diesel and gasoline (TPHd and TPHg), Benzene, Toluene, Ethylbenzene and Total Xylenes (BTEX), Methyl Tertiary Butyl Ether (MTBE) and Total Lead (Pb) and submit to a State-Certified laboratory
- 3) Update the database for water level/dissolved hydrocarbon level and groundwater field observation data
- 4) Review analytical results and prepare a report

CURRENT FIELD WORK:

On November 16, 1998, the five on-site wells were monitored, purged and sampled in accordance with ESTE's Standard Operating Procedures (SOP) (Appendix "C"), which comprise state and local guidelines.

GROUNDWATER MONITORING:

During field observation, STE staff detected only light sewerage odors in monitoring wells MW-1 and MW-2. Rainbow sheen and strong sewerage odors were noted in monitoring wells MW-3, STMW-4 and STMW-5.

Table 1 summarizes the groundwater monitoring data and laboratory analytical results.

GROUNDWATER SAMPLING:

Following groundwater monitoring, the on-site wells were purged at least five well volumes and sampled. The water samples were collected in glass vials and amber bottles with teflon-lined caps, labeled and placed in an ice-cooled chest for transportation to Priority Environmental Labs, a State-Certified laboratory with appropriate chain-of-custody record.

All groundwater samples were analyzed for TPHg, TPHd, BTEX, MTBE and Total Pb.

GROUNDWATER FLOW DIRECTION:

Groundwater elevation data was used to determine the direction of groundwater flow. Groundwater flow was approximately in a westerly direction as of November 16, 1998.

LABORATORY RESULTS:

Monitoring well MW-2 detected low levels of TPHg at 1.4 milligrams per liter (mg/L) and BTEX at (0.0021 mg/L; 0.0019 mg/L; 0.0023 mg/L and 0.0048 mg/L), respectively. Monitoring well MW-3 detected moderate levels of TPHg at 68 mg/L and

low levels of BTEX at (0.086 mg/L; 0.054 mg/L; 0.069 mg/L and 0.13 mg/L). Monitoring well STMW-4 detected low levels of TPHg at 13 mg/L and BTEX at (0.026 mg/L; 0.021 mg/L; 0.02 mg/L and 0.041 mg/L), respectively. Monitoring wells MW-1 and STMW-5 detected TPHg and BTEX concentrations below laboratory detection limit. All five monitoring wells detected TPHd, MTBE and Total Lead concentrations below laboratory detection limit. Table 1 summarizes the groundwater samples analytical results.

RECOMMENDATIONS:

Since dissolved hydrocarbons continue to be present in the wells and some of the hydrocarbon constituents decreased and some have increased in the wells, STE recommends the continuation of monitoring and sampling of the five monitoring wells. In addition, ESTE recommends a meeting with ACEHD and the Regional Water Quality Control Board to discuss the results and obtain a sense of direction as to the additional investigation(s) necessary for the site.

A copy of this report should be sent to the Alameda County Health Department and the California Regional Water Quality Control Board.

LIMITATIONS:

This report was prepared in accordance with the currently accepted standards for environmental investigations. The contents of this report reflect the conditions of the subject site at this particular time. No other warranties, expressed or implied, as to the professional advice provided are made.

The findings of this report are based on the results of independent laboratory analyses and are valid at the present date and conditions. However, changes in the conditions of a property can occur with the passage of time, whether they are due to natural processes or the works of man, on this property or adjacent properties.

A P P E N D I X "A"

ENVIRO SOIL TECH CONSULTANTS

TABLE 1
GROUNDWATER MONITORING DATA (feet)
AND ANALYTICAL RESULTS (mg/L)

Date	Well No./ Elevation	Depth of Well	Perf. Length	Depth to Water	GW Elev.	Well Observation	TPHg	TPHd	B	T	E	X	MTBE
4/30/89	MW-1 (97.71)	23	10	N/A	N/A	No sheen or odor	0.2	NA	0.018	0.005	0.002	0.012	NA
5/17/90				9.26	88.45	N/A	NA	NA	NA	NA	NA	NA	NA
9/26/90				9.92	87.79	No sheen/Mild petroleum odor	1.3	NA	0.055	0.031	0.12	0.1	NA
1/14/91				9.54	88.17	No sheen/Mild petroleum odor	3.1	NA	0.35	0.083	0.086	0.13	NA
7/03/91	(102.04) resurveyed			9.42	92.62	No sheen/Light petroleum odor	0.58	NA	0.032	0.041	0.04	0.055	NA
11/11/91				9.45	92.59	No sheen/Mild petroleum odor	0.33	NA	0.02	0.002	0.002	0.011	NA
3/04/92	(101.83) resurveyed			7.93	93.90	No sheen/Light petroleum odor	0.81	NA	0.011	0.005	0.01	0.023	NA
6/01/92				8.98	92.85	No sheen/Mild sewerage odor	2.2	NA	0.093	0.032	0.04	0.12	NA
9/28/92				9.29	92.54	No sheen/Mild sewerage odor	2.9	NA	0.024	0.0078	0.019	0.037	NA
1/11/93				7.56	94.27	No sheen/Light sewerage odor	1.7	NA	0.0057	0.006	0.011	0.028	NA
8/15/94				9.19	92.64	No sheen/Mild sewerage odor	2.0	NA	0.12	0.003	0.006	0.016	NA
11/07/96	(97.50) resurveyed			8.73	88.77	No sheen/Light sewerage odor	1.2	0.27	0.003	0.0011	0.0015	0.0038	ND
2/12/97				7.92	89.58	No sheen/Light sewerage odor	1.8	ND	0.013	0.0057	0.0048	0.017	ND

TABLE 1 CONT'D
GROUNDWATER MONITORING DATA (feet)
AND ANALYTICAL RESULTS (mg/L)

Date	Well No./ Elevation	Depth of Well	Perf. Length	Depth to Water	GW Elev.	Well Observation	TPHg	TPHd	B	T	E	X	MTBE
6/16/97	MW-1 (97.50)	23	10	9.04	88.46	No sheen/Very light sewerage odor	0.33	ND	0.0027	ND	ND	0.0012	ND
9/30/97				7.56	89.94	No sheen or odor	ND	ND	ND	ND	ND	ND	ND
1/27/98				7.96	89.54	No sheen or odor	ND	ND	ND	ND	ND	ND	ND
4/24/98				7.98	89.52	Light rainbow sheen Light sewerage odor	ND	ND	ND	ND	ND	ND	ND
8/17/98				8.98	88.52	No sheen Light sewerage odor	ND	ND	ND	ND	ND	ND	ND
11/16/98				8.90	88.90	No sheen Light sewerage odor	ND	ND	ND	ND	ND	ND	ND
4/30/89	MW-2 (97.78)	23	15	N/A	N/A	No sheen or odor	0.23	NA	0.039	0.018	0.005	0.023	NA
5/17/90				10.00	87.78	N/A	NA	NA	NA	NA	NA	NA	NA
9/26/90				10.83	86.95	No sheen/Mild petroleum odor	0.85	NA	0.94	0.005	0.025	0.047	NA
1/14/91				10.63	87.15	No sheen or odor	3.1	NA	0.35	0.083	0.086	0.13	NA
7/03/91	(102.02) resurveyed			10.08	91.94	No sheen/Light petroleum odor	1.59	NA	0.03	0.052	0.024	0.034	NA
11/11/91				10.21	91.81	No sheen/Mild petroleum odor	0.96	NA	0.32	0.015	0.004	0.029	NA
3/04/92	(101.67) resurveyed			8.70	92.97	No sheen/Light petroleum odor	1.5	NA	0.0095	0.0084	0.0098	0.022	NA
6/01/92				9.52	92.15	No sheen Mild sewerage odor	2.8	NA	0.084	0.041	0.059	0.095	NA

**TABLE 1 CONT'D
GROUNDWATER MONITORING DATA (feet)
AND ANALYTICAL RESULTS (mg/L)**

Date	Well No./ Elevation	Depth of Well	Perf. Length	Depth to Water	GW Elev.	Well Observation	TPHg	TPHd	B	T	E	X	MTBE
9/28/92	MW-2 (101.67) resurveyed	23	15	10.09	91.58	No sheen Mild sewerage odor	1.6	NA	0.047	0.02	0.047	0.097	NA
1/11/93				8.52	93.15	No sheen Light sewerage odor	2.5	NA	0.0086	0.01	0.017	0.032	NA
8/15/94	(97.49) resurveyed			9.91	91.76	No sheen/Light petroleum odor	6	NA	0.45	0.06	0.1	0.095	NA
11/07/96				10.02	87.47	No sheen/Very light sewerage odor	4.2	0.78	0.025	0.0049	0.0081	0.014	ND
2/12/97				8.91	88.58	No sheen/Very light sewerage odor	1.8	5.7	0.016	0.0031	0.0034	0.0088	ND
6/16/97				9.75	87.74	No sheen/Very light sewerage odor	2.5	ND	0.022	0.0051	0.0078	0.011	ND
9/30/97				7.98	89.51	No sheen or odor	ND	ND	ND	ND	ND	ND	ND
1/27/98				8.38	89.11	No sheen or odor	ND	ND	ND	ND	ND	ND	ND
4/24/98				8.68	88.81	No sheen/Slight sewerage odor	2.1	1.4	0.018	0.0065	0.0048	0.021	ND
8/17/98				9.74	87.75	No sheen or odor	2.9	ND	0.0051	0.0045	0.0058	0.017	ND
11/16/98				10.14	87.35	No sheen Light sewerage odor	1.4	ND	0.0021	0.0019	0.0023	0.0048	ND
4/30/90	MW-3 (98.14)	27	20	N/A	N/A	No sheen/Mild petroleum odor	56	NA	3.6	8.6	1.3	7.2	NA
5/17/90				12.42	85.72	N/A	NA	NA	NA	NA	NA	NA	NA
9/26/90				13.50	84.64	No sheen/Mild petroleum odor	54	NA	5.1	0.42	1.6	8.0	NA

TABLE 1 CONT'D
GROUNDWATER MONITORING DATA (feet)
AND ANALYTICAL RESULTS (mg/L)

Date	Well No./ Elevation	Depth of Well	Perf. Length	Depth to Water	GW Elev.	Well Observation	TPHg	TPHd	B	T	E	X	MTBE
1/14/91	MW-3 (98.14)	27	20	12.58	85.56	Light sheen/Strong petroleum odor	35	NA	2.6	6.6	1.5	5.7	NA
7/03/91	(102.46) resurveyed			12.08	90.38	Rainbow sheen Strong petroleum odor	33	NA	4.12	4.3	1.4	4.8	NA
11/11/91				12.29	90.17	Very light rainbow sheen Mild petroleum odor	57	NA	3.9	8.4	2.1	14	NA
3/04/92	(102.18) resurveyed			10.26	91.92	Brown sheen Strong petroleum odor	57	NA	0.72	0.87	0.81	3.1	NA
6/01/92	(97.94) resurveyed			11.40	90.78	Rainbow sheen/Mild petroleum odor	50	NA	0.24	0.24	0.22	0.74	NA
9/28/92				12.64	89.54	Rainbow sheen spots Strong petroleum odor	64	NA	0.11	0.093	0.097	0.25	NA
1/11/93				10.10	92.08	Rainbow sheen/Mild petroleum odor	68	NA	0.21	0.28	0.36	0.99	NA
8/15/94				12.20	89.98	Brown sheen spots Mild petroleum odor	50	NA	0.87	1.2	1.3	3	NA
11/07/96				12.40	85.54	Very thin layer of brown sheen/Light petroleum odor	68	0.47	0.033	0.027	0.063	0.12	ND
2/12/97				10.23	87.71	Brown sheen spots Light petroleum odor	25	3.5	0.039	0.043	0.015	0.091	ND
6/16/97				11.79	86.15	Light brown sheen spots/Very light petroleum odor	9.7	ND	0.026	0.029	0.045	0.081	ND
9/30/97				9.40	88.54	No sheen or odor	6	1.6	0.043	0.036	0.012	0.11	ND

TABLE 1 CONT'D
GROUNDWATER MONITORING DATA (feet)
AND ANALYTICAL RESULTS (mg/L)

Date	Well No./ Elevation	Depth of Well	Perf. Length	Depth to Water	GW Elev.	Well Observation	TPHg	TPHd	B	T	E	X	MTBE
1/27/98	MW-3 (97.94)	27	20	9.80	88.14	No sheen or odor	0.38	0.56	0.0057	0.0041	0.0017	0.0091	ND
4/24/98				9.90	88.04	Rainbow sheen Light sewerage odor	ND	0.68	ND	ND	ND	ND	ND
8/17/98				11.46	86.48	No sheen or odor	16	ND	0.02	0.018	0.031	0.082	ND
11/16/98				12.40	85.54	Rainbow sheen Strong sewerage odor	68	ND	0.086	0.054	0.069	0.13	ND
7/03/91	STMW-1 (103.58)	19.50	11.50	11.00	92.58	Light rainbow sheen Mild petroleum odor	3.1	NA	0.61	0.062	0.039	0.15	NA
11/11/91	STMW-4 (renamed)			11.08	92.50	Light rainbow sheen Strong pet. odor	3.6	NA	0.99	0.015	0.0026	0.18	NA
3/04/92	(103.08) resurveyed			9.44	93.64	Brown sheen spots Mild petroleum odor	5	NA	0.035	0.02	0.022	0.071	NA
6/01/92	(98.80) resurveyed			10.32	92.76	No sheen Light petroleum odor	13	NA	0.14	0.045	0.063	0.21	NA
9/28/92				10.76	92.32	Brown sheen spots Mild petroleum odor	40	NA	0.035	0.02	0.048	0.11	NA
1/11/93				9.28	93.80	Brown sheen spots Mild petroleum odor	24	NA	0.026	0.088	0.092	0.28	NA
8/15/94				10.54	92.54	Light rainbow sheen spots/Light petroleum odor	9	NA	0.5	0.034	0.046	0.13	NA
11/07/96				10.37	88.43	Rainbow sheen spots Very light petroleum odor	13	0.18	0.04	0.0029	0.0078	0.019	ND

**TABLE 1 CONT'D
GROUNDWATER MONITORING DATA (feet)
AND ANALYTICAL RESULTS (mg/L)**

Date	Well No./ Elevation	Depth of Well	Perf. Length	Depth to Water	GW Elev.	Well Observation	TPHg	TPHd	B	T	E	X	MTBE
2/12/97	STMW-4 (98.80) resurveyed	19.50	11.50	9.36	89.44	Rainbow sheen spots Very light petroleum odor	5.3	5.7	0.095	0.0053	0.0059	0.018	ND
6/16/97				10.40	88.40	No sheen/Very light sewerage odor	5.3	ND	0.037	0.0062	0.0017	0.011	ND
9/30/97				8.50	90.30	No sheen or odor	2.7	ND	0.042	0.0077	0.0057	0.026	ND
1/27/98				8.90	89.90	No sheen or odor	3	0.3	0.06	0.017	0.012	0.049	ND
4/24/98				9.50	89.30	Rainbow sheen Strong sewerage odor	ND	ND	ND	ND	ND	ND	ND
8/17/98				10.36	88.44	Rainbow sheen Light petroleum odor	29	ND	0.036	0.024	0.059	0.16	ND
11/16/98				10.56	88.24	Rainbow sheen Strong sewerage odor	13	ND	0.026	0.021	0.02	0.041	ND
7/03/91	STMW-2 (101.99)	24	16	13.92	88.07	No sheen or odor	0.69	NA	0.099	0.081	0.019	0.098	NA
11/11/91	STMW-5 (renamed)			14.00	87.99	No sheen/Very light petroleum odor	0.41	NA	0.061	0.0024	0.0014	0.02	NA
3/04/92	(101.36) resurveyed			11.80	89.56	No sheen/Very light petroleum odor	0.46	NA	0.013	0.0065	0.011	0.018	NA
6/01/92				13.06	88.30	No sheen Mild petroleum odor	1.8	NA	0.027	0.02	0.021	0.043	NA
9/28/92				14.04	87.32	No sheen Mild sewerage odor	1.5	NA	0.014	0.0061	0.018	0.022	NA

**TABLE 1 CONT'D
GROUNDWATER MONITORING DATA (feet)
AND ANALYTICAL RESULTS (mg/L)**

Date	Well No./ Elevation	Depth of Well	Perf. Length	Depth to Water	GW Elev.	Well Observation	TPHg	TPHd	B	T	E	X	MTBE
1/11/93	STMW-5 (101.36) resurveyed	24	16	11.61	89.75	No sheen Light sewerage odor	0.8	NA	0.0018	0.003	0.0031	0.0094	NA
8/15/94				13.85	87.51	No sheen Mild sewerage odor	3	NA	0.32	0.062	0.034	0.22	NA
11/07/96	(97.14) resurveyed			13.67	87.51	Rainbow sheen spots Very light pet. odor	1.2	0.33	0.011	0.0017	0.0044	0.013	ND
2/12/97				12.07	85.07	Rainbow sheen spots Very light pet. odor	1	3.7	0.011	0.0017	0.0017	0.0097	ND
6/19/97				13.33	83.81	No sheen/Very light sewerage odor	0.95	2.3	0.0074	0.001	0.001	0.0072	ND
9/30/97				11.24	85.90	No sheen Light sewerage odor	0.71	1.1	0.0058	0.004	0.001	0.011	ND
1/27/98				11.64	85.50	No sheen Light sewerage odor	0.34	1.1	0.002	0.0018	0.0016	0.0082	ND
4/24/98				11.84	85.30	Rainbow sheen Strong sewerage odor	3.3	ND	0.012	0.0094	0.0085	0.037	ND
8/17/98				13.20	83.94	Rainbow sheen Light sewerage odor	5.3	ND	0.026	0.017	0.014	0.039	ND

**TABLE 1 CONT'D
GROUNDWATER MONITORING DATA (feet)
AND ANALYTICAL RESULTS (mg/L)**

Date	Well No./ Elevation	Depth of Well	Perf. Length	Depth to Water	GW Elev.	Well Observation	TPHg	TPHd	B	T	E	X	MTBE
11/16/98	STMW-5 (97.14) resurveyed	24	16	13.74	83.40	Rainbow sheen Strong sewerage odor	ND	ND	ND	ND	ND	ND	ND

TPHd - Total Petroleum Hydrocarbons as diesel

BTEX - Benzene, Toluene, Ethylbenzene, Total Xylenes

GW Elev. - Groundwater Elevation

ND - Not Detected

N/A - Not Applicable

TPHg - Total Petroleum Hydrocarbons as gasoline

MTBE - Methyl Tertiary Butyl Ether

Perf. - Perforation

NA - Not Analyzed

**TABLE 2
GROUNDWATER SAMPLES ANALYZED
FOR TOTAL LEAD (Pb) IN mg/L**


Date	Sample Number	Lead (Pb) Results
11/07/98	MW-1	Not Detected
	MW-2	Not Detected
	MW-3	Not Detected
	STMW-4	Not Detected
	STMW-5	Not Detected
2/12/97	MW-1	Not Detected
	MW-2	Not Detected
	MW-3	Not Detected
	STMW-4	Not Detected
	STMW-5	Not Detected
6/16/97	MW-1	Not Detected
	MW-2	Not Detected
	MW-3	Not Detected
	STMW-4	Not Detected
	STMW-5	Not Detected
9/30/97	MW-1	Not Detected
	MW-2	Not Detected
	MW-3	Not Detected
	STMW-4	Not Detected
	STMW-5	Not Detected
1/27/98	MW-1	Not Detected
	MW-2	Not Detected
	MW-3	Not Detected
	STMW-4	Not Detected
	STMW-5	Not Detected

TABLE 2 CONT'D
GROUNDWATER SAMPLES ANALYZED
FOR TOTAL LEAD (Pb) IN mg/L

Date	Sample Number	Lead (Pb) Results
4/24/98	MW-1	Not Detected
	MW-2	Not Detected
	MW-3	Not Detected
	STMW-4	Not Detected
8/17/98	MW-1	Not Detected
	MW-2	Not Detected
	MW-3	Not Detected
	STMW-4	Not Detected
	STMW-5	Not Detected
11/16/98	MW-1	Not Detected
	MW-2	Not Detected
	MW-3	Not Detected
	STMW-4	Not Detected
	STMW-5	Not Detected

A P P E N D I X "B"

ENVIRO SOIL TECH CONSULTANTS

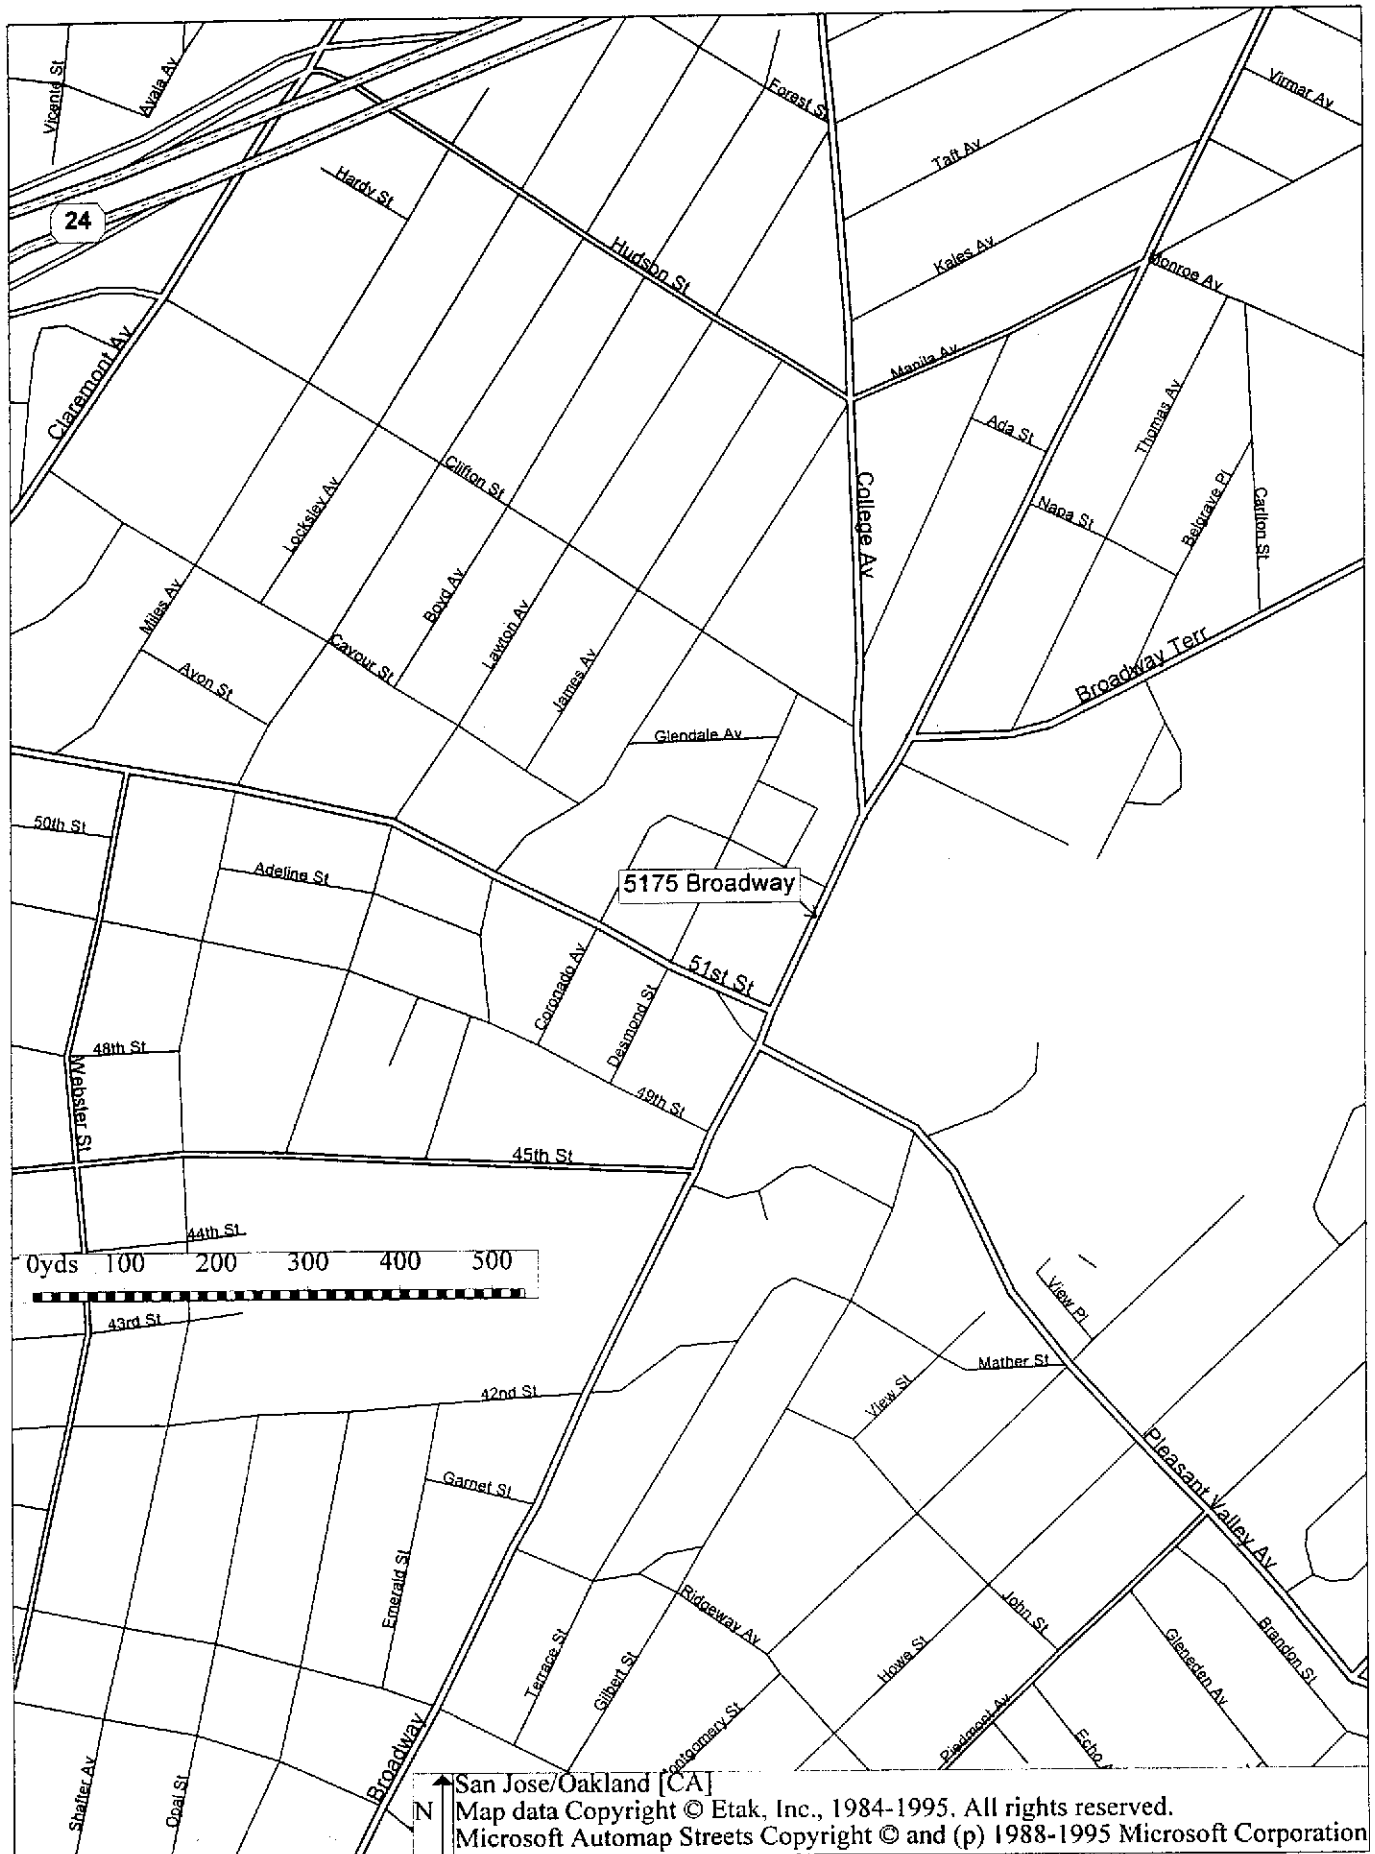

ENVIRO SOIL TECH CONSULTANTS


Figure 1

Approximate Direction
of Groundwater Flow
as of 11/16/98

CORONADO AVENUE



Residential Building

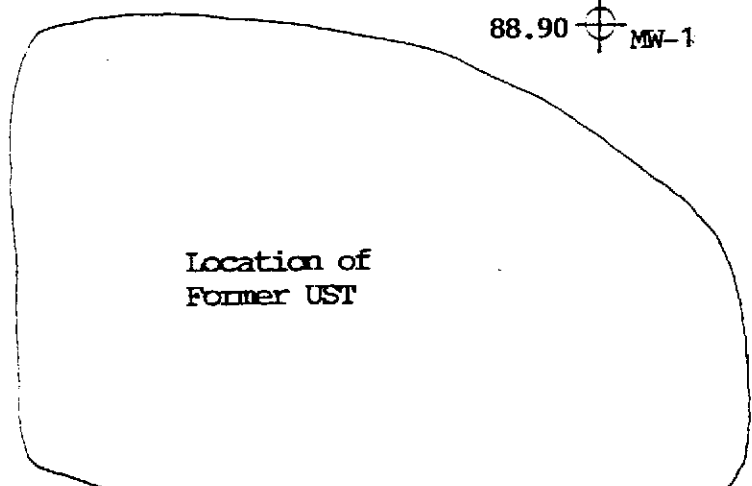

Location of
Former UST


88.90 MW-1

88.24 SIMW-4

87.35 MW-2

85.54 MW-3

83.94 SIMW-5

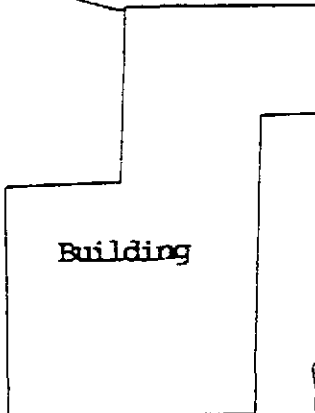

Building

Location of
Former UST

BROADWAY STREET

Commercial Building

Street
Flow Line

Monitoring Well

SCALE: 1"=20'

Figure 2

A P P E N D I X "C"

GROUNDWATER SAMPLING PROCEDURE

Prior to collection of groundwater samples, all of the sampling equipment (i.e. bailer, cables, bladder pump, discharge lines and etc...) was cleaned by pumping TSP water solution followed by distilled water.

Prior to purging, the well "Water Sampling Field Survey Forms" were filled out (depth to water and total depth of water column were measured and recorded). The well was then bailed or pumped to remove four to ten well volumes or until the discharged water temperature, conductivity and pH stabilized. "Stabilized" is defined as three consecutive readings within 15% of one another.

The groundwater sample was collected when the water level of the well recovered to 80% of its static level.

Forty milliliter (ml) glass volatile organic analysis (VOA) vials with Teflon septa were used as sample containers. The groundwater sample was decanted into each VOA vial in such a manner that there was a meniscus at the top. The cap was quickly placed over the top of the vial and securely tightened. The VOA vial was then inverted and tapped to see if air bubbles were present. If none were present, the sample was labeled and refrigerated for delivery under chain-of-custody to the laboratory. The label information would include a sample identification number, job identification number, date, time, type of analysis requested and the sampler's name.

A P P E N D I X "D"

ENVIRO SOIL TECH CONSULTANTS



PRIORITY ENVIRONMENTAL LABS

Precise Environmental Analytical Laboratory

November 24, 1998

PEL # 9811019

SOIL TECH ENGINEERING

Attn: Frank Hamedi

Re: Five water samples for Gasoline/BTEX with MTBE and Diesel analyses.

Project name: 5175 Broadway street, Oakland.

Project number: 8-90-420-GI

Date sampled: Nov 16, 1998


Date submitted: Nov 17, 1998

Date extracted: Nov 18-22, 1998

Date analyzed: Nov 18-22, 1998

RESULTS:

SAMPLE I.D.	MTBE (ug/L)	Gasoline (ug/L)	Diesel (ug/L)	Benzene (ug/L)	Toluene (ug/L)	Ethyl Benzene (ug/L)	Total Xylene (ug/L)
MW-1	N.D.	N.D.	N.D.	N.D.	N.D.	N.D.	N.D.
MW-2	N.D.	1400	N.D.	2.1	1.9	2.3	4.8
MW-3	N.D.	68000	N.D.	86	54	69	130
STMW-4	N.D.	13000	N.D.	26	21	20	41
STMW-5	N.D.	N.D.	N.D.	N.D.	N.D.	N.D.	N.D.
Blank	N.D.	N.D.	N.D.	N.D.	N.D.	N.D.	N.D.
Spiked Recovery	---	97.4%	81.8%	102.5%	90.6%	91.8%	104.3%
Detection limit	0.5	50	50	0.5	0.5	0.5	0.5
Method of Analysis	602	5030/ 8015	3510/ 8015	602	602	602	602

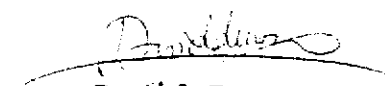
David Duong
Laboratory Director



PRIORITY ENVIRONMENTAL LABS

Precision Environmental Analytical Laboratory

November 24, 1998

PEL # 9811019

SOIL TECH ENGINEERING

Attn: Frank Hamedi

Re: Five water samples for total Lead analysis.

Project name: 5175 Broadway street, Oakland.

Project number: 8-90-420-GI

Date sampled: Nov 16, 1998


Date submitted: Nov 17, 1998

Date extracted: Nov 18-24, 1998

Date analyzed: Nov 18-24, 1998

RESULTS:

SAMPLE I.D.	Lead (mg/L)
MW - 1	N.D.
MW - 2	N.D.
MW - 3	N.D.
STMW - 4	N.D.
STMW - 5	N.D.
Blank	N.D.
Detection limit	0.10
Method of Analysis	7420

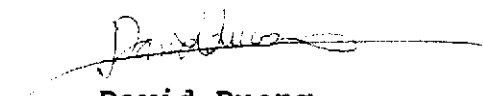
David Duong
Laboratory Director

PROJ. NO.		NAME				ANALYSES REQUESTED (2)				REMARKS	
8-90-420 GI		5175 Broadway Street, Oakland				TPH _H / BTEX TPH _d MIBE P.B.					
SAMPLERS: (Signature)											
Richard Manly											
NO.	DATE	TIME	SOIL	WATER	LOCATION	CON-TAINER					
1	11/14/98	10:00		✓	MW-1	3	✓	✓	✓	✓	
2		12:00		✓	MW-2	3	✓	✓	✓	✓	
3		14:00		✓	MW-3	3	✓	✓	✓	✓	
4		16:00		✓	STMW-4	3	✓	✓	✓	✓	
5	✓	18:00		✓	STMW-5	3	✓	✓	✓	✓	
PEL # 9811019 INV # 28630											
Relinquished by: (Signature)			Date / Time		Received by: (Signature)			Relinquished by: (Signature)		Date / Time	
Richard Manly			11/17/98 15:00								
Relinquished by: (Signature)			Date / Time		Received by: (Signature)			Relinquished by: (Signature)		Date / Time	
Relinquished by: (Signature)			Date / Time		Received for Laboratory by: (Signature)			Date / Time		Remarks	
					[Signature] 11-17-98			3:00 PM		P. E. L.	



ENVIRO SOIL TECH CONSULTANTS
 Environmental & Geotechnical Consultants
 111 TULLY ROAD, SAN JOSE, CALIFORNIA 95111
 Tel: (408) 297-1500 Fax: (408) 292-2116