

#### Consulting Engineers

P.O. BOX 996 • BENICIA, CA 94510 (707) 746-6915 • (707) 746-6916 • FAX: (707) 746-5581 MAR 1 9 1990 RONALD E. BOCK

KEI-J89-1106.R5
March 6, 1990

Unocal Corporation 2175 N. California Blvd., Suite #650 Walnut Creek, CA 94596

Attention: Mr. Tim Ross

RE: Follow-up Soil Sampling Report

Unocal Service Station #3072 2445 Castro Valley Blvd. Castro Valley, California

Dear Mr. Ross:

RECEIVED

2:35 pm, Apr 23, 2009

Alameda County Environmental Health

This follow-up report summarizes the additional soil sampling performed by Kaprealian Engineering, Inc. (KEI) at the referenced site. All work was performed in compliance with the guidelines established by the Regional Water Quality Control Board (RWQCB), and the Alameda County Health Care Services (ACHCS).

The scope of the work performed by KEI consisted of the following:

Coordination with regulatory agencies.

Collection of samples of native soil from the product pipe trenches.

Delivery of samples, including proper Chain of Custody documentation, to a certified analytical laboratory.

Technical review of field data and laboratory analyses, and preparation of this report.

#### SITE DESCRIPTION AND BACKGROUND

The subject site is presently used as a gasoline station. The service station site occupies the southwest corner at the intersection of Castro Valley Boulevard and Strobridge Avenue in Castro Valley, California. A Site Location Map and Site Plans are attached.

On November 14, 1989, KEI collected soil samples following the removal of three fuel storage tanks and one waste oil tank at the The soil samples under the fuel storage tanks referenced site. were collected at a depth of 13.5 feet. The soil sample under the waste oil tank was collected at a depth of 10.5 feet. soil samples were analyzed by Sequoia Analytical Laboratory in Redwood City, California. The samples under the fuel storage tanks were analyzed for total petroleum hydrocarbons (TPH) as gasoline, and benzene, toluene, xylenes and ethylbenzene (BTX&E). In addition, the two samples from under the diesel tank were analyzed for TPH as diesel. Analytical results showed TPH as gasoline ranging from non-detectable to 11 ppm, with non-detectable BTX&E concentrations in each case. TPH as diesel concentrations were non-detectable for the two diesel tank bottom samples. The soil sample from under the waste oil tank was analyzed for TPH as gasoline, BTX&E, TPH as diesel, TOG, EPA method 8010, 8270 compounds, and the metals cadmium, chromium, lead and zinc. Laboratory analyses showed TPH as gasoline at 5.9 ppm, metals ranging from non-detectable to 45 ppm, 55 ppb of 1,1-dichloroethene, and non-detectable levels of all other constituents analyzed.

On November 16, 1989, KEI collected six sidewall soil samples, designated as SW1 through SW6, and a water sample, designated as W1, from the fuel tank pit. The tank pit water level was measured to be 11.5 feet below the ground surface. The sidewall soil samples were collected approximately 6 to 12-inches above the tank pit water level. All samples were analyzed for TPH as Three of the six sidewall soil samples gasoline and BTX&E. (labeled SW2, SW3 and SW4) and the water sample were also analyzed for TPH as diesel. Laboratory analyses of the soil samples showed TPH as qasoline ranging from non-detectable to 29 ppm for four of the six samples, with samples SW1 and SW4 showing 140 and 160 ppm, respectively. TPH as diesel levels were nondetectable for two of the sidewall samples with sample SW4 showing 24 ppm. Analyses of the water sample showed 11,000 ppb TPH as diesel, 26,000 ppb TPH as gasoline, and 670 ppb benzene. Soil sample point locations are shown on the attached Site Plan, Laboratory results are summarized in Tables 1 and 2. Laboratory analyses and Chain of Custody documentation are also attached.

On November 28, 1989, KEI returned to the site to meet with the representative of the Alameda County Health Agency (ACHA) to clarify ACHA guidelines as applied to the subject site for fuel tank pit excavation and sampling. In response to the meeting, KEI submitted a Phase I work plan (KEI-P89-1106.P1) dated November 30, 1989, to define the extent of contamination in the

vicinity of the tank pit. The work plan was approved by the ACHA in a letter dated December 8, 1989.

On December 22, 1989, KEI returned to the site to collect additional sidewall soil samples after further excavation. Soil was excavated from the north, east and south sides of the pit. Sidewall soil samples were collected at depths of approximately 9 or 11 feet, and analyzed on-site by Mobile Chem Labs, Inc., of Lafayette, California, a state-certified mobile laboratory. After excavation, TPH as gasoline was detected at concentrations of 1,500 and 1,900 ppm on the northerly wall of the pit, at concentrations ranging from 3.0 to 1,700 ppm on the easterly wall, and at 410 ppm on the southerly wall. Results of the laboratory analyses are summarized in Table 3. Laboratory analyses and Chain of Custody documentation are attached. The additional areas excavated and sample point locations are as shown on the attached Site Plan, Figure 2.

On January 18 and 19, 1990, three monitoring wells were drilled at the site in order to establish ground water flow direction. Water level data acquired indicate ground water flows generally in the south-southeasterly direction. Well locations are shown on the attached Site Plan, Figure 3.

#### FIELD ACTIVITIES

KEI's field work was conducted on February 14, 1990, when three samples, labeled P1, P2 and P3, were collected of native soil from the product pipe trenches at depths ranging from 2.5 to 4.0 feet. Samples were collected using a driven tube-type sampler. Samples were placed in clean, two-inch diameter brass tubes, sealed with aluminum foil, plastic caps and tape, and stored in a cooled ice chest for delivery to a certified laboratory. Sample locations are as shown on the attached Site Plan, Figure 4. Soil sampling was witnessed by Mr. Scott Seery of the ACHCS.

#### SUBSURFACE CONDITIONS

The subsurface soils exposed in the pipe trench excavations consisted primarily of clay materials.

#### ANALYTICAL RESULTS

The pipe trench samples were analyzed by Sequoia Analytical Laboratory in Redwood City, California and were accompanied by properly executed Chain of Custody documentation. All soil samples were analyzed for total petroleum hydrocarbons (TPH) as gasoline using EPA method 5030 in conjunction with modified 8015, and benzene, toluene, xylenes and ethylbenzene (BTX&E) using EPA method 8020.

Analytical results of the soil samples, (P1, P2 and P3), collected from the product pipe trench, indicate levels of TPH as gasoline ranging from 6.0 to 87 ppm. The analytical results are summarized in Table 4. Copies of the laboratory analyses and the Chain of Custody documentation are attached to this report.

#### RECOMMENDATIONS

The recommended additional work outlined in KEI's work plan (KEI-P89-1106.P2) dated January 8, 1990, remains unchanged. KEI is actively working toward obtaining permission from Caltrans for the installation of exploratory borings.

#### DISTRIBUTION

A copy of this report should be sent to Mr. Scott Seery of the ACHCS, and to the RWQCB, San Francisco Bay Region.

#### **LIMITATIONS**

Soil deposits and rock formations may vary in thickness, lithology, saturation, strength and other properties across any site. In addition, environmental changes, either naturally-occurring or artificially-induced, may cause changes in the extent and concentration of any contaminants. Our studies assume that the field and laboratory data are reasonably representative of the site as a whole, and assume that subsurface conditions are reasonably conducive to interpolation and extrapolation.

The results of this study are based on the data obtained from the field and laboratory analyses obtained from a state certified laboratory. We have analyzed this data using what we believe to be currently applicable engineering techniques and principles in the Northern California region. We make no warranty, either expressed or implied, regarding the above, including laboratory analyses, except that our services have been performed in accordance with generally accepted professional principles and practices existing for such work.

Should you have any questions regarding this report, please feel free to call me at (707) 746-6915.

Sincerely,

Kaprealian Engineering, Inc.

Richard M. Bradish Staff Engineer

Don R. Braun

Certified Engineering Geologist

License No. 1310 Exp. Date 6/30/90

Mardo Kaprealian

President

jad

Attachments: Tables 1, 2, 3 & 4

undo Kyrolo

Location Map

Site Plans - Figures 1, 2, 3 & 4

Laboratory Analyses

Chain of Custody documentation

٠.

٠.

TABLE 1
SUMMARY OF LABORATORY ANALYSES
SOIL

(Samples collected on November 14 & 16, 1989)

<u>Sample</u>	Depth (feet)	TPH as <u>Diesel</u>	TPH as <u>Gasoline</u>	Benzene	Toluene	Xylenes	Ethyl- <u>benzene</u>
A1	13.5	ND	2.4	ND	ND ND		ND
A2	13.5	ND	ND	ND	ND	ND	ND
B1	13.5		1.9	ND	ND	ND	ND
B2	13.5		11	ND	ND	ND	ND
C1	13.5		1.5	ND	ND	ND	ND
C2	13.5		7.5	ND	ND	ND	ND
SW1	10.5		140	0.31	0.12	3.0	0.88
SW2	10.5	ND	ND	ND	ND	ND	ND
SW3	10.5	ND	ND	ND ND		ND	ND
SW4	9.5	24	160	0.33 6.4		30	9.4
SW5	9.5		3.5	0.06	0.27	0.76	0.19
SW6	10		29	0.12	0.21		
WO1(11)	* 11	ND	5.9	ND	ND	ND	ND
Detection Limits	on	1.0	1.0	0.05	0.1	0.1	0.1

<sup>\*</sup> TOG and all 8270 constituents were non-detectable. All 8010 constituents were non-detectable except 1,1-dichloroethene at 55 ppb. Metals concentrations were as follows: cadmium 2.5 ppm, chromium 39 ppm, lead 1.1 ppm, and zinc 45 ppm.

ND = Non-detectable.

Results in parts per million (ppm), unless otherwise indicated.

## TABLE 2

# SUMMARY OF LABORATORY ANALYSES WATER

(Sample collected on November 16, 1989)

Sample #	TPH as <u>Diesel</u>	TPH as <u>Gasoline</u>	<u>Benzene</u>	<u>Toluene</u>	<u>Xylenes</u>	Ethyl- <u>benzene</u>
W1	11,000	26,000	670	1,100	9,100	120
Detection Limits	50.0	30.0	0.3	0.3	0.3	0.3

Results in parts per billion (ppb), unless otherwise indicated.

TABLE 3
SUMMARY OF LABORATORY ANALYSES
SOIL

(Samples collected on December 22, 1989)

<u>Sample</u>	Depth (feet)	TPH as <u>Diesel</u>	TPH as <u>Gasoline</u>	<u>Benzene</u>	<u>Toluene</u>	<u>Xylenes</u>	Ethyl- <u>benzene</u>
SW1(17)	11	ND	1,900	14	24	120	28
SW2(17)	11	ND	1,500	17	17 29		23
SW7	9	ND	1,700	16	33	110	26
SW8	9	ND	200	2.6	0.9	7.7	5.0
SW3(13)	9	ND	690	11	11	28	11
SW9	9	ND	3.0	0.2	0.1	0.1	ND
SW10	9	ND	500	4.0	5.9	22	6.9
SW4 (11)	9	ND	410	2.7	3.9	19	3.8
Detection Limits	on	1.0	1.0	0.1	0.1	0.1	0.1

ND = Non-detectable.

Results in parts per million (ppm), unless otherwise indicated.

TABLE 4

SUMMARY OF LABORATORY ANALYSES

(Samples collected on February 14, 1990)

Sample	Depth <u>(feet)</u>	TPH as <u>Gasoline</u>	<u>Benzene</u>	<u>Toluene</u>	<u>Xylenes</u>	Ethylbenzene
P1	4.0	87	0.33	0.17	10	2.3
P2	2.5	6.0	0.23	ND	0.33	0.11
Р3	3.0	10	0.47	0.11	1.1	0.32
Detec Limit		1.0	0.05	0.1	0.1	0.1


ND = Non-detectable.

Results in parts per million (ppm), unless otherwise indicated.



## Consulting Engineers

PO BOX 996 • BENICIA. CA 94510 (707) 746-6915 • (707) 746-6916 • FAX. (707) 746-5581

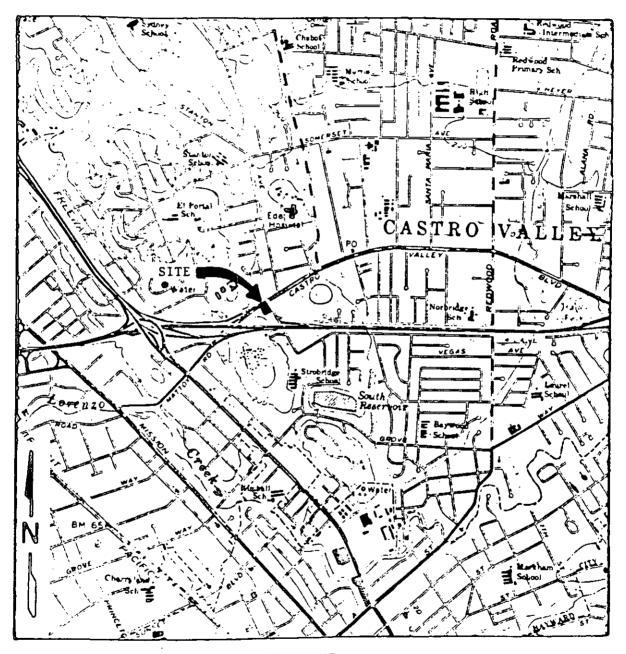


LOCATION MAP

Unocal Service Station #3072 2445 Castro Valley Blvd. Castro Valley, California



## **Consulting Engineers**

P.O. BOX 996 • BENICIA, CA 94510 (707) 746-6915 • (707) 746-6916 • FAX: (707) 746-5581

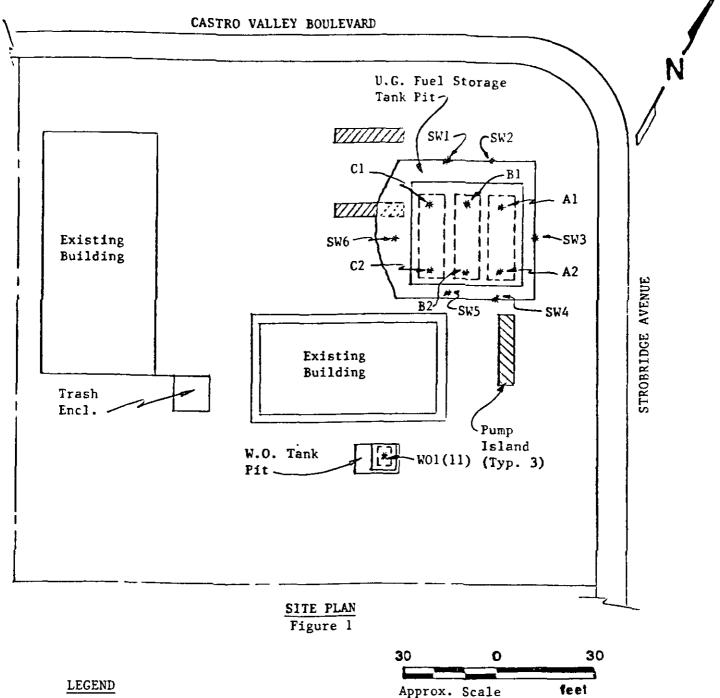


\* Sample Point Location

Unocal S/S #3072 2445 Castro Valley Blvd. Castro Valley, CA



#### Consulting Engineers

P.O. BOX 996 • BENICIA, CA 94510 (707) 746-6915 • (707) 746-6916 • FAX: (707) 746-5581

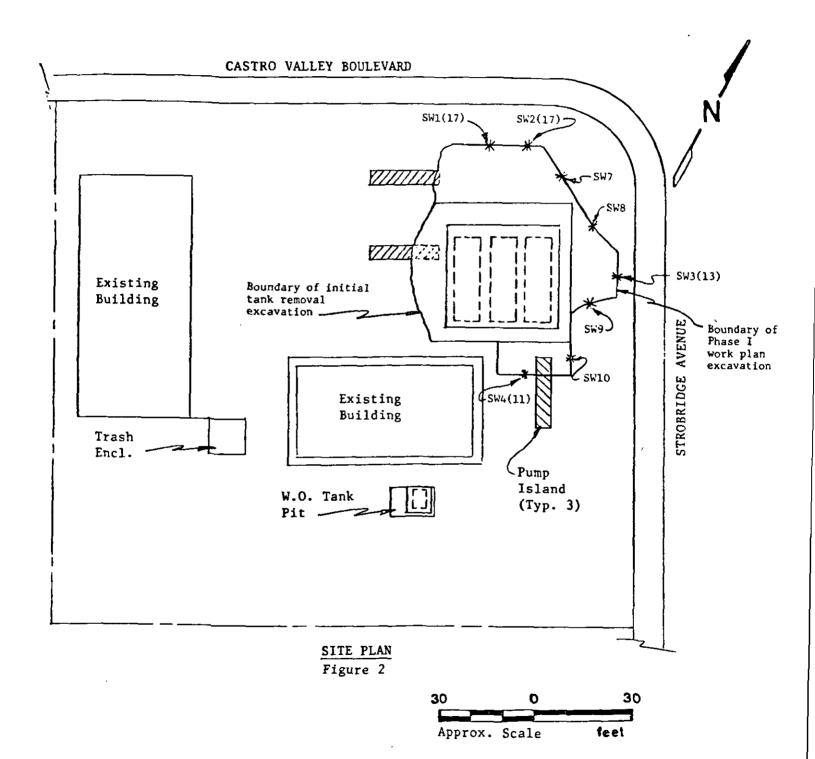

## LEGEND


\* Sample Point Location

Unocal S/S #3072 2445 Castro Valley Blvd. Castro Valley, CA



#### Consulting Engineers

P.O. BOX 996 • BENICIA, CA 94510 (707) 746-6915 • (707) 746-6916 • FAX. (707) 746-5581

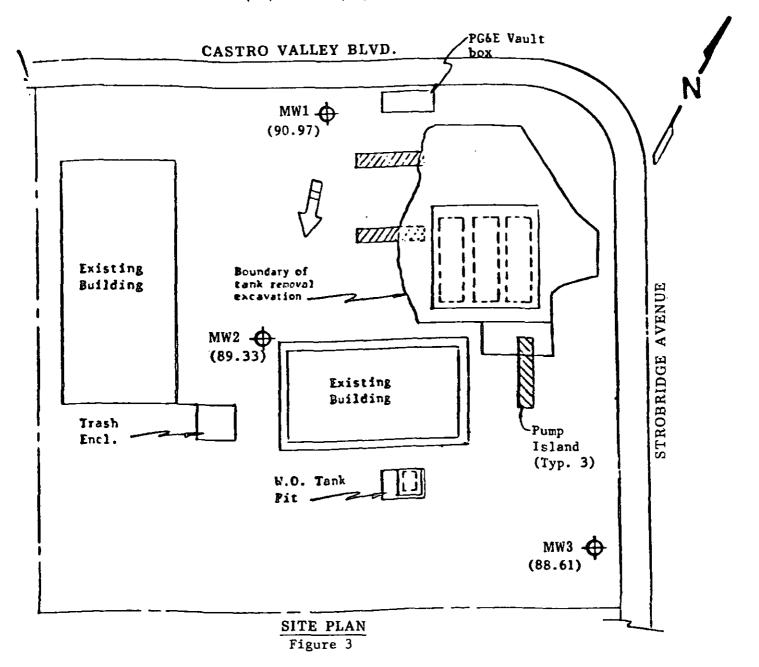

#### **LEGEND**



#### Monitoring Well

() Ground water elevation on 1/24/90. Elevation at top of MWl well cover assumed 100.00' as datum.

Direction of ground water flow




Unocal Service Station #3072 2445 Castro Valley Blvd. Castro Valley, California




#### Consulting Engineers

PO. BOX 996 • BENICIA, CA 94510 (707) 746-6915 • (707) 746-6916 • FAX: (707) 746-5581

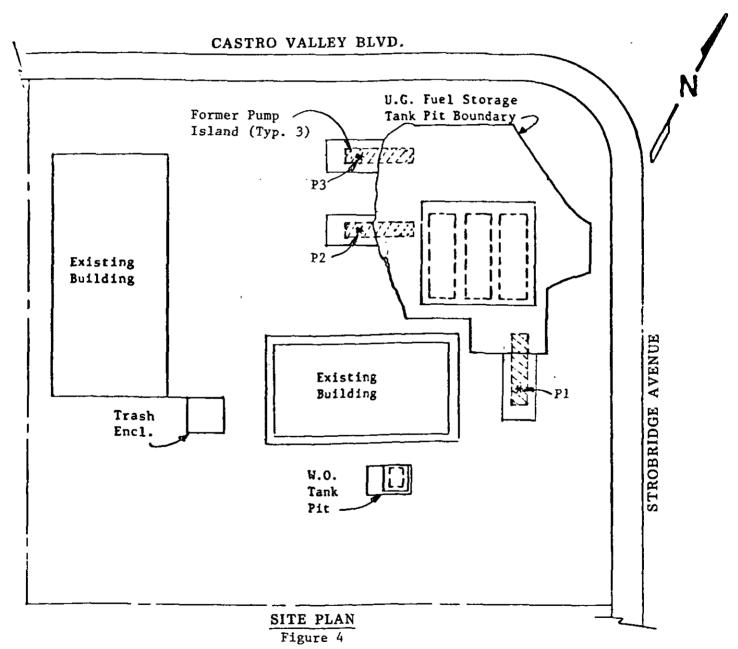

## LEGEND

\* Sample Point Location

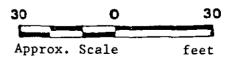

Unocal Service Station # 3072 2445 Castro Valley Blvd. Castro Valley, California



680 Chesapeake Drive • Redwood City, CA 94063 (415) 364-9600 • FAX (415) 364-9233

Kaprealian Engineering, Inc.

P.O. Box 996

Benicia, CA 94510 Attention: Mardo Kaprealian, P.E. Client Project ID:

Analysis Method:

Unocal #3072, Castro Valley, 2445 C V Blvd.

vd. S

Sampled: Feb 14, 1990

Matrix Descript: Soil

EPA 5030/8015/8020

Received: Analyzed: Feb 14, 1990 Feb 15, 1990

First Sample #: 002-1879

Reported:

Feb 16, 1990

## TOTAL PETROLEUM FUEL HYDROCARBONS with BTEX DISTINCTION (EPA 8015/8020)

Sample Number	Sample Description	Low/Medium B.P. Hydrocarbons mg/kg (ppm)	Benzene mg/kg (ppm)	Toluene mg/kg (ppm)	Ethyl Benzene mg/kg (ppm)	<b>Xylenes</b> mg/kg (ppm)	
002-1879	P1	87	0.33	0.17	2.3	10	
002-1880	P2	6.0	0.23	N.D.	0.11	0.33	
002-1881	P3	10	0.47	0.11	0.32	1,1	

Low to Medium Boiling Point Hydrocarbons are quantitated against a gasoline standard. Analytes reported as N.D. were not present above the stated limit of detection.

**SEQUOIA ANALYTICAL** 

Belinda C. Vega <sup>4</sup> Project Manager



# Kaprealian Engineering, Inc.

## CHAIN OF CUSTODY

SAMPLER	INESSING AGENCY  LANGO COUNTY HEALTH Carles Valley				is o		ANALYSES REQUESTED					TURN AROUND TIME:					
MITHESSING I	SCENCY EERY COURTY	HEALT	2. C	445	Ca	Va	200	Valla	7 1300	<i>₽</i>	P4-6 1871		     	 	     	 	
SAMPLE ID NO.	DATE	TIME	     soil	    water	GRAB	COMP	NO. OF CONT.		SAMPLING LOCATION		7-md1	i i	;   		   	     	REMARKS
PI Pz	2-14-90		~ ~	    			(	Person	P.PETE	Eall H	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \		     <del></del>				021879 001980
P3	u	<u> </u>	1 ~	   		i - I		<b>1</b>	**	<b>84</b>	V	   	   	 	1	- <del></del>	921981
 	\ \ \ \	 <del> </del>	 <del> </del>	\ <del> </del> 				 			 	1 <del> </del> 	 <del> </del> 		<del> </del>   <del> </del>		
}	1	1	 	1 		 		   				   	   			   	
 	   	 	   	   	     	     		 			   	   	   	<u> </u>	 	<del>-</del>	
Rel inquished	1. 130	adis	4/	ate/Timat	)	Í <del> </del>	teceiv	ed by: (Signature)  The following MUST BE completed by the laboratory accept for analysis:  1. Have all samples received for analysis been stored to by: (Signature)					İ				
Relinquished	· · · · · · · · · · · · · · · · · · ·	· <u></u>	i <del></del>	ate/Tie	<del>-</del>	+		ed by: (Si		·	i	Will samples remain refrigerated until analyzed?      Did any samples received for analysis have head space?					
  Relinquished		<del></del>	<u>i</u>	ate/Ti		j +		ed by: (S	ignature)	) uper	4. Were samples in appropriate containers and property packages for analysis have head space?  4. Were samples in appropriate containers and property packages for analysis have head space?				containers and property packaged?		