

January 16, 1998

Ms. Susan Hugo Alameda County Health Care Services Agency Environmental Health Services Environmental Protection (LOP) 1131 Harbor Bay Parkway, Suite 250 Alameda CA 94502-6577

Re: Response to Comments

July 25, 1997 Subsurface Investigation Report 1300 Powell Street Emeryville, California 94608 SLIC #322

Dear Ms Hugo:

Cambria Environmental Technology, Inc. (Cambria) is pleased to write this letter on behalf of Mr. Richard Becker in response to your October 1, 1997 letter regarding Cambria's July 25, 1997 Subsurface Investigation Report. Please find below responses to the concerns presented in your letter.

DISCUSSION

Comment # 1 From October 1, 1997 Letter

ENVIRONMENTAL

CAMBRIA

TECHNOLOGY, INC.

1144 65TH STREET,

SUITE B

OAKLAND,

CA 94608

PH: (510) 420-0700

Fax: (510) 420-9170

Elevated concentrations of total petroleum hydrocarbons (TPH) as diesel (17,900 ppb) and TPH as motor oil (24,000 ppb) were detected in the grab groundwater samples collected from the down gradient boring CB-3 located west along the property boundary. Polynuclear aromatic hydrocarbons (PNAs), benzene, toluene, ethyl benzene, and xylenes (BTEX) were not analyzed in the ground water. Please explain the rationale why these target compounds were not analyzed in any of the four grab water samples as proposed in the approved work plan. The absence of these chemicals of concern in groundwater is one of the criteria used to evaluate the site as a low risk fuel case.

CAMBRIA

Response # 1

In accordance with page three of Cambria's September 18, 1997 Investigation Workplan, only the initial sample was to be tested for the complete suite of analyses. Results of these analyses were used to characterize the contaminants of concern and determine which analyses should be conducted on remaining samples. The soil sample chosen to be tested for the complete suite (CB-4 at 5 ft) was collected near the location of the previous investigation's highest concentrations (B-2 at 5 ft, Figure 1). Because there were no detectable concentrations of TPH as gasoline, BTEX, PNAs, or volatile organic compounds (VOCs)in the initial screening sample, subsequent samples were not tested for these analytes. In addition, because no BTEX was detected in the initial samples, it is very unlikely that soluble BTEX exists in groundwater.

Comment # 2 From October 1, 1997 Letter

Please evaluate the presence of storm drains and utility lines at the site which may be acting as preferential conduits for groundwater contamination to migrate on and/or off-site. Soil samples collected from twelve borings (CB-1 to CB-12) at 3.0-5.0 feet bgs showed low levels of TPH diesel (nd-2 10 ppm) and TPH as motor oil (nd-450 ppm).

Response # 2

Subsurface utilities beneath the site exist solely on the eastern upgradient portion of the site and are shown on Figure 1.¹ Because none of these potential conduits are located beneath or downgradient of the areas with elevated hydrocarbon concentrations in soil, it is unlikely that preferential migration is transporting the low mobility diesel or petroleum oil and grease (POG) downgradient of the site.

Comment # 3 From October 1, 1997 Letter

Please identify any sensitive receptors (i.e., water wells, deeper drinking water aquifers and surface water) that are likely to be impacted by the groundwater contamination at the site.

Utility locations and depths provided by Richard Becker.

CAMBRIA

Response #3

Cambria performed a ½-mile radius area well survey for a property located at 5813 Shellmound Street (Attachment A). This site is located approximately 1,600 ft downgradient of the subject site. The survey radius covers approximately one mile downgradient and 1,000-ft upgradient of the subject site. The only well located within the survey radius, owned by Griffin and Skelly, is located approximately ½-mile up/cross gradient of the subject site. No drinking water aquifers exist near the site and the nearest surface water is the San Francisco Bay, located approximately ½-mile downgradient of the subject site. In addition, ground water samples collected from 1603 Powell Street contain total dissolved solids (TDS) concentrations of up to 7,210 parts per million (ppm), well above the 3,000 ppm limit. This shallow aquifer is not likely to be used as a potential drinking water source because the TDS concentrations exceed acceptable limits (Attachment B).

Comment # 4 From October 1, 1997 Letter

The extent of the groundwater contamination has not been adequately defined. Please provide our office with a brief work plan to characterize the extent of the hydrocarbon plume. Data collected from adjacent or nearby sites may be used to determine the extent of the contamination.

Response # 4

Analysis of grab ground water samples collected from on-site soil borings suggests that ground water beneath the site has been impacted by low to moderate concentrations of low mobility petroleum hydrocarbons, including TPH as diesel (TPHd), TPH as motor oil (TPHmo), and petroleum oil and grease (POG). In addition, the boring logs from both the Cambria July 1997 report and the Lush Geosciences (Lush) April 1995 report show that the site is underlain by interbedded low to moderate permeability fluvial deposits. The low permeability of the soils and the low mobility of the contaminants, in conjunction with the absence of known subsurface preferential pathways, suggest it is unlikely that the hydrocarbons have migrated significantly downgradient of the site.

The majority of the samples collected during both the Lush and Cambria investigations contained greater than 15% clay. A conservative estimate of the hydraulic conductivity of a soil containing 15% clay would

CAMBRIA

be about 1E-5 cm/s.² This hydraulic conductivity value is equivalent to about 0.5 ft/yr of ground water transport. Transport velocities of the low mobility petroleum hydrocarbons detected beneath the site would be much less due to adsorption and natural biodegradation. Therefore, since groundwater has migrated about 40 ft downgradient since Pennzoil occupied the site in the 1920s (78 yrs, 0.5 ft/yr), the low mobility hydrocarbons have probably not migrated more than 10 ft downgradient.

As you requested, Cambria reviewed an October 1994 Vista report (prepared for the nearby property located at 5813 Shellmound street) to assess whether any downgradient sites could be used to define the extent of the plume beneath the Becker property.³ No sites with ground water monitoring wells exist immediately downgradient of the site. We also visited the 1400 Powell Street Unocal station to check for monitoring wells. We did not locate any monitoring wells, and the Alameda County Health Care Services Agency - Environmental Health Services (ACHCSA-EHS) verified that the site is not on the ACHCSA-EHS local oversight program (LOP) list. The two known sites with monitoring wells are located about 1,600 ft downgradient of the site at 1603 Powell Street and 5813 Shellmound Street. The groundwater beneath both of these sites is impacted with hydrocarbons at concentrations similar to the subject site and both sites have known onsite hydrocarbon sources (Attachment B). The subject site does not pose a threat to a drinking water resource because the ground water downgradient of the Becker property contains TDS above acceptable concentrations and hydrocarbons from other sources.

Based on the rationale presented above, Cambria does not recommend any additional investigation.

Groundwater, Freeze and Cherry, 1979, Prentice-Hall, Inc. Englewood Cliffs, New Jersey, Page 29.

VISTA Environmental Information, Site Assessment Plus Report, October 13, 1994, Report ID: 056335-001.

CAMBRIA

CLOSURE REQUEST

Cambria trusts that the discussion above addresses all of the concerns presented in your October 1, 1997 letter, and that you will consider granting regulatory case closure based on the following rationale:

- Hydrocarbon concentrations in soil are defined to within 1,000 ppm, a common regulatory guideline, to the east, west, south, and most of the northern property line;
- The constituents of concern consist of POG, TPHd, and TPHmo. These hydrocarbons present very little risk to human health and the environment due to their low mobility, low volatility, and low toxicity;
- The site is located in an industrial area with numerous sites containing more highly impacted soil and groundwater;
- It is very unlikely that any remedial effort besides natural hydrocarbon biodegradation would be feasible to address the low hydrocarbon concentrations;
- Forensic analyses indicate that hydrocarbon biodegradation is occurring, indicating that hydrocarbon concentrations should diminish over time;
- The affected ground water does not have a present or known future beneficial use and likely contains dissolved solids above acceptable regulatory thresholds;
- No sensitive receptors exist downgradient of the site; and
- Since the majority of the soils beneath the site contain greater than 15% clay, it is unlikely that hydrocarbons have migrated more than 10 ft downgradient of the property boundary.

CLOSING

We appreciate this opportunity to provide environmental consulting services to Richard and Julia Becker. Please call me at (510) 420-3307 with any questions or comments.

Sincerely,

Cambria Environmental Technology, Inc.

David Elias, RG Senior Geologist No. 6534

Attachments: A - Area Well Survey


B - Analytic Data 1603 Powell Street and 5813 Shellmound Street

C - Partial Vista Report

CC:

Richard Becker, 1300 Powell Street, Emeryville, CA 94608 Julie Rose, Randick & O'Dea, 1800 Harrison Street, Suite 2350, Oakland, CA 94612

F:\PROJECT\CONSERV\Becker Resp.WPD

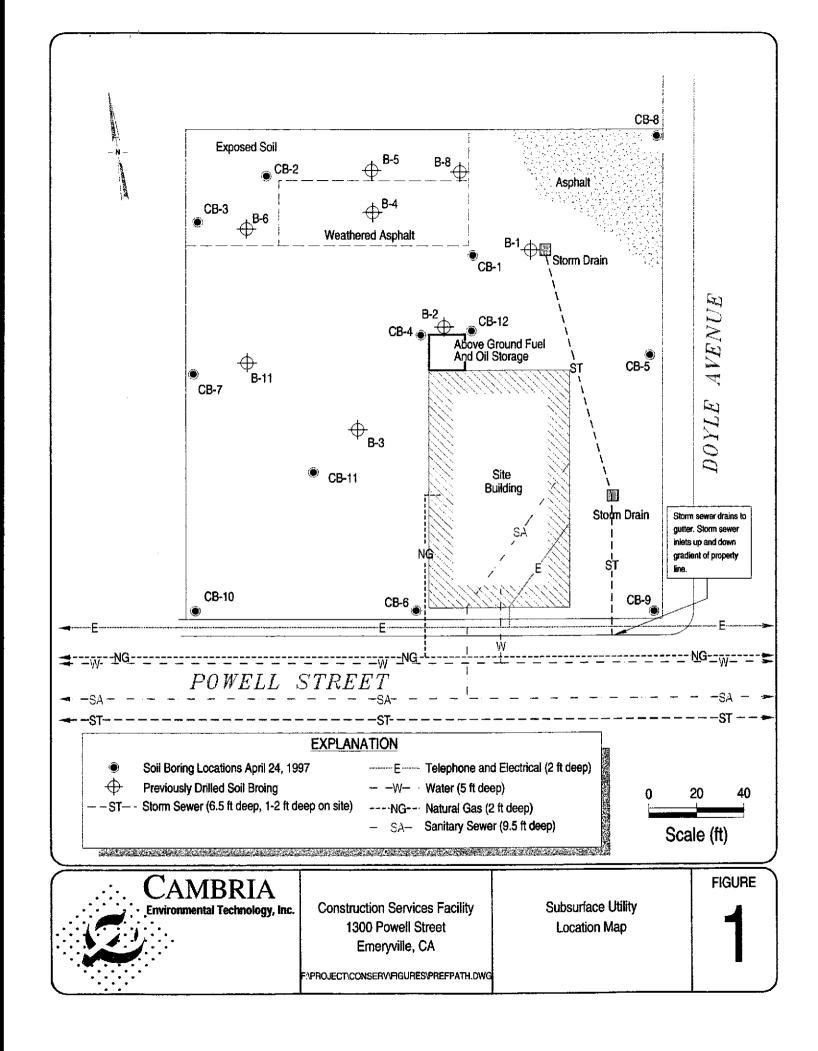

ATTACHMENT A

Area Well Survey



21 November 1997

CAMBRIA ENVIRONMENTAL TECHNOLOGY 1144 65th St, Suite B Oakland, CA 94608

Attn: Ms. Ann Crum

Re: Site Name:

Lathrop Property

Site Address:

5813-5815 Shellmound St, Emeryville, CA

Project #:


Dear Ms. Crum:

Banks Information Solutions, Inc. (Banks) in conjunction with Vista Information Solutions, Inc. has completed your request for a water well search of all known groundwater wells located within a one-half (1/2) mile radius of the above referenced site. Banks requested access to all available records, database information, and quadrangle maps maintained by the California Department of Water Resources, Central District, located in Sacramento, CA. The department approved our request and provided a water well drillers report for wells that fall within your area of review. Banks has located any wells that fall within your area on the enclosed U.S.G.S. 7.5' topographic map. Upon review of the information provided, Banks located the following wells within your area of review.

Map#	State I.D.	Owner	Туре	Total Depth	Date
1	15/4w - 15L	Griffin and Skelly	Unknown	213'	00/00/00

Following is an excerpt from the California Water Code, Section 13752:

The following opinion was released on March 30, 1970 from the office of Chief Counsel Porter A. Towner, Department of Water Resources: ".... Section 13752 (California Water Code) provides that the information in the logs and reports 'shall not be made available for inspection by the public but shall be made available to governmental agencies for use in making studies: provided, that any report shall be made available to any person who obtains a written authorization from the owner of the water well.' When a governmental agency hires you as a consultant, that agency can release the information in the log to you for use in a study, but you would be subject to the same limitations as the public agency. Publication of specific items of information from the well reports, including the well logs, without the consent of the owners, is prohibited. You may publish discussions of ground water conditions in an area described by section, township, and range, even though the conditions were established in whole or in part from studies of well reports. Reference to a specific well must be omitted if the information is derived from the report rather than an independent source. The best way for making the information available without restriction and to use it in a public report is to obtain written releases from the owners of the wells."

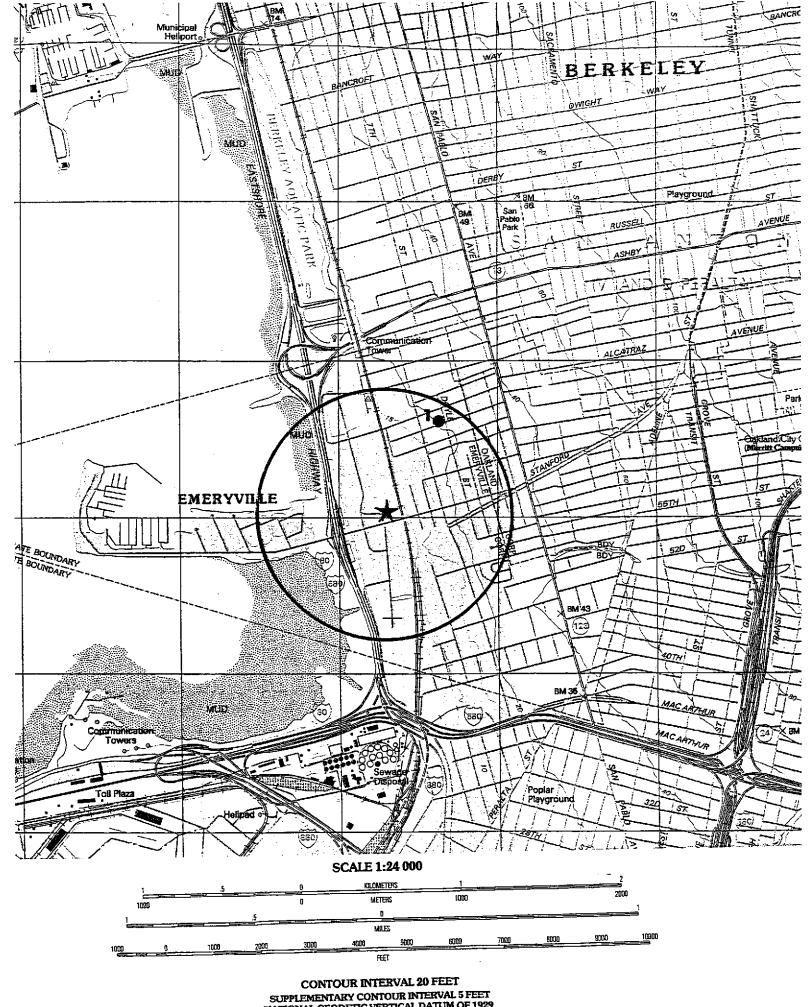

NATIONAL GEODETIC VERTICAL DATUM OF 1929

BANKS INFORMATION SOLUTIONS, INC.

P.O. Box 12851 Capitol Station ■ Austin, Texas 78711 512/478-0059

WATER WELL SEARCH

MAP REFERENCE NUMBER 1

31.3M.			state of Californ NT OF WATER	. '	- Maiss	4	1
UNTY.				. •	STATE REAL	15/4	1.111- 15
AS		_					
		3	WELL LC	G	•		
							•
gation <u>i</u>					·		<u> </u>
GRI JUPA							
<u> </u>	<u></u>						
Griff	in and Ska	117	<u> </u>	Zmaryvilla			
MSA					·		
	eregoli		110 S	utter, 3., 7	, Califor:	da,	1738 Larkin
(LLID BY		<u></u>	DORESTA	<u> </u>		<u> </u>	
3			•	*			
illing Xeinos-			grayel Packed	SATE	Compatition		
	154		5 + 35		WATER AT	•	
iz of casho de	4.5				35 05 1 30 57 77 THE		
RFORATIONS			* . *	<u></u>	·	×	·
		,	A William		:		
iter Livel bupo	re Perporati	NG	AFTER_				· · · · · · · · · · · · · · · · · · ·
• ••			• •				, L
ot data: Diecha	nge e. p. 31		ORAWDOW	N F7	KOURS	76N	
• •							<u>.</u>
Her dáta ayail	ABLE: WATER	Livel record		ANAL	YPIO		
•				• • •	Drille	rsil	ಎ ರ
RPACE SLEV		DATUM	30UR	ce of impormat	10H		
DEPTH .	SLIV. OF BOTTOM		MATERIAL		THICK NEED	Affire	
	ELEY. OF NOTTOM OF STRATUM		MATERIAL	本社工作	3820	VIETO	
0-4	ELY, OF BOTTOM OF STRATUM	FII2	MATERIAL	the country and	3820	vig.s	
8	SLEY, OF SCITCM OF STRATUM	adobe	MATERIAL	de transport Agricor	38250	Aligno	
3 - 1. 8 12	BLY, OF BOTTOM OF STRATUM	adobe yellow elsy	MATERIAL SECTION OF THE SECTION OF T	Anna Anna Anna Anna Anna Anna Anna Anna	38230	TOP.	e datab
8 12 14	BLIV. OF BOTTOM OF STRATUM	adobe yellow olay gray elay	BATTER AL.	A CONTRACTOR OF THE CONTRACTOR	38 38 38 38 38 38 38 38 38 38 38 38 38 3	V. 1.	
8 12 1h 17	BLIV. OF BOTTOM OF STRATUM	adobe yellow elay gray elay yellow elay	MATERIAL.	And the second s	38 38 38 38 38 38 38 38 38 38 38 38 38 3	VOILS	
8 12 14 17 25	ELTY. OF ECTION OF STRATUM	adobe yellow elay yellow elay yellow elay stone clay	BATTER AL.	And the second s	38 38 38 38 38 38 38 38 38 38 38 38 38 3	ALE TO	
8 12 14 17 25 36	ELTY, OF ECTION OF STRATUM	adobe yellow elay yellow elay etobe olay sandy clay	MATURI AL.	to come have a come of the com	38 38 38 38 38 38 38 38 38 38 38 38 38 3	YUSAS	1911/900 1915/42 1916/44 1916/44 1916/44
8 12 14 17 25 36 15 19	BLIV. OF BOTTOM OF STRATUM	adobe yellow elay gray elay yellow elay stone elay sandy elay gray elay yellow elay	MATURI AL.	And the second s	2(E36	VIEW I	1911/900 1915/42 1916/44 1916/44 1916/44
8 12 14 17 25 36 15 19 53	BLIV. OF BOTTOM OF STRATUM	adobe yellow elay sandy clay stone clay sandy clay yellow elay yellow elay	Send.	And the second s	9.0030	TO THE COLUMN TO	1911/900 1915/42 1916/44 1916/44 1916/44
8 12 14 17 25 36 15 19 53 57	BLIV. OF BOTTOM OF STRATUM	adobe yellow elay yellow elay yellow elay stone elay sapdy elay yellow elay yellow elay commant coarse gray elay	BATTOT AL.	And the second s		TOTAL S	1911/900 1915/42 1916/44 1916/44 1916/44
8 12 14 17 25 36 15 19 57 75	BLIV. OF BOTTOM OF STRATUM	adobe yellow elay gray elay stone clay sandy clay yellow elay yellow olay gray elay yellow olay coment coarse gray elay	Search Search	And the second s	9.0030	vigto	1911/900 1915/42 1916/44 1916/44 1916/44
8 12 14 17 25 36 45 45 45 77 75 88	BLIV. OF BOTTOM OF STRATUM	adobe yellow slay gray slay yellow slay etone clay sandy clay yellow clay yellow clay coment coarse gray slay coment slay	Search Search	And the second s		TUELS	1911/900 1915/42 1916/44 1916/44 1916/44
8 12 14 17 25 36 15 19 57 75 88 100	BLIV. OF BOTTOM OF STRATUM	adobe yellow slay gray slay yellow slay stone clay sandy clay yellow slay yellow slay cement scarse gray slay gray slay gray slay gray slay reliew slay	Send.	And the second s		TUELS	1911/900 1915/42 1916/44 1916/44 1916/44
8 12 14 17 25 36 15 19 57 75 88 100 108	ELTY, OF ROTTOM OF STRATUM	adobe yellow elay yellow elay yellow elay stone clay stone clay stone clay stone clay stone clay cement clay reliew clay reliew clay reliew clay cement clay reliew clay cement	Send.	To come the second seco		TUELS	1911/900 1915/42 1916/44 1916/44 1916/44
8 12 14 17 25 36 15 19 57 75 88 160 108 123	BLIV. OF BOTTOM OF STRATUM	adobe yellow elay yellow elay stone clay sendy clay yellow elay yellow clay coment clay coment clay railow clay yellow clay senest coment clay senest had yellow clay	Send.	To come the come of the come o		TOTAL S	
8 12 14 17 25 36 15 19 53 57 75 88 100 108 123 127	BLIV. CW BOTTOM OF STRATUM	adobe yellow elay yellow elay yellow elay stone clay sandy clay yellow elay yellow elay coment clay ray elay ray elay ray elay coment elay sement had yellow el dirty gravel	Send.	To come the second seco			
8 12 14 17 25 36 15 19 53 57 75 88 100 108 123 127 139	BLEV. CW BOTTOM OF STRATUM	adobe yellow elay yellow elay yellow elay stone elay sapdy clay yellow elay yellow elay yellow elay coment elay gray elay reliew elay gray elay reliew elay aray elay coment elay gray elay coment elay gray elay coment had yellow el gray grayel	BOOMS STATE OF THE PARTY OF THE	To come the come of the come o			
8 12 14 17 25 36 15 19 53 57 75 88 100 108 123 127 139 119	BLIV. OF BOTTOM OF STRATUM	adobe yellow elay gray elay yellow elay stone elay sandy clay yellow elay yellow elay yellow elay coment clay gray elay reliew elay reliew elay aray elay reliew elay coment had yellow el dirty gravel gray glay scarse sand	Send.	To come the come of the come o			
8 12 14 17 25 36 15 12 12 12 13 12 13 15 2 15 2	BLIV. OF BOTTOM OF STRATUM	adobe yellow elay yellow elay yellow elay stone clay sandy clay yellow olay yellow olay coment clay gray elay religw clay religw clay religw clay sement elay sement had yellow ol dirty grayel gray glay soorse sand sandy clay	Send.	To come the come of the come o			
8 12 14 17 25 36 15 15 150 152 156	ELTY, OF ROTTON OF STRATUM	adobe yellow slay gray slay yellow slay stone clay stone clay stone clay stone clay stone clay yellow clay coment clay gray slay relay relay relay sement stray grayel	Send.	To come the come of the come o			
8 12 14 17 25 36 15 150 108 129 119 119 152 156 166	ELTY, OF ROTTON OF STRATUM	adobe yellow slay gray slay yellow slay stone clay stone clay stone clay stone clay stone clay yellow clay cement clay gray slay relay relay relay sement stay sem	Send.	To come the come of the come o			
8 12 14 17 25 36 45 45 160 108 123 127 119 152 156 166 180	ELTY, OF BOTTOM OF STRATUM	adobe yellow slay yellow slay yellow slay yellow slay stone clay sandy clay yellow slay yellow slay cement slay religw clay religw clay religw clay sement had yellow clay scarse sand sandy clay religw clay yellow clay yellow clay religw clay	Send.	To come the come of the come o			
8 12 14 17 25 36 15 19 119 119 119 152 156 166 1910 1910	BLIV. CW BOTTOM OF STRATUM	adobe yellow slay yellow slay yellow slay yellow slay sandy clay yellow slay yellow slay yellow slay coment stay sandy slay sandy slay scarse sand sandy slay yellow slay yellow slay scarse sand sandy slay yellow slay	Stand	To come the come of the come o			
8 12 14 17 25 36 15 19 127 119 119 152 156 166 166 191 200	BLEV. CW BOTTOM OF STRATUM	adobe yellow elay yellow elay yellow elay stone clay sendy clay yellow elay yellow elay yellow elay coment coarse gray elay reliew elay gray elay reliew elay sement had yellow el dirty grayel gray slay scarse sand sandy elay yellow elay yellow elay yellow elay yellow elay sandy elay sandy elay sandy yellow	Stand	To come the come of the come o			
8 12 14 17 25 36 15 19 100 108 123 127 119 119 152 156 166 166 190 200 219	BLIV. CW BCTTCM OF STRATUM	adobe yellow slay yellow slay yellow slay stone clay sandy clay yellow slay yellow slay yellow slay coment stay stay slay relow slay stay slay soment had yellow sl dirty grayel stay slay scarse sand sandy slay yellow slay yellow slay yellow slay coment stay scarse sand andy slay coarse sandy an pdy yellow stayel	Stand	To come the come of the come o			
8 12 14 17 25 36 15 19 57 75 88 123 127 119 119 1152 156 166 166 191 200	BLIV. OF BOTTOM OF STRATUM	adobe yellow elay yellow elay yellow elay stone clay sendy clay yellow elay yellow elay yellow elay coment coarse gray elay reliew elay gray elay reliew elay sement had yellow el dirty grayel gray slay scarse sand sandy elay yellow elay yellow elay yellow elay yellow elay sandy elay sandy elay sandy yellow	Stand	To come the come of the come o			

ATTACHMENT B

Analytic Data 1603 Powell Street and 5813 Shellmound Street

	The state of the s
	drocarbons - Lathrop Investigation, 5813-15 Shellmound St., Emeryville, California
- M. L.L. 1 Publish Works Riovation and Anglytic USIS for Pelfoleum fit	AT OCH DOMS - DAMADO INTOSTIGATION, SOLD IS DICHIELDING DAY, ELLERY, THE COLUMN DESCRIPTION OF T

Sample ID	Date	TOC	GW	GW	TPHcr	TPHd	TPHmo	TPHg	Benzene	Toluene	Ethyl-	Xylenes	МТВЕ
	Sampled	Elevation	Depth	Elevation		-					benzene		
	•	(ft)	(ft)	(ft)				— (Con	centrations in	ug/L)			

Abbreviations and Notes:

ug/L = Micrograms per liter

ft = feet

NA = Not Analyzed


TOC = Top of Casing

a = The result appears to be a heavier hydrocarbon than diesel

TPHcr = Total petroleum hydrocarbons as creosote by modified EPA Method 8015
TPHmo = Total petroleum hydrocarbons as motor oil by modified EPA Method 8015
TPHg = Total petroleum hydrocarbons as gasoline by modified EPA Method 8015
TPHd = Total petroleum hydrocarbons as diesel by modified EPA Method 8015
Benzene, Ethylbenzene, Toluene, and Xylenes by EPA Method 8020
MTBE = Methyl Tertiary-Butyl Ether by EPA Method 8020

ATTACHMENT C

Partial Vista Report

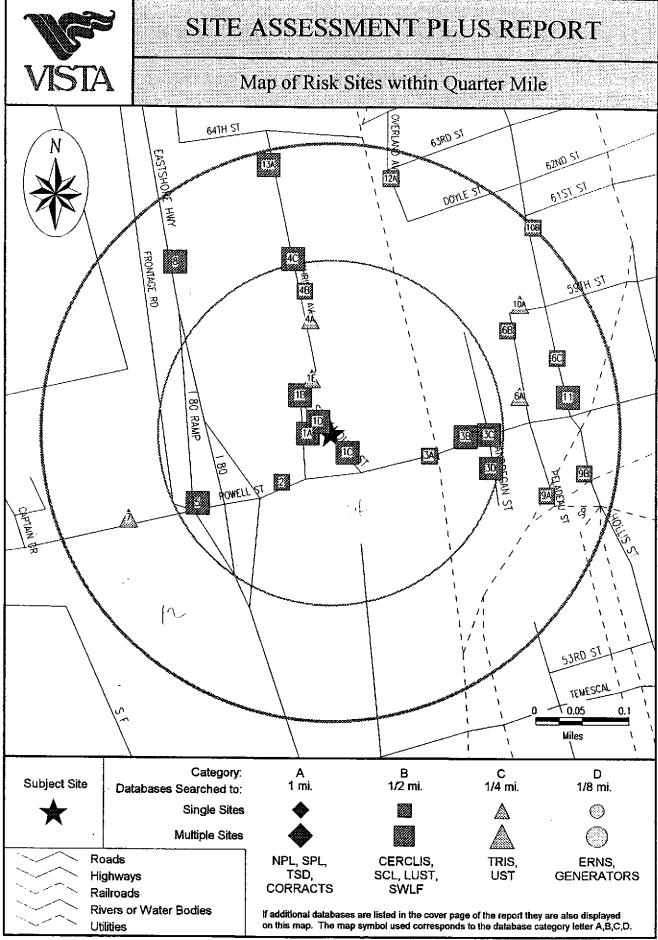

For More Information Call VISTA Environmental Information at 1 - 800 - 767 - 0403

Report ID: 056335-001

Date of Report: October 13, 1994
Page #4

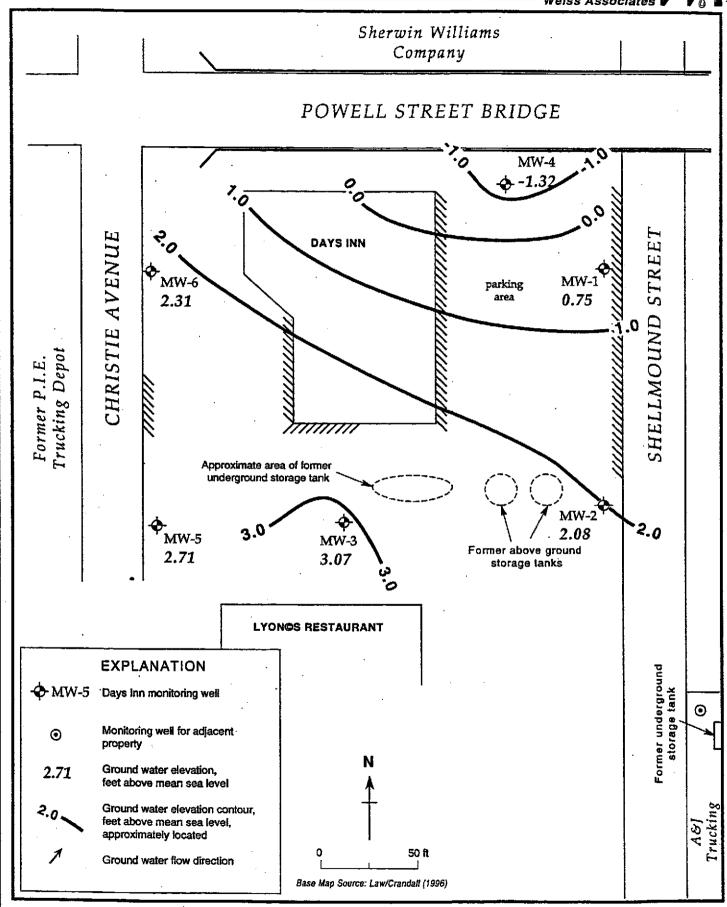


Figure 2. Ground Water Elevations - June 26, 1997 - Days Inn Hotel, 1603 Powell Street, Emeryville, California

SITE ASSESSMENT PLUS REPORT

RISKS DETAILS

	RISK AT SITE AND THE ADJACENT AR	EA (within 1/8 mile)	
Property Address with VISTA Verified\Enhanced City and Zip:	CAL COMP EMERYVILLE FIELD SVC 5801 CHRISTIE AVE STE 497 EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	1A 65154 N/A
DETAILS REGARDING:	RCRA-SmGen / SRC# 1832	EPA ID	CAD982014151
Agency Address:	SAME AS ABOVE		
Generator Class:	GENERATORS WHO GENERATE 100 KG. KG./MONTH OF NON-ACUTELY HAZAR		N 1000
Generator Requirements Violation:	NO		
Violation of Corrective Action Scheduled:	NO		
Land Requirements Violation:	NO		
Property Address with VISTA Verified\Enhanced City and Zip:	FLEXO PACKAGING SERVICES, INC 5800A CHRISTIE ST EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	1A 153999 N/A
DETAILS REGARDING:	RCRA-SmGen / SRC# 1832	EPA ID	CAD981385719
Agency Address:	SAME AS ABOVE		
Generator Class:	GENERATORS WHO GENERATE LESS THAZARDOUS WASTE.	HAN 100 KG./MONTH OF	NON-ACUTELY
Generator Requirements Violation:	NO		
Violation of Corrective Action Scheduled:	NO		
Land Requirements Violation:	NO		
Property Address with	SHERWIN WILLIAMS CO	Map ID#:	1A
VISTA Verified∖Enhanced City and Zip:	5815 SHELLMOUND AVE EMERYVILLE, CA 94608	YISTA ID#: Distance/Direction:	378950 N/A
DETAILS REGARDING:	RCRA-LgGen / SRC# 1832	EPA ID	CAT000619130
Agency Address:	SHERWIN WILLIAMS CO 5815 SHELLMOUND AVE OAKLAND, CA 94608		
Generator Class:	GENERATORS WHO GENERATE AT LEA HAZARDOUS WASTE OR 1 KG./MONTH		
Generator Requirements Violation:	NO		
Violation of Corrective Action Scheduled:	NO		
T 10 :	110		



Land Requirements
Violation:

NO

	K AT SITE AND THE ADJACENT AREA (within 1/8 mile) CONT.	
Property Address with VISTA Verified\Enhanced City and Zip:	LATHROP CONSTRUCTION CO. CORP 5817 SHELLMOUND EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	1A 1253036 N/A
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Underground Tanks:	1		
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	NOT REPORTED		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		1 12.002.00
Cank ID:	1		
Fank Contents:	LEADED GAS		
Tank Age:	NOT REPORTED		
Fank Size (Units):	3000 (GALLONS)		
Fank Status:	CLOSED REMOVED		
eak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN		
Tank Material:	UNKNOWN		
Property Address with VISTA Verified\Enhanced City and Zip:	VACU-DRY COMPANY 5801 CHRISTIE AVENUE EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	1A 1143554 N/A
DETAILS REGARDING:	SCL / SRC# 1542	Agency ID	01200005
gency Address:	SAME AS ABOVE	11.39.00	
tatus:	NOT AN NPL SITE		
acility Type:	NOT AVAILABLE		
ead Agency:	NOT REPORTED		
State Status:	NO FURTHER ACTION		
Pollutants:	NOT REPORTED		
C.			
roperty Address with	FISHER BERKELEY CORPORATION	Map ID#:	
/ISTA Verified∖Enhanced City and Zip:	5800 CHRISTIE AVENUE EMERYVILLE, CA 94608	VISTAUD#:	
	EVIER I VILLE, CA 94008	Distance/Direction:	N/A
	SCL / SRC# 1542	Agency ID	01360013
gency Address:	SAME AS ABOVE		
Agency Address: tatus:			
Agency Address: Status: Facility Type:	SAME AS ABOVE NOT AN NPL SITE NOT AVAILABLE		
Agency Address: Status: Facility Type: Lead Agency:	SAME AS ABOVE NOT AN NPL SITE NOT AVAILABLE NOT REPORTED		
DETAILS REGARDING: Agency Address: Status: Facility Type: Lead Agency: State Status: Pollutants:	SAME AS ABOVE NOT AN NPL SITE NOT AVAILABLE		



Property Address with VISTA Verified\Enhanced City and Zip:	WEATHERFORD BMW 5903 CHRISTIE E BAY PRK EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	1B 1600722 N/A		
DETAILS REGARDING:	RCRA-SmGen / SRC# 1832	EPA ID	CAD981442718		
Agency Address: Generator Class:	SAME AS ABOVE GENERATORS WHO GENERATE LESS THAN 100 KG./MONTH OF NON-ACUTELY HAZARDOUS WASTE.				
Generator Requirements Violation:	NO				
Violation of Corrective Action Scheduled:	NO				
Land Requirements Violation:	NO				

Property Address with	WEATHERFORD BMW	Map ID#:	1B			
VISTA Verified\Enhanced		VISTA ID#:	1153361			
City and Zip:	EMERYVILLE, CA 94608	Distance/Direction:	N/A			
DETAILS REGARDING:	CORTESE / SRC# 1082	EPA/Agency ID	N/A			
Agency Address:	WEATHERFORD BMW					
	5903 CHRISTIE AVE					
T	EMERYVILLE, CA 95608					
List Name:	LEAKING TANK					
Site ID:	NOT REPORTED					
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A			
Agency Address:	WEATHERFORD BMW, INC.					
	5903 CHRISTIE AVE E BAY					
	EMERYVILLE, CA 94608					
Underground Tanks:	1					
Aboveground Tanks:	NOT REPORTED					
Tanks Removed:	NOT REPORTED					
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A			
Agency Address:	WEATHERFORD BMW, INC.		•			
	5903 CHRISTIE AVE E BAY					
	EMERYVILLE, CA 94608					
Tank ID:	1					
Tank Contents:	UNLEADED GAS					
Tank Age:	NOT REPORTED					
Tank Size (Units):	2000 (GALLONS)					
Tank Status:	CLOSED REMOVED					
Leak Monitoring:	UNKNOWN					
Tank Piping:	UNKNOWN					
Tank Material:	UNKNOWN		· · · · · · · · · · · · · · · · · · ·			



RISI	K AT SITE AND THE ADJACENT A	REA (within 1/8 mile) CONT.	
Property Address with VISTA Verified\Enhanced City and Zip:	WEATHERFORD BMW 5903 CHRISTIE AVE EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	1B 1153361 N/A
DETAILS REGARDING:	LUST / SRC# 1640	EPA/Agency ID	N/A
Agency Address:	WEATHERFORD BMW 5903 CHRISTIE EMERYVILLE, CA 95608		
Tank Status:	NOT AVAILABLE		
Discovery Date:	MAY 08, 1989		
Media Affected:	GROUNDWATER		
Substance:	NOT REPORTED		·
Quantity (Units):	NOT REPORTED		
Leak Cause:	REPORTED AS "UNAVAILABLE" I	BY AGENCY	
Leak Source:	NOT REPORTED		
Remedial Action:	EXCAVATE DISPOSE		
Remedial Status 1:	CASE CLOSED/CLEANUP COMPLI	ETE	
Remedial Status 2:	NOT AVAILABLE		
DETAILS REGARDING:	Regional LUST / SRC# 1721	Agency ID	01-1651
Agency Address:	SAME AS ABOVE		
Tank Status:	NOT AVAILABLE		
Discovery Date:	APRIL 18, 1989		
Media Affected:	OTHER		
Substance:	GASOLINE (UNSPECIFIED)		
Quantity (Units):	NOT REPORTED		
Leak Cause:	STRUCTURAL FAILURE		
Leak Source:	UNDERGROUND TANK		
Remedial Action:	EXCAVATE DISPOSE		
Remedial Status 1:	CASE CLOSED/CLEANUP COMPLI	ETE	
Remedial Status 2:	NOT AVAILABLE		<u>-</u>
Property Address with VISTA Verified\Enhanced City and Zip:	MARKETPLACE CHRISTIE AT SHELLMOUND EMERYVILLE, CA 94608	Map ID#: YISTA ID#: Distance/Direction:	1B 1146196 N/A
DETAILS REGARDING:	SCL / SRC# 1542	Agency ID	01280005
Agency Address:	SAME AS ABOVE		
Status:	NOT AN NPL SITE		
Facility Type:	NOT AVAILABLE		
Lead Agency:	NOT REPORTED		
State Status:	NO FURTHER ACTION		
Pollutants:	NOT REPORTED		



Property Address with VISTA Verified\Enhanced City and Zip:	DEVELCO 5500 SHELLMOUND ST STE 150 EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	1C 4063088 N/A		
DETAILS REGARDING:	RCRA-LgGen / SRC# 1832	EPA ID	CAD98198639		
Agency Address:	SAME AS ABOVE				
Generator Class:	GENERATORS WHO GENERATE AT LEAST 1000 KG./MONTH OF NON-ACUTELY HAZARDOUS WASTE OR I KG./MONTH OF ACUTELY HAZARDOUS WASTE.				
Generator Requirements Violation:	NO				
Violation of Corrective Action Scheduled:	NO				
Land Requirements Violation:	NO				

Property Address with VISTA Verified\Enhanced City and Zip:	A J TRUCKING INC 5600 SHELLMOUND EMERYVILLE, CA 94608	Map ID#: VISTA ID#; Distance/Direction:	1C 1176851 N/A
DETAILS REGARDING:	CORTESE / SRC# 1082	EPA/Agency ID	N/A
Agency Address:	A J TRUCKING INC 5600 SHELLMOUND EMERYVILLE, CA 94662		
List Name:	LEAKING TANK		
Site ID:	NOT REPORTED		
DETAILS REGARDING:	CORTESE / SRC# 1082	EPA/Agency ID	N/A
Agency Address:	A J TRUCKING CO. INC. 5600 SHELLMOUND EMERYVILLE, CA 94662		
List Name:	UNDERGROUND TANK		
Site ID:	12648		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	A J TRUCKING CO., INC. 5600 SHELLMOUND EMERYVILLE, CA 94608		
Underground Tanks:	1		
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	NOT REPORTED		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	A J TRUCKING CO., INC. 5600 SHELLMOUND EMERYVILLE, CA 94608		
Tank ID:	1	-	
Tank Contents:	LEADED GAS		
Tank Age:	NOT REPORTED		
Tank Size (Units):	1000 (GALLONS)		
Tank Status:	CLOSED_REMOVED		
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN		
Tank Material:	BARE STEEL		



RIS	K AT SITE AND THE ADJACENT /	AREA (within 1/8 mile) CONT.	
Property Address with VISTA Verified\Enhanced City and Zip:	A J TRUCKING INC 5600 SHELLMOUND EMERYVILLE, CA 94608	Map ID#: YISTA ID#: Distance/Direction:	1C 1176851 N/A
DETAILS REGARDING:	LUST / SRC# 1640	EPA/Agency ID	N/A
Agency Address:	A J TRUCKING, INC 5600 SHELLMOUND EMERYVILLE, CA 94608		
Tank Status:	NOT AVAILABLE		
Discovery Date:	MARCH 10, 1988		
Media Affected:	GROUNDWATER		
Substance:	NOT REPORTED		
Quantity (Units):	NOT REPORTED		
Leak Cause:	REPORTED AS "UNAVAILABLE"	BY AGENCY	
Leak Source:	NOT REPORTED		
Remedial Action:	NO ACTION TAKEN		
Remedial Status 1:	PRELIMINARY ASSESSMENT		
Remedial Status 2:	NOT AVAILABLE		
DETAILS REGARDING:	Regional LUST / SRC# 1721	Agency ID	01-0012
Agency Address:	A J TRUCKING, INC 5600 SHELLMOUND ST EMERYVILLE, CA 94608	, , , , , , , , , , , , , , , , , , , ,	To a contract of the contract
Tank Status:	NOT AVAILABLE		
Discovery Date:	MARCH 10, 1988		
Media Affected:	OTHER		
Substance:	GASOLINE (UNSPECIFIED)		
Quantity (Units):	NOT REPORTED		
Leak Cause:	STRUCTURAL FAILURE		
Leak Source:	UNDERGROUND TANK		
Remedial Action:	EXCAVATE DISPOSE		
Remedial Status 1:	PRELIMINARY ASSESSMENT		
Remedial Status 2:	NOT AVAILABLE		
Property Address with VISTA Verified\Enhanced City and Zip:	MEDI-PHYSICS, INC 5855 CHRISTIE AVE EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	1D 266673 N/A
DETAILS REGARDING:	RCRA-LgGen / SRC# 1832	EPA ID	CAD981160138
Agency Address:	SAME AS ABOVE		
Generator Class:	GENERATORS WHO GENERATE A HAZARDOUS WASTE OR 1 KG./M		
Generator Requirements Violation:	NO		
Violation of Corrective Action Scheduled:	NO		
Land Requirements	NO		



Property Address with VISTA Verified\Enhanced City and Zip:	POWER MACHINE CO. 5768 SHELLMOUND EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	1D 1248684 N/A
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Underground Tanks:	1		
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	NOT REPORTED		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	1		
Tank Contents:	UNLEADED GAS		
Tank Age:	NOT REPORTED		
Tank Size (Units):	500 (GALLONS)		
Tank Status:	CLOSED REMOVED		
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN		
Tank Material:	UNKNOWN		

Property Address with VISTA Verified\Enhanced City and Zip:	NIELSEN PROPERTY 5800 SHELLMOUND ST EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	1D 929864 N/A
DETAILS REGARDING:	CORTESE / SRC# 1082	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
List Name:	LEAKING TANK		
Site ID:	NOT REPORTED		
DETAILS REGARDING:	LUST / SRC# 1640	EPA/Agency ID	N/A
Agency Address:	NIELSEN PROPERTY 5800 SHELLMOUND ST EMERYVILLE, CA		
Tank Status:	NOT AVAILABLE		
Discovery Date:	MAY 21, 1988		
Media Affected:	SOIL/SAND/LAND		
Substance:	NOT REPORTED		
Quantity (Units):	NOT REPORTED		
Leak Cause:	REPORTED AS "UNAVAILABLE"	BY AGENCY	
Leak Source:	NOT REPORTED		
Remedial Action:	NO ACTION TAKEN		
Remedial Status 1:	NO ACTION TAKEN-RP		
Remedial Status 2:	NOT AVAILABLE		
-			



RIS	K AT SITE AND THE ADJACENT AF	REA (within 1/8 mile) CONT.	
Property Address with VISTA Verified\Enhanced City and Zip:	NIELSEN PROPERTY 5800 SHELLMOUND ST EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	1D 929864 N/A
DETAILS REGARDING:	Regional LUST / SRC# 1721	Agency ID	01-1047
Agency Address:	NIELSEN PROPERTY 5800 SHELLMOUND ST EMERYVILLE, CA		101 104
Tank Status:	NOT AVAILABLE		
Discovery Date:	MAY 21, 1988		
Media Affected:	SOIL/SAND/LAND		
Substance:	GASOLINE (UNSPECIFIED)		
Quantity (Units):	NOT REPORTED		
Leak Cause:	STRUCTURAL FAILURE		
Leak Source:	UNDERGROUND TANK		
Remedial Action:	NO ACTION TAKEN		
Remedial Status 1:	NO ACTION TAKEN-RP		
Remedial Status 2:	NOT AVAILABLE		
Property Address with	SYBRON / KERR	Map ID#: VISTA ID#:	ID .
VISTA Verified\Enhanced City and Zip:	5770 SHELLMOUND STREET EMERYVILLE, CA 94608	VISTA ID#: Distance/Direction:	1144145 N/A
DETAILS REGARDING:	SCL / SRC# 1542	Agency ID	01220001
Agency Address:	SAME AS ABOVE		
Status:	NOT AN NPL SITE		
Facility Type:	NOT AVAILABLE		
Lead Agency:	NOT REPORTED		
State Status:	NO FURTHER ACTION		
Pollutants:	NOT REPORTED		
	1	F2	
Property Address with VISTA Verified\Enhanced City and Zip:	PORTER COATINGS 5900 CHRISTIE EMERYVILLE, CA 94608	Map ID#: YISTA ID#: Distance/Direction:	1E 335545 N/A
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Underground Tanks:	9		
1			
Aboveground Tanks:	NOT REPORTED		
Aboveground Tanks: Tanks Removed:			
Tanks Remoyed: DETAILS REGARDING:	NOT REPORTED NOT REPORTED UST // SRC# 1612	EPA/Agency ID	N/A
Tanks Removed: DETAILS REGARDING: Agency Address:	NOT REPORTED NOT REPORTED UST // SRC# 1612 SAME AS ABOVE	EPA/Agency ID	N/A
Tanks Remoyed: DETAILS REGARDING: Agency Address: Tank ID:	NOT REPORTED NOT REPORTED UST / SRC# 1612 SAME AS ABOVE 9		N/A
Tanks Removed: DETAILS REGARDING: Agency Address: Tank ID: Tank Contents:	NOT REPORTED NOT REPORTED UST / SRC# 1612 SAME AS ABOVE 9 REPORTED AS "UNKNOWN" BY ACCOUNTY OF THE PORTED AS "UNKNOWN" BY ACCOUNTY		N/A
Tanks Removed: DETAILS REGARDING: Agency Address: Tank ID: Tank Contents: Tank Age:	NOT REPORTED NOT REPORTED UST // SRC# 1612 SAME AS ABOVE P REPORTED AS "UNKNOWN" BY ACT NOT REPORTED		N/A
Tanks Removed: DETAILS REGARDING: Agency Address: Tank ID: Tank Contents: Tank Age: Tank Size (Units):	NOT REPORTED NOT REPORTED UST / SRC# 1612 SAME AS ABOVE 9 REPORTED AS "UNKNOWN" BY AG NOT REPORTED 2000 (GALLONS)		N/A
Tanks Removed: DETAILS REGARDING: Agency Address: Tank ID: Tank Contents: Tank Age: Tank Size (Units): Tank Status:	NOT REPORTED NOT REPORTED UST / SRC# 1612 SAME AS ABOVE 9 REPORTED AS "UNKNOWN" BY AC NOT REPORTED 2000 (GALLONS) CLOSED REMOVED		N/A
Tanks Removed: DETAILS REGARDING: Agency Address: Tank ID: Tank Contents: Tank Age: Tank Size (Units): Tank Status: Leak Monitoring:	NOT REPORTED NOT REPORTED UST / SRC# 1612 SAME AS ABOVE 9 REPORTED AS "UNKNOWN" BY AG NOT REPORTED 2000 (GALLONS)		N/A
Tanks Removed: DETAILS REGARDING: Agency Address: Tank ID: Tank Contents: Tank Age: Tank Size (Units): Tank Status:	NOT REPORTED NOT REPORTED UST / SRC# 1612 SAME AS ABOVE 9 REPORTED AS "UNKNOWN" BY AC NOT REPORTED 2000 (GALLONS) CLOSED REMOVED		N/A



	K AT SITE AND THE ADJACENT		
Property Address with VISTA Verified\Enhanced	PORTER COATINGS 5900 CHRISTIE	Map ID#: YISTA ID#:	1E 335545
City and Zip:	EMERYVILLE, CA 94608	Distance/Direction;	N/A
	<u> </u>		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE	······································	
Tank ID:	8		
Tank Contents:	AGENCY REPORTS THE UNDEFI	NED TERM "OTHER"	
Tank Age:	NOT REPORTED		
Tank Size (Units):	2000 (GALLONS)		
Tank Status:	CLOSED REMOVED		
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN	·	
Tank Material:	BARE STEEL		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	7	-	
Tank Contents:	REPORTED AS "UNKNOWN" BY	AGENCY	
Tank Age:	NOT REPORTED	£	
Tank Size (Units):	2000 (GALLONS)		
Tank Status:	CLOSED REMOVED		
Leak Monitoring:	UNKNOWN	:	
Tank Piping:	UNKNOWN	3	
Tank Material:	BARE STEEL		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	6		
Tank Contents:	AGENCY REPORTS THE UNDEFI	NED TERM "OTHER"	
Tank Age:	NOT REPORTED		
Tank Size (Units):	2000 (GALLONS)		
Tank Status:	CLOSED_REMOVED		
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN		
Tank Material:	BARE STEEL		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE	FDI-ATA-RELICY ID	
Tank ID:	5		
Tank Contents:	REPORTED AS "UNKNOWN" BY	AGENCY	
Tank Age:	NOT REPORTED	ISM ISM	
Tank Size (Units):	2000 (GALLONS)		
Tank Status:	CLOSED REMOVED		
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN		



RIS	RISK AT SITE AND THE ADJACENT AREA (within 1/8 mile) CONT.			
Property Address with VISTA Verified\Enhanced City and Zip:	PORTER COATINGS 5900 CHRISTIE EMERYVILLE, CA 94608	Map.ID#: VISTA ID#: Distance/Direction:	1E 335545 N/A	
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A	
Agency Address:	SAME AS ABOVE		15 755	
Tank ID:	4			
Tank Contents:	REPORTED AS "UNKNOWN" BY	AGENCY	···	
Tank Age:	NOT REPORTED			
Tank Size (Units):	2000 (GALLONS)			
Tank Status:	CLOSED REMOVED		****	
Leak Monitoring:	UNKNOWN		···	
Tank Piping:	UNKNOWN		-	
Tank Material:	BARE STEEL			
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A	
Agency Address:	SAME AS ABOVE			
Tank ID:	3	· · · · · · · · · · · · · · · · · · ·		
Tank Contents:	REPORTED AS "UNKNOWN" BY	AGENCY		
Tank Age:	NOT REPORTED		·····	
Tank Size (Units):	2000 (GALLONS)			
Tank Status:	CLOSED REMOVED			
Leak Monitoring:	UNKNOWN			
Tank Piping:	UNKNOWN			
Tank Material:	BARE STEEL			
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A	
Agency Address:	SAME AS ABOVE			
Tank ID:	2			
Tank Contents:	REPORTED AS "UNKNOWN" BY	AGENCY		
Tank Age:	NOT REPORTED			
Tank Size (Units):	2000 (GALLONS)			
Tank Status:	CLOSED_REMOVED			
Leak Monitoring:	UNKNOWN			
Tank Piping:	UNKNOWN			
Tank Material:	BARE STEEL			
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A	
Agency Address:	SAME AS ABOVE	[LITA/Agency II]	140740	
Tank ID:	1			
Tank Contents:	REPORTED AS "UNKNOWN" BY	AGENCY		
Tank Age:	NOT REPORTED	IMA IV.		
Tank Size (Units):	4000 (GALLONS)			
Tank Status:	CLOSED REMOVED	1 2 1111 2 2 2 2		
Leak Monitoring:	UNKNOWN			
Tank Piping:	UNKNOWN			
Tank Material:	BARE STEEL			
- William I I I I I I I I I I I I I I I I I I I	DEREG FEEL			



Property Address with VISTA Verified\Enhanced City and Zip:	PORTER COATINGS 5900 CHRISTIE EMERYVILLE, CA 94608	Map.ID#: VISTA ID#: Distance/Direction:	1E 335545 N/A
DETAILS REGARDING:	RCRA-LgGen / SRC# 1832	EPA ID	CAD057503823
Agency Address:	PORTER COATINGS 5900 CHRISTIE AVE EMERYVILLE, CA 94608		
Generator Class:	GENERATORS WHO GENERATE AT LEAST 1000 KG./MONTH OF NON-ACUTELY HAZARDOUS WASTE OR 1 KG./MONTH OF ACUTELY HAZARDOUS WASTE.		
Generator Requirements Violation:	NO		
Violation of Corrective Action Scheduled:	NO		
Land Requirements Violation:	NO		

Property Address with VISTA Verified\Enhanced City and Zip:	BP OIL COMPANY 1700 POWELL ST EMERYVILLE, CA 94408	Map ID#: YISTA ID#: Distance/Direction:	2 1595572 N/A
DETAILS REGARDING:	CORTESE / SRC# 1082	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
List Name:	HAZARDOUS WASTE INFORMATION	ON SYSTEM	
Site ID:	CAL000035352		· · · · · · · · · · · · · · · · · · ·
DETAILS REGARDING:	CORTESE / SRC# 1082	EPA/Agency ID	N/A
Agency Address:	BP OIL/MOBIL 1700 POWELL ST EMERYVILLE, CA 94408		
List Name:	LEAKING TANK		
Site ID:	NOT REPORTED		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	BP OIL CO FAC SITE NO 11126 1700 POWELL EMERYVILLE, CA 94608		
Underground Tanks:	4		
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	NOT REPORTED		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	BP OIL CO FAC SITE NO 11126 1700 POWELL EMERYVILLE, CA 94608		
Tank ID:	4		
Tank Contents:	OIL(NOT SPECIFIED)		
Tank Age:	NOT REPORTED		
Tank Size (Units):	1000 (GALLONS)		
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN		
Tank Piping:	FIBERGLASS		
Tank Material:	FIBERGLASS		



RISI	CAT SITE AND THE ADJACENT A	REA (within 1/8 mile) CONT.	
Property Address with VISTA Verified\Enhanced City and Zip:	BP OIL COMPANY 1700 POWELL ST EMERYVILLE, CA 94408	Map ID#: VISTA ID#: Distance/Direction:	2 1595572 N/A
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	BP OIL CO FAC SITE NO 11126 1700 POWELL EMERYVILLE, CA 94608		
Tank ID:	3		
Tank Contents:	UNLEADED GAS		
Tank Age:	NOT REPORTED		
Tank Size (Units):	6000 (GALLONS)		
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN		· · · · · · · · · · · · · · · · · · ·
Tank Piping:	FIBERGLASS		
Tank Material:	FIBERGLASS		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	BP OIL CO FAC SITE NO 11126 1700 POWELL EMERYVILLE, CA 94608	per Avagency in	13076
Tank ID:	2		
Tank Contents:	UNLEADED GAS		
Tank Age:	NOT REPORTED		
Tank Size (Units):	10000 (GALLONS)		
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN		
Tank Piping:	FIBERGLASS		
Tank Material:	FIBERGLASS		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	BP OIL CO FAC SITE NO 11126 1700 POWELL EMERYVILLE, CA 94608		
Tank ID:	1		
Tank Contents:	UNLEADED GAS		
Tank Age:	NOT REPORTED		· •
Tank Size (Units):	10000 (GALLONS)		
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN		
Tank Piping:	FIBERGLASS		
Tank Material:	FIBERGLASS		
DETAILS REGARDING:	LUST / SRC# 1640	EPA/Agency ID	N/A
Agency Address:	BP OIL/MOBIL 1700 POWELL ST EMERYVILLE, CA		
Tank Status:	NOT AVAILABLE		
Discovery Date:	MAY 08, 1989		
Media Affected:	SOIL/SAND/LAND		
Substance:	NOT REPORTED		
Quantity (Units):	NOT REPORTED		
Leak Cause:	REPORTED AS "UNAVAILABLE" I	BY AGENCY	
Leak Source:	NOT REPORTED		
Remedial Action:	NO ACTION TAKEN		
Remediai Status 1:	NO ACTION TAKEN-RP		
Remedial Status 2:	NOT AVAILABLE		



Property Address with VISTA Verified\Enhanced City and Zip:	BP OIL COMPANY 1700 POWELL ST EMERYVILLE, CA 94408	Map ID#: VISTA ID#: Distance/Direction:	2 1595572 N/A
DETAILS REGARDING:	Regional LUST / SRC# 1721	Agency ID	01-0222
Agency Address:	BP OIL/MOBIL 1700 POWELL ST EMERYVILLE, CA 94608		
Tank Status:	NOT AVAILABLE		•
Discovery Date:	MAY 02, 1989		
Media Affected:	SOIL/SAND/LAND	···	
Substance:	WASTE OIL		
Quantity (Units):	NOT REPORTED		
Leak Cause:	STRUCTURAL FAILURE		
Leak Source:	UNDERGROUND TANK		
Remedial Action:	NO ACTION TAKEN		· · · · · · · · · · · · · · · · · ·
Remedial Status 1:	NO ACTION TAKEN-RP		
Remedial Status 2:	NOT AVAILABLE		
Property Address with VISTA Verified\Enhanced	FIBERBOARD	Map ID#: VISTA ID#:	3A 1145017

Property Address with VISTA Verified\Enhanced City and Zip:	FIBERBOARD 1550 POWELL EMERYVILLE, CA 94608	Map ID#: YISTA ID#: Distance/Direction:	3A 1145017 N/A
DETAILS REGARDING:	SCL / SRC# 1542	Agency ID	01260001
Agency Address:	SAME AS ABOVE		
Status:	NOT AN NPL SITE		
Facility Type:	NOT AVAILABLE		
Lead Agency:	NOT REPORTED		
State Status:	NO FURTHER ACTION		
Pollutants:	NOT REPORTED		

Property Address with VISTA Verified\Enhanced City and Zip:	NASH SOLVENT THINER 1520 POWELL EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	3B 289689 N/A
DETAILS REGARDING:	RCRA-LgGen / SRC# 1832	EPA ID	CAT080034242
Agency Address:	SAME AS ABOVE		
Generator Class:	GENERATORS WHO GENERATE AT LEAST 1000 KG./MONTH OF NON-ACUTELY HAZARDOUS WASTE OR 1 KG./MONTH OF ACUTELY HAZARDOUS WASTE.		
Generator Requirements Violation:	NO		
Violation of Corrective Action Scheduled:	NO		
Land Requirements Violation:	NO		

Property Address with VISTA Verified Enhanced City and Zip:	AMERICAN BITUMALS ASPHALT 1520 POWELL ST EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	3B 18234 N/A
DETAILS REGARDING:	Regional CERCLIS / SRC# 1710	EPA ID	CAD982358665
Agency Address:	SAME AS ABOVE	Harris Berlin and Berlin Berli	
Regional Utility Description:	NEW CERCLIS SITE		



For More Information Call VISTA Environmental Information at 1 - 800 - 767 - 0403

Report ID: 056335-001

Date of Report: October 13, 1994

Version 2.0

Page #32

Property Address with VISTA Verified\Enhanced City and Zip:	AMERICAN BITUMALS ASPHALT 1520 POWELL ST EMERYVILLE, CA 94608	Map ID#: YISTA ID#: Distance/Direction:	3B 18234 N/A
DETAILS REGARDING:	Regional CERCLIS / SRC# 1710	EPA ID	CAD98235866
Agency Address:	SAME AS ABOVE		
Regional Utility Description:	CALIFORNIA 3012 SITE		
DETAILS REGARDING:	CERCLIS / SRC# 1722	EPA ID	CAD98235866
Agency Address:	SAME AS ABOVE		
NPL Status:	NOT A PROPOSED, CURRENT, OR DEL	ETED NPL SITE	
Site Ownership:	PRIVATE/NON-GOVERNMENTAL		
Lead Agency:	NO DETERMINATION		
Site Description:	NOT REPORTED	· · · · · · · · · · · · · · · · · · ·	
DETAILS REGARDING:	CERCLIS / SRC# 1722	EPA ID	CAD98235866
Agency Address:	SAME AS ABOVE		
EventType:	DISCOVERY		
Lead Agency:	NOT REPORTED		 .
Event Status:	NOT REPORTED		
Start Date:	NOT REPORTED		
Completion Date:	DECEMBER 01, 1987		
DETAILS REGARDING:	CERCLIS / SRC# 1722	EPA ID	CAD98235866
Agency Address:	SAME AS ABOVE		
EventType:	PRELIMINARY ASSESSMENT		
Lead Agency:	NOT REPORTED		
Event Status:	NO FURTHER REMEDIAL ACTION PLA	NNED	
Start Date:	NOT REPORTED		
Completion Date:	DECEMBER 13, 1988		

Property Address with VISTA Verified\Enhanced City and Zip:	MICHEL AND PELTON CO 5743 LANDREGAN ST EMERYVILLE, CA 94608	Map ID#: YISTA ID#: Distance/Direction:	3D 271421 0.11MI / E
DETAILS REGARDING:	CORTESE / SRC# 1082	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
List Name:	FACILITY INDEX SYSTEM		
Site ID:	CAD009122136		
DETAILS REGARDING:	CORTESE / SRC# 1082	EPA/Agency ID	N/A
Agency Address:	MICHEL PELTON 5743 LANDREGAN ST EMERYVILLE, CA 94608		
List Name:	LEAKING TANK		
Site ID:	NOT REPORTED		



Property Address with VISTA Verified\Enhanced City and Zip:	MICHEL AND PELTON CO 5743 LANDREGAN ST EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	3D 271421 0.11MI / E
DETAILS REGARDING:	LUST / SRC# 1640	EPA/Agency ID	N/A
Agency Address:	MICHEL PELTON CO 5743 LANDREGAN ST EMERYVILLE, CA 94608		
Tank Status:	NOT AVAILABLE		
Discovery Date:	FEBRUARY 23, 1987		
Media Affected:	SOIL/SAND/LAND	·	
Substance:	NOT REPORTED		
Quantity (Units):	NOT REPORTED		
Leak Cause:	REPORTED AS "UNAVAILABLE" BY AGENCY		
Leak Source:	NOT REPORTED		
Remedial Action:	NO ACTION TAKEN		
Remedial Status 1:	NO ACTION TAKEN-RP		
Remedial Status 2:	NOT AVAILABLE		
DETAILS REGARDING:	Regional LUST / SRC# 1721	Agency ID	01NBC0029
Agency Address:	MICHEL PELTON 5743 LANDREGAN ST EMERYVILLE, CA 94608		
Tank Status:	NOT AVAILABLE		
Discovery Date:	FEBRUARY 23, 1987		
Media Affected:	SOIL/SAND/LAND		
Substance:	REPORTED AS "UNKNOWN" BY AGEN	ICY	
Quantity (Units):	NOT REPORTED		
Leak Cause:	STRUCTURAL FAILURE		
Leak Source:	UNDERGROUND TANK		
Remedial Action:	NO ACTION TAKEN		
Remedial Status 1:	NO ACTION TAKEN-RP		
Remedial Status 2:	NOT AVAILABLE		· · · · · · · · · · · · · · · · · · ·
Property Address with	WHITNEY RESEARCH TOOL CO.	Мар Пж:	3D
VISTA Verified\Enhanced	5679 LANDREGAN ST.	VISTA ID#:	468808
City and Zip:	EMERYVILLE, CA 94608	Distance/Direction:	0.12MI / E
DETAILS REGARDING:	TRIS / SRC# 1489	EPA ID	CAD98139075
Agency Address	SAME AS ABOVE		

Property Address with VISTA Verified\Enhanced City and Zip:	WHITNEY RESEARCH TOOL CO. 5679 LANDREGAN ST. EMERYVILLE, CA 94608	Map.ID#: VISTA ID#: Distance/Direction:	3D 468808 0.12MI / E
DETAILS REGARDING:	TRIS / SRC# 1489	EPA ID	CAD981390750
Agency Address:	SAME AS ABOVE		
Chemical Abstract Service Registry:	CHROMIUM		
Quantity Released:	49255.00 (POUNDS)		
DETAILS REGARDING:	TRIS / SRC# 1489	EPA ID	CAD981390750
Agency Address:	SAME AS ABOVE		
Chemical Abstract Service Registry:	NICKEL		
Quantity Released:	34255.00 (POUNDS)		



Property Address with VISTA Verified\Enhanced City and Zip:	WHITNEY RESEARCH TOOL CO. 5679 LANDREGAN ST. EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	3D 468808 0.12MI / E
DETAILS REGARDING:	RCRA-LgGen / SRC# 1832	EPA ID	CAD981390750
Agency Address:	WHITNEY RESEARCH TOOL CO 5679 LANDREGAN ST EMERYVILLE, CA 94608		
Generator Class:	GENERATORS WHO GENERATE AT LEAST 1000 KG./MONTH OF NON-ACUTELY HAZARDOUS WASTE OR 1 KG./MONTH OF ACUTELY HAZARDOUS WASTE.		
Generator Requirements Violation:	NO		
Violation of Corrective Action Scheduled:	NO		
Land Requirements Violation:	NO		*

Property Address with VISTA Verified\Enhanced City and Zip:	A JTRUCKING CO., INC. 6150 CHRISTIE EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	4A 3193437 N/A
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Underground Tanks:	1		
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	NOT REPORTED		
DETAILS REGARDING:	UST // SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	1		
Tank Contents:	DIESEL		
Tank Age:	NOT REPORTED		
Tank Size (Units):	7500 (GALLONS)		
Tank Status:	CLOSED REMOVED		
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN		
Tank Material:	BARE STEEL		

Property Address with VISTA Verified\Enhanced City and Zip:	KING-KNIGHT COMPANY 6202 CHRISTIE EMERYVILLE, CA 94608	Map.ID#: YISTA ID#: Distance/Direction:	4B 1238838 N/A
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	KING-KNIGHT COMPANY 6202 CHRISTIE EMERYVILLE, CA 94662		
Underground Tanks:	2	·	
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	NOT REPORTED	•	



RIS	K AT SITE AND THE ADJACENT A	REA (within 1/8 mile) CONT.	
Property Address with VISTA Verified\Enhanced City and Zip:	KING-KNIGHT COMPANY 6202 CHRISTIE EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	KING-KNIGHT COMPANY 6202 CHRISTIE EMERYVILLE, CA 94662		
Tank ID:	2		
Tank Contents:	OIL(NOT SPECIFIED)		
Tank Age:	NOT REPORTED		
Tank Size (Units):	500 (GALLONS)		
Tank Status:	CLOSED REMOVED		
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN		
Tank Material:	BARE STEEL		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	KING-KNIGHT COMPANY 6202 CHRISTIE EMERYVILLE, CA 94662		
Tank ID:	1		<u> </u>
Tank Contents:	DIESEL		· · · · · · · · · · · · · · · · · · ·
Tank Age:	NOT REPORTED		·····
Tank Size (Units):	1000 (GALLONS)		
Tank Status:	CLOSED REMOVED	•	
Leak Monitoring:	UNKNOWN		*
Tank Piping:	UNKNOWN		
Tank Material:	BARE STEEL		
			* - [
DETAILS REGARDING:	LUST / SRC# 1640 KING-KNIGHT COMPANY 6202 CHRISTIE AVENUE EMERYVILLE, CA 94662	EPA/Agency ID	<u>IN/A</u>
Tank Status:	NOT AVAILABLE		
Discovery Date:	JUNE 06, 1990		
Media Affected:	GROUNDWATER		
Substance:	NOT REPORTED		
Quantity (Units):	NOT REPORTED		
Leak Cause:	REPORTED AS "UNAVAILABLE" I	BY AGENCY	
Leak Source:	NOT REPORTED		· · · · · · · · · · · · · · · · · · ·
Remedial Action:	NO ACTION TAKEN		
Remedial Status 1:	CASE CLOSED/CLEANUP COMPLI	TTR .	
Remedial Status 2:	NOT AVAILABLE		



RIS	K AT SITE AND THE ADJACENT ARE.	A (within 1/8 mile) CONT.	
Property Address with VISTA Verified\Enhanced City and Zip:	KING-KNIGHT COMPANY 6202 CHRISTIE EMERYVILLE, CA 94608	Map ID#: YISTA ID#: Distance/Direction:	4B 1238838 N/A
DETAILS REGARDING:	Regional LUST / SRC# 1721	Agency ID	01-0617
Agency Address:	KING KNIGHT CO 6202 CHRISTIE AVE EMERYVILLE, CA 94608		
Tank Status:	NOT AVAILABLE		
Discovery Date:	JUNE 06, 1990		
Media Affected:	OTHER		-
Substance:	DIESEL		
Quantity (Units):	NOT REPORTED		
Leak Cause:	STRUCTURAL FAILURE		
Leak Source:	UNDERGROUND TANK		
Remedial Action:	NO ACTION TAKEN		
Remedial Status 1:	CASE CLOSED/CLEANUP COMPLETE		
Remedial Status 2:	NOT AVAILABLE		···
		·	
Property Address with VISTA Verified\Enhanced City and Zip:	FELIX TANK EXCAVATION SITE 6202 CHRISTIE EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction;	4C 1592422 0.12MI / N
DETAILS REGARDING:	CORTESE / SRC# 1082	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		and the state of t
List Name:	LEAKING TANK		
Site ID:	NOT REPORTED		
		<u> </u>	
Property Address with VISTA Verified\Enhanced City and Zip:	BENETO TANK LINES 1800 POWELL ST EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	5 200071051 0.10MI / SW
DETAILS REGARDING:	ERNS / SRC# 1428	Agency ID	16441
Agency Address:	BENETO TANK LINES 1800 POWELL ST EMERYVILLE, CA		
Spill Date Time:	APRIL 09, 1990 09:30:00 AM	<u> </u>	
Case Number:	16441		
Spill Location:	1800 POWELL ST		
Source Agency:	N 16441		
Discharger Name:	WILLIS, PETE		
Discharger Org:	BENETO TANK LINES		
Discharger Phone:	NOT REPORTED		
Material Spilled:	GASOLINE: AUTOMOTIVE (4.23G PB/	G. 8.00 (GAL)	
			
Air Release:	NO		
Air Release: Land Release:	NOYES		



Water Release:

Ground Release:

Facility Release:

Waterway Affected:

Other Release:

NO

NO

NO

NO

CONCRETE

Property Address with	SHELL (BAY SUPER)	Map ID#: 5	
	1800 POWELL ST	VISTA ID#:	1255073
City and Zip:	EMERYVILLE, CA 94608	Distance/Direction:	0.10MI / SW
DETAILS REGARDING:	CORTESE / SRC# 1082	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
List Name:	HAZARDOUS WASTE INFORMATION:	SYSTEM	
Site ID:	CAX000030395		
DETAILS REGARDING	CORTESE / SRC# 1082	EPA/Agency ID	N/A
Agency Address:	SHELL		
3 ,	1800 POWELL ST		
	EMERYVILLE, CA 94608		
List Name:	LEAKING TANK		
Site ID:	NOT REPORTED	-	
DETAILS REGARDING	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	BAY SUPER SHELL INC		
<u> </u>	1800 POWELL		
	EMERYVILLE, CA 94608	_	
Underground Tanks:	4		
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	NOT REPORTED		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	BAY SUPER SHELL INC		
-	1800 POWELL		
	EMERYVILLE, CA 94608		
Tank ID:	4		
Tank Contents:	UNLEADED GAS		
Tank Age:	NOT REPORTED		
Tank Size (Units):	10000 (GALLONS)	<u></u>	
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN		
Tank Material:	FIBERGLASS		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	BAY SUPER SHELL INC		
	1800 POWELL		
Tank III.	EMERYVILLE, CA 94608		
Tank ID:		. <u></u>	
Tank Contents:	LEADED GAS		
Tank Age:	NOT REPORTED		
Tank Size (Units):	10000 (GALLONS)		
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN	· · · · · · · · · · · · · · · · · · ·	
Tank Piping:	UNKNOWN	·	
Tank Material:	FIBERGLASS		
	<u> </u>		



RISI	K AT SITE AND THE ADJACENT AREA (within 1/8 mile) CONT.	
Property Address with VISTA Verified\Enhanced City and Zip:	SHELL (BAY SUPER) 1800 POWELL ST EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	5 1255073 0.10MI / SW
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	BAY SUPER SHELL INC 1800 POWELL EMERYVILLE, CA 94608	<u> </u>	12.54
Tank ID:	2		
Tank Contents:	UNLEADED GAS		
Tank Age:	NOT REPORTED		
Tank Size (Units):	10000 (GALLONS)		
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN	***************************************	
Tank Material:	FIBERGLASS		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	BAY SUPER SHELL INC 1800 POWELL EMERYVILLE, CA 94608		<u>*************************************</u>
Tank ID:	1		
Tank Contents:	OIL(NOT SPECIFIED)		
Tank Age:	NOT REPORTED		
Tank Size (Units):	550 (GALLONS)		
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	MONITOR PRESENT		
Tank Piping:	UNKNOWN		
Tank Material:	BARE STEEL		
DETAILS REGARDING:	TION CONCULATOR	t	Feet and the second
Agency Address:	LUST / SRC# 1640 BAY SUPER SHELL INC 1800 POWELL EMERYVILLE, CA 94608	EFA/Agency.ID	IN/A
Tank Status:	NOT AVAILABLE		
Discovery Date:	SEPTEMBER 28, 1988		
Media Affected:	GROUNDWATER		
Substance:	NOT REPORTED	··· · · · · · · · · · · · · · · · · ·	
Quantity (Units):	NOT REPORTED	· · ·	
Leak Cause:	REPORTED AS "UNAVAILABLE" BY AGE	NCY	
Leak Source:	NOT REPORTED	~, · 	
Remedial Action:	REMOVE FREE PRODUCT		
Remedial Status 1:	SITE INVESTIGATION (SI)		
Remedial Status 2:	NOT AVAILABLE		
		_	



Property Address with VISTA Verified\Enhanced City and Zip:	SHELL (BAY SUPER) 1800 POWELL ST EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	51255073 0.10MI / SW
DETAILS REGARDING:	Regional LUST / SRC# 1721	Agency ID	01-1336
Agency Address:	SHELL 1800 POWELL ST EMERYVILLE, CA 94608		
Tank Status:	NOT AVAILABLE		
Discovery Date:	JANUARY 01, 1982		<u></u>
Media Affected:	OTHER		
Substance:	GASOLINE (UNSPECIFIED)		
Quantity (Units):	NOT REPORTED		
Leak Cause:	STRUCTURAL FAILURE		
Leak Source:	UNDERGROUND TANK		
Remedial Action:	REMOVE FREE PRODUCT		
Remedial Status 1:	REM INVEST/FEASABILITY STUDY		
Remedial Status 2:	NOT AVAILABLE		

Property Address with VISTA Verified\Enhanced City and Zip:	MAND N TRUCKLINE 6245 CHRISTIE AVENUE EMERYVILLE, CA 94608	Map_ID#: VISTA_ID#: Distance/Direction:	4C 1154656 0.14MI / N
DETAILS REGARDING:	SCL / SRC# 1542	Agency ID	01420002
Agency Address:	SAME AS ABOVE		
Status:	NOT AN NPL SITE		
Facility Type:	NOT AVAILABLE		
Lead Agency:	NOT REPORTED		
State Status:	NO FURTHER ACTION		
Pollutants:	NOT REPORTED		

Property Address with VISTA Verified\Enhanced City and Zip:	WESTINGHOUSE DISTRIBUTION CEN 5815 PELADEAU EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	6A 1232791 0.15MI / E
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address: Underground Tanks:	SAME AS ABOVE		
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	NOT REPORTED		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address: Tank ID:	SAME AS ABOVE		
Tank Contents:	UNLEADED GAS		
Tank Age:	NOT REPORTED		
Tank Size (Units):	3000 (GALLONS)		
Tank Status:	CLOSED REMOVED		
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN		
Tank Material:	UNKNOWN		



Property Address with	WESTINGHOUSE ELECTRIC CO - EME	Map ID#:	6B
	5899 PELADEAU STREET	VIŜTA ID#:	465950
City and Zip:	EMERYVILLE, CA 94608	Distance/Direction:	0.16MI / NE
DETAILS REGARDING:	SCL / SRC# 1542	Agency ID	01360057
gency Address:	SAME AS ABOVE		
Status:	NOT AN NPL SITE		
Facility Type:	NOT AVAILABLE		
ead Agency:	DEPT OF TOXIC SUBSTANCES CONTROL		
tate Status:	REMEDIAL ACTION PENDING/IN PROGRESS		
Pollutant 1:	POLYCHLORINATED BIPHENYLS MATE		
Pollutant 2:	CONTAMINATED SOIL		
Pollutant 3:	PHARMACEUTICAL WASTE		
DETAILS REGARDING:	Regional CERCLIS / SRC# 1710		CAT08003211
Agency Address:	WESTINGHOUSE ELECTRIC CORP EMER	I AILLE	
	5899 PELADEAU ST EMERYVILLE, CA 94608		
Regional Utility	ERRIS SITE		
Description:	ERRIS SITE		
-			
DETAILS REGARDING:	Regional CERCLIS / SRC# 1710		CAT08003211
Agency Address:	WESTINGHOUSE ELECTRIC CORP EMERYVILLE		
5899 PELADEAU ST EMERYVILLE, CA 94608			
Regional Utility	RCRA REGULATED: SEE NOTIFICATION	मा म	
Description:	REAL REGULATED. SEE NOTIFICATION	I. Allerdar	
-			
DETAILS REGARDING:	Regional CERCLIS / SRC# 1710		CAT08003211
Agency Address:	WESTINGHOUSE ELECTRIC CORP EMER 5899 PELADEAU ST	YVILLE	
	EMERYVILLE, CA 94608		
Regional Utility	RANKING STATE		
Description:			
DETAILS REGARDING:	Regional CERCLIS / SRC# 1710	I DO A DO	CAT08003211
Agency Address:	WESTINGHOUSE ELECTRIC CORP EMER		CA TOOUSZII
Agency Address:	WESTINGHOUSE ELECTRIC CORP EMER 5899 PELADEAU ST	I VILLE	
	EMERYVILLE, CA 94608		
Regional Utility	CHECK ON RESULTS OF EMERYVILLE M	ARKET PLACE	_
Description:			
DETAILS DECARRAGE	CONTROL CONTROL CONTROL	Language Spring	CAT08003211
DETAILS REGARDING:		EPAID	CA LUCUUSELL
Agency Address:	WESTINGHOUSE ELECTRIC CORP EMER 5899 PELADEAU ST	YVILL	
j	EMERYVILLE, CA 94608		
NPL Status:	NOT A PROPOSED, CURRENT, OR DELE	TED NPL SITE	
Site Ownership:	UNKNOWN		
Lead Agency:	NOT REPORTED		
Site Description:	NOT REPORTED		•
· · · · · · · · · · · · · · · · · · ·			
DETAILS REGARDING:	CERCLIS / SRC# 1722	EPA ID	CAT08003211
Agency Address:	WESTINGHOUSE ELECTRIC CORP EMER	YVILL	
	5899 PELADEAU ST		
	EMERYVILLE, CA 94608		
	DISCOVERY		
	EPA FUND FINANCED		
Lead Agency:			
Lead Agency: Eyent Status:	NOT REPORTED		
EventType: Lead Agency: Eyent Status: Start Date:			



RISK AT	SITES IN THE SURROUNDING AREA (w	ithin 1/8 - 1/4 mile) CONT.	•
Property Address with VISTA Verified\Enhanced City and Zip:	WESTINGHOUSE ELECTRIC CO - EME 5899 PELADEAU STREET EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	6B 465950 0.16MI / NE
DETAILS REGARDING:	CERCLIS / SRC# 1722	EPA ID	CAT080032113
Agency Address:	WESTINGHOUSE ELECTRIC CORP EMER 5899 PELADEAU ST EMERYVILLE, CA 94608		
EventType:	PRELIMINARY ASSESSMENT		
Lead Agency:	EPA FUND FINANCED		
Event Status:	NOT REPORTED		
Start Date:	NOT REPORTED		
Completion Date:	MARCH 01, 1985		
DETAILS REGARDING:	CERCLIS / SRC# 1722	EPA ID	CAT080032113
Agency Address:	WESTINGHOUSE ELECTRIC CORP EMER 5899 PELADEAU ST EMERYVILLE, CA 94608	YVILL	
EventType:	PRELIMINARY ASSESSMENT		
Lead Agency:	EPA FUND FINANCED		
Event Status:	NO FURTHER REMEDIAL ACTION PLAN	NED	
Start Date:	NOT REPORTED		
Completion Date:	JULY 01, 1988		

Property Address with VISTA Verified\Enhanced City and Zip:	AMERICAN MANUFACTURING COMP 5854 HOLLIS STREET EMERYVILLE, CA 94608	Map ID#: YISTA ID#: Distance/Direction:	6C 1154909 0.20MI / E
DETAILS REGARDING:	SCL / SRC# 1542	Agency ID	01500008
Agency Address:	SAME AS ABOVE	•	
Status:	NOT AN NPL SITE		
Facility Type:	NOT AVAILABLE		
Lead Agency:	NOT REPORTED		<u>_</u>
State Status:	NO FURTHER ACTION		
Pollutants:	NOT REPORTED		
	l		

Property Address with VISTA Verified\Enhanced City and Zip:	WATERGATE TOWER III 2000 POWELL EMERYVILLE, CA 94608	Map: ID#: YISTA ID#: Distance/Direction:	7 1247753 0.17MI / W
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Underground Tanks:	1		
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	NOT REPORTED		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	<u> </u>		
Tank Contents:	EMPTY		
Tank Age:	NOT REPORTED		
Tank Size (Units):	NOT REPORTED (GALLONS)		
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN		
Tank Material:	UNKNOWN		



RISK AT SITES IN THE SURROUNDING AREA (within 1/8 - 1/4 mile) CONT.			
Property Address with VISTA Verified\Enhanced City and Zip:	JUDSON STEEL CORPORATION 4200 EASTSHORE EMERYVILLE, CA 94608	Map.ID#: VISTA ID#: Distance/Direction:	8 1219782 0.18MI / NW
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Underground Tanks:	7		
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	NOT REPORTED		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	7		
Tank Contents:	LEADED GAS		
Tank Age:	NOT REPORTED		·
Tank Size (Units):	1000 (GALLONS)		
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN		·
Tank Piping:	UNKNOWN		
Tank Material:	UNKNOWN		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	6		
Tank Contents:	LEADED GAS		
Tank Age:	NOT REPORTED		
Tank Size (Units):	1000 (GALLONS)		
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN		
Tank Material:	UNKNOWN		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE	·····	
Tank ID:	5		
Tank Contents:	DIESEL		
Tank Age:	NOT REPORTED		
Tank Size (Units):	10000 (GALLONS)		
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN		.
Tank Piping:	UNKNOWN	· · · · · · · · · · · · · · · · · · ·	
Tank Material:	UNKNOWN		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	4		
Tank Contents:	DIESEL		
Tank Age:	NOT REPORTED		
Tank Size (Units):	2000 (GALLONS)		
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN		
Tank Material:	UNKNOWN		



D	HIDSON SPEET CORPORATION	MANUTE OF THE STREET	··· o
Property Address with VISTA Verified\Enhanced City and Zip:	JUDSON STEEL CORPORATION 4200 EASTSHORE EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	8 1219782 0.18MI / NW
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	3		
Fank Contents:	DIESEL		· · · · · · · · · · · · · · · · · · ·
Tank Age:	NOT REPORTED		
Tank Size (Units):	2000 (GALLONS)		
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN	·	
Tank Material:	UNKNOWN		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	2		
Tank Contents:	LEADED GAS		
Tank Age:	NOT REPORTED		
Tank Size (Units):	2000 (GALLONS)		
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN		• •
Tank Piping:	UNKNOWN		
Tank Material:	UNKNOWN		
DETAILS REGARDING:	UST / SRC#1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	1		
Tank Contents:	REPORTED AS "UNKNOWN" BY AGE	NCY	
Tank Age:	NOT REPORTED		
Tank Size (Units):	12000 (GALLONS)		
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN		
Tank Material:	FIBERGLASS		
	<u> </u>		
Property Address with VISTA Verified\Enhanced City and Zip:	SCOTT COMPANIES INC THE 4300 EASTSHORE HWY EMERYVILLE, CA	Map ID#: VISTA ID#: Distance/Direction:	8 3776494 0.19MI / NW
DETAILS REGARDING:		EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE	tern/Agency II/	147/6
List Name:	HAZARDOUS WASTE INFORMATION	EVETEM	
Site ID:	CAL000003743	2121EM	
SRE ID:	CAL000003743		
Property Address with	CHIRON	Man ID#:	8
VISTA Verified∖Enhanced City and Zip:	4300 EASTSHORE HWY EMERYVILLE, CA	VISTA ID#: Distance/Direction:	1593349 0.19MI / NW
DETAILS REGARDING:	CORTESE / SRC# 1082	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		



NOT REPORTED

Site ID:

RISK AT	SITES IN THE SURROUNDING AREA (w	ithin 1/8 - 1/4 mile) CONT	
Property Address with VISTA Verified\Enhanced City and Zip:	CHIRON 4300 EASTSHORE HWY EMERYVILLE, CA	Map ID#: YISFA ID#: Distance/Direction:	8 1593349 0.19MI / NW
DETAILS REGARDING:	LUST / SRC# 1640	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank Status:	NOT AVAILABLE		·
Discovery Date:	OCTOBER 04, 1990		
Media Affected:	GROUNDWATER		
Substance:	NOT REPORTED		
Quantity (Units):	NOT REPORTED		
Leak Cause:	REPORTED AS "UNAVAILABLE" BY AGE	ENCY	
Leak Source:	NOT REPORTED		
Remedial Action:	NO ACTION TAKEN		
Remedial Status 1:	NO ACTION TAKEN-RP		
Remedial Status 2:	NOT AVAILABLE		
DETAILS REGARDING:	Regional LUST / SRC# 1721	Agency ID	01-0394
Agency Address:	CHIRON 4300 EASTSHORE HWY EMERYVILLE, CA 94608		
Tank Status:	NOT AVAILABLE		
Discovery Date:	OCTOBER 04, 1990		
Media Affected:	OTHER		
Substance:	DIESEL		
Quantity (Units):	NOT REPORTED		
Leak Cause:	STRUCTURAL FAILURE		
Leak Source:	UNDERGROUND TANK		
Remedial Action:	NO ACTION TAKEN		
Remedial Status 1:	NO ACTION TAKEN-RP		
Remedial Status 2:	NOT AVAILABLE		
Property Address with VISTA Verified\Enhanced City and Zip:	BARBARY COAST STEEL CORPORATI 4300 EASTSHORE HWY EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	8 37486 0.19MI / NW
DETAILS REGARDING:	CORTESE / SRC# 1082	EPA/Agency ID	N/A
Agency Address:	BARBARY COAST STEEL CORPORATIO 4300 EASTSHORE HWY EMERYVILLE, CA		
List Name:	REGULATED AIR EMISSIONS GREATER	THAN 25 TONS/DAY	
Site ID:	3059		
DETAILS REGARDING:	CORTESE / SRC# 1082	EPA/Agency ID	N/A
Agency Address:	BARBARY COAST STEEL CORP.	EFAVAgency 1D	111/21
Agoney Address.	4300 EASTSHORE HWY EMERYVILLE, CA		
List Name:	CALIFORNIA TRIS 1987		
Site ID:	10463		· · ·
DETAILS REGARDING:	CORTESE / SRC# 1082	EPA/Agency ID	N/A
Agency Address:	BARBARY COAST STEEL CORP. 4300 EASTSHORE HWY EMERYVILLE, CA		
List Name:	CALIFORNIA TRIS 1988		
Site ID:	10463		



RISK AT	SITES IN THE SURROUNDING AREA (W	rithin 1/8 - 1/4 mile) CON	Γ.
Property Address with VISTA Verified\Enhanced City and Zip:	BARBARY COAST STEEL CORPORATI 4300 EASTSHORE HWY EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	8 37486 0.19MI / NW
DETAILS REGARDING:	CORTESE / SRC# 1082	EPA/Agency ID	N/A
Agency Address:	BARBARY COAST STEEL CORP. 4300 EASTSHORE HWY EMERYVILLE, CA		
List Name:	CALIFORNIA TRIS 1989		
Site ID:	10463	w	
DETAILS REGARDING:	CORTESE / SRC# 1082	EPA/Agency ID	N/A
Agency Address:	BARBARY COAST STEEL CORP. 4300 EASTSHORE HWY EMERYVILLE, CA		•
List Name:	CALIFORNIA TRIS 1990		
Site ID:	10463		
DETAILS REGARDING:	TRIS / SRC# 1489	EPA ID	CLENGOSIAGIAS
Agency Address:	BARBARY COAST STEEL CORP.	Bra ID	CAD009133489
Agency Admess:	4300 EASTSHORE HWY. EMERYVILLE, CA 94608		
Chemical Abstract Service Registry:	NOT REPORTED		
Quantity Released:	14032.00 (POUNDS)		
DETAILS REGARDING:	TRIS / SRC# 1489	EPA ID	CAD009133489
Agency Address:	BARBARY COAST STEEL CORP. 4300 EASTSHORE HWY. EMERYVILLE, CA 94608		
Chemical Abstract Service Registry:			
Quantity Released:	470.00 (POUNDS)		
DETAILS REGARDING:	TRIS / SRC# 1489	EPA ID	CAD009133489
Agency Address:	BARBARY COAST STEEL CORP. 4300 EASTSHORE HWY. EMERYVILLE, CA 94608		
Chemical Abstract Service Registry:	NOT REPORTED		
Quantity Released:	368.00 (POUNDS)		
DETAILS REGARDING:	TRIS / SRC# 1489	EPA ID	CAD009133489
Agency Address:	BARBARY COAST STEEL CORP. 4300 EASTSHORE HWY. EMERYVILLE, CA 94608	,	
Chemical Abstract Service Registry:	NOT REPORTED		
Quantity Released:	5807.00 (POUNDS)		
DETAILS REGARDING:	TRIS / SRC# 1489	EPA ID	CAD009133489
Agency Address:	BARBARY COAST STEEL CORP. 4300 EASTSHORE HWY. EMERYVILLE, CA 94608		
Chemical Abstract Service Registry:	NOT REPORTED		
Quantity Released:	120970.00 (POUNDS)		



Property Address with VISTA Verified\Enhanced City and Zip;	BARBARY COAST STEEL CORPORATI 4300 EASTSHORE HWY EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	8 37486 0.19MI / NW
DETAILS REGARDING:	SCL / SRC# 1542	Agency ID	01440005
Agency Address:	BARBARY COAST STEEL 4300 EASTSHORE HIGHWAY EMERYVILLE, CA 94608		
Status:	NOT AN NPL SITE		
Facility Type:	NOT AVAILABLE		
Lead Agency:	DEPT OF TOXIC SUBSTANCES CONTROL		
State Status:	SEARCH FOR POTENTIAL RESPONSIBLE	PARTY	
Pollutant 1:	CADMIUM		
Pollutant 2:	POLYCHLORINATED BIPHENYLS MATERIAL WITH PCBS		
Pollutant 3:	HYDROCARBON SOLVENTS		

Property Address with VISTA Verified\Enhanced City and Zip:	SCHWABACKER-FREY 5733 PELLEDEAU EMERYVILLE, CA 94608	Map ID#: YISFA ID#: Distance/Direction:	9A 929861 0.18MI / E
DETAILS REGARDING:	CORTESE / SRC# 1082	EPA/Agency ID	N/A
Agency Address:	SCHWABACKER-FREY 5733 PELLEDEAU EMERYVILLE, CA		
List Name:	LEAKING TANK		
Site ID:	NOT REPORTED		
DETAILS REGARDING:	LUST / SRC# 1640	EPA/Agency ID	N/A
Agency Address:	SCHWABACKER FREY 5733 PELLEDEAU EMERYVILLE, CA		
Tank Status:	NOT AVAILABLE		
Discovery Date:	JANUARY 27, 1987		
Media Affected:	SOIL/SAND/LAND		
Substance:	NOT REPORTED		
Quantity (Units):	NOT REPORTED		
Leak Cause:	REPORTED AS "UNAVAILABLE" BY AGENCY		
Leak Source:	NOT REPORTED		
Remedial Action:	NO ACTION TAKEN		
Remedial Status 1:	NO ACTION TAKEN-RP		
Remedial Status 2:	NOT AVAILABLE		
DETAILS REGARDING:	Regional LUST / SRC# 1721	Agency ID	01-1307
Agency Address:	SCHWABACKER-FREY 5733 PELLEDEAU EMERYVILLE, CA		
Tank Status:	NOT AVAILABLE	*	
Discovery Date:	JANUARY 27, 1987		
Media Affected:	SOIL/SAND/LAND		·
Substance:	GASOLINE (UNSPECIFIED)		· · ·
Quantity (Units):	NOT REPORTED		
Leak Cause:	STRUCTURAL FAILURE		
Leak Source:	UNDERGROUND TANK		
Remedial Action:	NO ACTION TAKEN		
Remedial Status 1:	NO ACTION TAKEN-RP		
Remedial Status 2:	NOT AVAILABLE		



RISK AT SITES IN THE SURROUNDING AREA (within 1/8 - 1/4 mile) CONT.				
Property Address with VISTA Verified\Enhanced City and Zip:	INDUSTRIAL HARD CHROME 5701-5705 HOLLIS STREET EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	9B 208172 0.21MI / E	
DETAILS REGARDING:	SCL / SRC# 1542	Agency ID	01340107	
Agency Address:	SAME AS ABOVE			
Status:	NOT AN NPL SITE			
Facility Type:	NOT AVAILABLE			
Lead Agency:	NOT REPORTED			
State Status:	PRELIMINARY ASSESSMENT REO-L	O₩		
Pollutant 1:	ACID SOLUTION 2 > PH WITH META	S		
DETAILS REGARDING:	Regional CERCLIS / SRC# 1710	EPA ID	CAD9808843	
Agency Address:	INDUSTRIAL HARD CHROME 5701 HOLLIS ST EMERYVILLE, CA 94608			
Regional Utility Description:	NEW ERRIS SITE			
DETAILS REGARDING:	CERCLIS / SRC# 1722	EPA ID	CAD9808843	
Agency Address:	INDUSTRIAL HARD CHROME 5701 HOLLIS ST EMERYVILLE, CA 94608			
NPL Status:	NOT A PROPOSED, CURRENT, OR DELETED NPL SITE			
Site Ownership:	UNKNOWN			
Lead Agency:	NO DETERMINATION			
Site Description:	NOT REPORTED			
DETAILS REGARDING:	CERCLIS / SRC# 1722 EPA ID CAD98088439			
Agency Address:	INDUSTRIAL HARD CHROME 5701 HOLLIS ST EMERYVILLE, CA 94608			
EventType:	DISCOVERY			
Lead Agency:	EPA FUND FINANCED			
Event Status:	NOT REPORTED			
Start Date:	NOT REPORTED			
Completion Date:	NOVEMBER 01, 1984	-		
DETAILS REGARDING:	CERCLIS / SRC# 1722	EPA ID	CAD9808843	
Agency Address:	INDUSTRIAL HARD CHROME 5701 HOLLIS ST EMERYVILLE, CA 94608			
EventType:	PRELIMINARY ASSESSMENT			
Lead Agency:	NOT REPORTED			
Event Status:	NO FURTHER REMEDIAL ACTION P	ANNED		
Start Date:	NOT REPORTED			
Completion Date:	DECEMBER 01, 1987			
Property Address with VISTA Verified\Enhanced City and Zip:	WEATHERFORD MOTORS INC 1710 059TH EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	10A 4016084 0,19MI / NE	
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A	
Agency Address:	SAME AS ABOVE			
Underground Tanks:	1			
Aboveground Tanki:	NOT REPORTED			
Tanka Removed	NOT DEDODTED			



Tanka Removed:

NOT REPORTED

Property Address with VISTA Verified\Enhanced City and Zip:	WEATHERFORD MOTORS INC 1710 059TH EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	10A 4016084 0.19MI / NE
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	1		
Tank Contents:	OIL(NOT SPECIFIED)		
Tank Age:	NOT REPORTED		
Tank Size (Units):	500 (GALLONS)		
Tank Status:	CLOSED REMOVED	· · · · · · · · · · · · · · · · · · ·	
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN		
Tank Material:	BARE STEEL		

Property Address with VISTA Verified\Enhanced City and Zip:	HOLLIS STREET PROJECT 6050 HOLLIS ST EMERYVILLE, CA 94608	Map ID#: YISFA ID#: Distance/Direction:	10B 929857 0.25MI / NE	
DETAILS REGARDING:	CORTESE / SRC# 1082 EPA/Agency ID N/A			
Agency Address:	SAME AS ABOVE			
List Name:	LEAKING TANK			
Site ID:	NOT REPORTED			
DETAILS REGARDING:	LUST / SRC# 1640	EPA/Agency ID	N/A	
Agency Address:	HOLLIS STREET PROJECT 6050 HOLLIS ST. EMERYVILLE, CA			
Tank Status:	NOT AVAILABLE			
Discovery Date:	MARCH 08, 1989			
Media Affected:	GROUNDWATER			
Substance:	NOT REPORTED			
Quantity (Units):	NOT REPORTED			
Leak Cause:	REPORTED AS "UNAVAILABLE" BY AGENCY			
Leak Source:	NOT REPORTED			
Remedial Action:	EXCAVATE TREAT			
Remedial Status 1:	PRELIMINARY ASSESSMENT			
Remedial Status 2:	NOT AVAILABLE			
DETAILS REGARDING:	Regional LUST / SRC# 1721	Agency ID	01-0773	
Agency Address:	SAME AS ABOVE			
Tank Status:	NOT AVAILABLE			
Discovery Date:	JULY 15, 1987			
Media Affected:	OTHER			
Substance:	GASOLINE (UNSPECIFIED)			
Quantity (Units):	NOT REPORTED			
Leak Cause:	STRUCTURAL FAILURE			
Leak Source:	UNDERGROUND TANK			
Remedial Action:	EXCAVATE TREAT			
Remedial Status 1:	PRELIMINARY ASSESSMENT			
Remedial Status 2:	NOT AVAILABLE			



Property Address with VISTA Verified\Enhanced City and Zip:	EMERYVILLE DEPOT 5805 HOLLIS EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	11 1221017 0.19MI / E
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Underground Tanks:	1		
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	NOT REPORTED		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	1		
Tank Contents:	LEADED GAS		
Tank Age:	NOT REPORTED		
Tank Size (Units):	10000 (GALLONS)		·
Tank Status:	CLOSED REMOVED		
Leak Monitoring:	MONITOR PRESENT		
Tank Piping:	UNKNOWN		
Tank Material:	BARE STEEL		· · ·

Property Address with VISTA Verified\Enhanced		Map ID#: VISTA ID#:	11 1255562
City and Zip:	EMERYVILLE, CA 94608	Distance/Direction:	0.20MI / E
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Underground Tanks:	4		
Aboveground Tanks:	NOT REPORTED		· · · ·
Tanks Removed:	NOT REPORTED		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	4		
Tank Contents:	OIL(NOT SPECIFIED)		
Tank Age:	NOT REPORTED		
Tank Size (Units):	550 (GALLONS)		
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN		
Tank Piping:	FIBERGLASS		
Tank Material:	FIBERGLASS		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	3		
Tank Contents:	DIESEL		
Tank Age:	NOT REPORTED		
Tank Size (Units):	10000 (GALLONS)		· · · · · · · · · · · · · · · · · · ·
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN		
Tank Piping:	FIBERGLASS		·
Tank Material:	FIBERGLASS		······································



Property Address with VISTA Verified\Enhanced City and Zip:	UNOCAL SS #3737 1400 POWELL EMERYVILLE, CA 94608	Map_ID#; VISTA_ID#; Distance/Direction;	11 1255562 0.20MI / E
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	2		<u></u>
Tank Contents:	UNLEADED GAS		
Tank Age:	NOT REPORTED		
Tank Size (Units):	10000 (GALLONS)		· · · · - · · - · · · · · · · · · ·
Tank Status:	ACTIVE/IN SERVICE		
Leak Monitoring:	UNKNOWN	3000 a.	
Tank Piping:	FIBERGLASS		
Tank Material:	FIBERGLASS		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	1		
Tank Contents:	UNLEADED GAS	2	
Tank Age:	NOT REPORTED		······
Tank Size (Units):	10000 (GALLONS)		
Tank Status:	ACTIVE/IN SERVICE	1	
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN	· · · · · · · · · · · · · · · · · · ·	·
Tank Material:	FIBERGLASS		

Property Address with VISTA Verified\Enhanced City and Zip:	OWENS TRUCKING AND CONCRETE S 5812 HOLLIS EMERYVILLE, CA 94608	Map ID#; VISFA ID#; Distance/Direction;	11 1258675 0.20MI / E
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Underground Tanks:	2		
Aboveground Tanks:	NOT REPORTED		
Tanks Removed:	NOT REPORTED		
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	2		
Tank Contents:	DIESEL		
Tank Age:	NOT REPORTED		
Tank Size (Units):	10000 (GALLONS)		
Tank Status:	CLOSED REMOVED		
Leak Monitoring:	UNKNOWN		
Tank Piping:	UNKNOWN		
Tank Material:	UNKNOWN		



	F SITES IN THE SURROUNDING AREA (w	The state of the s	N1
Property Address with VISTA Verified\Enhanced City and Zip:	OWENS TRUCKING AND CONCRETE S 5812 HOLLIS EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	11 1258675 0.20MI / E
DETAILS REGARDING:	UST / SRC# 1612	EPA/Agency ID	N/A
Agency Address:	SAME AS ABOVE		
Tank ID:	1		
Tank Contents:	LEADED GAS		
Tank Age:	NOT REPORTED		
Tank Size (Units):	10000 (GALLONS)		
Tank Status:	CLOSED REMOVED		
Leak Monitoring:	UNKNOWN		4
Tank Piping:	UNKNOWN		7
Tank Material:	OTHER DESCRIPTIONS		
Property Address with VISTA Verified\Enhanced City and Zip:	HYDAULIC ELECTRO SERVICE CORP 5812 HOLLIS ST EMERYVILLE, CA 94608	Map ID#: VISTA ID#: Distance/Direction:	11 4222653 0.20MI / E
DETAILS REGARDING:	LUST / SRC# 1640	EPA/Agency ID	N/A
Agency Address:	HYDAULIC ELECTRO SERVICE CORP 5812 HOLLIS ST EMERYVILLE, CA		
Cank Status:	NOT AVAILABLE		
Discovery Date:	NOT REPORTED		
Media Affected:	GROUNDWATER		
Substance:	NOT REPORTED		
Quantity (Units):	NOT REPORTED		·
eak Cause:	REPORTED AS "UNAVAILABLE" BY AGE	NCY	
eak Source:	NOT REPORTED		
Remedial Action:	REPORTED AS "UNKNOWN" BY AGENCY	7	
Remedial Status 1:	NO ACTION TAKEN-RP		
Remedial Status 2:	NOT AVAILABLE	~~~	
DETAILS REGARDING:	Regional LUST / SRC# 1721	Agency ID	01-1206
Agency Address:	HYDRAULIC ELECTRO SERVICE CORP 5812 HOLLIS ST EMERYVILLE, CA 94608		
ank Status:	NOT AVAILABLE		
Discovery Date:	DECEMBER 05, 1989		
ledia Affected:	OTHER		
ubstance:	DIESEL	7-1	
uantity (Units):	NOT REPORTED		*****
eak Cause:	REPORTED AS "UNKNOWN" BY AGENCY	· · · · · · · · · · · · · · · · · · ·	
eak Source:	REPORTED AS "UNKNOWN" BY AGENCY	7	
Remedial Action:	REPORTED AS "UNKNOWN" BY AGENCY		
temedial Status 1:	LEAK BEING CONFIRMED		····
	NOT AVAILABLE		



For More Information Call VISTA Environmental Information at 1 - 800 - 767 - 0403 Report ID: 056335-001 Date of Report: October 1 Date of Report: October 13, 1994 Page #52