FINAL REPORT
LNAPL ASSESSMENT AND
GROUNDWATER
CHARACTERIZATION EVALUATION
(VOLUME I - REPORT)

Mill Springs Park Apartments Livermore, California

Prepared for:

WINGFIELD VENTURE FUND Hinsdale, Illinois

Prepared by:

Investigation performed to demonstrate than containment plume may be from 2008 - it Street, Livermore

EARTH TECH Berkeley, California

October 1995

October 9, 1995

Alameda County Health Agency Department of Environmental Health Hazardous Materials Division 1131 Harbor Bay Parkway, Room 250 Alameda, California 94502 687157.08 File: Report

Attention:

Ms. Eva Chu

Subject:

Transmittal of Final LNAPL Assessment and Groundwater Characterization Investigation Report, Mill Springs Park Apartments,

1809 Railroad Avenue, Livermore, California

Dear Eva:

Terephone

This letter transmits two copies of EARTH TECH's (The Earth Technology Corporation) final LNAPL Assessment and Groundwater Characterization Report for the Mill Springs Park Apartment site in Livermore, California. The investigation was performed in conformance with EARTH TECH's June 30, 1995 Workplan as amended in correspondence dated July 27, 1995. The final report incorporates the data obtained from review of available files at the Alameda County Health Agency, Department of Environmental Health conducted on Septebmer 26 and October 3, 1995.

510 540 6954

Facsimile

5 110 540 7496

The report includes an assessment of the possible sources of the light non-aqueous phase liquid (LNAPL) detected in monitoring well MW-1. The report also presents the results of LNAPL measurements, groundwater level surveys and chemical analyses performed on groundwater samples obtained as part of the investigation. Conclusions are given based on interpretation of the data, and recommendations are made regarding the need for further characterization of the groundwater plume.

If you have any questions, please contact the undersigned.

Very truly yours,

EARTH TECH

Mark M. Milani, P.E.

Project Manager

687157 08:4\FCHRCTRZ.RPT

FINAL REPORT LNAPL ASSESSMENT AND GROUNDWATER CHARACTERIZATION EVALUATION (VOLUME I - REPORT)

Mill Springs Park Apartments 1809 Railroad Avenue Livermore, California

Submitted to:

WINGFIELD VENTURE FUND 125 North Park Avenue Hinsdale, Illinois 60521

Prepared by:

EARTH TECH

2030 Addison Street, Suite 500 Berkeley, CA 94704

> October 9, 1995 Project Nº. 687157.08



FINAL REPORT LNAPL ASSESSMENT AND GROUNDWATER CHARACTERIZATION EVALUATION

Mill Springs Park Apartments Livermore, California

TABLE OF CONTENTS

| | | age |
|-----|--|-----------------------------------|
| 1.0 | INTRODUCTION 1.1 PROJECT LOCATION AND DESCRIPTION 1.2 PREVIOUS INVESTIGATION AND REMEDIAL ACTION SUMMARY 1.3 SCOPE OF LNAPL ASSESSMENT AND GROUNDWATER CHARACTERIZATIO INVESTIGATION 1.4 REPORT ORGANIZATION | . 1 . 1 N . 2 |
| 2.0 | GEOLOGY AND HYDROGEOLOGY 2.1 REGIONAL GEOLOGY AND HYDROGEOLOGY 2.2 SITE GEOLOGY 2.3 SITE GROUNDWATER DEPTH, FLOW AND HYDRAULIC GRADIENT | . 6 |
| 3.0 | INVESTIGATION SUMMARY 3.1 KEY PROJECT OBJECTIVES 3.2 PERMITTING AND UTILITY CLEARANCE 3.3 FIELD INVESTIGATION 3.3.1 Piezometer Installation 3.3.2 Soil Sampling 3.3.3 LNAPL Thickness Measurements 3.3.4 Site Groundwater Depth, Flow and Hydraulic Gradient 3.4 GROUNDWATER SAMPLING 3.5 CHEMICAL ANALYSES 3.6 WASTE MANAGEMENT | . 8 . 9 . 9 . 10 . 10 |
| 4.0 | NATURE AND EXTENT OF CONTAMINATION 4.1 LNAPL FINGERPRINTING AND SOURCE INVESTIGATION 4.1.1 LNAPL Source Identification 4.1.2 LNAPL Fingerprinting 4.2 INTERPRETATION OF SOIL ANALYTICAL RESULTS 4.3 INTERPRETATION OF GROUNDWATER ANALYTICAL RESULTS 4.4 ESTIMATE OF GROUNDWATER IMPACT | . 13 . 13 . 15 . 15 |
| 5.0 | CONCLUSIONS AND RECOMMENDATIONS 5.1 CONCLUSIONS | . 17 |
| 6.0 | LIMITATIONS | . 19 |
| 7.0 | REFERENCES | . 20 |

TABLE OF CONTENTS (cont'd)

LIST OF FIGURES

| Figures Section | <u>on</u> |
|---|------------|
| Figure 1 Vicinity Map F | ₹_1 |
| Figure 2 Site Plan | 7.7 |
| Figure 3 Final Remediation Area Limits | Z |
| Figure 4 Cross Section AA-AA' | J |
| Figure 5 Cross Section BB-BB' | -5 |
| Figure 6 Cross Section CC-CC' | 7.6 |
| Figure 7 Well MW-1 Hydrograph | 1-0 1-7 |
| Figure 8 Groundwater Elevation Survey (August 16, 1995) | :-/ : Q |
| Figure 9 Groundwater Elevation Survey (August 24, 1995) | : O |
| Figure 10 Groundwater Elevation Survey (September 13, 1995) | 10 |
| Figure 11 Groundwater Elevation Survey (September 21, 1995) | 11 |
| Figure 12 Iso-concentration Contour Plot for TVH (gasoline) | 12 |
| Figure 13 Estimated Extent of Gasoline Impacted Groundwater | 12 |
| | 13 |
| | |
| Tables Section | on |
| LIST OF TABLES | |
| | |
| Table 1 Soil Sample Analytical Summary Table | -1 |
| Table 2 Product Thickness and Groundwater Elevation Table | -2 |
| Table 3 Groundwater Sample Analytical Summary Table | -3 |
| Table 4 Soil Sample Analytical Results | -4 |
| Table 5 Groundwater Analytical Results | -5 |
| | |
| | |
| APPENDICES | |
| | 1) |
| Appendix A Health and Safety Plan Volume II (part : | 1) |
| | 1) |

ii

687157.08\4\FCHRCTRZ.RPT

FINAL REPORT LNAPL ASSESSMENT AND GROUNDWATER CHARACTERIZATION EVALUATION

Mill Springs Park Apartments Livermore, California

1.0 INTRODUCTION

1.1 PROJECT LOCATION AND DESCRIPTION

This report presents the results of a floating product (LNAPL) assessment and groundwater characterization evaluation performed by EARTH TECH (The Earth Technology Corporation) at the Mill Springs Park Apartments site (MSP) in Livermore, California. The investigation was performed for the Wingfield Venture Fund (WVF), owner of the property. The MSP project site is located at 1809 Railroad Avenue, between South L and South P Streets, in Livermore, California. The site is shown in relation to the city of Livermore on the Vicinity Map, Figure 1.

The site is relatively level and occupies approximately 6½ acres. The site has been graded and has been developed with residential apartments. Additional site improvements include asphalt concrete paved roadways, parking areas and landscape improvements. The current usage and key features of the site are shown on the Site Plan, Figure 2.

1.2 PREVIOUS INVESTIGATION AND REMEDIAL ACTION SUMMARY

EARTH TECH (as Aqua Resources Inc.) previously provided environmental consultation and engineering services during the Phase I and Phase II (Final) Site Remediation and Closure for the Mill Springs Park Apartment site. Results of Phase I site remediation were presented in a report dated September 12, 1988; the final site remediation (Phase II) was documented in a report dated March 14, 1989. Site remediation included the physical removal of lead impacted soils from Area A and petroleum impacted soils from Areas B, C and D. These areas, where soil removal was conducted, are shown on the Final Remediation Area Location Plan, Figure 3.

As part of regulatory approval of the final site remediation, the Alameda County Health Care Agency, Department of Environmental Health (ACHA-DEH) requested that a groundwater monitoring plan be implemented at the MSP site. EARTH TECH prepared and implemented a groundwater monitoring program in conformance with an approved Workplan. As part of the groundwater monitoring program, EARTH TECH performed a groundwater study of the Mill Springs Park site, and presented the results in a report dated March 3, 1989. Based on the results of this study, one groundwater monitoring well (MW-1) was installed. The monitoring well location is shown on Figure 2. The groundwater monitoring program was conducted from September 1989 through May 1993.

No LNAPL was observed during this groundwater monitoring program and the only petroleum hydrocarbon compound detected in the groundwater samples was benzene. The results of the groundwater monitoring program were presented in a report dated September 14, 1993. This report along with a request for formal site closure was forwarded to the ACHA-DEH and the Regional Water

Quality Control Board (RWQCB). Final site closure was granted by the Regional Water Quality Control Board in December 1993.

In February 1995, EARTH TECH obtained Drilling Permit No. 95045 from the Alameda County Flood Control and Water Conservation District (ACFCWCD), Zone 7 to close the monitoring well. However, at the time well closure was performed, a hydrocarbon odor was detected when the monitoring well was opened. A light non-aqueous phase liquid (LNAPL) was identified when the depth to groundwater was measured using an electronic interface probe. The LNAPL thickness was determined to be between ¼ to ½ inch. The well closure operation was immediately suspended after the LNAPL was encountered. Following discovery of the LNAPL, the ACHA-DEH and the ACFCWCD were notified of the presence of the LNAPL.

In order to identify the source and evaluate the horizontal extent of the LNAPL and dissolved petroleum hydrocarbons on the MSP site, EARTH TECH prepared a Workplan that was submitted to ACHA-DEH on June 30, 1995. The Workplan was approved by ACHA-DEH in correspondence dated July 7, 1995. EARTH TECH amended the original Workplan in correspondence dated July 27, 1995.

EARTH TECH's Workplan was developed specifically to augment additional characterization to be performed by Desert Petroleum Inc. (DP). In addition, the Workplan was submitted with the intent of establishing a coordinated program for the gathering, disseminating and reviewing of all necessary and pertinent information needed to develop an effective and efficient course of action between the ACHA-DEH, MSP and Desert Petroleum Inc. for the remediation of the MSP site and others impacted by this contamination.

1.3 SCOPE OF LNAPL ASSESSMENT AND GROUNDWATER CHARACTERIZATION INVESTIGATION

The scope of services for the LNAPL Assessment and Groundwater Characterization Investigation performed by EARTH TECH included the following:

- Prepare a site specific Health and Safety Plan (HASP) in conformance with the Occupational Safety and Health Administration (OSHA) requirements [29 CFR 1910.120(j)].
- Prepare a Workplan for review and approval by ACHA-DEH and obtain necessary drilling permits from the ACFCWCD, Zone 7.
- Perform an initial site reconnaissance and utility clearance survey to clear proposed boring locations.
- Perform a subsurface investigation at 11 locations (H-1 to H-11) to collect soil and grab groundwater samples.
- Obtain depth-to-water measurements in all grab groundwater sampling locations and monitoring wells and LNAPL thickness measurements where floating product is found.

- Purge and sample monitoring well MW-1 at MSP and monitoring well G-1 located at Groth Brothers Oldsmobile.
- Submit soil and groundwater samples to a State-certified analytical laboratory for analyses for total petroleum hydrocarbons (TPH) as gasoline (TVH), diesel (TEHd), fuel oil (TEHfo) and for Benzene, Toluene, Ethylbenzene, and Xylene (BTEX) and Methyl Tertiary Butyl Ether (MTBE). Selected soil and groundwater samples would also be analyzed for other volatile organic compounds
- Perform necessary field and laboratory QA/QC checks to validate the analytical data.
- Evaluate the data obtained from the chemical analyses to identify the possible sources of the LNAPL (both onsite and offsite), estimate the lateral extent of floating product, estimate the groundwater impact from dissolved petroleum hydrocarbons, and evaluate the need for floating product removal and/or groundwater remediation.
- Review available regulatory agency files at the ACHA-DEH and evaluate the data obtained to identify the possible offsite sources of the LNAPL.
- Prepare a report summarizing the observed site conditions and data obtained from the investigation including conclusions and recommendations regarding the need for LNAPL removal and/or groundwater remediation and the need for additional monitoring wells.

In conjunction with this investigation, EARTH TECH prepared a separate Workplan to perform air monitoring at the Mill Springs Park Apartment site in Livermore California. This Workplan was prepared in response to the ACHA-DEH's request that air monitoring be performed at the subject site. This request was presented at a meeting held on Thursday, May 11, 1995 at ACHA-DEH's office. The air monitoring Workplan was submitted in correspondence dated June 9, 1995.

The purpose of the air monitoring was to evaluate if fugitive emissions were migrating from the LNAPL floating on groundwater detected at a depth of about 30 feet below ground surface (bgs) in monitoring well MW-1. Fugitive emissions from the LNAPL, characterized as gasoline - a complex mixture of petroleum hydrocarbons, could migrate through the non-saturated (vadose zone) soils in a vapor phase state and possibly enter enclosed spaces (i.e. below grade utility vaults, building envelopes, etc.). This could lead to possible exposure via inhalation. In addition, soil vapor containing gasoline could possibly enter enclosed spaces that are not ventilated, resulting in a potential explosive condition or fire hazard.

Data collected from the air monitoring program was used to evaluate the potential for exposure from inhalation and for physical hazards (fire/explosion). The results of the air monitoring program were presented in correspondence dated September 26, 1995. A copy of this report is presented in Appendix D.

1.4 REPORT ORGANIZATION

The LNAPL and groundwater characterization report is organized into five sections labeled 1.0 through 5.0. Section numbers and main headings are:

- 1.0 Introduction
- 2.0 Regional Geology and Hydrogeology
- 3.0 Investigation Summary
- 4.0 Nature and Extent of Contamination
- 5.0 Conclusions and Recommendations
- 6.0 Limitations

Section 2.0 gives a brief description of the regional and site geology and hydrogeology. Section 3.0 summarizes the field investigation including soil and groundwater sampling performed during this investigation. The nature and extent of groundwater impact are summarized in Section 4.0. Section 5.0 presents conclusions developed from the assessment and recommendations regarding the need for LNAPL removal or groundwater remediation at the MSP site. Section 6.0 presents investigation limitations. References are listed in Section 7.0. Figures and Tables referenced in the report are presented at the end of the report.

Supporting information is presented in four (4) Appendices, contained in Volume II (parts 1 through 4) of this report. Appendix A includes the project Health and Safety Plan. Boring Logs are presented in Appendix B. Appendix C contains copies of the Certified Analytical Reports and Chain of Custody Record Sheets. Appendix D includes regional groundwater elevation contour plots for the Livermore Groundwater Basin, additional historical data on the Mill Springs Park Apartment site and pertinent data obtained from the file review for sites referenced in the report.

2.3 SITE GROUNDWATER DEPTH, FLOW AND HYDRAULIC GRADIENT

EARTH TECH has monitored groundwater levels at the site as part of a previous groundwater monitoring program. Groundwater level data from monitoring well MW-1 is tabulated in Table 2 and presented graphically on the monitoring well hydrograph in Figure 7. The data indicate that there has been a seasonal rise in groundwater level during the winter and spring months (about November to June) and a fall in groundwater level during the summer and autumn months (July to October) except during 1991 when increased groundwater extraction occurred.

In March 1995, LNAPL was detected in the monitoring well (MW-1) at the time the well was to be closed.

As part of this investigation, groundwater level surveys were conducted between August 16 and September 21, 1995 to collect data for estimating groundwater gradient and groundwater flow directions. Results of these surveys are discussed in Section 3.3.4.

3.0 INVESTIGATION SUMMARY

3.1 KEY PROJECT OBJECTIVES

The primary objectives of this investigation were to:

- Obtain sufficient data to demonstrate that the LNAPL was not originating from the MSP site
- Obtain sufficient data to identify potential offsite sources of the LNAPL if the data demonstrate that an onsite source is not present
- Obtain sufficient data to characterize the lateral extent of the LNAPL and estimate the lateral extent of the dissolved petroleum hydrocarbons
- Obtain data to estimate the direction and gradient of groundwater flow

The first objective was evaluated by an extensive soil sampling and analysis program. Potential offsite sources were evaluated by file searches conducted by EARTH TECH personnel at the ACHA-DEH. The last three objectives were achieved by groundwater level surveys and a comprehensive groundwater sampling program. Quality Assurance and Quality Control objectives were achieved by implementing the field program in conformance with standard EARTH TECH Field Procedures and laboratory QA/QC procedures.

To achieve the above objectives, the LNAPL Assessment and Groundwater Characterization program performed by EARTH TECH at the Mill Springs Park (MSP) site included six tasks: Permitting/Utility Clearance, LNAPL Characterization, Groundwater Sampling, Soil Sampling and Waste Management/Site Restoration. Each of these tasks are described briefly below.

3.2 PERMITTING AND UTILITY CLEARANCE

EARTH TECH obtained necessary drilling permits from ACFCWCD-Zone 7 prior to drilling and will submit necessary reports to Zone 7 for permit compliance and closeout. An encroachment permit was also obtained from the City of Livermore, Public Works Department for borings located within the existing easement along the southern portion of the MSP site.

EARTH TECH contacted Underground Service Alert (USA) to have utility owners field locate known utilities at the MSP site and clear proposed boring locations. Areas that were unable to be cleared by USA were cleared using a private utility locating service.

On August 3, 1995, a site reconnaissance was conducted to visually assess the general condition of site, and locate and clear proposed boring locations of underground utilities. Utility clearance was performed by downUnder Technologies.

3.3 FIELD INVESTIGATION

The investigation consisted of drilling soil borings, collecting soil samples during drilling, installing temporary piezometers in the completed boreholes, performing field surveys to measure LNAPL thickness and depth to groundwater, collecting groundwater samples and managing investigation derived waste (IDW). Prior to performing the investigation, a site specific health and safety plan was prepared. A copy of the health and safety plan is presented in Appendix A.

3.3.1 Piezometer Installation

To estimate the horizontal extent of LNAPL and LNAPL thickness on the MSP site, EARTH TECH drilled eleven (11) soil borings (H-1 to H-11) on the MSP site. The boring locations are identified on the Site Plan, Figure 2. The borings were drilled by Bay Area Exploration (C-57 License No. 522125) using a CME 55 drill rig equipped with a 6-inch hollow stem auger. The boring depths ranged from 35 feet bgs up to 40 feet bgs.

A temporary piezometer was installed in each boring so that depth to groundwater and grab groundwater samples could be collected. The piezometers were constructed with 2-inch diameter, schedule 40 PVC casing. The lower 10 feet of casing was slotted (0.010 inch slot size). The piezometers were installed so that the screen interval extended above the free groundwater interface a minimum of two feet. A temporary surface seal was installed to minimize the potential for surface infiltration into the piezometers.

At the conclusion of the investigation, the temporary well points were removed and the borings were grouted using a Portland Type I-II cement and bentonite grout mixture.

3.3.2 Soil Sampling

To evaluate the MSP site as a possible source of the LNAPL, soil samples were collected from all soil borings within the unsaturated soil zone and field screened using a organic vapor analyzer equipped with a photoionization detector (OVM-PID). The borings were logged in the field by a registered geologist and a boring log was prepared for each boring. The completed boring logs are presented in Appendix B.

The soil samples were collected generally at five foot intervals and at changes in lithology. The soil samples were collected using a modified split barrel drive sampler (2-5/8 inch outer diameter and 2 inch inner diameter). The sampler has the capacity for obtaining an 18-inch sample using three six-inch long stainless steel liners. The sampler was driven using a 140 pound hammer having a drop of about 30-inches. Blow counts were recorded (at 6-inch intervals) for each sample drive.

Soil samples were collected at five-foot intervals during the drilling of each well. Sample intervals were staggered between boring locations. The soil exposed in the ends of each tube was quickly noted, and then the ends were sealed with teflon tape and new snug-fitting plastic caps. The sample tube was labeled with the sample number, depth, date, and project name. A second sample taken from each five-foot interval was used for lithologic logging purposes. Samples submitted for chemical analyses are summarized on Table 1, Soil Sample Analytical Summary Table.

Prior to each sample interval, the disassembled sampler and the sample liners were washed in a solution of Alconox in water. Each piece was triple rinsed, with the final rinse being distilled water. The soil samples were placed in a chilled ice chest as they were collected. Selected soil samples were suomitted for chemical analyses; remaining samples were held pending results of the chemical analyses.

3.3.3 LNAPL Thickness Measurements

Well surveys were conducted by EARTH TECH between August 16 and September 21, 1995 by an EARTH TECH field engineer. During each survey, an interface probe was used to collect data on floating product (LNAPL) thickness and depth to groundwater. The data are tabulated in Table 2, Product Thickness and Groundwater Elevation Table. The eleven piezometers and the existing monitoring well are identified as H-1 through H-11 and MW-1, respectively. The locations of the piezometers and the monitoring well are shown on the Site Plan, Figure 2.

Floating product (LNAPL) thickness, depth to groundwater and total casing depth were determined using a combined electric interface and groundwater depth probe. The thickness of floating product was first determined followed by the depth to groundwater and total casing depth. The measurements were recorded to the nearest 0.01 foot; all measurements were made relative to the top of casing.

No measurable floating product layer was encountered using an oil/water interface probe in any of the well points, except in H-7 during the first survey. No measurable floating product layer was encountered in monitoring well MW-1 during the initial surveys. However, LNAPL was present in monitoring well MW-1 at the time the temporary well points were closed on September 21, 1995. An LNAPL sample was collected during this investigation from monitoring well MW-1 to perform a "fingerprint" analysis so that the chromatograms could be compared with the LNAPL sample obtained from MW-1 in March 1995.

3.3.4 Site Groundwater Depth, Flow and Hydraulic Gradient

Groundwater level surveys were performed as part of the investigation. The groundwater survey included surveying the eleven temporary piezometers locations and the monitoring wells on the MSP and Groth sites to a common datum for both elevation and horizontal location. The surveying was performed by a licensed land surveyor.

The procedures used in determining depth to groundwater were described in section 3.3.3. Ground water has been identified at depths of between 26 feet and 30 feet bgs during this investigation. The groundwater appears to be contained in a shallow unconfined aquifer. The source of the groundwater in the aquifer appears to be from surface infiltration and local recharge.

Potentiometric surface maps developed by the Alameda County Flood Control and Water Conservation District have shown that the groundwater flow is generally west to northwest in the vicinity of the MSP site. Copies of the potentiometric surface maps are included in Appendix D.

Based on the groundwater depth data obtained during this investigation, groundwater level contour maps were developed for each survey interval, and are shown on Figures 8 through 11. The direction of groundwater flow is to generally to the west with an estimated average gradient of 0.015 foot/foot. The

direction and gradient appear to be relatively consistent over the four survey intervals and with direction and gradient of groundwater flow reported by others.

3.4 GROUNDWATER SAMPLING

Following the depth to groundwater and floating product thickness measurements, grab groundwater samples were collected from each well point using a bailer. A new, disposable bailer was used for each grab groundwater sample point to reduce the potential for cross contamination. In addition, monitoring well MW-1 on the MSP site and G-1 on the Groth site were purged to enable groundwater sampling. The depth to groundwater and total casing depth measurements were used to estimate purge volumes for each monitoring well. Monitoring well purging and groundwater sampling activities were conducted by an EARTH TECH field engineer using standard EARTH TECH Field Procedures.

The monitoring wells were purged using a submersible pump. The pump was decontaminated between wells in conformance with EARTH TECH Field Procedures. The standard purge volume of three casing volumes was obtained from both wells.

Following purging, the monitoring wells were allowed to recover to at least 80 percent of the original water column height so that a representative groundwater sample could be collected. Groundwater samples were collected using 1½ inch diameter disposable polyvinyl chloride (PVC) bailers. Groundwater samples submitted for chemical analyses are summarized on Table 3, Groundwater Sample Analytical Summary Table.

3.5 CHEMICAL ANALYSES

The soil and groundwater samples were collected, handled and shipped in conformance with EARTH TECH Field Procedures to a state Certified laboratory (Curtis & Tompkins, LTD.). All the soil samples submitted were analyzed for total petroleum hydrocarbons against gasoline, diesel and fuel oil standards (TVH, TEH), and for Benzene, Toluene, Ethylbenzene and Xylenes (BTXE) and for MTBE. TVH and TEH (diesel and fuel oil) were determined using modified EPA Method 8015 (LUFT) and BTXE and MTBE compounds were analyzed using EPA Method 8020. In addition, selected soil samples were analyzed for chlorinated hydrocarbons by EPA Method 8010.

All the groundwater samples submitted were also analyzed for total petroleum hydrocarbons against both gasoline, diesel and fuel oil standards (TVH and TEH), and for Benzene, Toluene, Ethylbenzene and Xylenes (BTXE) and for MTBE. TVH and TEH were determined using modified EPA Method 8015 (LUFT) and BTXE and MTBE compounds were analyzed using EPA Method 8020. In addition, selected groundwater samples were analyzed for chlorinated hydrocarbons by EPA Method 8010.

The soil and groundwater samples submitted and specific analyses performed and analytical results are summarized on Tables 4 and 5. Groundwater samples for diesel were collected in 1-liter glass bottles. Groundwater samples for gasoline and volatile organic compound (BTXE, MTBE and chlorinated hydrocarbons) analyses were collected in 40-ml glass VOAs equipped with a teflon septum. VOAs were visually inspected to ensure that no airspace or air bubbles remained in the sample container.

The soil and groundwater samples were individually labeled, and stored in an insulated cooler with ice. All samples collected were transported to the laboratory either by EARTH TECH or by a Curtis and

11

687157 08\4\FCHRCTRZ.RPT

Tompkins courier under chain-of-custody record. The chain-of-custody record was signed and kept with the cooler during transport. A temperature blank and trip blank were also contained in the cooler.

The analytical results for TVH, TEHd, TEHfo, BTXE and MTBE analyses are shown in Table 4 for soil analytical results and Table 5 for groundwater analytical results. No EPA 8010 analytes were detected above the $0.5~\mu g/L$ method detection limit for soil and groundwater samples collected at the MSP site. Laboratory reports and chain-of-custody documentation are included in Appendix B.

For QA/QC purposes, field duplicates were be collected for both soil and grab groundwater so that relative percent difference (RPDs) values could be calculated. Additional field QA/QC samples collected included trip blanks and temperature blanks. Laboratory QA/QC analyses are identified on the certified analytical reports (Appendix C).

3.6 WASTE MANAGEMENT

Drill cuttings were placed in a 20 cubic yard, lined and covered bin provided by a licensed waste disposal contractor (All Chemical Disposal). Purge water and decontamination fluids were contained in DOT approved 17H (open head style) drums. All drums were labelled with contents and accumulation start date.

Soil borings were backfilled with cement grout in conformance with Zone 7 requirements.

Representative samples were collected from the soil cuttings and fluids for waste characterization. Soil cuttings were transported to BFI's Vasco Road Landfill for disposal. Disposal of purge water is pending.

4.0 NATURE AND EXTENT OF CONTAMINATION

This section summarizes the nature and extent of groundwater contamination defined during this investigation. Based on the data from this investigations, EARTH TECH has developed estimates of the extent of groundwater impact from releases of gasoline. The nature and extent of this impact is discussed further below.

4.1 LNAPL FINGERPRINTING AND SOURCE INVESTIGATION

4.1.1 LNAPL Source Identification

As part of the investigation, EARTH TECH performed a detailed reconnaissance of the vicinity to identify potential sources of the LNAPL. Sites considered to be possible sources of the LNAPL are listed below by site name and address:

- Unocal Station, 1771 First Street
- Beacon Station, 1619 First Street
- Tri-Valley Tune-up, 1737 First Street
- B & C Gas Mini-mart (formerly Desert Petroleum), 2008 First Street, Livermore
- Groth Brothers Oldsmobile, 78 L Street, Livermore

EARTH TECH conducted a review of available files at the ACHA-DEH for the above sites on September 26, 1995 and October 3, 1995. Data obtained from this file review is presented in Appendix D by site and summarized below (in alphabetical order):

B & C Gas Mini-mart (formerly Desert Petroleum), 2008 First Street, Livermore - The B & C Minimart started operation in January 1994. The mini-mart is operated by Mr. Balaji Angle, and sells retail dry goods and sundries and operates a motor fuel dispensing system. Fuel is stored in three USTs (2-10,000 gallon, 1-8,000 gallon) onsite. Prior to 1994, the site was operated as service station (BP Oil Facility) by Desert Petroleum Inc.

The age of the USTs is unknown. However, the permits on file with ACHA-DEH indicate that one UST (10,000 gallon) is constructed of fiberglass; the remaining two USTs are constructed of galvanized steel. Distribution piping is constructed of galvanized steel. Cathodic protection is provided for the distribution piping and steel USTs. Overfill protection was reportedly installed for all three USTs in November 1993.

Several unauthorized release reports have been filed with ACHA-DEH by the current owner. The two most recent release reports were filed in April and September 1995, respectively. In addition, LNAPL has been detected in at least one monitoring well located on the site. In response to the September 1995

unauthorized release report, the fiberglass UST was removed from service permanently (in September 1995) due to a documented tank failure. The amount of product loss has not been determined.

Desert Petroleum has conducted several soil and groundwater investigations both onsite and offsite. Soils containing LNAPL were detected in one hydropunch boring conducted offsite during the most recent investigation (March 1995). Further characterization (both onsite and offsite) is pending.

Beacon Station, 1619 First Street - The facility is operated as a retail gas station. Fuel is stored in one 20,000 gallon and one 12,000 gallon USTs that were reportedly installed in 1992 to replace older USTs that were removed. The older USTs included one 10,000 gallon and two 8,000 gallon tanks used to store motor fuels and one 550 gallon tank used to store waste oil. The waste oil tank was removed in 1990; the remaining USTs were reportedly removed in 1992.

Previous reports (see Appendix D) document that releases of petroleum hydrocarbons have occurred from this site and that offsite migration of a groundwater plume has occurred. The plume has been characterized and has been shown not to impact the MSP site. A Remedial Action Plan has been approved by ACHA-DEH and the RWQCB that included soil vapor extraction from onsite wells and groundwater extraction and treatment from both onsite and offsite wells.

Groth Brothers Oldsmobile, 78 L Street, Livermore - The site is currently operated as an auto sales and service dealership. Prior to October 1990, four USTs were operated at the site. The year of installation, age and construction of these USTs are unknown. However, some information regarding the UST usage was found in the file.

The USTs were reportedly not equipped with any form of monitoring equipment. A six month interim permit was issued for the USTs on March 7, 1989. A facility inspection conducted by the ACHA-DEH on April 25, 1990 resulting in a Notice of Violation. In response to the NOV, two of the four USTs [waste oil and gasoline tanks] were removed and two [motor oil] were abandoned in-place in October 1990 as part of an approved UST closure plan. Some soil contamination was noted around both the waste oil and gasoline USTs. The gasoline excavation was overexcavated and additional confirmation samples were collected. Based on the results of the additional confirmation samples, no release was believed to have occurred.

As part of final closure, a groundwater monitoring program has been implemented. Low levels of gasoline and other VOCs have been detected in the groundwater monitoring well.

<u>Tri-Valley Tune-up.</u> 1737 First Street - The facility is operated as an auto repair and retail gas station. Fuel is stored in four USTs (3 - 5,000 gallon, 1 - 8,000 gallon) onsite. The ACHA-DEH issued a Notice of Violation (NOV) on September 18, 1995 for deficiencies in monitoring and reporting requirements under Title 23 CCR Section 2643. Review of reconciliation records by ACHA-DEH indicates that between January and April 1995, actual variations in the inventory reconciliation have exceeded allowable amounts. However, these variations appeared to result from errors in the calculations. No monitoring

wells have been installed; no remedial action has been required. No response to the NOV was available at the time of the file review.

<u>Unocal Station</u>, 1771 First Street - The facility is operated as a retail gas station. Fuel is stored in two 10,000 gallon, fiberglass USTs. The ACHA-DEH issued a Notice of Violation (NOV) on July 18, 1994 for deficiencies in monitoring and reporting requirements under Title 23 CCR Sections 2620, 2643 and 2650. Unocal responded to the NOV in correspondence dated August 25, 1994. A tank and piping tightness test was performed and both systems were determined not to be leaking. No monitoring wells have been installed; no remedial action has been required.

4.1.2 LNAPL Fingerprinting

Due to recent unauthorized release reports filed by the B & C Mini-mart with the ACHA-DEH, the UST failure that has occurred at this site and the increased LNAPL thickness observed in monitoring well MW-1 at the MSP site, samples of gasoline products dispensed at the B & C Mini-mart were obtained for "fingerprint" analysis. The product samples were submitted to Curtis & Tompkins under chain of custody by EARTH TECH personnel. The "fingerprints" obtained from these analyses were compared against the "fingerprint" of the LNAPL sample obtained from monitoring well MW-1.

A comparison of the three fingerprints was performed by Curtis & Tompkins, and their assessment was presented in a letter dated September 29, 1995. A copy of this letter is presented in Appendix D. There are marked similarities between the fingerprints and the LNAPL sample from MW-1 was characterized as "fresh" gasoline.

4.2 INTERPRETATION OF SOIL ANALYTICAL RESULTS

Based on the data presented in Table 4, gasoline, diesel and fuel type hydrocarbons were not detected in soil samples located in the unsaturated zone collected during this investigation. No fuel oil was detected in any of the soil samples collected during this investigation. In addition, no VOCs (EPA 8010 and 8020 analytes) were detected in any of the soil samples collected from the unsaturated zone during this investigation. Selected soil samples located at or below the groundwater interface had detectable concentrations of gasoline and BTXE compounds.

4.3 INTERPRETATION OF GROUNDWATER ANALYTICAL RESULTS

Based on the data presented in Table 5, total petroleum hydrocarbons as gasoline and BTXE and MTBE compounds have been detected in at least 6 of the 13 locations (11 well points and two monitoring wells) sampled during this investigation. The concentration of gasoline (TVH) in the groundwater, where detected, exceeded the 50 μ g/L action level presented in the Tri-Regional Guidelines for Investigating Leaking Underground Fuel Tanks by the Regional Water Quality Control Board (RWQCB). At sample locations H-5, H-6, H-7, H-8 and well MW-1, the TVH concentrations were considered to be significant since they exceeded 1000 μ g/L.

In addition, the concentrations of benzene, toluene, xylene and ethylbenzene (BTXE) compounds in the groundwater also exceeded the applicable Maximum Contaminant Limit (MCLs) for benzene for drinking water in up to 7 of the 13 locations sampled (H-3, H-4, H-5, H-6, H-7, H-8 and well MW-1). The MCLs for xylene and ethylbenzene were also exceeded in the grab groundwater sample collected from H-7. While no MCL has been established for MTBE, significant concentrations of MTBE (exceeding $10,000~\mu g/L$) were also detected at grab groundwater sample locations H-5, H-6, H-7 and H-8. The highest MTBE concentration was measured at H-6 at $67,000~\mu g/L$.

No fuel oil was detected in any of the groundwater samples collected during this investigation.

4.4 ESTIMATE OF GROUNDWATER IMPACT

Groundwater contamination appears to be limited to the eastern portion of the MSP site. Iso-concentration contour maps for TVH were developed using a computer contouring program. No contour maps for LNAPL occurrence could be prepared since LNAPL was only detected in monitoring well MW-1 on a consistent basis.

The contouring was performed using the TVH data presented in Table 5. Where TVH was not detected above the method detection limit (mdl), a value of one half the mdl (½ mdl) was used for those sample locations. An iso-contour plot of the TVH (gasoline) data is presented on Figure 12. The estimated limits of groundwater impact from gasoline are shown on Figure 13.

The iso-concentration contours indicate that the TVH groundwater plume is flowing to the west. This is consistent with the potentiometric surface maps generated from the groundwater elevation data. The downgradient edge of the plume could not be determined since the groundwater samples from H-7 and H-8 contained significant TVH concentrations.

5.0 CONCLUSIONS AND RECOMMENDATIONS

5.1 CONCLUSIONS

Conclusions developed during the LNAPL assessment and groundwater characterization investigation are presented below.

- The results of soil analyses indicate that the MSP site is not a source of the LNAPL detected in MW-1 since no petroleum hydrocarbons were detected in the soil samples collected from the unsaturated zone. Based on this, EARTH TECH concludes that the LNAPL has originated from an offsite source.
- The results of the file review indicate that the UNOCAL and Tri-Valley Tune-up sites have not experienced unauthorized releases from the USTs operated at these sites. Based on this, EARTH TECH concludes that it is unlikely for the LNAPL to have originated from these offsite locations.
- The Beacon site has documented soil and groundwater contamination from the former USTs that were removed. However, the groundwater plume has been characterized and has been shown not to impact the MSP site. Results of grab groundwater samples collected during this investigation, support this conclusion. Based on this, EARTH TECH concludes that it is unlikely for the LNAPL to have originated from this offsite location.
- No unauthorized releases appear to have occurred from the Groth Brothers Oldsmobile site. However, low levels of petroleum hydrocarbons have been detected in the monitoring well on the Groth Brothers Oldsmobile property and some overexcavation was documented to have been performed around the former gasoline UST when it was removed. Based on this, EARTH TECH cannot conclude for certain that some dissolved petroleum hydrocarbon contamination detected in the groundwater at the MSP site may have originated from the Groth Brothers Oldsmobile site.

However, EARTH TECH has concluded that the Groth Brothers Oldsmobile site is not the source of the LNAPL for two reasons. First, the LNAPL product sample obtained from MW-1 on the MSP site during this investigation is considered to be a fresh, "unweathered" gasoline. The last documented bulk shipment of gasoline to the Groth Brothers Oldsmobile site was October 1990. Second, the gasoline UST on the Groth Oldsmobile site was removed in October 1990, shortly after the last bulk shipment, and no evidence of an LNAPL release was reported.

In addition to the data obtained from the file review, the hydrogeologic and analytical data obtained from this investigation also support limiting the potential source of the LNAPL to two sites: B & C Mini-mart (2008 First Street) and Groth Brothers

Oldsmobile (78 L street). Of these two sources, the B&C Mini-mart has had at least two unauthorized releases of gasoline within the last six months and has recently (September 1995) removed a UST from service due to a tank failure. In addition, comparison of the LNAPL fingerprint from monitoring well MW-1 with fingerprints of petroleum products (gasoline) dispensed at the B & C Mini-mart shows numerous similarities.

The Groth site has a history of USTs on the property; however, the USTs have either been removed or abandoned in-place and no LNAPL has been detected in the monitoring well.

- No significant thickness of LNAPL was detected during this investigation. However, LNAPL was detected in selected well points and in well MW-1. The largest accumulation of LNAPL was detected in MW-1. In addition, an increased LNAPL thickness was observed in the monitoring well MW-1 during this investigation.
- Groundwater underlying the MSP site has been impacted from releases of gasoline and dissolved gasoline constituents (BTXE and MTBE). The groundwater impact appears to be limited to the eastern portion of the site.
- Groundwater contamination appears to extend beyond the MSP property boundary based on the results of H-7 and H-8. The extent of this contamination beyond the MSP property could not be determined.

5.2 RECOMMENDATIONS

Based on the above conclusions, EARTH TECH recommends the following:

- Since the LNAPL and groundwater contamination appears to originate from an offsite source, EARTH TECH recommends that the final site closure granted by the RWQCB remain in place and that the present and any future owner of the MSP site not be required to perform any further site characterization or periodic groundwater monitoring.
- The closure of monitoring well MW-1 should be completed and if further monitoring wells need to be installed, they should be installed by the responsible party causing the offsite contamination that has migrated onto the MSP property by subsurface transport.
- ACHA-DEH should issue a letter to MSP stating that final site closure status has not changed and that MSP will not be held responsible for further monitoring or remediation of impacted groundwater underlying the site. ACHA-DEH should also obtain similar concurrence from the RWQCB regarding monitoring and remediation.
- ACHA-DEH should require that a detailed subsurface investigation be performed at the site located at 2008 First Street to determine if this is the source of the LNAPL.

6.0 LIMITATIONS

Our investigation was performed in substantial conformance with the approved scope of services. Soil and groundwater data utilized were used as reported. Chemical analyses were performed by others not under direct supervision by EARTH TECH. The conclusions and recommendations contained herein represent professional opinions prepared consistent with the standards of care and diligence normally practiced by environmental consultants of a similar nature in the same locale. No other warranty, expressed or implied, is made.

OTHER CONSIDERATIONS

Data and findings developed from this investigation will be made available to all interested parties so that an informed decision can be made jointly by all parties.

7.0 REFERENCES

Aqua Resources, 1988, Interim Report - Environmental Engineering Services Summary during Phase I Remediation; Mill Springs Park Apartments, Livermore. California.

Aqua Resources, 1988, Final Closure Workplan - Phase II Remediation; Mill Springs Park Apartments, Livermore. California.

Aqua Resources, 1989, Final Remediation and Site Closure Report - Phase II Remediation; Mill Springs Park Apartments, Livermore. California.

Aqua Resources, 1989, Final Remediation and Site Closure Report - Phase II Remediation; Mill Springs Park Apartments, Livermore. California.

EARTH TECH, 1993, Final Groundwater Monitoring Program Report and Request for Final Site Closure; Mill Springs Park Apartments, Livermore. California.

California Regional Water Quality Control Board, 1993, UST Case Closure for Mill Springs Apartments; Mill Springs Park Apartments, Livermore. California.

EARTH TECH, 1995, Notice of Floating Product during Abandonment of Monitoring Well; Mill Springs Park Apartments, Livermore. California.

EARTH TECH, 1995, LNAPL Assessment Report; Mill Springs Park Apartments, Livermore. California.

EARTH TECH, 1995, Air Monitoring Workplan; Mill Springs Park Apartments, Livermore. California.

EARTH TECH, 1995, Workplan to Support Coordinated Approach to LNAPL Characterization Mill Springs Park Apartments, Livermore. California.

Table 1 Soil Sample and Analysis Summary Table

| Sample (D | Sampling | Gasoline (TVH) | Diesel (TEH) | Fuel Oil (TEH) | BTEX & MTBE | Other VOCs |
|-------------|----------|-----------------|-----------------|-----------------|---------------|------------|
| | Depth | EPA 8015 (LUFT) | EPA 8015 (LUFT) | EPA 8015 (LUFT) | EPA 8020/8240 | EPA 8010 |
| | (ft) | mg/kg | mg/kg | mg/kg | ug/kg | ug/kg |
| MSP-H1-SD2 | 10.5 | x | NA | x | × | X |
| MSP-H1-SD3 | 15.5 | Х | X | X | X | X |
| MSP-H1-SD4 | 20.5 | X | NA | NA | X | NA |
| MSP-H1-SD5 | 25 5 | X | X | X | X | X |
| MSP-H2-SD2 | 11.5 | X | X | X | X | X |
| MSP-H2-SD3 | 16.5 | X | NA | X | X | NA |
| MSP-H2-SD4 | 21.5 | NA | NA | NA | NA | NA |
| MSP-H2-SD5 | 26.5 | X | X | X | X | X |
| MSP-H2-SD6 | 31.5 | X | NA | X | X | ΝA |
| MSP-H2-SD7 | 36.5 | NA | NA | NA | NA | NA |
| MSP-H3-SD1 | 5.5 | NA | NA | NA | NA | NA |
| MSP-H3-SD2 | 10.5 | NA | NA | NA | NA | NA |
| MSP-H3-SD3 | 15 | X | X | X | X | NA |
| MSP-H3-SD4 | 20 | NA | NA | NA | NA | NA |
| MSP-H3-SD5 | 25 | X | X | X | X | NA |
| MSP-H4-SD1 | 65 | X | NA | x | x | x |
| MSP-H4-SD3 | 16.5 | X | NA | X | X | x |
| MSP-H4-SD5 | 26.5 | X | X | Х | Х | x |
| MSP-H4-SD6 | 29 | Х | NA | NA | Х | NA |
| MSP-H5-SD1 | 5.5 | X | NA | X | NA | NA |
| MSP-H5-SD2 | 10.5 | X | NA | X | Х | NA |
| MSP-H5-SD3 | 15.5 | NA | NA | NA | NA | NΑ |
| MSP-H5-SD4 | 20.5 | NA | NA | NA | NA | NA |
| MSP-H5-SD5 | 25.5 | X | X | Х | X | NA |
| MSP-H6-SD1 | 5.5 | NA | NA | NA | NA | NA |
| MSP-H6-SD2 | 9.5 | X | X | X | X | NA |
| MSP-H6-SD4 | 20.5 | X | NA | NΑ | x | NA |
| MSP-H6-SD5- | 25.5 | X | x | X | X | NA |
| MSP-H6-SD5- | 25 5 | X | X | X | X | NA |
| MSP-H7-SD1 | 65 | X | NA | NA | x | x |
| MSP-H7-SD3 | 16.5 | X | NA | NA | х | NA |
| MSP-H7-SD4 | 21 | X | NA | NA | x | NA |
| MSP-H7-SD5 | 26 5 | X | X | X | x | NA |
| MSP-H8-SD1 | 5.5 | NA | NA | NA | NA | NA |
| MSP-H8-SD2 | 105 | X | NA | X | X | NA |
| MSP-H8-SD3 | 15.5 | X | X | X | X | NA |
| MSP-H8-SD4 | 20 | NA | NA | ' NA | NA | NΑ |
| MSP-H8-SD5 | 25.5 | X | X | X | X | NΑ |
| MSP-H9-SD2 | 10.5 | x | X | X | X | NA |
| MSP-H9-SD3- | 16.5 | X | X | X | X | NA |
| MSP-H9-SD3- | 16.5 | x | X | × | x | NA |
| MSP-H9-SD4 | 21 | NA. | NA NA | NA. | NA NA | NA |
| MSP-H9-SD5- | 26 | X | × | X | X | NA |
| MSP-H9-SD5- | 26 | x | x | x | x | NA |
| MSP-H9-SD6 | 31.5 | NA | NA | NA. | NA . | NA |
| MSP-H9-SD7 | 35.5 | × | NA. | NA | x | NA |
| MSP-H10-SD2 | 11.5 | NA NA | NA | NA | NA NA | NA |
| MSP-H10-SD3 | 16 | X | X | × | X | NΑ |
| MSP-H10-SD5 | 26 5 | x | x | x | x | NA. |
| MSP-H11-SD1 | 65 | NA NA | NA NA | NA. | NA NA | NA |
| MSP-H11-SD2 | 11.5 | X | X | X | X | X |
| MSP-H11-SD3 | 16.5 | NA | NA | NA . | NA NA | NA. |
| MSP-H11-SD4 | 21.5 | X | NA NA | X | X | NA |
| MSP-H11-SD4 | 26.5 | x | X | x | x | X |

Notes:

Soil sample depths were measured relative to ground surface
 X - Indicates sample was submitted for chemical analyses indicated in column heading
 NA - not analyzed

TABLE 2 Product Thickness and Groundwater Elevation Table

Page: 1 of 4 Date: 10/09/95

| SITE | DATE | MP ELEVATION ⁽²⁾ | TIME | DEPTH TO WATER | FLOATING PRODUCT THICKNESS | WATER ELEV. ⁽²⁾ | WATER ELEV!1) | EQUIV. FRESH WATER HEAD |
|------|----------|--------------------------------|-------|----------------------|----------------------------------|-------------------------------|------------------|----------------------------------|
| | | (feet) | | (feet) | (feet) | (feet) | (feet) | (feet) |
| H-01 | 08/11/95 | 476.43 | 00:00 | 28.38 | .00 | 448.05 | NA | 448.0! |
| H-01 | 08/14/95 | 476.43 | 00:00 | 28.64 | .00 | 447.79 | 26 | 447.7 |
| H-01 | 08/16/95 | 476.43 | 00:00 | 28.62 | .00 | 447.81 | .02 | 447.8 |
| H-01 | 08/21/95 | 476.43 | 00:00 | 28.74 | .00 | 447.69 | 12 | 447.6 |
| H-01 | 08/24/95 | 476.43 | 00:00 | 28.82 | .01 | 447.61 | 08 | 447.6 |
| H-01 | 09/13/95 | 476.43 | 00:00 | 30.22 | .00 | 446.21 | -1.40 | 446.2 |
| H-01 | 09/21/95 | 476.43 | 00:00 | 30.66 | .00 | 445.77 | 44 | 445.7 |
| H-02 | 08/11/95 | 477.56 | 00:00 | 27.28 | .00 | 450.28 | NA | 450.2 |
| H-02 | 08/14/95 | 477.56 | 00:00 | 27.32 | .00 | 450.24 | 04 | 450.2 |
| H-02 | 08/16/95 | 477.56 | 00:00 | 27.49 | .00 | 450.07 | 17 | 450.0 |
| H-02 | 08/21/95 | 477.56 | 00:00 | 27.89 | .00 | 449.67 | 40 | 449.6 |
| H-02 | 08/24/95 | 477.56 | 00:00 | 28.06 | .01 | 449.50 | 17 | 449.5 |
| H-02 | 09/13/95 | 477.56 | 00:00 | 29.20 | .00 | 448.36 | -1.14 | 448.3 |
| H-02 | 09/21/95 | 477.56 | 00:00 | 29.56 | .00 | 448.00 | 36 | 448.0 |
| H-03 | 08/11/95 | 478.87 | 00:00 | 27.19 | .00 | 451.68 | NA | 451.6 |
| H-03 | 08/14/95 | 478.87 | 00:00 | 27.31 | .00 | 451.56 | 12 | 451.5 |
| H-03 | 08/16/95 | 478.87 | 00:00 | 27.46 | .00 | 451.41 | 15 | 451.4 |
| H-03 | 08/21/95 | 478.87 | 00:00 | 27.95 | .00 | 450.92 | 49 | 450.9 |
| H-03 | 08/24/95 | 478.87 | 00:00 | 28.06 | .00 | 450.81 | 11 | 450.8 |
| H-03 | 09/13/95 | 478.87 | 00:00 | 29.42 | .00 | 449.45 | -1.36 | 449.4 |
| H-03 | 09/21/95 | 478.87 | 00:00 | 29.80 | .00 | 449.07 | 38 | 449.0 |
| H-04 | 08/11/95 | 478.30 | 00:00 | 25.35 | .00. | 452.95 | NA | 452.9 |
| H-04 | 08/14/95 | 478.30 | 00:00 | 25.56 | .00 | 452.74 | 21 | 452.7 |
| H-04 | 08/16/95 | 478.30 | 00:00 | 25.70 | .00 | 452.60 | 14 | 452.6 |
| H-04 | 08/21/95 | 478.30 | 00:00 | 26.22 | .01 | 452.08 | 52 | 452.0 |
| H-04 | 08/24/95 | 478.30 | 00:00 | 26.37 | .00 | 451.93 | -,15 | 451.9 |
| H-04 | 09/13/95 | 478.30 | 00:00 | 28.17 | .00 | 450.13 | -1.80 | 450.1 |
| H-04 | 09/21/95 | 478.30 | 00:00 | 28.20 | .00 | 450.10 | 03 | 450.1 |
| H-05 | 08/11/95 | 479.17 | 00:00 | 26.36 | .00 | 452.81 | NA | 452.8 |
| H-05 | 08/14/95 | 479.17 | 00:00 | 26.50 | .00 | 452.67 | 14 | 452.6 |
| H-05 | 08/16/95 | 479.17 | 00:00 | 26.65 | .00 | 452.52 | -,15 | 452.5 |
| H-05 | 08/21/95 | 479.17 | 00:00 | 27.16 | .01 | 452.01 | 51 | 452.0 |

⁽¹⁾ Change in Water Elevation since last reported measurement

⁽²⁾ Measurements Based on Mean Sea Level

TABLE 2
Product Thickness and Groundwater
Elevation Table

Page: 2 of 4 Date: 10/09/95

D = Dry

NA = Not Available

| SITE | DATE | MP ELEVATION ⁽²⁾ | TIME | DEPTH TO WATER | FLOATING PRODUCT THICKNESS | WATER ELEV. ⁽²⁾ | △ WATER ELEV! ¹³ | EQUIV. FRESH WATER HEAD ⁷² |
|------|----------|--------------------------------|-------|----------------------|----------------------------------|-------------------------------|-----------------------------------|--|
| | | (feet) | | (feet) | (feet) | (feet) | (feet) | (feet) |
| H-05 | 08/24/95 | 479.17 | 00:00 | 27.33 | .00 | 451.84 | - 17 | 451.84 |
| H-05 | 09/13/95 | 479.17 | 00:00 | 28.81 | .00 | 450.36 | -1.48 | 450.36 |
| H-05 | 09/21/95 | 479.17 | 00:00 | 29.14 | .00 | 450.03 | 33 | 450.03 |
| Н-06 | 08/11/95 | 478.45 | 00:00 | 26.22 | .00 | 452.23 | NA | 452.23 |
| н-06 | 08/14/95 | 478.45 | 00:00 | 26.34 | .00 | 452.11 | 12 | 452.11 |
| H-06 | 08/16/95 | 478.45 | 00:00 | 26.57 | .00 | 451.88 | 23 | 451.88 |
| H-06 | 08/21/95 | 478.45 | 00:00 | 27.06 | .00 | 451.39 | 49 | 451.39 |
| H-06 | 08/24/95 | 478.45 | 00:00 | 26.21 | .00 | 452.24 | .85 | 452.24 |
| H-06 | 09/13/95 | 478.45 | 00:00 | 28.66 | .00 | 449.79 | -2.45 | 449.79 |
| H-06 | 09/21/95 | 478.45 | 00:00 | 29.05 | .00 | 449.40 | 39 | 449.40 |
| н-07 | 08/11/95 | 477.44 | 00:00 | 25.71 | .00 | 451.73 | NA | 451.7 |
| H-07 | 08/14/95 | 477.44 | 00:00 | 25.86 | .01 | 451.58 | 15 | 451.58 |
| H-07 | 08/16/95 | 477.44 | 00:00 | 26.00 | .00 | 451.44 | - 14 | 451.4 |
| H-07 | 08/21/95 | 477.44 | 00:00 | 26.53 | .00 | 450.91 | 53 | 450.9 |
| H-07 | 08/24/95 | 477.44 | 00:00 | 26.71 | .00 | 450.73 | 18 | 450.73 |
| H-07 | 09/13/95 | 477.44 | 00:00 | 28.49 | .00 | 448.95 | -1.78 | 448.9 |
| H-07 | 09/21/95 | 477.44 | 00:00 | 28.31 | .00. | 449.13 | .18 | 449.13 |
| H-08 | 08/11/95 | 474.37 | 00;00 | 27.89 | .00 | 446.48 | NA | 446.48 |
| H-08 | 08/14/95 | 474.37 | 00:00 | 27.91 | .00 | 446.46 | 02 | 446.46 |
| H-08 | 08/16/95 | 474.37 | 00:00 | 28.05 | .00 | 446.32 | 14 | 446.32 |
| H-08 | 08/21/95 | 474.37 | 00:00 | 28.46 | .00, | 445.91 | 41 | 445.9 |
| H-08 | 08/24/95 | 474.37 | 00:00 | 28.68 | .00 | 445.69 | 22 | 445.69 |
| H-08 | 09/13/95 | 474.37 | 00:00 | 29.94 | .00 | 444.43 | -1.26 | 444.43 |
| Н-08 | 09/21/95 | 474.37 | 00:00 | 30.67 | .00 | 443.70 | 73 | 443.70 |
| н-09 | 08/11/95 | 472.10 | 00:00 | 28.30 | .00 | 443.80 | NA | 443.80 |
| H-09 | 08/14/95 | 472.10 | 00:00 | 27.93 | .00 | 444.17 | .37 | 444.1 |
| H-09 | 08/16/95 | 472.10 | 00:00 | 27.97 | .00. | 444.13 | 04 | 444.13 |
| H-09 | 08/21/95 | 472.10 | 00:00 | 28.02 | .01 | 444.08 | 05 | 444.08 |
| н-09 | 08/24/95 | 472.10 | 00:00 | 27.59 | .01 | 444.51 | .43 | 444. 5 |
| н-09 | 09/13/95 | 472.10 | 00:00 | 28.71 | .00 | 443.39 | -1.12 | 443.39 |
| H-09 | 09/21/95 | 472.10 | 00:00 | 28.67 | .00 | 443.43 | .04 | 443,4 |

⁽¹⁾ Change in Water Elevation since last reported measurement

⁽²⁾ Measurements Based on Mean Sea Level

of 4 Page: 3 Date: 10/09/95

| SITE | DATE | MP ELEVATION ⁽²⁾ | TIME | DEPTH TO WATER | FLOATING PRODUCT THICKNESS | WATER ELEV. ⁽²⁾ | MATER ELEV!1) | EQUIV. FRESH WATER HEAD ¹² |
|------|----------|--------------------------------|-------|----------------------|----------------------------------|-------------------------------|------------------|--|
| | | (feet) | | (feet) | (feet) | (feet) | (feet) | (feet) |
| H-10 | 08/11/95 | 473.35 | 00:00 | 27.71 | .00 | 445.64 | NA | 445.64 |
| H-10 | 08/14/95 | 473.35 | 00:00 | 27.74 | .00 | 445.61 | 03 | 445.61 |
| H-10 | 08/16/95 | 473.35 | 00:00 | 27.79 | .00 | 445.56 | 05 | 445.50 |
| H-10 | 08/21/95 | 473.35 | 00:00 | 28.24 | .01 | 445.11 | 45 | 445.1 |
| H-10 | 08/24/95 | 473.35 | 00:00 | 28.31 | .01 | 445.04 | 07 | 445.0 |
| H-10 | 09/13/95 | 473.35 | 00:00 | 29.63 | .00 | 443.72 | -1.32 | 443.7 |
| H-10 | 09/21/95 | 473.35 | 00:00 | 30.16 | .00 | 443.19 | 53 | 443.1 |
| H-11 | 08/11/95 | 474.70 | 00:00 | 28.44 | .00 | 446.26 | NA | 446.2 |
| H-11 | 08/14/95 | 474.70 | 00:00 | 28.41 | .00. | 446.29 | .03 | 446.2 |
| H-11 | 08/16/95 | 474.70 | 00:00 | 28.47 | .00 | 446.23 | 06 | 446.2 |
| H-11 | 08/21/95 | 474.70 | 00:00 | 28.92 | .00 | 445.78 | - 45 | 445.7 |
| H-11 | 08/24/95 | 474.70 | 00:00 | 29.04 | .01 | 445.66 | 12 | 445.6 |
| H-11 | 09/13/95 | 474.70 | 00:00 | 30.03 | .00. | 444.67 | 99 | 444.6 |
| H-11 | 09/21/95 | 474.70 | 00:00 | 30.50 | .00 | 444.20 | 47 | 444.2 |
| MW-1 | 04/19/89 | 477.08 | 00:00 | 43.50 | .00 | 433.58 | NA | 433.5 |
| MW-1 | 05/01/89 | 477.08 | 00:00 | 42.74 | .00 | 434.34 | .76 | 434.3 |
| MW-1 | 08/01/89 | 477.08 | 00:00 | 43.86 | .00 | 433.22 | -1.12 | 433.2 |
| MW-1 | 09/01/89 | 477.08 | 00:00 | 45.35 | .00 | 431.73 | -1.49 | 431.7 |
| MW-1 | 11/02/89 | 477.08 | 00:00 | 46.39 | .00 | 430.69 | -1.04 | 430.6 |
| MW-1 | 02/02/90 | 477.08 | 00:00 | 45.36 | .00 | 431.72 | 1.03 | 431.7 |
| MW-1 | 05/02/90 | 477.08 | 00:00 | 42.58 | .00 | 434.50 | 2.78 | 434.5 |
| MW-1 | 03/06/91 | 477.79 | 00:00 | 41.25 | .00 | 436.54 | 2.04 | 436.5 |
| MW-1 | 05/02/91 | 477.79 | 00:00 | 40.05 | .00 | 437.74 | 1.20 | 437.7 |
| MW-1 | 08/07/91 | 477.79 | 00:00 | 53.79 | .00 | 424.00 | -13.74 | 424.0 |
| MW-1 | 11/05/91 | 477.79 | 00:00 | 59.25 | .00 | 418.54 | -5.46 | 418.5 |
| MW-1 | 02/21/92 | 477.79 | 00:00 | 59.27 | .00. | 418.52 | 02 | 418.5 |
| MW-1 | 05/04/92 | 477.79 | 00:00 | 54.47 | .00 | 423.32 | 4.80 | 423.3 |
| MW-1 | 02/12/93 | 477.79 | 00:00 | 52.02 | .00 | 425.77 | 2.45 | 425.7 |
| MW-1 | 05/04/93 | 477.79 | 00:00 | 39.42 | .00 | 438.37 | 12.60 | 438.3 |
| MW-1 | 02/23/95 | 477.79 | 00:00 | 33.10 | .00 | 444.69 | 6.32 | 444.6 |
| MW-1 | 04/28/95 | 477.79 | 00:00 | 26.40 | .06 | 451.39 | 6.70 | 451.4 |
| MW-1 | 06/02/95 | 477.79 | 00:00 | 26.16 | .01 | 451.63 | .24 | 451.€ |
| MW-1 | 06/30/95 | 447.79 | 00:00 | 27.06 | .01 | 420.73 | -30.90 | 420.7 |
| MW-1 | 07/25/95 | 477.79 | 00:00 | 28.55 | .05 | 449.24 | 28.51 | 449.2 |

⁽¹⁾ Change in Water Elevation since last reported measurement

⁽²⁾ Measurements Based on Mean Sea Level

TABLE 2 Product Thickness and Groundwater Elevation Table

Page: 4 of 4 Date: 10/09/95

| SITE | DATE | MP ELEVATION ⁽²⁾ | TIME | DEPTH TO WATER | FLOATING PRODUCT THICKNESS | WATER ELEV. ⁽²⁾ | WATER ELEV ⁽¹⁾ | EQUIV. FRESH WATER HEAD ⁽²⁾ |
|------|----------|--------------------------------|-------|----------------------|----------------------------------|-------------------------------|------------------------------|---|
| | | (feet) | | (feet) | (feet) | (feet) | (feet) | (feet) |
| MW-1 | 08/07/95 | 477.79 | 00:00 | 29.49 | .04 | 448.30 | 94 | 448.32 |
| MW-1 | 08/11/95 | 477.79 | 00:00 | 29.81 | .03 | 447.98 | 32 | 448.00 |
| MW-1 | 08/14/95 | 477.79 | 00:00 | 29.75 | .00 | 448.04 | .06 | 448.04 |
| MW-1 | 08/16/95 | 477.79 | 00:00 | 29.95 | .00 | 447.84 | 20 | 447.84 |
| MW-1 | 08/21/95 | 477.79 | 00:00 | 30.34 | .00 | 447.45 | 39 | 447.45 |
| MW-1 | 08/24/95 | 477.79 | 00:00 | 30.62 | .00 | 447.17 | 28 | 447.17 |
| MW-1 | 09/13/95 | 477.79 | 00:00 | 31.92 | .00 | 445.87 | -1.30 | 445.87 |
| MW-1 | 09/21/95 | 477.79 | 00:00 | 32.53 | .18 | 445.26 | 61 | 445.38 |

⁽¹⁾ Change in Water Elevation since last reported measurement

Table 3
Groundwater Sample Analytical Summary Table

| Sample Location | TVH (Gasoline) EPA 8015 (LUFT) | TEH (Diesel) EPA 8015 (LUFT) | TEH (Fuel Oil) EPA 8015 (LUFT) | BTXE EPA 8020 | MTBE EPA 8020 | Other VOCs EPA 8010 |
|--------------------|-----------------------------------|---------------------------------|-----------------------------------|------------------|------------------|------------------------|
| MSP-MW1 | х | х | х | X | х | NA |
| MSP-H1 | x | x | x | X | x | NA |
| MSP-H2 | x | x | x | x | x | NA |
| мѕр-нз | x | х | x | x | x | NA |
| MSP-H4 | x | x | x | X | X | NA |
| MSP-H5 | x | x | x | x | X | NA |
| MSP-H6 | x | x | x | х | x | NA |
| MSP-H7 | x | x | x | х | x | NA |
| MSP-H8 | x | x | x | х | x | NA |
| MSP-H9 | X | x | x | х | x | NA |
| MSP-H10 | x | x | x | х | х | NA |
| MSP-H11 | x | x | x | X | x | NA |
| GROTH-MW1 | x | x | x | x | x | X |

Table 4 Soil Sample Analytical Results

| Sample ID | Sample Depth | Gasoline (TVH) | Diesel (TEH) | Fuel Oil (TEH) |
|------------------------------|--------------|-----------------|-----------------|-----------------|
| | •••• | EPA 8015 (LUFT) | EPA 8015 (LUFT) | EPA 8015 (LUFT) |
| , | (ft) | mg/kg | mg/kg | mg/kg |
| MSP-H1-SD2 | 10.5 | ND (1) | ND (1) | ND (25) |
| MSP-H1-SD3 | 15.5 | NĐ (1) | ND (1) | ND (25) |
| MSP-H1-SD4 | 20.5 | ND (1) | NA | NA |
| MSP-H1-SD5 | 25.5 | ND (1) | ND (1) | ND (25) |
| MSP-H2-SD2 | 11.5 | ND (1) | ND (1) | ND (25) |
| MSP-H2-SD3 | 16.5 | ND (1) | ND (1) | ND (25) |
| MSP-H2-SD4 | 21 5 | NA | NÀ | NÀ Í |
| MSP-H2-SD5 | 26.5 | ND (1) | ND (1) | ND (25) |
| MSP-H2-SD6 | 31.5 | ND (1) | ND (1) | ND (25) |
| MSP-H2-SD7 | 36.5 | NÀ ´ | NÀ | NA |
| MSP-H3-SD1 | 5.5 | NA | NA | NA |
| VISP-H3-SD2 | 10.5 | NA | NA | NA |
| MSP-H3-SD3 | 15 | ND (1) | ND (1) | ND (25) |
| MSP-H3-SD4 | 20 | NA | NA | NA NA |
| MSP-H3-SD5 | 25 | ND (1) | ND (1) | ND (25) |
| MSP-H4-SD1 | 6.5 | ND (1) | ND (1) | ND (25) |
| MSP-H4-SD3 | 16.5 | ND (1) | ND (1) | ND (25) |
| MSP-H4-SD5 | 26.5 | ND (1) | ND (1) | ND (25) |
| MSP-H4-SD6 | 29 | ND (1) | NA NA | NA |
| MSP-H5-SD1 | 5.5 | ND (1) | ND (1) | ND (25) |
| MSP-H5-SD2 | 10 5 | ND (1) | ND (1) | ND (25) |
| MSP-H5-SD3 | 15 5 | NA NA | NA NA | NA |
| VISP-H5-SD4 | 20.5 | NA NA | NA NA | NA |
| MSP-H5-SD5 | 25 5 | ND (1) | ND (1) | ND (25) |
| MSP-H6-SD1 | 5.5 | NA NA | NA NA | NA NA |
| WSP-H6-SD2 | 9.5 | ND (1) | | |
| * = | | | ND (1) NA | ND (25) |
| VISP-H6-SD4 VISP-H6-SD5-1 | 20.5 | ND (1) | | NA ND (05) |
| | 25 5 | ND (1) | ND (1) | ND (25) |
| MSP-H6-SD5-2 | 25 5 | 1.6 | ND (1) | ND (25) |
| MSP-H7-SD1 | 6.5 | ND (1) | NA NA | NA NA |
| MSP-H7-SD3 | 16.5 | ND (1) | NA NA | NA |
| MSP-H7-SD4 | 21 | ND (1) | NA ND (1) | NA NA |
| MSP-H7-SD5 | 26 5 | ND (1) | ND (1) | ND (25) |
| ASP-H8-SD1 | 5.5 | NA ND (4) | NA NB (1) | NA NB (TEX |
| MSP-H8-SD2 | 10.5 | ND (1) | ND (1) | ND (25) |
| MSP-HB-SD3 | 15.5 | ND (1) | ND (1) | ND (25) |
| MSP-H8-SD4 | 20 | NA NB /// | NA | NA |
| MSP-H8-SD5 | 25.5 | ND (1) | ND (1) | ND (25) |
| MSP-H9-SD2 | 10.5 | ND (1) | ND (1) | ND (25) |
| MSP-H9-SD3-1 | 16.5 | ND (1) | ND (1) | ND (25) |
| MSP-H9-SD3-2 | 16.5 | ND (1) | ND (1) | ND (25) |
| MSP-H9-SD4 | 21 | NA | NA Limita | NA |
| /ISP-H9-SD5-1 | 26 | ND (1) | ND (1) | ND (25) |
| MSP-H9-SD5-2 | 26 | ND (1) | ND (1) | ND (25) |
| VISP-H9-SD6 | 31.5 | NA | NA NA | NA |
| MSP-H9-SD7 | 35 5 | ND (1) | NA | NA |
| MSP-H10-SD2 | 11.5 | NA NA | NA | NA |
| MSP-H10-SD3 | 16 | ND (1) | ND (1) | ND (25) |
| MSP-H10-SD5 | 26.5 | ND (1) | ND (1) | ND (25) |
| MSP-H11-SD1 | 6.5 | NA | NA | NA |
| MSP-H11-SD2 | 11.5 | ND (1) | ND (1) | ND (25) |
| MSP-H11-SD3 | 16,5 | NA | NA | NA |
| MSP-H11-SD4 | 21.5 | ND (1) | ND (1) | ND (25) |
| MSP-H11-SD5 | 26.5 | ND (1) | ND (1) | ND (25) |

Notes

¹ Soll sample depths were measured relative to ground surface 2 NA - not analyzed 3 ND () - non detect (reporting limit)

Table 4 (cont'd) Soil Sample BTEX and Other VOC Analytical Results

| Sample ID | Sampling Depth | Benzene | Toluene | Ethylbenzene | Total Xylene | Other VOCs |
|--------------|----------------|--------------|------------------|--------------|--------------|------------|
| | (ft) | EPA 8020 | EPA 8020 | EPA 8020 | EPA 8020 | EPA 8010 |
| | | ug/kg | ug/kg | ug/kg | ug/kg | ug/kg |
| MSP-H1-SD2 | 10.5 | ND (5) | ND (5) | ND (5) | ND (5) | МD |
| MSP-H1-SD3 | 15.5 | ND (5) | ND (5) | ND (5) | ND (5) | ΝĐ |
| MSP-H1-SD4 | 20.5 | ND (5) | ND (5) | ND (5) | ND (5) | NA |
| MSP-H1-SD5 | 25.5 | ND (5) | ND (5) | ND (5) | ND (5) | ND |
| MSP-H2-SD2 | 11.5 | ND (5) | ND (5) | ND (5) | ND (5) | В |
| MSP-H2-SD3 | 165 | ND (5) | ND (5) | ND (5) | ND (5) | NA |
| MSP-H2-SD4 | 21.5 | NA. | NA | NA | NA | NA |
| MSP-H2-SD5 | 26 5 | ND (5) | ND (5) | ND (5) | ND (5) | ND |
| MSP-H2-SD8 | 315 | ND (5) | ND (5) | ND (5) | ND (5) | NA |
| MSP-H2-SD7 | 36 5 | NA. | NA | NA NA | NA | NA |
| MSP-H3-SD1 | 5.5 | NA | NA | NA | NA | NA |
| MSP-H3-SD2 | 10.5 | NA | NA | NA | NA | NA |
| MSP-H3-SD3 | 15 | ND (5) | ND (5) | ND (5) | ND (5) | NA |
| MSP-H3-SD4 | 20 | NA. | NA. | NA | NA | NA |
| MSP-H3-SD5 | 25 | ND (5) | ND (5) | ND (5) | ND (5) | NA |
| MSP-H4-SD1 | 6.5 | ND (5) | ND (5) | ND (5) | ND (5) | ND |
| MSP-H4-SD3 | 16 5 | ND (5) | ND (5) | ND (5) | ND (5) | ND |
| MSP-H4-SD5 | 26.5 | ND (5) | ND (5) | ND (5) | ND (5) | ND |
| MSP-H4-SD6 | 29 | ND (5) | ND (5) | ND (5) | ND (5) | NA |
| MSP-H5-SD1 | 5.5 | ND (5) | ND (5) | ND (5) | ND (5) | NA |
| MSP-H5-SD2 | 10 5 | ND (5) | ND (5) | ND (5) | ND (5) | NA |
| MSP-H5-SD3 | 15 5 | NA | NA | NA | NA | NA |
| MSP-H5-SD4 | 20 5 | NA. | NA NA | NA | NA | NA |
| MSP-H5-SD5 | 25,5 | ND (5) | ND (5) | ND (5) | ND (5) | NA |
| MSP-H6-SD1 | 5,5 | NA NA | NA NA | NA. | NA | NA |
| MSP-H6-SD2 | 9.5 | ND (5) | ND (5) | ND (5) | ND (5) | NA |
| | 95 205 | ND (5) | ND (5) | ND (5) | ND (5) | NA |
| MSP-H6-SD4 | 20 5 25 5 | 95 | 9.2 | 97 | 13 | NA. |
| MSP-H6-SD5-1 | | 160 | 39 | ND (5) | 45 | NA |
| MSP-H6-SD5-2 | 25 5 6 5 | ND (5) | ND (5) | ND (5) | ND (5) | NA |
| MSP-H7-SD1 | | ND (5) | ND (5) | ND (5) | ND (5) | NA. |
| MSP-H7-SD3 | 16 5 | | ND (5) | ND (5) | ND (5) | NA. |
| MSP-H7-S04 | 21 | ND (5) 19 | ND (5) | ND (5) | ND (5) | NA. |
| MSP-H7-SD5 | 26.5 | NA NA | ND (5) | NA NA | NA NA | NA. |
| MSP-H8-S01 | 5.5 | | ND (5) | ND (5) | ND (5) | NA. |
| MSP-H8-SD2 | 10.5 | ND (5) | ND (5) | ND (5) | ND (5) | NA. |
| MSP-H8-SD3 | 15 5 | ND (5) | | NA NA | NA NA | NA NA |
| MSP-H8-SD4 | 20 | NA ND (6) | NA ND (5) | ND (5) | ND (5) | NA NA |
| MSP-H8-SD5 | 25.5 | ND (5) | | ND (5) | ND (5) | NA NA |
| MSP-H9-SD2 | 10.5 | ND (5) | ND (5) | ND (5) | ND (5) | NA NA |
| MSP-H9-SD3-1 | 16.5 | ND (5) | ND (5) | ND (5) | ND (5) | NA NA |
| MSP-H9-SD3-2 | 16.5 | ND (5) | ND (5) NA | ND (5) | NA NA | NA |
| MSP-H9-SD4 | 21 | NA ND (6) | NA ND (5) | ND (5) | ND (5) | NA. |
| MSP-H9-SD5-1 | 26 | ND (5) | NO (5) NO (5) | ND (5) | ND (5) | NA. |
| MSP-H9-805-2 | 26 | ND (5) | NA AN (3) | NA NA | NA NA | NA. |
| MSP-H9-SD6 | 31.5 | NA ND (E) | | ND (5) | ND (5) | NA NA |
| MSP-H9-SD7 | 35 5 | ND (5) | ND (5) NA | ND (5) NA | NA ND (a) | NA NA |
| MSP-H10-SD2 | 11.5 | NA NB (E) | | | ND (5) | NA NA |
| MSP-H10-SD3 | 16 | ND (5) | ND (5) | ND (5) | ND (5) | NA NA |
| MSP-H10-SD5 | 26.5 | ND (5) | ND (5) | ND (5) | NA NA | NA NA |
| MSP-H11-SD1 | 6.5 | NA NA | NA ND (5) | NA NO (6) | | NA ND |
| MSP-H11-SD2 | 11.5 | ND (5) | ND (5) | ND (5) | ND (5) | |
| MSP-H11-SD3 | 16.5 | NA | NA | NA NA | NA ND (5) | NA |
| MSP-H11-SD4 | 21.5 | ND (5) | ND (5) | ND (5) | ND (5) | NA NB |
| MSP-H11-SD5 | 26.5 | ND (5) | ND (5) | ND (5) | ND (5) | ND |

Notes:

Soil sample depths were measured relative to ground surface
 NA - not analyzed
 ND () - non detect (reporting limit)

TABLE 5
Groundwater Analyses Summary Table

Page: 1A of 1A Date: 10/09/95

| SITE | DATE | Gasoline (ug/l) | Benzene (ug/l) | Toluene (ug/l) | Ethyl benzene (ug/l) | Total xylenes (ug/l) | MTBE (ug/l) |
|-------|----------|--------------------|-------------------|-------------------|---------------------------------------|-------------------------|----------------|
| GROTH | 08/11/95 | <50 | < 0.5 | <0.5 | · · · · · · · · · · · · · · · · · · · | <0.5 | _ |
| | | | | | < 0.5 | | <2.0 |
| H-01 | 08/11/95 | <50 | < 0 5 | <0.5 | <0.5 | <0.5 | <2.0 |
| H-01 | 09/13/95 | <50 | < 0.5 | < 0.5 | < 0.5 | <0.5 | <2.0 |
| H-02 | 08/14/95 | <50 | < 0.5 | < 0.5 | < 0.5 | 5.4 | < 2.0 |
| H-03 | 08/11/95 | <50 | 10 | < 0.5 | < 0.5 | < 0.5 | 26 |
| H-04 | 08/14/95 | 210 | 9.2 | < 0.5 | < 0.5 | 4.8 | 29 |
| H-04 | 09/13/95 | <50 | 1.3 | < 0.5 | < 0.5 | < 0.5 | < 2.0 |
| H-05 | 08/11/95 | 4000 | 1300 | 270 | 43 | 350 | 14000 |
| H-05 | 08/16/95 | 970 | 340 | <5.0 | < 5.0 | 80 | 4800 |
| H-06 | 08/14/95 | 16000 | 7700 | 1100 | 120 | 800 | 67000 |
| H-07 | 08/11/95 | 17000 | 3200 | 820 | 740 | 1900 | 14000 |
| H-07 | 09/13/95 | 5800 | 2800 | 77 | 280 | 510 | 11000 |
| H-08 | 08/11/95 | 7300 | 3000 | 89 | 140 | 230 | 15000 |
| H-08 | 09/13/95 | 4000 | 2200 | 61 | 42 | 120 | 8000 |
| H-09 | 08/14/95 | < 50 | <0.5 | < 0.5 | < 0.5 | 0.8 | < 2.0 |
| H-09 | 08/16/95 | <50 | < 0.5 | < 0.5 | <0.5 | < 0.5 | <2.0 |
| H-10 | 08/14/95 | <50 | < 0.5 | < 0.5 | <0.5 | < 0.5 | <2.0 |
| H-11 | 08/14/95 | < 50 | < 0.5 | < 0.5 | < 0.5 | < 0.5 | <2.0 |
| MW-1 | 08/14/95 | 11000 | 190 | 260 | 110 | 900 | 210 |

Values represent total concentrations unless noted < = Not detected at indicated reporting limit --- = Not analyzed


For RCL 8020C&T


Page: 1A of 1A Date: 10/09/95

| SITE | DATE | Diesel | Fuel oil no. 6 |
|------|----------|--------|----------------|
| | | (ug/l) | (ug/l) |
| H-01 | 08/11/95 | < 50 | <1300 |
| H-02 | 08/14/95 | <50 | <1300 |
| H-03 | 08/11/95 | <50 | <1300 |
| H-04 | 08/14/95 | < 50 | <1300 |
| H-05 | 08/11/95 | 74 | <1300 |
| H-05 | 08/16/95 | <50 | <1300 |
| H-06 | 08/14/95 | 540 | <1300 |
| H-07 | 08/11/95 | 620 | <1300 |
| H-08 | 08/11/95 | 87 | <1300 |
| H-09 | 08/14/95 | 260 | <1300 |
| H-09 | 08/16/95 | < 50 | <1300 |
| H-10 | 08/14/95 | <50 | <1300 |
| H-11 | 08/14/95 | <50 | <1300 |
| MW-1 | 08/14/95 | 1100 | <1300 |


Values represent total concentrations unless noted <= Not detected at indicated reporting limit --- = Not analyzed

For RCL 8015MC&T

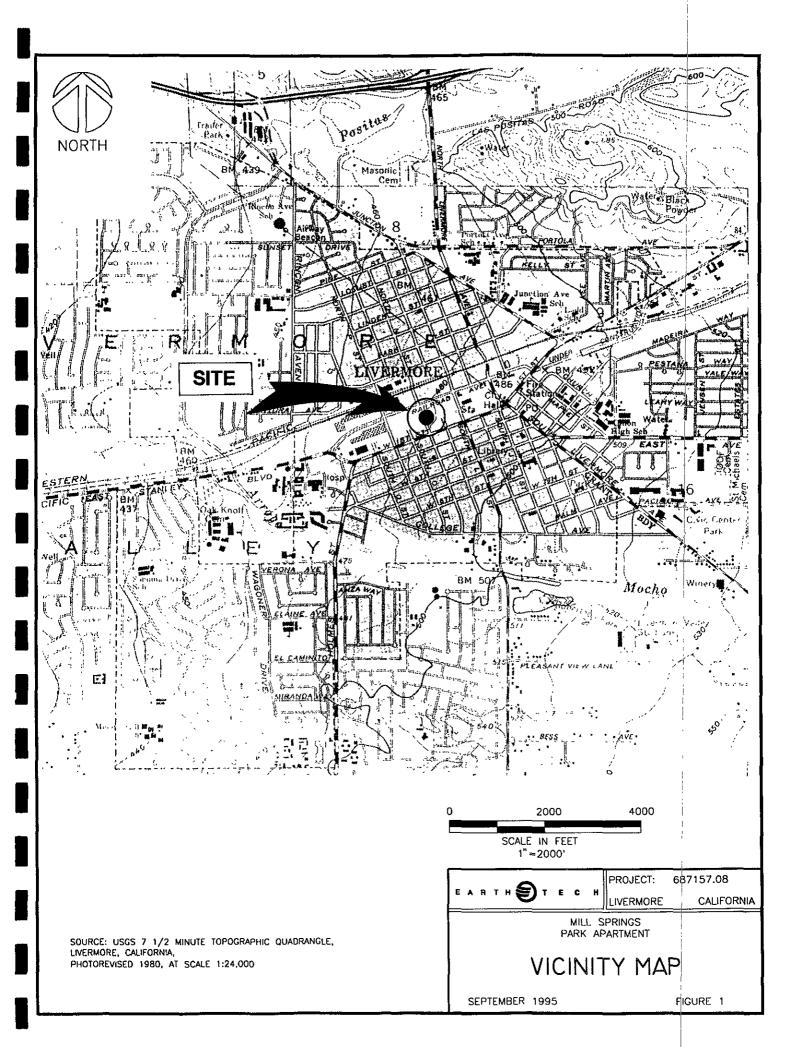

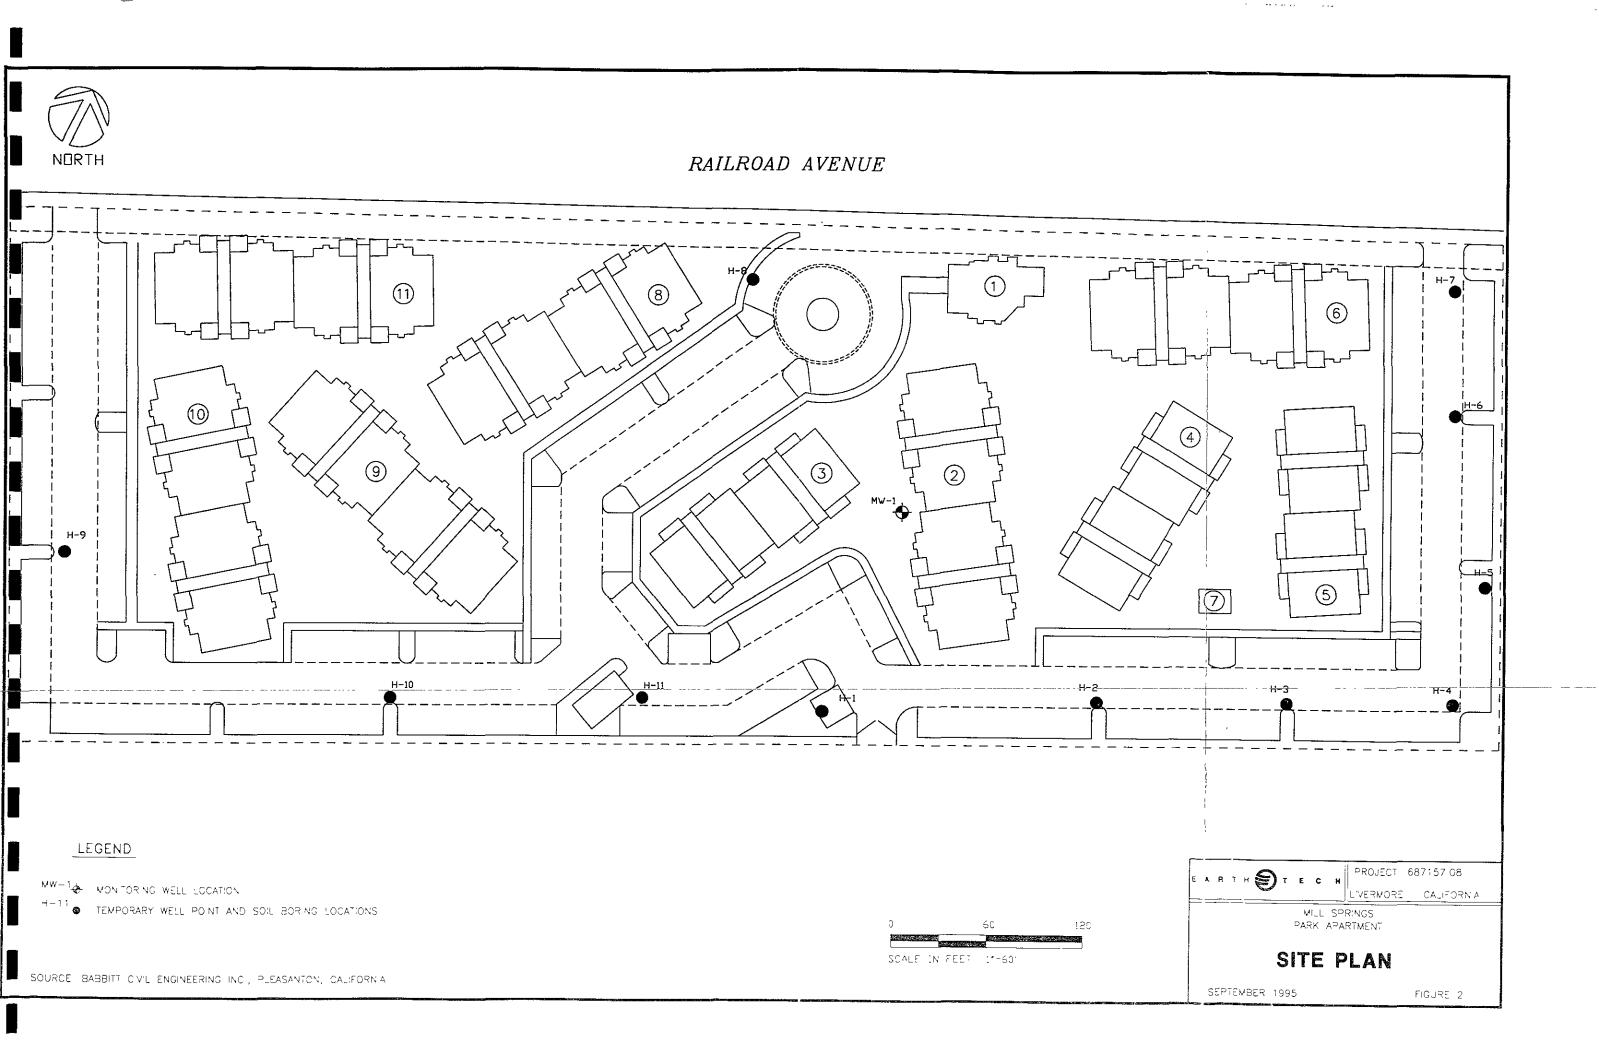



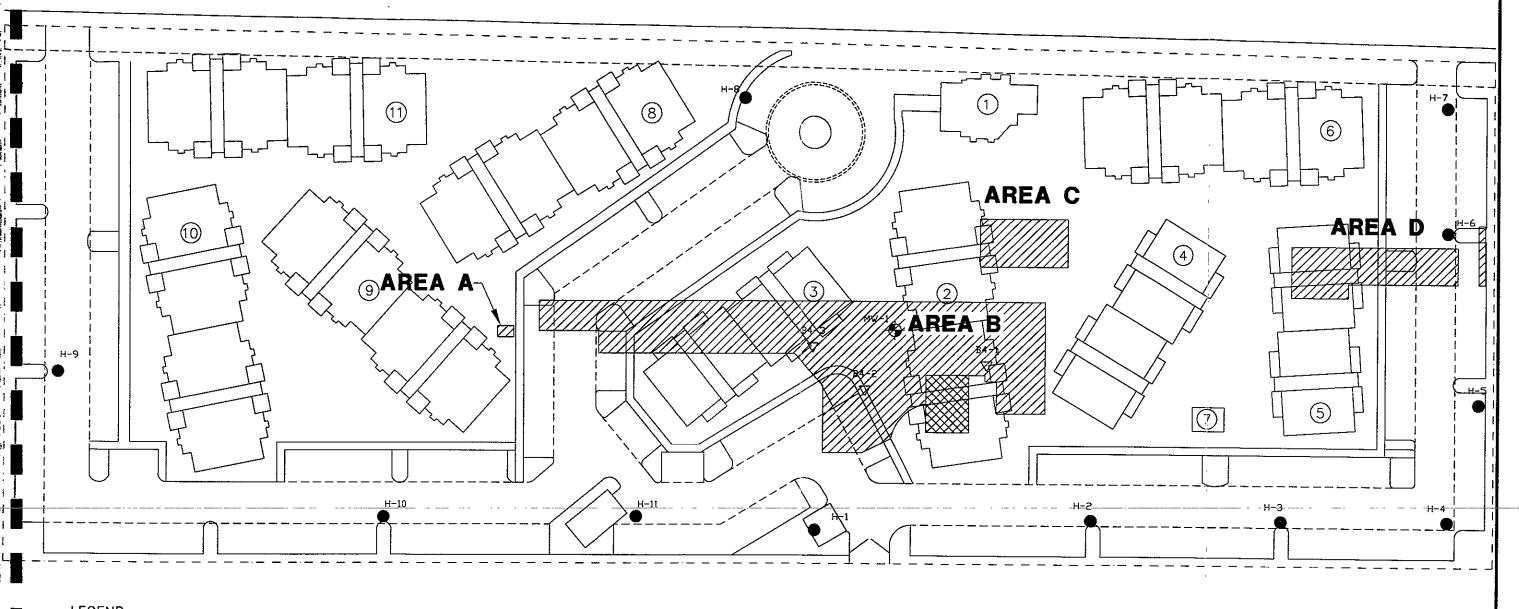

LEGEND

MW-1. ✓ MONITORING WELL LOCATION

TEMPORARY WELL POINT AND SOIL BORING LOCATIONS

 $^{\mathrm{B4-3}}\nabla$ Boring location (Phase I)

PHASE | EXCAVATION LIMITS (APPROX.)

CONCRETE VAULT STRUCTURE

SOURCE BABBITT CIVILIENGINEERING INC., PLEASANTON, CALIFORNIA







FINAL REMEDIATION AREA LIMITS

SEPTÉMBER 1995

FIGURE 3

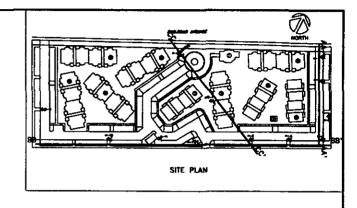

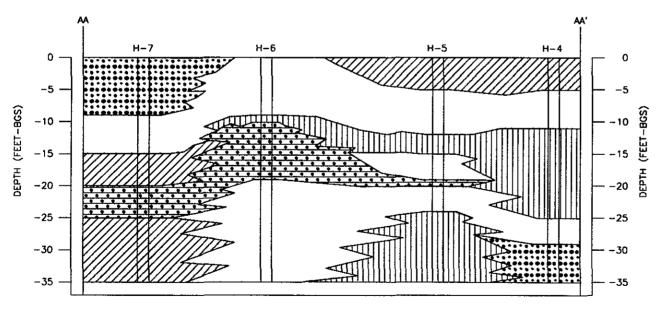

USCS CLASSIFICATION

CL Gravelly Clay/Sondy Clay/Silty Clay/Clay

GC Clayey Gravel

GP Gravel/Sandy Gravel

ML Silt/Clayey Silt/Sandy Silt

SC Cloyer Sand

SP Growthy Sond/Sond

0 60 120

HOR, SCALE IN FEET 1"=60"


A R T H T T E E E LIVERMORE CALIFORNIA


MILL SPRINGS PARK APARTMENT

CROSS SECTION

SEPTEMBER 1995

TIGURE 4

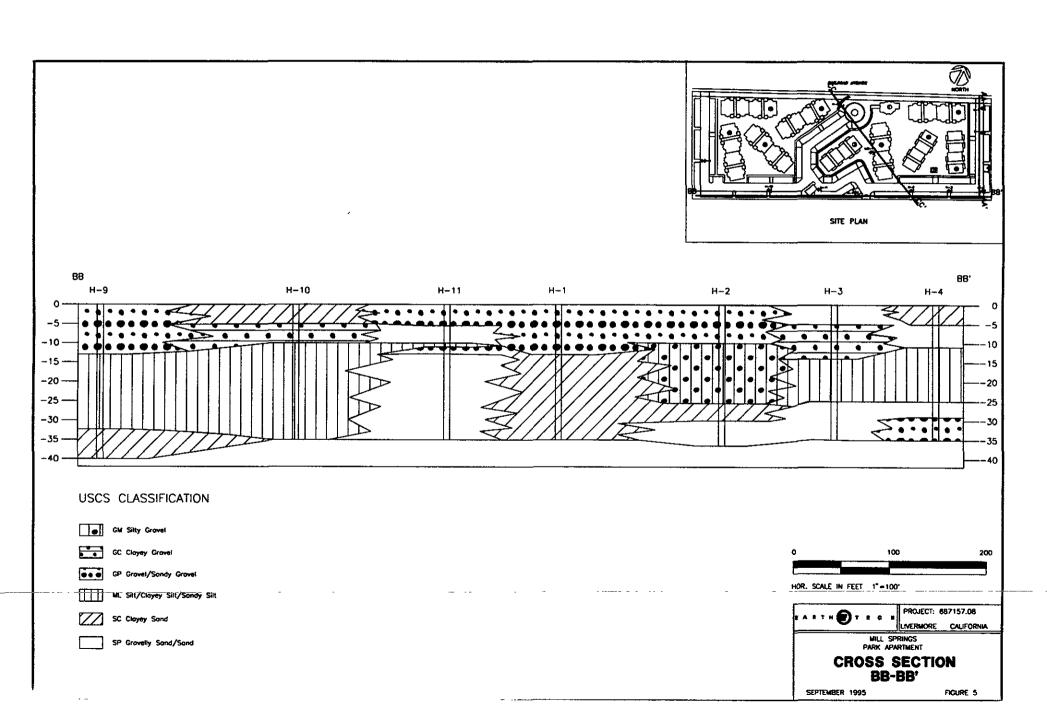

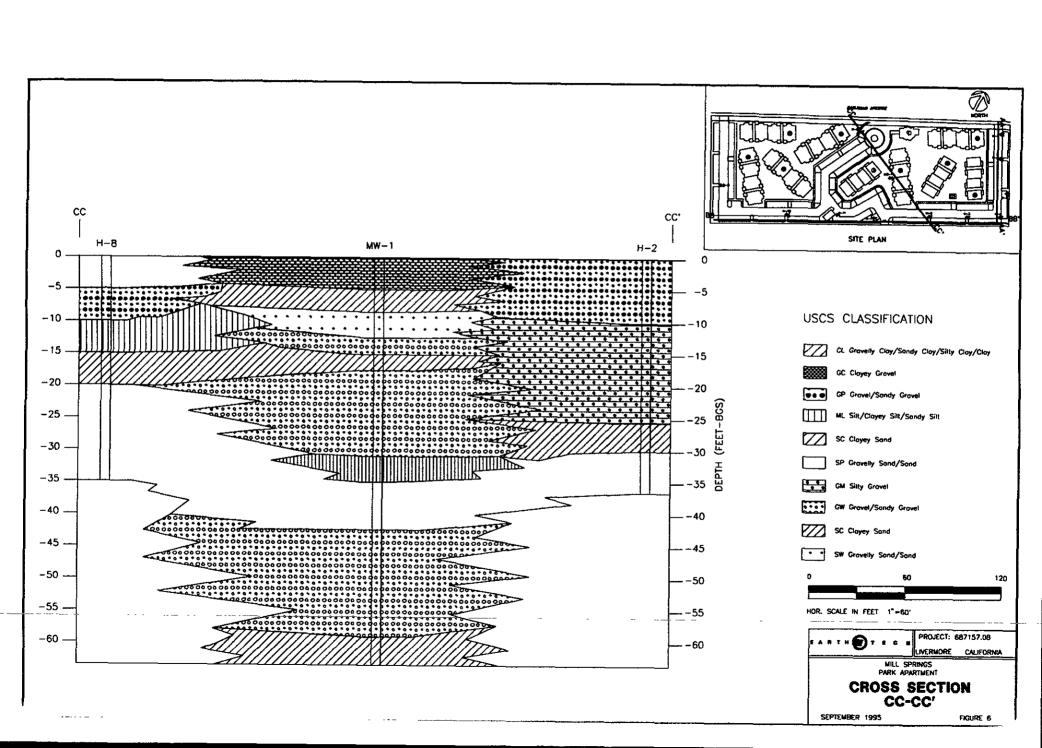

Site: MW-1

 $\Delta \Omega \cdot \Delta \Delta$


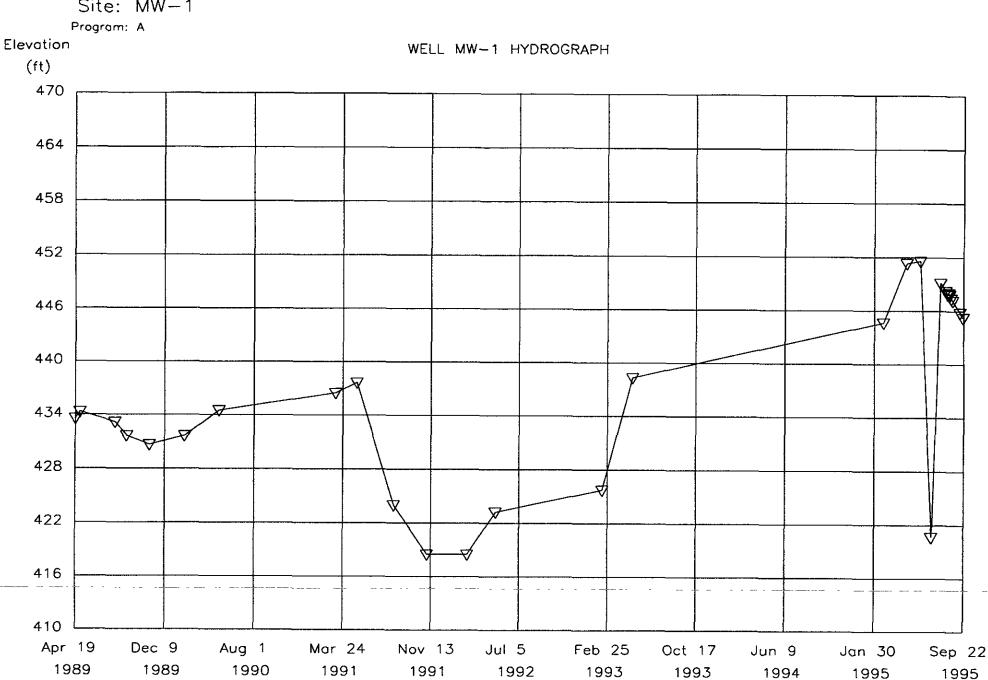


FIGURE 7



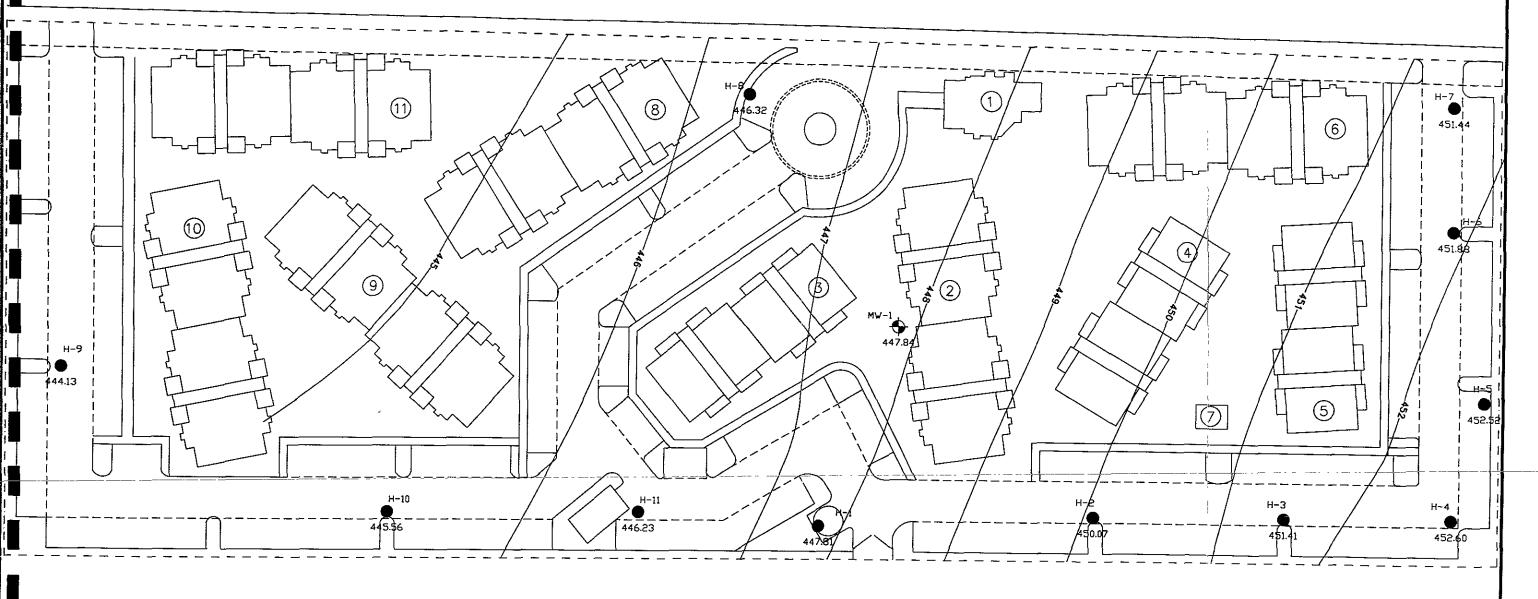

LEGEND

MW−1

MON/TORING WELL LOCATION

H-1. TEMPORARY WELL POINT AND SO'L BORING LOCATONS

C 60 120 SCALE IN FEET 1'=60'




GROUNDWATER ELEVATION CONTOUR-AUG. 16, 1995

SEPTEMBER 1995

F/GLRE 8



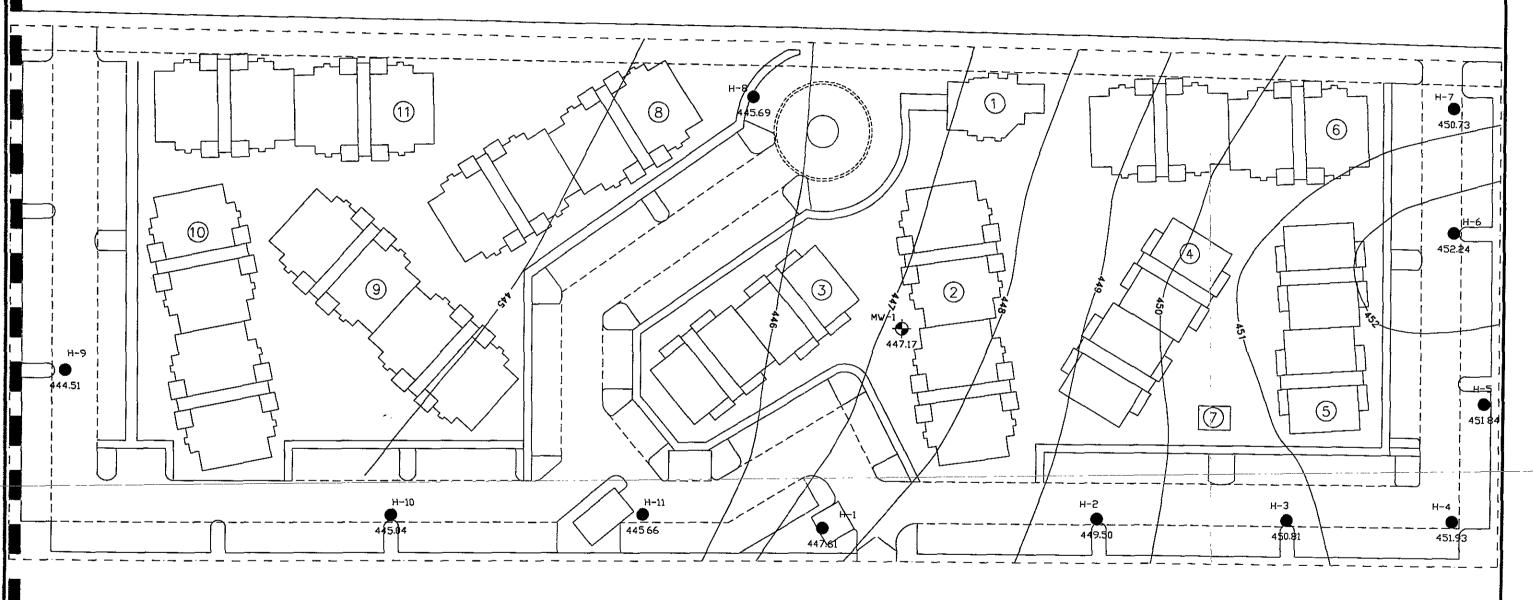

LEGEND

MW-1 MONITORING WELL LOCATION

H-11 TEMPORARY WELL POINT AND SOIL BORING LOCATIONS

0 60 120 SCALE IN FEET : '=60'




GROUNDWATER ELEVATION CONTOUR-AUG.24, 95

SEPTEMBER 1995

FIGURE 9



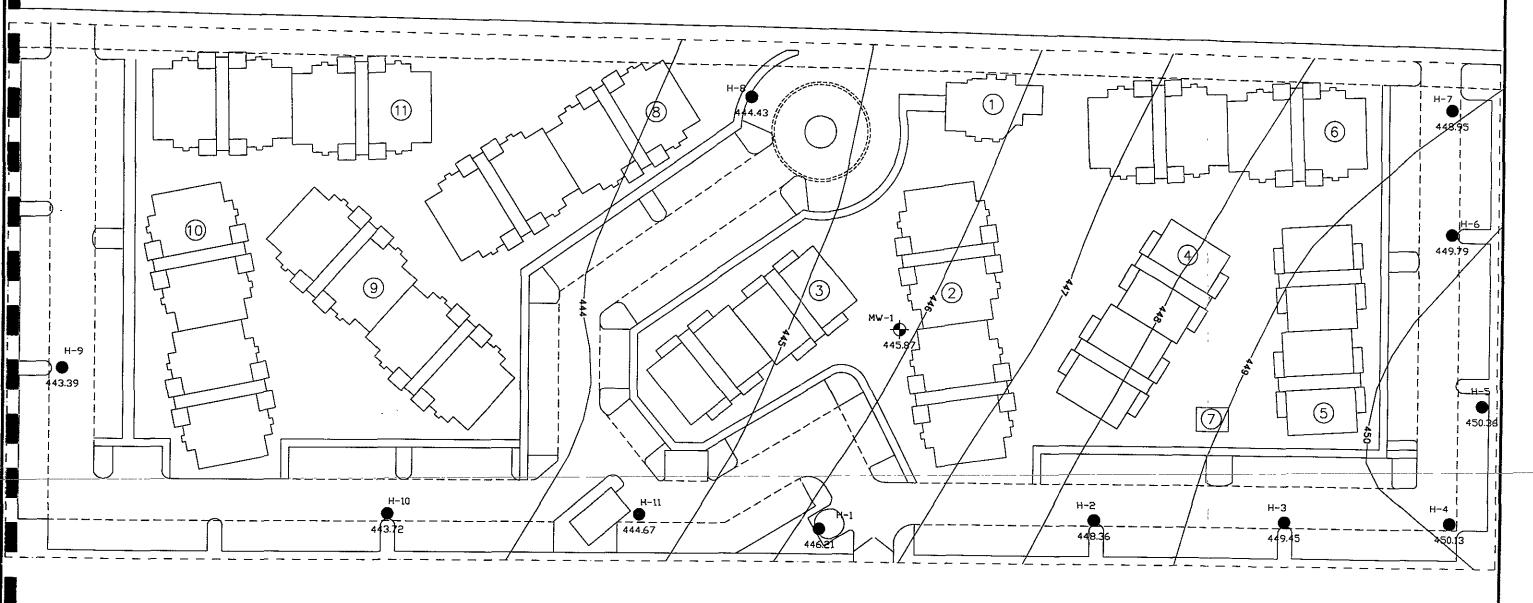

LEGEND

MW-1 MONITORING WELL LOCATION

F-11 • TEMPORARY WELL POINT AND SO'L BORING LOCATIONS

0 60 120 SCALE IN FEET :'=60' PROJECT 687157 08

JIL VERMORE CALIFORNIA


WILL SPRINGS
PARK APARTMENT

GROUNDWATER ELEVATION CONTOUR-SEPT.13, 1995

SEPTEMBER 1995

FIGURE 10



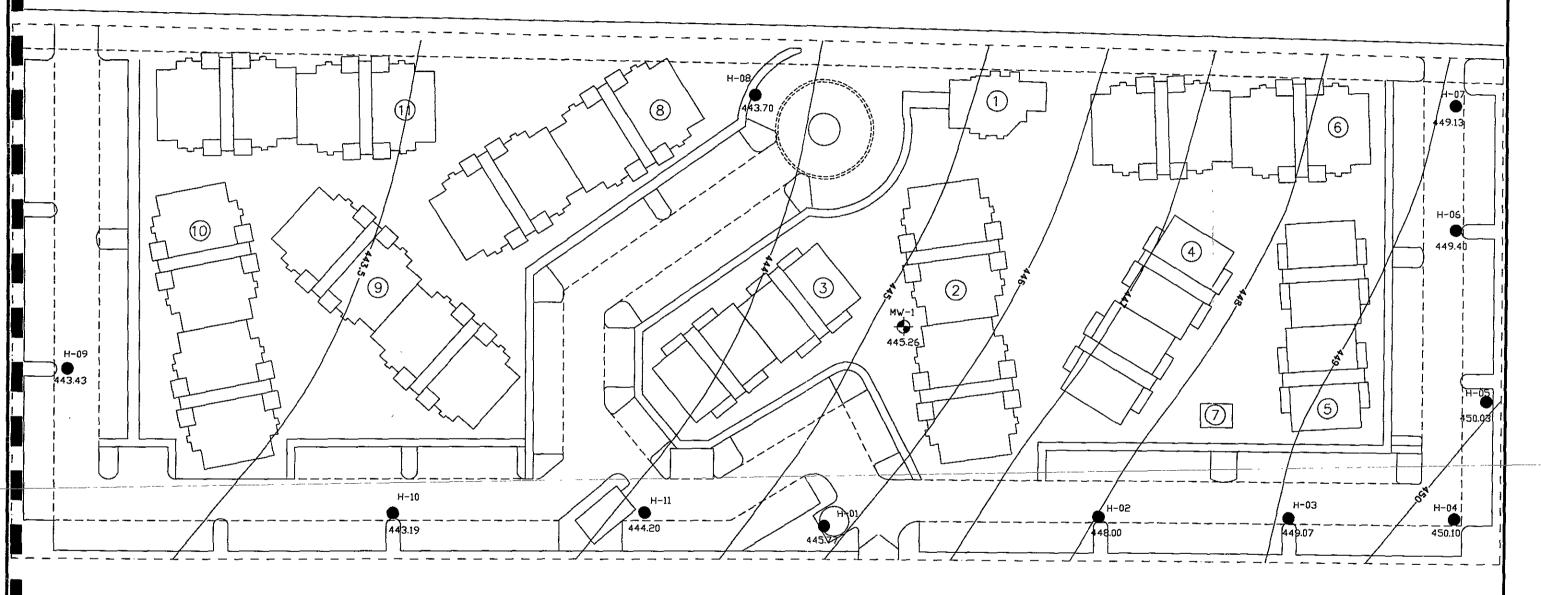

LEGEND

MW-1- MONITORING WELL LOCATION

H-11 • TEMPORARY WELL POINT AND SOIL BORING LOCATIONS

0 60 :20 SCALE IN FEET 1'=60'



SOURCE BABBITT CIVIL ENGINEERING INC. PLEASANTON, CALIFORNIA

