

*R049*

**Semiannual Monitoring Report for  
July 1 through December 31, 1998  
East Baybridge Center  
Emeryville and Oakland, California**

**February 1, 1999  
1649.98-002**

Prepared for  
Catellus Development Corporation  
201 Mission Street  
San Francisco, California 94105



February 1, 1999

1649.98-002

Ms. Susan Hugo  
Alameda County Health Care Services Agency  
1131 Harbor Bay Parkway, Second Floor  
Alameda, California 94502

Subject: Semiannual Monitoring Report for July 1 through December 31, 1998, East Baybridge Center, Emeryville and Oakland, California

Dear Ms. Hugo:

This report presents the results of semiannual groundwater monitoring by LFR Levine•Fricke (LFR) on behalf of Catellus Development Corporation for July 1 through December 31, 1998, at the Yerba Buena/East Baybridge Center in Emeryville and Oakland, California.

Monitoring was conducted in accordance with LFR's revised "Groundwater Monitoring Plan for the East Baybridge Center, Emeryville and Oakland, California," submitted April 15, 1998, and verbally approved by you in our phone conversation. If there are any questions or comments concerning this report, please call me.

Sincerely,



Ron Goloubow  
Senior Project Geologist

Enclosure

cc: James Adams, Catellus Development  
Sumadhu Arigala, Regional Water Quality Control Board

**CONTENTS**

<b>CERTIFICATION .....</b>	iii
<b>1.0      INTRODUCTION .....</b>	1
<b>2.0      BACKGROUND.....</b>	1
2.1 Areas A and B.....	2
2.2 Area C .....	2
<b>3.0      GROUNDWATER ELEVATIONS AND FLOW DIRECTION .....</b>	3
3.1 Areas A and B.....	3
3.2 Area C .....	3
<b>4.0      GROUNDWATER SAMPLING AND ANALYSIS.....</b>	3
<b>5.0      GROUNDWATER QUALITY .....</b>	4
5.1 Volatile Organic Compounds .....	4
5.2 Total Petroleum Hydrocarbons .....	5
5.2.1 Former Bashland Company Property .....	6
5.2.2 Former Bay Area Warehouse Property.....	6
<b>6.0      SUMMARY .....</b>	6
<b>7.0      SCHEDULED ACTIVITIES PROPOSED .....</b>	7
<b>8.0      REFERENCES.....</b>	8

**TABLES**

- 1 Well Construction and Groundwater Elevation Data
- 2A Summary of Sampling QA/QC
- 2B Summary of Analytical QA/QC
- 3 Semiannual Summary of Groundwater Quality Data
- 4 Semiannual Groundwater Monitoring Schedule

**FIGURES**


- 1 Site Location Map**
- 2 Site Plan Showing Groundwater Elevations in Shallow Wells, September 14, 1998**

**APPENDICES**

- A Field Procedures**

## CERTIFICATION

All hydrogeologic and geologic information, conclusions, and recommendations in this document have been prepared under the supervision of and reviewed by an LFR Levine-Fricke California Registered Geologist.



Donald T. Bradshaw  
Principal Hydrogeologist  
California Registered Geologist (5300)

2/1/99  
Date

## 1.0 INTRODUCTION

This report presents the results of groundwater monitoring by LFR Levine·Fricke (LFR) during the semiannual period from July 1 through December 31, 1998, at the East Baybridge Center in Emeryville and Oakland, California ("the Site"; Figure 1). LFR is performing groundwater monitoring and submitting this report on behalf of Catellus Development Corporation ("Catellus") in accordance with a December 19, 1994 groundwater monitoring plan submitted to the Alameda County Health Care Services Agency (ACHCSA; LFR 1994a).

The Site covers approximately 51 acres, is partially developed, and is undergoing further development. To aid in organizing environmental investigation, remediation, and monitoring, the Site has been divided into Areas A, B, and C (Figure 2).

Semiannual monitoring at the Site includes measuring water levels in accessible wells and collecting groundwater samples from selected wells, to monitor volatile organic compound (VOC) concentrations in groundwater and assess the effectiveness of a groundwater extraction system installed at the Site during the summer of 1994. In addition, soils affected with total petroleum hydrocarbons (TPH) have been contained on site beneath building pads, and monitoring data are being collected to assess possible effects on groundwater quality beneath the Site from the contained soils.

The revised monitoring plan reducing monitoring to a semiannual event has been implemented based on verbal confirmation from Ms. Susan Hugo of the ACHCSA.

## 2.0 BACKGROUND

From the early 1900s to approximately 1990, the Site was used by a variety of industrial and commercial businesses. These businesses included warehouse storage of predominantly dry goods and limited quantities of hazardous materials (oxides and acids [a complete record of materials stored at the Site is not available]); metal foundries; truck maintenance and repair; an auto storage and wrecking yard; a construction yard; and several passenger and freight rail lines.

In preparation for site development, LFR began environmental investigations at the Site on behalf of Catellus in September 1989. Site investigation and remediation continued for about five years. Results of Phase I and Phase II investigations indicated that VOCs were present in shallow groundwater beneath the Site. During site development, underground storage tanks (USTs) were excavated at several locations across the Site. Groundwater monitoring wells were installed in the vicinity of the former UST locations (Figure 2) to monitor groundwater quality, in accordance with agency guidelines.

## 2.1 Areas A and B

As illustrated on Figure 2, Area A and a portion of Area B have been developed for commercial use, including a large retail store, several smaller retail stores, and two large parking areas. Areas north of the parking lots and west of Emery Street have been developed into apartments.

A groundwater monitoring program was implemented at the Site in January 1992 to monitor VOC concentrations in groundwater in Area A. To reduce the potential for off-site migration of shallow VOC-affected groundwater, a groundwater extraction and treatment system was installed in Area A (Figure 2). This extraction system began operation in August 1994. Details regarding the operation of the extraction and treatment system are presented in an LFR semiannual self-monitoring report submitted to the East Bay Municipal Utilities District.

Approximately 25,000 cubic yards of petroleum hydrocarbon-affected soil was excavated from Area B and contained beneath building pads in Areas A and B in accordance with an LFR containment plan (LFR 1992a). The removal of soil from this area of the Site was described in LFR's soil remediation activities report for the Site (LFR 1992b). To assess groundwater quality in Areas A and B, five monitoring wells were installed and sampled on a quarterly basis for over a year. In response to a request from the Regional Water Quality Control Board (RWQCB), LFR prepared a soils management plan for the contained soils (LFR 1994b). The plan outlined periodic groundwater monitoring to evaluate the possible effects on groundwater from soils contained at the Site.

## 2.2 Area C

Area C (the area west of Hollis Street) has been developed for commercial use, including the construction of two retail stores and large parking areas. One smaller retail store has yet to be constructed in this portion of the development.

VOCs have been detected in groundwater samples collected in Area C of the Site. The distribution of VOCs detected indicates it is likely that the VOCs have migrated from an off-site source. The RWQCB concurs with this conclusion, according to the RWQCB's letter to Catellus and others dated May 11, 1994.

Several USTs were identified at various locations within Area C during environmental investigations and site grading. Groundwater monitoring wells were installed following the excavation of some of these USTs. These groundwater monitoring wells (LF-31 and LF-32, installed at the former Bashland and Bay Area Warehouse properties, respectively) were monitored on a quarterly basis until they were destroyed during site development in June 1994, along with the other wells located west of Hollis Street (except well LF-13).

Replacement wells for those wells (MW-31R and MW-32R) were installed in December 1995. In addition, well MW-12R was installed downgradient from (west of) USTs formerly located along Beach Street, to monitor groundwater quality in that area. Wells MW-10R and MW-34R were installed, in locations presented on Figure 2, to monitor possible on-site migration of VOCs from a known source located north of the property.

### **3.0 GROUNDWATER ELEVATIONS AND FLOW DIRECTION**

On September 14, 1998, depth to water was measured in all accessible on- and off-site wells to the nearest 0.01 foot using an electric water-level sounding probe. Table 1 summarizes the depth-to-water and groundwater elevation data collected. Depth to groundwater in shallow wells (less than 25 feet deep) ranged from 6.45 feet below ground surface (bgs) in well MW-10 to 18.45 feet bgs in well MW-9.

#### **3.1 Areas A and B**

Figure 2 is a groundwater elevation contour map illustrating water levels measured on September 14, 1998. As illustrated, the direction of shallow groundwater flow beneath Areas A and B of the Site is toward the west-southwest, in the direction of the groundwater extraction wells (EX-3 and EX-4) and the groundwater collection trench. The hydraulic gradient across this portion of the Site is 0.015 foot per foot (ft/ft), as measured between wells MW-2 and MW-9. The direction and gradient are consistent with the groundwater flow direction previously reported at the Site (LFR 1997).

The influence of pumping from the shallow extraction wells and collection trench on the groundwater flow pattern is illustrated in Figure 2 by depressions in the groundwater surface and deflections of contour lines in the vicinity of the extraction wells and collection trench.

#### **3.2 Area C**

As illustrated in Figure 2, the direction of shallow groundwater flow beneath Area C of the Site is toward the west. The hydraulic gradient across this portion of the Site is 0.008 ft/ft, as measured between wells MW-31R and MW-12R. The direction and gradient are consistent with the groundwater flow direction previously reported at the Site (LFR 1997).

### **4.0 GROUNDWATER SAMPLING AND ANALYSIS**

LFR personnel collected groundwater samples on September 14 through 16, 1998, for chemical analysis. A total of 17 samples were collected from 13 shallow groundwater monitoring wells (less than 25 feet bgs; MW-2, MW-3, MW-4, MW-5, MW-6, MW-7,

MW-8, MW-9, MW-10R, MW-12R, MW-34R, LF-22, and LF-23), two shallow extraction wells (less than 25 feet bgs; EX-3 and EX-4), and the collection trench. A total of four samples were collected from three intermediate-depth wells (30 to 45 feet bgs; MW-6D, MW-7D, and MW-9D) and one deeper well (50 to 65 feet bgs; MW-7Z).

Before groundwater samples were collected, three to four well volumes of water were purged from each well in accordance with field procedures for groundwater sampling described in Appendix A. During purging, indicator parameters such as pH, temperature, and specific conductance were recorded on water-quality sampling sheets. After collection, samples were submitted under strict chain-of-custody protocols to Entech Analytical Labs, Inc. ("Entech"), a California state-certified laboratory, located in Sunnyvale, California.

Samples were analyzed as follows:

- Samples from wells MW-3, MW-4, MW-5, MW-6, MW-6D, MW-7, MW-7D, MW-7Z, MW-8, MW-9, MW-9D, MW-10R, MW-12R, MW-34R, LF-22, LF-23, EX-3, and EX-4 and the groundwater collection trench were analyzed for VOCs using EPA Method 8010.
- Samples from wells MW-3, MW-4, MW-5, MW-6, MW-7, MW-12R, EX-3, EX-4, and the collection trench were analyzed for TPH as diesel (TPHd; carbon chain length C<sub>12</sub> to C<sub>22</sub>), and TPH as oil (TPHo; carbon chain length C<sub>22</sub> to C<sub>36</sub>) in accordance with the Soils Management Plan (LFR 1994b).
- The sample from well MW-2 was analyzed for TPHd. This sample was also analyzed for TPH as gasoline (TPHg) and benzene, toluene, ethylbenzene, and total xylenes (BTEX) to monitor whether TPHg-affected groundwater is migrating onto the Site. Results of chemical analyses are discussed in Section 5.0.

For QA/QC purposes, a duplicate sample was collected from well MW-7. The sample was analyzed for VOCs. Results of the duplicate sample collected at MW-7 were similar to the result from the primary sample. Summaries of the analytical and sampling QA/QC for samples collected during this semiannual monitoring period are presented in Tables 2A and 2B.

## 5.0 GROUNDWATER QUALITY

Table 3 summarizes the analytical results for groundwater samples collected.

### 5.1 Volatile Organic Compounds

In general, the concentration of VOCs detected in samples collected during this monitoring period are within the same order of magnitude as samples previously

collected at the Site (Table 3). No VOCs were detected at concentrations above method detection limits in groundwater samples collected from shallow wells LF-22, MW-3, MW-4, MW-8, and MW-12R, or from deeper wells MW-6D and MW-9D.

1,1-Dichloroethene (1,1-DCE) was detected in samples collected from five shallow wells at concentrations ranging from 0.001 parts per million (ppm) in well MW-34R to 0.210 ppm (well MW-6) and at concentrations of 0.150 ppm, 0.096 ppm, and 0.150 ppm in samples from shallow extraction wells EX-3 and EX-4, and the collection trench, respectively. 1,1-DCE was detected in a sample collected from one of the deeper wells, MW-7D, at a concentration of 0.016 ppm.

Trichloroethene (TCE) was detected in the samples collected from shallow monitoring wells MW-10R and MW34R at concentrations of 0.550 ppm and 0.0073 ppm, respectively.

TCE was not detected in the samples collected from remaining shallow or deeper wells sampled during the current monitoring event.

Tetrachloroethene (PCE) was detected in samples collected from shallow monitoring well MW-5 at a concentration of 0.0005 ppm and off-site well LF-23 at 0.0007 ppm. Concentrations of PCE were detected in the samples collected from shallow extraction well EX-3 (0.03 ppm), EX-4 (0.012 ppm) and the collection trench (0.015 ppm).

PCE was not detected in the samples collected from remaining shallow or deeper wells sampled during the current monitoring event.

1,1,1-Trichloroethane (1,1,1-TCA) was detected in samples collected from shallow monitoring wells MW-6, MW-7, and MW-9 at concentrations of 0.0099 ppm, 0.0097 ppm, and 0.0037 ppm, respectively. 1,1,1-TCA was also detected in samples collected from shallow extraction wells EX-3 (0.0037 ppm) and EX-4 (0.0025 ppm).

1,1,1-TCA was not detected in the samples collected from remaining shallow or deeper wells sampled during the current monitoring event.

## 5.2 Total Petroleum Hydrocarbons

TPHd was not detected in samples collected from shallow monitoring wells.

TPHg was detected at 0.95 ppm in the sample collected from well MW-2. The sample collected from well MW-2 contained benzene (0.0061 ppm), ethylbenzene (0.054 ppm), and total xylenes (0.051 ppm).

### 5.2.1 Former Bashland Company Property

Well LF-31 was replaced by well LF-31R in November 1995. The replacement well was installed within 20 feet of the original well's location. Samples are collected from this well to monitor groundwater quality in the vicinity of a UST formerly located at the former Bashland property. This well has not been sampled pending the response to a request for case closure that was submitted to the ACHCSA on June 3, 1997. The status of this site will not be discussed in subsequent monitoring reports until events warrant it.

### 5.2.2 Former Bay Area Warehouse Property

Well LF-32 was replaced by well LF-32R in November 1995. The location of LF-32R was selected based on survey information, and is less than 20 feet from the former location of LF-32. Samples are collected from this well to monitor groundwater quality in the vicinity of a UST formerly located at the former Bay Area Warehouse property. This well was not sampled this quarter pending the response to a request for case closure that was submitted to the ACHCSA on June 3, 1997. The status of this site will not be discussed in subsequent monitoring reports until events warrant it.

## 6.0 SUMMARY

Groundwater gradient and flow direction measured in September 1998 are generally consistent with the groundwater flow direction previously reported for the Site (LFR 1997).

Analytical results for groundwater samples collected in September 1998 are similar to results previously reported for the Site (Table 3). Results indicate that the plume of VOC-affected groundwater likely extends to the north between wells MW-3 and MW-6 and to the south between wells MW-7 and MW-8. The plume extends approximately 800 feet southwest (downgradient) from well MW-6 toward the extraction wells and collection trench, and is approximately 300 feet wide. Analytical results for samples collected from wells LF-22 and LF-23 indicate that the groundwater extraction and treatment system has been successful in reducing the migration of VOC-affected groundwater present at Area A of the Site.

Analysis of samples from well MW-2 continue to indicate that TPHg-affected groundwater is migrating onto the property from the east.

Samples collected during the last monitoring event from deeper zone well MW-7Z detected the presence of VOCs at low concentration (0.0092 ppm PCE). PCE has not been previously detected in a sample collected from this well. PCE was not detected above method detection limits (0.0005 ppm) in the sample collected from the well this monitoring period. This well will be monitored during the first half of 1999.

## 7.0 SCHEDULED ACTIVITIES PROPOSED

In accordance with the revised "Groundwater Monitoring Plan, East Baybridge Center, Emeryville and Oakland, California," submitted on April 15, 1998, to ACHCSA, groundwater monitoring consisting of water-level measurements and groundwater sampling will occur during the first half of 1999. The sampling schedule is summarized in Table 4. LFR anticipates submitting a report summarizing those activities by July 1999.

## 8.0 REFERENCES

- LFR. 1992a. Containment Plan for Total Petroleum Hydrocarbon-Affected Soils, Yerba Buena Project Site, Emeryville and Oakland, California. March 10.
- . 1992b. Soil Remediation Activities Report, Former Ransome Property, Yerba Buena Project Site, Emeryville, California. March 21.
- . 1994a. Groundwater Monitoring Plan, East Baybridge Center, Emeryville and Oakland, California. December 19.
- . 1994b. Soils Management Plan for Petroleum Hydrocarbon-Affected Soils, Yerba Buena/East Baybridge Center, Emeryville and Oakland, California. November 30.
- . 1996. Quarterly Monitoring Report for April 1 through June 30, 1996, East Baybridge Center, Emeryville and Oakland, California. July 31.
- . 1997. Quarterly Monitoring Report for October 1 through December 31, 1997, East Baybridge Center, Emeryville and Oakland, California. January 30.

**Table 1**  
**Well Construction and Groundwater Elevation Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**

Well Number	Well Elevation (1)	Well Depth (2)	Screened Interval (2)	Date Measured	Depth to Water	Groundwater Elevation (3)
<b>Shallow Wells</b>						
MW-1	27.47	30	15-30	12-Sep-94 30-Nov-94 16-Feb-95 08-May-95 30-Aug-95 19-Dec-95 26-Feb-96 29-Apr-96 03-Sep-96 13-Dec-96	14.88 14.61 14.73 14.55 14.62 13.38 14.27 14.69 14.70 (4)	12.59 12.86 12.74 12.92 12.85 14.09 13.20 12.78 12.77
MW-2	37.23	18	8-18	12-Sep-94 30-Nov-94 16-Feb-95 08-May-95 30-Aug-95 19-Dec-95 26-Feb-96 29-Apr-96 03-Sep-96 13-Dec-96 18-Feb-97 26-May-97 21-Aug-97 02-Jan-98 09-Mar-98 14-Sep-98	8.00 6.84 6.84 7.08 9.03 6.95 6.62 7.92 8.10 6.59 7.60 8.16 7.06 7.87 6.94 7.79	29.23 30.39 30.39 30.15 28.20 30.28 30.61 29.31 29.13 30.64 29.63 29.07 30.17 29.36 30.29 29.44
MW-3	32.05	25	14-25	12-Sep-94 30-Nov-94 16-Feb-95 08-May-95 30-Aug-95 19-Dec-95 26-Feb-96 29-Apr-96 03-Sep-96 13-Dec-96 18-Feb-97 26-May-97 21-Aug-97 02-Jan-98 09-Mar-98 14-Sep-98	9.88 9.96 9.24 9.82 11.75 9.65 8.80 10.66 10.51 9.85 9.93 10.66 9.80 10.75	22.17 22.09 22.81 22.23 20.30 22.40 23.25 21.39 21.54 22.20 22.12 21.39 22.25 21.30

**Table 1**  
**Well Construction and Groundwater Elevation Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**

Well Number	Well Elevation (1)	Well Depth (2)	Screened Interval (2)	Date Measured	Depth to Water	Groundwater Elevation (3)
				09-Mar-98	9.03	23.02
				14-Sep-98	9.82	22.23
MW-4	24.28	25	12-25	12-Sep-94	17.01	7.27
				30-Nov-94	16.15	8.13
				16-Feb-95	16.38	7.90
				08-May-95	16.27	8.01
				30-Aug-95	16.32	7.96
				19-Dec-95	14.52	9.76
				26-Feb-96	13.29	10.99
				29-Apr-96	15.08	9.20
				03-Sep-96	14.70	9.58
				13-Dec-96	13.52	10.76
				18-Feb-97	13.92	10.36
				26-May-97	14.51	9.77
				21-Aug-97	14.40	9.88
				02-Jan-98	14.07	10.21
				09-Mar-98	13.39	10.89
				14-Sep-98	14.30	9.98
MW-5	22.19	21.5	11.5-21.5	12-Sep-94	17.15	5.04
				30-Nov-94	15.94	6.25
				16-Feb-95	16.45	5.74
				08-May-95	16.08	6.11
				30-Aug-95	15.79	6.40
				19-Dec-95	13.81	8.38
				26-Feb-96	12.69	9.50
				29-Apr-96	14.49	7.70
				03-Sep-96	14.11	8.08
				13-Dec-96	12.67	9.52
				18-Feb-97	12.83	9.36
				26-May-97	13.90	8.29
				21-Aug-97	13.71	8.48
				02-Jan-98	13.54	8.65
				09-Mar-98	12.88	9.31
				14-Sep-98	13.88	8.31
MW-6	28.54	21.5	11.5-21.5	12-Sep-94	12.58	15.96
				30-Nov-94	12.75	15.79
				16-Feb-95	12.17	16.37
				08-May-95	12.75	15.79
				30-Aug-95	14.22	14.32
				19-Dec-95	13.17	15.37
				26-Feb-96	11.37	17.17
				29-Apr-96	12.95	15.59

**Table 1**  
**Well Construction and Groundwater Elevation Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**

Well Number	Well Elevation (1)	Well Depth (2)	Screened Interval (2)	Date Measured	Depth to Water	Groundwater Elevation (3)
				03-Sep-96	12.67	15.87
				13-Dec-96	11.83	16.71
				18-Feb-97	11.92	16.62
				26-May-97	12.40	16.14
				21-Aug-97	12.31	16.23
				02-Jan-98	12.18	16.36
				09-Mar-98	11.37	17.17
				14-Sep-98	12.24	16.30
MW-7	26.29	23.5	13.5-23.5	12-Sep-94	11.60	14.69
				30-Nov-94	11.53	14.76
				16-Feb-95	10.82	15.47
				08-May-95	11.84	14.45
				30-Aug-95	12.81	13.48
				19-Dec-95	11.77	14.52
				26-Feb-96	10.04	16.25
				29-Apr-96	11.55	14.74
				03-Sep-96	11.32	14.97
				13-Dec-96	10.96	15.33
				18-Feb-97	10.68	15.61
				26-May-97	11.08	15.21
				21-Aug-97	10.92	15.37
				02-Jan-98	10.78	15.51
				09-Mar-98	10.06	16.23
				14-Sep-98	10.95	15.34
MW-8	24.40	20.5	10.5-20.5	12-Sep-94	9.96	14.44
				30-Nov-94	9.96	14.44
				16-Feb-95	9.68	14.72
				08-May-95	10.06	14.34
				30-Aug-95	11.10	13.30
				19-Dec-95	10.22	14.18
				26-Feb-96	8.78	15.62
				29-Apr-96	10.05	14.35
				03-Sep-96	9.67	14.73
				13-Dec-96	9.20	15.20
				18-Feb-97	9.30	15.10
				26-May-97	9.50	14.90
				21-Aug-97	9.06	15.34
				02-Jan-98	9.38	15.02
				09-Mar-98	8.51	15.89
				14-Sep-98	9.38	15.02
MW-9	24.17	26	14-26	12-Sep-94	19.70	4.47
				30-Nov-94	17.65	6.52

**Table 1**  
**Well Construction and Groundwater Elevation Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**

Well Number	Well Elevation (1)	Well Depth (2)	Screened Interval (2)	Date Measured	Depth to Water	Groundwater Elevation (3)
				16-Feb-95	18.85	5.32
				08-May-95	19.47	4.70
				30-Aug-95	19.65	4.52
				19-Dec-95	18.43	5.74
				26-Feb-96	16.46	7.71
				29-Apr-96	18.91	5.26
				03-Sep-96	19.12	5.05
				13-Dec-96	16.22	7.95
				18-Feb-97	18.49	5.68
				26-May-97	18.60	5.57
				21-Aug-97	17.32	6.85
				02-Jan-98	15.33	8.84
				09-Mar-98	17.41	6.76
				14-Sep-98	18.45	5.72
<b>MW-10</b>	<b>13.21</b>			19-Dec-95	6.31	6.90
				26-Feb-96	6.09	7.12
				29-Apr-96	6.73	6.48
				03-Sep-96	6.50	6.71
				13-Dec-96	5.86	7.35
				18-Feb-97	6.72	6.49
				26-May-97	6.61	6.60
				21-Aug-97	6.82	6.39
				02-Jan-98	6.60	6.61
				09-Mar-98	5.95	7.26
				14-Sep-98	6.45	6.76
<b>MW-12</b>	<b>10.42</b>			19-Dec-95	10.69	-0.27
				26-Feb-96	9.66	0.76
				29-Apr-96	10.98	-0.56
				03-Sep-96	11.05	-0.63
				13-Dec-96	10.04	0.38
				18-Feb-97	10.42	0.00
				26-May-97	10.83	-0.41
				21-Aug-97	10.53	-0.11
				02-Jan-98	10.05	0.37
				09-Mar-98	10.10	0.32
				14-Sep-98	10.71	-0.29
<b>MW-31</b>	<b>19.14</b>			19-Dec-95	6.92	12.22
				26-Feb-96	6.99	12.15
				29-Apr-96	7.54	11.60
				03-Sep-96	7.55	11.59
				13-Dec-96	6.72	12.42
				18-Feb-97	7.45	11.69

**Table 1**  
**Well Construction and Groundwater Elevation Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**

Well Number	Well Elevation (1)	Well Depth (2)	Screened Interval (2)	Date Measured	Depth to Water	Groundwater Elevation (3)
				26-May-97	7.45	11.69
				21-Aug-97	7.06	12.08
				02-Jan-98	7.30	11.84
				09-Mar-98	7.04	12.10
				14-Sep-98	7.38	11.76
MW-32	15.52			19-Dec-95	8.92	6.60
				26-Feb-96	8.48	7.04
				29-Apr-96	9.46	6.06
				03-Sep-96	9.20	6.32
				13-Dec-96	8.35	7.17
				18-Feb-97	9.15	6.37
				26-May-97	9.10	6.42
				21-Aug-97	9.32	6.20
				02-Jan-98	8.98	6.54
				09-Mar-98	8.29	7.23
				14-Sep-98	8.95	6.57
MW-34	11.97			19-Dec-95	11.20	0.77
				26-Feb-96	12.12	-0.15
				29-Apr-96	12.47	-0.50
				03-Sep-96	12.21	-0.24
				13-Dec-96	11.36	0.61
				18-Feb-97	11.74	0.23
				26-May-97	11.74	0.23
				21-Aug-97	11.51	0.46
				02-Jan-98	12.18	-0.21
				09-Mar-98	11.46	0.51
				14-Sep-98	11.22	0.75
LF-13	9.19			19-Dec-95	2.86	6.33
				26-Feb-96	2.55	6.64
				29-Apr-96	6.13	3.06
				03-Sep-96	6.58	2.61
				13-Dec-96	1.67	7.52
				18-Feb-97	4.59	4.60
				21-Aug-97	NM	NM
				02-Jan-98	NM	NM
				09-Mar-98	NM	NM
				14-Sep-98	NM	NM
LF-22	17.99	20	10-20	12-Sep-94	11.96	6.03
				30-Nov-94	9.69	8.30
				16-Feb-95	10.45	7.54
				08-May-95	11.40	6.59

**Table 1**  
**Well Construction and Groundwater Elevation Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**

Well Number	Well Elevation (1)	Well Depth (2)	Screened Interval (2)	Date Measured	Depth to Water	Groundwater Elevation (3)
				30-Aug-95	13.03	4.96
				19-Dec-95	9.42	8.57
				26-Feb-96	8.84	9.15
				29-Apr-96	10.29	7.70
				03-Sep-96	11.20	6.79
				13-Dec-96	8.18	9.81
				18-Feb-97	9.56	8.43
				26-May-97	10.90	7.09
				21-Aug-97	10.75	7.24
				02-Jan-98	9.33	8.66
				09-Mar-98	9.23	8.76
				14-Sep-98	10.55	7.44
LF-23	17.99	20	10-20	12-Sep-94	12.24	5.75
				30-Nov-94	10.05	7.94
				16-Feb-95	11.10	6.89
				08-May-95	11.88	6.11
				30-Aug-95	13.38	4.61
				19-Dec-95	10.01	7.98
				26-Feb-96	8.97	9.02
				29-Apr-96	10.84	7.15
				03-Sep-96	11.35	6.64
				13-Dec-96	8.47	9.52
				18-Feb-97	9.28	8.71
				26-May-97	10.71	7.28
				21-Aug-97	10.75	7.24
				02-Jan-98	9.57	8.42
				09-Mar-98	9.21	8.78
				14-Sep-98	10.97	7.02

Extraction Wells						
EX-1 (LF-1)	23.51	NA	NA	12-Sep-94	24.83	-1.32
				30-Nov-94	19.16	4.35
				08-May-95	23.45	0.06
				30-Aug-95	23.45	0.06
				19-Dec-95	23.50	0.01
				26-Feb-96	18.38	5.13
				29-Apr-96	NM	NM
				03-Sep-96	22.15	1.36
				13-Dec-96	13.38	10.13
				09-Jan-97	10.65	12.86
				18-Feb-97	20.55	2.96
				26-May-97	19.40	4.11
				21-Aug-97	20.70	2.81
				02-Jan-98	9.70	13.81

**Table 1**  
**Well Construction and Groundwater Elevation Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**

Well Number	Well Elevation (1)	Well Depth (2)	Screened Interval (2)	Date Measured	Depth to Water	Groundwater Elevation (3)
				09-Mar-98	20.60	2.91
				14-Sep-98	NM	NM
EX-2 (LF-2)	20.03	NA	NA	12-Sep-94	20.11	-0.08
				30-Nov-94	15.68	4.35
				08-May-95	20.70	-0.67
				30-Aug-95	20.68	-0.65
				19-Dec-95	20.40	-0.37
				26-Feb-96	14.91	5.12
				29-Apr-96	20.47	-0.44
				03-Sep-96	18.80	1.23
				13-Dec-96	NM	NM
				09-Jan-97	10.69	9.34
				18-Feb-97	NM	NM
				26-May-97	23.50	-3.47
				21-Aug-97	23.46	-3.43
				02-Jan-98	NM	NM
				09-Mar-98	NM	NM
				14-Sep-98	22.05	-2.02
EX-3	20.96	24	7.5-24	12-Sep-94	22.33	-1.37
				30-Nov-94	15.50	5.46
				16-Feb-95	17.80	3.16
				08-May-95	19.80	1.16
				30-Aug-95	19.86	1.10
				19-Dec-95	17.00	3.96
				26-Feb-96	15.10	5.86
				29-Apr-96	16.21	4.75
				03-Sep-96	16.65	4.31
				13-Dec-96	12.95	8.01
				18-Feb-97	12.40	8.56
				26-May-97	13.11	7.85
				21-Aug-97	13.15	7.81
				02-Jan-98	10.86	10.10
				09-Mar-98	12.03	8.93
				14-Sep-98	15.36	5.60
EX-4	24.40	25	8-25	12-Sep-94	22.61	1.79
				30-Nov-94	20.70	3.70
				16-Feb-95	20.55	3.85
				08-May-95	20.85	3.55
				30-Aug-95	20.88	3.52
				19-Dec-95	19.41	4.99
				26-Feb-96	20.40	4.00
				29-Apr-96	19.75	4.65

**Table 1**  
**Well Construction and Groundwater Elevation Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**

Well Number	Well Elevation (1)	Well Depth (2)	Screened Interval (2)	Date Measured	Depth to Water	Groundwater Elevation (3)
				03-Sep-96	20.65	3.75
				13-Dec-96	18.59	5.81
				18-Feb-97	21.00	3.40
				26-May-97	21.00	3.40
				21-Aug-97	18.67	5.73
				02-Jan-98	13.09	11.31
				09-Mar-98	20.90	3.50
				14-Sep-98	20.28	4.12
Deeper Wells						
MW-6D	28.48	45	32-40	12-Sep-94	11.09	17.39
				30-Nov-94	11.46	17.02
				16-Feb-95	10.67	17.81
				08-May-95	11.58	16.90
				30-Aug-95	12.93	15.55
				19-Dec-95	13.14	15.34
				26-Feb-96	10.14	18.34
				29-Apr-96	11.57	16.91
				03-Sep-96	11.48	17.00
				13-Dec-96	12.29	16.19
				18-Feb-97	10.75	17.73
				26-May-97	16.50	11.98
				21-Aug-97	10.86	17.62
				02-Jan-98	11.21	17.27
				09-Mar-98	9.97	18.51
				14-Sep-98	11.85	16.63
MW-7D	26.27	40	27-40	12-Sep-94	11.32	14.95
				30-Nov-94	11.30	14.97
				16-Feb-95	11.01	15.26
				08-May-95	11.35	14.92
				30-Aug-95	12.65	13.62
				19-Dec-95	11.61	14.66
				26-Feb-96	9.84	16.43
				29-Apr-96	11.38	14.89
				03-Sep-96	11.18	15.09
				13-Dec-96	10.72	15.55
				18-Feb-97	10.45	15.82
				26-May-97	10.90	15.37
				21-Aug-97	10.75	15.52
				02-Jan-98	10.60	15.67
				09-Mar-98	9.87	16.40
				14-Sep-98	10.77	15.50
MW-9D	24.17	45	32-45	12-Sep-94	18.38	5.79

**Table 1**  
**Well Construction and Groundwater Elevation Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**

Well Number	Well Elevation (1)	Well Depth (2)	Screened Interval (2)	Date Measured	Depth to Water	Groundwater Elevation (3)
				30-Nov-94	16.35	7.82
				16-Feb-95	16.43	7.74
				08-May-95	16.96	7.21
				30-Aug-95	18.28	5.89
				19-Dec-95	16.50	7.67
				26-Feb-96	14.68	9.49
				29-Apr-96	16.85	7.32
				03-Sep-96	17.61	6.56
				13-Dec-96	15.23	8.94
				18-Feb-97	15.97	8.20
				26-May-97	17.14	7.03
				21-Aug-97	17.22	6.95
				02-Jan-98	16.10	8.07
				09-Mar-98	15.11	9.06
				14-Sep-98	17.29	6.88
<b>Deep Well</b>						
MW-7Z	25.96	65	50-65	12-Sep-94	11.78	14.18
				30-Nov-94	10.76	15.20
				16-Feb-95	9.16	16.80
				08-May-95	9.85	16.11
				30-Aug-95	11.85	14.11
				19-Dec-95	10.89	15.07
				26-Feb-96	8.62	17.34
				29-Apr-96	9.91	16.05
				03-Sep-96	11.01	14.95
				13-Dec-96	10.31	15.65
				18-Feb-97	9.25	16.71
				26-May-97	13.00	12.96
				21-Aug-97	11.10	14.86
				02-Jan-98	NM	NM
				09-Mar-98	7.93	18.03
				14-Sep-98	10.72	15.24

Data updated by TGL 09/25/98 Proofed by TGL.

#### Notes

- (1) Well elevation is in feet mean sea level as surveyed by Nolte and Associates in August 1994.
- (2) Well depth and screened interval are in feet below ground surface as measured at the time of well installation.
- (3) Water level elevation is in feet mean sea level.
- (4) Monitoring Well MW-1 was abandoned in December 1996.
- NA Not applicable, well associated with extraction trench.
- NM Water level not measured.

**Table 2A:Summary of Sampling QA/QC**  
**East Baybridge Center, Emeryville and Oakland, California**

East Baybridge	East Baybridge Center Emeryville and Oakland CA	June 1 through December 31,1998
<p>Sampling Performed By: J. Rodgers          Firm Name: LFR Levine - Fricke          Firm Address: 1900 Powell Street, Emeryville, California          Firm Contact: Ron Goloubow          Firm Telephone Number: (510) 652-4500</p> <p>Were chain-of-custody forms completed for all samples? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No</p> <p>Were field parameters stabilized prior to taking samples? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No</p> <p>For VOCs samples, was there zero head space in sample containers? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No</p> <p>Were samples preserved according to analytical method? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No</p> <p>Were the required field QA/QC samples taken? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No</p> <p>For any questions above answered with "No", please provide an explanation:</p>		

Table 2B:Summary of Analytical QA/QC

## East Baybridge Center, Emeryville and Oakland, California

East Baybridge	East Baybridge Center Emeryville and Oakland CA	June 1 through December 31, 1998
<b>Analysis Performed By:</b> Lab Name: Entech Analytical Labs, Inc. Lab Address: 525 Del Rey Avenue Suite E Sunnyvale, CA 94806 Lab Contact: Alan Aks Lab Telephone Number: 408-735-1550		
<b>Analytical Method Used: (check applicable methods)</b> <input type="checkbox"/> Total Dissolved Solids by EPA Method _____ <input type="checkbox"/> Bioassay 96-hr % survival by Standard Method _____ <input type="checkbox"/> Turbidity (NTU) by EPA Method _____ <input type="checkbox"/> Dissolved Oxygen (mg/l and % saturation) by Standard Method _____ <input type="checkbox"/> Hardness (mg/l CaCO <sub>3</sub> ) by EPA Method _____ <input type="checkbox"/> Arsenic by EPA Method _____ <input type="checkbox"/> Cadmium by EPA Method _____ <input type="checkbox"/> Chromium (total) by EPA Method _____ <input type="checkbox"/> Chromium (hexavalent) _____ <input type="checkbox"/> Copper by EPA Method _____ <input type="checkbox"/> Lead by EPA Method _____ <input type="checkbox"/> Mercury by EPA Method _____ <input type="checkbox"/> Nickel by EPA Method _____ <input type="checkbox"/> Selenium by EPA Method _____ <input type="checkbox"/> Silver by EPA Method _____ <input type="checkbox"/> Zinc by EPA Method _____ <input checked="" type="checkbox"/> Halogenated Volatile Organics by EPA Method 601 or 8010 <input type="checkbox"/> Aromatic and Unsaturated Volatile Organics by EPA 602 or 8020 <input type="checkbox"/> Volatile Organics by EPA Method 624 or 8240 <input type="checkbox"/> Semivolatile Organics by EPA Method 625 or 8270 <input type="checkbox"/> EDB and DBCP by EPA Method 504 <input checked="" type="checkbox"/> TPH gasoline by EPA Method 8015 modified <input checked="" type="checkbox"/> TPH diesel by EPA Method 8015 modified		
Is the lab state-certified for the above analytical method(s)?		<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No
Were analyses performed according to standard methods?		<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No
Were sample holding times met?		<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No
Were all reported analytical results values above MDLs?		<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No
Were QA/QC samples (i.e., blanks, field replicates, spikes, and surrogates) analyzed in accordance and consistent with the analytical method?		<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No
Did QA/QC results meet all acceptance criteria?		<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No
Are QA/QC results and acceptance criteria on file?		<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No
For any questions above answered with "No", please provide an explanation: *		
<i>RELATIVE PERCENT DIFFERENCE FOR DUPLICATE SAMPLE COLLECTED AT MW-7D EXCEEDED SD % FOR 1, 1 DCE. THIS RESULT SHOULD BE CONSIDERED ESTIMATED.</i>		

\* The explanation should describe any modifications to standard methods and whether approved by Board staff, and describe corrective actions taken in response to any QA/QC results that fall outside acceptance criteria.

**Table 3**  
**Semiannual Summary of Groundwater Quality Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**  
*(concentrations expressed in parts per million [ppm])*

Well ID	Notes	Date Sampled	Lab	TPHg	TPHd	Benzene	Toluene	Ethyl-benzene	Total Xylenes	TCE	1,1,1-TCA	PCE	1,1-DCE	1,1-DCA	1,2-DCA	cis/trans-1,2-DCE	Total VOCs
<b>Shallow Wells (20 to 25 feet below grade)</b>																	
MW-1		13-Sep-94	AEN	<0.005	0.30	<0.0005	<0.0005	<0.0005	<0.0005	NA	NA	NA	NA	NA	NA	NA	NA
		30-Nov-94	AEN	NA	0.10	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		17-Feb-95	AEN	<0.05	0.08	<0.0005	<0.0005	<0.0005	<0.0005	<0.002	NA	NA	NA	NA	NA	NA	NA
		09-May-95	AEN	<0.05	0.20	<0.0005	<0.0005	<0.0005	<0.0005	<0.002	NA	NA	NA	NA	NA	NA	NA
		31-Aug-95	AEN	<0.05	0.30	<0.0005	<0.0005	<0.0005	<0.0005	<0.002	NA	NA	NA	NA	NA	NA	NA
		27-Dec-95	AEN	<0.05	0.10	<0.0005	<0.0005	<0.0005	<0.0005	<0.002	NA	NA	NA	NA	NA	NA	NA
		27-Feb-96	AEN	<0.05	0.18	<0.0005	<0.0005	<0.0005	<0.0005	<0.002	NA	NA	NA	NA	NA	NA	NA
		01-May-96	AEN	<0.05	0.10	<0.0005	<0.0005	<0.0005	<0.0005	<0.002	NA	NA	NA	NA	NA	NA	NA
		04-Sep-96	AEN	<0.05	0.25	<0.0005	<0.0005	<0.0005	<0.002	NA	NA	NA	NA	NA	NA	NA	NA
MW-2		01-Dec-94	AEN	7.10	NA	0.065	<0.01	0.13	0.47	NA	NA	NA	NA	NA	NA	NA	NA
		17-Feb-95	AEN	3.50	0.30	0.045	0.005	0.11	0.35	NA	NA	NA	NA	NA	NA	NA	NA
		09-May-95	AEN	3.50	0.20	0.025	0.009	0.085	0.25	NA	NA	NA	NA	NA	NA	NA	NA
		31-Aug-95	AEN	0.90	0.20	0.011	<0.0005	0.032	0.072	NA	NA	NA	NA	NA	NA	NA	NA
		20-Dec-95	AEN	2.60	<0.05	0.016	0.002	0.079	0.24	NA	NA	NA	NA	NA	NA	NA	NA
		27-Feb-96	AEN	4.10	0.20	0.076	0.0095	0.21	0.62	NA	NA	NA	NA	NA	NA	NA	NA
		01-May-96	AEN	2.40	0.23	0.039	0.0047	0.098	0.26	NA	NA	NA	NA	NA	NA	NA	NA
		04-Sep-96	AEN	0.54	0.22	0.0024	<0.0005	0.018	0.045	NA	NA	NA	NA	NA	NA	NA	NA
		17-Dec-96	A2AC	0.776	<0.010	0.004	0.009	0.011	0.019	NA	NA	NA	NA	NA	NA	NA	NA
		18-Feb-97	AEN	1.2	0.24	0.015	0.0009	0.057	0.140	NA	NA	NA	NA	NA	NA	NA	NA
		15-May-97	AEN	0.46	0.11	0.0033	<0.0005	0.035	0.059	NA	NA	NA	NA	NA	NA	NA	NA
(44)		11-Dec-97	AEN	1.7	0.15	0.016	0.0010	0.061	0.106	NA	NA	NA	NA	NA	NA	NA	NA
		10-Mar-98	AEN	0.81	0.14	0.011	0.0006	0.045	0.086	NA	NA	NA	NA	NA	NA	NA	NA
		15-Sep-98	ENT	0.95	<0.05	0.0061	<0.0005	0.054	0.051	NA	NA	NA	NA	NA	NA	NA	NA
MW-3		12-Sep-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		01-Dec-94	AEN	NA	0.07	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		16-Feb-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		08-May-95	AEN	NA	0.07	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		31-Aug-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		20-Dec-95	AEN	NA	<0.05	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		27-Feb-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		30-Apr-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		04-Sep-96	AEN	NA	0.11	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		17-Dec-96	A2AC	NA	<0.010	NA	NA	NA	NA	<0.001	<0.001	<0.001	<0.001	<0.001	<0.001	<0.001	ND
		18-Feb-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
dup		18-Feb-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		15-May-97	AEN	NA	0.08	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND

**Table 3**  
**Semiannual Summary of Groundwater Quality Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**  
*(concentrations expressed in parts per million [ppm])*

Well ID	Notes	Date Sampled	Lab	TPHg	TPHd	Benzene	Toluene	Ethyl-benzene	Total Xylenes	TCE	1,1,1-TCA	PCE	1,1-DCE	1,1-DCA	1,2-DCA	cis/trans-1,2-DCE	Total VOCs
MW-4		21-Aug-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		11-Dec-97	AEN	NA	<0.05	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		10-Mar-98	AEN	NA	<0.05	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		15-Sep-98	ENT	NA	<0.05	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		01-Dec-94	AEN	NA	0.09	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	
		08-May-95	AEN	NA	0.10	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	0.004	<0.0005	<0.0005	0.004
		20-Dec-95	AEN	NA	0.09	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	0.001	<0.0005	<0.0005	0.001
		30-Apr-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	0.0022	<0.0005	<0.0005	0.0022
		04-Sep-96	AEN	NA	0.14	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	
	(27)	17-Dec-96	A2AC	NA	<0.010	NA	NA	NA	NA	<0.001	<0.001	<0.001	0.002	0.001	<0.001	0.001	0.004
MW-5		15-May-97	AEN	NA	0.45	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	0.0013	<0.0005	<0.0005	0.0013
		11-Dec-97	AEN	NA	0.08	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	0.0008	<0.0005	<0.0005	0.0008
		10-Mar-98	AEN	NA	0.08	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		15-Sep-98	ENT	NA	<0.05	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		13-Sep-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.001	0.0007	0.003	0.002	<0.0005	<0.0005	0.0067
		01-Dec-94	AEN	NA	0.05	NA	NA	NA	NA	<0.0005	0.0007	0.0005	0.004	0.003	<0.0005	<0.0005	0.0082
		16-Feb-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.001	0.002	0.008	0.003	<0.0005	<0.0005	0.014
		08-May-95	AEN	NA	0.09	NA	NA	NA	NA	0.0005	0.002	0.002	0.016	0.005	<0.0005	<0.0005	0.0255
		31-Aug-95	AEN	NA	NA	NA	NA	NA	NA	0.0007	0.002	0.002	0.013	0.004	<0.0005	<0.0005	0.0217
		20-Dec-95	AEN	NA	0.1	NA	NA	NA	NA	<0.0005	0.001	0.0008	0.009	0.002	<0.0005	<0.0005	0.0128
duplicate		27-Feb-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.0008	0.0024	0.010	0.0029	<0.0005	<0.0005	0.0161
		30-Apr-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	0.001	0.0051	0.0021	<0.0005	<0.0005	0.0082
		04-Sep-96	AEN	NA	0.24	NA	NA	NA	NA	<0.0005	<0.0005	0.0010	0.0051	0.0022	<0.0005	<0.0005	0.0083
		17-Dec-96	A2AC	NA	NA	NA	NA	NA	NA	<0.001	<0.001	0.002	0.005	0.002	<0.001	<0.001	0.009
		18-Feb-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	0.0009	0.0079	0.002	<0.0005	<0.0005	0.0108
		15-May-97	AEN	NA	0.07	NA	NA	NA	NA	0.0006	0.0005	0.0021	0.019	0.0039	<0.0005	<0.0005	0.0261
		21-Aug-97	AEN	NA	NA	NA	NA	NA	NA	0.0006	<0.0005	0.0026	0.019	0.0041	<0.0005	<0.0005	0.0263
		21-Aug-97	AEN	NA	NA	NA	NA	NA	NA	0.0005	<0.0005	0.0024	0.015	0.0038	<0.0005	<0.0005	0.0217
MW-6	(2)	13-Sep-94	AEN	NA	NA	NA	NA	NA	NA	0.0005	<0.0005	0.0024	0.015	0.0038	<0.0005	<0.0005	0.0217
	(6)	01-Dec-94	AEN	NA	0.08	NA	NA	NA	NA	0.0006	0.041	<0.0005	0.280	0.005	0.001	0.001	0.3285
		16-Feb-95	AEN	NA	NA	NA	NA	NA	NA	<0.003	0.039	<0.003	0.280	0.003	<0.0005	<0.0005	0.3456
		16-Feb-95	AEN	NA	NA	NA	NA	NA	NA	<0.003	0.045	<0.003	0.290	0.004	<0.003	<0.003	0.322
duplicate		09-May-95	AEN	NA	0.20	NA	NA	NA	NA	<0.003	0.031	<0.003	0.260	0.003	<0.003	<0.003	0.339
																0.294	

**Table 3**  
**Semiannual Summary of Groundwater Quality Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**  
*(concentrations expressed in parts per million [ppm])*

Well ID	Notes	Date Sampled	Lab	TPHg	TPHd	Benzene	Toluene	Ethyl-benzene	Total Xylenes	TCE	1,1,1-TCA	PCE	1,1-DCE	1,1-DCA	1,2-DCA	cis/trans-1,2-DCE	Total VOCs
		31-Aug-95	AEN	NA	NA	NA	NA	NA	NA	<0.003	0.032	<0.003	0.270	0.004	<0.003	<0.003	0.306
		28-Dec-95	AEN	NA	0.1	NA	NA	NA	NA	<0.003	0.040	<0.003	0.280	0.004	<0.003	<0.003	0.324
		27-Feb-96	AEN	NA	NA	NA	NA	NA	NA	<0.005	0.031	<0.005	0.270	<0.005	<0.005	<0.005	0.301
		01-May-96	AEN	NA	NA	NA	NA	NA	NA	<0.003	0.026	<0.003	<0.200	0.003	<0.003	<0.003	0.029
		04-Sep-96	AEN	NA	0.17	NA	NA	NA	NA	<0.003	0.033	<0.003	0.330	0.005	<0.003	<0.003	0.368
		17-Dec-96	A2AC	NA	<0.010	NA	NA	NA	NA	0.010	0.060	<0.001	0.310	<0.001	<0.001	<0.001	0.38
		18-Feb-97	AEN	NA	NA	NA	NA	NA	NA	<0.003	0.029	<0.003	0.260	0.003	<0.003	<0.003	0.292
		15-May-97	AEN	NA	0.07	NA	NA	NA	NA	<0.003	0.018	<0.003	0.200	0.004	<0.003	<0.003	0.222
		21-Aug-97	AEN	NA	NA	NA	NA	NA	NA	<0.003	0.019	<0.003	0.230	0.003	<0.003	<0.003	0.252
		11-Dec-97	AEN	NA	0.07	NA	NA	NA	NA	<0.003	0.020	<0.003	0.210	0.004	<0.003	<0.003	0.234
		09-Mar-98	AEN	NA	0.08	NA	NA	NA	NA	<0.003	0.015	<0.003	0.180	0.003	<0.003	<0.003	0.198
		14-Sep-98	ENT	NA	<0.05	NA	NA	NA	NA	<0.003	0.0099	<0.003	0.210	0.0048	<0.003	<0.003	0.2247
MW-7		12-Sep-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.017	<0.0005	0.160	0.003	0.0009	<0.0005	0.1809
		30-Nov-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.016	<0.0005	0.170	0.003	<0.0005	<0.0005	0.189
		16-Feb-95	AEN	NA	NA	NA	NA	NA	NA	<0.003	0.011	<0.003	0.120	<0.003	<0.003	<0.003	0.131
		09-May-95	AEN	NA	0.09	NA	NA	NA	NA	<0.0005	0.015	<0.0005	0.180	0.004	<0.0005	<0.0005	0.199
		30-Aug-95	AEN	NA	NA	NA	NA	NA	NA	<0.003	0.012	<0.003	0.140	0.003	<0.003	<0.003	0.155
		20-Dec-95	AEN	NA	<0.05	NA	NA	NA	NA	<0.003	0.011	<0.003	0.170	<0.003	<0.003	<0.003	0.181
		27-Feb-96	AEN	NA	NA	NA	NA	NA	NA	<0.003	0.018	<0.003	0.210	0.0035	<0.003	<0.003	0.2315
duplicate		27-Feb-96	AEN	NA	NA	NA	NA	NA	NA	<0.003	0.017	<0.003	0.210	0.003	<0.003	<0.003	0.23
		30-Apr-96	AEN	NA	NA	NA	NA	NA	NA	<0.003	0.016	<0.003	0.220	0.003	<0.003	<0.003	0.239
		03-Sep-96	AEN	NA	0.11	NA	NA	NA	NA	<0.003	0.021	<0.003	0.290	0.004	<0.003	<0.003	0.315
		17-Dec-96	A2AC	NA	<0.010	NA	NA	NA	NA	<0.001	0.050	<0.001	0.280	<0.001	<0.001	<0.001	0.33
		19-Feb-97	AEN	NA	NA	NA	NA	NA	NA	<0.003	0.007	<0.003	0.150	<0.003	<0.003	<0.003	0.157
		15-May-97	AEN	NA	<0.05	NA	NA	NA	NA	<0.003	0.014	<0.003	0.230	0.005	<0.003	<0.003	0.249
		21-Aug-97	AEN	NA	NA	NA	NA	NA	NA	<0.003	0.013	<0.003	0.250	0.005	<0.003	<0.003	0.268
		11-Dec-97	AEN	NA	0.06	NA	NA	NA	NA	<0.003	0.014	<0.003	0.220	0.006	<0.003	<0.003	0.24
		09-Mar-98	AEN	NA	0.05	NA	NA	NA	NA	<0.003	0.010	<0.003	0.170	0.005	<0.003	<0.003	0.185
duplicate		15-Sep-98	ENT	NA	<0.05	NA	NA	NA	NA	<0.0005	0.0097	<0.0005	0.270	0.008	<0.0005	<0.0005	0.2876
		15-Sep-98	ENT	NA	<0.05	NA	NA	NA	NA	<0.0005	0.0064	<0.0005	0.190	0.0089	<0.0005	<0.0005	0.2053
MW-8	(3)	13-Sep-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	0.0005	<0.0005	<0.0005	0.0005
		02-Dec-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		16-Feb-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		09-May-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		31-Aug-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		20-Dec-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		27-Feb-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND

**Table 3**  
**Semiannual Summary of Groundwater Quality Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**  
*(concentrations expressed in parts per million [ppm])*

Well ID	Notes	Date Sampled	Lab	TPHg	TPHd	Benzene	Toluene	Ethyl-benzene	Total Xylenes	TCE	1,1,1-TCA	PCE	1,1-DCE	1,1-DCA	1,2-DCA	cis/trans-1,2-DCE	Total VOCs
duplicate		29-Apr-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		04-Sep-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		17-Dec-96	A2AC	NA	NA	NA	NA	NA	NA	<0.001	<0.001	<0.001	<0.001	<0.001	<0.001	<0.001	ND
		19-Feb-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		15-May-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		15-May-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		21-Aug-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		11-Dec-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		10-Mar-98	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		15-Sep-98	ENT	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
MW-9		12-Sep-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.017	<0.0005	0.120	0.0005	0.006	<0.0005	0.1435
duplicate		12-Sep-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.015	<0.0005	0.120	0.0005	0.009	<0.0005	0.1445
duplicate		30-Nov-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.016	<0.0005	0.150	0.0005	<0.0005	<0.0005	0.1665
		30-Nov-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.016	<0.0005	0.160	0.0005	<0.0005	<0.0005	0.1765
		16-Feb-95	AEN	NA	NA	NA	NA	NA	NA	<0.003	0.014	<0.003	0.120	<0.003	<0.003	<0.003	0.134
		08-May-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.013	<0.0005	0.110	0.005	<0.0005	<0.0005	0.128
		31-Aug-95	AEN	NA	NA	NA	NA	NA	NA	<0.003	0.013	<0.003	0.130	0.004	<0.003	<0.003	0.147
		20-Dec-95	AEN	NA	NA	NA	NA	NA	NA	<0.003	0.009	<0.003	0.092	<0.003	<0.003	<0.003	0.101
		27-Feb-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.0099	<0.0005	0.087	0.0035	<0.0005	<0.0005	0.1004
		03-Sep-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.0083	<0.0005	0.099	0.0030	<0.0005	<0.0005	0.1103
		03-Sep-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.0078	<0.0005	0.097	0.0026	<0.0005	<0.0005	0.1074
	dup	17-Dec-96	A2AC	NA	NA	NA	NA	NA	NA	<0.001	0.005	<0.001	0.059	0.002	<0.001	<0.001	0.066
duplicate		17-Dec-96	A2AC	NA	NA	NA	NA	NA	NA	<0.001	0.006	<0.001	0.064	0.002	<0.001	<0.001	0.072
		19-Feb-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.008	<0.0005	0.087	0.0023	<0.0005	<0.0005	0.0973
		15-May-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.0056	<0.0005	0.063	0.0025	<0.0005	<0.0005	0.0711
		22-Aug-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.0080	<0.0005	0.067	0.0022	<0.0005	<0.0005	0.0772
		11-Dec-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.0050	<0.0005	0.058	0.0022	<0.0005	<0.0005	0.0652
		10-Mar-98	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.0060	<0.0005	0.084	0.0018	<0.0005	<0.0005	0.0918
		14-Sep-98	ENT	NA	NA	NA	NA	NA	NA	<0.0005	0.0037	<0.0005	0.078	0.0030	<0.0005	<0.0005	0.0847
		20-Dec-95	AEN	NA	NA	NA	NA	NA	NA	0.910	<0.005	0.007	<0.005	<0.005	<0.005	0.222	1.139
	(19)	29-Apr-96	AEN	NA	NA	NA	NA	NA	NA	0.650	<0.005	<0.005	<0.005	<0.005	<0.005	<0.005	0.65
	(28)	17-Dec-96	A2AC	NA	NA	NA	NA	NA	NA	0.610	<0.001	<0.001	<0.001	<0.001	<0.001	0.160	0.77
(47)		15-May-97	AEN	NA	NA	NA	NA	NA	NA	0.500	<0.005	<0.005	<0.005	<0.005	<0.005	0.156	0.656
		12-Dec-97	AEN	NA	NA	NA	NA	NA	NA	0.420	<0.005	<0.005	<0.005	<0.005	<0.005	0.125	0.545
		10-Mar-98	AEN	NA	NA	NA	NA	NA	NA	0.500	<0.005	<0.005	<0.005	<0.005	<0.005	0.140	0.64
		15-Sep-98	ENT	NA	NA	NA	NA	NA	NA	0.550	<0.005	<0.005	<0.005	<0.005	<0.005	0.032	0.582

**Table 3**  
**Semiannual Summary of Groundwater Quality Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**  
*(concentrations expressed in parts per million [ppm])*

Well ID	Notes	Date Sampled	Lab	TPHg	TPHd	Benzene	Toluene	Ethyl-benzene	Total Xylenes	TCE	1,1,1-TCA	PCE	1,1-DCE	1,1-DCA	1,2-DCA	cis/trans-1,2-DCE	Total VOCs	
MW-12R		27-Dec-95	AEN	NA	0.2	NA	NA	NA	NA	0.003	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	0.002	0.005	
		27-Feb-96	AEN	<0.05	0.36	<0.0005	<0.0005	<0.0005	<0.002	NA	NA	NA	NA	NA	NA	NA	NA	
	(20)	30-Apr-96	AEN	<0.05	0.23	<0.0005	<0.0005	<0.0005	<0.002	0.0025	<0.0005	<0.0005	<0.0005	0.0024	<0.0005	<0.0005	0.0049	
		17-Dec-96	A2AC	NA	<0.010	NA	NA	NA	NA	0.001	<0.001	<0.001	<0.001	0.005	<0.001	0.004	0.01	
		15-May-97	AEN	NA	0.29	NA	NA	NA	NA	0.0009	<0.0005	<0.0005	<0.0005	0.0059	<0.0005	0.0007	0.0075	
		12-Dec-97	AEN	NA	0.44	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	0.0014	<0.0005	<0.0005	0.0014	
		10-Mar-98	AEN	NA	0.49	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND	
		16-Sep-98	ENT	NA	<0.05	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND	
MW-31R		27-Dec-95	AEN	NA	0.3	NA	NA	NA	NA	0.018	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	0.009	0.027	
		27-Feb-96	AEN	<0.05	0.37	<0.0005	<0.0005	<0.0005	<0.002	NA	NA	NA	NA	NA	NA	NA	NA	
	(21)	30-Apr-96	AEN	NA	0.19	NA	NA	NA	NA	0.015	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	0.015	
		05-Sep-96	AEN	NA	0.54	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	
		17-Dec-96	A2AC	NA	<0.010	NA	NA	NA	NA	0.008	<0.001	<0.001	<0.001	<0.001	<0.001	0.004	0.012	
		19-Feb-97	AEN	NA	0.49	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	
MW-32R	(15)	22-Dec-95	AEN	NA	0.2	NA	NA	NA	NA	0.058	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	0.055	0.113	
		27-Feb-96	AEN	<0.05	0.26	<0.0005	<0.0005	<0.0005	<0.002	NA	NA	NA	NA	NA	NA	NA	NA	
	(22)	01-May-96	AEN	NA	0.17	NA	NA	NA	NA	0.074	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	0.074	
		05-Sep-96	AEN	NA	0.34	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	
	(31)	17-Dec-96	A2AC	NA	<0.010	NA	NA	NA	NA	0.110	<0.001	<0.001	<0.001	<0.001	<0.001	0.100	0.21	
		19-Feb-97	AEN	NA	0.35	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	
MW-34R		27-Dec-95	AEN	NA	0.3	NA	NA	NA	NA	0.009	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	0.009	
		29-Apr-96	AEN	NA	NA	NA	NA	NA	NA	0.035	0.0011	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	0.0361	
		17-Dec-96	AEN	NA	NA	NA	NA	NA	NA	0.018	<0.001	<0.001	0.002	<0.001	<0.001	0.005	0.025	
	(40)	15-May-97	AEN	NA	NA	NA	NA	NA	NA	0.0028	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	0.0008	0.0036
	(46)	12-Dec-97	AEN	NA	NA	NA	NA	NA	NA	0.0012	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	0.0012
	(49)	10-Mar-98	AEN	NA	NA	NA	NA	NA	NA	0.020	<0.0005	<0.0005	0.0021	<0.0005	<0.0005	0.0015	0.249	
		16-Sep-98	ENT	NA	NA	NA	NA	NA	NA	0.0073	<0.0005	<0.0005	0.0010	<0.0005	<0.0005	0.0022	0.0022	
LF-13		09-May-95	AEN	NA	NA	NA	NA	NA	NA	0.006	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	0.006	
		28-Dec-95	AEN	NA	NA	NA	NA	NA	NA	0.006	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	0.006	
		30-Apr-96	AEN	NA	NA	NA	NA	NA	NA	0.0031	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	0.0031	
		30-Apr-96	AEN	NA	NA	NA	NA	NA	NA	0.0031	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	0.0031	
	(38)	17-Dec-96	A2AC	NA	NA	NA	NA	NA	NA	0.003	<0.001	<0.001	<0.001	<0.001	<0.001	<0.001	0.003	
LF-22		12-Jul-91	ANA	NA	NA	NA	NA	NA	NA	0.0007	0.012	0.0017	0.053	0.0063	0.0016	<0.0005	0.0753	
		07-Jan-92	ANA	NA	NA	NA	NA	NA	NA	<0.0005	0.009	0.0037	0.041	0.0054	0.0011	<0.0005	0.0602	

**Table 3**  
**Semiannual Summary of Groundwater Quality Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**  
*(concentrations expressed in parts per million [ppm])*

Well ID	Notes	Date Sampled	Lab	TPHg	TPHd	Benzene	Toluene	Ethyl-benzene	Total Xylenes	TCE	1,1,1-TCA	PCE	1,1-DCE	1,1-DCA	1,2-DCA	cis/trans-1,2-DCE	Total VOCs
		16-Apr-92	ANA	NA	NA	NA	NA	NA	NA	<0.0005	0.0026	0.0018	0.015	0.0021	<0.0005	<0.0005	0.0215
	(1)	23-Jul-92	ANA	NA	NA	NA	NA	NA	NA	<0.0005	0.0034	0.0014	0.027	0.0052	<0.0005	<0.0005	0.037
		20-Oct-92	ANA	NA	NA	NA	NA	NA	NA	0.0008	0.0013	0.0007	0.014	0.004	<0.0005	<0.0005	0.02074
		25-May-93	ANA	NA	NA	NA	NA	NA	NA	<0.0005	0.0008	0.0006	0.0061	0.0024	<0.0005	<0.0005	0.00992
	(4)	13-Jul-93	ANA	NA	NA	NA	NA	NA	NA	0.0007	0.001	0.0009	0.0077	0.0033	<0.0005	<0.0005	0.01352
		13-Sep-94	AEN	NA	NA	NA	NA	NA	NA	0.004	<0.0005	0.008	0.003	0.001	0.0007	<0.0005	0.0167
		01-Dec-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	0.0006	0.0009	<0.0005	<0.0005	0.0015
		17-Feb-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	0.0006	0.0007	0.001	<0.0005	<0.0005	0.0023
		09-May-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	0.0007	0.0007	<0.0005	<0.0005	0.0014
duplicate		09-May-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	0.0005	0.0006	<0.0005	<0.0005	0.0011
	(11)	31-Aug-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	0.001	0.001	<0.0005	<0.0005	0.002
duplicate	(11)	31-Aug-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	0.001	0.001	<0.0005	<0.0005	0.002
		20-Dec-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	(17)	27-Feb-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	(24)	29-Apr-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		04-Sep-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		17-Dec-96	A2AC	NA	NA	NA	NA	NA	NA	<0.001	<0.001	<0.001	<0.001	<0.001	<0.001	<0.001	ND
		18-Feb-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		16-May-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		22-Aug-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		12-Dec-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		09-Mar-98	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		16-Sep-98	ENT	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
LF-23		12-Jul-91	ANA	NA	NA	NA	NA	NA	NA	0.0039	0.0009	0.027	0.0012	0.011	0.0009	<0.0005	0.0449
		07-Jan-92	ANA	NA	NA	NA	NA	NA	NA	0.007	0.0023	0.056	0.0034	0.012	0.0013	<0.0005	0.082
		16-Apr-92	ANA	NA	NA	NA	NA	NA	NA	0.0036	0.0007	0.020	0.0044	0.0044	0.0011	<0.0005	0.03418
		23-Jul-92	ANA	NA	NA	NA	NA	NA	NA	0.0038	0.0013	0.029	0.0061	0.0044	0.0014	<0.0005	0.046
		20-Oct-92	ANA	NA	NA	NA	NA	NA	NA	0.0033	0.0005	0.023	0.0047	0.002	0.0015	<0.0005	0.03504
		25-May-93	ANA	NA	NA	NA	NA	NA	NA	0.0042	0.0007	0.016	0.0035	0.0017	0.0019	<0.0005	0.02795
		13-Jul-93	ANA	NA	NA	NA	NA	NA	NA	0.0081	0.0015	0.018	0.0074	0.0033	0.0051	<0.0005	0.0434
		13-Sep-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	0.0006	0.002	0.003	0.0007	<0.0005	0.0063
	(7)	01-Dec-94	AEN	NA	NA	NA	NA	NA	NA	0.004	<0.0005	0.008	0.0006	<0.0005	<0.0005	0.002	0.0146
	(8)	17-Feb-95	AEN	NA	NA	NA	NA	NA	NA	0.003	<0.0005	0.006	<0.0005	<0.0005	<0.0005	0.002	0.011
	(9)	09-May-95	AEN	NA	NA	NA	NA	NA	NA	0.002	<0.0005	0.005	<0.0005	<0.0005	<0.0005	0.001	0.008
	(10)	31-Aug-95	AEN	NA	NA	NA	NA	NA	NA	0.002	<0.0005	0.007	0.0007	0.0007	<0.0005	0.001	0.0114
	(14)	20-Dec-95	AEN	NA	NA	NA	NA	NA	NA	0.001	<0.0005	0.006	<0.0005	<0.0005	<0.0005	<0.0005	0.007
	(18)	27-Feb-96	AEN	NA	NA	NA	NA	NA	NA	0.0008	<0.0005	0.0038	<0.0005	<0.0005	<0.0005	<0.0005	0.0046
	(25)	29-Apr-96	AEN	NA	NA	NA	NA	NA	NA	0.0006	<0.0005	0.0028	<0.0005	<0.0005	<0.0005	<0.0005	0.0034

**Table 3**  
**Semiannual Summary of Groundwater Quality Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**  
*(concentrations expressed in parts per million [ppm])*

Well ID	Notes	Date Sampled	Lab	TPHg	TPHd	Benzene	Toluene	Ethyl-benzene	Total Xylenes	TCE	1,1,1-TCA	PCE	1,1-DCE	1,1-DCA	1,2-DCA	cis/trans-1,2-DCE	Total VOCs
		(26)	04-Sep-96	AEN	NA	NA	NA	NA	NA	0.0014	<0.0005	0.0032	<0.0005	<0.0005	<0.0005	<0.0005	0.0046
		(35)	17-Dec-96	A2AC	NA	NA	NA	NA	NA	0.001	<0.001	0.003	<0.001	<0.001	<0.001	<0.001	0.004
		(39)	18-Feb-97	AEN	NA	NA	NA	NA	NA	0.0007	<0.0005	0.0017	<0.0005	<0.0005	<0.0005	<0.0005	0.0024
		(41)	16-May-97	AEN	NA	NA	NA	NA	NA	0.0014	<0.0005	0.0021	<0.0005	<0.0005	<0.0005	0.0012	0.0047
		(43)	22-Aug-97	AEN	NA	NA	NA	NA	NA	0.0013	<0.0005	0.0025	<0.0005	<0.0005	<0.0005	0.0009	0.0047
		(45)	11-Dec-97	AEN	NA	NA	NA	NA	NA	0.0010	<0.0005	0.0019	<0.0005	<0.0005	<0.0005	0.0009	0.0038
		(48)	09-Mar-98	AEN	NA	NA	NA	NA	NA	0.0010	<0.0005	0.0024	<0.0005	<0.0005	<0.0005	0.0005	0.0045
			16-Sep-98	ENT	NA	NA	NA	NA	NA	<0.0005	<0.0005	0.0007	<0.0005	<0.0005	<0.0005	<0.0005	0.0007
<b>Shallow Extraction Wells (20 to 30 feet below grade)</b>																	
EX-3		14-Sep-94	AEN	NA	NA	NA	NA	NA	NA	0.004	0.014	0.042	0.100	0.005	0.001	0.008	0.174
		02-Dec-94	AEN	NA	0.10	NA	NA	NA	NA	0.004	0.015	0.045	0.140	0.005	<0.0005	<0.0005	0.209
		17-Feb-95	AEN	NA	<0.05	NA	NA	NA	NA	0.003	0.014	0.037	0.096	0.005	<0.0005	<0.0005	0.155
		09-May-95	AEN	NA	0.10	NA	NA	NA	NA	0.003	0.012	0.031	0.120	0.005	<0.0005	<0.0005	0.171
		31-Aug-95	AEN	NA	0.10	NA	NA	NA	NA	<0.003	0.012	0.027	0.120	0.005	<0.003	<0.003	0.164
		28-Dec-95	AEN	NA	0.10	NA	NA	NA	NA	<0.003	0.009	0.036	0.160	0.004	<0.003	<0.003	0.209
		27-Feb-96	AEN	NA	0.12	NA	NA	NA	NA	<0.003	0.0077	0.030	0.120	0.0032	<0.003	<0.003	0.1609
		30-Apr-96	AEN	NA	0.08	NA	NA	NA	NA	<0.003	0.008	0.026	0.120	0.003	<0.003	<0.003	0.157
		05-Sep-96	AEN	NA	0.14	NA	NA	NA	NA	<0.003	0.008	0.029	0.140	0.004	<0.003	<0.003	0.181
		17-Dec-96	A2AC	NA	<0.010	NA	NA	NA	NA	0.006	0.010	0.020	0.098	0.003	<0.001	0.004	0.141
(42)		19-Feb-97	AEN	NA	<0.05	NA	NA	NA	NA	<0.003	0.006	<0.003	0.070	<0.003	<0.003	<0.003	0.076
		15-May-97	AEN	NA	0.12	NA	NA	NA	NA	<0.0005	0.007	0.0048	0.082	0.0025	<0.0005	<0.0005	0.0963
		21-Aug-97	AEN	NA	<0.05	NA	NA	NA	NA	<0.0005	0.0073	0.0053	0.075	0.0022	<0.0005	<0.0005	0.0898
		12-Dec-97	AEN	NA	0.06	NA	NA	NA	NA	<0.0005	0.0079	0.0050	0.083	0.0029	<0.0005	<0.0005	0.0988
		09-Mar-98	AEN	NA	0.05	NA	NA	NA	NA	<0.0005	0.0043	0.0035	0.062	0.0021	<0.0005	<0.0005	0.0719
EX-4		16-Sep-98	ENT	NA	<0.05	NA	NA	NA	NA	<0.0005	0.0037	0.0300	0.150	<0.0005	<0.0005	<0.0005	0.1837
		14-Sep-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	0.025	0.010	0.220	0.006	0.001	<0.0005	0.262
		02-Dec-94	AEN	NA	0.09	NA	NA	NA	NA	<0.0005	0.020	0.011	0.240	0.006	<0.0005	<0.0005	0.277
		17-Feb-95	AEN	NA	<0.05	NA	NA	NA	NA	<0.003	0.017	0.011	0.210	0.004	<0.003	<0.003	0.242
		09-May-95	AEN	NA	0.10	NA	NA	NA	NA	<0.003	0.020	0.011	0.210	0.004	<0.003	<0.003	0.245
		31-Aug-95	AEN	NA	0.20	NA	NA	NA	NA	<0.003	0.016	0.010	0.200	0.005	<0.003	<0.003	0.231
		28-Dec-95	AEN	NA	0.10	NA	NA	NA	NA	<0.003	0.014	0.014	0.210	0.004	<0.003	<0.003	0.242
		27-Feb-96	AEN	NA	0.13	NA	NA	NA	NA	<0.0005	0.0086	0.012	0.150	<0.0005	<0.0005	<0.0005	0.1706
		30-Apr-96	AEN	NA	0.06	NA	NA	NA	NA	<0.003	0.010	0.010	0.150	<0.003	<0.003	<0.003	0.17
		05-Sep-96	AEN	NA	0.14	NA	NA	NA	NA	<0.003	0.008	0.009	0.140	0.003	<0.003	<0.003	0.16
		17-Dec-96	A2AC	NA	0.334	NA	NA	NA	NA	0.001	0.009	0.010	0.090	0.003	<0.001	0.004	0.117
		19-Feb-97	AEN	NA	0.11	NA	NA	NA	NA	<0.003	0.005	0.005	0.097	<0.003	<0.003	<0.003	0.107
		15-May-97	AEN	NA	0.17	NA	NA	NA	NA	<0.003	0.006	0.008	0.110	0.003	<0.003	<0.003	0.127

**Table 3**  
**Semiannual Summary of Groundwater Quality Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**  
*(concentrations expressed in parts per million [ppm])*

Well ID	Notes	Date Sampled	Lab	TPHg	TPHd	Benzene	Toluene	Ethyl-benzene	Total Xylenes	TCE	1,1,1-TCA	PCE	1,1-DCE	1,1-DCA	1,2-DCA	cis/trans-1,2-DCE	Total VOCs
EXTR		21-Aug-97	AEN	NA	0.13	NA	NA	NA	NA	<0.003	0.005	0.007	0.087	<0.003	<0.003	<0.003	0.099
		12-Dec-97	AEN	NA	<0.05	NA	NA	NA	NA	<0.003	0.007	0.014	0.097	0.003	<0.003	<0.003	0.121
		09-Mar-98	AEN	NA	0.13	NA	NA	NA	NA	<0.0005	0.0051	0.0098	0.072	0.0023	<0.0005	0.072	0.1612
		16-Sep-98	ENT	NA	<0.05	NA	NA	NA	NA	<0.0005	0.0025	0.0120	0.096	0.0009	<0.0005	<0.0005	0.1114
		27-Feb-96	AEN	NA	0.15	NA	NA	NA	NA	<0.0005	0.0069	0.0013	0.066	0.0028	<0.0005	<0.0005	0.077
		30-Apr-96	AEN	NA	0.11	NA	NA	NA	NA	<0.0005	0.0055	0.0012	0.063	0.0024	<0.0005	<0.0005	0.0721
		05-Sep-96	AEN	NA	0.12	NA	NA	NA	NA	<0.0005	0.0082	0.0031	0.099	0.0031	<0.0005	<0.0005	0.1134
		17-Dec-96	A2AC	NA	1.520	NA	NA	NA	NA	0.001	0.008	0.009	0.074	0.002	<0.001	0.004	0.098
		19-Feb-97	AEN	NA	0.13	NA	NA	NA	NA	<0.0005	0.0034	0.0021	0.059	0.0016	<0.0005	<0.0005	0.0661
		15-May-97	AEN	NA	0.08	NA	NA	NA	NA	<0.0005	0.0041	0.0018	0.060	0.0021	<0.0005	0.0006	0.0686
		21-Aug-97	AEN	NA	0.07	NA	NA	NA	NA	<0.0005	0.007	0.0048	0.073	0.0023	<0.0005	<0.0005	0.0871
		12-Dec-97	AEN	NA	<0.05	NA	NA	NA	NA	0.0006	0.0063	0.0040	0.075	0.0031	<0.0005	0.0006	0.0896
		09-Mar-98	AEN	NA	0.07	NA	NA	NA	NA	<0.0005	0.0043	0.0040	0.064	0.0021	<0.0005	<0.0005	0.0744
		16-Sep-98	ENT	NA	<0.05	NA	NA	NA	NA	<0.0005	<0.0005	0.0150	0.150	<0.0005	<0.0005	<0.0005	0.165

**Table 3**  
**Semiannual Summary of Groundwater Quality Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**  
*(concentrations expressed in parts per million [ppm])*

Well ID	Notes	Date Sampled	Lab	TPHg	TPHd	Benzene	Toluene	Ethyl-benzene	Total Xylenes	TCE	1,1,1-TCA	PCE	1,1-DCE	1,1-DCA	1,2-DCA	cis/trans-1,2-DCE	Total VOCs
<b>Deeper Wells (40 to 45 feet below grade)</b>																	
MW-6D		13-Sep-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	0.003	<0.0005	0.0005	<0.0005	0.0035
		01-Dec-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		16-Feb-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		09-May-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		31-Aug-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		28-Dec-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		27-Feb-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		01-May-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		03-Sep-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		17-Dec-96	A2AC	NA	NA	NA	NA	NA	NA	<0.001	<0.001	<0.001	<0.001	<0.001	<0.001	<0.001	ND
		18-Feb-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		16-May-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		22-Aug-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		11-Dec-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		09-Mar-98	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		14-Sep-98	ENT	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
MW-7D		13-Sep-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	0.003	<0.0005	<0.0005	<0.0005	0.003
		30-Nov-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	0.003	<0.0005	<0.0005	<0.0005	0.003
		16-Feb-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	0.003	<0.0005	<0.0005	<0.0005	0.003
		09-May-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		30-Aug-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	0.002	<0.0005	<0.0005	<0.0005	0.002
		20-Dec-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
duplicate		20-Dec-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		27-Feb-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		30-Apr-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		03-Sep-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	0.0010	<0.0005	<0.0005	<0.0005	0.001
		17-Dec-96	A2AC	NA	NA	NA	NA	NA	NA	<0.001	<0.001	<0.001	0.008	<0.001	<0.001	<0.001	0.008
		19-Feb-97	AEN	NA	NA	NA	NA	NA	NA	<0.0025	0.0009	<0.0005	0.0081	<0.0005	<0.0005	<0.0005	0.009
		16-May-97	AEN	NA	NA	NA	NA	NA	NA	<0.0025	<0.0005	<0.0005	0.0023	<0.0005	<0.0005	<0.0005	0.0023
		22-Aug-97	AEN	NA	NA	NA	NA	NA	NA	<0.0025	<0.0005	<0.0005	0.0083	<0.0005	<0.0005	<0.0005	0.0083
		11-Dec-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	0.0081	<0.0005	<0.0005	<0.0005	0.0081
		09-Mar-98	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	0.0081	<0.0005	<0.0005	<0.0005	0.0081
(50)		15-Sep-98	ENT	NA	NA	NA	NA	NA	NA	<0.0005	<0.0009	0.0008	0.0160	0.0013	<0.0005	<0.0005	0.0181
MW-9D		12-Sep-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		30-Nov-94	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		16-Feb-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND

**Table 3**  
**Semiannual Summary of Groundwater Quality Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**  
*(concentrations expressed in parts per million [ppm])*

Well ID	Notes	Date Sampled	Lab	TPHg	TPHd	Benzene	Toluene	Ethyl-benzene	Total Xylenes	TCE	1,1,1-TCA	PCE	1,1-DCE	1,1-DCA	1,2-DCA	cis/trans-1,2-DCE	Total VOCs
DUP	08-May-95	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	31-Aug-95	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	20-Dec-95	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	26-Feb-96	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	01-May-96	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	03-Sep-96	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	17-Dec-96	A2AC	NA	NA	NA	NA	NA	NA	NA	<0.001	<0.001	<0.001	0.001	<0.001	<0.001	<0.001	0.001
	19-Feb-97	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	16-May-97	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	22-Aug-97	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	11-Dec-97	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	0.0024	<0.0005	<0.0005	<0.0005	0.0024
	11-Dec-97	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	0.0025	<0.0005	<0.0005	<0.0005	0.0025
	10-Mar-98	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	14-Sep-98	ENT	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
<b>Deep Well (65 feet below grade)</b>																	
MW-7Z	13-Sep-94	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	30-Nov-94	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	16-Feb-95	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	30-Aug-95	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	28-Dec-95	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	27-Feb-96	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	30-Apr-96	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	03-Sep-96	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
	(36)	17-Dec-96	A2AC	NA	NA	NA	NA	NA	NA	0.001	<0.001	<0.001	<0.001	<0.001	<0.001	<0.001	0.004
		19-Feb-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		16-May-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		22-Aug-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		11-Dec-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
Duplicate	09-Mar-98	AEN	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	0.0092	<0.0005	<0.0005	<0.0005	<0.0005	0.0092
	15-Sep-98	ENT	NA	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	0.0092	<0.0005	<0.0005	<0.0005	<0.0005	0.0092

**Table 3**  
**Semiannual Summary of Groundwater Quality Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**  
*(concentrations expressed in parts per million [ppm])*

Well ID	Notes	Date Sampled	Lab	TPHg	TPHd	Benzene	Toluene	Ethyl-benzene	Total Xylenes	TCE	1,1,1-TCA	PCE	1,1-DCE	1,1-DCA	1,2-DCA	cis/trans-1,2-DCE	Total VOCs
		27-Feb-96	AEN	<0.05	NA	<0.0005	<0.0005	<0.0005	<0.002	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		03-Sep-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		19-Feb-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		15-May-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		22-Aug-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		11-Dec-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
		09-Mar-98	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
Field Blanks																	
LF-22		17-Feb-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
LF-22		09-May-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
MW-7Z		09-May-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
LF-22-FB		31-Aug-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
MW-7D-FB		20-Dec-95	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
MW-7-FB		26-Feb-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
MW-9-FB		03-Sep-96	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
LF-22-FB	(37)	17-Dec-96	A2AC	NA	NA	NA	NA	NA	NA	<0.001	<0.001	<0.001	<0.001	<0.001	<0.001	<0.001	ND
MW-8-FB		19-Feb-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
MW-10R-FB		15-May-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
MW-10R-FB		15-Sep-98	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	0.032	0.032
LF-23-FB		22-Aug-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
MW-9-FB		11-Dec-97	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
MW-6D-FB		09-Mar-98	AEN	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND
MW-34R-FB		16-Sep-98	ENT	NA	NA	NA	NA	NA	NA	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	<0.0005	ND

Data entered by TGL, Data proofed by CK and QA/QC by SJS.

#### NOTES:

#### Key to abbreviations:

TPHg = Total petroleum hydrocarbons as gasoline

TPHd = Total petroleum hydrocarbons as diesel

TPHo = Total petroleum hydrocarbons as oil

TCE = Trichloroethene

1,1,1-TCA = 1,1,1-Trichloroethane

PCE = Tetrachloroethene

1,1-DCE = 1,1-Dichloroethene

1,1-DCA = 1,1-Dichloroethane

1,2-DCA = 1,2-Dichloroethane

**Table 3**  
**Semiannual Summary of Groundwater Quality Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**  
*(concentrations expressed in parts per million [ppm])*

Well ID	Notes	Date Sampled	Lab	TPHg	TPHd	Benzene	Toluene	Ethyl-benzene	Total Xylenes	TCE	1,1,1-TCA	PCE	1,1-DCE	1,1-DCA	1,2-DCA	cis/trans-1,2-DCE	Total VOCs
---------	-------	--------------	-----	------	------	---------	---------	---------------	---------------	-----	-----------	-----	---------	---------	---------	-------------------	------------

ENY = Entech Analytical Labs, Inc. in Sunnyvale, California

AEN = American Environmental Network in Pleasant Hill, California

ANA = Inchcape Testing Anametrix, Inc., in San Jose, California

A2AC - Aqua Air (A2) Analytical Corporation

NA = parameter not analyzed

ND = parameter not detected

**Notes:**

- (1) 0.00081 ppm vinyl chloride .
- (2) 0.002 ppm chloroform .
- (3) 0.0008 ppm chloroform .
- (4) 0.002 ppm chloroform .
- (6) 0.002 ppm chloroform .
- (7) 0.0002 ppm chloroform .
- (8) 0.002 ppm chloroform .
- (9) 0.014 ppm chloroform .
- (10) Chloroform = 0.004 .
- (11) Chloroform = 0.0006
- (14) Chloroform = 0.006.
- (15) Bromodichloroethane = 0.010 ppm, vinyl chloride = 0.017 .
- (17) Chloroform = 0.0012
- (18) Chloroform = 0.010, Bromodichloromethane = 0.0011.
- (19) 1,2-DCE = 0.194.
- (20) 1,2-DCE = 0.0024.
- (21) 1,2-DCE = 0.011.
- (22) Vinyl chloride = 0.025, 1,2-DCE = 0.087, Bromodichloromethane = 0.004.
- (23) 1,1,2-Trichlorotrifluoroethane = 0.0021.
- (24) Chloroform = 0.0015.
- (25) Bromodichloromethane = 0.001, Chloroform = 0.013.
- (26) Chloroform=0.002
- (27) Methylene Chloride-0.001 .
- (28) Chloroform-0.030 .
- (31) Methylene Chloride-0.010.
- (35) Chloroform-0.002
- (36) Chloroform-0.001
- (37) Chloroform-0.001.
- (38) Methylene Chloride-0.001.

**Table 3**  
**Semiannual Summary of Groundwater Quality Data**  
**East Baybridge Center**  
**Emeryville and Oakland, California**  
*(concentrations expressed in parts per million [ppm])*

Well ID	Notes	Date Sampled	Lab	TPHg	TPHd	Benzene	Toluene	Ethyl-benzene	Total Xylenes	TCE	1,1,1-TCA	PCE	1,1-DCE	1,1-DCA	1,2-DCA	cis/trans-1,2-DCE	Total VOCs
---------	-------	--------------	-----	------	------	---------	---------	---------------	---------------	-----	-----------	-----	---------	---------	---------	-------------------	------------

(39) Chloroform-0.0007.

(40) Bromodichloromethane-0.0014, Chloroform-0.043

(41) Chloroform-0.0009.

(42) TPH as Oil .0003

(43) Chloroform-0.0009

(44) Methyl t-Butyl Ether 0.063

(45) Chloroform 0.0006

(46) Bromodichloromethane 0.0010, Chloroform 0.015

(47) Vinyl chloride 0.006

(48) Vinyl chloride 0.006

(49) 1,1,2-Trichlorotrifluoroethane

(50) A duplicate sample was collected at MW-7D. The results for this sample were rejected based on Entech's conclusion that the sample reported false positive results because of cross contamination by the laboratory.

**Table 4**  
**Semiannual Groundwater Monitoring Schedule**  
**East Baybridge Center, Emeryville and Oakland, California**

Well Identification		Well Depth (feet)	Analysis
<b>Shallow Zone</b>			
MW-2	Area A	20-25	TPHg, TPHd, BTEX
MW-3		20-25	VOCs, TPHd, TPHo
MW-4		20-25	VOCs, TPHd, TPHo
MW-5		20-25	VOCs, TPHd, TPHo
MW-6		20-25	VOCs, TPHd, TPHo
MW-7		20-25	VOCs, TPHd, TPHo
MW-8		20-25	VOCs
MW-9		20-25	VOCs
LF-22		20-25	VOCs
LF-23		20-25	VOCs
EX-1		20-25	VOCs, TPHd, TPHo
EX-2		20-25	VOCs, TPHd, TPHo
Collection Trench		20-25	VOCs, TPHd, TPHo
MW-1R*	Area B	30	TPHg, BTEX, TPHd, TPHo
MW-10R	Area C	20-25	VOCs
MW-12R		20-25	VOCs, TPHd, TPHo
MW-34R		20-25	VOCs
LF-13		20-25	VOCs
<b>Deep Zone</b>			
MW-6D	Area A	40-45	VOCs
MW-7D		40-45	VOCs
MW-9D		40-45	VOCs
MW-7Z		60	VOCs

\* MW-1R will be installed after the completion of site development.

Samples will be collected once between January and June, and once between July and December.


Samples will be analyzed using the following EPA methods:

TPHg using EPA Method 8015, modified


BTEX using EPA Method 8020

TPHo and TPHd using EPA Method 3550

VOCs using EPA Method 8010

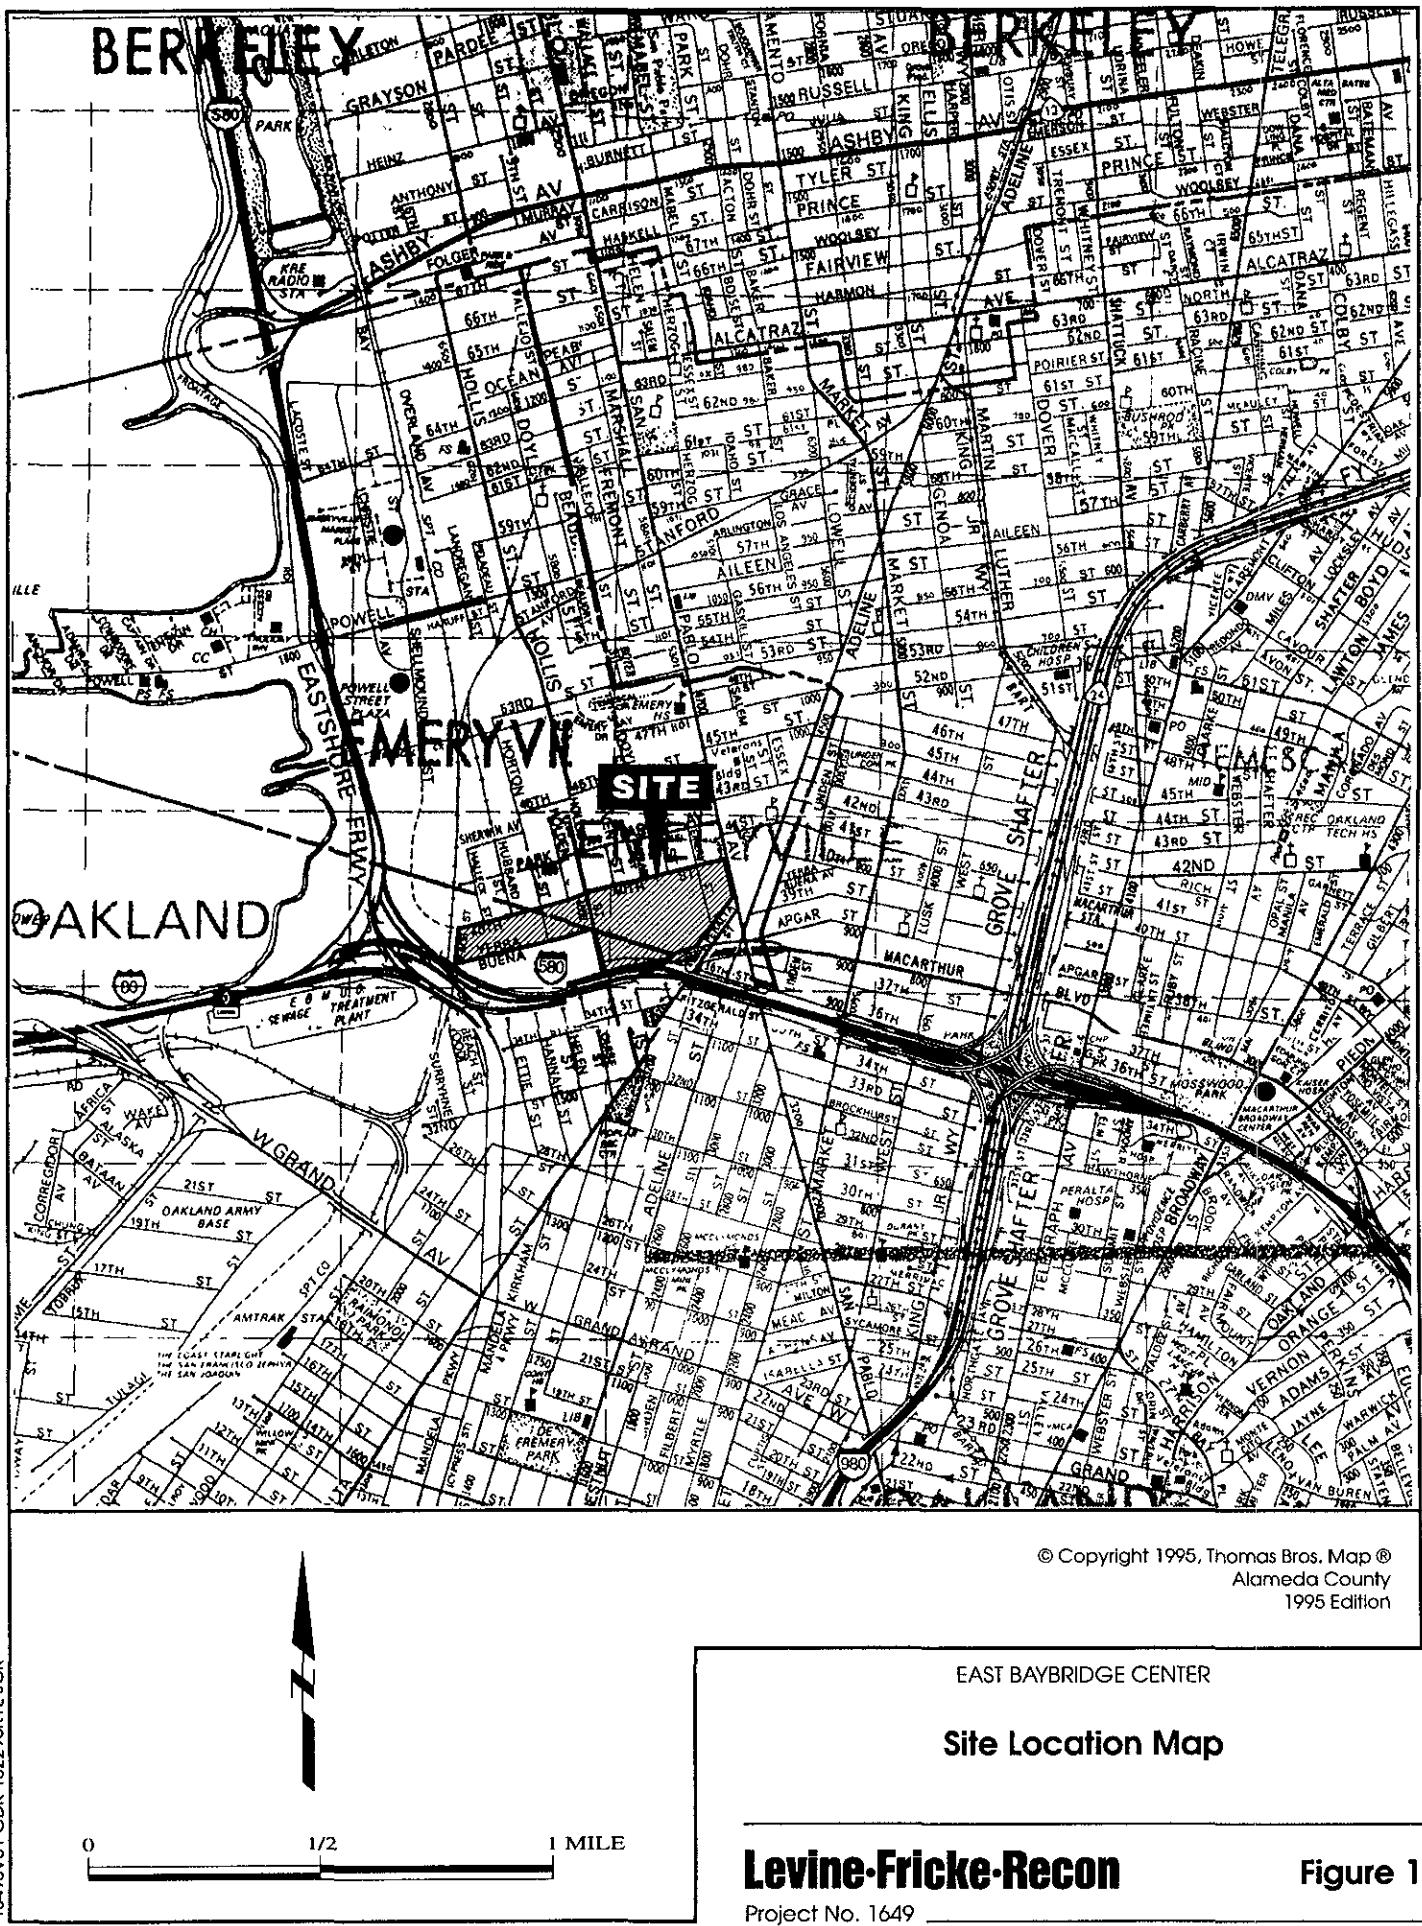

0 150 300 FEET

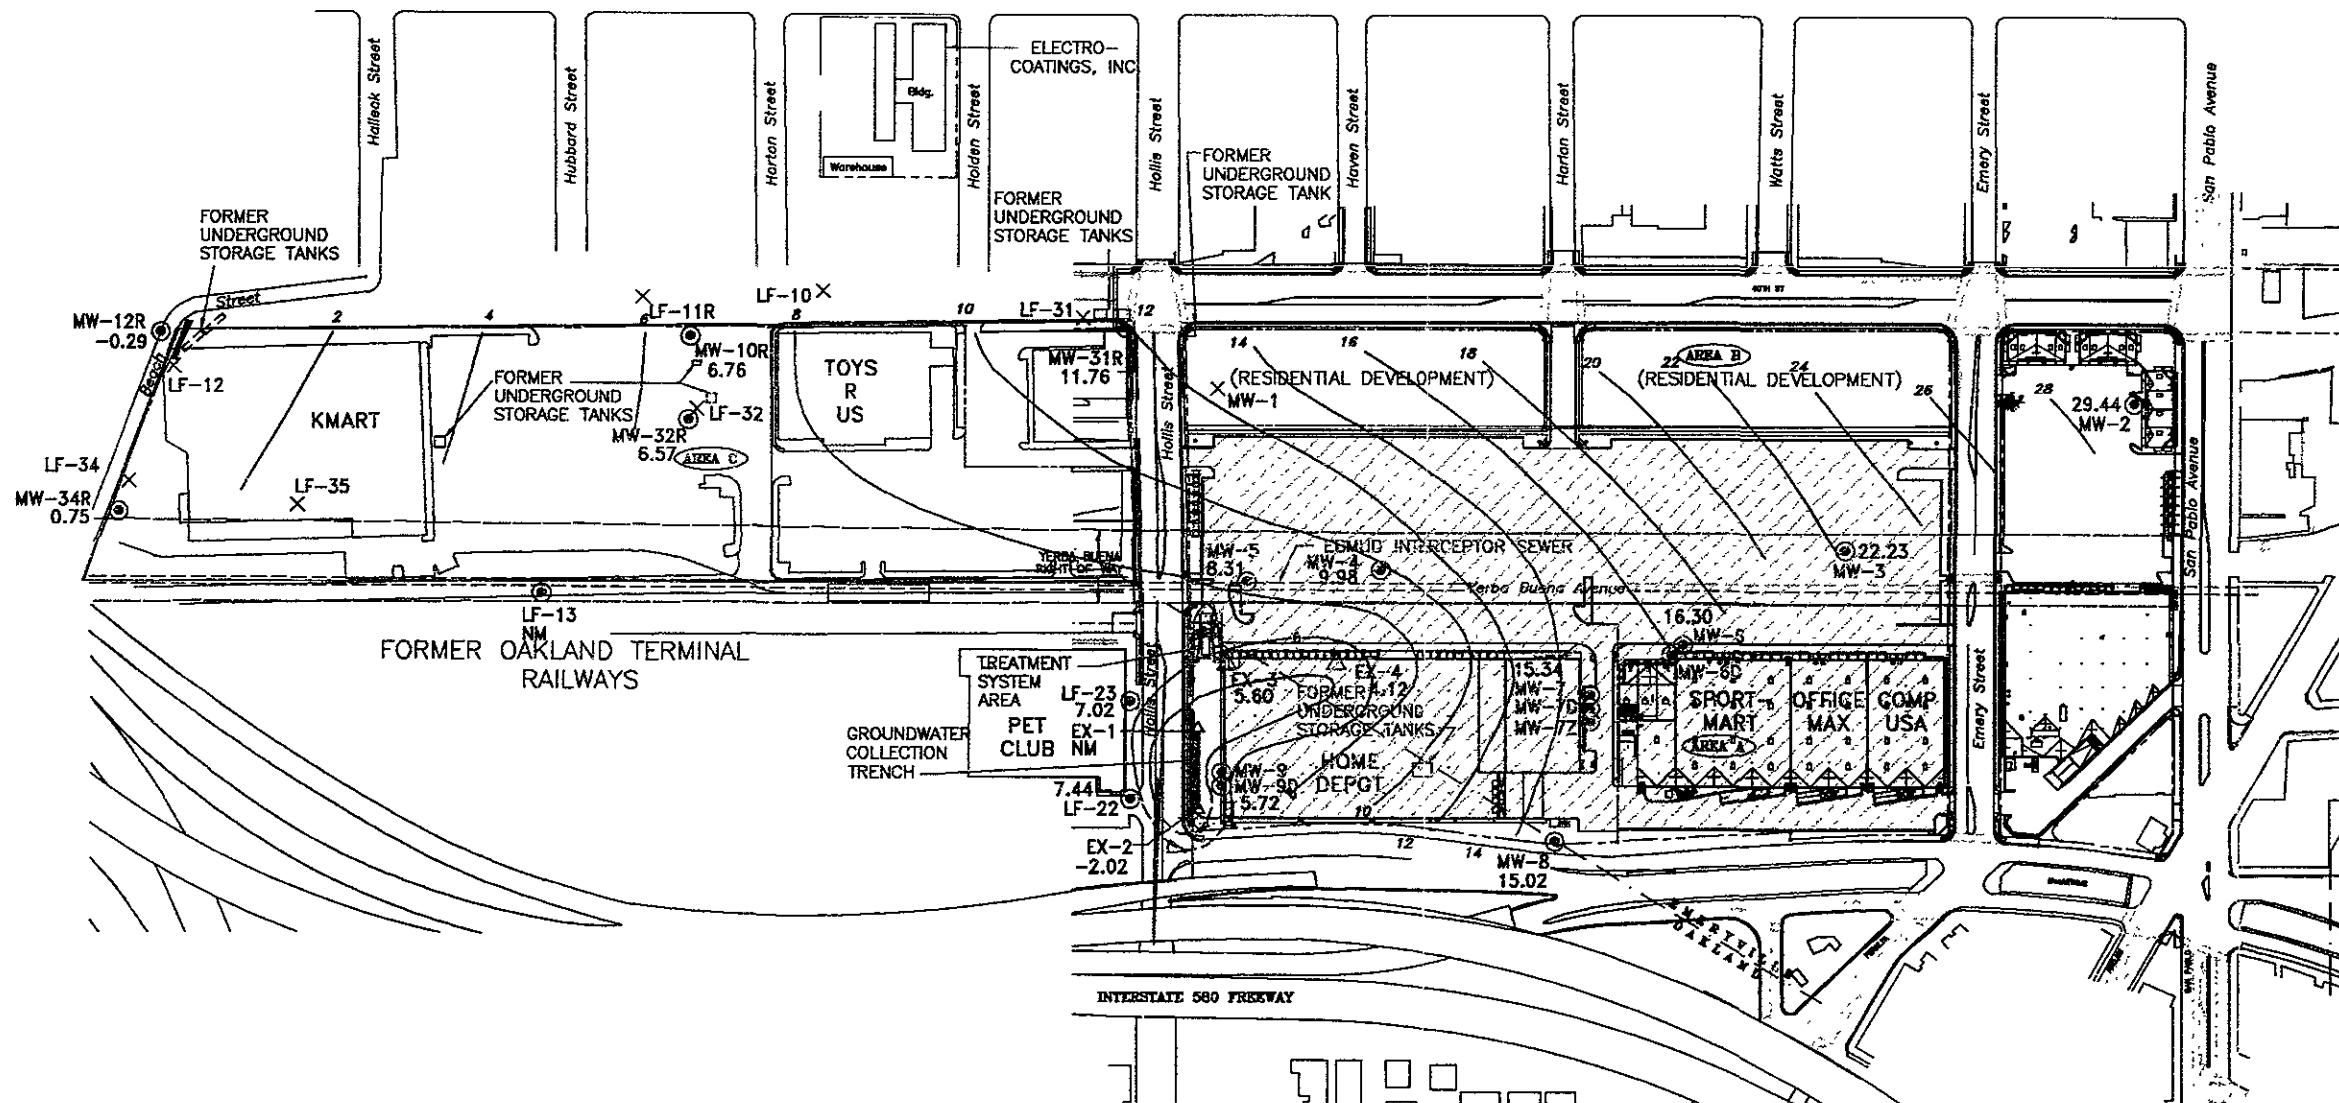

#### EXPLANATION

- MONITORING WELL LOCATION
- △ EXTRACTION WELL
- ✗ ABANDONED GROUNDWATER MONITORING WELL
- APPROXIMATE PROPERTY LINE
- 17.17 GROUNDWATER ELEVATION
- 12 GROUNDWATER ELEVATION CONTOUR (FEET, MSL)
- NM NOT MEASURED
- RETAIL DEVELOPMENT WITH PETROLEUM  
AFFECTED SOIL CONTAINED ON SITE

△	REVISION	DESIGN	DRAWN	CHECKED	DATE
	SCALE :				
	DESIGN :				
	DRAWN :				
	CHECKED :				



APPROVED :

DATE



YERBA BUENA/EAST BAYBRIDGE DEVELOPMENT  
Figure 2  
SITE PLAN SHOWING GROUNDWATER  
ELEVATIONS IN SHALLOW WELLS  
SEPTEMBER 14, 1998

Project No. 1649
Date SEP. 98
Sheet of
Issue

## **APPENDIX A**

### **Field Procedures**