



2014003972

01/07/2014 03:13 PM

OFFICIAL RECORDS OF ALAMEDA COUNTY
PATRICK O'CONNELL
RECORDING FEE: 196.00

58 PGS

Recording Requested By:

Hanson Aggregates Mid-Pacific, Inc.
12667 Alcosta Blvd Suite 400
San Ramon, CA 94583

58

58

When Recorded, Mail To:

Ariu Levi, Director
Alameda County Environmental Health Services
1131 Harbor Bay Parkway
Alameda, California 94502

COVENANT AND ENVIRONMENTAL RESTRICTION
ON PROPERTY

MISSION VALLEY ROCK AND ASPHALT PLANT
7999 ATHENOUR WAY
SUNOL, CALIFORNIA

This Covenant and Environmental Restriction on Property (this "Covenant") is made as of the 4th day of December, 2013 by Hanson Aggregates Mid-Pacific, Inc. ("Covenantor") who is the Owner of record of that certain property situated at 7999 Athenour Way (the Mission Valley Rock and Asphalt Plant), in the County of Alameda, State of California. A portion of the asphalt plant at the Mission Valley Rock and Asphalt Plant, more particularly described in Exhibit A attached hereto, and incorporated herein by this reference (such portion hereinafter referred to as the "Burdened Property"), for the benefit of the Alameda County Environmental Health Services (the "County"), with reference to the following facts:

A. The soil and groundwater underlying the Burdened Property contains hazardous materials and is subject to the Soil and Groundwater Site Management Plan (SMP). The SMP is included as Exhibit B attached hereto and incorporated herein by this reference and provides the following information regarding the Burdened Property:

1. Operational background
2. Summary of remedial actions and current environmental conditions
3. Summary of human health risks
4. Institutional controls
5. Specific controls on the use of groundwater
6. Requirement for ACEH notification and approval of subsurface activities that will encounter residual contamination
7. Requirement for a health and safety plan for all subsurface work

8. Protocols for excavation, grading and management of excavated materials
9. Periodic inspection
10. Contingency plan for discovery of unknown features of environmental concern

B. Contamination of the Burdened Property. Soil at the Burdened Property was contaminated by releases of fuel from underground storage tanks (USTs) and/or the operation of the Burdened Property as an asphalt batch plant that was owned and operated by the Mission Valley Rock Company, since the 1950s. These operations resulted in contamination of soil and groundwater with organic chemicals including petroleum hydrocarbons and methyl-tert-butyl ether (MTBE) detected in soil and groundwater samples which constitute hazardous materials as that term is defined in Health & Safety Code Section 25260.

Several investigations have been conducted since 1996. A full-scale air injection system was installed in March 2009 and operated from April 6, 2009 to July 15, 2010 to enhance the natural biodegradation of petroleum hydrocarbons in groundwater in the vicinity of well cluster MW-9. The results of groundwater monitoring conducted until September 2010 indicated that the air injection system had been effective in reducing concentrations of petroleum constituents in groundwater in the area of well cluster MW-9 and that residual petroleum constituents in groundwater are present within the various vertical portions of the aquifer north of the asphalt plant, in the vicinity of the cluster of former gasoline and diesel USTs. Subsequent further investigations found residual highly weathered diesel in light non-aqueous phase liquid (LNAPL) in the subsurface. The results of investigation suggested the nature of the LNAPL is a highly-weathered diesel with limited transmissivity (i.e., not mobile).

C. Exposure Pathways. The contaminants addressed in this Covenant are present in soil and groundwater in the subsurface at the Burdened Property. Without the mitigation measures which have been performed at the Burdened Property and following the procedures provided in the SMP, exposure to these contaminants could take place via ingestion, inhalation, or dermal contact with soil; inhalation of ambient air; and ingestion, inhalation, or dermal contact with groundwater. Releases from the former USTs and historical operations have resulted in residual concentrations of petroleum constituents in soil, soil gas, and groundwater that could result in a risk to human health. Potential receptors include workers and visitors, including contractors.

The risk of public exposure to the contaminants has been substantially lessened by the remediation and controls described herein and the SMP.

D. Adjacent Land Uses and Population Potentially Affected. The Burdened Property is used for industrial land uses and is adjacent to commercial, industrial, and agricultural land uses.

E. Full and voluntary disclosure to the County of the presence of hazardous materials on the Burdened Property has been made and extensive sampling of the Burdened Property has been conducted.

F. Covenantor desires and intends that in order to benefit the County, and to protect the present and future public health and safety, the Burdened Property shall be used in such a

manner as to avoid potential harm to persons or property that may result from hazardous materials that may have been deposited on portions of the Burdened Property.

ARTICLE I GENERAL PROVISIONS

1.1 Provisions to Run with the Land. This Covenant sets forth protective provisions, covenants, conditions and restrictions (collectively referred to as "Restrictions") upon and subject to which the Burdened Property and every portion thereof shall be improved, held, used, occupied, leased, sold, hypothecated, encumbered, and/or conveyed. The restrictions set forth in Article III are reasonably necessary to protect present and future human health and safety or the environment as a result of the presence on the land of hazardous materials. Each and all of the Restrictions shall run with the land, and pass with each and every portion of the Burdened Property, and shall apply to, inure to the benefit of, and bind the respective successors in interest thereof, for the benefit of the County and all Owners and Occupants. Each and all of the Restrictions are imposed upon the entire Burdened Property unless expressly stated as applicable to a specific portion of the Burdened Property. Each and all of the Restrictions run with the land pursuant to section 1471 of the Civil Code. Each and all of the Restrictions are enforceable by the County.

1.2 Concurrence of Owners and Lessees Presumed. All purchasers, lessees, or possessors of any portion of the Burdened Property shall be deemed by their purchase, leasing, or possession of such Burdened Property, to be in accord with the foregoing and to agree for and among themselves, their heirs, successors, and assignees, and the agents, employees, and lessees of such owners, heirs, successors, and assignees, that the Restrictions as herein established must be adhered to for the benefit of the County and the Owners and Occupants of the Burdened Property and that the interest of the Owners and Occupants of the Burdened Property shall be subject to the Restrictions contained herein.

1.3 Incorporation into Deeds and Leases. Covenantor desires and covenants that the Restrictions set out herein shall be incorporated in and attached to each and all deeds and leases of any portion of the Burdened Property. Recordation of this Covenant shall be deemed binding on all successors, assigns, and lessees, regardless of whether a copy of this Covenant and Agreement has been attached to or incorporated into any given deed or lease.

1.4 Purpose. It is the purpose of this instrument to convey to the County real property rights, which will run with the land, to facilitate the remediation of past environmental contamination and to protect human health and the environment by reducing the risk of exposure to residual hazardous materials.

ARTICLE II
DEFINITIONS

2.1 County. "County" shall mean the Alameda County Environmental Health Services and shall include its successor agencies, if any.

2.2 Improvements. "Improvements" shall mean all buildings, roads, driveways, regradings, and paved parking areas, constructed or placed upon any portion of the Burdened Property.

2.3 Occupants. "Occupants" shall mean Owners and those persons entitled by ownership, leasehold, or other legal relationship to the exclusive right to use and/or occupy all or any portion of the Burdened Property.

2.4 Owner or Owners. "Owner" or "Owners" shall mean the Covenantor and/or its successors in interest, who hold title to all or any portion of the Burdened Property.

ARTICLE III
DEVELOPMENT, USE AND CONVEYANCE OF THE BURDENED PROPERTY

3.1 Restrictions on Development and Use. Covenantor promises to restrict the use of the Burdened Property as follows:

- a. Development of the Burdened Property shall be restricted to industrial, commercial or office space;
- b. No residence for human habitation shall be permitted on the Burdened Property;
- c. No hospitals shall be permitted on the Burdened Property;
- d. No schools for persons under 21 years of age shall be permitted on the Burdened Property;
- e. No day care centers for children or day care centers for Senior Citizens shall be permitted on the Burdened Property;
- f. No Owners or Occupants of the Property or any portion thereof shall conduct any excavation work on the Property, unless expressly permitted in writing by the County and in accordance with the SMP. Any contaminated soils brought to the surface by grading, excavation, trenching, or backfilling shall be managed by Covenantor or his agent, or successor owners or occupants, in accordance with the SMP and all applicable provisions of local, state and federal law;
- g. All uses and development of the Burdened Property shall be consistent with the SMP

which is hereby incorporated by reference.

h. No Owners or Occupants of the Burdened Property or any portion thereof shall drill, bore, otherwise construct, or use a well for the purpose of extracting water for any use, including but not limited to domestic, potable, irrigation, or industrial uses, unless expressly permitted in writing by the County. Further restrictions for well installation are described in the SMP.

i. The Covenantor agrees that the County, and/or any persons acting pursuant to County cleanup orders, shall have reasonable access to the Burdened Property for the purposes of inspection, surveillance, maintenance, or monitoring, as provided for in Division 7 of the Water Code.

j. No Owner or Occupant of the Burdened Property shall act in any manner that will aggravate or contribute to the existing environmental conditions of the Burdened Property. All use and development of the Burdened Property shall preserve the integrity of any capped areas.

k. No Owner or User of the Burdened Property shall grow fruits or vegetables for consumption using site soils. Gardening on the Burdened Property shall only be permitted using imported soil within raised beds that do not allow direct contact between plant roots and the underlying site soil.

3.2 Enforcement. Failure of an Owner or Occupant to comply with any of the restrictions, as set forth in paragraph 3.1, shall be grounds for the County, by reason of this Covenant, to have the authority to require that the Owner modify or remove any Improvements constructed in violation of that paragraph. Violation of the Covenant shall be grounds for the County to file civil actions against the Owner as provided by law.

3.3 Notice in Agreements. After the date of recordation hereof, all Owners and Occupants shall execute a written instrument which shall accompany all purchase agreements or leases relating to the property. Any such instrument shall contain the following statement:

The land described herein contains hazardous materials in soils and in the ground water under the property, and is subject to a deed restriction dated as of _____, 20__, and recorded on _____, 20__, in the Official Records of _____ County, California, as Document No. _____, which Covenant and Restriction imposes certain covenants, conditions, and restrictions on usage of the property described herein. This statement is not a declaration that a hazard exists.

ARTICLE IV
VARIANCE AND TERMINATION

4.1 Variance. Any Owner or, with the Owner's consent, any Occupant of the Burdened Property or any portion thereof may apply to the County for a written variance from the provisions of this Covenant.

4.2 Termination. Any Owner or, with the Owner's consent, any Occupant of the Burdened Property or a portion thereof may apply to the County for a termination of the Restrictions as they apply to all or any portion of the Burdened Property.

4.3 Term. Unless terminated in accordance with paragraph 4.2 above, by law or otherwise, this Covenant shall continue in effect in perpetuity.

ARTICLE V
MISCELLANEOUS

5.1 No Dedication Intended. Nothing set forth herein shall be construed to be a gift or dedication, or offer of a gift or dedication, of the Burdened Property or any portion thereof to the general public.

5.2 Notices. Whenever any person gives or serves any notice, demand, or other communication with respect to this Covenant, each such notice, demand, or other communication shall be in writing and shall be deemed effective (1) when delivered, if personally delivered to the person being served or official of a government agency being served, or (2) three (3) business days after deposit in the mail if mailed by United States mail, postage paid certified, return receipt requested:

If To: "Covenantor"
Environmental Manager
Lehigh Hanson West Region
12667 Alcosta Blvd Suite 400
San Ramon, CA 94583

If To: "County"
Alameda County Environmental Health Services
Attention: Director
1131 Harbor Bay Parkway
Alameda, California 94502

5.3 Partial Invalidity. If any portion of the Restrictions or terms set forth herein is determined to be invalid for any reason, the remaining portion shall remain in full force and effect as if such portion had not been included herein.

5.4 Article Headings. Headings at the beginning of each numbered article of this Covenant are solely for the convenience of the parties and are not a part of the Covenant.


5.5 Recordation. This instrument shall be executed by the Covenantor and by the Director of Environmental Health Services. This instrument shall be recorded by the Covenantor in the County of _____ within ten (10) days of the date of execution.

5.6 References. All references to Code sections include successor provisions.


5.7 Construction. Any general rule of construction to the contrary notwithstanding, this instrument shall be liberally construed in favor of the Covenant to effect the purpose of this instrument and the policy and purpose of the Water Code. If any provision of this instrument is found to be ambiguous, an interpretation consistent with the purpose of this instrument that would render the provision valid shall be favored over any interpretation that would render it invalid.

IN WITNESS WHEREOF, the parties execute this Covenant as of the date set forth above.

Covenantor: Hanson Aggregates Mid-Pacific Inc.

By: 
Title: Vice President
Date: 12-4-13

Agency: Alameda County
Environmental Health Services

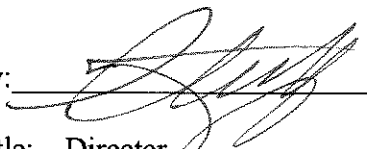By: 
Title: Director
Date: 12/4/2013

STATE OF CALIFORNIA, COUNTY OF Contra Costa

On December 4, 2013 before me Patty Sanders, Notary Public,
personally appeared

Ariw Benjamin Levi and John Paul Bruno
who proved to me on the basis of satisfactory evidence to be the person(s) whose name(s) is/are
subscribed to the within instrument and acknowledged to me that he/she/they executed the same
in his/her/their authorized capacity(ies), and that by his/her/their signature(s) on the instrument
the person(s), or the entity upon behalf of which the person(s) acted, executed the instrument.

I certify under PENALTY OF PERJURY under the laws of the State of California that the
foregoing paragraph is true and correct.

WITNESS my hand and official seal.

Patty Sanders
Notary Public in and for said
County and State



STATE OF CALIFORNIA, COUNTY OF _____

On _____, before me _____, Notary Public,
personally appeared

_____ who proved to me on the basis of satisfactory evidence to be the person(s) whose name(s) is /are
subscribed to the within instrument and acknowledged to me that he/she/they executed the same
in his/her/their authorized capacity(ies), and that by his/her/their signature(s) on the instrument
the person(s), or the entity upon behalf of which the person(s) acted, executed the instrument.

I certify under PENALTY OF PERJURY under the laws of the State of California that the
foregoing paragraph is true and correct.

WITNESS my hand and official seal.

Notary Public in and for said
County and State

EXHIBIT A

LEGAL DESCRIPTION OF PROPERTY AND SITE PLAN

EXHIBIT "A"
Legal Description

PROPOSED DEED RESTRICTION AREA
Near Athenour Way, Sunol, CA
APN'S 096-0001-11-8 and 096-0080-1-7

Real property situate in the County of Alameda, State of California, described as follows:

Being a portion of PARCEL B1, PARCEL B2 and PARCEL C, as said parcels are described in that certain GRANT DEED, recorded on March 28, 2005 in Document No. 2005120345, Alameda County Records, more particularly described as follows;

COMMENCING a the BRASS DISC identified and stamped as "A-602" on Caltrans Monument Map S-235.6, Route 680, Alameda County, Post Mile 9.7;

Thence South 17°59'48" East 1564.52 feet to the intersection of the easterly line described in that certain GRANT DEED, recorded on March 28, 25005 in Document No. 2005120347, more particularly described as South 7°06'04" West 377.13 feet, with the easterly line of said PARCEL B1;

Thence along the easterly line of said PARCEL B1 South 20°51'17" East 336.22 feet to the **TRUE POINT OF BEGINNING**;

Thence North 10°33'18" East 34.02 feet to the beginning of a tangent curve concave to the northwest having a radius of 50.00 feet;

Thence along said curve, through a central angle of 09°59'56", for an arc length of 8.73 feet;

Thence North 00°33'22" East 68.05 feet;

Thence North 10°20'18" East 53.03 feet;

Thence North 15°21'32" East 120.40 feet to the beginning of a tangent curve concave to the southeast having a radius of 25.00 feet

Thence along said curve, through a central angle of 30°53'26", for an arc length of 13.48 feet;

Thence North 46°14'58" East 82.19 feet the beginning of a tangent curve concave to the south having a radius of 20.00 feet;

Thence along said curve, through a central angle of 118°54'21", for an arc length of 41.51 feet;

Thence South 14°50'41" East 40.87 feet the beginning of a tangent curve concave to the northeast having a radius of 100.00 feet;

Thence along said curve, through a central angle of 30°46'19", for an arc length of 53.71 feet;

Thence South 45°37'00" East 96.34 feet the beginning of a tangent curve concave to the West having a radius of 40.00 feet;

Thence along said curve, through a central angle of 87°49'36", for an arc length of 61.31 feet;

Thence South 42°12'36" West 49.84 feet;

Thence South 47°21'12" West 40.03 feet the beginning of a tangent curve concave to the northwest having a radius of 50.00 feet;

Thence along said curve, through a central angle of 23°51'33", for an arc length of 20.82 feet;

Thence South 71°12'45" West 24.04 feet the beginning of a tangent curve concave to the southeast having a radius of 25.00 feet;

Thence along said curve, through a central angle of 45°47'29", for an arc length of 19.98 feet;

Thence South 25°25'15" West 237.59 feet the beginning of a tangent curve concave to the north having a radius of 32.00 feet;

Thence along said curve, through a central angle of 147°11'02", for an arc length of 82.20 feet;

Thence North 07°23'43" West 46.68 feet the beginning of a tangent curve concave to the southeast having a radius of 50.00 feet;

Thence along said curve, through a central angle of 29°24'11", for an arc length of 25.66 feet;

Thence North 22°00'28" East 37.82 feet the beginning of a tangent curve concave to the northwest having a radius of 50.00 feet

Thence along said curve, through a central angle of 11°27'10", for an arc length of 9.99 feet;

Thence North 10°33'18" East 55.89 feet to the **TRUE POINT OF BEGINNING**.

Containing 76,484 square feet or 1.756 acres, more or less.

Being a portion of Assessor's Parcel Number 096-0001-11-8 and 096-0080-1-7

As shown on Exhibit "B" attached hereto and made a part hereof.


For: BKF Engineers

By: _____
Davis Thresh, P.L.S. No. 6868
License expires: 09-30-2014

Date: _____
K:\SurJ3\137085.50 Sunol Quarry Plat\MAIN\LEGAL\DEED RESTRICTION AREA.doc

LEGEND

APN	ASSESSOR PARCEL NUMBER
MON	MONUMENT
P.O.C.	POINT OF COMMENCEMENT
T.P.O.B.	TRUE POINT OF BEGINNING
R	RADIUS
Δ	DELTA
L	LENGTH

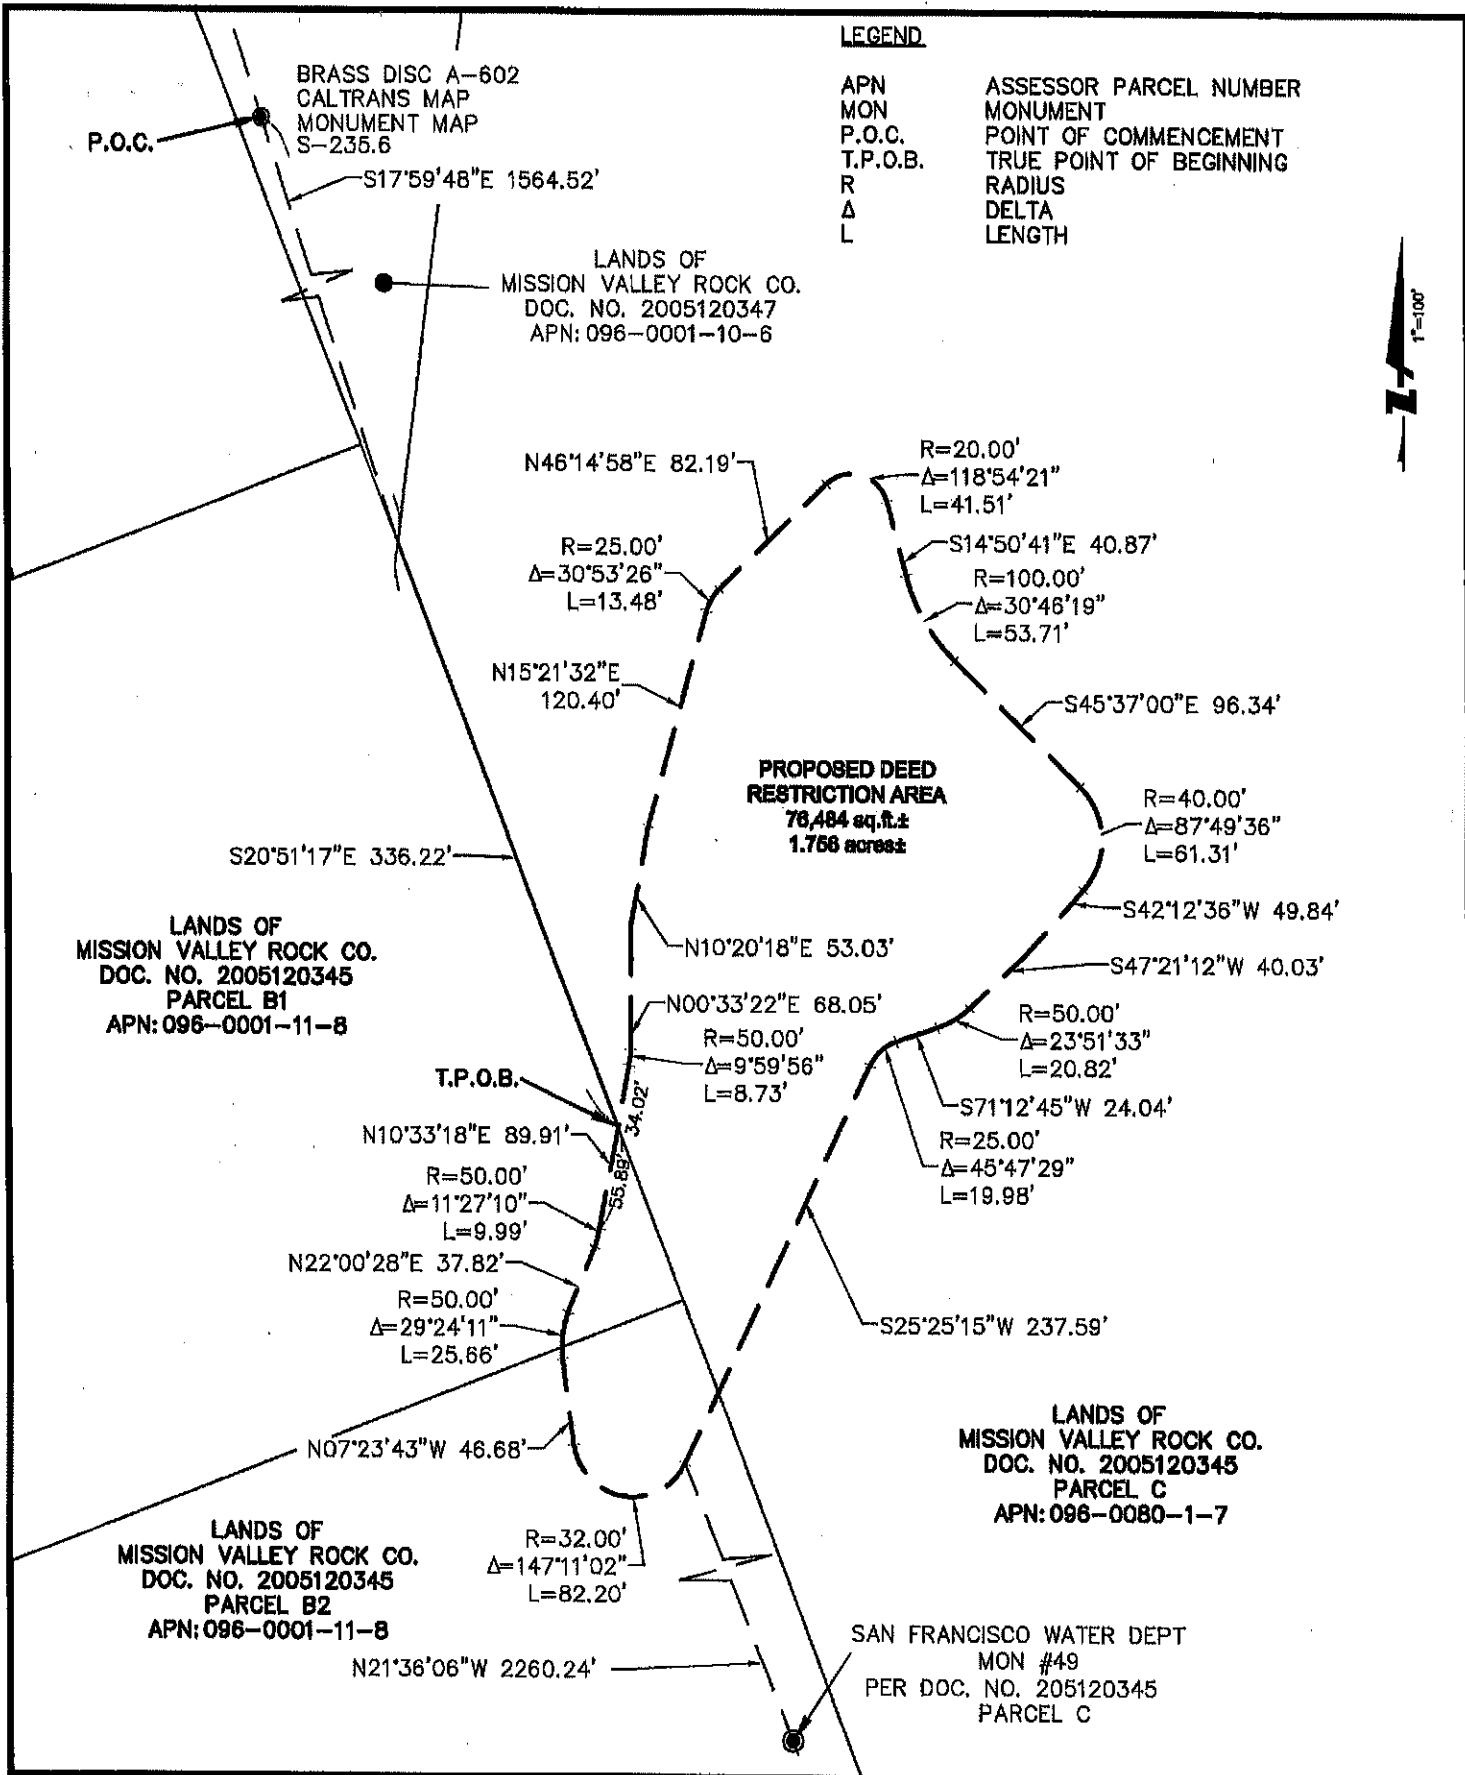

4780 CHABOT DRIVE
SUITE 104
PLEASANTON, CA 94588
925-396-7700
925-396-7799 (FAX)

Subject PROPOSED DEED RESTRICTION AREA
SUNOL QUARRY
Job No. 20137085
By RL Date 9/20/13 Chkd. WS
SHEET 1 OF 1

Parcel name: SUNOL QUARRY AREA

North: 392978.7487 East : 1601089.4401
Line Course: N 10-33-18 E Length: 34.02
 North: 393012.1931 East : 1601095.6718
Curve Length: 8.73 Radius: 50.00
 Delta: 9-59-56 Tangent: 4.37
 Chord: 8.71 Course: N 05-33-20 E
 Course In: N 79-26-42 W Course Out: S 89-26-38 E
 RP North: 393021.3521 East : 1601046.5179
 End North: 393020.8668 East : 1601096.5155
Line Course: N 00-33-22 E Length: 68.05
 North: 393088.9136 East : 1601097.1760
Line Course: N 10-20-18 E Length: 53.03
 North: 393141.0826 East : 1601106.6928
Line Course: N 15-21-32 E Length: 120.40
 North: 393257.1826 East : 1601138.5824
Curve Length: 13.48 Radius: 25.00
 Delta: 30-53-26 Tangent: 6.91
 Chord: 13.32 Course: N 30-48-15 E
 Course In: S 74-38-28 E Course Out: N 43-45-02 W
 RP North: 393250.5610 East : 1601162.6896
 End North: 393268.6200 East : 1601145.4016
Line Course: N 46-14-58 E Length: 82.19
 North: 393325.4560 East : 1601204.7721
Curve Length: 41.51 Radius: 20.00
 Delta: 118-54-21 Tangent: 33.89
 Chord: 34.45 Course: S 74-17-52 E
 Course In: S 43-45-02 E Course Out: N 75-09-19 E
 RP North: 393311.0088 East : 1601218.6025
 End North: 393316.1329 East : 1601237.9350
Line Course: S 14-50-41 E Length: 40.87
 North: 393276.6269 East : 1601248.4059
Curve Length: 53.71 Radius: 100.00
 Delta: 30-46-19 Tangent: 27.52
 Chord: 53.06 Course: S 30-13-50 E
 Course In: N 75-09-19 E Course Out: S 44-23-00 W
 RP North: 393302.2470 East : 1601345.0683
 End North: 393230.7794 East : 1601275.1227
Line Course: S 45-37-00 E Length: 96.34
 North: 393163.3938 East : 1601343.9746
Curve Length: 61.31 Radius: 40.00
 Delta: 87-49-36 Tangent: 38.51
 Chord: 55.49 Course: S 01-42-12 E
 Course In: S 44-23-00 W Course Out: S 47-47-24 E
 RP North: 393134.8068 East : 1601315.9964
 End North: 393107.9328 East : 1601345.6239
Line Course: S 42-12-36 W Length: 49.84
 North: 393071.0169 East : 1601312.1389
Line Course: S 47-21-12 W Length: 40.03
 North: 393043.8976 East : 1601282.6950
Curve Length: 20.82 Radius: 50.00
 Delta: 23-51-33 Tangent: 10.56
 Chord: 20.67 Course: S 59-16-58 W
 Course In: N 42-38-48 W Course Out: S 18-47-15 E
 RP North: 393080.6749 East : 1601248.8212
 End North: 393033.3389 East : 1601264.9242
Line Course: S 71-12-45 W Length: 24.04
 North: 393025.5966 East : 1601242.1651
Curve Length: 19.98 Radius: 25.00

Delta: 45-47-30	Tangent: 10.56
Chord: 19.45	Course: S 48-19-00 W
Course In: S 18-47-15 E	Course Out: N 64-34-45 W
RP North: 393001.9286	East : 1601250.2165
End North: 393012.6602	East : 1601227.6371
Line Course: S 25-25-15 W	Length: 237.59
North: 392798.0738	East : 1601125.6483
Curve Length: 82.20	Radius: 32.00
Delta: 147-11-02	Tangent: 108.67
Chord: 61.39	Course: N 80-59-14 W
Course In: N 64-34-45 W	Course Out: S 82-36-17 W
RP North: 392811.8103	East : 1601096.7466
End North: 392807.6914	East : 1601065.0128
Line Course: N 07-23-43 W	Length: 46.68
North: 392853.9831	East : 1601059.0044
Curve Length: 25.66	Radius: 50.00
Delta: 29-24-11	Tangent: 13.12
Chord: 25.38	Course: N 07-18-23 E
Course In: N 82-36-17 E	Course Out: N 67-59-32 W
RP North: 392860.4188	East : 1601108.5885
End North: 392879.1554	East : 1601062.2319
Line Course: N 22-00-28 E	Length: 37.82
North: 392914.2196	East : 1601076.4042
Curve Length: 9.99	Radius: 50.00
Delta: 11-27-10	Tangent: 5.01
Chord: 9.98	Course: N 16-16-53 E
Course In: N 67-59-32 W	Course Out: S 79-26-42 E
RP North: 392932.9562	East : 1601030.0476
End North: 392923.7973	East : 1601079.2016
Line Course: N 10-33-18 E	Length: 55.89
North: 392978.7416	East : 1601089.4395

Perimeter: 1324.18 Area: 76,484 sq. ft. 1.756 acres

Mapcheck Closure - (Uses listed courses, radii, and deltas)
 Error Closure: 0.0072 Course: S 04-56-15 W
 Error North: -0.00716 East : -0.00062
 Precision 1: 183,913.89

EXHIBIT B

SOIL AND GROUNDWATER SITE MANAGEMENT PLAN

EXHIBIT B

SOIL AND GROUNDWATER SITE MANAGEMENT PLAN



October 2, 2013

Mr. Jerry Wickham
Alameda County Health Care Services
Environmental Health Services
1131 Harbor Bay Parkway, Suite 250
Alameda, California 94502-6577

Subject: Soil and Groundwater Site Management Plan at the Mission Valley Rock and Asphalt Plant Located at 7999 Athenour Way in Sunol, California Alameda County Case No. RO0000207 and GeoTracker Global ID T0600102092

Dear Mr. Wickham:

The attached Soil and Groundwater Site Management Plan was prepared by ARCADIS U.S., Inc. (ARCADIS) on behalf of Lehigh Hanson West Region ("Hanson") for the asphalt plant area of the Hanson Aggregates Former Mission Valley Rock Facility, located at 7999 Athenour Way, Sunol, California ("the Site"). The site management plan was prepared in response to the Alameda County Environmental Health Services (ACEH) letter to Hanson dated March 13, 2013 and presents the management processes for the residual petroleum-affected soil and groundwater.

I declare, under penalty of perjury, that the information and/or recommendations contained in the attached report are true and correct to the best of my knowledge.

If you have any questions or comments concerning this report, please call Tina Lau, Environmental Manager, at (925) 244-6584 or Ron Goloubow of ARCADIS at (510) 596-9550.

Sincerely,

Mike Roth
Vice President/General Manager
Lehigh Hanson West Region

Attachment



Imagine the result

Lehigh Hanson West Region

Soil and Groundwater Site Management Plan

Hanson Aggregates Mission Valley Rock
Facility, 7999 Athenour Way
Sunol, Alameda County, California
(SLIC Case #RO0000207 and
GeoTracker ID T0600102092)

October 2, 2013




Caitlin Bell

Caitlin Bell, P.E.
Staff Environmental Engineer

R. Goloubow

Ron Goloubow, P.G.
Principal Geologist
California Professional Geologist (8655)

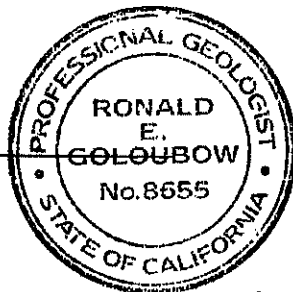

Expires No. 30, 2015

**Soil and Groundwater Site
Management Plan**

Mission Valley Rock and Asphalt
Plant, 7999 Athenour Way, Sunol,
California

Prepared for
Lehigh Hanson West Region
12667 Alcosta Boulevard, Suite 400
San Ramon, California 94583

Prepared by
ARCADIS U.S., Inc.
2000 Powell Street, 7th Floor
Emeryville, California 94608
Tel 510.652.4500
Fax 510.652.4906
www.arcadis-us.com

Our Ref.:
EM009480.0016

Date:
October 2, 2013

This document is intended only for the use of the individual or entity for which it was prepared and may contain information that is privileged, confidential and exempt from disclosure under applicable law. Any dissemination, distribution or copying of this document is strictly prohibited.

1.	Introduction	1
1.1.	Soil and Groundwater Site Management Plan Organization	1
2.	Site Background	2
2.1.	Geology and Hydrogeology	2
2.2.	Environmental Conditions and Chemicals of Concern	3
2.3.	Investigations and Remedial Activities	3
2.3.1.	Remedial Action	4
2.3.2.	Groundwater Monitoring	5
2.3.3.	LNAPL Investigation	6
3	Summary of Human Health Risks	7
3.3	Soil	7
3.4	Soil Gas	8
3.5	Groundwater	8
4	Summary of Institutional Controls	9
5	Soil and Groundwater Site Management Plan	10
5.3	Notification and Approval Requirements	10
5.4	Health and Safety Requirements	10
5.5	Groundwater Use Controls	11
5.6	Potential Future Mining Development	11
5.7	Soil and Groundwater Management During Subsurface Activities	11
5.7.2	Soil Management Procedures	12
5.7.3	Groundwater Management Procedures	13
5.8	Contingency Plan	13
5.9	Record Keeping, Inspections, and Reporting	16
5.10	Soil and Groundwater Site Management Plan Availability	16
6	References	17

Tables

Table 1	Groundwater Monitoring Well Details
Table 2	Historical Soil Gas Analytical Results

Figures

Figure 1	Site Location Map
Figure 2	Site Plan
Figure 3	Groundwater Elevation Contours for the Shallow Interval (September 27, 2010)
Figure 4	Groundwater Elevation Contours for the Deep Interval (September 27, 2010)
Figure 5	Groundwater Elevation Contours for the Livermore Formation (September 27, 2010)
Figure 6	Vadose Zone Soil Analytical Results
Figure 7	Concentrations of TPHd, TPHg, and MTBE in Groundwater for the Shallow Interval (September 2010)
Figure 8	Concentrations of TPHd, TPHg, and MTBE in Groundwater for the Deep Interval (September 2010)
Figure 9	Concentrations of TPHd, TPHg, and MTBE in Groundwater for the Livermore Formation (September 2010)

Appendices

Appendix A	Historical Soil Data
------------	----------------------



Soil and Groundwater Site Management Plan

Mission Valley Rock and Asphalt Plant
7999 Athenour Way, Sunol, California

1. Introduction

On behalf of Lehigh Hanson West Region (Hanson), ARCADIS U.S., Inc. (ARCADIS) is submitting this Soil and Groundwater Site Management Plan (SMP) to prevent future exposure to residual contamination that remains in place following the completion of site investigation and cleanup activities at the Mission Valley Rock and Asphalt Plant located at 7999 Athenour Way in Sunol, California (Figure 1). The portion of the facility that is subject to the SMP is illustrated on Figure 2 and will be referred to in the remainder of this SMP as the Burdened Property. This SMP is incorporated by reference into a Covenant and Environmental Restriction on Property, which has been recorded for the Burdened Property. The SMP includes the following information, per the request of the ACEH in the letter dated March 13, 2013:

1. Site background
2. Summary of remedial actions and current environmental conditions
3. Summary of human health risks
4. Institutional controls
5. Specific controls on the use of groundwater at the Burdened Property
6. Requirement for ACEH notification and approval of subsurface activities that will encounter residual contamination
7. Requirement for a health and safety plan for all subsurface work
8. Protocols for excavation, grading, and management of excavated materials
9. Periodic inspection
10. Contingency plan for discovery of unknown features of environmental concern

The objective of this SMP is to provide a mechanism for continued protection of the health and safety of future Site workers and visitors due to residual contamination remaining in soil and groundwater within the Burdened Property (Figure 2).

1.1. Soil and Groundwater Site Management Plan Organization

The remainder of this SMP is organized as follows:



Soil and Groundwater Site Management Plan

Mission Valley Rock and Asphalt Plant
7999 Athenour Way, Sunol, California

- Section 2 provides a summary of the Site background, geology, hydrogeology, environmental conditions, and historical investigations and remedial actions.
- Section 3 provides a review of the human health risks at the Burdened Property.
- Section 4 provides the summary of the institutional controls being employed at the Burdened Property.
- Section 5 is the management plan for soil and groundwater including notification requirements, health and safety considerations, groundwater use controls, guidance for soil management, inspection requirements, contingency plan for discovery of unknown features of environmental concern, record keeping requirements, and availability of the SMP.
- Section 6 provides cited references.

2. Site Background

The Burdened Property is located within the 588-acre Mission Valley Rock Facility previously owned by Mission Valley Rock (MVR) Company since the 1950s. Hanson purchased the property in early 2005 but retained the business and legal entity of MVR. The facility is currently operated as a sand and gravel quarry with an asphalt manufacturing facility and a ready mix concrete plant. Additionally, various areas throughout the facility are leased for industrial, agricultural, and storage purposes. The Burdened Property, which is the portion of the facility subject to this SMP, has been impacted by unauthorized releases of petroleum hydrocarbons from gasoline and diesel fuel underground storage tank systems.

2.1. Geology and Hydrogeology

Sediments beneath the Site consist of approximately 5 to 20 feet of relatively low-permeability silts, clays, and clayey gravels overlying approximately 20 to 30 feet of relatively permeable fine- to coarse-grained gravels, that are considered to be the predominant water-bearing stratum. The Livermore Formation encountered at approximately 30 to 40 feet below ground surface (bgs) underlies these shallower water-bearing strata and appears to be somewhat less permeable than the overlying strata due to increased fines content.



Soil and Groundwater Site Management Plan

Mission Valley Rock and Asphalt Plant
7999 Athenour Way, Sunol, California

The depth to groundwater beneath the Site typically ranges from 2 to 6 feet bgs. Groundwater flow conditions in the vicinity of the Site are influenced by low-permeability features, such as the former gravel pits filled with relatively less permeable, finer-grained sediment, and by groundwater removal from adjacent former mining pits. The local flow direction generally has been to the south, southeast, and east, as measured in site groundwater monitoring wells since approximately 1998 (Figures 3 through 5). Historically, the groundwater table likely fluctuated significantly as nearby aggregate mining pits were advanced, dewatered, and then filled with water and silt.

2.2. Environmental Conditions and Chemicals of Concern

The asphalt plant has been in operation since approximately 1980. Operations from 1980 to 1996 included two 10,000-gallon diesel fuel underground storage tanks (USTs) and one 2,000-gallon gasoline UST used to fuel company vehicles (Figure 2), all of which were removed in June 1996.

A fourth UST (10,000-gallon diesel; designated "D-4") was located in the southeastern portion of the Burdened Property and apparently was partially buried (Figure 2). UST D-4 reportedly was abandoned and removed and is not believed to have released significant quantities of petroleum hydrocarbons to the environment. A fifth UST (diesel, approximately 8,000 to 10,000 gallons) may have been located in the southern portion of the Burdened Property, approximately beneath the two existing 25,000-gallon asphalt cement aboveground storage tanks (ASTs). Per an unverified account of a former Site worker, this fifth UST was used for a few years before being abandoned in place (likely filled with concrete) during the 1970s, before the asphalt plant was built. No other USTs or ASTs are reported to have existed at the Burdened Property since approximately 1970. The chemicals of concern are those related to diesel and gasoline stored in the area shown in Figure 2. The existing 25,000-gallon ASTs contain asphalt cement and are not considered a potential source of the diesel-range organic compounds that have been detected in groundwater samples collected from the Burdened Property (Figure 2).

2.3. Investigations and Remedial Activities

Remedial actions were initiated at the Burdened Property when the two 10,000-gallon diesel fuel USTs and one 2,000-gallon gasoline UST were removed in June 1996 by Tank Protect Engineering (1997). Impacted soil and groundwater were found during the UST removal. The USTs were found to be in good condition with no holes evident, although a ¼-inch-diameter hole was observed in one of the fuel lines. Several



Soil and Groundwater Site Management Plan

Mission Valley Rock and Asphalt Plant
7999 Athenour Way, Sunol, California

subsurface investigations have been completed by past consultants from 1996 through the present in the vicinity of the asphalt plant (Tank Protect Engineering 1997).

Several investigations have been completed at the Burdened Property since 1996. The scope of these investigations included the analysis of soil and grab groundwater samples collected during the advancement of approximately 18 soil borings, and the installation and monitoring of 27 groundwater monitoring wells (currently there are 26 groundwater monitoring wells; former well MW-2 was abandoned in 2005).

Groundwater monitoring wells MW-1 through MW-8 were installed as single, double, or triple completion wells where one or more wells are completed in a single boring. Well clusters MW-9 through MW-12 were installed during April and May 2006 as groups of single completion wells with well screens at three different depths. Groundwater monitoring wells at the Burdened Property are designated based on their well screen depths as shallow ("S", screened approximately from 5 to 10 feet bgs), deep ("D", screened approximately between 15 and 25 feet bgs), and Livermore Formation ("LF", screened approximately from 35 to 40 feet bgs and believed to be approximately within the top 5 to 10 feet of the Livermore Formation). A summary of the construction details for each groundwater monitoring well installed, including latitudinal and longitudinal location of each well or well cluster, is included for ease of future identification of the areas of residual soil and groundwater impacts (Table 1).

The soil data collected in the vicinity of the asphalt plant indicate the presence of low concentrations (less than 1,400 milligrams per kilogram [mg/kg]) of petroleum-related constituents, specifically diesel-range total petroleum hydrocarbons (TPHd), near the former USTs (Figure 6 and Appendix A). Residual soil impacts are located in similar areas to residual groundwater impacts, as discussed below.

2.3.1. Remedial Action

Based on the results of previous investigations and groundwater monitoring conducted at the Burdened Property, ACEH concurred with LFR Inc. (LFR) in an April 27, 2007 letter that no additional characterization investigations are necessary for this Site. ACEH requested that a scope of work be submitted to implement pilot testing of the LFR proposed remedial alternative for affected groundwater in the vicinity of well cluster MW-9 (ACEH 2007a). LFR submitted a work plan on August 3, 2007 describing the scope of work to perform a pilot study to test the effectiveness of injecting air to enhance the natural biodegradation in the vicinity of well cluster MW-9 (LFR 2007b). The pilot test work plan was approved by ACEH on August 30, 2007 (ACEH 2007b), and LFR conducted the pilot test in January and February 2008.



Soil and Groundwater Site Management Plan

Mission Valley Rock and Asphalt Plant
7999 Athenour Way, Sunol, California

As described in the Air Sparge Pilot Test Completion Report (LFR 2008a), results of the pilot test indicated that effective delivery of oxygen into groundwater to approximately 45 feet bgs (into the "S", "D," and "LF" groundwater depth intervals) can be achieved using a conventional air injection approach. Increases in microbial populations, oxidation-reduction potential (ORP), and dissolved oxygen (DO) concentrations, and decreases in total petroleum hydrocarbons (TPH) and TPH-related compound concentrations observed during and/or after the pilot test indicated that oxygen injection created conditions that enhanced biodegradation in the source area.

Based on the successful results of the pilot test, LFR submitted a work plan on October 3, 2008 (LFR 2008b) proposing the adoption of air injection as the remedial approach in the vicinity of monitoring well MW-9 and adoption of a monitored natural attenuation (MNA) approach for the remainder of affected groundwater. MNA was proposed as an effective remedial approach because historical groundwater data indicated attenuation mechanisms were effective at stabilizing the migration of the affected groundwater and resulted in decreasing trends in the majority of the plume. These remedial approaches were approved by ACEH in a letter dated October 24, 2008 (ACEH 2008).

A full-scale air injection system was installed in March 2009. The air injection system consisted of an air compressor and associated piping to inject compressed air through a series of regulators, filters, valves, flow meters, hoses, and eventually through the screened intervals of injection wells OXY-1D and OXY-1LF. These two wells were constructed with wells screens located somewhat deeper than well screens for wells MW-9D and MW-9LF, respectively. The air injection system was started on April 6, 2009 and operated until July 15, 2010.

2.3.2 Groundwater Monitoring

As requested by ACEH, groundwater monitoring of select wells located in the vicinity of the air injection system was conducted on a quarterly basis to monitor the performance of the air injection system. Semi-annual groundwater monitoring of all Burdened Property wells was conducted until September 2010. The area extent of residual petroleum hydrocarbons in groundwater in September 2010 is shown on Figures 7 through 9.

Light non-aqueous phase liquid (LNAPL) was measured in groundwater monitoring wells MW-2, MW-2S, MW-2D, MW-3, MW-9D, and MW-11D (ARCADIS 2011; ARCADIS 2012; ARCADIS 2013). LNAPL thicknesses in those wells ranged from a non-measurable sheen (less than 0.01 foot) to approximately 4 feet (well MW-2 in January 1999). However, data collected through 2010 indicated LNAPL thicknesses



Soil and Groundwater Site Management Plan

Mission Valley Rock and Asphalt Plant
7999 Athenour Way, Sunol, California

decreased significantly over time, and an appreciable measurable amount of LNAPL had not been measured in any wells at the Burdened Property between 2002 and 2010 (ARCADIS 2011).

In response to comments provided by ACEH in a June 21, 2012 letter (and as part of the regulatory case closure process) a water level elevation survey was conducted at the Burdened Property in May 2012 (ARCADIS 2012). During that water level elevation survey, approximately 0.61-foot of LNAPL was measured in well MW-11D. In addition, during two previous water level measurement events on December 24, 2010 and September 27, 2010 a "petroleum hydrocarbon-like liquid," was observed on the water level probe; however, LNAPL thickness was not measured using an interface probe (ARCADIS 2011). As a result of the measurement of the LNAPL at well MW-11D, in a letter dated June 21, 2012 the ACEH requested an additional investigation to assess the vertical extent of the LNAPL and the properties of the LNAPL.

2.3.3 LNAPL Investigation

From December 2012 through January 2013, ARCADIS conducted a series of investigations to determine the characteristics of the LNAPL in MW-11D, including a bail down test to determine the transmissivity of the LNAPL, characterization of a sample of the LNAPL, and a cone penetrometer test/laser induced fluorescence (CPT/LIF) investigation to determine the vertical extent of the LNAPL in the vicinity of monitoring well MW-11D (ARCADIS 2013). The results of these activities suggested the nature of the LNAPL is a highly-weathered diesel with limited transmissivity (i.e., not mobile). Based on the high degree of microbial degradation identified within the LNAPL, it was concluded that the original release of LNAPL occurred in the distant past. The anticipated source of the LNAPL is the former USTs; there is no indication that there is an ongoing source of LNAPL at the Burdened Property. The mass of residual LNAPL remaining in the subsurface is expected to decrease with time and remain within the area it currently occupies; the residual LNAPL within the subsurface is likely immobile based on its age and the results of the bail down test. Therefore, it is not anticipated that the LNAPL will move laterally within the subsurface to impact other areas of the Burdened Property.

The results of the LIF investigation indicate the vertical extent of potentially petroleum-impacted soil within this area is approximately 18 feet thick. The screen interval of monitoring well MW-11D lies within this vertical interval; therefore, it is not anticipated that LNAPL within MW-11D will move vertically to impact a new area. The integrity of

monitoring well MW-11D remains intact so further migration of LNAPL through cracks or other imperfections in the well construction of MW-11D is not anticipated.

3 Summary of Human Health Risks

The following is a summary of the potential human health risks associated with the residual petroleum concentrations in the vadose zone soil, soil gas, and groundwater at the Burdened Property. There are several potential exposure pathways (LFR 2007a). These include ingestion, inhalation, or dermal contact with soil; inhalation of ambient air; and ingestion, inhalation, or dermal contact with groundwater. For a potential exposure pathway to be considered a complete exposure pathway there must be a source of chemical concentrations above thresholds for risk to human health, a media through which contamination moves, and a receptor that comes into contact with the media.

The former USTs and historical operations have resulted in residual concentrations of petroleum constituents in three media: soil, soil gas, and groundwater. Potential receptors include Site workers and Site visitors, including contractors. Based on current routine Site activities that do not involve subsurface excavation, there are no completed pathways for a Site worker or visitor in the area outlined in Figure 2 to contact with any of the media identified above. However, there is a potential for future exposure to residual contamination for human receptors involved in excavation or construction activities. Section 5 of this SMP identifies management protocols to minimize potential exposure.

3.3 Soil

Petroleum-affected vadose zone soil is generally located in the vicinity of the former USTs and asphalt plant (Figure 6). During historical investigation activities, petroleum-related constituents were detected in soil samples collected within the vadose zone (taken as the top 5 feet of soil) at concentrations ranging from 0.0043 mg/kg benzene at the soil boring associated with monitoring wells MW-5S and MW-5D to 1,400 mg/kg TPHd at soil boring TB-6. These values represent the highest concentrations of petroleum constituents detected within the top 5 feet of soil. Many of these detected values were above the applicable 2013 Tier 1 Environmental Screening Levels (ESLs) put forth by the San Francisco Bay Regional Water Quality Control Board (SFBRWQCB) for commercial land use soils that are less than 3 meters bgs in an area where the groundwater is considered a current or potential drinking water source.



Soil and Groundwater Site Management Plan

Mission Valley Rock and Asphalt Plant
7999 Athenour Way, Sunol, California

Potential exposure pathways for Site workers and Site visitors or contractors to shallow soil contamination include ingestion, inhalation, or dermal contact of affected media. Based on routine Site operations and the institutional controls described in Section 4 below, these potential exposure pathways are not anticipated to be completed. Section 4 and Section 5 of this SMP detail the actions to be taken to prevent human exposure to petroleum-related constituents in soil while performing routine and infrequent subsurface activities at the Burdened Property.

3.4 Soil Gas

Based on the analytical results for soil gas samples collected between February 2008 and December 2010 (LFR 2010), historical concentrations of petroleum constituents in soil gas ranged from 6 micrograms per cubic meter ($\mu\text{g}/\text{m}^3$) of toluene in SG-3 to 550,000 $\mu\text{g}/\text{m}^3$ of gasoline-range total petroleum hydrocarbons (TPHg) in samples collected from soil gas point SG-4. These concentrations were detected during the air injection pilot study, as well as during operation of the full air injection system. There were no soil gas concentrations detected above the applicable 2013 Tier 1 ESLs to screen for vapor intrusion concerns for commercial/industrial land use (Table 2). The protocols detailed in Section 4 and Section 5 for management of affected soil are also designed to detect and eliminate human exposure to petroleum-related constituents in soil gas while performing routine and infrequent subsurface activities at the Burdened Property.

3.5 Groundwater

Petroleum-affected groundwater is generally located in the vicinity of the former USTs (Figures 7 through 9). The horizontal extent of groundwater impacts varies with vertical depth, with the largest extent within the deeper aquifer zone and the smallest extent within the Livermore Formation. TPHg detected in groundwater samples collected in September 2010 ranged from 50 micrograms per liter ($\mu\text{g}/\text{L}$) at monitoring well MW-2D to 13,000 $\mu\text{g}/\text{L}$ at monitoring well MW-7D (see Figure 8). Similarly, TPHd detected in groundwater samples collected in the most recent groundwater sampling event (September 2010) ranged from 51 $\mu\text{g}/\text{L}$ at monitoring well MW-5D to 47,000 $\mu\text{g}/\text{L}$ at monitoring well MW-11D (see Figure 8). Lastly, methyl-tert-butyl ether (MTBE) detected in groundwater samples collected in September 2010 ranged from 0.61 $\mu\text{g}/\text{L}$ at monitoring well MW-12LF to 110 $\mu\text{g}/\text{L}$ at monitoring well MW-11LF. Many of these groundwater concentrations of TPHg, TPHd, and MTBE were detected above the applicable Tier 1 ESLs for groundwater that is a current or potential drinking water



Soil and Groundwater Site Management Plan

Mission Valley Rock and Asphalt Plant
7999 Athenour Way, Sunol, California

source. These ESLs for TPHg, TPHd, and MTBE are 100 µg/L, 100 µg/L, and 5 µg/L, respectively.

Potential exposure pathways for Site workers and Site visitors or contractors include ingestion, inhalation, or dermal contact of the affected groundwater. Based on the current land use, routine Site operations, current water supply sources, and the institutional controls described below, these potential exposure pathways are not considered complete. Section 4 and Section 5 of this SMP detail the actions to be taken to eliminate human exposure to petroleum-related constituents in groundwater when performing routine and infrequent subsurface activities. The extent of impacted groundwater has been demonstrated to be stable in size and is anticipated to remain within the area identified in Figure 2.

4 Summary of Institutional Controls

Institutional controls include administrative and legal controls to limit human contact with residual contamination in soil and groundwater remaining within the Burdened Property identified on Figure 2. A Covenant and Environmental Restriction on Property (Covenant) has been recorded for the Burdened Property which is identified on Figure 2. The Covenant and this SMP limit the land use within the area identified in Figure 2 to industrial, commercial, or office space. However, notification and approval by ACEH is required prior to excavation or subsurface disturbance during construction. Agricultural use of the land to grow any type of food for human consumption is not allowed. However, use of the land for cattle grazing, or other livestock grazing, is permitted. This is due to the limited root depth necessary for grass growth and the associated limited human interaction with the impacted soils. No residence or human habitation, hospital, school for persons under 21 years of age, day care centers for children or seniors, or gardening will be permitted under the Covenant.

The Covenant and this SMP also restrict the use of groundwater at the Burdened Property. No water supply wells are to be installed within the Burdened Property unless approved in writing by ACEH. Furthermore, water wells are not to be installed within 1,000 feet in any direction from the area outlined as the Burdened Property on Figure 2. Water supply wells may be installed at the Mission Valley Rock facility at a distance of more than 1,000 feet from the Burdened Property without prior approval of ACEH.

Additionally, activities that cause a disturbance to soil or groundwater within the Burdened Property are not to be conducted without the approval of ACEH and are to be performed in accordance with the requirements set forth in this SMP.



Soil and Groundwater Site Management Plan

Mission Valley Rock and Asphalt Plant
7999 Athenour Way, Sunol, California

5 Soil and Groundwater Site Management Plan

The following specifies the general procedures for notifications and approvals, health and safety requirements, and handling, moving, storing, and reusing or disposing of soil and groundwater that may be encountered during routine or infrequent subsurface activities conducted at the Burdened Property.. Activities that may cause soil or groundwater disturbance at the Burdened Property include, but are not limited to, the following:

- grading,
- removing/installing underground utilities and utility pipeline repair activities,
- installing foundations,
- mining operations,
- and performing other construction activities.

5.3 Notification and Approval Requirements

Prior to the commencement of subsurface activities listed above that are proposed to take place within the area illustrated on Figure 2, a work plan detailing the scope of the activities and compliance with this SMP will be prepared and submitted to the ACEH for review and approval. After approval is obtained from ACEH the subsurface activities at the Burdened Property may be initiated.

5.4 Health and Safety Requirements

Subsurface activities that may involve contact with impacted soil or groundwater at the Burdened Property within the area illustrated on Figure 2 are subject to the provisions specified in this SMP. Personnel at the Burdened Property who handle, or have the potential to come in contact with, potentially contaminated soil or groundwater shall have the appropriate health and safety training and wear the appropriate personal protective equipment.

Subsurface activities conducted at the Burdened Property within the area illustrated on Figure 2 must be in compliance with applicable rules and regulations governed by the California Division of Occupational Safety and Health (Cal/OSHA), even if not

expressly noted in this SMP. A project-specific health and safety plan shall be prepared prior to initiating subsurface construction work at the Burdened Property.

5.5 Groundwater Use Controls

Residual concentrations of petroleum-related compounds remain within the groundwater at the Burdened Property. As shown on Figures 7 through 9, remaining concentrations are present at various magnitudes at different depths. During current standard operations, Site workers or contractors are not expected to encounter impacted groundwater. Current water usage at the facility is primarily for dust control and aggregate washing. The water is comprised primarily of recycled wash water and collected storm water run-off. As needed, the recycled water system is supplemented with water pumped from containment ponds approximately 2,200 feet north of the area outlined in Figure 2.

Water supply wells are not to be installed within the Burdened Property unless approved in writing by ACEH. Water supply wells for industrial/mining uses may be installed outside the Burdened Property at the MVR facility provided they meet the following conditions:

- The water supply well will be located a minimum of approximately 1,000 feet away (in all directions) from the perimeter of the Burdened Property illustrated on Figure 2.
- The minimum depth of the seal of an industrial water supply well must be located 50 feet bgs per the guidance from the Department of Water Resources California Well Standards.

5.6 Potential Future Mining Development

Per the nature of mining operations at the facility, there is the potential to mine the Burdened Property illustrated on Figure 2 in the future. Prior to initiating mining activities, a plan describing the scope of activities and compliance with the SMP is to be submitted to ACEH for review and approval.

5.7 Soil and Groundwater Management During Subsurface Activities

Subsurface activities that may occur within the Burdened Property identified in Figure 2 include soil or groundwater removal as part of potential future mining operations, and infrequent subsurface intrusions, such as accessing underground utilities. The soil and



Soil and Groundwater Site Management Plan

Mission Valley Rock and Asphalt Plant
7999 Athenour Way, Sunol, California

groundwater management protocols detailed in this section will be followed during these types of subsurface activities. The protocols described herein may be modified as appropriate if additional site characterization is performed prior to initiation of potential future mining operations or subsurface intrusions. The SMP applies to the Burdened Property but does not apply to mining activities conducted elsewhere on the MVR facility.

5.7.2 Soil Management Procedures

Within the Burdened Property shown on Figure 2, excavated soil will be inspected for visual/olfactory evidence of impacts. If potentially-impacted soil (e.g., soil exhibiting discoloration, oily liquids, a petroleum odor, or other signs of contamination from petroleum fuels) is observed, the following actions shall be taken:

- Stockpile potentially-impacted soil separately on polyethylene sheeting and in accordance with this SMP;
- Screen the stockpiled potentially-impacted soil with a photoionization detector (PID), if appropriate;
- Characterize the stockpiled soils as specified below, and appropriately dispose of stockpiled soil at an appropriately licensed facility or suitable end use (e.g., reuse on a portion of the facility); and,
- Document and report the discovery of the apparently impacted soil as required to the appropriate jurisdictional agency.

Potentially-impacted soil generated from excavation activities will be stockpiled on-site. The stockpiles will be placed on, and covered with, polyethylene sheeting to provide separation and to prevent off-site soil migration due to wind and water erosion. In addition, a berm made of hay bales or another accepted material will be placed around each stockpile to limit potential runoff from the stockpile.

Dust control measures will be used during excavation activities such that no visible dust migration is observed. Typically, misting with water can be used to control dust emissions. Mitigation procedures to prevent wind erosion of an active stockpile will include applying sufficient water, or other accepted material, to keep the soil slightly damp, but not so much water to create runoff from oversaturation. Stockpiles will not be piled excessively high to further prevent airborne transport of stockpiled material.



Soil and Groundwater Site Management Plan

Mission Valley Rock and Asphalt Plant
7999 Athenour Way, Sunol, California

Should odor issues be identified by Site workers or contractors during subsurface activities, personnel shall have appropriate health and safety training, wear the appropriate personal protective equipment, and field instruments shall be used to screen for the presence of VOCs within the breathing zone as appropriate. Should the detected concentrations of specific VOCs identified as part of a health and safety plan exceed the identified action levels, subsurface activities will be stopped and the mitigation measures identified within the health and safety plan will be performed.

Soils will be adequately sampled and characterized/profiled per the disposal facility requirements in the event that off-site disposal is selected as the method of final disposition of the soils. Soils identified for transportation and off-site disposal should be profiled, either in-place or from the stockpile.

5.7.3 Groundwater Management Procedures

If groundwater is encountered during subsurface activities, or if dewatering is necessary, the following procedures should be followed. Field instruments shall be used to screen for the presence of volatile organic compounds (VOCs) within the breathing zone of Site workers and contractors. Groundwater produced during dewatering activities may be treated to remove sediment and/or dissolved fuel hydrocarbons and related constituents and discharged to a sanitary sewer in accordance with applicable permits from the appropriate regulatory agencies. Alternatively, groundwater may be collected, removed from the Burdened Property, and disposed of appropriately. Both potential means of disposal may require collection and analysis of the groundwater for petroleum-related constituents to ensure compliance with the applicable permits. Groundwater shall not be used for dust control, either during routine operations or infrequent activities, unless groundwater analyses indicate concentrations of petroleum-related constituents are below analytical laboratory reporting limits.

5.8 Contingency Plan

This section describes the protocols to be followed in the event that unknown areas of affected soil, groundwater and/or underground structures are identified at the facility. These protocols will be followed by all involved parties, including Hanson and other entities, such as a contractor or qualified consultant, designated or certified by Hanson.

Unknown conditions (e.g., suspected affected soil) that may trigger contingency monitoring procedures during Site activities include, but are not limited to, those listed



Soil and Groundwater Site Management Plan

Mission Valley Rock and Asphalt Plant
7999 Athenour Way, Sunol, California

below. Discovery of any of these conditions could require either alternative or additional measures to protect human health and the environment:

- Oily, shiny, or saturated soil or free product;
- Soil with a strong chemical odor;
- Discovery of objects of environmental concern such as USTs and associated piping or buried drums;
- Discovery of potentially-hazardous debris (e.g., automobile tires, asbestos-containing pipes, and transite pipes);
- Discovery of hazardous storage areas; and
- Other conditions that vary materially from those documented during previous investigations.

If suspected affected soil is detected during subsurface activities, the following procedures shall be followed:

- All field activities that may potentially disturb the suspected affected soil must be immediately stopped and the area around the suspected affect soil vacated.
- If an emergency situation arises such that emergency services are needed, call 911 and follow the emergency procedures given in the health and safety plan, including notification of the appropriate Hanson employees.
- Any equipment and clothing that comes in contact with the suspected or known affected soil must be decontaminated as specified in the health and safety plan.
- If stockpiling is necessary, stockpiles will be placed on polyethylene sheeting and covered at the end of each work day.

During the subsurface activities conducted at the Burdened Property, it is possible that USTs, sumps, or other underground structures that were not identified during previous investigations will be discovered. For example, a UST may be unearthed during grading and site excavation. Other subsurface structures might not have features that



Soil and Groundwater Site Management Plan

Mission Valley Rock and Asphalt Plant
7999 Athenour Way, Sunol, California

extend above the excavated surface and could be unearthed when construction equipment comes into contact with them. The remainder of this section outlines the measures that govern identification and removal of USTs, and appropriate measures for addressing other underground structures encountered during development.

Chapter 6.7 of the California Health and Safety Code contains the specific requirements for removing and remediating affected soil associated with a leaking UST (LUST). The county within which the UST is encountered is responsible for local oversight and oversees the removal of USTs. Environmental investigations and responses required following removal of the UST will be conducted under the direction of the ACEH and in accordance with the specific provisions delineated in Chapter 6.7 of the California Health and Safety Code. Additionally, the Alameda County Fire Department will be notified in the event that a LUST or appurtenant piping is discovered at the Burdened Property.

For other subsurface structures that may have been related to former use and storage of chemicals, such as underground vaults and sumps, the following procedures will be implemented to determine the proper disposition of the encountered structure.

The structure will be inspected to assess whether it contains any indication of chemical residuals or free liquids, other than water. A qualified individual will make this assessment in the field using visual or olfactory evidence, or field monitoring equipment (e.g., PID). If there is no indication, based on visual observation, odor, or field air monitoring equipment, of chemical impact within the vault or sump, then removal of the structure is not necessary for environmental reasons, but may be prudent for other reasons.

If a sump or vault contains liquids that appear to contain chemicals, based on visual observations, odor, or field air monitoring equipment, then the following steps shall be taken:

- The potentially chemical-containing liquids will be sampled and analyzed for profiling purposes.
- The chemical will be characterized and the appropriate response action will be determined. If appropriate, the liquids will be properly removed and disposed.
- A report will be prepared documenting response activities for submittal to the Alameda County Fire Department and ACEH.



Soil and Groundwater Site Management Plan

Mission Valley Rock and Asphalt Plant
7999 Athenour Way, Sunol, California

If LNAPL is encountered, the horizontal and vertical extent will be assessed, the chemical characterized, and the soil managed in a manner approved by ACEH.

5.9 Record Keeping, Inspections, and Reporting

Record keeping and inspection procedures to monitor compliance with this SMP shall be the responsibility of the party performing the work (i.e., Hanson or contractors). During intrusive subsurface work in the area identified in Figure 2 in which there is potential exposure to contaminated soil, soil vapor and/or groundwater, a daily log will be maintained to provide detailed documentation of work activities until potential contamination is removed or contained.

Additionally, Hanson will perform an annual inspection of the Burdened Property to ensure compliance with this SMP. The items to be inspected will be developed by Hanson as part of their existing inspection processes. The results of the annual inspection will be communicated via letter to the ACEH. At this time, any upcoming plans for land use or operational changes that may initiate the protocols set forth herein will also be communicated to the ACEH.

5.10 Soil and Groundwater Site Management Plan Availability

The location of affected soil and groundwater remaining at the Burdened Property will be communicated to Site workers and contractors through this SMP. The existence of this SMP will be documented as part of a Covenant to be recorded with the deed for the property. Additionally, this SMP will be provided to the current property owner for distribution to Site workers or contractors performing intrusive subsurface work.



Soil and Groundwater Site Management Plan

Mission Valley Rock and Asphalt Plant
7999 Athenour Way, Sunol, California

6 References

- ARCADIS-U.S., Inc. (ARCADIS). 2011. Fourth Quarter 2010 Air Injection System and Groundwater Monitoring Report. March 18.
- ARCADIS. 2012. Response to Alameda County Environmental Health Public Comments for Fuel Leak Case No. RO0000207 and GeoTracker Global ID T0600102092, Mission Valley Rock and Asphalt, 7999 Athenour Way, Sunol, CA 94586. June 1.
- ARCADIS. 2013. Investigation to Assess Non-Aqueous Phase Liquid at the Mission Valley Rock and Asphalt Plant Located at 7999 Athenour Way in Sunol, California. February 1.
- Alameda County Environmental Health (ACEH). 2007a. Letter to Lee Cover of Hanson Aggregates West Region from Jerry Wickham, re: Fuel Leak Case No. RO0000207 and GeoTracker Global ID T0600102092, Mission Valley Rock and Asphalt, 7999 Athenour Way, Sunol, CA 94586. April 27.
- ACEH. 2007b. Letter to Lee Cover of Hanson Aggregates West Region from Jerry Wickham, re: Fuel Leak Case No. RO0000207 and GeoTracker Global ID T0600102092, Mission Valley Rock and Asphalt, 7999 Athenour Way, Sunol, CA 94586. August 30.
- ACEH. 2008. Letter to Lee Cover of Hanson Aggregates West Region from Jerry Wickham, re: Fuel Leak Case No. RO0000207 and GeoTracker Global ID T0600102092, Mission Valley Rock and Asphalt, 7999 Athenour Way, Sunol, CA 94586. October 24.
- ACEH, 2012. Letter to Lee Cover of Hanson Aggregates from Jerry Wickham, re: Case File Review for Fuel Leak Case No. RO0000207 and GeoTracker Global ID T0600102092, Mission Valley Rock and Asphalt, 7999 Athenour Way, Sunol, CA 94586. June 21.
- ACEH, 2013. Letter to Gregory Knapp of Lehigh Hanson from Jerry Wickham, re: Case File Review for Fuel Leak Case No. RO0000207 and GeoTracker Global ID T0600102092, Mission Valley Rock and Asphalt, 7999 Athenour Way, Sunol, CA 94586. March 13.



Soil and Groundwater Site Management Plan

Mission Valley Rock and Asphalt Plant
7999 Athenour Way, Sunol, California

Department of Toxic Substances Control. 2001. Information Advisory: Clean Imported Fill Material. October.

LFR Inc. (LFR). 2007a. Site Assessment Report of Additional Lateral and Vertical Characterization and Plan for Interim Remediation at the Asphalt Plant, Hanson Aggregates Mission Valley Rock Facility. April 10.

LFR. 2007b. Work Plan to Conduct a Groundwater Remediation Pilot Test at the Asphalt Plant and Additional Subsurface Characterization in the Former Diesel Spray Area, Hanson Aggregates Mission Valley Rock Facility. August 3.

LFR. 2008a. Air Sparge Pilot Test Completion Report, Hanson Aggregates Mission Valley Rock Facility, 7999 Athenour Way, Sunol, Alameda County, California. March 28.

LFR. 2008b. Work Plan to Conduct Air Injection and Implement Monitored Natural Attenuation, Hanson Aggregates Mission Valley Rock Facility, 7999 Athenour Way, Sunol, Alameda County, California. October 3.

LFR Inc. and ARCADIS Company. 2010. Fourth Quarter Air Injection System and Groundwater Monitoring Report, Hanson Aggregates Mission Valley Rock Facility, 7999 Athenour Way, Sunol, Alameda County, California. February 12.

Tank Protect Engineering of Northern California Inc., May 13, 1997, Preliminary Site Assessment Report, Mission Valley Rock Company, 7999 Athenour Way, Sunol, California 94586.



Tables

Table 1
Groundwater Monitoring Well Details
Hanson Aggregates
7999 Athenour Way, Sunol, California

WELL ID #	NORTHING (FT.) / LATITUDE (D.MS)	EASTING (FT.) / LONGITUDE (D.MS)	ELEVATION (FT.)	DESCRIPTION
MW-1	2033631.2	6162569.3	258.68	PVC
	37.5718715	-121.8771414	259.03	Box
MW-2S	2033560.2	6162561.6	258.84	PVC
	37.5716762	-121.8771643	259.09	Box
MW-2M	2033560.2	6162561.6	258.99	PVC
	37.5716762	-121.8771643	259.09	Box
MW-2D	2033560.2	6162561.6	258.91	PVC
	37.5716762	-121.8771643	259.09	Box
MW-3	2033545.9	6162615.1	259.08	PVC
	37.5716392	-121.8769792	259.64	Box
MW-4S	2033585.5	6162653.7	259.14	PVC
	37.5717493	-121.8768479	259.57	Box
MW-4D	2033585.5	6162653.7	259.22	PVC
	37.5717493	-121.8768479	259.57	Box
MW-5S	2033577.7	6162610.5	259.43	PVC
	37.5717264	-121.8769967	259.78	Box
MW-5D	2033577.7	6162610.5	259.40	PVC
	37.5717264	-121.8769967	259.78	Box
MW-6S	2033559.6	6162581.5	258.75	PVC
	37.5716753	-121.8770956	259.62	Box
MW-6D	2033559.6	6162581.5	259.27	PVC
	37.5716753	-121.8770956	259.62	Box
MW-7S	2033611.9	6162537.7	258.82	PVC
	37.5718173	-121.8772494	259.09	Box
MW-7D	2033611.9	6162537.7	258.07	PVC
	37.5718173	-121.8772494	259.09	Box
MW-8	2033607.6	6162516.9	258.84	PVC
	37.5718047	-121.8773211	259.40	Box
MW-9S	2033664.2	6162537.6	258.41	TOP 2" PVC N. SIDE
	37.341905897	-121.523810911	259.12	LID
			258.82	GROUND
MW-9D	2033657.0	6162535.6	258.86	TOP 2" PVC N. SIDE
	37.341898750	-121.523813263	259.21	LID
			258.92	GROUND
MW-9LF	2033650.0	6162534.0	258.94	TOP 2" PVC N. SIDE
	37.341891807	-121.523815123	259.20	LID
			258.94	GROUND
MW-10S	2033614.1	6162622.3	260.67	TOP 2" PVC N. SIDE
	37.341857601	-121.523704793	261.01	LID

Table 1
Groundwater Monitoring Well Details
Hanson Aggregates
7999 Athenour Way, Sunol, California

WELL ID #	NORTHING (FT.) / LATITUDE (D.MS)	EASTING (FT.) / LONGITUDE (D.MS)	ELEVATION (FT.)	DESCRIPTION
			260.63	GROUND
MW-10D	2033619.6	6162621.8	260.64	TOP 2" PVC N. SIDE
	37.341863031	-121.523705515	261.34	LID
			261.08	GROUND
MW-10LF	2033615.6	6162638.9	260.58	TOP 2" PVC N. SIDE
	37.341859325	-121.523684203	261.02	LID
			259.59	GROUND
MW-11S	2033488.3	6162571.1	258.96	TOP 2" PVC N. SIDE
	37.341732489	-121.523766087	259.33	LID
			258.87	GROUND
MW-11D	2033493.5	6162569.1	258.98	TOP 2" PVC N. SIDE
	37.341737601	-121.523768666	259.27	LID
			258.93	GROUND
MW-11LF	2033488.0	6162566.0	259.01	TOP 2" PVC N. SIDE
	37.341732119	-121.523772416	259.32	LID
			258.97	GROUND
MW-12S	2033494.7	6162438.2	262.69	TOP 2" PVC N. SIDE
	37.341736883	-121.523931272	263.17	LID
			262.93	GROUND
MW-12D	2033498.8	6162439.1	262.70	TOP 2" PVC N. SIDE
	37.341740949	-121.523930229	262.23	LID
			262.86	GROUND
MW-12LF	2033504.3	6162441.4	262.90	TOP 2" PVC N. SIDE
	37.341746420	-121.523927472	263.17	LID
			262.82	GROUND

BENCH MARK: MW-6(D) TOP PVC

MORROW SURVEYING PLATE DATED 2-8-05

Elevation =259.27 FEET NAVD88 Datum

HORIZONTAL CONTROL: MW2 AND MW 4 COORDINATES PER LFR

MW-2

NORTHING =2,033,560.2 , EASTING = 6,162,561.6 FEET; EPOCH DATE = 2000.35

MW-4

NORTHING =2,033,585.5 , EASTING = 6,162,653.7 FEET; EPOCH DATE = 2000.35

Coordinate values are based on the California Coordinate System, Zone III NAD 83 Datum.

Table 2
Historical Soil Gas Analytical Data
Hanson Aggregates
7999 Athenour Way, Sunol, California

Soil-Gas Probe ID	SG-1		SG-2		SG-3		SG-4				Tier 1 ESL
	Date Sampled	12/18/09	12/18/09	12/18/09	2/19/08	2/18/08	2/19/08	2/18/08	2/19/08	2/18/08	
Sample Collection Timing	2 - 4 Hours After Turning Off Air Injection	2 - 4 Hours After Turning Off Air Injection	2 - 4 Hours After Turning Off Air Injection	2 - 4 Hours After Turning Off Air Injection	One Day After Test Air Injection Ceased	During Continuous Air Injection Test	One Day After Test Air Injection Ceased	During Continuous Air Injection Test	One Day After Test Air Injection Ceased	During Continuous Air Injection Test	2 - 4 Hours After Turning Off Air Injection
Sample Volume (ml)	1,037	943	943	943	2,003	2,015	2,003	2,000	2,003	2,000	962
Units	ng	µg/m ³	ng	µg/m ³	ng	µg/m ³	ng	µg/m ³	ng	µg/m ³	ng
TPHd	<1,000	<1,000	<1,000	<1,000	<1,000	<1,000	<1,000	<1,000	<1,000	<1,000	<1,000
TPHg	<1,000	<1,000	<1,000	<1,000	500 J	74,000	1,000 J	1,100,000	1,400	550,000	77,000
Benzene	<10	<10	<10	<10	<2.5	<2.5	<5.0	41	<2.5	21	11
Toluene	<5.0	<5.0	<5.0	<5.0	2.9	6	5.8	12	69	65	<5.0
Ethylbenzene	<5.0	<5.0	<5.0	<5.0	<2.5	21	<5.0	21	<5.0	140	<5.0
m, p-Xylene	<10	<10	<10	<10	<5.0	13	<10	26	<10	35	<10
o-Xylene	<5.0	<5.0	<5.0	<5.0	<2.5	<2.5	<5.0	<2.5	<5.0	11	<5.0
Naphthalene	<5.0	<5.0	<5.0	<5.0	<2.5	<2.5	<5.0	<2.5	<5.0	<2.5	<5.0
MTBE	<50	<50	<50	<50	<25	<25	<50	<50	<25	<25	<50

Notes:
 " < " = analyte not detected at or above the noted laboratory reporting limit
 ml = milliliters
 ng = micrograms
 µg/m³ = micrograms per cubic meter
 J = estimated value
 TPHg = total petroleum hydrocarbons as gasoline
 TPHd = total petroleum hydrocarbons as diesel
 MTBE = methyl tertiary-butyl ether
 E = Exceeds instrument calibration range
 Bolded values are above the 2013 Tier 1 ESL
 Tier 1 ESL = Commercial/Industrial 2013 Tier 1 Environmental Screening Levels (ESLs) put forth by the San Francisco Bay Regional Water Quality Control Board




Figures



HANSON AGGREGATES, 7999 ATHENOUR WAY,
SUNOL, CALIFORNIA


SITE LOCATION MAP

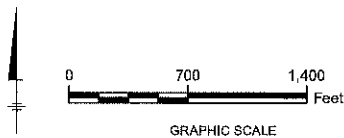


 **ARCADIS**

FIGURE
1

XREFS IMAGES PROJECTNAME
 Google Earth Image August 2012.jpg

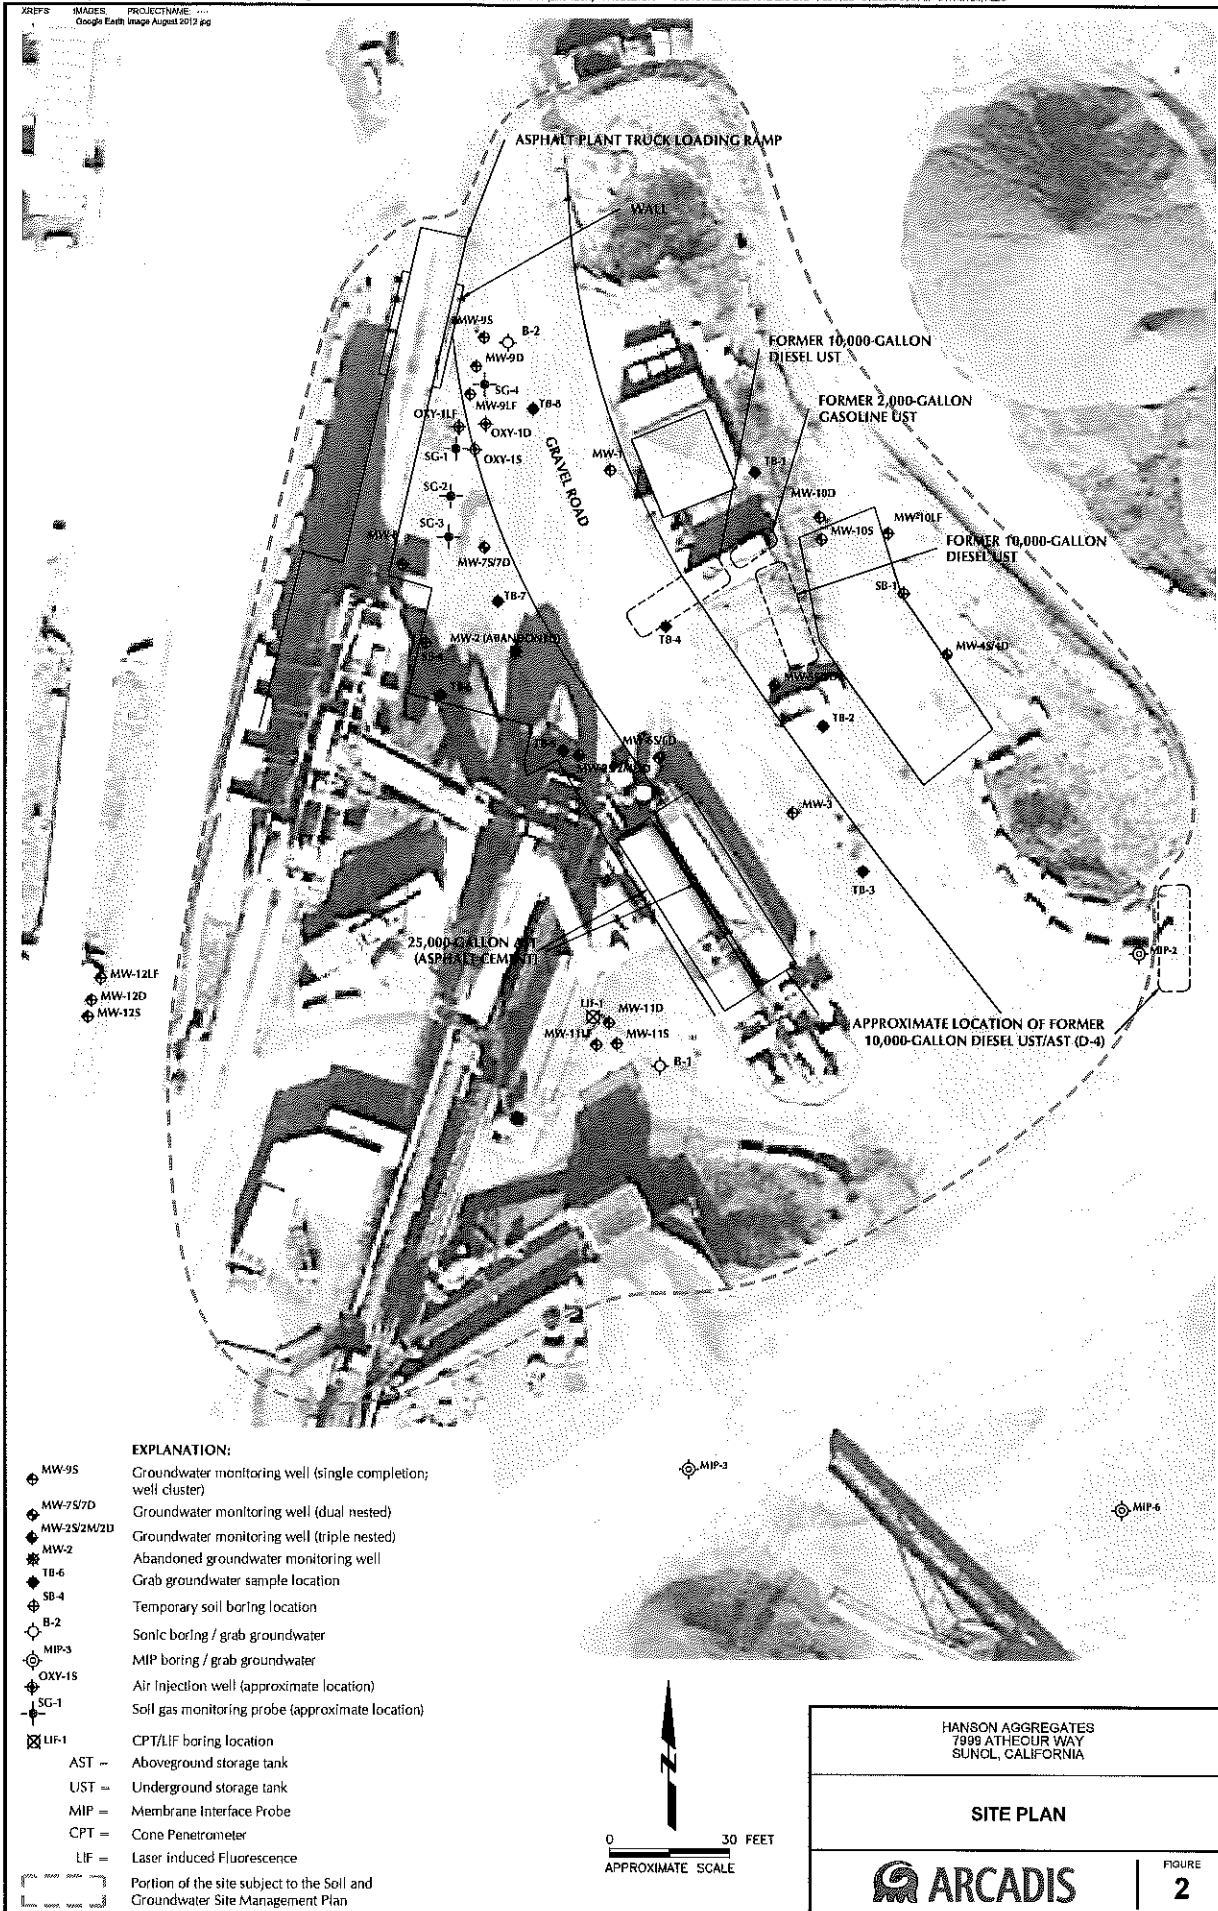

- EXPLANATION:**
- MW-9S Groundwater monitoring well (single completion; well cluster)
 - ◆ MW-7S/7D Groundwater monitoring well (dual nested)
 - ◆ MW-2S/2M/2D Groundwater monitoring well (triple nested)
 - ◆ MW-2 Abandoned groundwater monitoring well
 - ◆ TB-6 Grab groundwater sample location
 - ◆ SB-4 Temporary soil boring location
 - ◆ B-2 Sonic boring / grab groundwater
 - ◆ MIP-3 MIP boring / grab groundwater
 - ◆ OXY-15 Air Injection well (approximate location)
 - ◆ SG-1 Soil gas monitoring probe (approximate location)
 - ⊗ LIF-1 CPT/LIF boring location
 - AST = Aboveground storage tank
 - UST = Underground storage tank
 - MIP = Membrane Interface Probe
 - CPT = Cone Penetrometer
 - LIF = Laser induced Fluorescence
 - ⌈ ⌋ Portion of the site subject to the Soil and Groundwater Site Management Plan

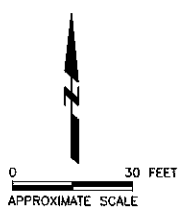

HANSON AGGREGATES
 7999 ATHEOUR WAY
 SUNOL, CALIFORNIA


SITE PLAN

PROJECT NAME: _____
 Google Earth Image August 2012.jpg




- EXPLANATION:**
- ◆ MW-95 Groundwater monitoring well (single completion; well cluster)
 - ◆ MW-757D Groundwater monitoring well (dual nested)
 - ◆ MW-252/M/2D Groundwater monitoring well (triple nested)
 - ◆ MW-2 Abandoned groundwater monitoring well
 - ◆ TB-6 Grab groundwater sample location
 - ◆ SB-4 Temporary soil boring location
 - ◆ B-2 Sonic boring / grab groundwater
 - ◆ MIP-3 MIP boring / grab groundwater
 - ◆ OXY-15 Air injection well (approximate location)
 - ◆ SG-1 Soil gas monitoring probe (approximate location)
 - ⊗ LIF-1 CPT/LIF boring location
- AST – Aboveground storage tank
 UST – Underground storage tank
 MIP – Membrane Interface Probe
 CPT – Cone Penetrometer
 LIF – Laser induced Fluorescence
- (970 TPHg) MAXIMUM CONCENTRATION OF THE COMPOUND INDICATED WITHIN THE VADOSE ZONE VADOSE ZONE TAKEN AS THE TOP 5 FEET OF SOIL BASED ON A RANGE OF GROUNDWATER DEPTHS OF 2 TO 6 FEET BELOW GROUND SURFACE
- TPHg TOTAL PETROLEUM HYDROCARBONS AS GASOLINE
 TPHd TOTAL PETROLEUM HYDROCARBONS AS DIESEL
 ND NOT DETECTED ABOVE THE APPLICABLE LABORATORY REPORTING LIMIT
 CLEAN NO POSITIVE IDENTIFICATION OF PETROLEUM COMPOUNDS
 LNAPL OBSERVED PRESENCE OF LIGHT NON-AQUEOUS PHASE LIQUID

SOIL INVESTIGATION RESULTS OBTAINED FROM:
 TAIT ENVIRONMENTAL MANAGEMENT, INC. 2006, SUMMARY REPORT: ENVIRONMENTAL ACTIVITIES, MISSION VALLEY ROCK COMPANY, 7999 ATHENOUR WAY, SUNOL, CALIFORNIA, MAY 16.

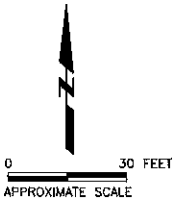

HANSON AGGREGATES
 7999 ATHEOUR WAY
 SUNOL, CALIFORNIA


VADOSE ZONE SOIL ANALYTICAL RESULTS

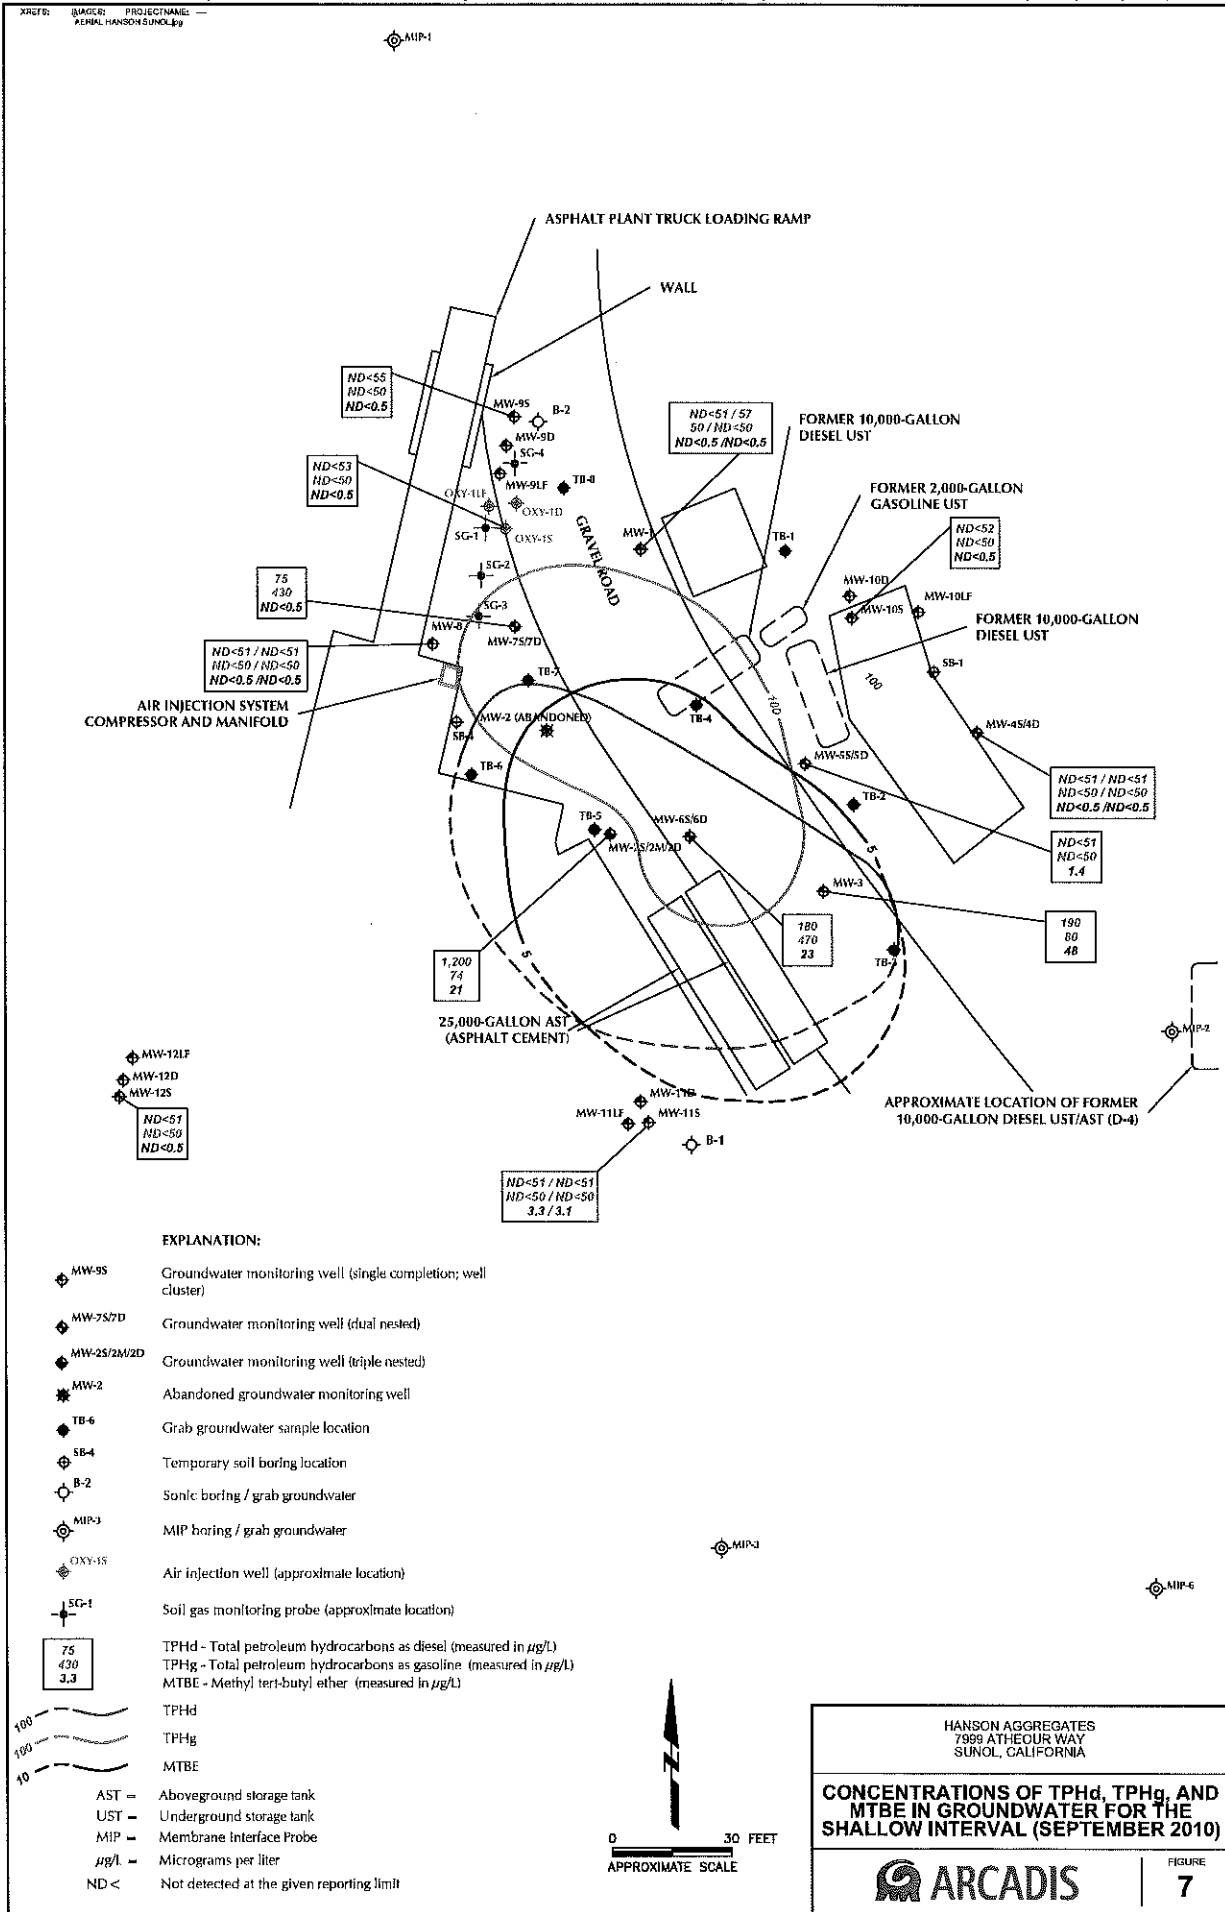

EXPLANATION:

- MW-95 Groundwater monitoring well (single completion; well cluster)
- MW-7S7D Groundwater monitoring well (dual nested)
- MW-2S2M2D Groundwater monitoring well (triple nested)
- MW-2 Abandoned groundwater monitoring well
- TB-6 Grab groundwater sample location
- SB-4 Temporary soil boring location
- B-2 Sonic boring / grab groundwater
- MIP-3 MIP boring / grab groundwater
- OXY-15 Air injection well (approximate location)
- SG-1 Soil gas monitoring probe (approximate location)

TPHd - Total petroleum hydrocarbons as diesel (measured in µg/L)
 TPHg - Total petroleum hydrocarbons as gasoline (measured in µg/L)
 MTBE - Methyl tert-butyl ether (measured in µg/L)





- AST = Aboveground storage tank
- UST = Underground storage tank
- MIP = Membrane Interface Probe
- µg/L = Micrograms per liter
- ND < = Not detected at the given reporting limit

HANSON AGGREGATES
7999 ATHEUR WAY
SUNOL, CALIFORNIA

CONCENTRATIONS OF TPHd, TPHg, AND MTBE IN GROUNDWATER FOR THE SHALLOW INTERVAL (SEPTEMBER 2010)

FIGURE
7

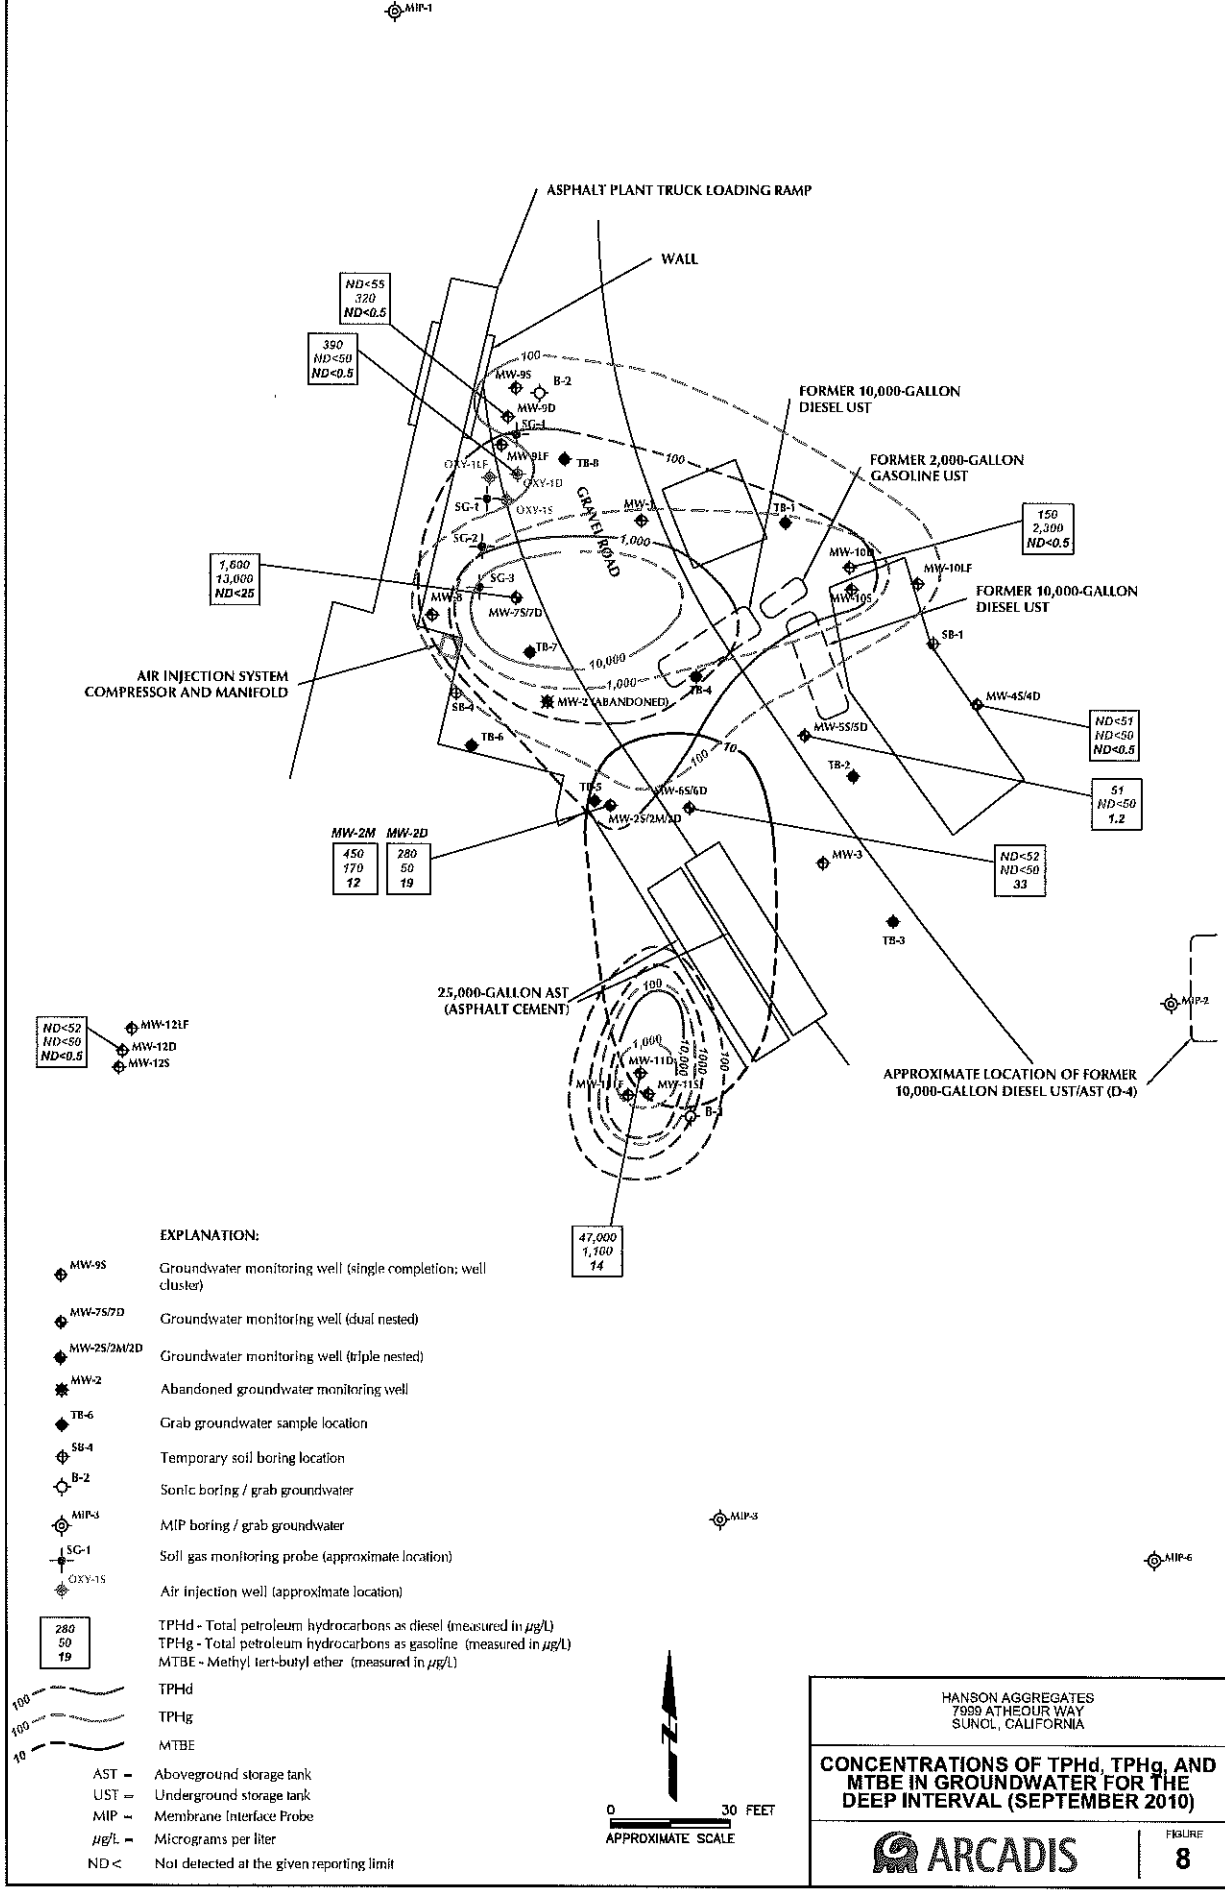

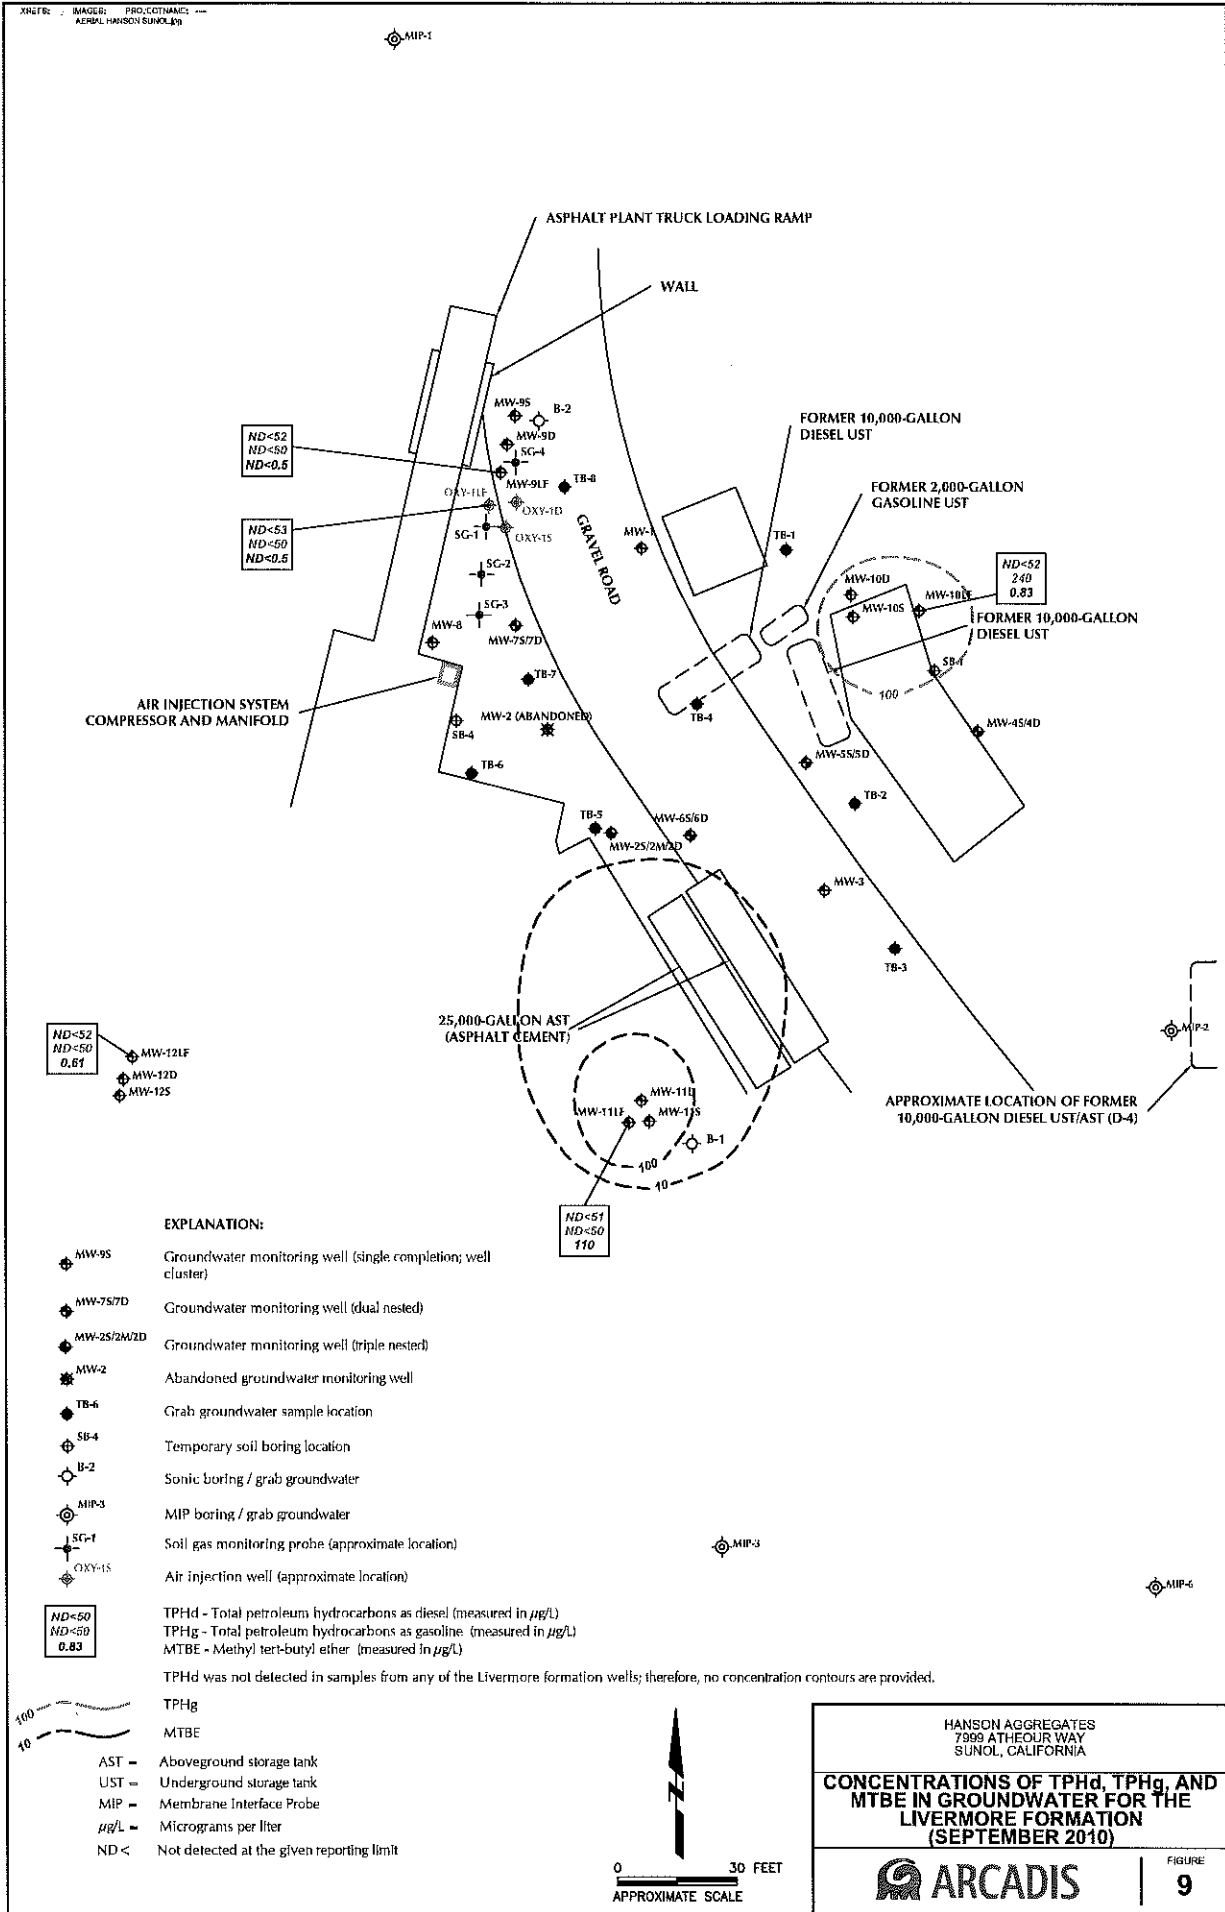

EXPLANATION:


- MW-95 Groundwater monitoring well (single completion; well cluster)
- MW-7S/7D Groundwater monitoring well (dual nested)
- MW-2S/2M/2D Groundwater monitoring well (triple nested)
- MW-2 Abandoned groundwater monitoring well
- TB-6 Grab groundwater sample location
- SB-4 Temporary soil boring location
- B-2 Sonic boring / grab groundwater
- MIP-3 MIP boring / grab groundwater
- SG-1 Soil gas monitoring probe (approximate location)
- OXY-1S Air injection well (approximate location)

ND<50
 ND<50
 ND<51
 ND<50 Total petroleum hydrocarbons as diesel (measured in $\mu\text{g/L}$)
 ND<50 Total petroleum hydrocarbons as gasoline (measured in $\mu\text{g/L}$)
 0.83 MTBE - Methyl tert-butyl ether (measured in $\mu\text{g/L}$)

TPHd was not detected in samples from any of the Livermore formation wells; therefore, no concentration contours are provided.



- AST - Aboveground storage tank
- UST - Underground storage tank
- MIP - Membrane Interface Probe
- $\mu\text{g/L}$ - Micrograms per liter
- ND < - Not detected at the given reporting limit

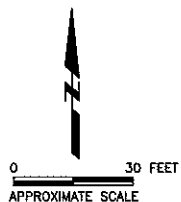

HANSON AGGREGATES
7999 ATHEOUR WAY
SUNOL, CALIFORNIA

**CONCENTRATIONS OF TPHd, TPHg, AND
MTBE IN GROUNDWATER FOR THE
LIVERMORE FORMATION
(SEPTEMBER 2010)**

ARCADIS

FIGURE
9



Appendix A


Historical Soil Data

**Summary Report
Environmental Activities**

Mission Valley Rock Company
7999 Athenour Way
Sunol, California



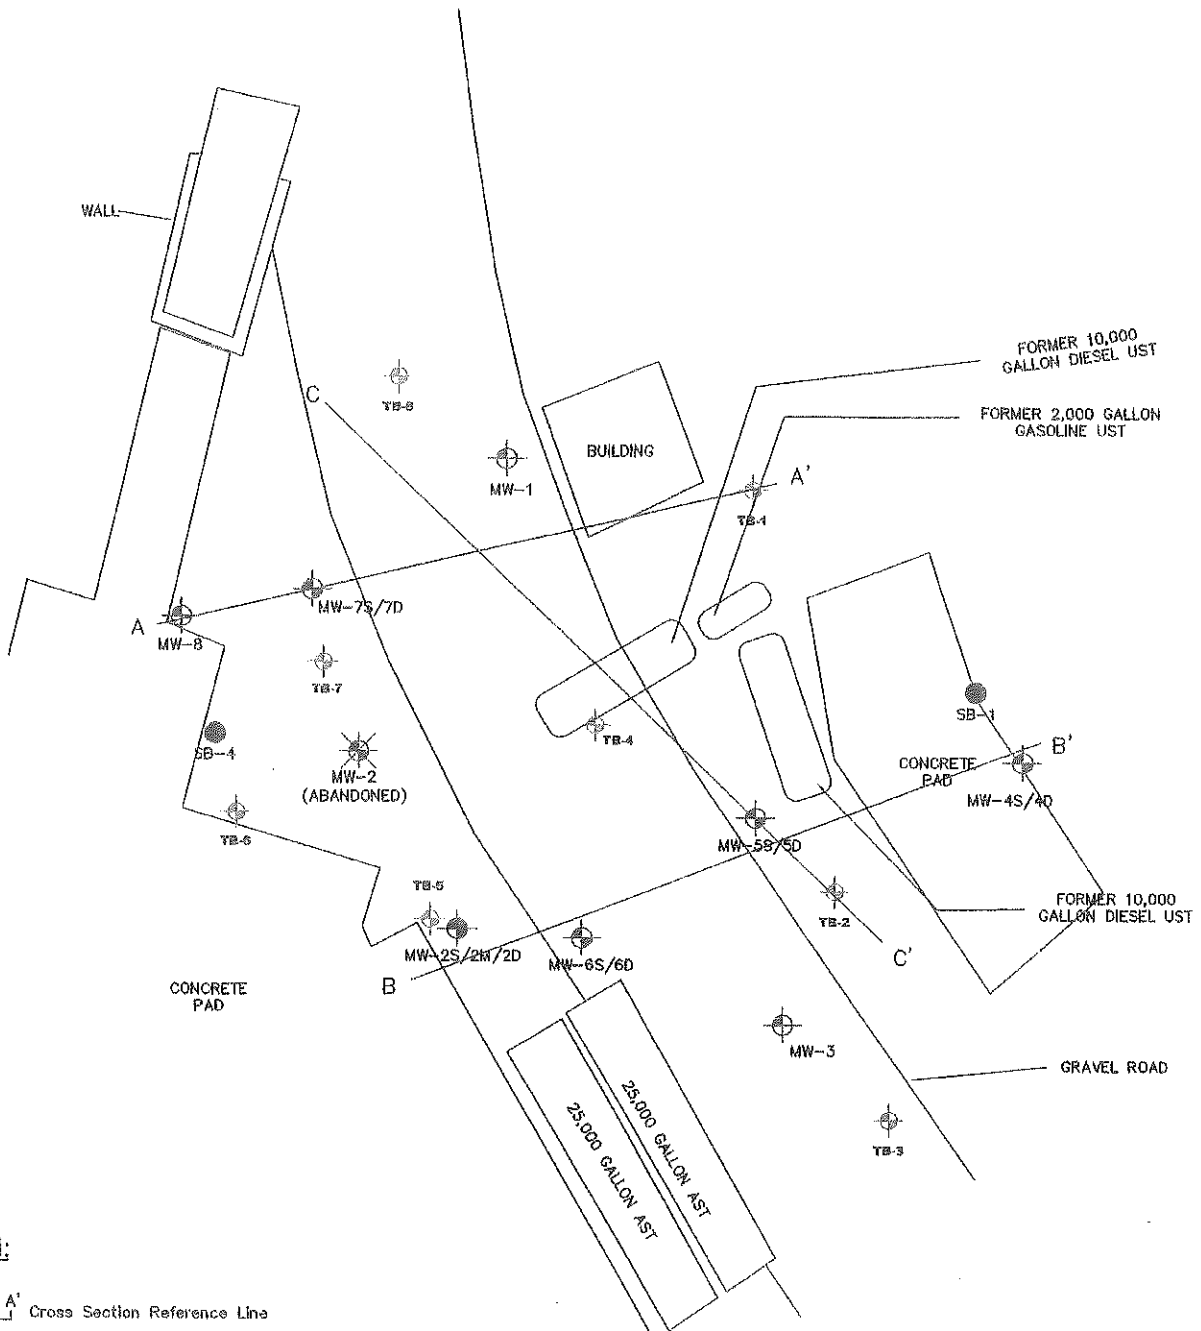


Prepared by:
Tait Environmental Management, Inc.


May 16, 2006




Legend:

A ——— A' Cross Section Reference Line

-  Groundwater Monitoring Well - Single Completion
MW-1
-  Groundwater Monitoring Well - Dual Nested
MW-7S/7D
-  Groundwater Monitoring Well - Triple Nested
MW-2S/2M/2D
-  Abandoned Groundwater Monitoring Well
MW-2
-  Soil Boring
SB-1

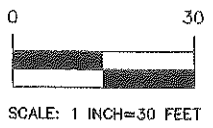

	701 NORTH PARKCENTER DRIVE SANTA ANA, CALIFORNIA 92705 (714) 560-8200 (714) 560-8235 FAX
	ENVIRONMENTAL MANAGEMENT, INC.
HISTORICAL SITE PLAN WITH CROSS-SECTION REFERENCE LINES	
MISSION VALLEY ROCK 7999 ATHENOUR WAY SUNOL, CALIFORNIA	

PROJECT NO. EM-5009B FIGURE 2

TABLE 6
SOIL ANALYTICAL RESULTS - JANUARY 2005

MISSION VALLEY ROCK
7999 ATHENOUR WAY
SUNOL, CALIFORNIA

Sample ID	Date	Sample Depth (feet bgs)	Constituents (milligrams per kilogram)										
			TPH-D	TPH-G	Methyl-tert- Butyl Ether	Benzene	Toluene	Ethylbenzene	Total Xylenes	tert-Butanol	Di-Isopropyl Ether	Ethyl-tert- Butyl Ether	tert-Amyl Methyl Ether
MW5-5	1/4/2005	5	ND<10	ND<1	ND<0.005	0.0043	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
MW5-10	1/4/2005	10	ND<10	ND<1	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
MW5-20	1/4/2005	20	ND<10	ND<1	ND<0.005	0.0038	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
MW2-5	1/4/2005	5	900	14	ND<0.005	ND<0.005	ND<0.005	ND<0.005	0.002	ND<0.005	ND<0.005	ND<0.050	ND<0.050
MW2-10	1/4/2005	10	740	15	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
MW2-15	1/4/2005	15	23	0.96	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
MW6-10	1/5/2005	10	78	6.8	0.0077	ND<0.005	ND<0.005	ND<0.005	0.0044	ND<0.005	ND<0.005	ND<0.050	ND<0.050
MW6-25	1/5/2005	25	12	1.2	0.024	0.0041	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
MW4-5	1/5/2005	5	ND<10	ND<1	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
MW4-10	1/5/2005	10	ND<10	ND<1	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
MW4-20	1/5/2005	20	ND<10	ND<1	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
MW2-30	1/5/2005	30	ND<10	ND<1	ND<0.005	0.022	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
MW6-25	1/5/2005	25	17	5.4	0.047	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
SB1-5	1/6/2005	5	ND<10	ND<1	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
SB1-15	1/6/2005	15	ND<10	ND<1	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
SB1-20	1/6/2005	20	ND<10	ND<1	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
SB2-5	1/6/2005	5	ND<10	0.67	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
SB2-10	1/6/2005	10	ND<10	ND<1	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
SB2-15	1/6/2005	15	ND<10	0.86	ND<0.005	ND<0.005	ND<0.005	ND<0.005	0.012	0.0273	ND<0.005	ND<0.050	ND<0.050
SB2-23	1/6/2005	23	16	510	ND<0.005	ND<0.005	ND<0.005	ND<0.005	9.7	14.86	ND<0.005	ND<0.050	ND<0.050
SB2-26	1/6/2005	26	39	840	ND<0.005	ND<0.005	ND<0.005	ND<0.005	10	16.4	ND<0.005	ND<0.050	ND<0.050
SB3-5	1/6/2005	5	ND<10	ND<1	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
SB3-15	1/6/2005	15	ND<10	ND<1	ND<0.005	ND<0.005	ND<0.005	ND<0.005	0.0049	0.0107	ND<0.005	ND<0.050	ND<0.050
SB3-20	1/6/2005	20	ND<10	ND<1	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
SB3-25	1/6/2005	25	ND<10	0.51	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
SB4-5	1/6/2005	5	190	42	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	0.0046	ND<0.005	ND<0.050	ND<0.050
SB4-10	1/6/2005	10	14	2.7	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
SB4-15	1/6/2005	15	ND<10	4.5	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
SB4-20	1/6/2005	20	17	2.7	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050
SB4-25	1/6/2005	25	ND<10	ND<1	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.005	ND<0.050	ND<0.050

Notes:

bgs = Below Ground Surface

ND = Not detected at or above the indicated laboratory reporting limit.

TPH-D = Total Petroleum Hydrocarbons as Diesel

TPH-G = Total Petroleum Hydrocarbons as Gasoline

Concentrations of TPH-D and TPH-G reported using EPA Method No. 8015M.

Concentrations of Methyl-tert-Butyl Ether, Benzene, Toluene, Ethylbenzene, Total Xylenes, tert-Butanol, Di-Isopropyl Ether, Ethyl-tert-Butyl Ether, and tert-Amyl Methyl Ether reported using EPA Method No. 8260B.