

CONFIDENCE UST SERVICES, INC.

417 Montclair Street, Bakersfield, CA 93309, 800-339-9930 or 805-631-3870

: FINAL TEST RESULTS:

ALERT 1000 / ALERT ULLAGE 1050X / AES PLT-100R

ENVIRONMENTAL PROTECTION
98 FEB 19 PM 3:40

CUSTOMER ADDRESS:

Hutch, s Car Wash
1367 A Street
Hayward, CA 94541

WORK ORDER 2705

TEST DATE: 01-27-1998

SITE ADDRESS:

Hutch's Car Wash
17945 Hesperian Blvd.
San Lorenzo, CA

SITE CONTACT: Kirk Hutchinson

PHONE NUMBER: 510-538-9274

TECHNICIAN: Doug Young

PHONE NUMBER: 800-339-9930 LICENSE: 99-1076

WATER IN BACKFILL: 0.00"


DATE & TIME OF LAST FUEL DELIVERY: 20+ hours

TANK INFORMATION: (WETTED)


| | TANK 1 | TANK 2 | TANK 3 | TANK 4 |
|--|----------------|----------------|----------------|----------------|
| PRODUCT TYPE: | Regular | Supreme | Supreme | |
| TOTAL GALLONS: | 10000 gallons | 5000 gallons | 5000 gallons | |
| PRODUCT LEVEL: | 66.5 inches | 62.5 inches | 79.5 inches | |
| PERCENT FULL: | 75% | 70% | 89% | |
| TEST METHOD: | Alert 1000 | Alert 1000 | Alert 1000 | |
| WATER IN TANK: | 0.25 inches | 1.00 inches | 1.75 inches | |
| TANK MATERIAL: | F.G.Lined | F.G.Lined | F.G.Lined | |
| P.S.I. @ BOTTOM: | 1.6625 psi | 1.5625 psi | 1.9875 psi | |
| TEST DURATION: | 2.0 hours | 2.0 hours | 2.0 hours | |
| FINAL LEAK RATE: | -0.043 gph | -0.029 gph | +0.039 gph | |
| TEST RESULT: | PASS | PASS | PASS | |
| TANK INFORMATION: (ULLAGE) U/F ONLY | ALERT 1050X | ALERT 1050X | ALERT 1050X | ALERT 1050X |
| ULLAGE GALLONS: | 2521 gallons | 1512 gallons | 530 gallons | |
| START PRESSURE: | 1.5 psi | 1.5 psi | 1.5 psi | |
| END PRESSURE: | 1.5 psi | 1.5 psi | 1.5 psi | |
| TEST RESULT: | PASS | PASS | PASS | |
| PRODUCT LINES: | AES PLT-100R | AES PLT-100R | AES PLT-100R | AES PLT-100R |
| LINE TYPE: | Suction | Suction | Suction | |
| START TIME: | 08:10a | 08:15a | 08:05a | |
| END TIME: | 08:40a | 08:45a | 08:35a | |
| TEST PRESSURE: | 10 psi | 10 psi | 10 psi | |
| FINAL LEAK RATE: | -0.005 gph | -0.003 gph | -0.005 psi | |
| TEST RESULT: | PASS | PASS | PASS | |
| MECHANICAL LEAK DETECTORS: | Red Jacket FTA | Red Jacket FTA | Red Jacket FTA | Red Jacket FTA |
| MODEL: | | | | |
| SERIAL NUMBER: | | | | |
| CHECK VALVE PSI: | | | | |
| BLEED OFF ml: | | | | |
| LEAK RATE TESTED: | | | | |
| TEST RESULT: | N/A | N/A | N/A | |

A) These systems and methods meet or exceed the criteria in USEPA 40CFR parts 280, NFPA 329-87 and all applicable state codes.

B) Any failure listed above may require further action, check with all regulatory agencies.

| | | |
|--|------------------|--|
| Technician's signature:  | Date: 1-27-98 | Manufacturer Certification No: Alert: ALTX123 and/or AES: 86116 |
|--|------------------|--|

T1 = 10000 GAL. REGULAR
T2 = 5000 GAL. SUPREME
T3 = 5000 GAL. SUPREME

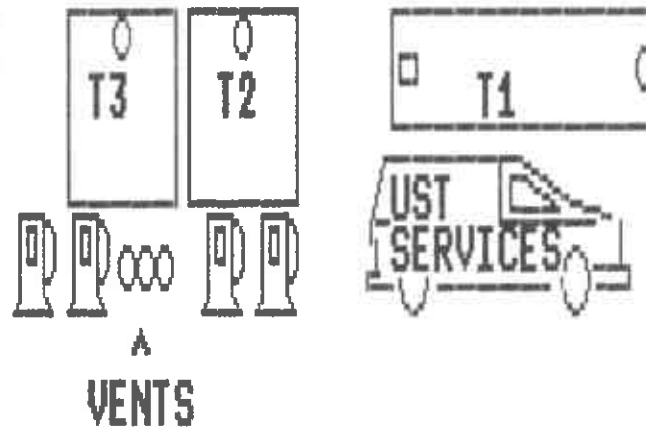

HESPERIAN BLVD.

Site Layout For : 17945 HESPERIAN BLVD. , SAN LORENZO, CA.

Gal

VIEWDATA VER2.C

DATA FILE
27050001.d11

+08

TANK SIZE
10000 Gal

+04

PROD TYPE
Regular

00

PROD SGU
.74

-04

TOT HOURS
2.0

-08

AVGT (Gal)
-0.043

1.0

2.0

3.0

4.0

(hr)

Job#: 27050001

[L/C fbw=300] [TEMP fbw=n100] [DISR hrs=0,0.]

Cust: Hutch's Car Wash

Loca: 17945 Hesperian Blvd. San Lorenzo, CA


EsQUIT F3REPT

ALERT TECHNOLOGIES


PLOT OF ULLAGE TEST DATA

Hutch's Car Wash
17945 Hesperian Blvd.
San Lorenzo, CA

10000 GALLON Regular TANK

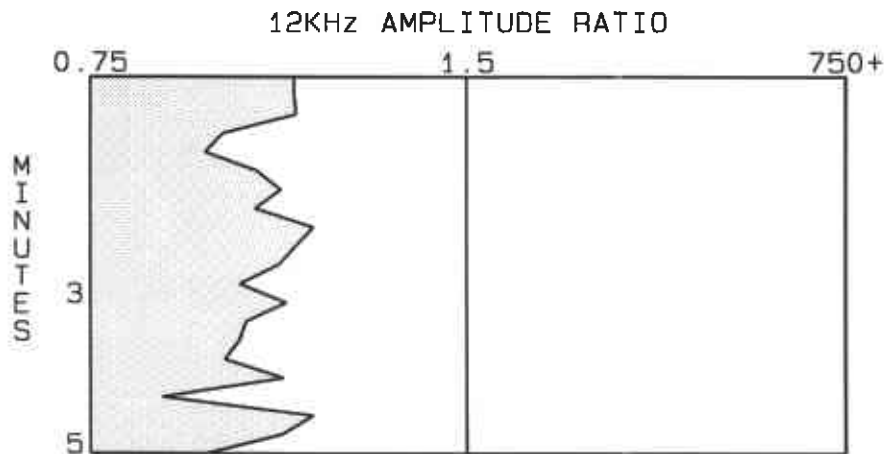

12KHz DETECTION RATIO = 1.00

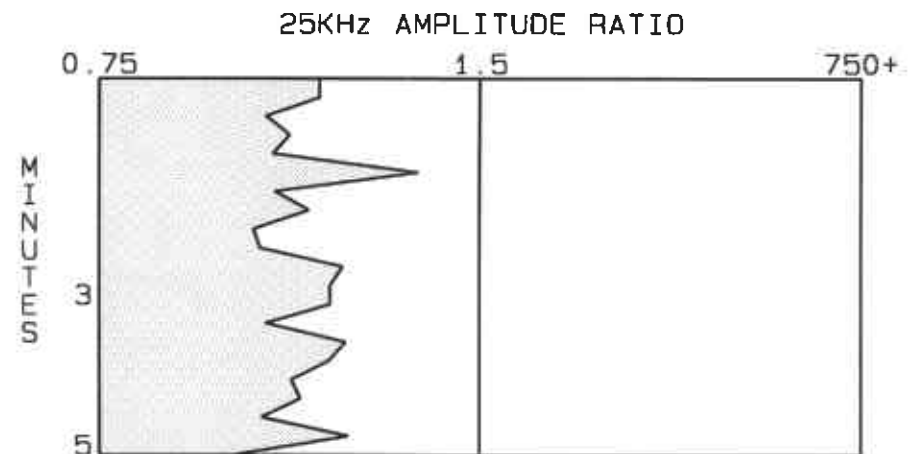

25KHz DETECTION RATIO = 1.01

TEST RESULT = PASS

DATE AND TIME OF TEST: 01/27/98 8:44AM

BEGINNING BOTTLE PRESSURE = 2300
BEGINNING TANK PRESSURE = 1.5 PSIG

ENDING BOTTLE PRESSURE = 2100
ENDING TANK PRESSURE = 1.5 PSIG

Gal

VIEWDATA VER2.C

DATA FILE
27050001.d12

+08

TANK SIZE
5000 Gal

+04

PROD TYPE
Supreme

00

PROD SGU
.74

-04

TOT HOURS
2.0

-08

dVdT (Gal)
-0.029

1.0

2.0

3.0

4.0


(hr)

Job#: 27050001 [L/C fbw=300] [TEMP fbw=n100] [DISR hrs=0,0.]
Cust: Hutch's Car Wash
Loca: 17945 Hesperian Blvd. San Lorenzo, CA EsQUIT F3REPT


ALERT TECHNOLOGIES
PLOT OF ULLAGE TEST DATA

Hutch's Car Wash
17945 Hesperian Blvd.
San Lorenzo, CA

5000 GALLON Supreme TANK

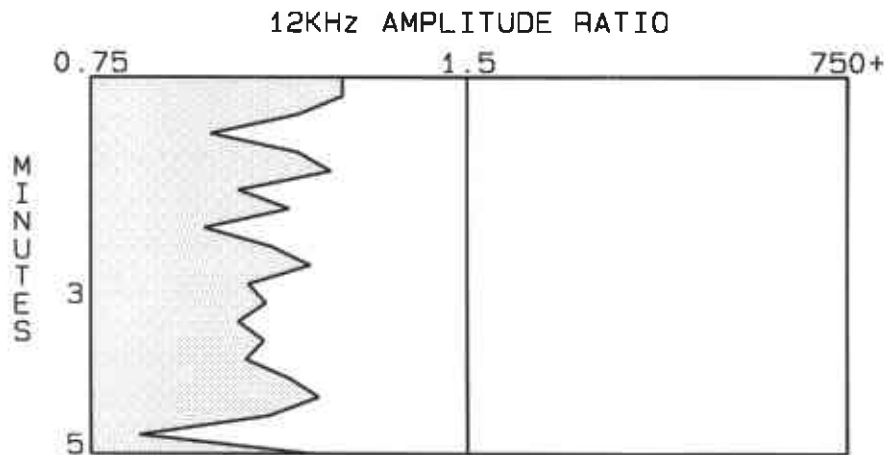

12KHz DETECTION RATIO = .986

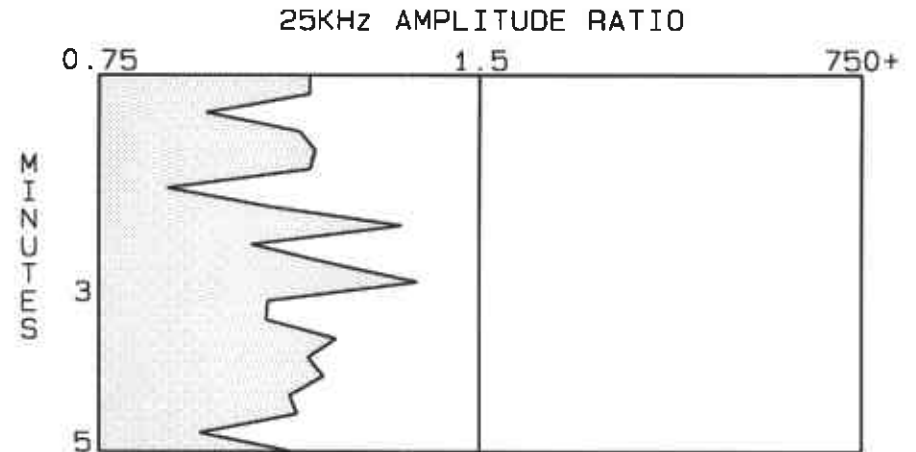


25KHz DETECTION RATIO = 1.01

TEST RESULT = PASS

DATE AND TIME OF TEST: 01/27/98 8:55AM

BEGINNING BOTTLE PRESSURE = 2300
BEGINNING TANK PRESSURE = 1.5 PSIG

ENDING BOTTLE PRESSURE = 2000
ENDING TANK PRESSURE = 1.5 PSIG

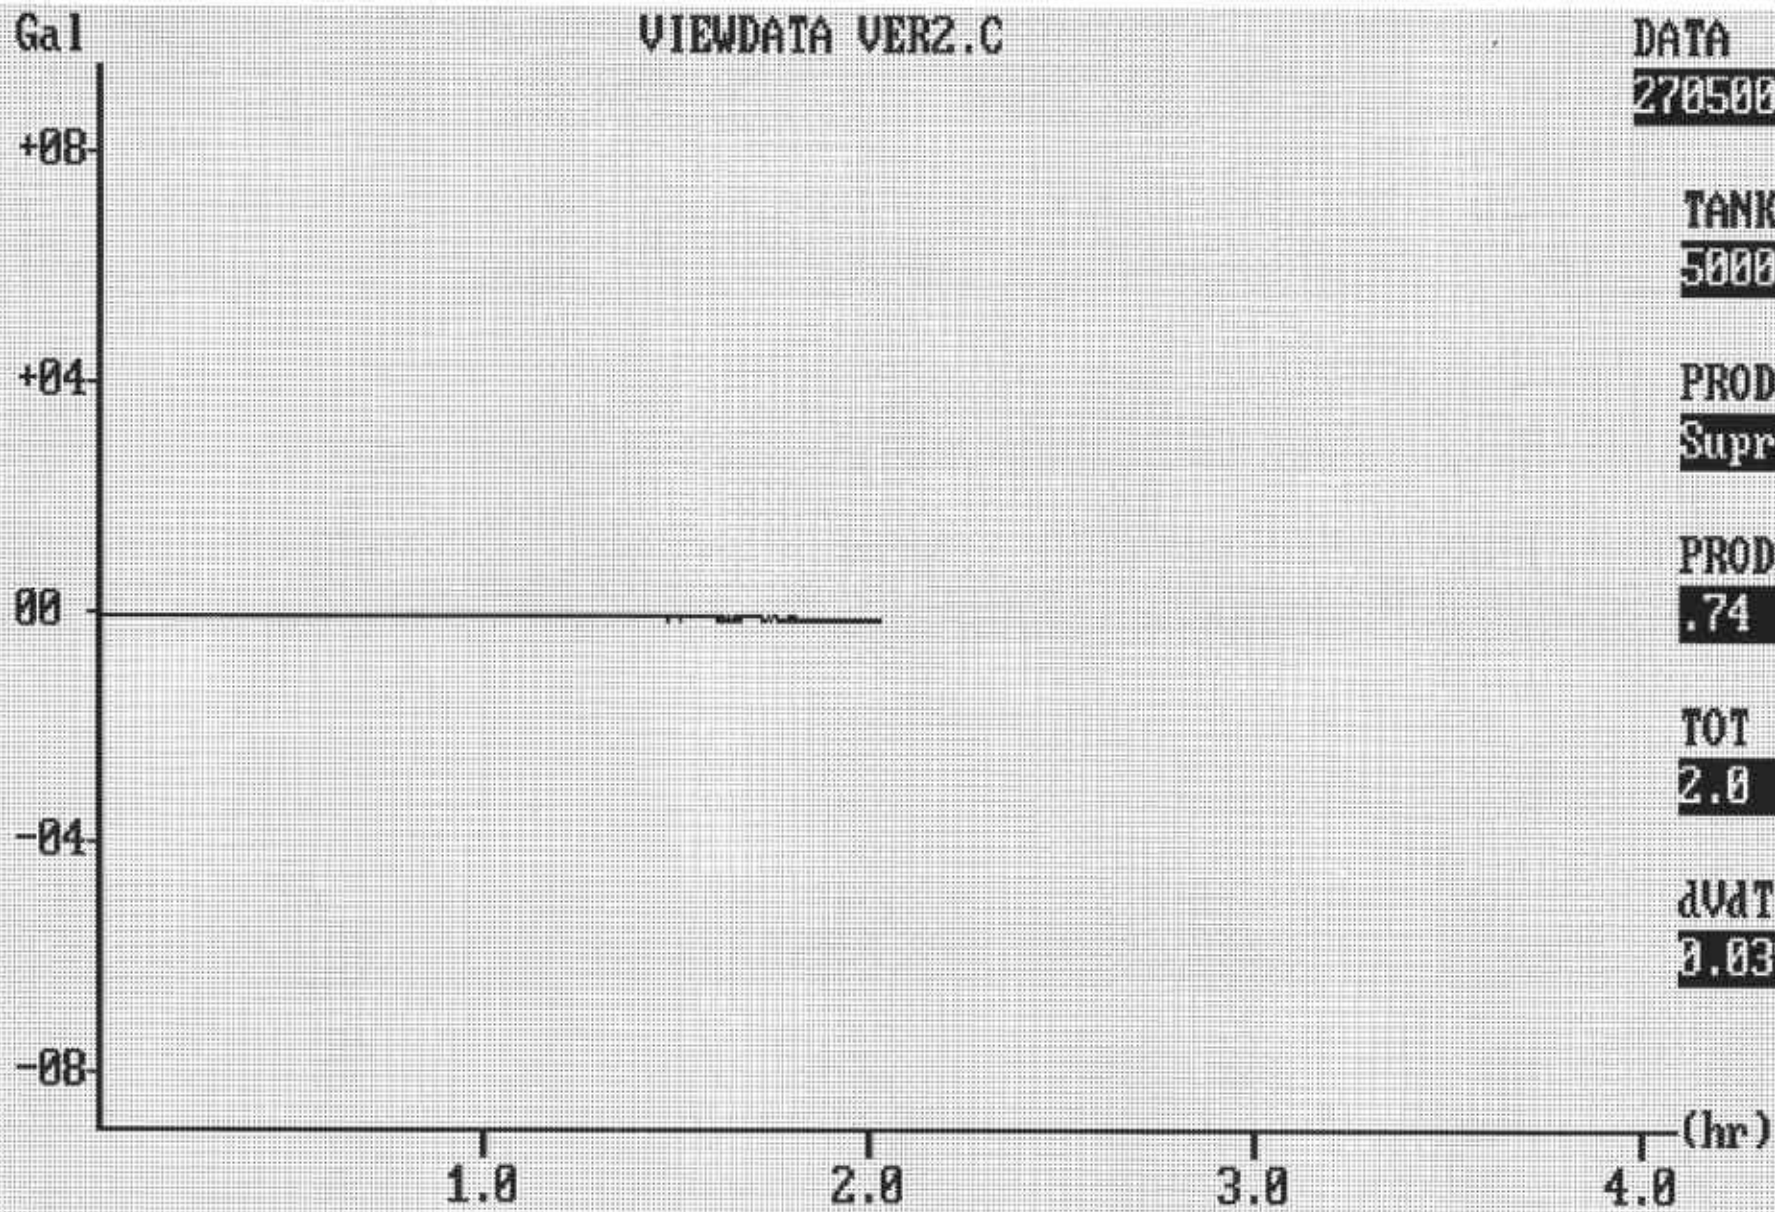

DATA FILE
27050001.d13

TANK SIZE
5000 Gal

PROD TYPE
Supreme

PROD SGU
.74

TOT HOURS
2.0

dVdt (Gal)
0.039


Job#: 27050001 [L/C fbw=300] [TEMP fbw=n100] [DISR hrs=0,0.]
 Cust: Hutch's Car Wash
 Loca: 17945 Hesperian Blvd. San Lorenzo, CA EsQUIT F3REPT

ALERT TECHNOLOGIES


PLOT OF ULLAGE TEST DATA

Hutch's Car Wash
17945 Hesperian Blvd.
San Lorenzo, CA

5000 GALLON Supreme TANK

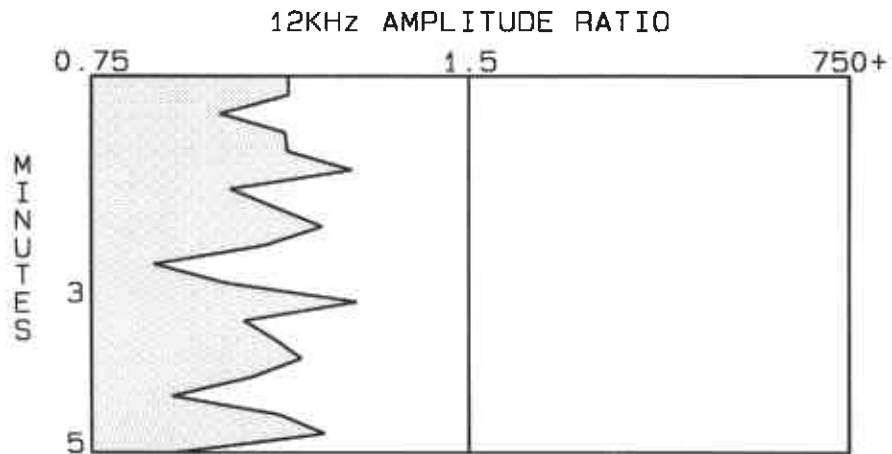

12KHz DETECTION RATIO = .992

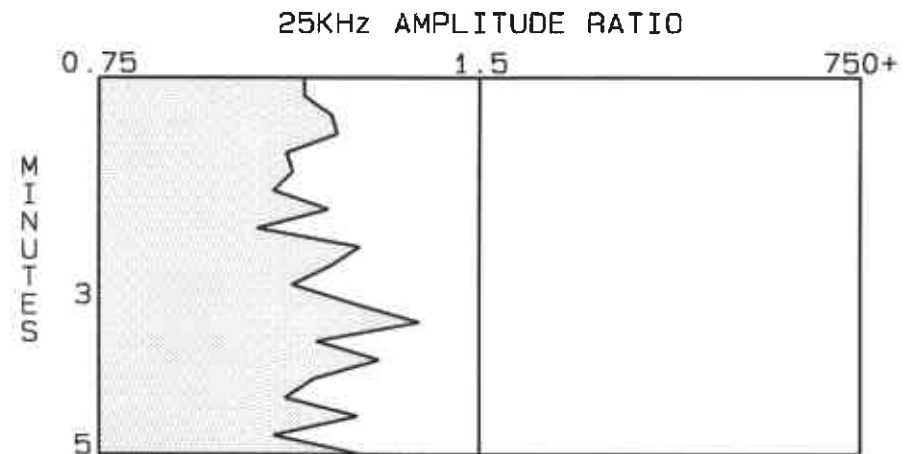

25KHz DETECTION RATIO = 1.07

TEST RESULT = PASS

DATE AND TIME OF TEST: 01/27/98 9:03AM

BEGINNING BOTTLE PRESSURE = 2300

ENDING BOTTLE PRESSURE = 1900

BEGINNING TANK PRESSURE = 1.5 PSIG

ENDING TANK PRESSURE = 1.5 PSIG