

LOWNEY ASSOCIATES

Environmental/Geotechnical/Engineering Services

FAX

To: Robert Weston		From: Mark Arniola	
Firm: Alameda County Department of Environmental Health	Fax: (510) 337-9335	Date: March 5, 2003	Pages: 3
Cc: John Sutfin	Fax: (925) 551-7895	Project: 1888-1	
Cc:	Fax:	Project #:	
<input type="checkbox"/> Urgent <input checked="" type="checkbox"/> For review <input checked="" type="checkbox"/> Reply ASAP <input type="checkbox"/> Please comment		Please call the indicated office below if you received this fax in error.	

Robert:

A table of laboratory analytical results and a site plan for the 770 El Charro Road, Pleasanton site are attached. Please call me and let me know if any additional excavation or sampling will be required.

Thank you,



Lowney Associates
 Mark Arniola
 Senior Project Geologist
 (510) 267-1970, ext. 208

MOUNTAIN VIEW
 405 Clyde Avenue
 CA 94043
 T: 650.967.2365
 F: 650.967.2785

FAIRFIELD
 2850 Cordella Road
 Suite 140
 CA 94534
 T: 707.423.2523
 F: 707.428.1725

OAKLAND
 167 Filbert Street
 CA 94607
 T: 510.267.1970
 F: 510.267.1972

SAN RAMON
 2258 Camino Ramon
 CA 94583
 T: 925.275.2550
 F: 925.275.2555

FULLERTON
 251 E. Imperial Hwy
 Suite 470
 CA 92835
 T: 714.441.3090
 F: 714.441.3091

**TABLE 2. Analytical Results of Selected Soil Samples
(concentrations in parts per million)**


Sample Number	Depth (feet)	Location	TPHd	TPHg	Benzene	Toluene	Ethylbenzene	Xylenes
T-1-1	7 ½	Tank#1 non-fill	1.0	<1.0	<0.005	<0.005	<0.005	<0.005
T-1-2	7 ½	Tank#1 fill-end	1.4	<1.0	<0.005	<0.005	<0.005	<0.005
T-2-1	10 ½	Tank#2 non-fill	<1.0	<1.0	<0.005	<0.005	<0.005	<0.005
T-2-2	10 ½	Tank#2 fill-end	<1.0	<1.0	<0.005	<0.005	<0.005	<0.005
T-3-1	11 ½	Tank#3 fill-end	<1.0	<1.0	<0.005	<0.005	<0.005	<0.005
T-3-2	11 ½	Tank#3 non-fill	<1.0	<1.0	<0.005	<0.005	<0.005	<0.005
SP-1,2,3,4	NA	Stockpile	1.0	<1.0	<0.005	0.0051	<0.005	<0.005
SP-5,6,7,8	NA	Stockpile	1.0	<1.0	<0.005	0.006	<0.005	<0.005
SP-9,10,11,12	NA	Stockpile	1.0	<1.0	<0.005	0.0087	<0.005	0.034
SP-13,14,15,16	NA	Stockpile	1.0	<1.0	<0.005	0.0081	0.020	0.140

Sample Number	EDB	1,2 DCA	TBA	MTBE	DIPE	ETBE	TAME	Lead
T-1-1	<0.005	<0.005	<0.005	<0.005	<0.005	<0.005	<0.005	5.4
T-1-2	<0.005	<0.005	<0.005	<0.005	<0.010	<0.005	<0.005	4.5
T-2-1	<0.005	<0.005	<0.005	<0.005	<0.010	<0.005	<0.005	6.5
T-2-2	<0.005	<0.005	<0.005	<0.005	<0.010	<0.005	<0.005	7.3
T-3-1	<0.005	<0.005	<0.005	<0.005	<0.010	<0.005	<0.005	8.3
T-3-2	<0.005	<0.005	<0.005	<0.005	<0.010	<0.005	<0.005	8.3
SP-1,2,3,4	<0.005	<0.005	<0.005	<0.005	<0.010	<0.005	<0.005	5.8
SP-5,6,7,8	<0.005	<0.005	<0.005	<0.005	<0.010	<0.005	<0.005	7.0
SP-9,10,11,12	<0.005	<0.005	<0.005	<0.005	<0.010	<0.005	<0.005	8.8
SP-13,14,15,16	<0.005	<0.005	<0.0	<0.000	<0.010	<0.000	<0.000	9.6

< Indicates that the compound was not detected at or above the stated laboratory reporting limit



Barn/stables

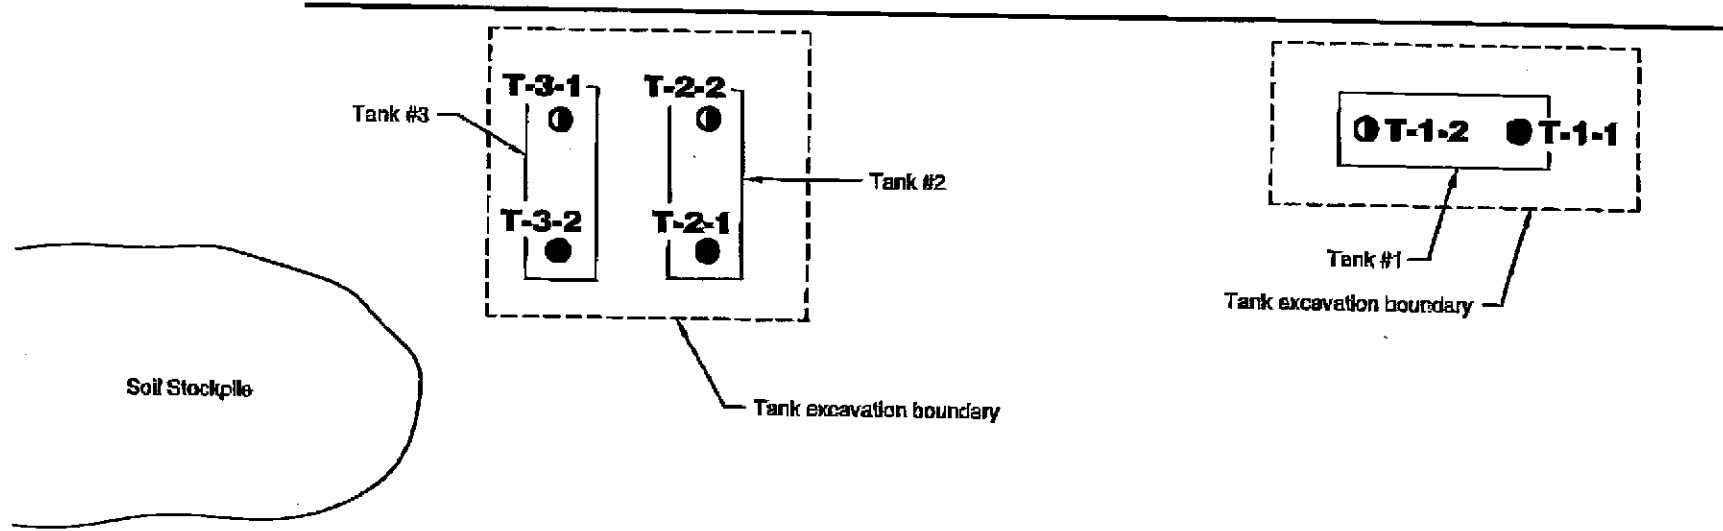

LEGEND

- - Approximate location of fill end soil verification sample
- - Approximate location of non-fill end soil verification sample

Base approximated from Lowney Associates field notes.

Approximate Scale:
 0 10
 Scale feet

SITE PLAN
 770 EL CHARRO ROAD
 Pleasanton, California