RECEIVED

1:01 pm, Mar 15, 2007

Alameda County Environmental Health



March 12, 2007

Alameda County Department of Environmental Health 1131 Harbor Bay Parkway, 2nd Floor Alameda, CA 94502

Attention: Barney Chan

Subject: Report of Phase I Activities and Workplan Addendum

Former Coast Sausage Company UST Site

1173 28th Street, Oakland, California

ACDEH Fuel Leak Case No.: RO0002562

GA Project No. 317-02-01

Ladies and Gentlemen:

Gribi Associates is pleased to submit this report documenting recent Phase I activities and including a workplan addendum to conduct additional investigation activities at the former Coast Sausage Company underground storage tank (UST) site at 1173 28th Street in Oakland, California (see Figure 1 and Figure 2). Phase I activities reported herein include: (1) Review of historical records for the project site and site vicinity; and (2) Review of hazardous waste site records for the site and site vicinity. The purpose of these Phase I activities was to assess possible sources for halogenated volatile organic compounds (HVOCs) encountered near the south project site property boundary. This report also includes a workplan addendum amending the original April 11, 2006 *Workplan to Conduct Site Characterization Activities*, proposing the drilling and sampling of five additional soil borings in Adeline Street south from the project site to assess offsite HVOC sources.

Note that, as part of this assessment, Gribi Associates conducted an inspection of the Adeline Street properties adjacent to the project site to assess utility locations in Adeline Street. Results of this inspection are summarized in Figure 3.

HISTORICAL RECORDS REVIEW

The historical records review consisted of a search of available public records to help establish the known past history of the site, and to determine whether obvious recognized environmental conditions have occurred in connection with the project site or properties adjacent to the project site.

Historical Sanborn Maps Review

Gribi Associates obtained copies of Sanborn Fire Insurance Maps for the project site from Environmental Data Resources (EDR) for years 1902, 1912, 1952, 1954, 1959, 1962, 1967, and 1970. Copies of these maps are included in Appendix A. Review of these Sanborn maps revealed the following:

- The project site is shown with one residential dwelling on the 1902 map and with two residential dwellings on the 1912 map. Surrounding properties are undeveloped or are developed as residences.
- On the 1952, 1954, and 1959 maps, the north portion of the site is fully covered with the original pre-fire project site building and is labeled as "Holly Meat Packing, Whol. Meats & Pack'g, Sausage Facty". The southwest portion of the site is covered with a building labeled as "Aluminum Casting", at 2700 Magnolia Street. This aluminum casting building is also shown on the 1962 map, but is replaced by a parking lot on the 1967 and 1970 maps.
- On maps from 1959 to 1970, a Machine Shop is shown approximately 50 feet south of the east side of the project site, at 2701 Adeline Street.
- On maps from 1952 to 1970, Laher Spring & Tire Corp. is shown approximately 50 to 100 feet south from the project site, at 2639 Adeline Street/2650 Magnolia Street. The building adjacent to Adeline Street, at 2639 Adeline Street, is labeled as "Brake Shoe Rebonding Dept".
- The property at 2601 Adeline, located approximately 100 feet south from the project site, is labeled as Kraft Foods Company on the 1952 and 1954 maps, as "Fire Ruins" on the 1959 map, and as a "Rag Cleaning W'ks," on the 1962, 1967, and 1970 maps.
- A "Test Lab." is shown immediately east across Adeline Street, at 2722 Adeline Street, on the 1967 and 1970 maps.

City Directory Review

A review of Polk and Haines city directories for years ranging from 1920 to 2006 were obtained from EDR. These directories provide tenant names for given street addresses. Review of selected city directories revealed the following:

- The 1173 28th Street project site address is listed as Bastian & Richards Wholesale Meats in the 1943 directory, and as Coast Sausage in directories from 1980 to 1992.
- The 2736 Magnolia Street project site address is listed as Ambassador Laundry Company in the 1925 directory, as Holly Meat Packing Company in directories from 1943 to 1970,



as Beta Sales Institutional Food Broker in the 1991 directory, and as La Coste Meat Company in the 1992 directory.

- The 2700 Magnolia Street project site address is listed as Leon Cameto Brass Foundry in the 1933 and 1943 directories, and as Production Foundry Company and Production Castings in directories from 1938 to 1955.
- The adjacent south parcel, at 2711 Adeline Street, is listed as Mist O2 Generating Equipment in directories from 1967 to 1975.
- The property at 2601 Adeline, located approximately 100 feet south from the project site, is listed as Kraft Foods in directories from 1938 to 1955, as East Bay Sanitary Rag Works in directories from 1962 to 1986, and as multiple construction-related tenants in directories from 1991 to 2000.
- Laher Spring & Electric Company is listed at 2615 Magnolia Street, west across Magnolia Street from the project site (but also apparently occupying a portion of the property immediately south from the project site) in directories from 1933 to 1967.

Historical Aerial Photographs Review

Historical aerial photos from 1931, 1939, 1946, 1958, 1965, 1982, 1993, and 1998 were obtained from EDR. Copies of selected aerial photos are contained in Appendix B. Information obtained from the aerial photos review is summarized in Table 1.

Table 1 AERIAL PHOTO REVIEW 1178 28 th Street, Oakland, California						
Date and Scale	ale					
of Photo	Project Site	Site Vicinity				
1931 (1" = 266')	 East (currently present) site building not present-possible residences on east side of site. Former west building (destroyed by fire in 1990s) is present. 	 Residences present east of project site. Large apparent industrial building (Laher Spring & Electric?) present west of project site across Magnolia Street. Building at 2601 Adeline Street (Kraft Foods) is present. 				
1939 (1" = 555')	Same as previous.	Generally same as previous.				
1946 (1" = 655')	Same as previous.	Generally same as previous.				
1958 (1" =555')	• Currently-present building on east side of site is present.	Increased industiral development south of site.				



Table 1 AERIAL PHOTO REVIEW 1178 28 th Street, Oakland, California						
Date and Scale	Feature Noted in Photo					
of Photo	Project Site	Site Vicinity				
1965 (1" = 333')	Generally same as previous.	Generally same as previous.				
1982 (1" = 690')	 Poor quality photo, very little site detail. 	Generally same as current conditions.				
1993 (1" = 666')	Generally same as current conditions, with building on west side of site no longer present.	Generally same as current conditions.				
1998 (1" = 666')	Generally same as current conditions.	Generally same as current conditions.				

Oakland Planning Department Records Review

Mr. Jim Gribi of Gribi Associates reviewed City of Oakland Planning Department records for sites to the south of the project site (2601 Adeline Street, 2639 Adeline Street/2650 Magnolia Street, and 2701/11 Adeline Street) on January 10, 2007. Results of this records review are summarized below.

- 2601 Adeline Street: Records indicate that this site, located approximately 100 feet south from the east portion of the project site, was occupied by Kraft Foods and Kraft Cheese Company from at least 1936 to 1959. A fire apparently destroyed the interior of the building in 1959. East Bay Sanitary Rag Works applied for building permits in 1959 and 1960 to construct a clerk's office and repair the fire-damaged roof, respectively. The facility apparently included a "processing plant", and two dryers were installed in 1975.
- 2639 Adeline Street/2650 Magnolia Street: Records indicate that this property, located immediately south of the project site, was occupied by Laher Spring & Tire Company in the 1950s and 1960s. A 1953 record lists the site use as "bonding brake linings to break shoes."
- **2701/2711 Adeline Street:** Records indicate that this property was occupied by CSB Construction Company in 1963.

Interviews with Knowledgeable Persons

Mr. Ed Gonsalves, the previous owner/operator of Coast Sausage for at least 20 years, stated that his operation was inspected by USDA inspectors regularly and that it did not include the use of solvents or other hydrocarbon products. He further indicated that the East Bay Sanitary Rag



Works, which was present at 2601 Adeline Street when he occupied the project site, included an industrial rag cleaning and delivery operation, and, as such, did include dry cleaning.

HAZARDOUS WASTE SITE RECORDS REVIEW

Gribi Associates reviewed hazardous waste information from the following governmental agency sources: (1) Federal lists; and (2) State and regional lists. The purpose of this review was to provide information about reported hazardous waste sites and incidents in the project site vicinity. In order to facilitate our review of Federal, State and regional lists, Gribi Associates obtained and reviewed a radius site profile for the project site area from Environmental Data Resources, Inc. (EDR). The EDR report includes a computer-generated search of the following regulated hazardous waste site lists within a specified radius from the project site. The executive summary and relevant portions of the EDR report are contained in Appendix C.

The project site is included on the CHMIRS, ERNS, and CS lists. The CHMIRS and ERNS listings refers to minor ammonia releases during a fire at the Coast Sausage facility in 1993. The CS is an Alameda County listing referring to the fuel USTs which were formerly located on the project site. This County leaking UST listing has been investigated and, as summarized in the August 2006 SWI report, does not pose a significant risk for the planned residential redevelopment of the site.

A review of the EDR report indicates one site in a possible expected upgradient groundwater flow direction which may have used HVOCs in the past. This site, Aervoe Pacific, is located approximately 500 feet south from the project site at 2528 Adeline Street. According to its website, Aerovoe Industries has been a manufacturer of paints, specialty coatings, cleaners, lubricants, and other products for over 35 years. This site is included on the LUST, Cortese, CA FID UST, CS, and SWEEPS UST lists. These listings all refer to the operation of USTs to store V, M & P Naptha and Diesel fuel.

WORKPLAN ADDENDUM

Evaluation of Historical Records Review

Base on our review of available historical records, it appears that the most likely source of the chlorinated solvents (HVOC) groundwater impacts on the extreme southeast side of the project site is the former East Bay Sanitary Rag Works, which occupied the property at 2601 Adeline Street, approximately 100 feet south from the project site, from about 1959 to 1986. Alternatively, a machine shop formerly located immediately south from the site could be a source for these HVOC impacts. Another possible offsite HVOC source is the former Aerovoe Pacific site, located approximately 500 feet south from the project site at 2528 Adeline Street, which may have included the manufacturing of paints, specialty coatings, cleaners, and lubricants. While these sites are not located in an expected upgradient groundwater flow



direction from the identified HVOC impacts on the project site, it is possible that underground utilities, which run along Adeline Street, could act as preferential migratory pathways for the HVOCs.

PROPOSED SCOPE OF WORK

In order to assess possible offsite HVOC sources, this workplan proposes the drilling and sampling of five soil borings in the Adeline Street parking lane.

Prefield Activities

Prior to implementing field activities, soil boring permits will be obtained from Alameda County Department of Public Works and notification will be given at least 72 hours prior to drilling. Necessary encroachment permits will be obtained for those borings to be drilled on public right-of-ways.

Prior to drilling, soil boring locations will be marked with white paint and USA will be notified. Also, a private utility locator will identify all utilities, which could represent HVOC migratory pathways.

Prior to drilling, site specific Health and Safety Plan will be issued to all site workers and a tailgate meeting conducted prior to beginning field work

Soil and Groundwater Sampling

Approximately five soil borings, GA-12 through GA-16, will be drilled to a depth of about 12 feet below surface (first encountered groundwater) using direct-push coring equipment (see Figure 3). Two of the soil borings, GA-12 and GA-13, will be located on the east side of Adeline Street, south of previous boring GA-1. The three remaining borings, GA-14, GA-15, and GA-16, will be located on the west side of Adeline Street, south of previous borings borings GA-2 and GA-3. Each borehole will be logged by a qualified Gribi Associates field scientist in accordance with the Unified Soil Classification System.

At least one soil sample and one grab groundwater sample will be collected from each soil boring. Soil samples will be collected at approximately four-foot depth intervals, or when obviously contaminated soils are encountered. Grab groundwater samples will be collected after placing temporary well casing in the borings. Soil and grab groundwater samples will be collected in accordance with standard sampling protocols.



Laboratory Analysis

Approximately ten soil samples and five grab groundwater samples will be analyzed for the following parameters:

USEPA 8260B Halogenated Volatile Organic Compounds (HVOCs)

All samples will be analyzed by a state-certified laboratory with standard turn around on laboratory results.

Data Evaluation and Reporting

Upon completion of the previously described activities, a summary report will be prepared for submittal to ACDEH. The report will describe and document the results of the field investigations.

PROJECT SCHEDULE

Subject to your authorization, Gribi Associates is prepared to begin project activities immediately, with completion of proposed field activities within approximately four weeks, and completion of the summary report within approximately six to eight weeks.

We appreciate the opportunity to present this workplan for your review. Please call if you have questions or require additional information. We look forward to working with you on this important project.


Very truly yours,


James E. Gribi Registered Geologist California No. 5843

JEG/ct Enclosure







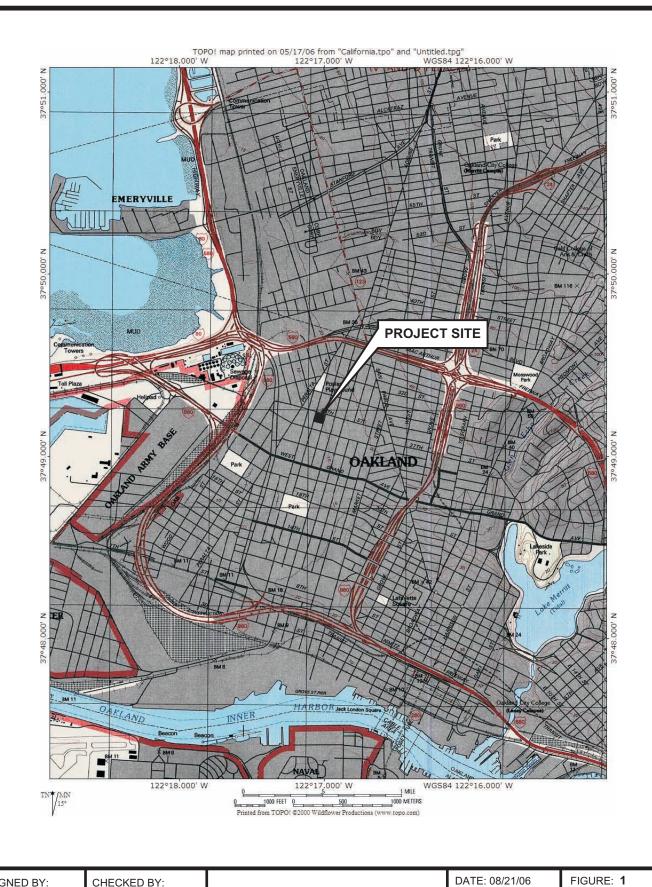



DESIGNED BY:	CHECKED BY:	
DRAWN BY: JG	SCALE:	
PROJECT NO: 317-01-01		

SITE VICINITY MAP


FORMER COAST SAUSAGE SITE OAKLAND, CALIFORNIA

DATE: 08/21/06

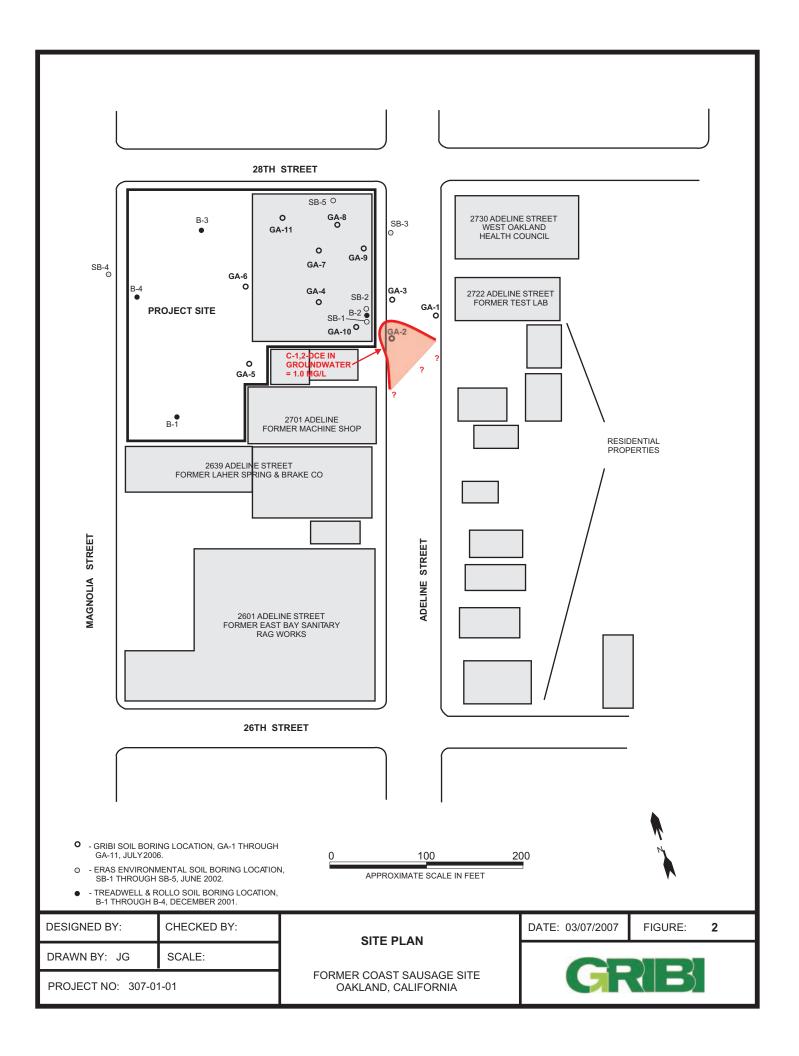

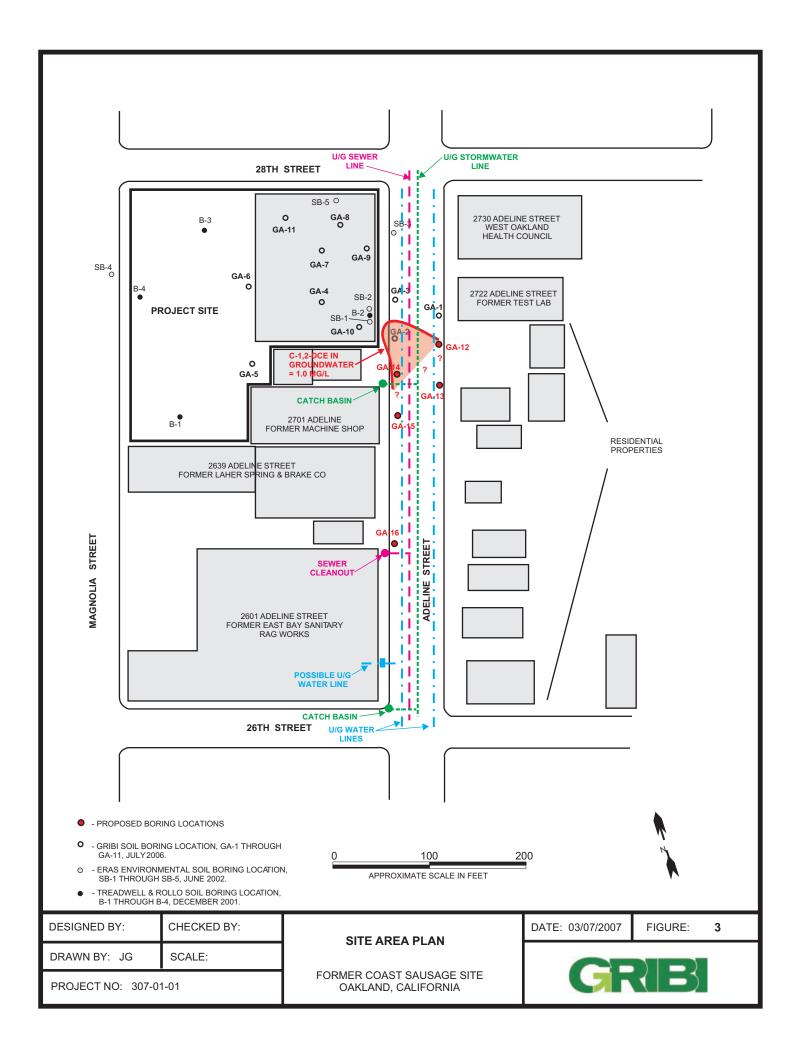

APPENDIX A HISTORICAL SANBORN MAPS

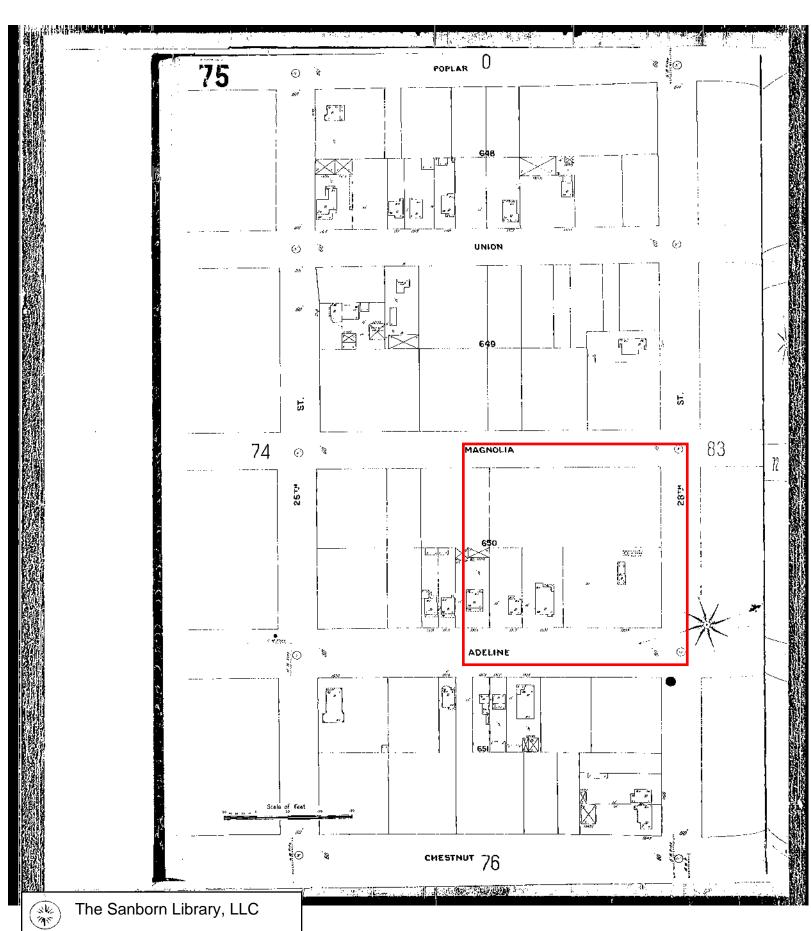



Copyright® 1902 The Sanborn Library, LLC SPM.

Year

EDR Research Associate

Reproduction in whole or in part of any may of the Sanborn Library, LLC may be prohibited without prior written

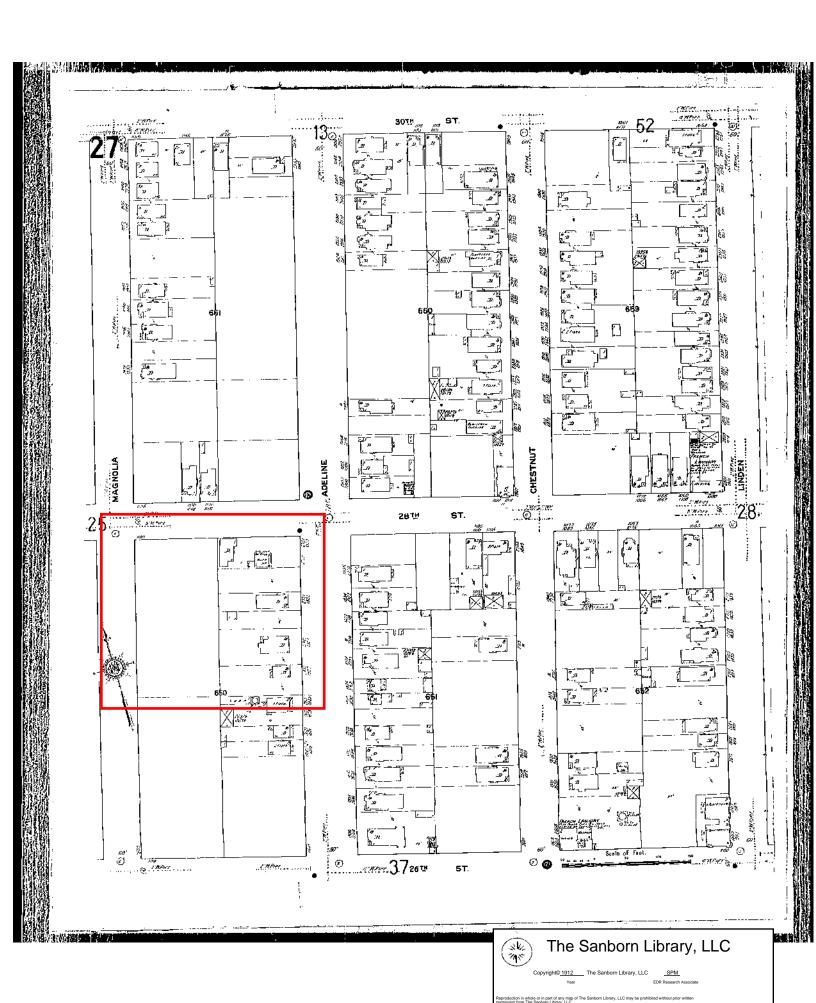

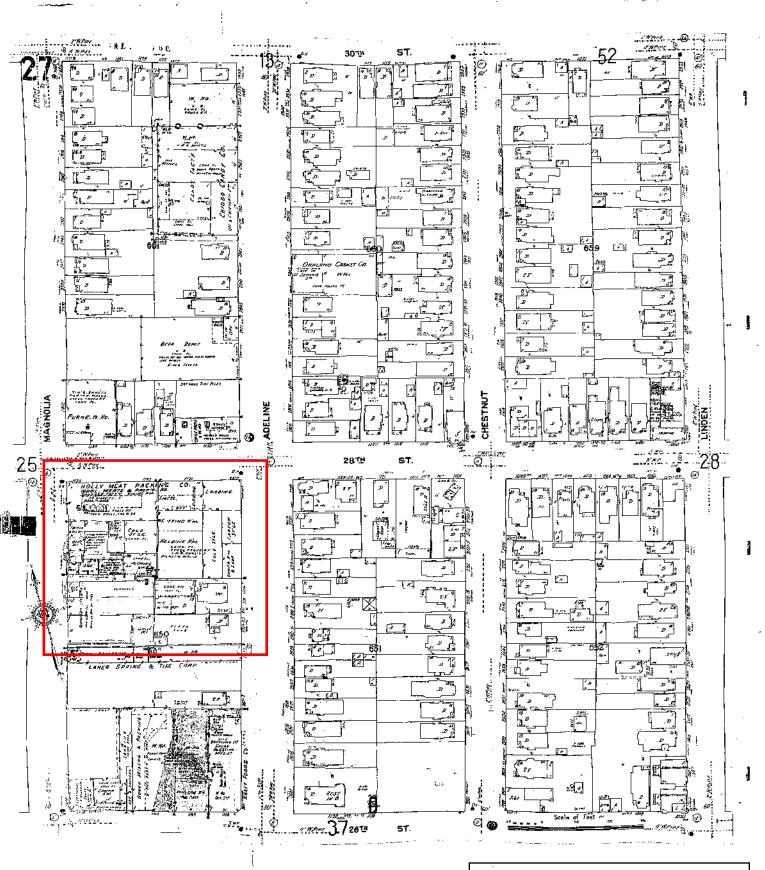

The Sanborn Library, LLC

Copyright© 1951


Year


The Sanborn Library, LLC


SPM


EDR Research Associate


Reproduction in whole or in part of arm good The Sanborn Library, LLC may be prohibited without prior written permission from The Sanborn Library, LLC.

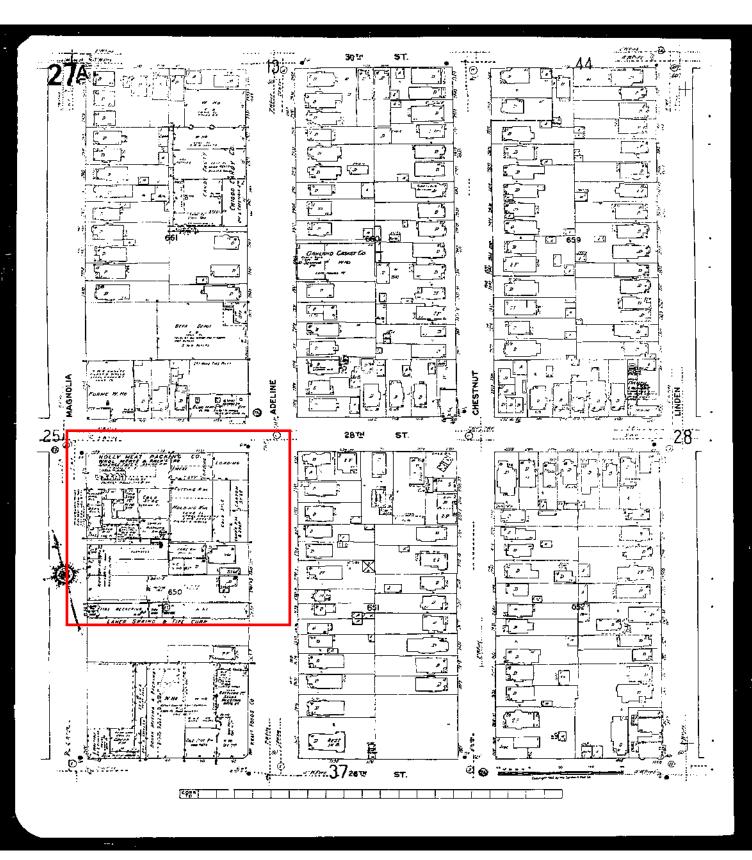





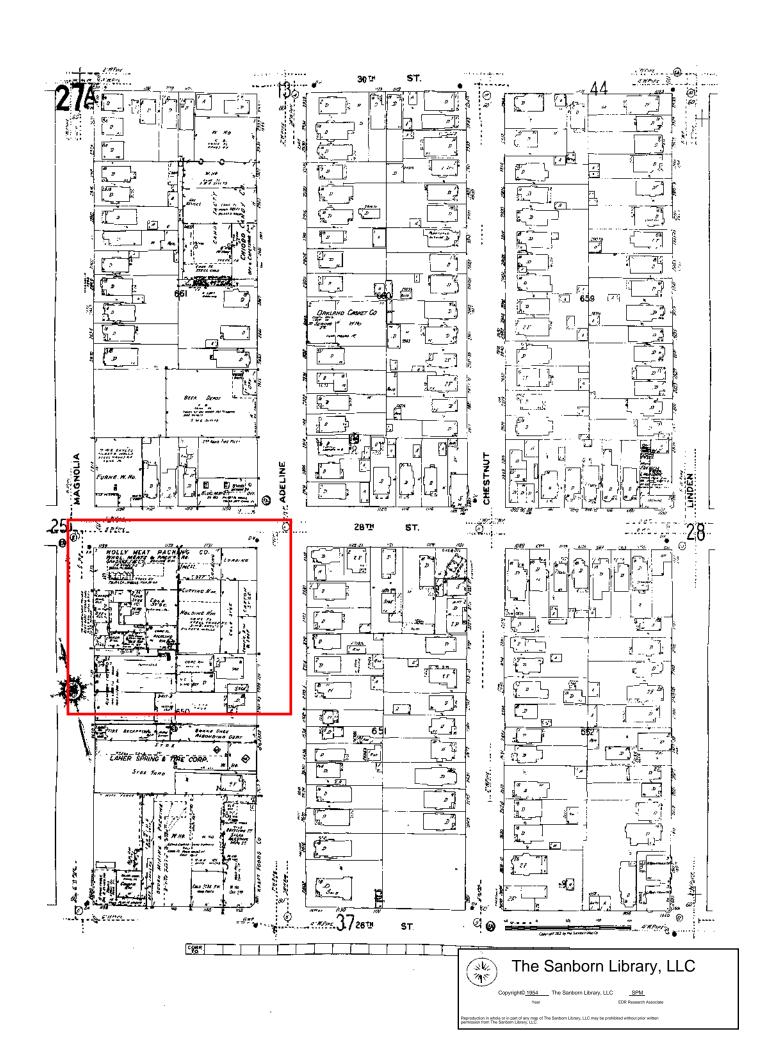

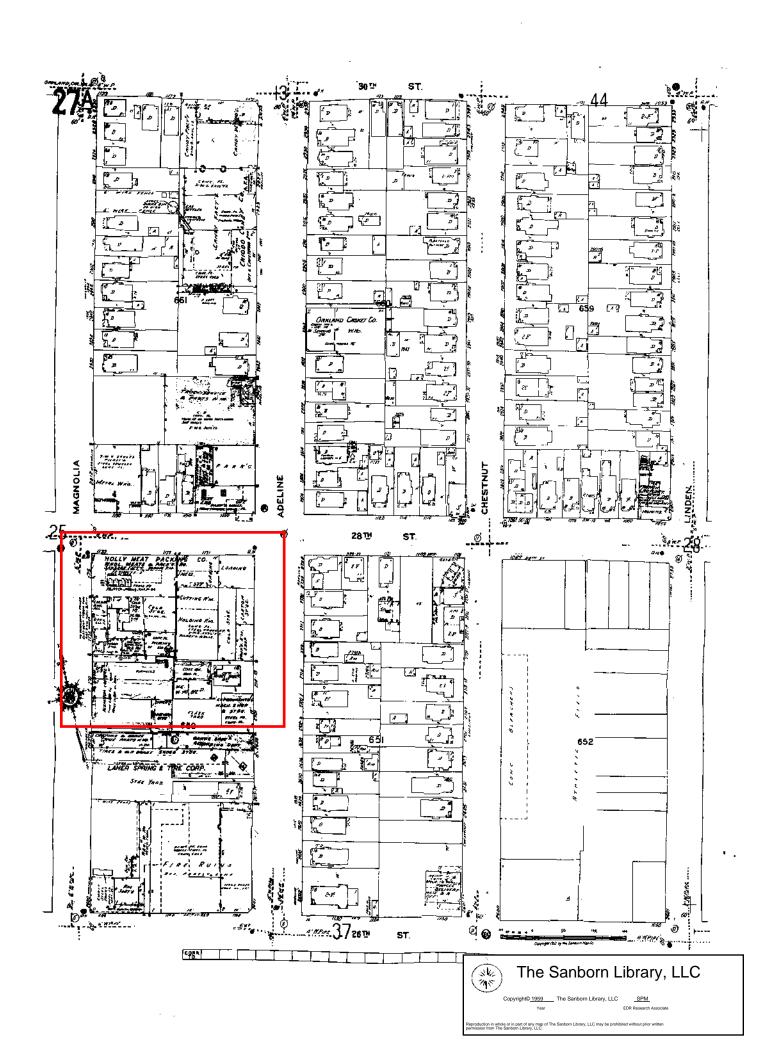

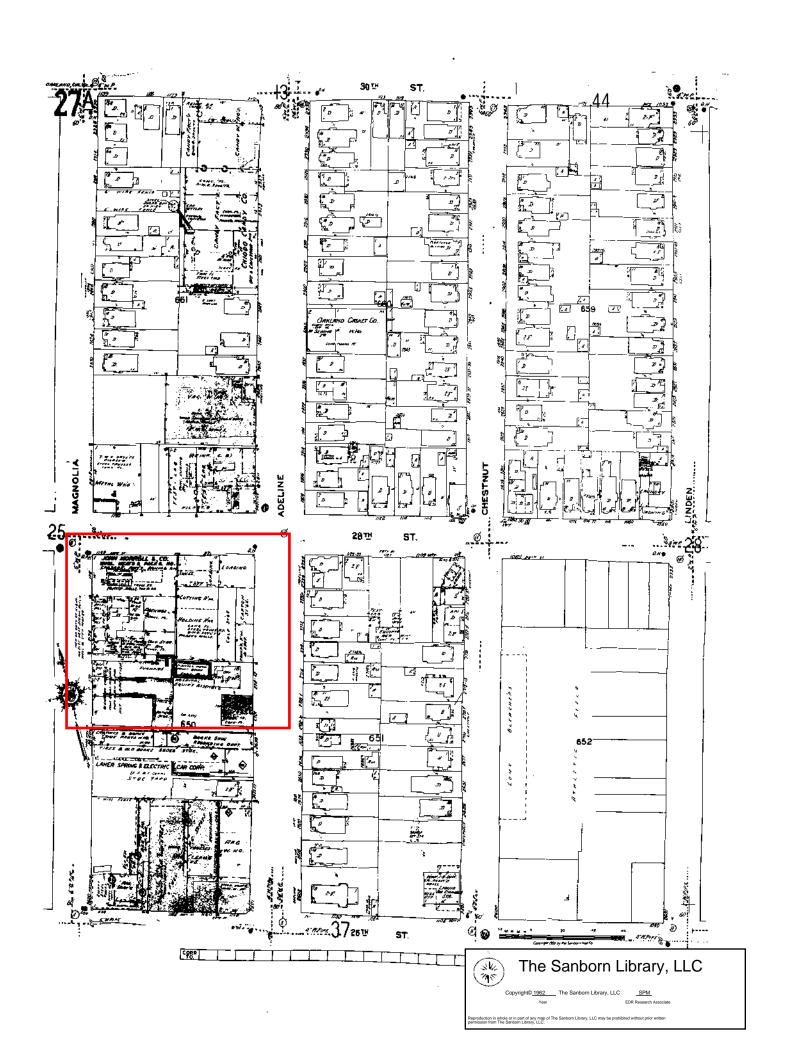


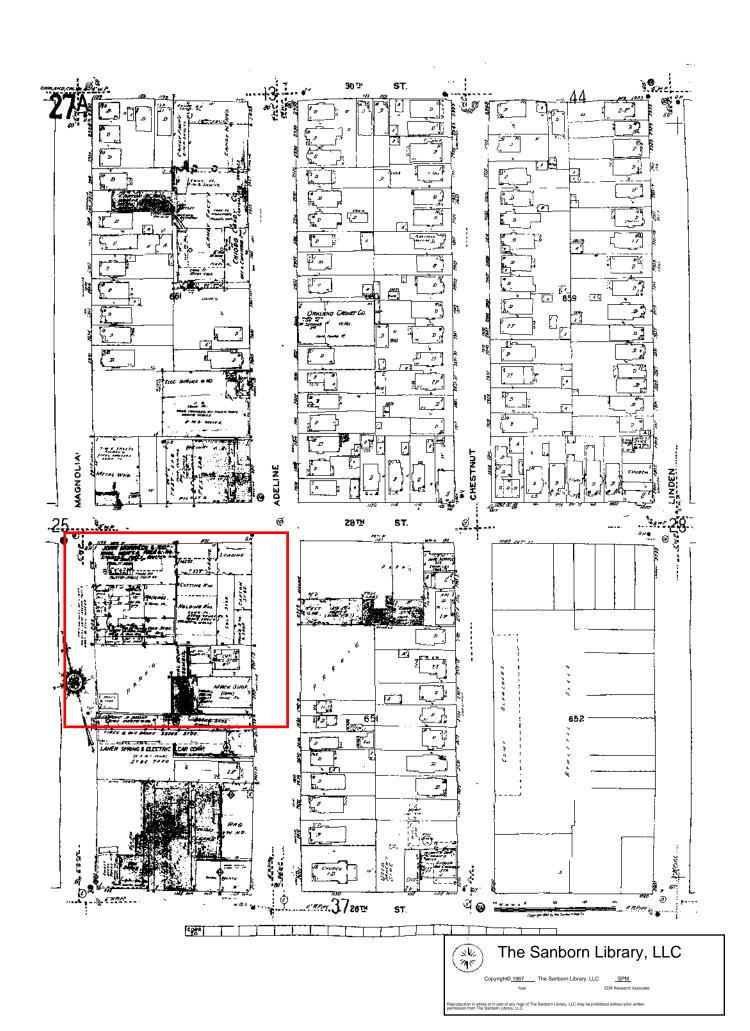


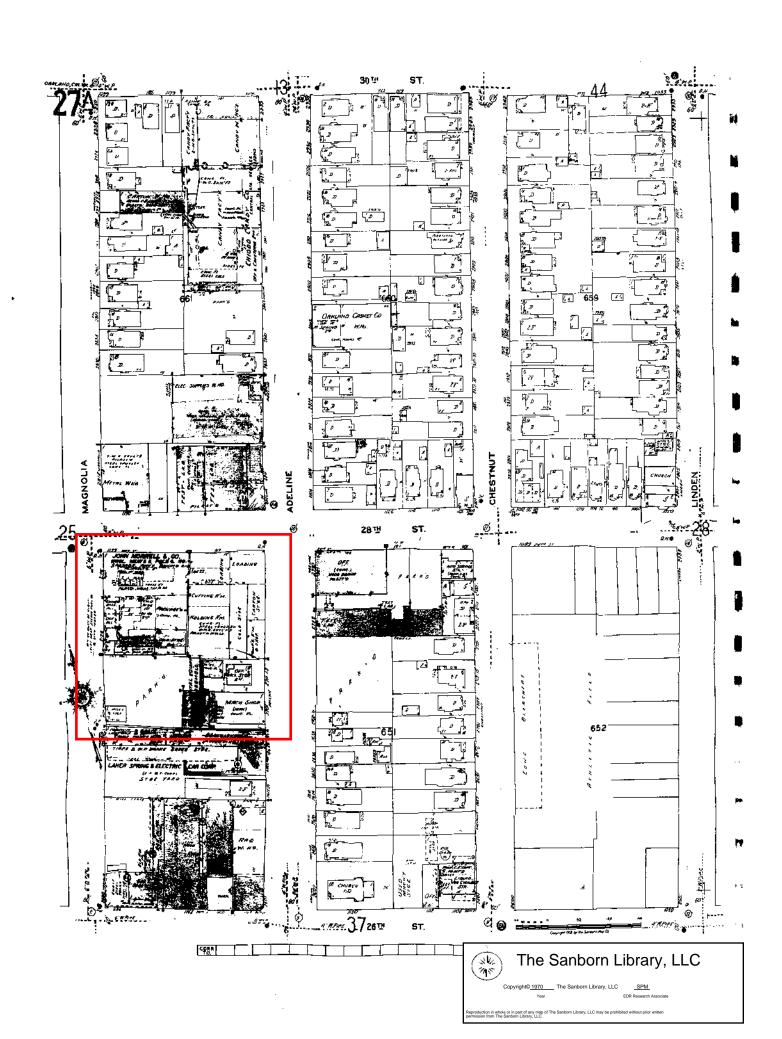

APPENDIX B HISTORICAL AERIAL PHOTOS




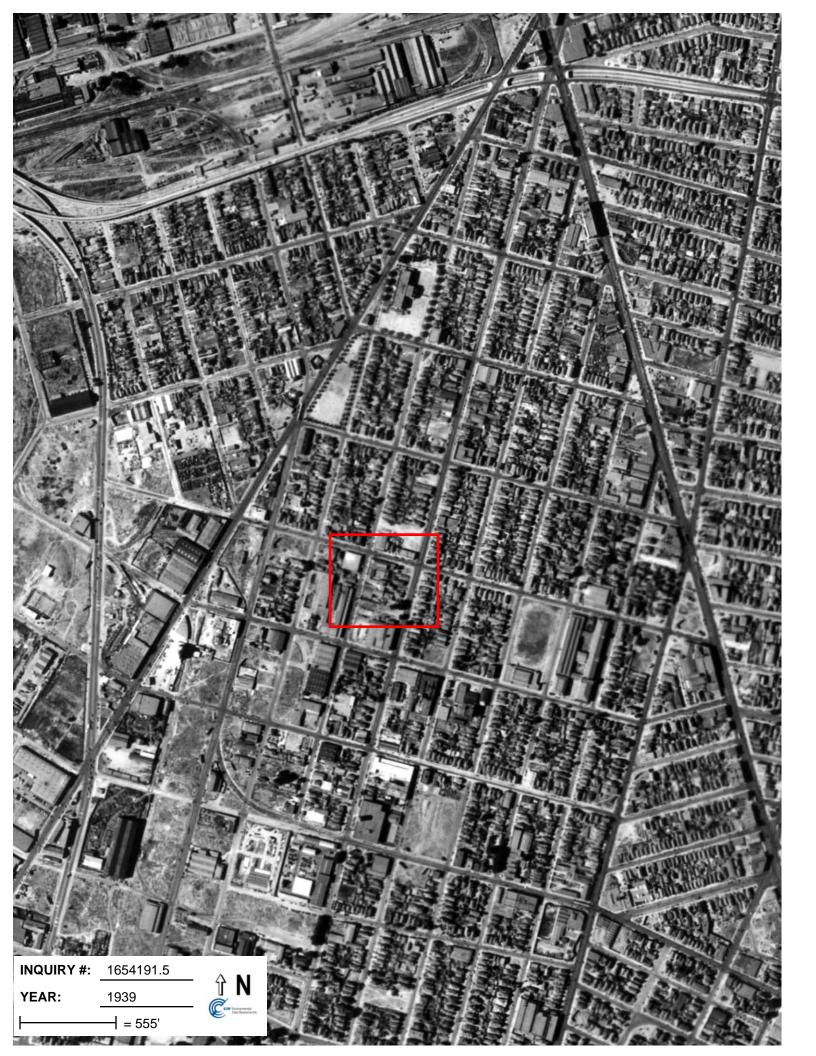

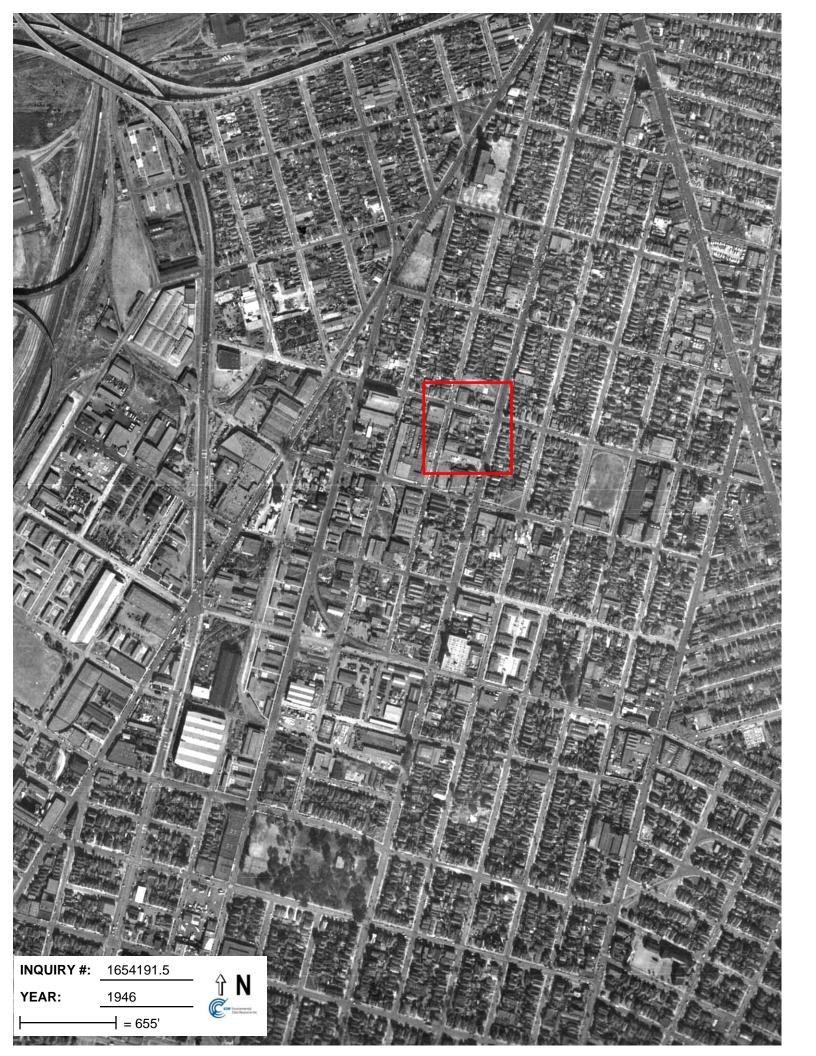






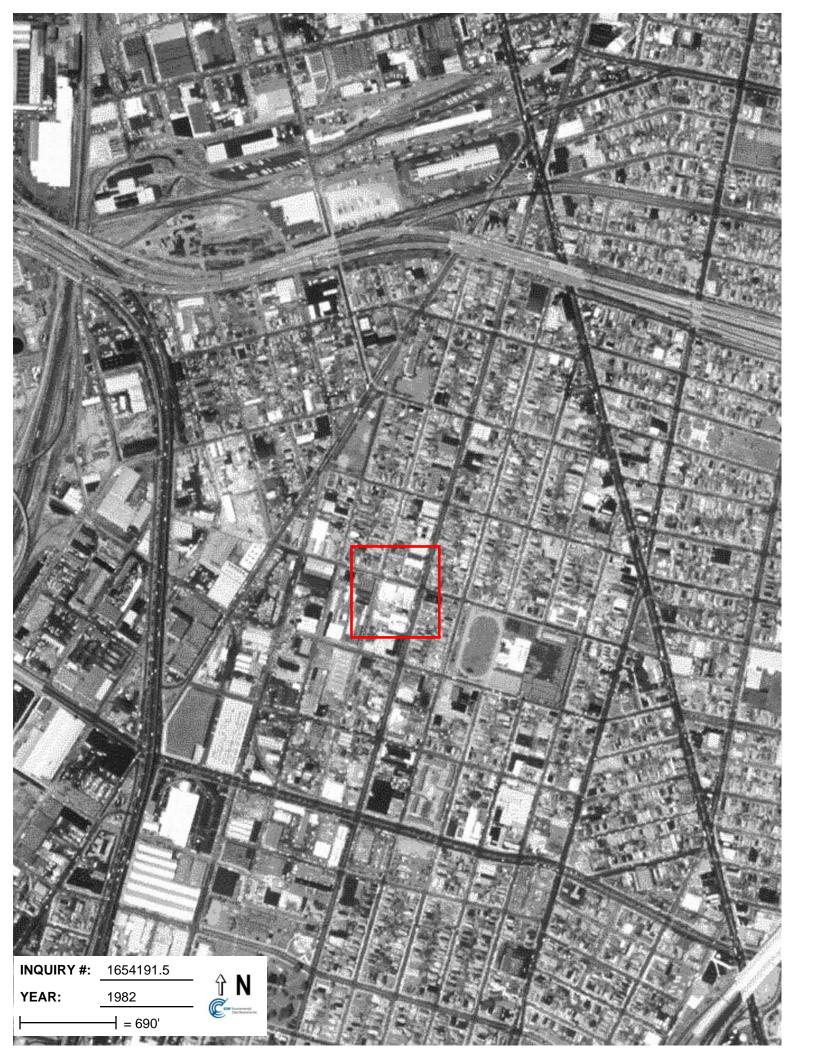



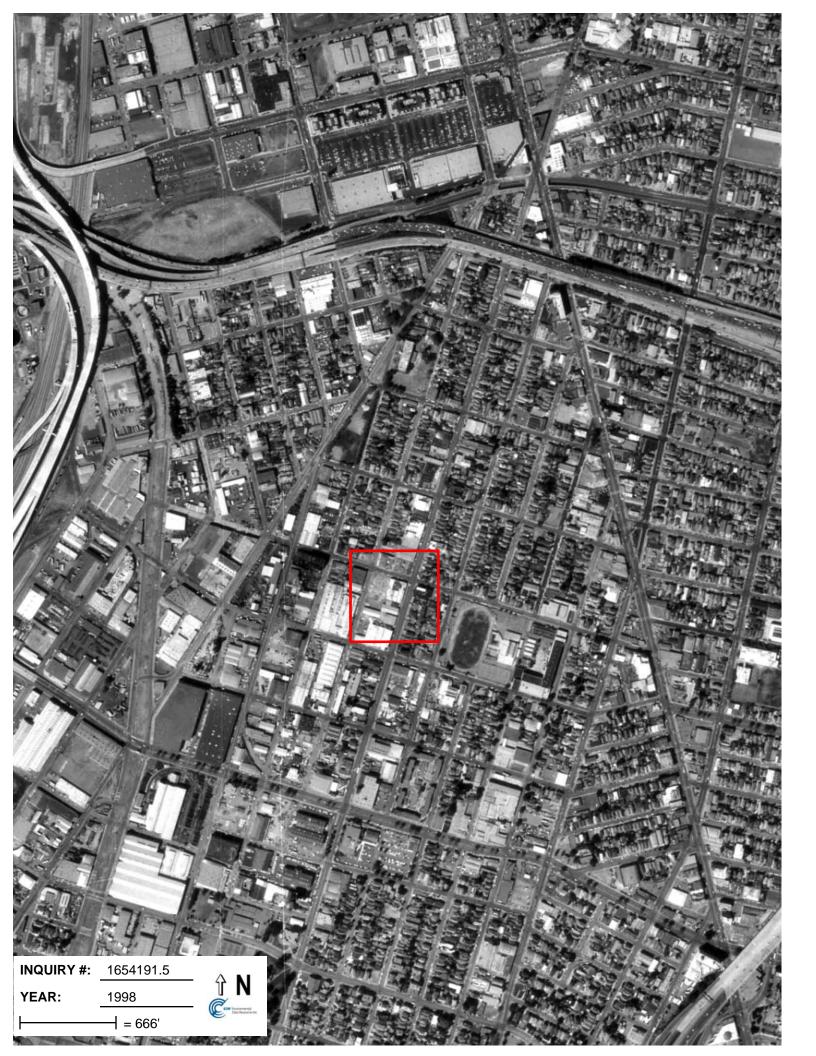

APPENDIX C

PORTIONS OF EDR RADIUS REPORT



The EDR Radius Map with GeoCheck®

Former Coast Sausage Facility 1173 28th Street Oakland, CA 94607

Inquiry Number: 1654191.2s

April 13, 2006

The Standard in Environmental Risk Management Information

440 Wheelers Farms Road Milford, Connecticut 06461

Nationwide Customer Service

Telephone: 1-800-352-0050 Fax: 1-800-231-6802 Internet: www.edrnet.com

TABLE OF CONTENTS

SECTION	PAGE	
Executive Summary	ES1	
Overview Map	2	
Detail Map	3	
Map Findings Summary	4	
Map Findings	6	
Orphan Summary	219	
EPA Waste Codes	EPA- 1	
Government Records Searched/Data Currency Tracking.	GR-1	
GEOCHECK ADDENDUM	,	
Physical Setting Source Addendum	A-1	
Physical Setting Source Summary	A-2	
Physical Setting SSURGO Soil Map.		
Physical Setting Source Map.	A-8	
Physical Setting Source Map Findings.	A-9	
Physical Setting Source Records Searched	A-20	

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2006 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-05) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

1173 28TH STREET OAKLAND, CA 94607

COORDINATES

Latitude (North): 37.820000 - 37° 49' 12.0" Longitude (West): 122.283000 - 122° 16' 58.8"

Universal Tranverse Mercator: Zone 10 UTM X (Meters): 563106.2 UTM Y (Meters): 4185880.8

Elevation: 14 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map: 37122-G3 OAKLAND WEST, CA

Most Recent Revision: 1980

TARGET PROPERTY SEARCH RESULTS

The target property was identified in the following government records. For more information on this property see page 6 of the attached EDR Radius Map report:

Site	Database(s)	EPA ID
RUSH PROPERTY 28TH ST 1173 28TH ST OAKLAND, CA 94608	CS	N/A
1173 28TH 1173 28TH OAKLAND, CA	CHMIRS	N/A
1173 28TH ST 1173 28TH ST OAKLAND, CA 94607	ERNS	N/A

EXECUTIVE SUMMARY

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

FEDERAL RECORDS

NPL...... National Priority List

System

CORRACTS...... Corrective Action Report

US ENG CONTROLS...... Engineering Controls Sites List
US INST CONTROL....... Sites with Institutional Controls
US BROWNFIELDS........ A Listing of Brownfields Sites

CONSENT...... Superfund (CERCLA) Consent Decrees

TRIS...... Toxic Chemical Release Inventory System

TSCA..... Toxic Substances Control Act

FTTS...... FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, &

Rodenticide Act)/TSCA (Toxic Substances Control Act)

MINES..... Mines Master Index File

FINDS Facility Index System/Facility Registry System
RAATS RCRA Administrative Action Tracking System

STATE AND LOCAL RECORDS

NFA..... No Further Action Determination

REF...... Unconfirmed Properties Referred to Another Agency

WMUDS/SWAT..... Waste Management Unit Database

UST...... Active UST Facilities

AST..... Aboveground Petroleum Storage Tank Facilities

DEED...... Deed Restriction Listing CLEANERS..... Cleaner Facilities

WIP..... Well Investigation Program Case List

TRIBAL RECORDS

INDIAN RESERV..... Indian Reservations

EXECUTIVE SUMMARY

INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land INDIAN UST..... Underground Storage Tanks on Indian Land

EDR PROPRIETARY RECORDS

Manufactured Gas Plants... EDR Proprietary Manufactured Gas Plants EDR Historical Auto StationsEDR Proprietary Historic Gas Stations EDR Historical Cleaners..... EDR Proprietary Historic Dry Cleaners

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.

Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in **bold italics** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

FEDERAL RECORDS

CERCLIS-NFRAP: Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

A review of the CERC-NFRAP list, as provided by EDR, and dated 02/01/2006 has revealed that there are 2 CERC-NFRAP sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
ZERO WASTE SYSTS INC	1450 32ND ST	1/4 - 1/2 NNW	U67	90
Lower Elevation	Address	Dist / Dir	Map ID	Page
DONCO INDUSTRIES - OAK	2401 UNION ST.	1/8 - 1/4 SW	44	64

RCRAInfo: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System(RCRIS). The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate

between 100 kg and 1,000 kg of hazardous waste per month Large quantity generators generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

A review of the RCRA-LQG list, as provided by EDR, and dated 02/21/2006 has revealed that there is 1 RCRA-LQG site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Dist / Dir	Map ID	Page
PACIFIC CRYOGENICS INCORPORATE	2311 MAGNOLIA STREET	1/8 - 1/4 SSW	/ 54	<i>7</i> 8

RCRAInfo: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System(RCRIS). The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month Large quantity generators generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

A review of the RCRA-SQG list, as provided by EDR, and dated 02/24/2006 has revealed that there are 11 RCRA-SQG sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
MATRECON INC	2811 ADELINE ST		B4	8
TESTING ENGINEERS, INC	2811 ADELINE ST	0 - 1/8 ENE	B5	8
CALIFORNIA ELECTRIC CO	3015 ADELINE ST	1/8 - 1/4 NNE	20	24
LENNYS AUTO BODY & PAINTING	3116 ADELINE	1/8 - 1/4NNE	46	66
Lower Elevation	Address	Dist / Dir	Map ID	Page
ENGLUND STUDIO	2534 MAGNOLIA ST UNIT A	0 - 1/8 SSW	11	12
ZERO WASTE SYSTEMS, INC.	2928 POPLAR ST	1/8 - 1/4 NW	<i>1</i> 27	34
CHEMICALS FOR RESEARCH & IND	2928 POPLAR ST	1/8 - 1/4 NW	<i>1</i> 28	36
NORTHWESTERN VENETIAN SUPPLY C	1218 24TH ST	1/8 - 1/4SSW	M40	55
MORGAN ENVIRONMENTAL SERVICES	2433 POPLAR ST	1/8 - 1/4SW	<i>047</i>	68
MORGAN ENVIRONMENTAL SERVICES	2433 POPLAR ST MAIN OFF	1/8 - 1/4WSW	O48	71
OAKLAND SCAVENGER COMPANY	2601 PERALTA STREET	1/8 - 1/4W	Q52	76

Federal Lands: Consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

A review of the DOD list, as provided by EDR, and dated 12/31/2004 has revealed that there is 1 DOD site within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
OAKLAND ARMY BASE (CLOSED)		1/2 - 1 WNV	V 0	7

FUDS: The Listing includes locations of Formerly Used Defense Sites Properties where the US Army Corps Of Engineers is actively working or will take necessary cleanup actions.

A review of the FUDS list, as provided by EDR, and dated 12/05/2005 has revealed that there are 2 FUDS sites within approximately 1 mile of the target property.

Lower Elevation	Address	Dist / Dir	Map ID	Page
PACIFIC OVERSEAS AIR SERVICE C		1/4 - 1/2WNV	V 124	188
ARMY-NAVY DISTRIBUTING CENTER		1/2 - 1 W	133	206

STATE AND LOCAL RECORDS

AWP: California DTSC's Annual Workplan, formerly known as BEP, identifies known hazardous substance sites targeted for cleanup. The source is the California Environmental Protection Agency.

A review of the AWP list, as provided by EDR, and dated 08/08/2005 has revealed that there are 2 AWP sites within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
HARRIS DRY CLEANERS	2801 MARTIN LUTHER KING	1/2 - 1 ESE	135	208
Lower Elevation	Address	Dist / Dir	Map ID	Page
NORTHWESTERN VENETIAN SUPPLY C	1218 24TH STREET	1/8 - 1/4 SSW	M39	54

CAL-SITES: Formerly known as ASPIS, this database contains both known and potential hazardous substance sites. The source is the California Department of Toxic Substance Control.

A review of the Cal-Sites list, as provided by EDR, and dated 08/08/2005 has revealed that there are 3 Cal-Sites sites within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
HARRIS DRY CLEANERS Facility Status: ANNUAL WORKPLAN (A	2801 MARTIN LUTHER KING AWP) - ACTIVE SITE	1/2 - 1 ESE	135	208
Lower Elevation	Address	Dist / Dir	Map ID	Page
NORTHWESTERN VENETIAN SUPI Facility Status: ANNUAL WORKPLAN (A		1/8 - 1/4 SSW	M39	54
ALAMEDA CHEMICAL AND SCIENT Facility Status: CERTIFIED AS HAVING	IFI 2668 HANNAH STREET BEEN REMEDIED SATISFACTORILY UNDE	1/8 - 1/4WNW R DTSC OVERSIGI		64

BEP: Department of Health Services developed a site-specific expenditure plan as the basis for an appropriation of Hazardous Substance Cleanup Bond Act funds. It is not updated.

A review of the CA BOND EXP. PLAN list, as provided by EDR, and dated 01/01/1989 has revealed that there are 3 CA BOND EXP. PLAN sites within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
ELECTRO-COATINGS, INC	1421 PARK AVENUE	1/2 - 1 NNW	/ 140	211

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
PACIFIC GAS & ELECTRIC COMPANY	4525 HOLLIS STREET	1/2 - 1 NNW	143	214
Lower Elevation	Address	Dist / Dir	Map ID	Page
SOUTHERN PACIFIC TRANSPORTATIO	1707 WOOD STREET	1/2 - 1 WSW	AK137	210

NFE: This category contains properties that are suspected of being contaminated. These are unconfirmed contaminated properties that need to beassessed using the PEA process. PEA in Progress indicates properties where DTSC has determined a PEA is required, but not currently underway.

A review of the NFE list, as provided by EDR, and dated 08/08/2005 has revealed that there is 1 NFE site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Dist / Dir	Map ID	Page
LAHER SPRING AND ELECTRIC CAR	2419 MAGNOLIA STREET	1/8 - 1/4 SSW	G29	38

TOXIC PITS: The Toxic Pits Cleanup Act Sites database identifies sites suspected of containing hazardous substances where cleanup has not yet been completed. The data come from the State Water Resources Control Board.

A review of the Toxic Pits list, as provided by EDR, and dated 07/01/1995 has revealed that there are 2 Toxic Pits sites within approximately 1 mile of the target property.

Lower Elevation	Address	Dist / Dir Map ID	Page
SP, W.OAKLAND YD(OILY WASTE) Closure Date: 04/21/93	1707 WOOD STREET	1/2 - 1 WSW AK138	210
SP, W.OAKLAND YARD-(WASHWATER) Closure Date: 06/30/92	1707 WOOD STREET	1/2 - 1 WSW AK139	211

CORTESE: This database identifies public drinking water wells with detectable levels of contamination, hazardous substance sites selected for remedial action, sites with known toxic material identified through the abandoned site assessment program, sites with USTs having a reportable release and all solid waste disposal facilities from which there is known migration. The source is the California Environmental Protection Agency/Office of Emergency Information.

A review of the Cortese list, as provided by EDR, and dated 04/01/2001 has revealed that there are 63 Cortese sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
BROOKS AUTO SERVICE	1101 28TH ST	0 - 1/8 E	D9	9
CALIFORNIA ELECTRIC CO	3015 ADELINE ST	1/8 - 1/4 NNE	20	24
GOLDEN STATE LINEN SERVIC	958 28TH	1/4 - 1/2 E	R59	85
KENT CROWLEY	3016 FILBERT ST	1/4 - 1/2 ENE	60	85
MCCLYMOND HIGH SCHOOL	2607 MYRTLE ST	1/4 - 1/2 ESE	66	88
ZERO WASTE SYSTEMS INC	1450 32ND	1/4 - 1/2 NNW	U68	90
CAL WEST PERIODICALS	2400 FILBERT ST	1/4 - 1/2 SSE	71	92
AB CO WATERPROOFING	3135 FILBERT ST	1/4 - 1/2 ENE	<i>7</i> 8	105
ROMAK IRON WORKS	3250 HOLLIS ST	1/4 - 1/2 N	<i>7</i> 9	106
SAFEWAY ICE CREAM PLANT	2240 FILBERT ST	1/4 - 1/2 SSE	Y81	110
WSB ELECTRIC COMPANY	3032 MARKET ST	1/4 - 1/2 E	82	113

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
COMMERCIAL PROPERTY	1000 GRAND AVE W	1/4 - 1/2 SSE	Y83	115
TUNE UP MASTERS #318	2901 SAN PABLO AVE	1/4 - 1/2 E	AA86	120
THREE H TRUCK AND AUTO CENTER	2801 SAN PABLO AVE	1/4 - 1/2 ESE	AB89	124
CITY OF MORGAN HILL CORP	3427 MAGNOLIA	1/4 - 1/2 NNE	95	132
GUITON BUS LINES	3421 HOLLIS ST	1/4 - 1/2 N	98	132
DOUGCO INC	1073 34TH ST	1/4 - 1/2 NNE	AC99	136
HEMSATH DRAYAGE	1350 34TH ST	1/4 - 1/2 N	101	140
LOOMIS ARMORED INC	936 BROCKHURST ST	1/4 - 1/2 ENE	104	144
CLAWSON HIGH SCHOOL	3420 PERALTA ST	1/4 - 1/2 N	AE105	146
CITY WOOD	3423 HARLAN ST	1/4 - 1/2 N	AE107	149
THRIFTY OIL	3400 SAN PABLO AVE	1/4 - 1/2 NE	AH112	157
SHELL	3420 SAN PABLO AVE	1/4 - 1/2 NE	AH117	169
ARCO # 02169	889 GRAND AVE W	1/4 - 1/2SSE	_	172
OAKLAND FIRE STATION #5	934 34TH ST	1/4 - 1/2NE	131	200
Lower Elevation	Address	Dist / Dir	Map ID	Page
CUSTON ALLOY SCRAP SALES	2711 UNION	0 - 1/8 WNW	/ C7	9
AERVOE PACIFIC	2528 ADELINE ST	1/8 - 1/4S	E12	15
NONE	1229 28TH	1/8 - 1/4 WNV	/ 14	19
LINDFORD AIR & REFRIGERATION	2850 POPLAR	1/8 - 1/4 NW	F19	23
BLOUNT INTERNATIONAL, LTD.	2452 MAGNOLIA ST	1/8 - 1/4 SSW	G23	30
WESTERN SEAFARE COMPANY	1301 26TH ST	1/8 - 1/4 WSW	/ H25	31
EASTSHORE LINES INC	2400 ADELINE ST	1/8 - 1/4S	K33	45
CUSTOM ALLOY SCRAP SALES	2730 PERALTA ST	1/8 - 1/4 WNW	/ L36	52
RB MATHESON HOLDINGS	2500 POPLAR ST	1/8 - 1/4 WSW	/ N41	55
RESIDENTIAL	2856 HELEN ST	1/8 - 1/4 NW	45	65
MORGAN ENVIRONMENTAL SERVICES	2433 POPLAR ST	1/8 - 1/4 SW	047	68
OAKLAND SCAVENGER COMPANY	2601 PERALTA ST	1/8 - 1/4 W	Q51	<i>7</i> 3
PACIFIC CRYOGENICS INCORPORATE	2311 MAGNOLIA STREET	1/8 - 1/4 SSW	54	<i>7</i> 8
NED CLYDE CONSTRUCTION	2311 ADELINE ST	1/8 - 1/4 S	P55	80
JH FITZMAURICE INC	2857B HANNAH ST	1/4 - 1/2 NW	S57	82
CLARKE CRAMER INC	2500 KIRKHAM ST	1/4 - 1/2 WSИ	/ 6 5	88
CALIFORNIA BRAKE AND CLUT	2221 UNION	1/4 - 1/2 SW	W72	93
C. E. TOLAND & SON, INC.	2635 PERALTA	1/4 - 1/2 W	<i>7</i> 3	95
WALKER'S CONCRETE	2400 PERALTA ST	1/4 - 1/2 WSИ	/ 74	96
SAN CARLOS BEACH	1549 32ND	1/4 - 1/2 NW	X76	103
KANTOR'S FURNITURE	2525 CYPRESS	1/4 - 1/2 W	80	108
EBMUD	2130 ADELINE ST	1/4 - 1/2 S	Z 84	117
EAST BAY MUNICIPAL UTILITY DIS	1200 21ST STREET	1/4 - 1/2 S	Z 91	125
JT TRUCKING	2818 CYPRESS ST	1/4 - 1/2 WNV	/ 93	129
CERESKE ELECTRIC	1688 24TH ST	1/4 - 1/2 W	AD100	138
WAREHAM PROPERTY	2855 CYPRESS ST	1/4 - 1/2 WNV	/ 103	142
GENERAL TRANSPORTATION	3211 WOOD ST	1/4 - 1/2 WNV	/ AG111	155
GARDINER MFG COMPANY	1920 UNION ST	1/4 - 1/2 SSW	113	161
PG & E	2121 PERALTA ST	1/4 - 1/2 WSИ	/ 115	166
PACIFIC SUPPLY	1735 24TH ST	1/4 - 1/2 W	116	167
RUSS ELLIOT	2526 WOOD ST	1/4 - 1/2 W	AI120	179
B & P DISMANTLERS	2525 WOOD	1/4 - 1/2 W	AI122	186
WOOD STREET WAREHOUSE	2510 WOOD ST	1/4 - 1/2 W	AI123	186
AT & SF RAILROAD PROPERTY	ALONG WOOD / 32ND STR	1/4 - 1/2 WNV		189
HENRY SHIREK ESTATE	3425 ETTIE ST	1/4 - 1/2 NW		192
C & L TRUCKING	2460 WOOD ST	1/4 - 1/2 W	127	194
CONSTRUCTION YARD	3428 ETTIE ST	1/4 - 1/2 NW		198
CROWN ZELLERBACH	2230 WILLOW ST	1/4 - 1/2 WSW	/ 132	202

SWRCY: A listing of recycling facilities in California.

A review of the SWRCY list, as provided by EDR, and dated 01/05/2006 has revealed that there are 2 SWRCY sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
ALLIANCE METALS	3426 PERALTA ST	1/4 - 1/2 N	AE106	148
Lower Elevation	Address	Dist / Dir	Map ID	Page
CUSTOM ALLOY SCRAP SALES INC	2730 PERALTA ST	1/8 - 1/4 WN	W L35	50

LUST: The Leaking Underground Storage Tank Incident Reports contain an inventory of reported leaking underground storage tank incidents. The data come from the State Water Resources Control Board Leaking Underground Storage Tank Information System.

A review of the LUST list, as provided by EDR, and dated 01/09/2006 has revealed that there are 56 LUST sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
BROOKS AUTO SERVICE Facility Status: Preliminary site assessment ur	1101 28TH ST nderway	0 - 1/8 E	D9	9
CALIFORNIA ELECTRIC CO Facility Status: Case Closed	3015 ADELINE ST	1/8 - 1/4NNE	20	24
GOLDEN STATE LINEN SERVICE Facility Status: Case Closed	958 28TH ST	1/4 - 1/2E	R58	84
KENT CROWLEY Facility Status: Case Closed	3016 FILBERT ST	1/4 - 1/2 ENE	60	85
MCCLYMOND HIGH SCHOOL Facility Status: Preliminary site assessment ur	2607 MYRTLE ST nderway	1/4 - 1/2 ESE	66	88
ATLAS HEATING & AIR CONDITIONI Facility Status: Leak being confirmed	1451 32ND STREET	1/4 - 1/2 NNW	V70	90
CAL WEST PERIODICALS Facility Status: Case Closed	2400 FILBERT ST	1/4 - 1/2 SSE	71	92
AB CO WATERPROOFING Facility Status: Case Closed	3135 FILBERT ST	1/4 - 1/2 ENE	78	105
ROMAK IRON WORKS Facility Status: Case Closed	3250 HOLLIS ST	1/4 - 1/2 N	79	106
WSB ELECTRIC COMPANY Facility Status: Case Closed	3032 MARKET ST	1/4 - 1/2 E	82	113
COMMERCIAL PROPERTY Facility Status: Case Closed	1000 GRAND AVE W	1/4 - 1/2 SSE	Y83	115
TUNE UP MASTERS #318 Facility Status: Case Closed	2901 SAN PABLO AVE	1/4 - 1/2 E	AA86	120
THREE H TRUCK AND AUTO CENTER Facility Status: Case Closed	2801 SAN PABLO AVE	1/4 - 1/2 ESE	AB89	124
GUITON BUS LINES Facility Status: Case Closed	3421 HOLLIS ST	1/4 - 1/2 N	98	132
DOUGCO INC Facility Status: Preliminary site assessment ur	1073 34TH ST nderway	1/4 - 1/2 NNE	AC99	136

Address	Dist / Dir	Map ID	Page
1350 34TH ST	1/4 - 1/2 N	101	140
936 BROCKHURST ST	1/4 - 1/2 ENE	104	144
3420 PERALTA ST	1/4 - 1/2N	AE105	146
3423 HARLAN ST	1/4 - 1/2N	AE107	149
905 GRAND AVE W	1/4 - 1/2SSE	AF108	150
3400 SAN PABLO AVE	1/4 - 1/2NE	AH112	157
3420 SAN PABLO AVE	1/4 - 1/2NE	AH117	169
889 GRAND AVE W way	1/4 - 1/2SSE	AF118	172
934 34TH ST	1/4 - 1/2 NE	131	200
Address	Dist / Dir	Map ID	Page
2528 ADELINE ST way	1/8 - 1/4S	E12	15
2528 ADELINE ST	1/8 - 1/4S	E13	17
2850 POPLAR ST	1/8 - 1/4NW	F17	20
2452 MAGNOLIA ST	1/8 - 1/4SSW	G21	28
1301 26TH ST	1/8 - 1/4WSW	H25	31
2400 ADELINE ST	1/8 - 1/4S	K33	45
2730 PERALTA ST	1/8 - 1/4 WNW	' L35	50
2500 POPLAR ST ay	1/8 - 1/4WSW	N41	55
2856 HELEN ST way	1/8 - 1/4NW	45	65
2433 POPLAR ST	1/8 - 1/4SW	O47	68
2601 PERALTA ST	1/8 - 1/4W	Q51	73
2311 MAGNOLIA STREET	1/8 - 1/4SSW	54	78
2311 ADELINE ST	1/8 - 1/4S	P55	80
	2350 34TH ST 236 BROCKHURST ST 2420 PERALTA ST 2423 HARLAN ST 205 GRAND AVE W 2420 SAN PABLO AVE 2420 SAN PABLO AVE 2434 34TH ST 2452 ADELINE ST 2452 MAGNOLIA ST 2400 ADELINE ST 2400 ADELINE ST 2430 PERALTA ST 2433 POPLAR ST 2433 POPLAR ST 2433 POPLAR ST 2431 MAGNOLIA STREET	1/4 - 1/2 N 1/4 - 1/4 N 1/4 N	1/4 - 1/2N 101 101 1036 BROCKHURST ST 1/4 - 1/2N 104 104 104 105 104 105

Lower Elevation	Address	Dist / Dir	Map ID	Page
JH FITZMAURICE INC Facility Status: Case Closed	2857B HANNAH ST	1/4 - 1/2 NW	S57	82
C. E. TOLAND & SON, INC. Facility Status: Case Closed	2635 PERALTA	1/4 - 1/2 W	73	95
WALKER'S CONCRETE Facility Status: Case Closed	2400 PERALTA ST	1/4 - 1/2 WSW	74	96
KANTOR'S FURNITURE Facility Status: Case Closed	2525 CYPRESS	1/4 - 1/2 W	80	108
EBMUD Facility Status: Preliminary site assessment und	2130 ADELINE ST erway	1/4 - 1/2S	Z84	117
EAST BAY MUNICIPAL UTILITY DIS Facility Status: Preliminary site assessment und	1200 21ST STREET erway	1/4 - 1/2S	Z 91	125
JT TRUCKING Facility Status: Case Closed	2818 CYPRESS ST	1/4 - 1/2 WNW	93	129
CERESKE ELECTRIC Facility Status: Preliminary site assessment und	1688 24TH ST erway	1/4 - 1/2 W	AD100	138
WAREHAM PROPERTY Facility Status: Preliminary site assessment und	2855 CYPRESS ST erway	1/4 - 1/2 WNW	103	142
GENERAL TRANSPORTATION Facility Status: Preliminary site assessment und	3211 WOOD ST erway	1/4 - 1/2 WNW	' AG111	155
GARDINER MFG COMPANY Facility Status: Case Closed	1920 UNION ST	1/4 - 1/2SSW	113	161
PG & E Facility Status: Case Closed	2121 PERALTA ST	1/4 - 1/2 WSW	115	166
PACIFIC SUPPLY Facility Status: Remedial action (cleanup) Under	1735 24TH ST way	1/4 - 1/2 W	116	167
RUSS ELLIOT Facility Status: Preliminary site assessment und	2526 WOOD ST erway	1/4 - 1/2 W	AI120	179
WOOD STREET WAREHOUSE Facility Status: Case Closed	2510 WOOD ST	1/4 - 1/2 W	AI123	186
HENRY SHIREK ESTATE Facility Status: Case Closed	3425 ETTIE ST	1/4 - 1/2 NW	AJ126	192
C & L TRUCKING Facility Status: Post remedial action monitoring	2460 WOOD ST	1/4 - 1/2 W	127	194
TULLUCH CONSTRUCTION COMPANY Facility Status: Pollution Characterization	3428 ETTIE ST	1/4 - 1/2NW	AJ130	199
CROWN ZELLERBACH Facility Status: Case Closed	2230 WILLOW ST	1/4 - 1/2 WSW	132	202

CA FID: The Facility Inventory Database contains active and inactive underground storage tank locations. The source is the State Water Resource Control Board.

A review of the CA FID UST list, as provided by EDR, and dated 10/31/1994 has revealed that there are 11 CA FID UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
SERVISCO, GOLDEN STATE LINEN	958 028TH ST	1/8 - 1/4 <i>E</i>	15	19
CALIFORNIA ELECTRIC CO	3015 ADELINE ST	1/8 - 1/4 NNE	20	24
Lower Elevation	Address	Dist / Dir	Map ID	Page
MODERN MAIL SERVICE INC.	2836 UNION ST	0 - 1/8 NW	10	11
AERVOE PACIFIC	2528 ADELINE ST	1/8 - 1/4 S	E12	15
LINFORD AIR & REFRIGERATION	2850 POPLAR ST	1/8 - 1/4 NW	F17	20
BLOUNT INTERNATIONAL, LTD.	2452 MAGNOLIA ST	1/8 - 1/4 SSW	G23	30
WESTERN SEAFARE COMPANY	1301 26TH ST	1/8 - 1/4 WSW	' H25	31
EAST BAY SHEET METAL	2914 POPLAR ST	1/8 - 1/4 NW	<i>1</i> 26	33
BUS STORAGE YARD EASTSHORE	2400 ADELINE ST	1/8 - 1/4S	K34	49
RB MATHESON HOLDINGS	2500 POPLAR ST	1/8 - 1/4 WSW	N41	55
OAKLAND SCAVENGER COMPANY	2601 PERALTA ST	1/8 - 1/4 W	Q51	73

CA SLIC: SLIC Region comes from the California Regional Water Quality Control Board.

A review of the SLIC list, as provided by EDR, and dated 01/09/2006 has revealed that there are 4 SLIC sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
SAFEWAY ICE CREAM PLANT	2240 FILBERT ST	1/4 - 1/2SSE	Y81	110
Lower Elevation	Address	Dist / Dir	Map ID	Page
<i>EZ REST PRODUCTS NORTHWESTERN VENETIAN BLIND SU</i> GRAND AND POPLAR	2528 ADELINE ST 1218 24TH ST 1250-1276 WEST GRAND AV	1/8 - 1/4 S 1/8 - 1/4 SSW 1/4 - 1/2 SSW		17 53 103

Alameda CS: A listing of contaminated sites overseen by the Toxic Release Program (oil and groundwater contamination from chemical releases and spills) and the Leaking Underground Storage Tank Program (soil and ground water contamination from leaking petroleum USTs).

A review of the CS list, as provided by EDR, and dated 02/16/2006 has revealed that there are 68 CS sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
BROOK'S AUTO SERVICE	1101 28TH ST	0 - 1/8 E	D8	9
CALIFORNIA ELECTRIC CO	3015 ADELINE ST	1/8 - 1/4NNE	20	24
KENT CROWLEY	3016 FILBERT ST	1/4 - 1/2 ENE	60	85
LITTLE PROPERTY	1201 32ND AVE	1/4 - 1/2 N	T62	87
MAGNOLIA STREET LLC PROPERTY	1200 32ND ST	1/4 - 1/2 N	T63	87
POCKET DEVELOPMENT	1200 32ND ST	1/4 - 1/2 N	T64	87
MCCLYMOND HIGH SCHOOL	2607 MYRTLE ST	1/4 - 1/2 ESE	66	88
ATLAS HEATING & AIR CONDITIONI	1451 32ND AVE	1/4 - 1/2NNW	V69	90
CAL WEST PERIODICALS	2400 FILBERT ST	1/4 - 1/2 SSE	71	92
AB CO WATERPROOFING	3135 FILBERT ST	1/4 - 1/2 ENE	<i>7</i> 8	105
ROMAK IRON WORKS	3250 HOLLIS ST	1/4 - 1/2 N	<i>7</i> 9	106
SAFEWAY ICE CREAM PLANT	2240 FILBERT ST	1/4 - 1/2 SSE	Y81	110
WSB ELECTRIC COMPANY	3032 MARKET ST	1/4 - 1/2 E	82	113
COMMERCIAL PROPERTY	1000 GRAND AVE W	1/4 - 1/2 SSE	Y83	115
CHUNG PROPERTY	2926-2942 SAN PABLO AVE	1/4 - 1/2E	AA85	120

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
TUNE-UP MASTERS #318	2901 SAN PABLO AVE	1/4 - 1/2 E	AA87	122
CALIFORNIA AUTO REPAIR	2801 SAN PABLO AVE	1/4 - 1/2ESE		125
BURKE PROPERTY	949 W GRAND AVE	1/4 - 1/2SSE		131
DOUGCO METAL FINISHING GUITON BUS LINES	1073 34TH ST 3421 HOLLIS ST	1/4 - 1/2NNE 1/4 - 1/2N	98	132 132
HEMSATH DRAYAGE	1350 34TH ST	1/4 - 1/2 N 1/4 - 1/2 N	90 101	140
ORTON & LIBITZKY PROPERTY AKA	2303-2317 MARKET ST	1/4 - 1/2 SE	102	142
LOOMIS ARMORED INC	936 BROCKHURST ST	1/4 - 1/2 ENE		144
CLAWSON HIGH SCHOOL	3420 PERALTA ST	1/4 - 1/2 N	AE105	146
CITY WOOD	3423 HARLAN ST	1/4 - 1/2 N	AE107	149
MAC AUTO REPAIR	905 W GRAND AVE	1/4 - 1/2 SSE		152
THRIFTY OIL	3400 SAN PABLO AVE	1/4 - 1/2 NE	AH112	157
SHELL	3420 SAN PABLO AVE	1/4 - 1/2NE	AH117	169
ARCO FACILITY #02169 OAKLAND FIRE STATION #5	889 W GRAND AVE 934 34TH ST	1/4 - 1/2SSE 1/4 - 1/2NE	AF119 131	174 200
OAKLAND FIRE STATION #5	934 34111 31	1/4 - 1/2 NE	131	200
Lower Elevation	Address	Dist / Dir	Map ID	Page
CUSTOM ALLOY SCRAP SALES (TOXI	2711 UNION ST	0 - 1/8 WNW	/ C6	8
MODERN MAIL SERVICE INC.	2836 UNION ST	0 - 1/8 NW	-	11
AERVOE PACIFIC	2528 ADELINE ST	1/8 - 1/4S	E12	15
NONE	1229 28TH	1/8 - 1/4 WNW		19
LINFORD AIR & REFRIGERATION	2850 POPLAR ST 2452 MAGNOLIA ST	1/8 - 1/4NW 1/8 - 1/4SSW		20 30
BLOUNT INTERNATIONAL, LTD. WESTERN SEAFARE COMPANY	1301 26TH ST	1/8 - 1/4 33W 1/8 - 1/4 WSW		30 31
GIAMPOLINI & COMPANY	2847 PERALTA ST	1/8 - 1/4 NW	J31	42
EASTSHORE LINES INC	2400 ADELINE ST	1/8 - 1/4S	K33	45
CUSTOM ALLOY SCRAP SALES	2730 PERALTA ST	1/8 - 1/4 WNV		52
RB MATHESON HOLDINGS	2500 POPLAR ST	1/8 - 1/4 WSW	/ N41	55
RESIDENTIAL	2856 HELEN ST	1/8 - 1/4 NW	-	65
MORGAN ENVIRONMENTAL SERVICES	2433 POPLAR ST	1/8 - 1/4SW	_	68
OAKLAND SCAVENGER COMPANY	2601 PERALTA ST	1/8 - 1/4 W	Q51	73 70
PACIFIC CRYOGENICS INCORPORATE NED CLYDE CONSTRUCTION	2311 MAGNOLIA STREET 2311 ADELINE ST	1/8 - 1/4SSW 1/8 - 1/4S	54 P55	78 80
J H FITZMAURICE INC	2857 HANNAH ST	1/4 - 1/2 NW		82
CLARKE CRAMER INC	2500 KIRKHAM ST	1/4 - 1/2 WSW		88
CALIFORNIA BRAKE AND CLUT	2221 UNION	1/4 - 1/2 SW		93
C. E. TOLAND & SON, INC.	2635 PERALTA	1/4 - 1/2 W	<i>7</i> 3	95
WALKER'S CONCRETE	2400 PERALTA ST	1/4 - 1/2 WSW	/ 74	96
DON TORKINGTON	1549 32ND ST	1/4 - 1/2 NW		104
KANTOR'S FURNITURE	2525 CYPRESS	1/4 - 1/2 W	80	108
EBMUD	2130 ADELINE ST	1/4 - 1/2 S	Z84	117
EAST BAY MUNICIPAL UTILITY DIS FRANK'S TIRE SERVICE	1200 21ST STREET	1/4 - 1/2S	Z91	125 120
JT TRUCKING	1115 21ST ST 2818 CYPRESS ST	1/4 - 1/2 S 1/4 - 1/2 WNW	92 7 03	129 129
HOA HUYNH	1685 24TH ST	1/4 - 1/2 W	AD97	132
CERESKE ELECTRIC	1688 24TH ST	1/4 - 1/2 W	AD100	138
GENERAL TRANSPORTATION	3211 WOOD ST	1/4 - 1/2 WNV		155
GARDINER MFG COMPANY	1920 UNION ST	1/4 - 1/2 SSW	113	161
PACIFIC SUPPLY	1735 24TH ST	1/4 - 1/2 W	116	167
RUSS ELLIOT	2526 WOOD ST	1/4 - 1/2 W	AI120	179
WOOD STREET WAREHOUSE	2510 WOOD ST	1/4 - 1/2 W	AI123	186
HENRY SHIREK ESTATE	3425 ETTIE ST	1/4 - 1/2 NW	AJ126	192
C & L TRUCKING TULLOCH CONSTRUCTION INC	2460 WOOD ST 3428 ETTIE ST	1/4 - 1/2 W 1/4 - 1/2 NW	127 A 1128	194 196
CROWN ZELLERBACH	2230 WILLOW ST	1/4 - 1/2NW 1/4 - 1/2WSW		196 202
ONO HIN ELLELINDAVII	LLUJ IIILLUII UI	./- //2 1/3/1	102	202

HIST UST: Historical UST Registered Database.

A review of the HIST UST list, as provided by EDR, and dated 10/15/1990 has revealed that there are 7 HIST UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
CALIFORNIA ELECTRIC CO	3015 ADELINE ST	1/8 - 1/4NNE	20	24
Lower Elevation	Address	Dist / Dir	Map ID	Page
LINFORD AIR & REFRIGERATION C	2850 POPLAR ST	1/8 - 1/4 NW	F18	23
BLOUNT INTERNATIONAL, LTD.	2452 MAGNOLIA ST	1/8 - 1/4 SSW	G22	29
WESTERN SEAFARE COMPANY	1301 26TH ST	1/8 - 1/4WSW	H24	31
OAKLAND YARD	2500 POPLAR ST	1/8 - 1/4WSW	N42	62
LEON HOMMEL MACHINE WORKS, INC	2340 ADELINE STREET, OA	1/8 - 1/4S	P49	72
MAIN OFFICE	2601 PERALTA ST	1/8 - 1/4W	Q50	72

SWEEPS: Statewide Environmental Evaluation and Planning System. This underground storage tank listing was updated and maintained by a company contacted by the SWRCB in the early 1980's. The listing is no longer updated or maintained. The local agency is the contact for more information on a site on the SWEEPS list.

A review of the SWEEPS UST list, as provided by EDR, and dated 06/01/1994 has revealed that there are 11 SWEEPS UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
SERVISCO, GOLDEN STATE LINEN	958 028TH ST	1/8 - 1/4 E	15	19
CALIFORNIA ELECTRIC CO	3015 ADELINE ST	1/8 - 1/4NNE	20	24
Lower Elevation	Address	Dist / Dir	Map ID	Page
MODERN MAIL SERVICE INC.	2836 UNION ST	0 - 1/8 NW	10	11
AERVOE PACIFIC	2528 ADELINE ST	1/8 - 1/4S	E12	15
LINFORD AIR & REFRIGERATION	2850 POPLAR ST	1/8 - 1/4 NW	F17	20
BLOUNT INTERNATIONAL, LTD.	2452 MAGNOLIA ST	1/8 - 1/4 SSW	G23	30
WESTERN SEAFARE COMPANY	1301 26TH ST	1/8 - 1/4 WSW	H25	31
EAST BAY SHEET METAL	2914 POPLAR ST	1/8 - 1/4 NW	<i>1</i> 26	33
EASTSHORE LINES INC	2400 ADELINE ST	1/8 - 1/4 S	K33	45
RB MATHESON HOLDINGS	2500 POPLAR ST	1/8 - 1/4 WSW	N41	55
OAKLAND SCAVENGER COMPANY	2601 PERALTA ST	1/8 - 1/4 W	Q51	73

NOTIFY 65: Notify 65 records contain facility notifications about any release that could impact drinking water and thereby expose the public to a potential health risk. The data come from the State Water Resources Control Board's Proposition 65 database.

A review of the Notify 65 list, as provided by EDR, and dated 10/21/1993 has revealed that there are 13 Notify 65 sites within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
Not reported	958 28TH STREET	1/8 - 1/4E	R53	78
MOSTLY MUSTANGS	2576 MARTIN LUTHER KING	1/2 - 1 ESE	134	206
NABISCO BRANDS, INC.	1267 14TH STREET	1/2 - 1 SSW	136	209
SERVICE STATION	2225 TELEGRAPH AVENUE	1/2 - 1 SE	141	214
45TH STREET ARTIST COOPERATIV	E 1420 45TH STREET	1/2 - 1 NNW	144	218

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
BROADWAY VOLKSWAGON	2749 BROADWAY	1/2 - 1 ESE	145	218
Lower Elevation	Address	Dist / Dir	Map ID	Page
NONE	1229 28TH	1/8 - 1/4 WNW	/ 14	19
LINDFORD AIR & REFRIGERATION	2850 POPLAR	1/8 - 1/4 NW	F16	20
LINDFORD AIR & REFRIGERATION	2850 POPLAR	1/8 - 1/4 NW	F19	23
NED CLYDE CONSTRUCTION YARD	2311 ADELINE STREET	1/4 - 1/2 SSW	61	87
C. E. TOLAND & SON, INC.	2635 PERALTA	1/4 - 1/2 W	73	95
KANTOR'S FURNITURE	2525 CYPRESS	1/4 - 1/2 W	80	108
BUILDING 331 EAST	7 MERRITIME	1/2 - 1 W	142	214

VCP: Contains low threat level properties with either confirmed or unconfirmed releases and the project proponents have request that DTSC oversee investigation and/or cleanup activities and have agreed to provide coverage for DTSC's costs.


A review of the VCP list, as provided by EDR, and dated 08/08/2005 has revealed that there are 7 VCP sites within approximately 0.5 miles of the target property.

Lower Elevation	Address	Dist / Dir	Map ID	Page
GIAMPOLINI PROPERTY	2847 PERALTA STREET	1/8 - 1/4NW	J30	40
WESTERN PACIFIC RAILROAD	UNION STREET	1/8 - 1/4SW	32	42
MANDELA PARKWAY EXTENSION PROJ	MANDELA PARKWAY / 32ND	1/4 - 1/2 NW	88	122
GENERAL TRANSPORTATION	3211 WOOD STREET	1/4 - 1/2WNW	AG110	152
FORMER HALL PROPERTY	2601 WOOD STREET	1/4 - 1/2WNW	114	163
B & P DISMANTLERS	2525 WOOD STREET	1/4 - 1/2W	AI121	182
AT & SF RAILROAD PROPERTY	ALONG WOOD / 32ND STR	1/4 - 1/2 WNW	125	189

Due to poor or inadequate address information, the following sites were not mapped:

Site Name	Database(s)
CALTRANS CYPRESS PROJECT	CS
1396 FIFTH STREET LLC	CS
1675 7TH ST.	CHMIRS, CS
OAKLAND POLICE STATION	SWEEPS UST
SCHNITZER STEEL PRODUCTS COMPA	RCRA-SQG, FINDS, CA FID UST,
	HIST UST, SWEEPS UST
SOUTHERN PACIFIC -WEST OAKLAND RAI	Cal-Sites, AWP
COMMERCIAL BUILDINGS	Cal-Sites, AWP
BNSF WOOD STREET YARD	Cal-Sites, AWP
HALL'S CLEANERS BARBARY COAST STEEL CORPORATIO	CLEANERS
UNION PACIFIC	Cal-Sites, DEED, EMI LUST, CHMIRS
OAKLAND ARMY BASE	HAZNET, LUST, CHMIRS, CA WDS
PHOENIX 766 PROPERTY	Cortese, VCP
EMERYVILLE MARKETPLACE	CERC-NFRAP
CAPITOL REF CO	CERC-NFRAP
PG&E GAS PLANT OAKLAND 601 2	CERC-NFRAP
PG&E GAS PLANT OAKLAND 601 2A	CERC-NFRAP
BATAVIA PROPERTY	CERC-NFRAP
OAKLAND ARMY BASE - TANK 677	LUST
OAKLAND ARMY BASE - TANK 742	LUST
OAKLAND ARMY BASE - TANK 743	LUST
OAKLAND ARMY BASE -11A/12A/13A	LUST
OAKLAND FISC UST 334-1-2	LUST
OAKLAND ARMY BASE TANK 2A	LUST
OAKLAND ARMY BASE TANK B/C (W BLD.	LUST
OAKLAND FISC UST 331N	LUST
CHRYSLER AUTO UNLOADING FACILITY	LUST
OAKLAND FISC 331SOUTH 331S	LUST
OAKLAND FISC UST SITE 211-1,2,3	LUST
OAKLAND ARMY BASE TANK 10	LUST
OAKLAND ARMY BASE TANK L	LUST
COMMERCIAL BUILDING 63RD STREET TRUNK SEWER PROJECT	LUST VCP
CYPRESS FREEWAY/BIKEWAY PROJECT	VCP
CYPRESS FREEWAY-3RD STREET SOUNDWA	VCP
MICRONESIAN CARGO INTERNATIONAL	VCP
OAKLAND MAIN POST OFFICE PARKING S	VCP
JUDSON STEEL CORPORATION	HIST UST
CITY OF OAKLAND #2 ENGINE FIRE	HIST UST
CHIRON CORPORATION	RCRA-SQG, FINDS, HAZNET
SANTA FE PACIFIC PIPELINE OAKLAND	RCRA-SQG, FINDS
OAKLAND TERMINAL RAILWAY PROPERTY	SLIC
UNION PACIFIC RAILROAD - 5TH AND U	SLIC
SITE B PROPERTIES	SLIC
OAKLAND AIRPORT TERMINAL	SLIC
FRANCIS PLATING	SLIC
WEST COAST AUTO SERVICE	EDR Historical Auto Stations


OVERVIEW MAP - 1654191.2s

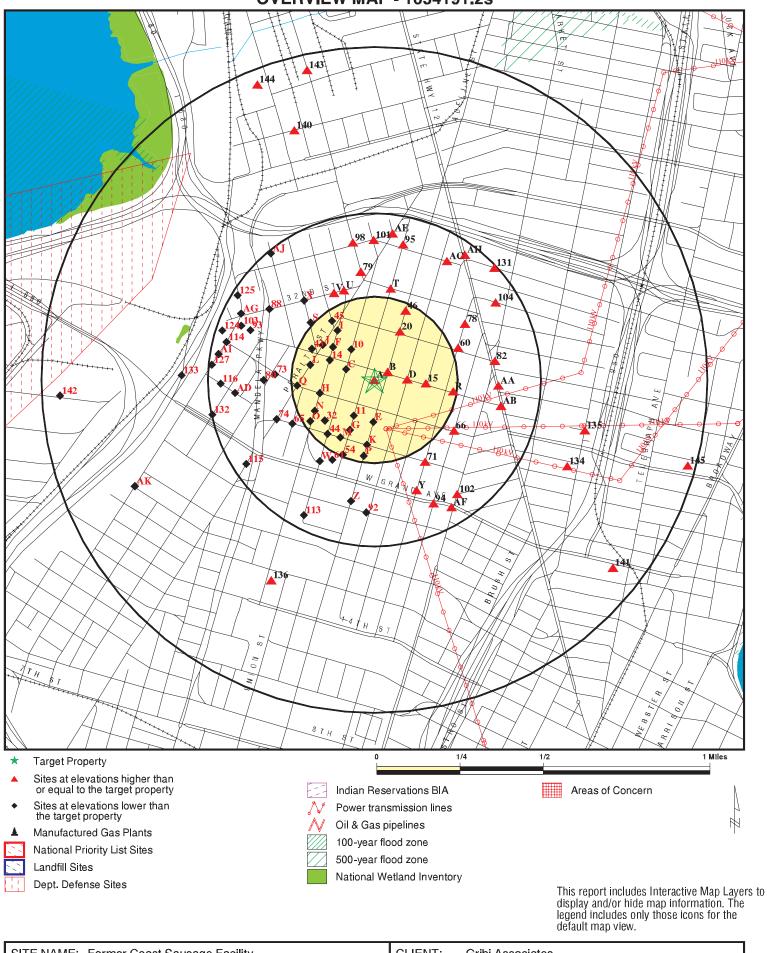

SITE NAME: Former Coast Sausage Facility ADDRESS: 1173 28th Street

Oakland CA 94607 LAT/LONG: 37.8200 / 122.2830 CLIENT: Gribi Associates CONTACT: Jim Gribi INQUIRY #: 1654191.2s DATE: April 13, 2006

DETAIL MAP - 1654191.2s

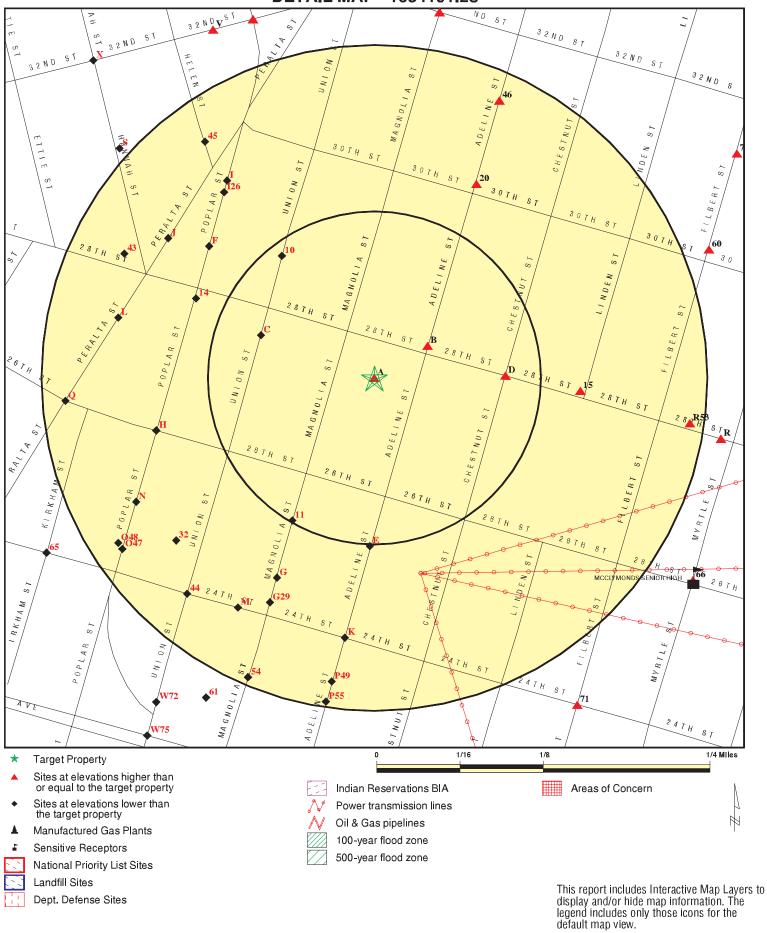

SITE NAME: Former Coast Sausage Facility ADDRESS: 1173 28th Street

Oakland CA 94607 LAT/LONG: 37.8200 / 122.2830 CLIENT: Gribi Associates CONTACT: Jim Gribi INQUIRY #: 1654191.2s DATE: April 13, 2006

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
FEDERAL RECORDS								
NPL Proposed NPL Delisted NPL NPL RECOVERY CERCLIS CERC-NFRAP CORRACTS RCRA TSD RCRA Lg. Quan. Gen. RCRA Sm. Quan. Gen. ERNS HMIRS US ENG CONTROLS US INST CONTROL DOD FUDS US BROWNFIELDS CONSENT ROD UMTRA ODI TRIS TSCA FTTS SSTS PADS MLTS MINES FINDS RAATS	X	1.000 1.000 1.000 TP 0.500 0.500 1.000 0.250 0.250 TP TP 0.500 0.500 1.000 1.000 1.000 0.500 1.000 1.000 TP	0 0 0 R 0 0 0 0 0 3 R R 0 0 0 0 0 0 0 0	0 0 0 NR 0 1 0 0 1 8 NR NR 0 0 0 0 0 0 0 0 NR	0 0 0 NR 0 1 0 0 NR NNR NNR NNR NNR NNR NNR NNR NNR	0 0 0 R R R R R R R R R R R R R R R R R	NR N	0 0 0 0 0 0 1 11 0 0 0 0 0 0 0 0 0 0 0
STATE AND LOCAL RECOR	<u>DS</u>							
AWP Cal-Sites CA Bond Exp. Plan NFA NFE REF SCH Toxic Pits State Landfill CA WDS WMUDS/SWAT Cortese SWRCY LUST CA FID UST		1.000 1.000 1.000 0.250 0.250 0.250 1.000 0.500 TP 0.500 0.500 0.500 0.500	0 0 0 0 0 0 0 0 NR 0 2 0	1 2 0 0 1 0 0 0 0 NR 0 14 1 14 10	0 0 0 NR NR NR 0 0 NR 0 47 1 41 NR	1 3 NR NR NR NR NR NR NR NR NR NR NR NR	NR NR NR NR NR NR NR NR NR NR NR NR NR N	2 3 3 0 1 0 0 2 0 0 63 2 56 11

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
SLIC CS UST HIST UST AST SWEEPS UST CHMIRS Notify 65	x	0.500 0.500 0.250 0.250 0.250 0.250 TP 1.000	0 3 0 0 0 1 NR 0	2 15 0 7 0 10 NR 4	2 50 NR NR NR NR NR NR	NR NR NR NR NR NR NR	NR NR NR NR NR NR NR	4 68 0 7 0 11 0
DEED VCP DRYCLEANERS WIP CDL HAZNET EMI		0.500 0.500 0.500 0.250 0.250 TP TP TP	0 0 0 0 NR NR NR	0 2 0 0 NR NR NR	0 5 NR NR NR NR NR	NR NR NR NR NR NR NR	NR NR NR NR NR NR NR	0 7 0 0 0 0
INDIAN RESERV INDIAN LUST INDIAN UST		1.000 0.500 0.250	0 0 0	0 0 0	0 0 NR	0 NR NR	NR NR NR	0 0 0
EDR PROPRIETARY RECORM Manufactured Gas Plants EDR Historical Auto Statio EDR Historical Cleaners	<u> </u>	1.000 0.250 0.250	0 0 0	0 0 0	0 NR NR	0 NR NR	NR NR NR	0 0 0

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

MAP FINDINGS

Map ID Direction Distance Distance (ft.)

EDR ID Number Elevation Site Database(s) **EPA ID Number**

Α1 **RUSH PROPERTY 28TH ST** CS S106661073 N/A

Target 1173 28TH ST OAKLAND, CA 94608 **Property**

Site 1 of 3 in cluster A

Actual: 14 ft.

Alameda County Contaminated Sites:

RO0002562 Record Id: PE: 5602

Status: Pollution Characterization

CHMIRS S105631030 N/A

A2

Target 1173 28TH **Property** OAKLAND, CA

Site 2 of 3 in cluster A

Actual: 14 ft.

CHMIRS:

OES Control Number: 27768 Extent of Release: Not reported Property Use: Not reported Incident Date: Not reported

Date Completed: Not reported Time Completed: Not reported Agency Id Number: Not reported Agency Incident Number: Not reported OES Incident Number: 27768 Time Notified: Not reported Surrounding Area: Not reported Estimated Temperature: Not reported Property Management: Not reported More Than Two Substances Involved?: Not reported Special Studies 1: Not reported Special Studies 2: Not reported Special Studies 3: Not reported Special Studies 4: Not reported Special Studies 5: Not reported Special Studies 6: Not reported Resp Agncy Personel # Of Decontaminated: Not reported Others Number Of Decontaminated: Not reported Others Number Of Injuries: Not reported Others Number Of Fatalities: Not reported Vehicle Make/year : Not reported Vehicle License Number: Not reported Vehicle State: Not reported Vehicle Id Number: Not reported CA/DOT/PUC/ICC Number: Not reported Company Name: Not reported Reporting Officer Name/ID: Not reported Report Date: Not reported Comments: Not reported Facility Telephone Number: Not reported Waterway Involved: YES Waterway: Not reported Spill Site: Not reported Cleanup By: coast sausage co. Containment: Not reported

What Happened: Not reported Type: CHEMICAL Not reported Other: Substance: ammonia

Direction
Distance
Distance (ft.)

Distance (ft.)

Elevation Site

EDR ID Number

EPA ID Number

(Continued) S105631030

Quantity Released:

E Date: Not reported
Contained: NO
Site Type: Not reported
Evacuations: Not reported
Num Of Injuries: Not reported
Num Of Fatalities: Not reported

Date/Time:
Year:
Agency:
Not reported
1993
alameda co/doh

Not reported BBLS: Not reported Cups: CUFT: Not reported Gallons: Not reported Grams: Not reported Pounds: Not reported Liters: Not reported Ounces: Not reported Pints: Not reported Quarts: Not reported Sheen: Not reported Tons: Not reported Unknown: Not reported

Description: fire at the coast sausage co. caused ammonia lint to burst open

into fire.

Incident date: 4/12/93/05:00
Admin Agency: Not reported
OES date: 4/23/1993
OES time: 11:30:00 AM
OES notification: Not reported
Amount: unknown

Amount. unknown

A3 1173 28TH ST ERNS 93322284
Target 1173 28TH ST N/A

Property OAKLAND, CA 94607

Site 3 of 3 in cluster A

Actual: 14 ft.

Click this hyperlink while viewing on your computer to access

additional ERNS detail in the EDR Site Report.

DOD OAKLAND ARMY BASE (CLOSED)

DOD CUSA036046

Region N/A

Region WNW 1/2-1 3873 ft.

OAKLAND ARMY BASE (CLOSED (County), CA

FEDERAL LANDS:

State:

Feature 1: Army DOD
Feature 2: Not reported
Feature 3: Not reported
Agency: DOD
URL: Not reported

Name 1: Oakland Army Base (Closed)

CA

Name 2: Not reported Name 3: Not reported

Direction Distance Distance (ft.)

EDR ID Number Elevation Site Database(s) **EPA ID Number**

B4 MATRECON INC RCRA-SQG 1000355300 **ENE 2811 ADELINE ST FINDS** CAD066550880

OAKLAND, CA 94608 < 1/8

245 ft.

Site 1 of 2 in cluster B

Relative: Higher

RCRAInfo:

MATRECON INC Owner:

Actual: (415) 555-1212

16 ft. EPA ID: CAD066550880

> Contact: **ENVIRONMENTAL MANAGER**

> > (415) 451-2757

Small Quantity Generator Classification:

TSDF Activities: Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:

RESOURCE CONSERVATION AND RECOVERY ACT INFORMATION SYSTEM

B5 TESTING ENGINEERS, INC RCRA-SQG 1000413451 **ENE 2811 ADELINE ST** CAD981383847

< 1/8 OAKLAND, CA 94608

245 ft.

Site 2 of 2 in cluster B

Relative: Higher

RCRAInfo:

Owner: J MORRIS BROWNING

Actual: (415) 555-1212 16 ft.

EPA ID: CAD981383847

> Contact: **ENVIRONMENTAL MANAGER**

(415) 835-3142

Small Quantity Generator Classification:

TSDF Activities: Not reported

Violation Status: No violations found

S106784920 C6 **CUSTOM ALLOY SCRAP SALES (TOXIC)** WNW **2711 UNION ST** N/A

< 1/8 OAKLAND, CA 94607

482 ft.

Site 1 of 2 in cluster C

Relative: Alameda County Contaminated Sites: Lower

Record Id: RO0002489

PE: Actual: 5502

13 ft. Pollution Characterization Status:

MAP FINDINGS Map ID

Direction Distance Distance (ft.)

EDR ID Number Elevation Site Database(s) **EPA ID Number**

C7 CUSTON ALLOY SCRAP SALES Cortese S102405629 WNW

2711 UNION N/A

OAKLAND, CA < 1/8

482 ft.

Site 2 of 2 in cluster C Relative:

CORTESE: Lower

CORTESE Region: Actual: Fac Address 2: Not reported

13 ft.

D8 **BROOK'S AUTO SERVICE** CS S105871034

East 1101 28TH ST N/A

OAKLAND, CA 94608 < 1/8

518 ft.

Site 1 of 2 in cluster D

Relative: Alameda County Contaminated Sites: Higher

RO0000222 Record Id: PE: Actual: 5602

17 ft. Status: Preliminary site assessment workplan submitted

> Record Id: RO0000222 PE: 5602

Status: Leak being confirmed

D9 **BROOKS AUTO SERVICE** S103177080 LUST

1101 28TH ST **East** Cortese N/A

OAKLAND, CA 94608 LOS ANGELES CO. HMS < 1/8

518 ft.

Site 2 of 2 in cluster D

Relative: Higher

State LUST:

Cross Street: CHESTNUT Actual: Qty Leaked: Not reported 17 ft. Case Number Not reported

Reg Board:

Chemical: Gasoline Local Agency Lead Agency: Local Agency: 01000L Case Type: Soil only

Status: Preliminary site assessment underway

1998-03-16 00:00:00 Review Date: Confirm Leak: 1998-03-16 00:00:00 Workplan: 1965-01-02 00:00:00 Prelim Assess: 1965-01-02 00:00:00 Pollution Char: Not reported Remed Plan: Not reported

Remed Action: Not reported Monitoring: Not reported Close Date: Not reported Release Date: Not reported Cleanup Fund Id: Not reported Discover Date : Not reported Enforcement Dt: Not reported Enf Type: Not reported Enter Date: Not reported Funding: Not reported

Staff Initials: AG

How Discovered: Tank Closure Not reported How Stopped: Interim: Not reported Leak Cause: UNK Leak Source: UNK

Direction
Distance
Distance (ft.)

Distance (ft.)

Elevation Site

EDR ID Number

EPA ID Number

BROOKS AUTO SERVICE (Continued)

S103177080

MTBE Date : 1965-01-02 00:00:00
Max MTBE GW : 0 Parts per Billion

MTBE Tested: MTBE Detected. Site tested for MTBE & MTBE detected

Priority: Not reported

Local Case #: 345

Beneficial: Not reported

Staff: CC

GW Qualifier: Not reported
Max MTBE Soil: Not reported
Soil Qualifier: Not reported
Hydr Basin #: Alameda East Bay (2-

Operator: Not reported

Oversight Prgm: LUST

Review Date: 2001-04-03 00:00:00

Stop Date: Not reported

Work Suspended :No

Responsible PartyBLANK RP
RP Address: Not reported
Global Id: T0600102303
Org Name: Not reported
Contact Person: Not reported

MTBE Conc: 1 Mtbe Fuel: 1

Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 0
Waster Disables and Clabel ID: Not reported

Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported

Summary: Not reported

LUST Region 2:

 Region:
 2

 Case Number:
 345

 Facility Id:
 21-2304

Facility Status: Preliminary site assessment underway

Permit Status:

Not reported

How Discovered: TC Leak Cause: UNK Leak Source: UNK Oversight Program: LUST 3/16/1998 Date Leak Confirmed: Prelim. Site Assesment Wokplan Submitted: Not reported Preliminary Site Assesment Began: 1/2/1965 Pollution Characterization Began: Not reported Pollution Remediation Plan Submitted: Not reported Date Remediation Action Underway: Not reported Date Remediation Action Underway: Not reported

CORTESE:

Region: CORTESE Fac Address 2: 1101 28TH ST

HMS:

Facility Id: 020055-028588

Region: LA Area: 29

Facility Type: Not reported Permit Number: Not reported

Facility Status: OPEN

Region: Los Angeles County:

Direction
Distance
Distance (ft.)

Distance (ft.)

Elevation Site

EDR ID Number

EPA ID Number

 10
 MODERN MAIL SERVICE INC.
 CA FID UST S101624442

 NW
 2836 UNION ST
 CS N/A

OAKLAND, CA 94608 SWEEPS UST

< 1/8 608 ft.

Relative: Alameda County Contaminated Sites:

Lower Record Id: RO0002901
PE: 5602

Actual: Status: Preliminary site assessment underway

13 ft.

Record Id: RO0002901 PE: 5602

Status: Pollution Characterization

FID:

Facility ID: 01002564 Regulate ID: 00008914

Reg By: Active Underground Storage Tank Location

Cortese Code: Not reported SIC Code: Not reported Status: Active Facility Tel: (415) 444-6245

Mail To: Not reported

P O BOX

OAKLAND, CA 94608

Contact:Not reportedContact Tel:Not reportedDUNs No:Not reportedNPDES No:Not reportedCreation:10/22/93Modified:00/00/00

EPA ID: Not reported Comments: Not reported

SWEEPS:

Status: A
Comp Number: 8914
Number: 9

Board Of Equalization: 44-000124
Ref Date: 07-01-85
Act Date: Not reported
Created Date: 02-29-88

Tank Status: A
Owner Tank Id: 1

Swrcb Tank Id: 01-000-008914-000001

Actv Date : 07-01-85 Capacity : 10000 Tank Use : M.V. FUEL

Stg: P

Content: REG UNLEADED

Number Of Tanks: 2

Status: A
Comp Number: 8914
Number: 9

Board Of Equalization: 44-000124
Ref Date: 07-01-85
Act Date: Not reported
Created Date: 02-29-88
Tank Status: A

Owner Tank Id: 2

Swrcb Tank ld: 01-000-008914-000002

Actv Date : 07-01-85
Capacity : 2000
Tank Use : M.V. FUEL

Stg: F

Direction
Distance
Distance (ft.)

Distance (ft.)

Elevation Site

EDR ID Number

EPA ID Number

EPA ID Number

MODERN MAIL SERVICE INC. (Continued) S101624442

Content: REG UNLEADED Number Of Tanks: Not reported

 11
 ENGLUND STUDIO
 RCRA-SQG
 1001967609

 SSW
 2534 MAGNOLIA ST UNIT A
 FINDS
 CAR000071084

< 1/8 OAKLAND, CA 94607

654 ft.

Relative: RCRAInfo:

Lower Owner: STEVE ENGLUND (510) 986-1144

Actual: EPA ID: CAR000071084

12 ft. CARDON CARDON

Contact: STEVE ENGLUND

(510) 986-1144

Classification: Small Quantity Generator

TSDF Activities: Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site: HAZARDOUS WASTE TRACKING SYSTEM-DATAMART

NATIONAL EMISSIONS INVENTORY

RESOURCE CONSERVATION AND RECOVERY ACT INFORMATION SYSTEM

HAZNET:

Gepaid: CAR000071084
TSD EPA ID: CAT080013352
Gen County: Alameda
Tsd County: Alameda
Tons: 0.45
Facility Address 2: Not reported

Waste Category: Off-specification, aged, or surplus organics

Disposal Method: Recycler

Contact: STEVE ENGLUND
Telephone: (510) 986-1144
Mailing Name: Not reported

Mailing Address: 2534 MAGNOLIA ST UNIT A

OAKLAND, CA 94607

County 1

EMISSIONS:

 Year :
 1997

 Facility ID :
 11172

 Air District Code :
 BA

 SIC Code :
 2431

 Air Basin :
 SF

Air District Name:

Community Health Air Pollution Info System:

Not reported

Consolidated Emission Reporting Rule:

Not reported

County Code: 1
County ID: 1
Total Organic Hydrocarbon Gases Tons/Yr: 2
Reactive Organic Gases Tons/Yr: 1
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smaller Tons/Yr:

HAZNET

EMI

Direction
Distance
Distance (ft.)

Distance (ft.)

Elevation Site

EDR ID Number

EPA ID Number

ENGLUND STUDIO (Continued)

1001967609

 Year :
 1998

 Facility ID :
 11172

 Air District Code :
 BA

 SIC Code :
 2431

 Air Basin :
 SF

Air District Name: BAY AREA AQMD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported

County Code: 1
County ID: 1
Total Organic Hydrocarbon Gases Tons/Yr: 1
Reactive Organic Gases Tons/Yr: 1
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smaller Tons/Yr: 0

 Year :
 1999

 Facility ID :
 11172

 Air District Code :
 BA

 SIC Code :
 2431

 Air Basin :
 SF

Air District Name : BAY AREA AQMD Community Health Air Pollution Info System : Not reported Consolidated Emission Reporting Rule : Not reported

County Code: 1
County ID: 1
Total Organic Hydrocarbon Gases Tons/Yr: 1
Reactive Organic Gases Tons/Yr: 1
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smaller Tons/Yr: 0

 Year :
 2000

 Facility ID :
 11172

 Air District Code :
 BA

 SIC Code :
 2431

 Air Basin :
 SF

Air District Name: BAY AREA AQMD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported

County Code: 1
County ID: 1
Total Organic Hydrocarbon Gases Tons/Yr: 1
Reactive Organic Gases Tons/Yr: 1
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smaller Tons/Yr: 0

Year : 2001 Facility ID : 11172 Map ID MAP FINDINGS
Direction

Direction
Distance
Distance (ft.)
Elevation Site

EDR ID Number
Database(s) EPA ID Number

ENGLUND STUDIO (Continued)

1001967609

Air District Code : BA
SIC Code : 2431
Air Basin : SF

Air District Name: BAY AREA AQMD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported

County Code: 1
County ID: 1
Total Organic Hydrocarbon Gases Tons/Yr: 1
Reactive Organic Gases Tons/Yr: 1
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smaller Tons/Yr: 0

 Year :
 2002

 Facility ID :
 11172

 Air District Code :
 BA

 SIC Code :
 2431

 Air Basin :
 SF

Air District Name: BAY AREA AQMD Community Health Air Pollution Info System: Not reported Consolidated Emission Reporting Rule: Not reported

County Code: 1
County ID: 1
Total Organic Hydrocarbon Gases Tons/Yr: 1
Reactive Organic Gases Tons/Yr: 1
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smaller Tons/Yr: 0

 Year :
 2003

 Facility ID :
 11172

 Air District Code :
 BA

 SIC Code :
 2431

 Air Basin :
 SF

Air District Name: BAY AREA AQMD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported

County Code: 1
County ID: 1
Total Organic Hydrocarbon Gases Tons/Yr: 1
Reactive Organic Gases Tons/Yr: 1
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smaller Tons/Yr:

MAP FINDINGS Map ID

Direction Distance Distance (ft.)

EDR ID Number Elevation Site Database(s) **EPA ID Number**

E12 **AERVOE PACIFIC** LUST S101624363

South **2528 ADELINE ST** 1/8-1/4 OAKLAND, CA 94607 668 ft.

CS **SWEEPS UST** Site 1 of 2 in cluster E

Relative:

State LUST: Lower

Cross Street: Not reported Actual: Qty Leaked: Not reported 13 ft. Case Number Not reported

Reg Board:

Chemical: V, M & P Naptha Lead Agency: Local Agency 01000L Local Agency: Case Type: Undefined

Status: Preliminary site assessment underway

Abate Method: No Action Taken - no action has as yet been taken at the site

Review Date: 1998-03-20 00:00:00 Confirm Leak: 1998-03-20 00:00:00 1965-01-02 00:00:00 Prelim Assess: 1965-01-02 00:00:00 Workplan: Pollution Char: Not reported Remed Plan: Not reported

Remed Action: Not reported Monitoring: Not reported Close Date: Not reported Release Date: Not reported Cleanup Fund Id: Not reported Discover Date: Not reported Enforcement Dt: Not reported Enf Type: Not reported Enter Date: Not reported Funding: Federal Funds

Staff Initials: AG

How Discovered: Tank Closure How Stopped: Not reported

Interim: No

Leak Cause: Structure Failure

Leak Source: Tank MTBE Date: Not reported Max MTBE GW: Not reported

Not Required to be Tested. MTBE Tested:

Priority: Not reported

Local Case #: Beneficial: Not reported

Staff: CC

GW Qualifier: Not reported Max MTBE Soil: Not reported Soil Qualifier: Not reported

Hydr Basin #: Alameda East Bay (2-

266

Operator: Not reported

Oversight Prgm: LUST

Review Date: 2000-03-22 00:00:00

Stop Date: Not reported

Work Suspended :No

Responsible PartyBLANK RP RP Address: Not reported Global Id: T0600102135 Org Name: Not reported Contact Person: Not reported

MTBE Conc: Mtbe Fuel:

Cortese

CA FID UST

N/A

Direction
Distance
Distance (ft.)

Distance (ft.)

Elevation Site

EDR ID Number

EPA ID Number

AERVOE PACIFIC (Continued)

S101624363

Water System Name: Not reported Well Name: Not reported

Distance To Lust: 0

Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported

Summary: ALSO IN SLIC 01S0081; WAS CALLED EZ REST PRODUCTS

LUST Region 2:

 Region:
 2

 Case Number:
 266

 Facility Id:
 01-2321

Facility Status: Preliminary site assessment underway

How Discovered:

Leak Cause: Structure Failure

Leak Source: Tank Oversight Program: LUST Date Leak Confirmed: 3/20/1998 Prelim. Site Assesment Wokplan Submitted: Not reported Preliminary Site Assesment Began: 1/2/1965 Pollution Characterization Began: Not reported Pollution Remediation Plan Submitted: Not reported Date Remediation Action Underway: Not reported Date Remediation Action Underway: Not reported

Alameda County Contaminated Sites:

Record Id: RO0000463 PE: 5602

Status: Leak being confirmed

Record Id: RO0000463 PE: 5602

Status : Preliminary site assessment underway

Record Id: RO0000463 PE: 5602

Status: Preliminary site assessment workplan submitted

CORTESE:

Region: CORTESE Fac Address 2: 2528 ADELINE ST

FID:

Facility ID: 01002272 Regulate ID: 00067445

Reg By: Inactive Underground Storage Tank Location

Cortese Code: Not reported SIC Code: Not reported Status: Facility Tel: (415) 836-3980

Mail To: Not reported P O BOX

OAKLAND, CA 94607

Contact:Not reportedContact Tel:Not reportedDUNs No:Not reportedNPDES No:Not reportedCreation:10/22/93Modified:00/00/00

EPA ID: Not reported Comments: Not reported

SWEEPS:

Status: Not reported Comp Number: 67445 Number: Not reported Board Of Equalization: 44-000747

Direction
Distance
Distance (ft.)

Distance (ft.)

Elevation Site

EDR ID Number

EPA ID Number

AERVOE PACIFIC (Continued)

S101624363

Ref Date: Not reported
Act Date: Not reported
Created Date: Not reported
Tank Status: Not reported
Owner Tank Id: Not reported

Swrcb Tank Id: 01-000-067445-000001

Actv Date: Not reported
Capacity: 1000
Tank Use: UNKNOWN
Stg: PRODUCT
Content: Not reported

Number Of Tanks: 2

Status: Not reported Comp Number: 67445 Number: Not reported Board Of Equalization: 44-000747 Ref Date: Not reported Act Date: Not reported Created Date: Not reported Tank Status: Not reported Owner Tank Id: Not reported

Swrcb Tank Id: 01-000-067445-000002

Actv Date : Not reported Capacity : 1
Tank Use : LINKNOWN

Tank Use: UNKNOWN
Stg: PRODUCT
Content: Not reported
Number Of Tanks: Not reported

Confirm Leak:

Prelim Assess:

Remed Plan:

E13 EZ REST PRODUCTS
South 2528 ADELINE ST
1/8-1/4 OAKLAND, CA 94607
668 ft.

Site 2 of 2 in cluster E

Relative: Lower

State LUST:

Cross Street: Not reported

Actual: Qty Leaked: 13 ft. Case Number

Case Number Not reported

Reg Board: 2 Chemical: Diesel

Lead Agency: Regional Board Local Agency: 01000L Case Type: Undefined

Status: Leak being confirmed
Review Date: 1988-08-12 00:00:00

Workplan: Not reported Not reported Pollution Char: Remed Action: Not reported Monitoring: Not reported Close Date: Not reported Release Date: Not reported Cleanup Fund Id: Not reported Discover Date : Not reported Enforcement Dt: Not reported

Enforcement Dt: Not reported
Enf Type: Not reported
Enter Date: Not reported
Funding: Not reported

LUST

SLIC

1988-08-12 00:00:00

Not reported

Not reported

S103393902

N/A

Direction
Distance
Distance (ft.)

Distance (ft.)

Elevation Site

EDR ID Number

Database(s)

EPA ID Number

EZ REST PRODUCTS (Continued)

S103393902

Staff Initials: AG

How Discovered: Tank Closure
How Stopped: Not reported
Interim: Not reported
Leak Cause: UNK
Leak Source: UNK
MTBE Date: Not reported

MTBE Date: Not reported Max MTBE GW: Not reported

MTBE Tested: Not Required to be Tested.

Priority: Not reported Local Case # : Not reported Beneficial: Not reported

Staff: CC

GW Qualifier: Not reported

Max MTBE Soil: Not reported

Soil Qualifier: Not reported

Hydr Basin #: Alameda East Bay (2-

Operator: Not reported

Oversight Prgm: Spills, Leaks, Investigations and Cleanup UST

Review Date: Not reported
Stop Date: Not reported
Work Suspended: No
Responsible PartyBLANK RP
RP Address: Not reported
Global Id: T0600191492
Org Name: Not reported
Contact Person: Not reported

MTBE Conc: 0 Mtbe Fuel: 0

Water System Name: Not reported Well Name: Not reported

Distance To Lust: 0

Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported

Summary: Not reported

SLIC Region 2:

Facility ID: 01S0081 Region: 2 Facility Status: 1

Date Closed: Not reported Local Case #: Not reported How Discovered : Tank Closure

Leak Cause : UNK Leak Source : UNK Date Confirmed :

Date Confirmed: 8/12/1988

Date Prelim Site Assmnt Workplan Submitted: Not reported Date Preliminary Site Assessment Began: Not reported Date Pollution Characterization Began: Not reported Date Remediation Plan Submitted: Not reported Date Remedial Action Underway: Not reported Date Post Remedial Action Monitoring Began: Not reported

MAP FINDINGS Map ID

Direction Distance Distance (ft.)

EDR ID Number Elevation Site Database(s) **EPA ID Number**

14 **NONE** Notify 65 S100179268

1229 28TH 1/8-1/4 OAKLAND, CA 92626

775 ft.

WNW

Alameda County Contaminated Sites: Relative:

Record Id: RO0000978 Lower PE: 5602 Case Closed Actual: Status:

12 ft.

NOTIFY 65:

Date Reported: Not reported Staff Initials: Not reported

Board File Number: Not reported Facility Type: Not reported Discharge Date: Not reported Incident Description: 92626

CORTESE:

Region: **CORTESE** 1229 28th St Fac Address 2:

15 SERVISCO, GOLDEN STATE LINEN CA FID UST S101624450 **SWEEPS UST**

East 958 028TH ST 1/8-1/4 OAKLAND, CA 94608

816 ft.

FID: Relative:

Facility ID: 01002269 Regulate ID: 00067249 Higher

Reg By: Inactive Underground Storage Tank Location

Actual: Cortese Code: SIC Code: Not reported Not reported 19 ft. Status: Inactive Facility Tel: (415) 832-2711

Mail To: Not reported

958 028TH ST OAKLAND, CA 94608

Contact: Not reported Contact Tel: Not reported DUNs No: Not reported NPDES No: Not reported 10/22/93 Modified: 00/00/00 Creation:

EPA ID: Not reported Comments: Not reported

SWEEPS:

Status: Not reported 67249 Comp Number: Number: Not reported Board Of Equalization: 44-000740 Ref Date: Not reported Not reported Act Date: Not reported Created Date: Tank Status: Not reported Owner Tank Id: Not reported

Swrcb Tank Id: 01-000-067249-000001

Actv Date : Not reported 7500 Capacity: M.V. FUEL Tank Use: Stg: **PRODUCT** LEADED Content: Number Of Tanks:

Status: Not reported Comp Number: 67249 Number: Not reported Board Of Equalization: 44-000740

Cortese

CS

N/A

N/A

MAP FINDINGS Map ID

Direction Distance Distance (ft.)

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SERVISCO, GOLDEN STATE LINEN (Continued)

S101624450

LUST

CS

CA FID UST

SWEEPS UST

S101624438

N/A

Ref Date: Not reported Act Date : Not reported Created Date: Not reported Tank Status: Not reported Owner Tank Id: Not reported

01-000-067249-000002 Swrcb Tank Id:

Actv Date : Not reported Capacity: 1000 Tank Use: M.V. FUEL Stg: **PRODUCT REG UNLEADED** Content: Number Of Tanks: Not reported

LINDFORD AIR & REFRIGERATION F16 Notify 65 S100453871 NW N/A

2850 POPLAR 1/8-1/4 OAKLAND, CA 94608

839 ft.

Site 1 of 4 in cluster F

Relative: Lower

NOTIFY 65:

Date Reported: Not reported Staff Initials: Not reported

Actual: Board File Number: Not reported 13 ft. Facility Type: Not reported Discharge Date: Not reported

Incident Description: 94608-4424

F17 **LINFORD AIR & REFRIGERATION**

NW 2850 POPLAR ST 1/8-1/4

839 ft.

OAKLAND, CA 94608

Site 2 of 4 in cluster F

Relative: Lower

State LUST:

Not reported Cross Street: Actual: Qty Leaked: Not reported 13 ft. Not reported Case Number

> Reg Board: Chemical: Gasoline Lead Agency: Local Agency 01000L Local Agency:

Other ground water affected Case Type:

Status: **Case Closed**

Abate Method: No Action Taken - no action has as yet been taken at the site

Review Date: Not reported Confirm Leak: Not reported Workplan: Not reported Prelim Assess: Not reported Pollution Char: Not reported Remed Plan: Not reported

Remed Action: 1998-01-23 00:00:00 Monitoring: Not reported 1999-12-08 00:00:00 Close Date:

Release Date: Not reported Cleanup Fund Id: Not reported Discover Date : Not reported Enforcement Dt: Not reported Enf Type: Not reported Enter Date: Not reported Funding: Federal Funds

Staff Initials: AG

How Discovered: Tank Closure

Direction
Distance
Distance (ft.)

Distance (ft.)

Elevation Site

EDR ID Number

EPA ID Number

LINFORD AIR & REFRIGERATION (Continued)

S101624438

How Stopped: Not reported

Interim: No

Leak Cause: Structure Failure

Leak Source: Tank

MTBE Date : 1997-05-28 00:00:00
Max MTBE GW : 250 Parts per Billion

MTBE Tested: MTBE Detected. Site tested for MTBE & MTBE detected

Priority: Not reported

Local Case #: 4048

Beneficial: Not reported

Staff: CC GW Qualifier: <

Max MTBE Soil : Not reported Soil Qualifier : Not reported

Hydr Basin #: Alameda East Bay (2-

Operator: Not reported

Oversight Prgm: LUST

Review Date : 2000-01-21 00:00:00

Stop Date: Not reported

Work Suspended :No

Responsible PartyBLANK RP
RP Address: Not reported
Global Id: T0600100839
Org Name: Not reported
Contact Person: Not reported

MTBE Conc: 1 Mtbe Fuel: 1

Water System Name: Not reported Well Name: Not reported

Distance To Lust: 0

Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported

Summary: CURRENT MTBE DATE: 12/18/98. MAXGW=TPHG. CLOSURE SUMMARY

RECEIVED 9/17/99 FROM ACHD. MWS DESTRUCTED 12/7/99. CC PER ACHD

12/8/99.

LUST Region 2:

 Region:
 2

 Case Number:
 4048

 Facility Id:
 01-0913

 Facility Status:
 Case Closed

How Discovered: TC

Leak Cause: Structure Failure

Leak Source: Tank Oversight Program: LUST Date Leak Confirmed: Not reported Prelim. Site Assesment Wokplan Submitted: Not reported Preliminary Site Assesment Began: Not reported Pollution Characterization Began: Not reported Pollution Remediation Plan Submitted: Not reported Date Remediation Action Underway: 1/23/1998 Date Remediation Action Underway: Not reported

Alameda County Contaminated Sites:

 Record Id:
 RO0000902

 PE:
 5602

 Status:
 Case Closed

Direction
Distance
Distance (ft.)

Distance (ft.)

Elevation Site

EDR ID Number

Database(s)

EPA ID Number

LINFORD AIR & REFRIGERATION (Continued)

S101624438

FID:

Facility ID: 01001027 Regulate ID: CAC000809

Reg By: Inactive Underground Storage Tank Location

Cortese Code: Not reported SIC Code: Not reported Status: Facility Tel: (510) 834-2430

Mail To: Not reported

2850 POPLAR ST OAKLAND, CA 94608

Contact: Not reported Contact Tel: Not reported DUNs No: Not reported NPDES No: Not reported Creation: 10/22/93 Modified: 00/00/00

EPA ID: Not reported Comments: Not reported

SWEEPS:

Status: Not reported Comp Number: 51535 Number: Not reported Board Of Equalization: 44-000495 Not reported Ref Date: Act Date: Not reported Created Date: Not reported Tank Status: Not reported Owner Tank Id: Not reported

Swrcb Tank ld: 01-000-051535-000001

 Actv Date :
 Not reported

 Capacity :
 10000

 Tank Use :
 M.V. FUEL

 Stg :
 PRODUCT

 Content :
 REG UNLEADED

Number Of Tanks: 2

Status: Not reported Comp Number: 51535 Not reported Number: Board Of Equalization: 44-000495 Ref Date: Not reported Act Date: Not reported Not reported Created Date: Not reported Tank Status: Owner Tank Id: Not reported

Swrcb Tank ld: 01-000-051535-000002

Actv Date: Not reported
Capacity: 5000
Tank Use: M.V. FUEL
Stg: PRODUCT
Content: DIESEL
Number Of Tanks: Not reported

MAP FINDINGS Map ID

Direction Distance Distance (ft.)

EDR ID Number Elevation Site Database(s) **EPA ID Number**

F18 **LINFORD AIR & REFRIGERATION C HIST UST** U001599289

N/A

LINFORD AIR & REFRIGERATION C

STATE

1981

Tank Construction: Not Reported

NW 2850 POPLAR ST OAKLAND, CA 94608 1/8-1/4

839 ft.

Site 3 of 4 in cluster F

Relative: Lower

UST HIST:

51535 Facility ID: Actual: Total Tanks:

13 ft. Owner Address: 2850 POPLAR

OAKLAND, CA 94604

Tank Used for: **PRODUCT**

Tank Num:

Tank Capacity: 00010000 Type of Fuel: **UNLEADED**

Leak Detection: Stock Inventor

Contact Name: Not reported Telephone: (415) 834-2430

Facility Type: Other Other Type: CONSTRUCTION CONTRAC

Owner Name:

Container Num:

Year Installed:

Region:

LINFORD AIR & REFRIGERATION C Facility ID: 51535 Owner Name: Total Tanks: Region: STATE

2850 POPLAR Owner Address:

OAKLAND, CA 94604

PRODUCT Tank Used for:

Tank Num: Container Num: 2 Tank Capacity: 00004000 Year Installed: 1972 Type of Fuel: **DIESEL** Tank Construction: 3/16 inches

Leak Detection: Stock Inventor Contact Name: Not reported Telephone: (415) 834-2430

Facility Type: Other Other Type: CONSTRUCTION CONTRAC

Staff Initials: Not reported

F19 **LINDFORD AIR & REFRIGERATION** Notify 65

NW **2850 POPLAR** 1/8-1/4 OAKLAND, CA 94608

839 ft.

Site 4 of 4 in cluster F

Relative: Lower

NOTIFY 65: Date Reported:

Actual: Board File Number: 0LG921236 13 ft. Facility Type: Leak Rpt

Not reported Discharge Date: Incident Description: 94608-4424

> Date Reported: 07/30/1992 Staff Initials: Not reported

07/30/1992

Board File Number: 0LG921236 Facility Type: Leak Rpt Discharge Date: Not reported 94608-4424 Incident Description:

CORTESE:

Region: **CORTESE** Fac Address 2: Not reported S100453834

N/A

Cortese