

MPDS-UN5901-04 September 29, 1994

Unocal Corporation 2000 Crow Canyon Place, Suite 400 P.O. Box 5155 San Ramon, California 94583

Attention: Mr. Adadu Yemane

RE: Quarterly Data Report

Former Unocal Service Station #5901

11976 Dublin Boulevard Dublin, California

Dear Mr. Yemane:

This data report presents the results of the most recent quarter of monitoring and sampling of the monitoring wells at the referenced site by MPDS Services, Inc.

RECENT FIELD ACTIVITIES

The monitoring wells that were monitored and sampled during this quarter are indicated in Table 1. Prior to sampling, the wells were checked for depth to water and the presence of free product or sheen. The monitoring data and the ground water elevations are summarized in Table 1. The ground water elevations during the most recent quarter are shown on the attached Figure 1.

Ground water samples were collected on September 1, 1994. Prior to sampling, the wells were each purged of between 2 and 7 gallons of water. Samples were then collected using a clean Teflon bailer. The samples were decanted into clean VOA vials and/or one-liter amber bottles, as appropriate, which were then sealed with Teflon-lined screw caps, labeled, and stored in a cooler, on ice, until delivery to a state-certified laboratory. MPDS Services, Inc. transported the purged ground water to the Unocal Refinery located in Rodeo, California, for treatment and discharge to San Pablo Bay under NPDES permit.

ANALYTICAL RESULTS

The ground water samples were analyzed at Sequoia Analytical Laboratory and were accompanied by properly executed Chain of Custody documentation. The analytical results of the ground water samples collected to date are summarized in Table 2. The concentrations of Total Petroleum Hydrocarbons (TPH) as gasoline and benzene detected in the ground water

MPDS-UN5901-04 September 29, 1994 Page 2

samples collected this quarter are shown on the attached Figure 2. Copies of the laboratory analytical results and the Chain of Custody documentation are attached to this report.

LIMITATIONS

Environmental changes, either naturally-occurring or artificially-induced, may cause changes in ground water levels and flow paths, thereby changing the extent and concentration of any contaminants.

DISTRIBUTION

A copy of this report should be sent to Ms. Eva Chu of the Alameda County Health Care Services.

If you have any questions regarding this report, please do not hesitate to call at (510) 602-5120.

Sincerely,

MPDS Services, Inc.

Talin Kaloustian Staff Engineer

Joel G. Greger, C.E.G.

Senior Engineering Geologist

License No. EG 1633 Exp. Date 8/31/96

/bp

Attachments: Tables 1 & 2

Location Map Figures 1 & 2

Laboratory Analyses

Chain of Custody documentation

cc: Mr. Timothy R. Ross, Kaprealian Engineering, Inc.



TABLE 1 SUMMARY OF MONITORING DATA Product Ground Water Depth to Total Well Water Thickness Purged · Elevation Water Depth (feet)◆ (feet) ◆ (feet) Sheen <u>(qallons)</u> (feet) Well # (Monitored and Sampled on September 1, 1994) 361.80 5.00 19.73 0 0 MW1* 0 351.83 15.03 19.66 0 - -**MW3*** 5.48 19.72 0 _ _ 0 MW4 * 362.10 7 24.97 0 No 14.82 MW5 350.73 22.35 25.12 0 No 2 343.33 MW6 (Monitored and Sampled on June 3, 1994) 0 0 4.79 MM MW1* 362.01 MM 0 0 351.94 14.92 * EWM 0 0 MM - -362.35 5.23 MW4 * 25.02 0 No 5.5 14.30 MW5 351.25 2 25.12 No 21.34 0 MW6 344.34 (Monitored and Sampled on March 3, 1994) 0 0 MW1* 362.05 4.75 19.81

MW3 *	352.05	14.81	19.71	0		0
MW4 *	362.42	5.16	19.74	0		0
MW5	351.64	13.91	25.03	0	No	8
MW6	346.47	19.21	25.11	0	No	4.5
	(Moni	tored and San	mpled on Decem	ber 9, 19	93)	
MWl	362.22	4.58	19.80	0	No	10.5
MW3	352.26	14.60	19.65	0	No	3.5
MW4 *	362.53	5.05	19.76	0		0
MW5	352.01	13.54	25.04	0	No	8
MW6	344.03	21.65	25.12	0	No	2.5

TABLE 1 (Continued)

SUMMARY OF MONITORING DATA

Well #	Well Casing Elevation (feet)**
MWl	366.80
ММЗ	366.86
MW4	367.58
MW5	365.55
MW6	365.68

- ◆ The depth to water level and total well depth measurements were taken from the top of the well casings.
- * Monitored only.
- ** The elevations of the top of the well casings have been surveyed relative to Mean Sea Level (MSL), per the National Geodetic Survey disk stamped "I-1257, reset 1975" (elevation = 439.93 feet MSL).
- -- Sheen determination was not performed.

NM = Not measured.

Note: - Wells MW1 and MW4, wells MW3 and MW5, and well MW6 are reportedly located in three separate hydrologic regimes caused by fault splays.

TABLE 2
SUMMARY OF LABORATORY ANALYSES
WATER

		TPH as			Ethyl-	
<u>Date</u>	Well #	<u>Gasoline</u>	<u>Benzene</u>	<u>Toluene</u>	<u>benzene</u>	<u>Xylenes</u>
9/01/94	MW5	ND	ND	1.6	ND	2.1
	MW6	490	8.1	2.9	ND	1.9
6/03/94	MW5	ND	ND	ND	ND	ND
	MW6	ИИ	ND	МD	ND	ND
3/03/94	MW5	ND	ND	0.84	ND	0.60
	MW6	150	2.4	2.8	ND	1.2
12/09/93	MW1◆		- -			
	MW3	ND	ND	ND	ND	ND
	MW5	ND	ND	ND	ND	ND
	MW6	790	0.64	1.0	ND	ND
10/09/93	MW5	ND	ND	ND	ND	ND
• •	MW6	480	1.8	0.63	0.81	ND
9/16/93	MW1◆	~ -				
	MW3	ND	ND	ND	ND	ND
6/18/93	MW1♦	~				
	ЕММ	ND	ИD	ND	ND	ND
4/03/92	MW1*	ND	ND	ND	ND	ND
	MW2	ND	ND	ND	ND	ND
	KW3	ND	ND	ND	ND	ND
	MW4	ND	ND	ND	ND	ND
1/02/92	MW1*	ND	ND	ND	ND	ND
	MW2	ИD	ND	ND	ND	ND
	MW3 * *	38	ND	ND	ND	ND
	MW4	ND	ND	ND	ND	ND
10/03/91	MW1*	ND	ND	ND	ND	ND
,,	MW2	ND	ND	ND	ND	ND
	MW3	32	ND	ND	ND	ND
	MW4	ND	ND	ND	ND	ND

TABLE 2 (Continued)

SUMMARY OF LABORATORY ANALYSES WATER

<u>Date</u>	Well #	TPH as <u>Gasoline</u>	<u>Benzene</u>	Toluene	Ethyl- <u>benzene</u>	Xylenes
7/02/91	MW1*	ND	ND	ND	ND	ND
	MW2	ND	ND	ND	ND	ND
	MW3	ND	ND	ND	ND	ND
	MW4	ND	ND	ND	ND	ND
4/01/91	MW1*	ND	ND	ND	ND	ND
	MW2	ND	ND	ND	ND	ND
	MW3	ND	ND	ND	ND	ND
	MW4	ND	ND	ND	ND	ND
11/16/90	MW1*	ND	ND	ND	ИD	ND
	MW2	ND	ND	ND	ND	ND
	MW3	ND	ND	ND	ND	ND
	MW4	ND	ND	ND	ND	ND


- All EPA method 8100 constituents (polynuclear aromatic hydrocarbons) were non-detectable.
- * TPH as diesel, Total Oil & Grease (TOG), and EPA method 8010 constituents were all non-detectable for MW1.
- ** All EPA method 8010 constituents were non-detectable.

ND = Non-detectable.


-- Indicates analysis was not performed.

Results are in micrograms per liter ($\mu g/L$), unless otherwise indicated.

Note: Laboratory analyses data prior to December 9, 1993, were provided by Kaprealian Engineering, Inc.

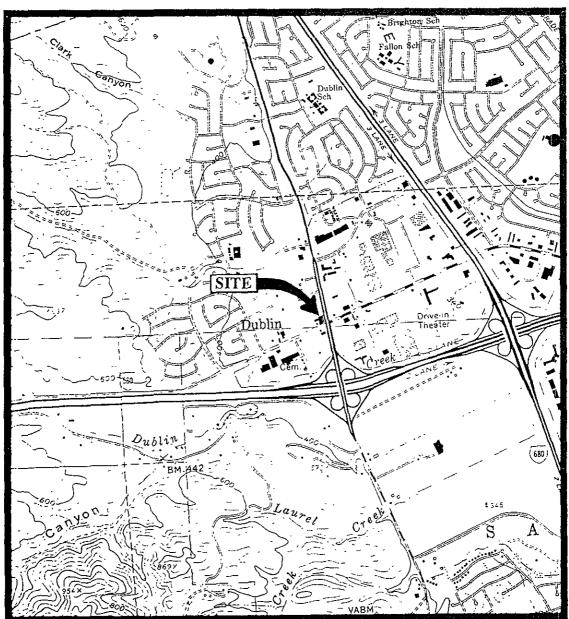


Base modified from 7.5 minute U.S.G.S. Dublin Quadrangle (photorevised 1980)

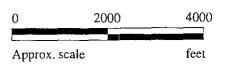




FORMER UNOCAL S/S #5901 11976 DUBLIN BOULEVARD DUBLIN, CALIFORNIA

LOCATION MAP

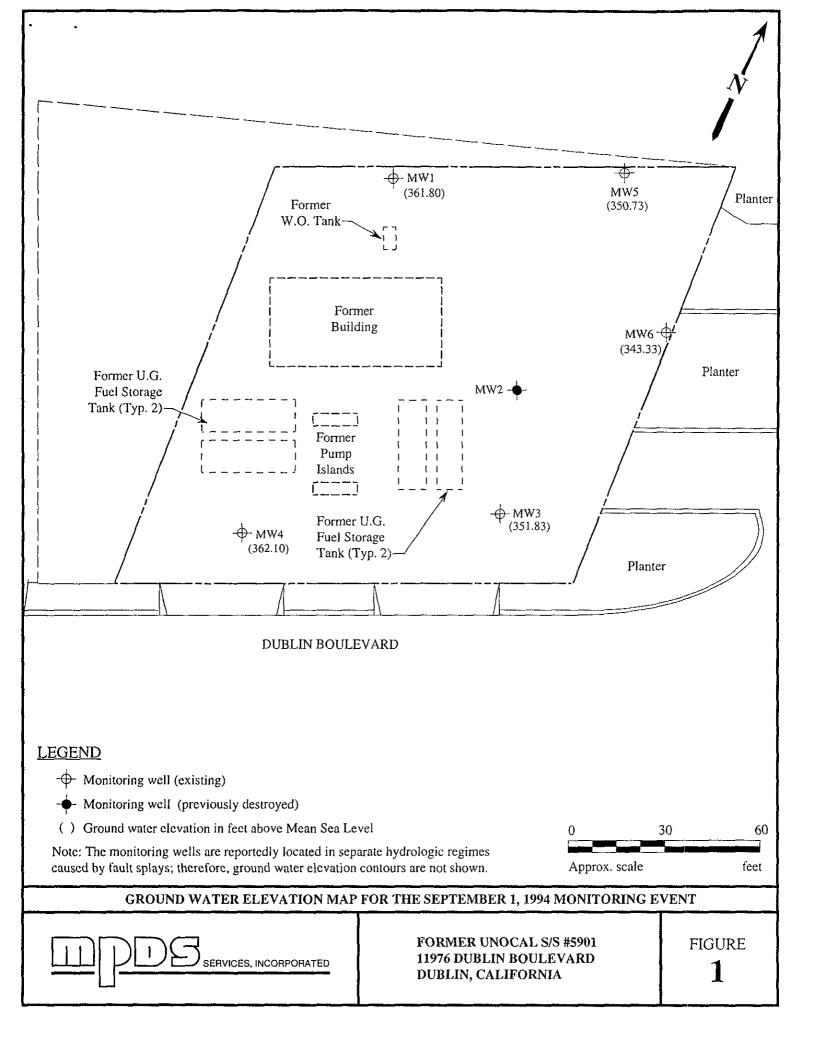

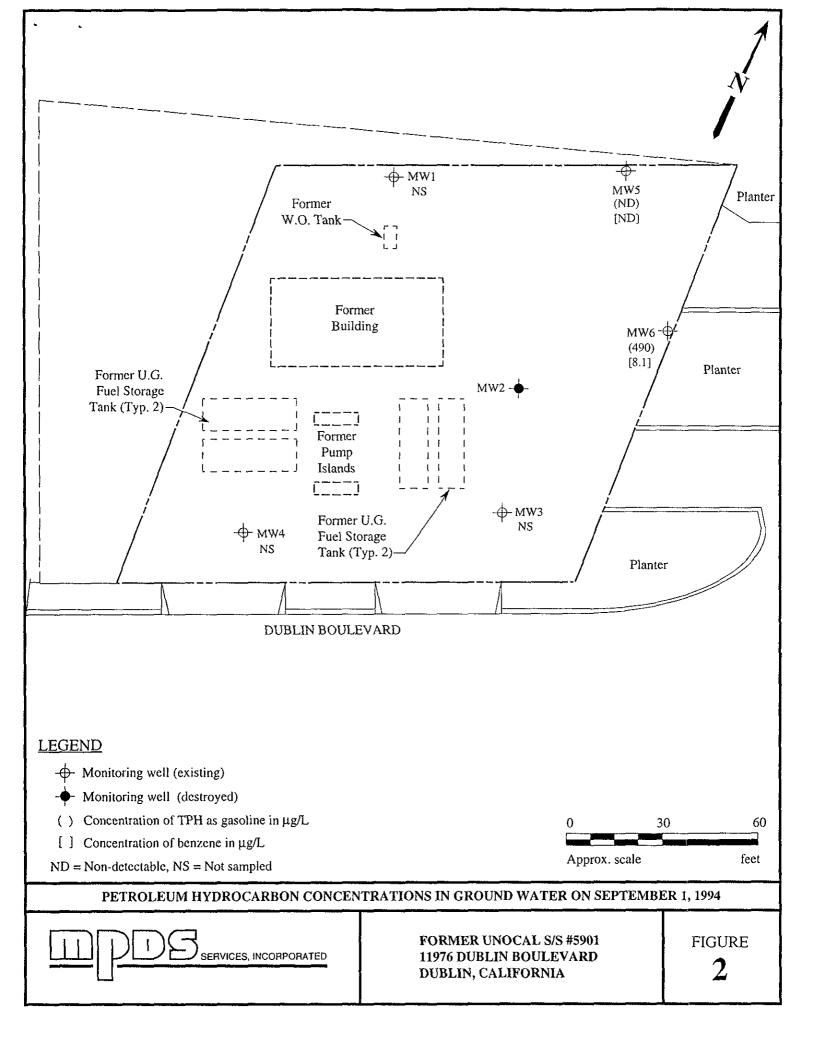



680 Chesapeake Drive 1900 Bates Avenue, Suite L 819 Striker Avenue, Suite 8

Redwood City, CA 94063 Concord, CA 94520 Sacramento, CA 95834

(415) 364-9600 (510) 686-9600 (916) 921-9600

an an arthriting a martin marin tarbetat ing tratification take parabeta at betate on a diskription asserbagi

FAX (415) 364-9233 FAX (510) 686-9689 FAX (916) 921-0100

to the temperature of the MPDS Services 2401 Stanwell Dr., Ste. 400 Concord, CA 94520 Attention: Avo Avedessian

Client Project ID: Matrix Descript:

Unocal #5901, 11976 Dublin Blvd., Dublin Water

Received:

Sep 1, 1994

Analysis Method: First Sample #:

EPA 5030/8015/8020 409-0197

Reported:

Sep 16, 1994

TOTAL PURGEABLE PETROLEUM HYDROCARBONS with BTEX DISTINCTION

Sample Number	Sample Description	Purgeable Hydrocarbons μg/L	Benzene μg/L	Toluene μg/L	Ethyl Benzene µg/L	Total Xylenes μg/L
409-0197	MW-5	ND	ND	1.6	ND	2.1
409-0198	MW-6	490	8.1	2.9	ND	1.9

Detection Limits:	50	0.50	0.50	0.50	0.50	


Total Purgeable Petroleum Hydrocarbons are quantitated against a fresh gasoline standard. Analytes reported as ND were not present above the stated limit of detection.

SEQUOIA ANALYTICAL, #1271

Signature on File

Alan B. Kemp **Project Manager**



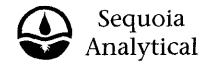

680 Chesapeake Drive 1900 Bates Avenue, Suite L Concord, CA 94520 819 Striker Avenue, Suite 8 Sacramento, CA 95834

Redwood City, CA 94063

(415) 364-9600 (510) 686-9600 (916) 921-9600 FAX (415) 364-9233 FAX (510) 686-9689 FAX (916) 921-0100

2401 Stanwell Dr., Ste. 400 Concord, CA 94520

Matrix Descript:

MPDS Services Client Project ID: Unocal #5901, 11976 Dublin Blvd., Dublin Sampled: Water

Received:

Sep 1, 1994 Sep 1, 1994

Attention: Avo Avedessian la produce com un empre a produce de la francisca del mais mais mais mais mais mais de mais com as mais mais m

Analysis Method: EPA 5030/8015/8020 First Sample #: 409-0197

Sep 16, 1994 Reported:

TOTAL PURGEABLE PETROLEUM HYDROCARBONS with BTEX DISTINCTION

Sample Number	Sample Description	Chromatogram Pattern	DL Mult. Factor	Date Analyzed	Instrument ID	Surrogate Recovery, % QC Limits: 70-130
409-0197	MW-5		1.0	9/7/94	HP-5	110
409-0198	MW-6	Gasoline	1.0	9/7/94	HP-5	91

SEQUOIA ANALYTICAL, #1271

Signature on File

Alan B. Kemp **Project Manager**





680 Chesapeake Drive 1900 Bates Avenue, Suite L 819 Striker Avenue, Suite 8

Redwood City, CA 94063 Concord, CA 94520 Sacramento, CA 95834

(415) 364-9600 (510) 686-9600 (916) 921-9600

Reported:

FAX (415) 364-9233 FAX (510) 686-9689 FAX (916) 921-0100

Sep 16, 1994

e strige Aways in 1981 a MPDS Services · 2401 Stanwell Dr., Ste. 400 Concord, CA 94520

Attention: Avo Avedessian

egyetek terde terskéznar désketk terdedag Unocal #5901, 11976 Dublin Blvd., Dublin Client Project ID:

Matrix: Liquid

QC Sample Group: 4090197-98 รายทาง (การ การ การ การทาง เพราะ การ (การที่สายการ การที่สายการที่สายการทางที่สายที่สายที่สายที่สายที่สายที่สาย

QUALITY CONTROL DATA REPORT

ANALYTE	Benzene	Toluene	Ethyl	Xylenes	
			Benzene		
Method:	EPA 8020	EPA 8020	EPA 8020	EPA 8020	
Analyst:	J. Fontecha	J. Fontecha	J. Fontecha	J. Fontecha	
MS/MSD					
Batch#:	4081801	4081801	4081801	4081801	
Date Prepared:	9/7/94	9/7/94	9/7/94	9/7/94	
Date Analyzed:	9/7/94	9/7/94	9/7/94	9/7/94	
Instrument I.D.#:	HP-5	HP-5	HP-5	HP-5	
Conc. Spiked:	20 μg/L	20 μg/L	20 μg/L	60 µg/L	
Matrix Spike					
% Recovery:	110	115	115	113	
Matrix Spike					
Duplicate %					
Recovery:	110	120	120	118	
Relative %					
Difference:	0.0	4.2	4.2	4.3	

LCS Batch#:	3LC\$090794	3LC\$090794	3LCS090794	3LCS090794
Date Prepared:	9/7/94	9/7/94	9/7/94	9/7/94
Date Analyzed:	9/7/94	9/7/94	9/7/94	9/7/94
Instrument I.D.#:	HP-5	HP-5	HP-5	HP-5
LCS %				
Recovery:	100	104	104	102
% Recovery	 _			
Control Limits:	71-133	72-128	72-130	71-120

SEQUOIA ANALYTICAL, #1271

Signature on File

Alan B. Kemp Project Manager Please Note:

The LCS is a control sample of known, interferent free matrix that is analyzed using the same reagents, preparation, and analytical methods employed for the samples. The matrix spike is an aliquot of sample fortified with known quantities of specific compounds and subjected to the entire analytical procedure. If the recovery of analytes from the matrix spike does not fall within specified control limits due to matrix interference, the LCS recovery is to be used to validate the batch.



M P D S Services, Inc.

2401 Stanwell Drive, Suite 400, Concord, CA 94520 Tel: (510) 602-5120 Fax: (510) 689-1918

CHAIN OF CUSTODY

NICHOLAS PERROW UNOCAL S/S # 590 CITY: DUBLIN						ANALYSES REQUESTED						TURN AROUND TIME:				
WITNESSING AGENCY			ADDRESS: 1976 DURUN BLUP			TPH-GAS BTEX	BO10					-	REGULAR REMARKS			
SAMPLE ID NO.	DATE	TIME	WATER	GRAB	СОМР	NO OF CONT	SAMPLING LOCATION	TPI BTI	TPF	TOG	80					REMARKS
MW-5	9/194	10:40 _{an}	V	V		2 Voa's	WELL	V								4090197 V
MW-6	9/194	11:202	V	1		2 Voa's	WELL	V								4090198
	,															
														<u> </u>		
														ļ <u>.</u>		
																,
		,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,											. <u> </u>			
							,									
														 	-	
RELIN	QUISHED BY:		D	ATE/Tik	ΛE	RECEIV	'ED BY:	i			<u>Be</u> Compi /ED For Ai				CEPTING S	AMPLES FOR ANALYSES:
							·				U	e\$		•		
This pioon of Kelly gland Decipal																
ISIGNATUREI								No								
(SIGNATURE)				•		(SIGNATURE)				n appropi	RIATE CON)		RLY PACK		
(SIGNATURE)					· · · · · · · · · · · · · · · · · · ·	(SIGNATURE)	····	SIGNATI L		<u> </u>	3.C. V	11 - 124-	rle: Ceviti	.(D.A	ATE: