



ENVIRONMENTAL HEALTH SERVICES
ENVIRONMENTAL PROTECTION
1131 Harbor Bay Parkway, Suite 250
Alameda, CA 94502-6577
(510) 567-6700
FAX (510) 337-9335

July 27, 2012

Mr. Frank Capilla
Can Am Plumbing, Inc.
151 Wyoming Street
Pleasanton, CA 94566

Subject: Case Closure for Fuel Leak Case No. RO0002425 and GeoTracker Global ID T0600156201,
Can Am Plumbing, 151 Wyoming Street, Pleasanton, CA 94566

Dear Mr. Capilla:

This letter transmits the enclosed underground storage tank (UST) case closure letter in accordance with Chapter 6.75 (Article 4, Section 25299.37[h]). The State Water Resources Control Board adopted this letter on February 20, 1997. As of March 1, 1997, the Alameda County Environmental Health (ACEH) is required to use this case closure letter for all UST leak sites. We are also transmitting to you the enclosed case closure summary. These documents confirm the completion of the investigation and cleanup of the reported release at the subject site. The subject fuel leak case is closed. This case closure letter and the case closure summary can also be viewed on the State Water Resources Control Board's Geotracker website (<http://geotracker.swrcb.ca.gov>) and the Alameda County Environmental Health website (<http://www.acgov.org/aceh/index.htm>).

SITE INVESTIGATION AND CLEANUP SUMMARY

Please be advised that the following conditions exist at the site:

- Methyl tert-butyl ether remains in groundwater at concentrations up to 1,300 ppb.
- As described in section IV of the attached Case Closure Summary, the case was closed with Site Management Requirements that limit future land use to the current commercial land use only.

If you have any questions, please call Jerry Wickham at (510) 567-6791. Thank you.

Sincerely,


Donna L. Drogos, P.E.
Division Chief

Enclosures:

1. Remedial Action Completion Certification
2. Case Closure Summary

**ALAMEDA COUNTY
HEALTH CARE SERVICES
AGENCY**

ALEX BRISCOE, Director



DEPARTMENT OF ENVIRONMENTAL HEALTH
OFFICE OF THE DIRECTOR
1131 HARBOR BAY PARKWAY
ALAMEDA, CA 94502
(510) 567-6777
FAX (510) 337-9135

REMEDIAL ACTION COMPLETION CERTIFICATION

July 27, 2012

Mr. Frank Capilla
Can Am Plumbing, Inc.
151 Wyoming Street
Pleasanton, CA 94566

Subject: Case Closure for Fuel Leak Case No. RO0002425 and GeoTracker Global ID T0600156201, Can Am Plumbing, 151 Wyoming Street, Pleasanton, CA 94566

Dear Mr. Capilla:

This letter confirms the completion of a site investigation and remedial action for the underground storage tanks formerly located at the above-described location. Thank you for your cooperation throughout this investigation. Your willingness and promptness in responding to our inquiries concerning the former underground storage tank(s) are greatly appreciated.


Based on information in the above-referenced file and with the provision that the information provided to this agency was accurate and representative of site conditions, this agency finds that the site investigation and corrective action carried out at your underground storage tank(s) site is in compliance with the requirements of subdivisions (a) and (b) of Section 25299.37 of the Health and Safety Code and with corrective action regulations adopted pursuant to Section 25299.77 of the Health and Safety Code and that no further action related to the petroleum release(s) at the site is required.

Claims for reimbursement of corrective action costs submitted to the Underground Storage Tank Cleanup Fund more than 365 days after the date of this letter or issuance or activation of the Fund's Letter of Commitment, whichever occurs later, will not be reimbursed unless one of the following exceptions applies:

- Claims are submitted pursuant to Section 25299.57, subdivision (k) (reopened UST case); or
- Submission within the timeframe was beyond the claimant's reasonable control, ongoing work is required for closure that will result in the submission of claims beyond that time period, or that under the circumstances of the case, it would be unreasonable or inequitable to impose the 365-day time period.

This notice is issued pursuant to subdivision (h) of Section 25299.37 of the Health and Safety Code. Please contact our office if you have any questions regarding this matter.

Sincerely,

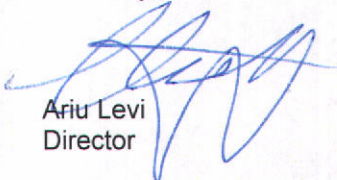

Ariu Levi
Director

cc:

Colleen Winey (QIC 8021) w/enc
Zone 7 Water Agency
100 North Canyons Pkwy
Livermore, CA 94551
(Sent via E-mail to: cwiney@zone7water.com)

Danielle Stefani (w/enc)
Livermore-Pleasanton Fire Department
3560 Nevada Street,
Pleasanton, CA 94566
(Sent via E-mail to: dstefani@lpfire.org)

Martin O'Gara
Can Am Plumbing, Inc.,
151 Wyoming Street
Pleasanton, CA 94566

Closure Unit
State Water Resources Control Board
UST Cleanup Fund
P.O. Box 944212
Sacramento, CA 94244-2120
(uploaded to GeoTracker)

City of Livermore Planning Department (w/enc),
1052 South Livermore Avenue,
Livermore, CA 94550

Douglas Lee
Gettler-Ryan, Inc.
6747 Sierra Court, Suite J
Dublin, CA 94568
(Sent via E-mail to: dlee@grinc.com)

Donna Drogos, ACEH (Sent via E-mail to: donna.drogos@acgov.org)
Jerry Wickham, ACEH (Sent via E-mail to: jerry.wickham@acgov.org)

GeoTracker (w/enc)
eFile (w/orig enc)

CASE CLOSURE SUMMARY
LEAKING UNDERGROUND FUEL STORAGE TANK - LOCAL OVERSIGHT PROGRAM

I. AGENCY INFORMATION

Date: April 11, 2012

Agency Name: Alameda County Environmental Health	Address: 1131 Harbor Bay Parkway
City/State/Zip: Alameda, CA 94502-6577	Phone: (510) 567-6791
Responsible Staff Person: Jerry Wickham	Title: Senior Hazardous Materials Specialist

II. CASE INFORMATION

Site Facility Name: Can Am Plumbing		
Site Facility Address: 151 Wyoming Street, Pleasanton, CA 94566		
RB Case No.: --	Local Case No.: STID 6437	LOP Case No.: RO0002425
URF Filing Date: 06/15/1999	GeoTracker ID: T0600156201	APN: 946-4542-5-01
Responsible Parties	Addresses	Phone Numbers
Frank Capilla	151 Wyoming Street Pleasanton, CA 94566	(925) 946-1833

Tank I.D. No	Size in Gallons	Contents	Closed In Place/Removed?	Date
1	1,000 gallons	Gasoline	Removed	6/10/1999
2	1,000 gallons	Gasoline	Removed	6/10/1999
Dispensers and Piping			Removed	6/10/1999

III. RELEASE AND SITE CHARACTERIZATION INFORMATION

Cause and Type of Release: The cause of the release is unknown. There were no holes, cracks, or other signs of failures or leaks observed during the removal of the USTs. The contaminants detected in soil and groundwater are consistent with a gasoline release.		
Site characterization complete? Yes	Date Approved By Oversight Agency: -----	
Monitoring wells installed? Yes	Number: 17	Proper screened interval? Yes
Highest GW Depth Below Ground Surface: 3.17 feet bgs	Lowest Depth: 52.20 feet bgs	Flow Direction: Variable across multiple vertical zones. The predominant regional flow direction is to the north.
Most Sensitive Current Use: Drinking water source.		

Summary of Production Wells in Vicinity: The nearest water supply well is an irrigation well located approximately 1,100 feet southeast of the site. The second nearest water supply well is a domestic well located approximately 1,250 feet southwest of the site. A total of three domestic wells and two municipal wells are located within a half mile of this site. Based on the distances from the site, none of these water supply wells are expected to be a receptor for the site.

Are drinking water wells affected? No	Aquifer Name: Amador Subbasin of Livermore-Amador Groundwater Basin
Is surface water affected? No	Nearest SW Name: Arroyo Del Valle, which is approximately 640 feet south of the site
Off-Site Beneficial Use Impacts (Addresses/Locations): None	
Reports on file? Yes	Where are reports filed? Alameda County Environmental Health and Livermore-Pleasanton Fire Department

TREATMENT AND DISPOSAL OF AFFECTED MATERIAL			
Material	Amount (Include Units)	Action (Treatment or Disposal w/Destination)	Date
Tank	2- 1,000 gal tanks	Transported to Ecology Control Industries facility at 255 Parr Blvd., Richmond, CA for disposal	6/10/1999
Piping	Approximately 30 feet	Transported to Ecology Control Industries facility at 255 Parr Blvd., Richmond, CA for disposal	6/10/1999
Free Product	---	---	---
Soil	¹⁾ 1.56 tons	¹⁾ , ²⁾ Transported to the Forward Incorporated facility in Manteca, CA for disposal	¹⁾ 6/16/2000
	²⁾ 3.61 tons		²⁾ 1/8/2003
	³⁾ 4.10 tons		³⁾ 6/29/2003
	⁴⁾ 2 tons	³⁾ , ⁴⁾ , ⁵⁾ Transported to Allied Waste's Keller Canyon Landfill facility in Pittsburg, CA for disposal	⁴⁾ 5/11/2007
	⁵⁾ 2.75 tons		⁵⁾ 2/3/2009
Groundwater	¹⁾ 1,000 gal	¹⁾ Transported to Ecology Control Industries facility at 255 Parr Blvd., Richmond, CA	¹⁾ 6/10/1999
	²⁾ 75 gal		²⁾ 11/4/1999
	³⁾ 110 gal	³⁾ Transported to Seaport Refining & Environmental 700 Seaport Boulevard Redwood City, CA 94063	³⁾ 3/31/2010
	⁴⁾ 12,355 gal		⁴⁾ Groundwater purged from W-1 on 10/12/99, 10/14/99, 10/28/99, 11/04/99, 2/8/00, 2/22/00, 5/4/00, 7/15/02, 8/1/02, and 8/6/02

MAXIMUM DOCUMENTED CONTAMINANT CONCENTRATIONS BEFORE AND AFTER CLEANUP
(Please see Attachments 1 through 5 for additional information on contaminant locations and concentrations)

Contaminant	Soil (ppm)		Water (ppb)	
	Before	After	Before	After
TPH (Gas)	3.3	3.3	39,000 ¹	<50 ²
TPH (Diesel)	Not Analyzed	Not Analyzed	Not Analyzed	Not Analyzed
Oil and Grease	Not Analyzed	Not Analyzed	Not Analyzed	Not Analyzed
Benzene	0.005	0.005	1,100 ¹	<0.50 ²
Toluene	<0.005	<0.005	660 ¹	<0.50 ²
Ethylbenzene	0.023	0.023	490 ¹	<0.50 ²
Xylenes	0.038	0.038	18,000 ¹	<0.50 ²
Heavy Metals (Cd, Cr, Pb, Ni, Zn)	<5.0 ³	<5.0 ³	Not Analyzed	Not Analyzed
MTBE	4.1 ⁴	4.1 ⁴	100,000 ⁵	1,300 ⁶
Other (8240/8270)	Not Analyzed	Not Analyzed	Not Analyzed	Not Analyzed

¹⁾ Maximum concentration before cleanup is a results from a grab groundwater sample collected on June 10, 1999 during tank removal from location W-1.

²⁾ Not detected at concentrations above the reporting limit in any wells during the most recent sampling event on June 7, 2011.

³⁾ Lead <5.0 ppm; no other metals analyzed.

⁴⁾ MTBE = 4.1 ppm; TBA = 1.7 ppm; TAME = 0.083 ppm; DIPE < 0.005 ppm; ETBE < 0.005 ppm; EDB <0.005 ppm; and EDC < 0.005 ppm.

⁵⁾ MTBE = 100,000 ppb; TBA = 860 ppb; TAME = 61 ppb; DIPE < 9.0 ppb; ETBE < 9.0 ppb; EDB <0.5 ppb; EDC < 0.5 ppb; and ethanol <10,000 ppb.

⁶⁾ During the most recent groundwater sampling event on June 7, 2011, MTBE = 1,300 ppb; TBA = 80 ppb; TAME = 130 ppb; DIPE < 15 ppb; ETBE < 15 ppb; EDB, EDC, and ethanol not analyzed.

Site History and Description of Corrective Actions:

The site is a commercial property currently used by Can Am Plumbing. Surrounding land use is also commercial. The site is underlain by Holocene-age alluvium ranging in grain size from clay to well-graded gravel. Three water-bearing zones consisting of coarse-grained soils have been identified within the upper 80 feet. In addition, a perched zone is present within the area of the former tank pit. Groundwater flow directions are variable within each of the vertical zones and are not consistent across zones.

Two 1,000-gallon single-wall fiberglass USTs were removed from the site on June 10, 1999. The USTs were reportedly installed in 1972 and were in use up to the removal date. Upon removal, two soil samples were collected from the north and south sidewalls of the UST excavation (X-1-3 and X-2-3) at a depth of approximately three feet below grade (fbg). Soil samples from the UST excavation contained 0.005 ppm benzene and 4.1 ppm MTBE. One soil sample was also collected from beneath the former dispenser (D-1-3) and contained 0.008 ppm xylenes and 3.6 ppm MTBE. Two soil stockpile samples (S-1 and S-2) contained 3.3 ppm TPHg, 0.11 ppm xylenes, and 0.2 ppm MTBE. A groundwater sample (W-1) was collected from the UST backfill monitoring casing, located approximately four feet east of the former USTs. Water sample W-1 contained 39,000 ppb TPHg, 1,100 ppb benzene, and 100,000 ppb MTBE.

Two on-site soil borings were drilled on January 21, 2000 and completed as groundwater monitoring wells MW-1 and MW-2. The wells were installed to an approximate depth of 32 feet. Neither TPHg nor BTEX were detected in either MW-1 or MW-2 soil samples. MTBE was detected in five of six soil samples collected from well boring MW-2 at concentrations of 0.12 ppm to 3.6 ppm. MTBE was not detected in any MW-1 soil samples.

Monitoring well MW-1 was developed on January 26, 2000. MW-1 was dewatered during construction and yielded only five well volumes. Well MW-2 was dry and therefore not developed. A grab groundwater sample was collected on January 31, 2000 from MW-1 and well MW-2 was again dry. Another groundwater sampling event took place on May 11, 2000 in which wells MW-1, MW-2, and the UST pit monitoring casing W-1 were sampled. Groundwater was observed in well MW-2 during this event and the well was developed on February 24, 2000. The dewatering process during the construction of well MW-2 yielded four well volumes. Wells MW-1 and MW-2 were sampled again on May 11, 2000. The UST pit monitoring casing W-1 was additionally sampled on January 27, February 24, and May 11, 2000.

The analysis of the grab groundwater samples collected from MW-1 on January 31 and May 11, 2000 did not report any analytes at concentrations above reporting limits. Groundwater samples from MW-2, collected on May 11, 2000, contained 11,000 ppb MTBE by EPA Method 8020, 12,000 ppb MTBE by EPA Method 8260, and TPHg and BTEX were reported as not detected due to elevated detection levels.

Perched groundwater was removed intermittently from UST pit monitoring casing well W-1, starting on October 12, 1999. Between the dates October 12, 1999 and August 6, 2002, a total of 12,355 gallons of groundwater were removed from well W-1.

On September 5, 2002, soil boring B-1 was advanced to a depth of approximately 32 fbg. On October 31 and November 1, 2002, soil borings B-2, B-3, and MW-3 were advanced in addition to the overdrilling and extension of boring B-1. All borings (B-1 to B-3, MW-3) were drilled to depths between 40 and 42 fbg and soil samples were collected every five feet. Soil boring MW-3 was converted to a monitoring well on December 26, 2002.

As part of a perched groundwater study and well installation, three groundwater monitoring wells (MW-1A, MW-2A and MW-3A) and seven piezometers (PZ-1 through PZ-7) were installed on May 8 to 10, 2006 to depths ranging from 10 to 55 fbg. Soil borings for monitoring wells were sampled every five feet. One soil sample was collected from each piezometer soil boring and collected at a depth of 10 feet. The soil stockpiled from the construction of the monitoring wells and piezometers was sampled as a composite (SP1-A,B,C, D).

No analytes were detected in the soil samples collected from soil boring MW-1A. The only contaminants in soil boring MW-2A were MTBE, TBA, and TAME which were detected at concentrations of up to 1.3 ppm, 1.7 ppm, and 0.021 ppm, respectively. The only contaminant detected in soil boring MW-3A was MTBE at depths of 10 and 15 fbg and at concentrations of 0.026 ppm and 0.0070 ppm, respectively. The piezometer boring samples, which were collected in and around the former UST excavation pit, contained MTBE and TBA at concentrations up to 1.9 ppm and 1.6 ppm, respectively. One soil boring sample, PZ-6, contained TPHg, ethylbenzene, and xylenes at concentrations of 3.3 ppm, 0.023 ppm, and 0.034 ppm, respectively.

Site History and Description of Corrective Actions (continued):

Groundwater samples were collected from monitoring wells MW-1A, MW-2A, and MW-3A on June 9, 2006. Groundwater from well MW-2A was reported as having the highest concentrations of 5,300 ppb MTBE, 61 ppb TAME, and 860 ppb TBA. TPHg, BTEX, and DIPE were not detected in any of the groundwater samples.

Soil borings MW-4 and MW-5 were drilled on April 10 and 11, 2007 to depths of 53.5 and 52 fbg, respectively. Soil samples from MW-4 contained MTBE, TBA, and TAME. MTBE was detected at all depths in the MW-4 samples except 29.5 fbg and the highest concentration was 0.51 ppm, collected at 53 fbg. Similarly, MW-5 soil samples contained MTBE, TBA, and TAME, with the greatest MTBE concentration of 0.29 ppm at the deepest collection depth of 50.5 fbg.

Seven Geoprobe borings (GP-1 through GP-7) were advanced on April 9, 2007 to depths of 10 and 15 fbg. Analytical reports of the Geoprobe soil samples reported MTBE, TBA, and TAME at concentrations up to 0.69 ppm, 0.23 ppm, and 0.0069 ppm, respectively.

One cone penetration test (CPT) boring, CPT-1, was advanced on April 17, 2007 to a maximum depth of 80 fbg in order to obtain soil and hydrogeologic data, and collect discrete groundwater samples. The soil and hydrogeologic data revealed two more permeable water bearing zones, one from 67 to 70 fbg, and another from 78 to 80 fbg. Discrete groundwater samples were collected from these water bearing zones at 70 and 80 fbg. Analysis of the groundwater samples revealed that the first water bearing zone, 67 to 70 fbg, contained MTBE, TAME, and TBA at concentrations of 2,600 ppb, 28 ppb, and 280 ppb. The second water bearing zone, 78 to 80 fbg, contained only MTBE at 1.8 ppb.

Four CPT borings (CPT-2 through CPT-5) were advanced on February 21 and 22, 2008 and April 11, 2008. CPT-2 was advanced to obtain soil stratigraphy and hydrogeologic data to a depth of 46 fbg. CPT-3, CPT-4, and CPT-5 were used to collect discrete groundwater samples and advanced to 65 fbg, 64 fbg, and 80 fbg, respectively. Discrete permeable zones were encountered while performing the CPT borings. Attempts were made to collect water in intervals within each permeable zone. However, water was not always present and only four depth-discrete samples were collected. MTBE was the only analyte detected and in only two of the four groundwater samples, CPT3-51 and CPT4-51.5, at concentrations of 1.4 ppb and 0.98 ppb, respectively.

Monitoring wells MW-6 and MW-7 were completed on January 13, 2009 to depths of 50 and 51 fbg, respectively. Soil samples were collected from the well borings at five foot intervals. MW-7 had insufficient water to collect a groundwater sample and MW-6 was dry. Therefore, no groundwater samples were collected during this event.

Groundwater monitoring was conducted quarterly from 3rd quarter 2006 to 2nd quarter 2011. Concentrations of TPHg and MTBE have been consistently highest in MW-2, which is located down gradient of the former UST. Groundwater has had a historical low depth of 52.20 fbg on September 22, 2008 from MW-5. The historically high depth of groundwater is 3.17 fbg, measured on December 26, 2002 in former tank pit casing W-1.



IV. CLOSURE

Does completed corrective action protect existing beneficial uses per the Regional Board Basin Plan? Yes		
Does completed corrective action protect potential beneficial uses per the Regional Board Basin Plan? Yes		
Does corrective action protect public health for current land use? Alameda County Environmental Health staff does not make specific determinations concerning public health risk. However, based upon the information available in our files to date, it does not appear that the release would present a risk to human health based upon current land use and conditions.		
Site Management Requirements: Case closure for this fuel leak site is granted for the current commercial land use only. If a change in land use to any residential or other conservative land use scenario occurs at this site, Alameda County Environmental Health (ACEH) must be notified as required by Government Code Section 65850.2.2. ACEH will re-evaluate the case upon receipt of approved development/construction plans.		
Excavation or construction activities in areas of residual contamination require planning and implementation of appropriate health and safety procedures by the responsible party prior to and during excavation and construction activities.		
Should corrective action be reviewed if land use changes? Yes		
Was a deed restriction or deed notification filed? No		Date Recorded: --
Monitoring Wells Decommissioned: No	Number Decommissioned: 0	Number Retained: 17
List Enforcement Actions Taken: None		
List Enforcement Actions Rescinded: --		

V. ADDITIONAL COMMENTS, DATA, ETC.

Considerations and/or Variances:
No soil vapor sampling has been conducted at the site. Based on the absence of volatile compounds in soil and groundwater samples, soil vapor sampling does not appear to be warranted.
Conclusion:
Alameda County Environmental Health staff believe that the levels of residual contamination do not pose a significant threat to water resources, public health and safety, and the environment under the current commercial land use based upon the information available in our files to date. No further investigation or cleanup for the fuel leak case is necessary unless a change in land use to any residential or other conservative land use scenario occurs at the site. ACEH staff recommend closure for this site.

VI. LOCAL AGENCY REPRESENTATIVE DATA

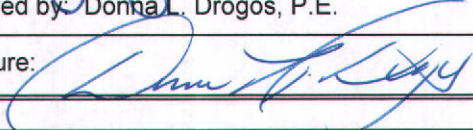Prepared by: Jerry Wickham	Title: Senior Hazardous Materials Specialist
Signature: 	Date: 04/25/12
Approved by: Donna L. Drogos, P.E.	Title: Division Chief
Signature: 	Date: 04/25/12

This closure approval is based upon the available information and with the provision that the information provided to this agency was accurate and representative of site conditions.

VII. REGIONAL BOARD NOTIFICATION

Regional Board Staff Name: Cherie McCaulou	Title: Engineering Geologist
Notification Date: 05/01/12	

VIII. MONITORING WELL DECOMMISSIONING

Date Requested by ACEH: 04/25/12	Date of Well Decommissioning Report: 07/25/12	
All Monitoring Wells Decommissioned: Yes ☒ No ☐	Number Decommissioned: 18	Number Retained: 0
Reason Wells Retained: NA		
Additional requirements for submittal of groundwater data from retained wells: None		
ACEH Concurrence - Signature: Jerry Wailsham		Date: 07/26/12

Attachments:

1. Site Vicinity Maps (2 pp)
2. Site Plans and Cross Sections (5 pp)
3. Groundwater Elevation Contour and Chemical Concentration Maps (6 pp)
3. Soil Analytical Data (8 pp)
4. Groundwater Analytical Data (31 pp)
5. Boring Logs (43 pp)

This document and the related CASE CLOSURE LETTER & REMEDIAL ACTION COMPLETION CERTIFICATE shall be retained by the lead agency as part of the official site file.

Wickham, Jerry, Env. Health


From: Cherie MCcaulou [CMccaulou@waterboards.ca.gov]
Sent: Tuesday, May 01, 2012 12:17 PM
To: Wickham, Jerry, Env. Health
Subject: Re: Pending closure for RO2425, 151 Wyoming Street, Pleasanton

Jerry - thank you for the notice of case closure for 151 Wyoming Street site in Pleasanton. We have no objection to this ACEH action. If you have any questions, please call me. Thanks

v.org> 5/1/2012 7:55 AM >>>
Hi Cherie,

This email provides notification of pending closure for ACEH case RO2425, 151 Wyoming Street, Pleasanton.

Jerry Wickham
Alameda County Environmental Health
1131 Harbor Bay Parkway
Alameda, CA 94502-6577
phone: 510-567-6791
jerry.wickham@acgov.org

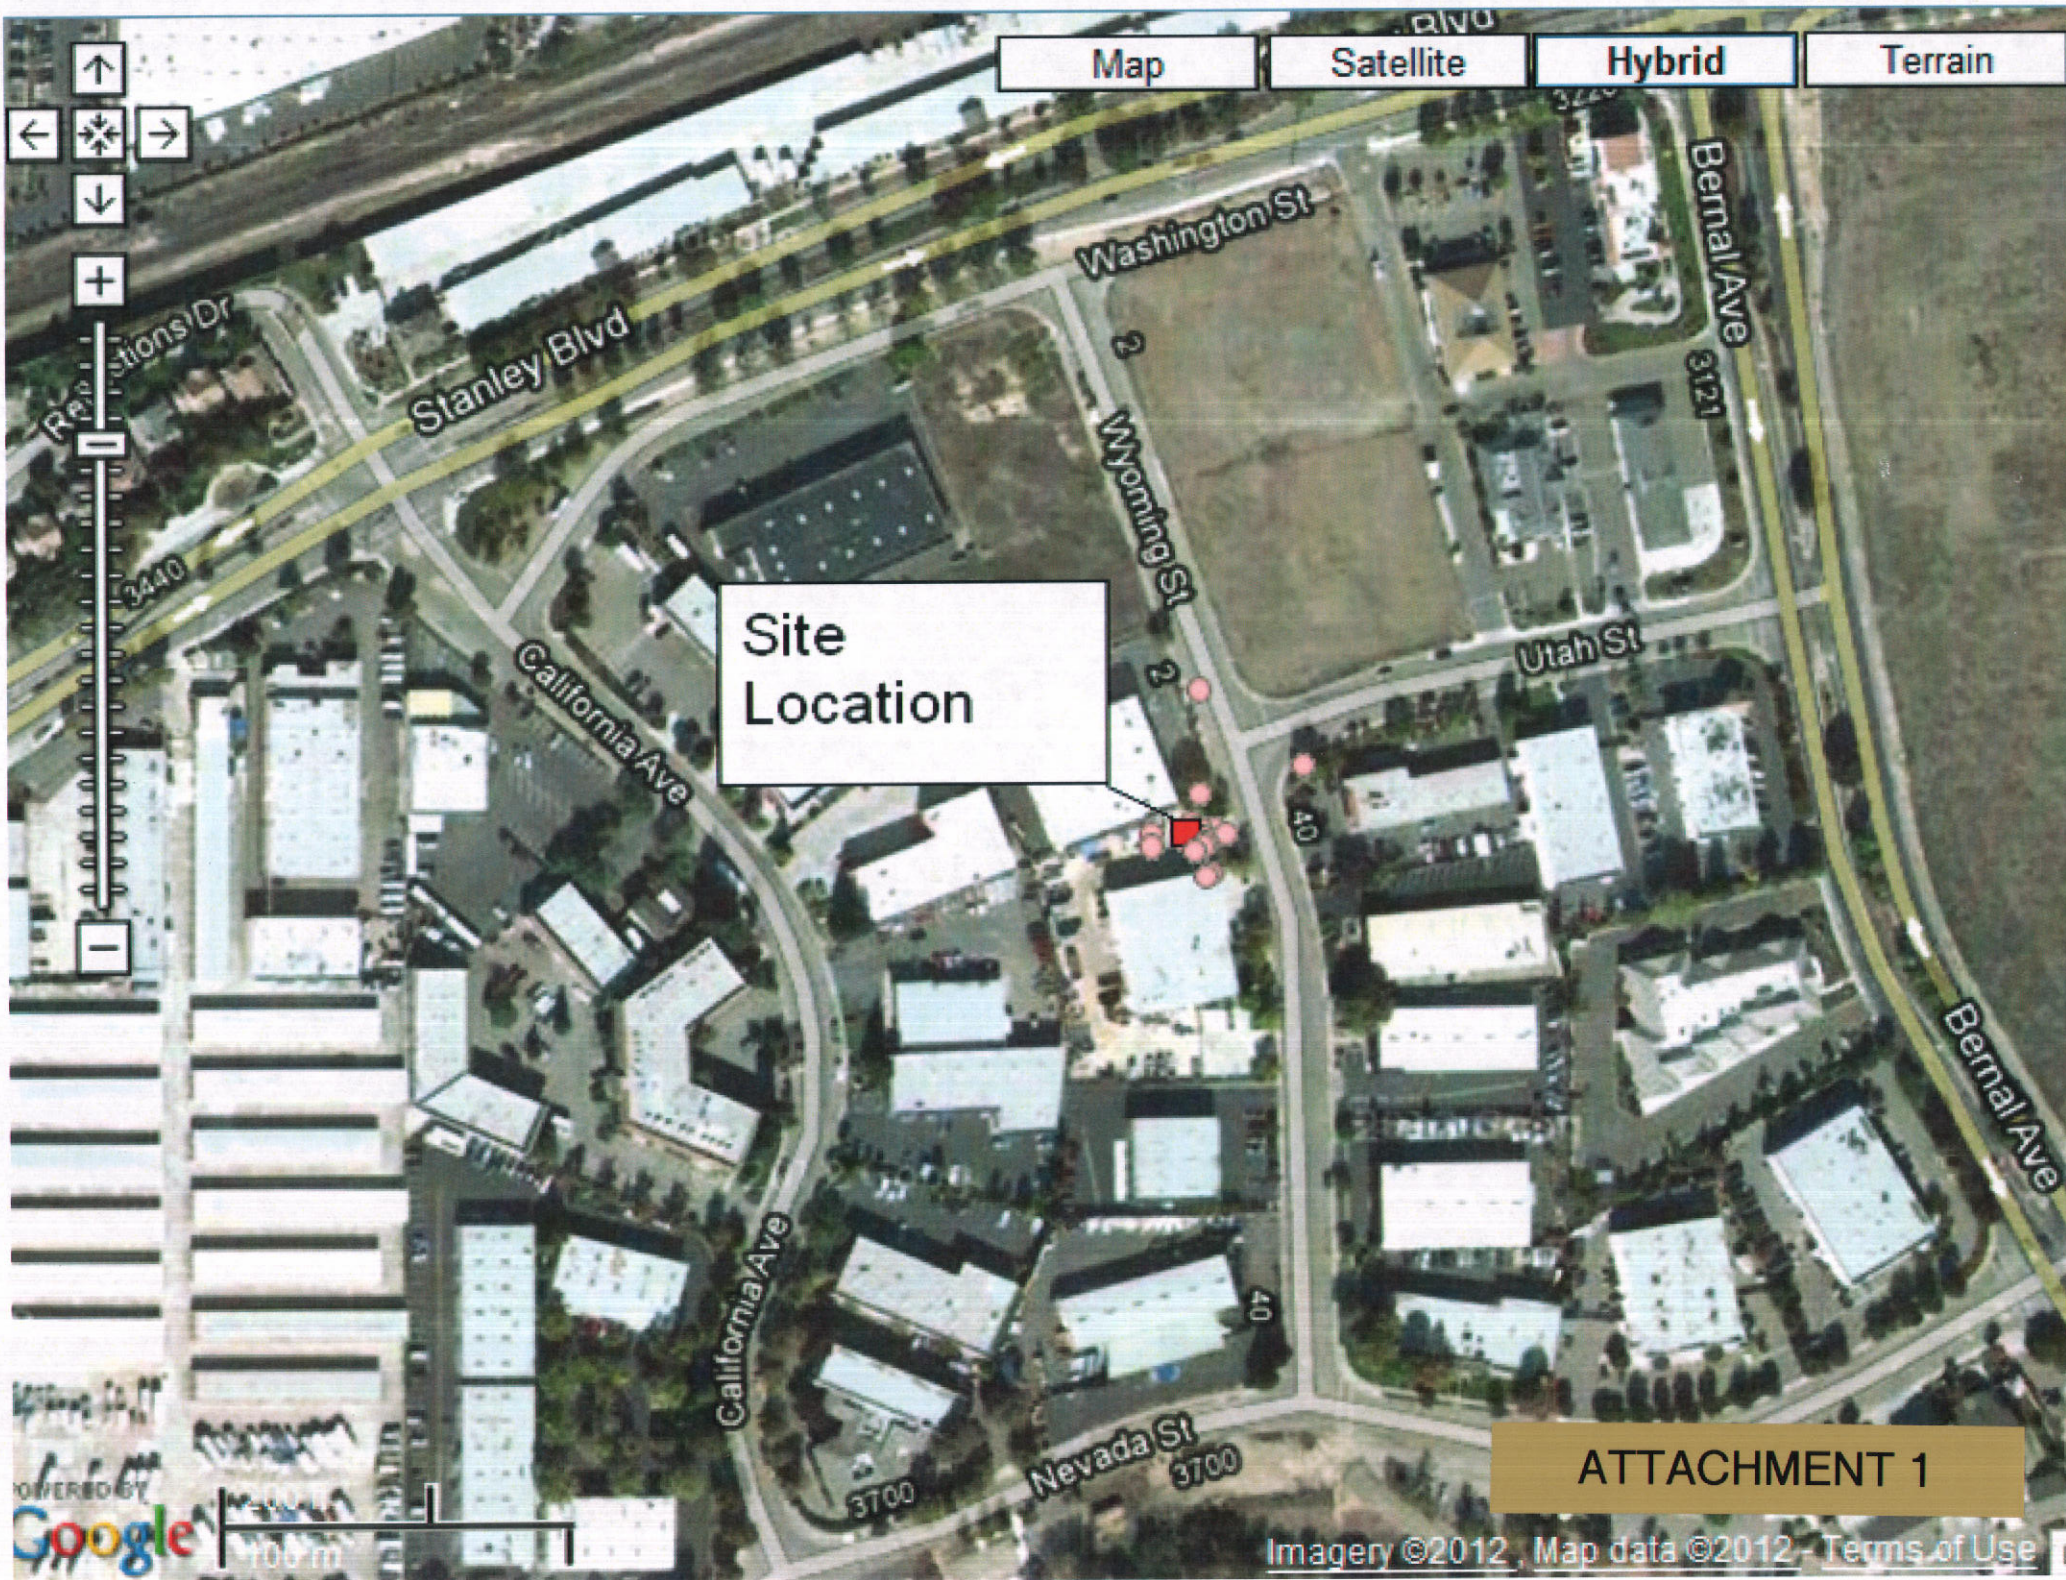

Map

Satellite


Hybrid

Terrain

Site
Location

ATTACHMENT 1

Imagery ©2012, Map data ©2012, Terms of Use

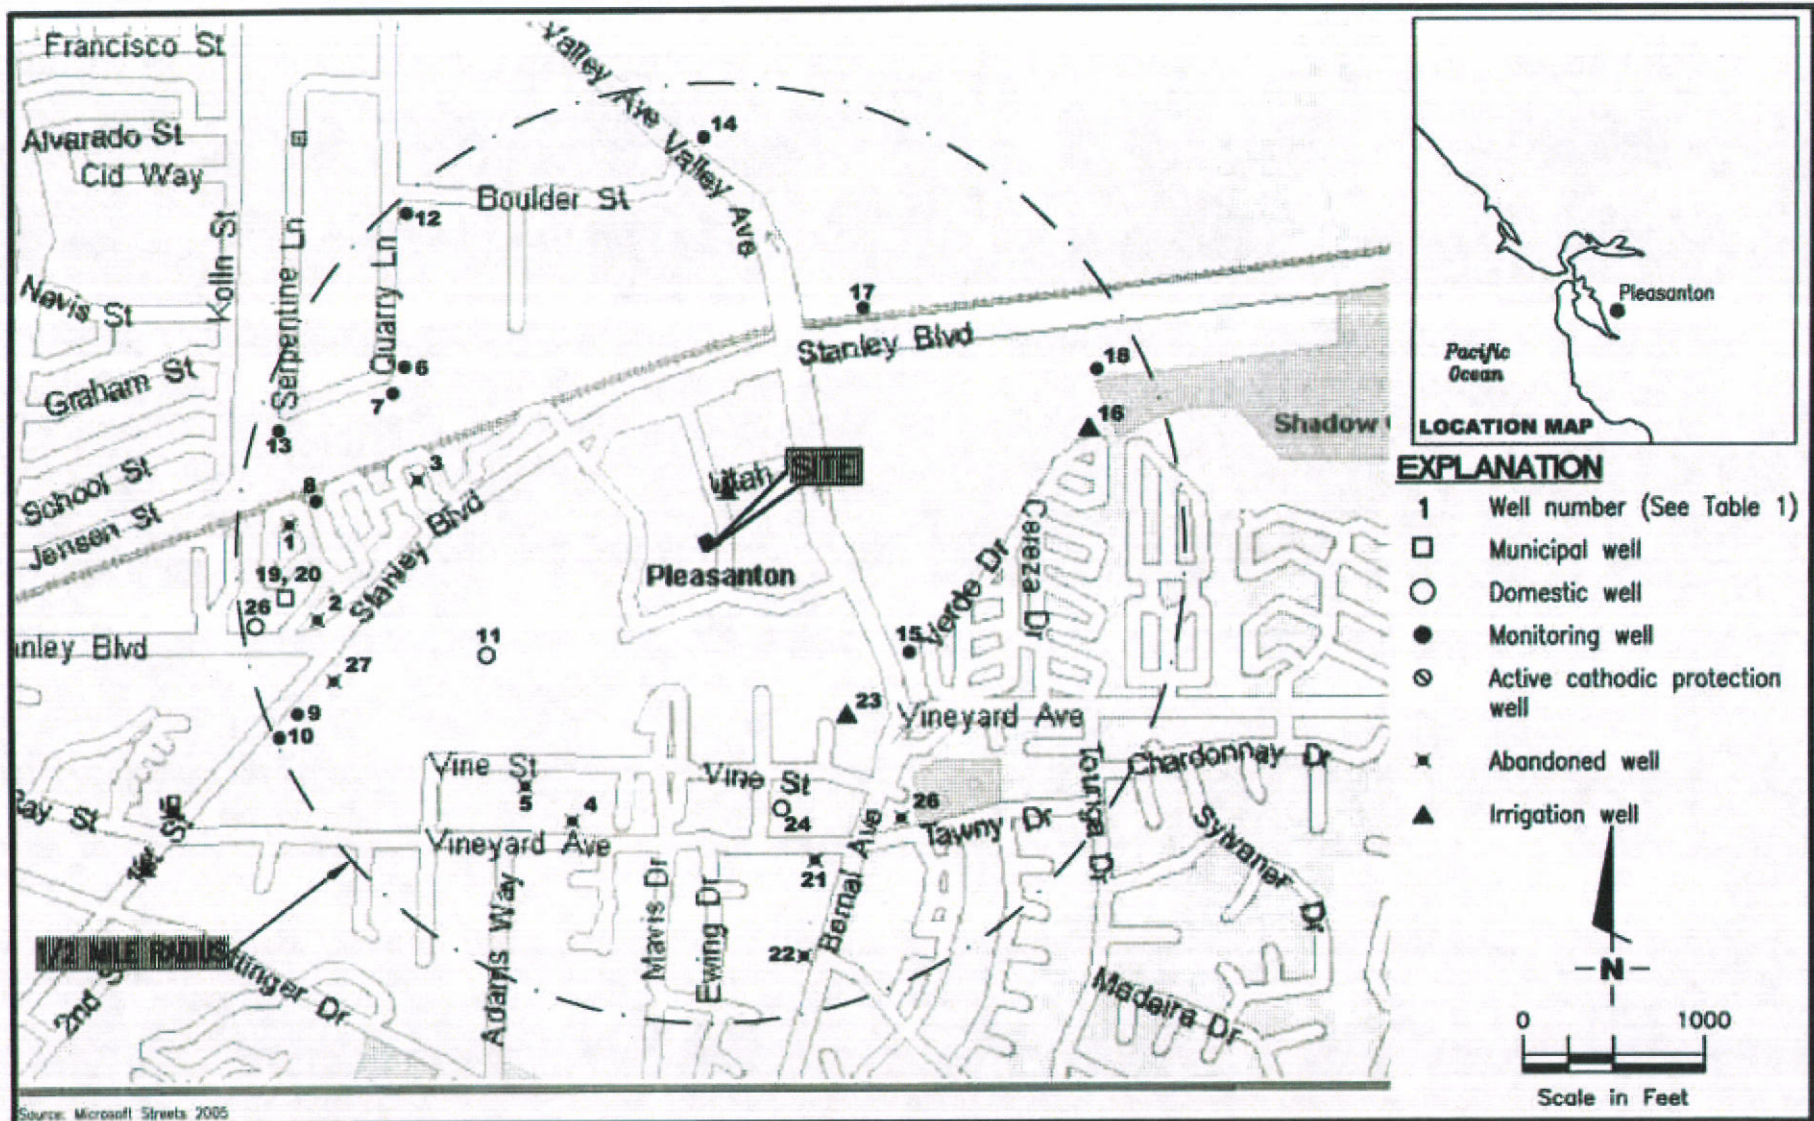

GETTLER - RYAN INC.
 6747 Sierra Court, Suite J
 Dublin, CA 94568 (925) 551-7555

WELL SEARCH MAP - 1/2 MILE RADIUS
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

PROJECT NUMBER
 948162.04

REVIEWED BY

DATE
 01/06

REVISED DATE



FILE NAME: P:\Enviro\Can-Am Plumbing\WC-Can-Am Plumbing.dwg | Layout Tab: Well Search 01-06

FIGURE

4

EXPLANATION

- ◆ Groundwater monitoring well
- ⊕ Existing tank backfill casing
- ⊗ Piezometer
- Soil boring
- Soil sample location
- SD— Storm drain

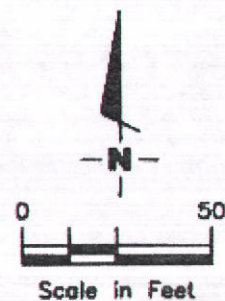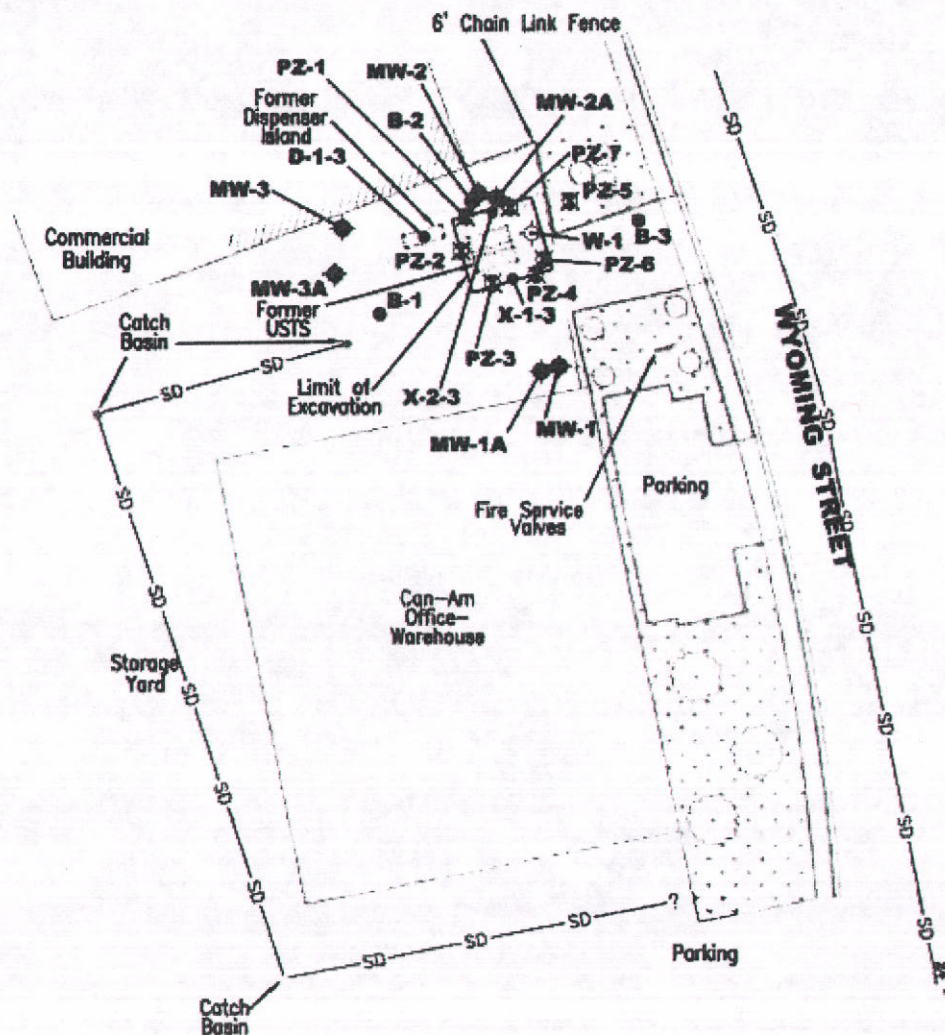

Source: Figure drawn from Gettler-Ryan field observations.

GETTLER - RYAN INC.
 6747 Sierra Court, Suite J
 Dublin, CA 94568 (925) 551-7555

SITE PLAN
 Can-Am Plumbing Inc.
 151 Wyoming Street
 Pleasanton, California

JOB NUMBER
 948162.4

REVIEWED BY

DATE
 June 15, 2006

REVISED

FILE NAME: F:\Environ\Can-Am Plumbing\AOB-151.dwg | Layout Tab: Site Plan


FIGURE

2

ATTACHMENT 2

EXPLANATION

- ◆ Groundwater monitoring well
- ⊕ Existing tank backfill casing
- ⊗ Piezometer
- Soil boring
- Soil sample location
- SD— Storm drain
- A A' Cross section line

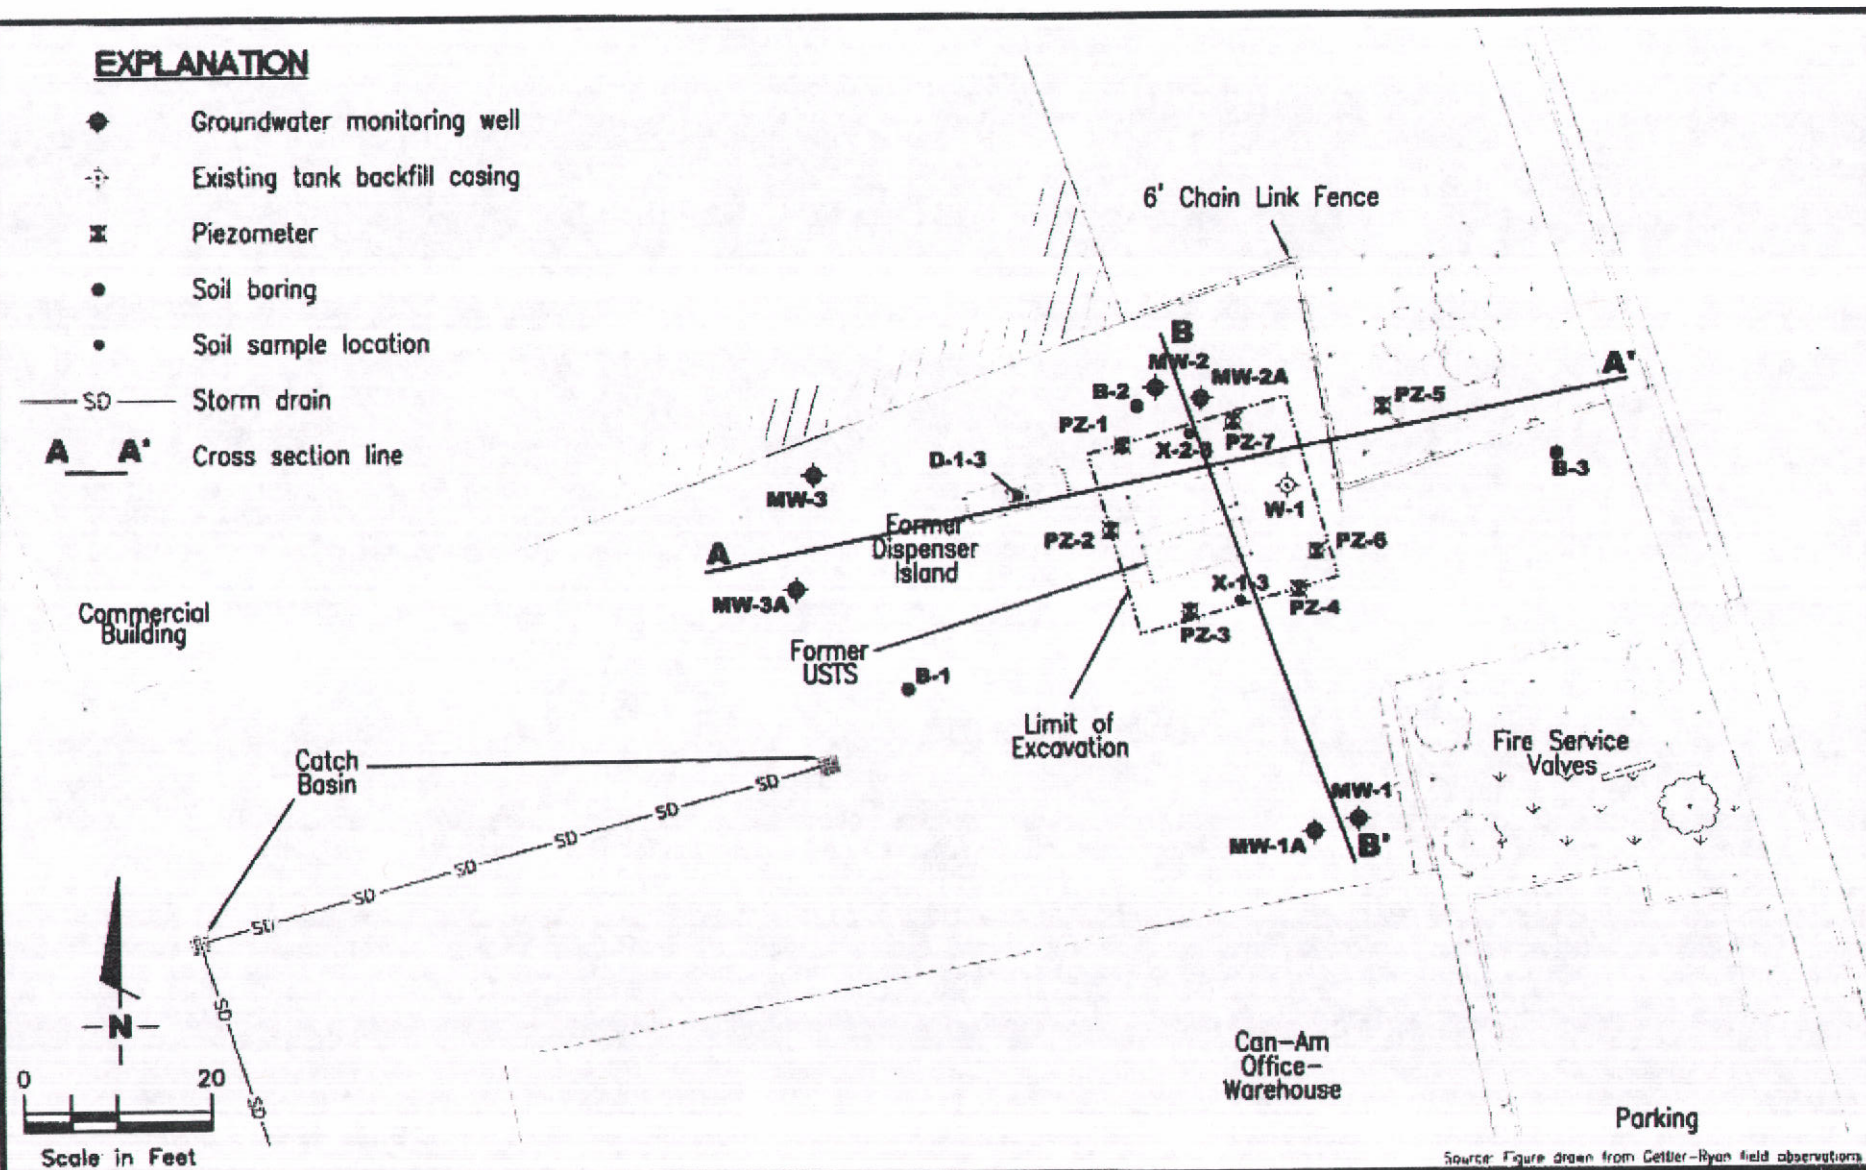

GETTLER - RYAN INC.
 6747 Sierra Court, Suite J
 Dublin, CA 94568 (925) 551-7555

DETAILED SITE PLAN
 Can-Am Plumbing Inc.
 151 Wyoming Street
 Pleasanton, California

JOB NUMBER
 948162.4

REVIEWED BY


DATE
 June 15, 2006

REVISED DATE


FILE NAME: P:\Drawings\Can-Am Plumbing\426-151.dwg | Layout Tab: Detailed Site Plan

FIGURE

3

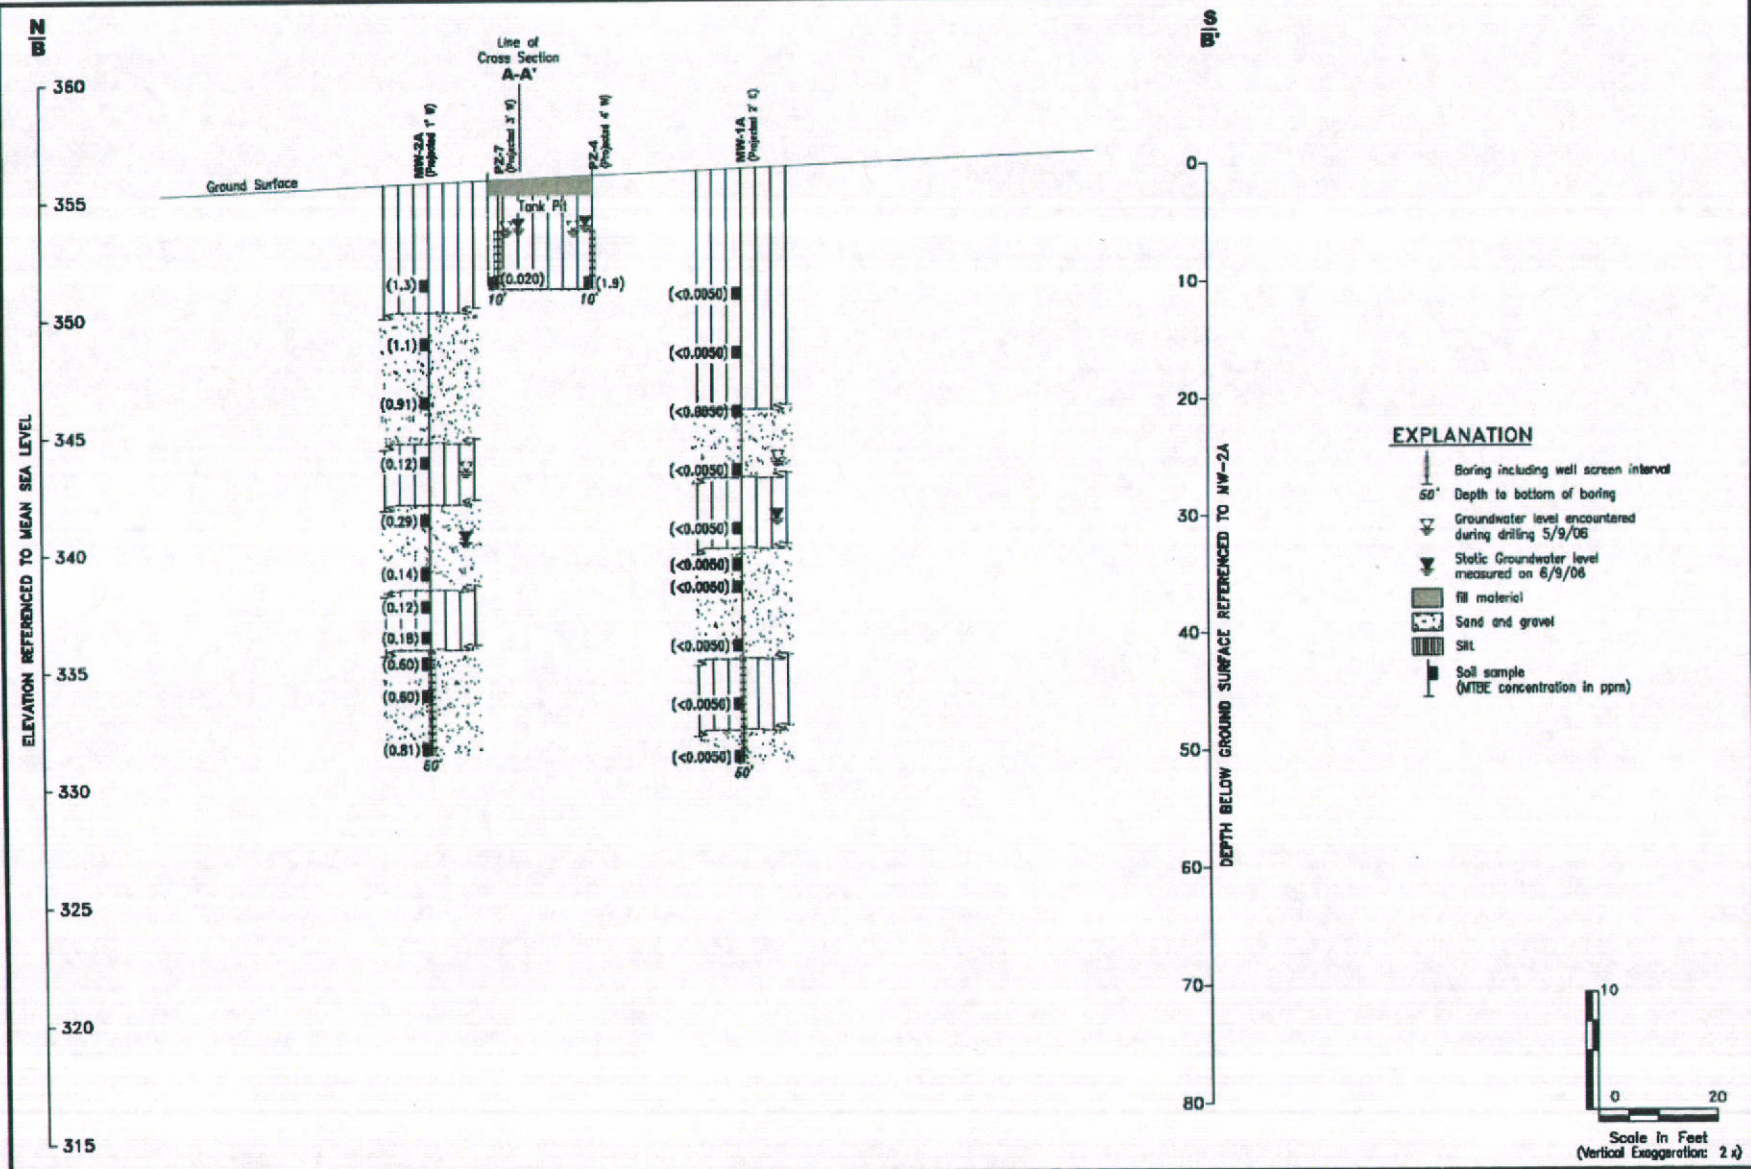

GW M 2011

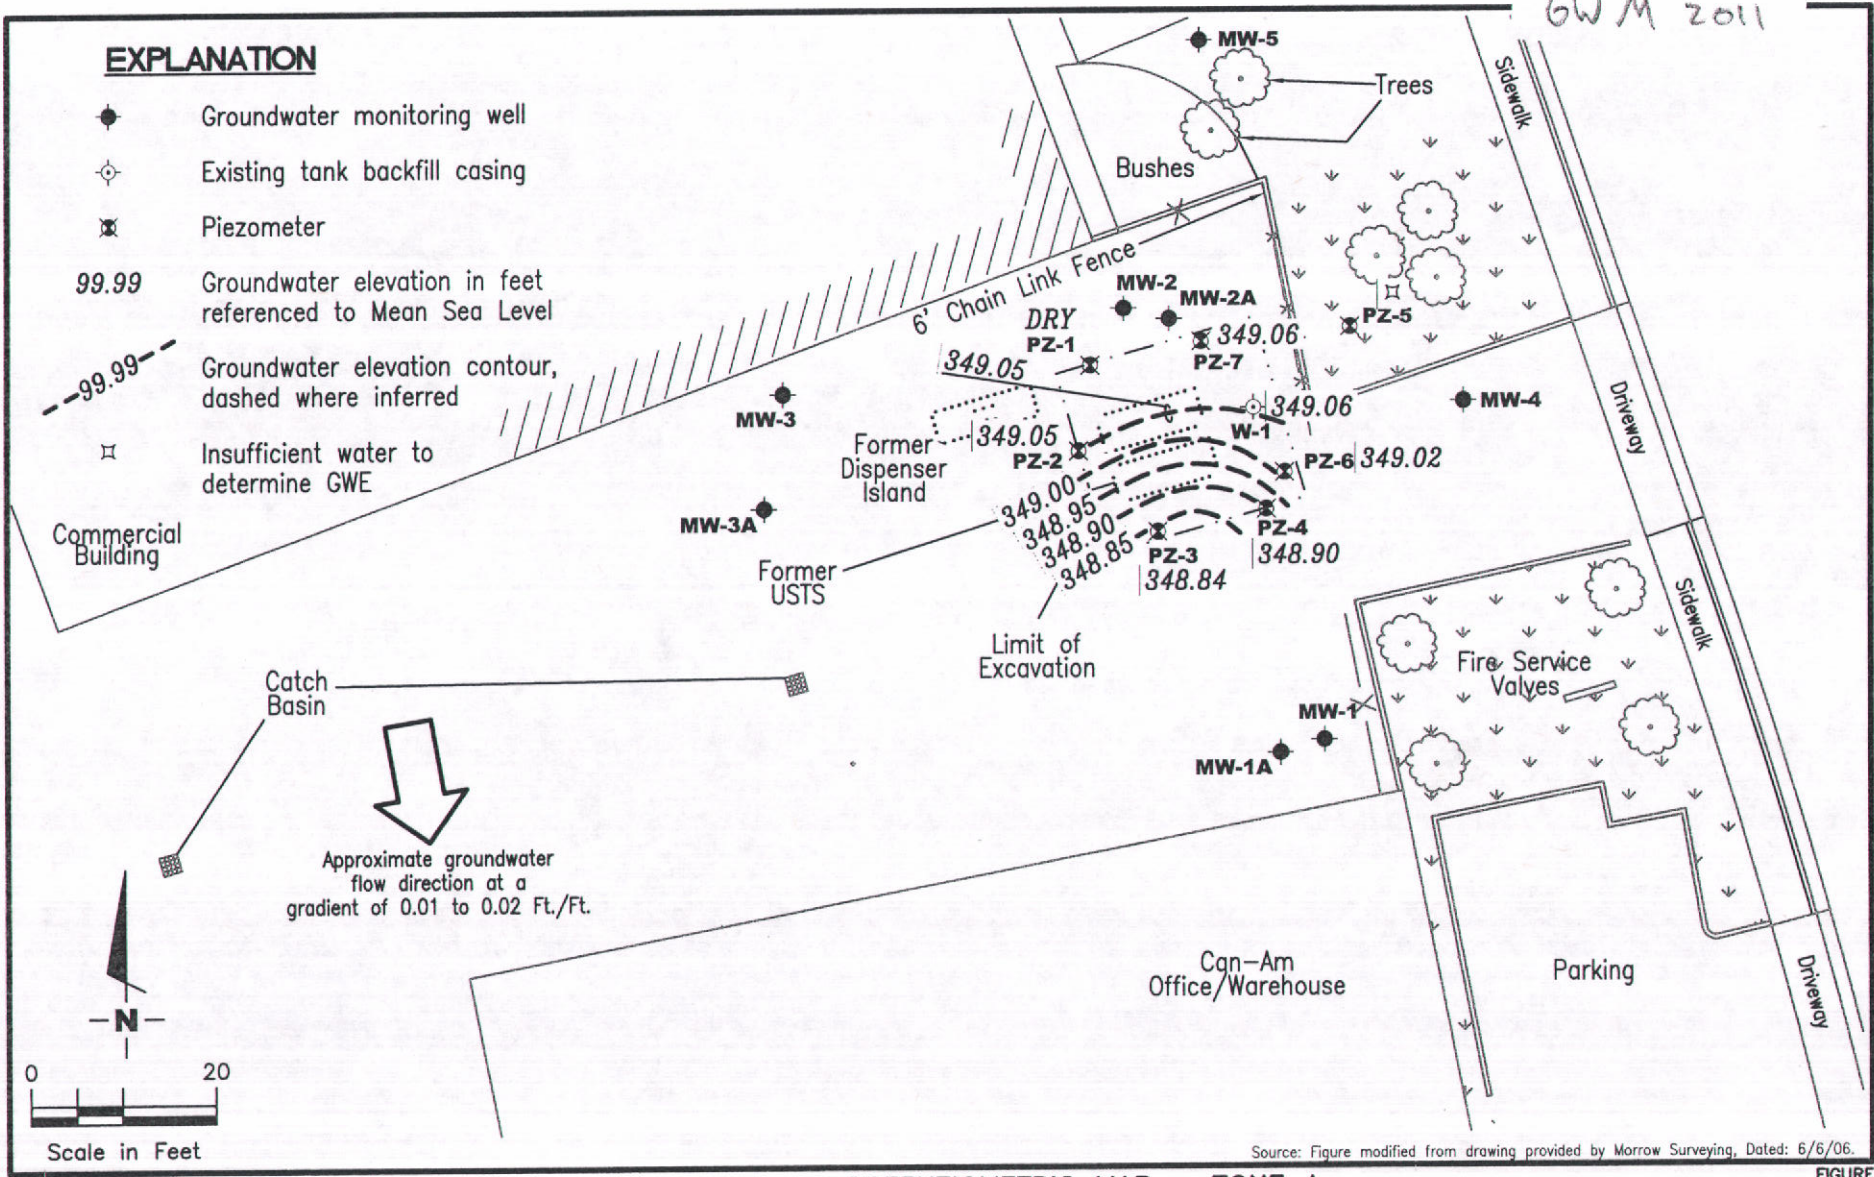

GETTLER - RYAN INC.
 6747 Sierra Court, Suite J
 Dublin, CA 94568 (925) 551-7555

POTENTIOMETRIC MAP - ZONE A
 Can-Am Plumbing Inc.
 151 Wyoming Street
 Pleasanton, California

FIGURE
3

JOB NUMBER
 948162

REVIEWED BY


DATE
 June 7, 2011

FILE NAME: P:\Enviro\Can-Am Plumbing\Q11AB-Can-Am Plumbing.dwg | Layout Tab: Pot2-A

ATTACHMENT 3

- Groundwater monitoring well
- Existing tank backfill casing
- Piezometer

Groundwater elevation contour,
dashed where inferred

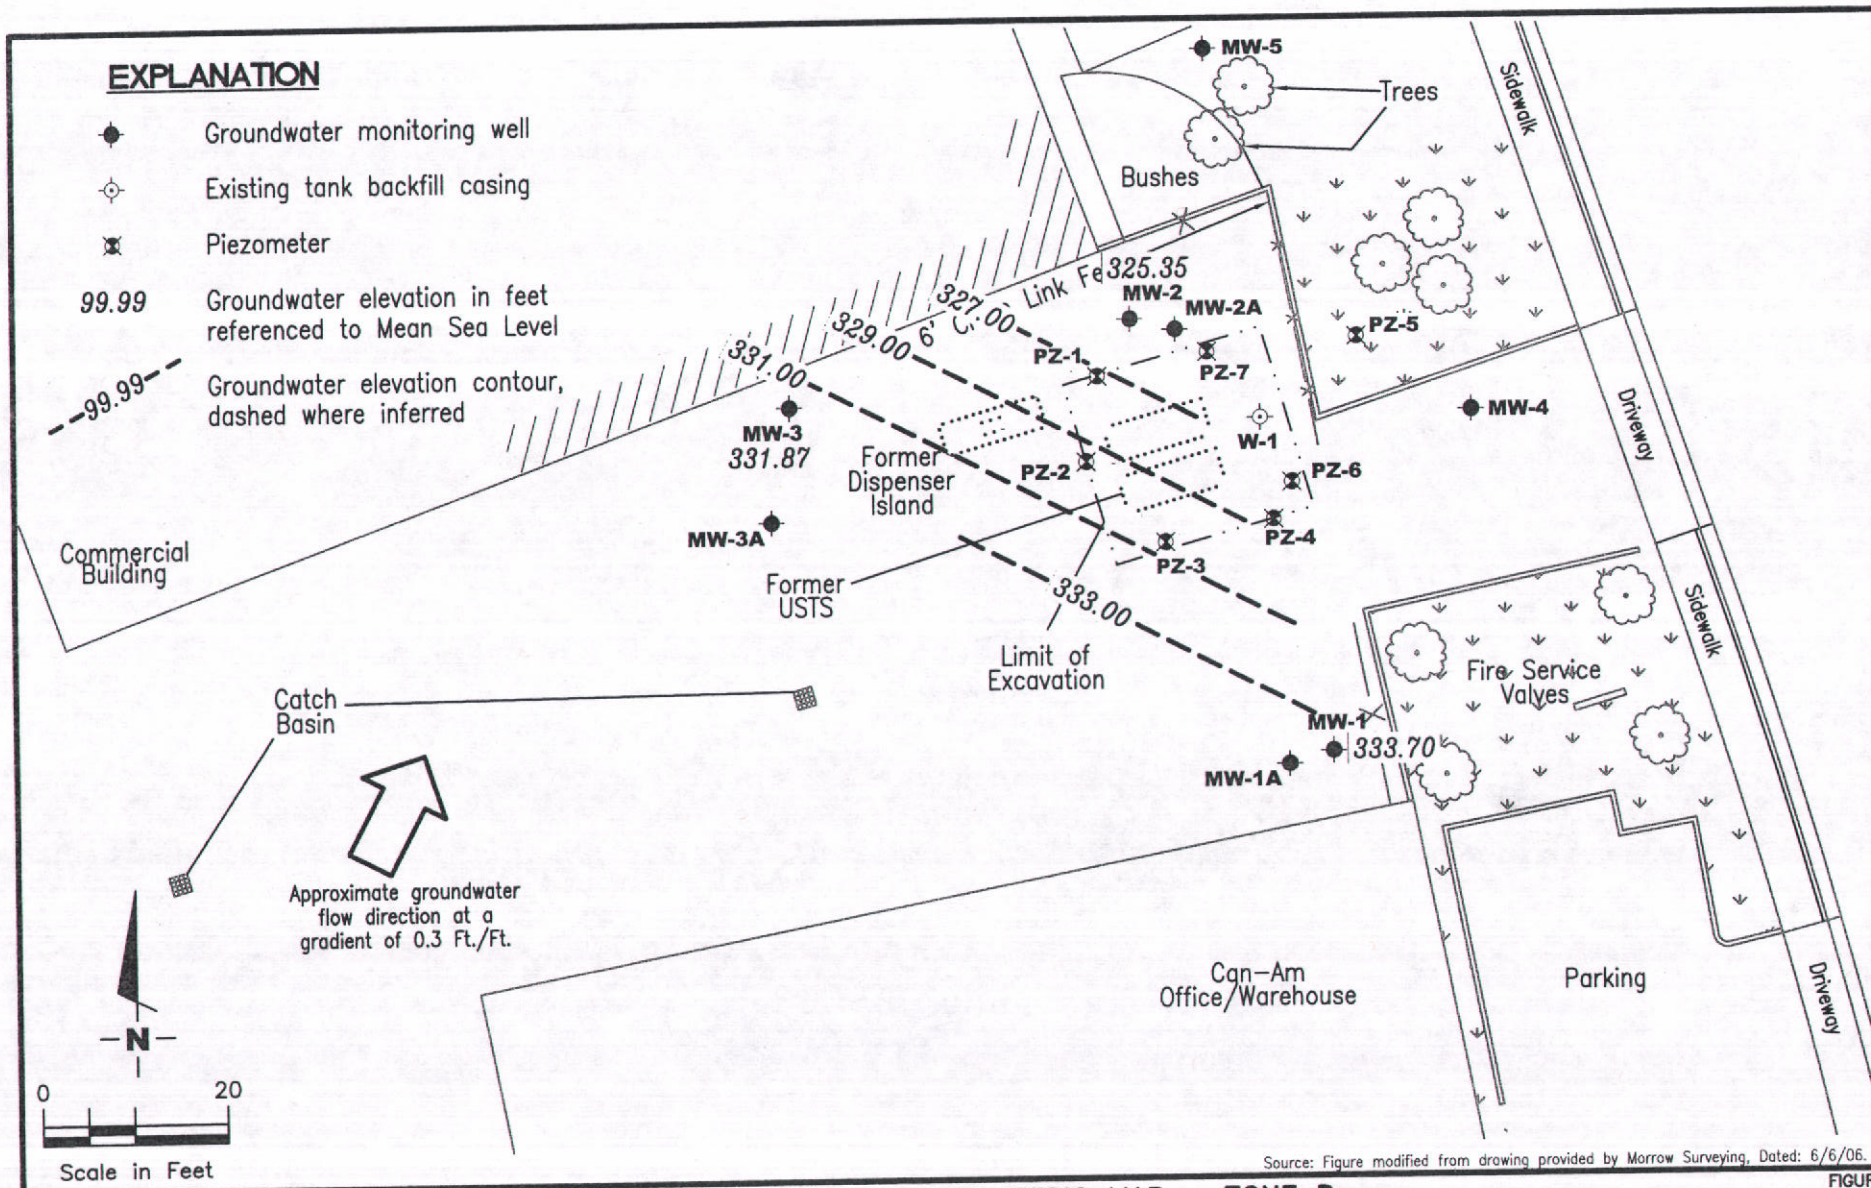

Source: Figure modified from drawing provided by Morrow Surveying, Dated: 6/6/06.

FIGURE



GETTLER - RYAN Inc.

6747 Sierra Court, Suite J
Dublin, CA 94568

(925) 551-7555

POTENTIOMETRIC MAP - ZONE B

Can-Am Plumbing Inc.
151 Wyoming Street
Pleasanton, California

4


JOB NUMBER
948162

REVIEWED BY


DATE
June 7, 2011

REVISÉ DATE

FILE NAME: P:\Enviro\Can-Am Plumbing\Q11AB-Can-Am Plumbing.dwg | Layout Tab: Pot2-B

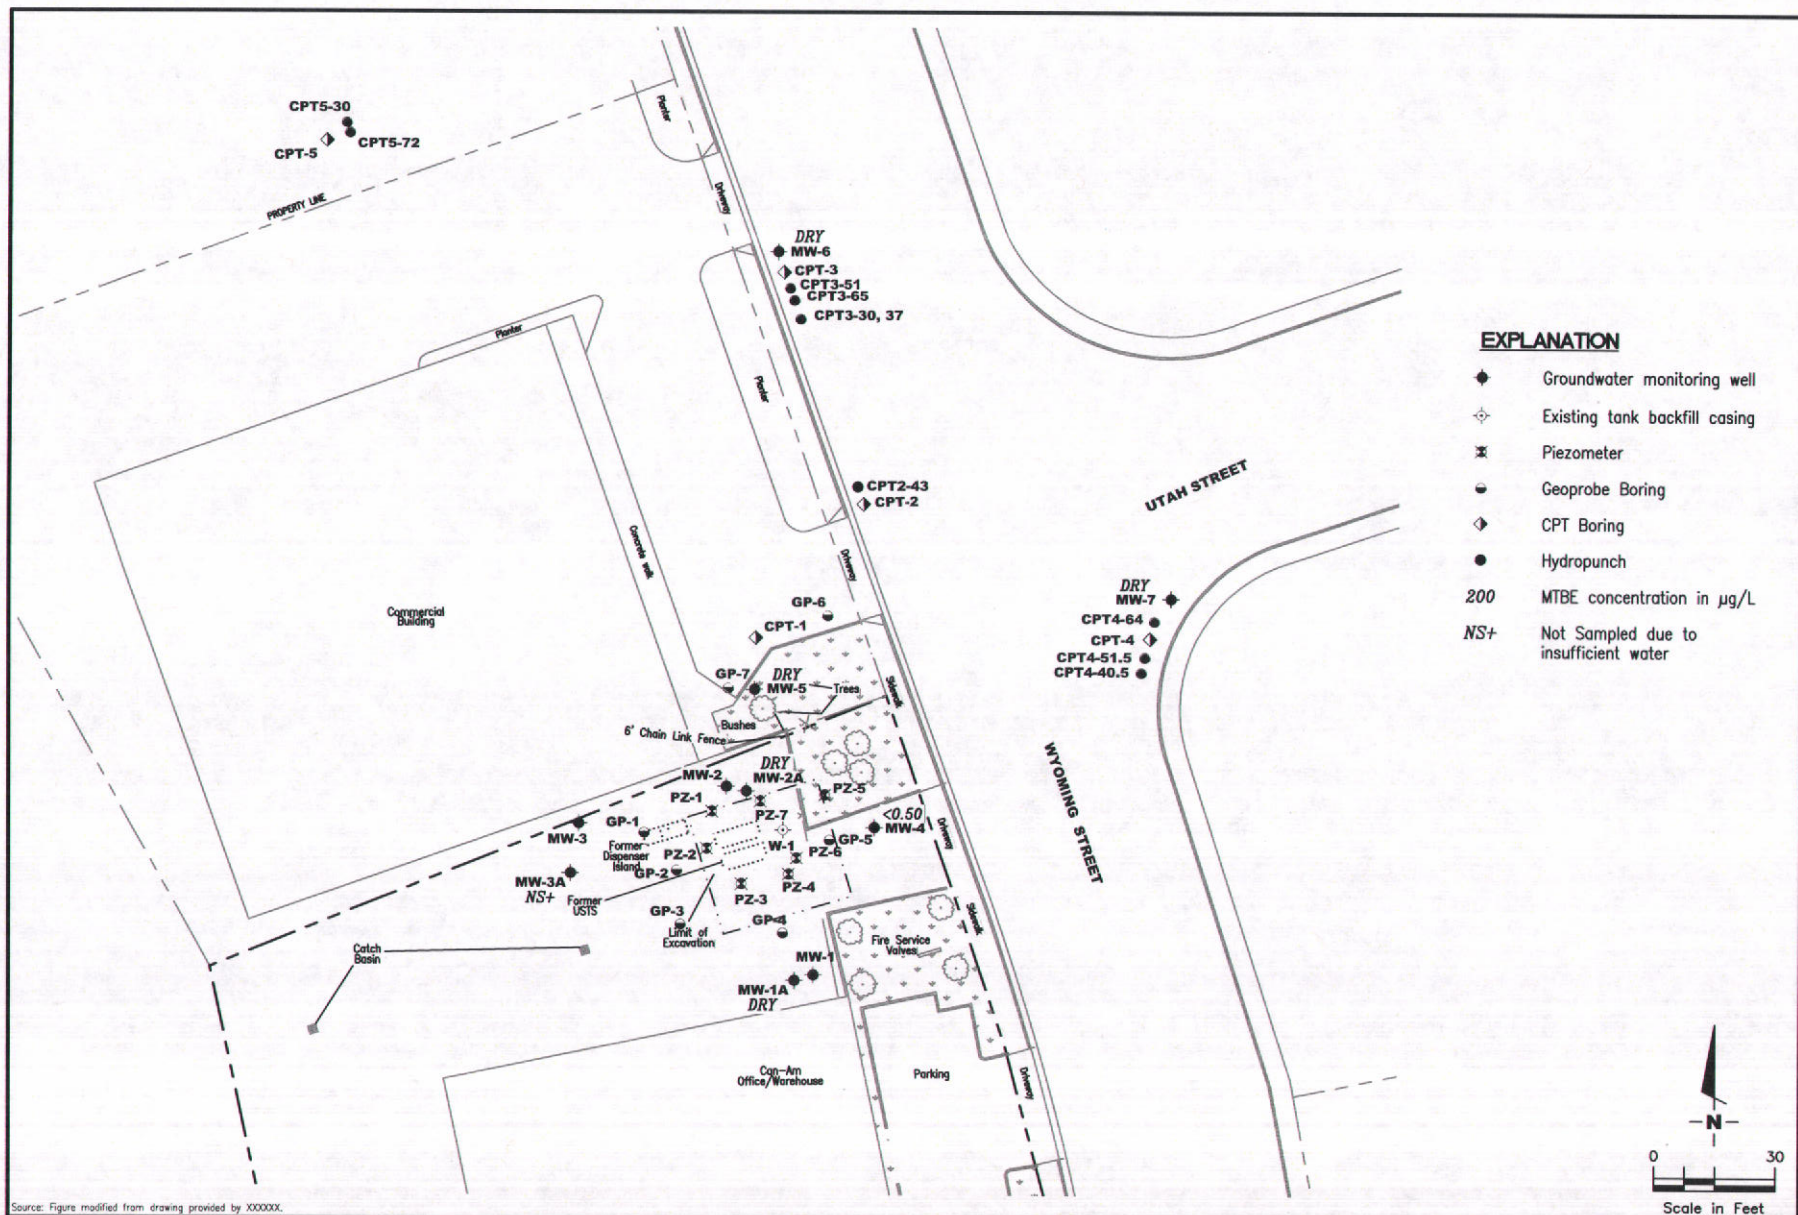

Source: Figure modified from drawing provided by XXXXXX.

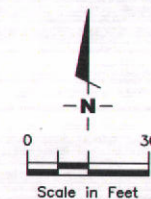

EXPLANATION

- ◆ Groundwater monitoring well
- ◇ Existing tank backfill casing
- ⊗ Piezometer
- Geoprobe Boring
- ◇ CPT Boring
- Hydropunch
- 200 MTBE concentration in $\mu\text{g/L}$
- NS+ Not Sampled due to insufficient water

FIGURE 8

MTBE CONCENTRATION MAP - ZONE C


GETTLER - RYAN INC.
 6747 Sierra Court, Suite J
 Dublin, CA 94568
 (925) 351-7555

PROJECT NUMBER: 048162
 REVIEWED BY: [Signature]
 DATE: June 7, 2011
 REVISION DATE: [Blank]

FILE NAME: P:\Environ\Can-Am Plumbing\01C-Can-Am Plumbing.dwg | Layout: Title: M02-C

EXPLANATION

- Groundwater monitoring well
- ⊙ Existing tank backfill casing
- ⊗ Piezometer
- 200 MTBE concentration in $\mu\text{g/L}$
- NS+ Not Sampled due to insufficient water

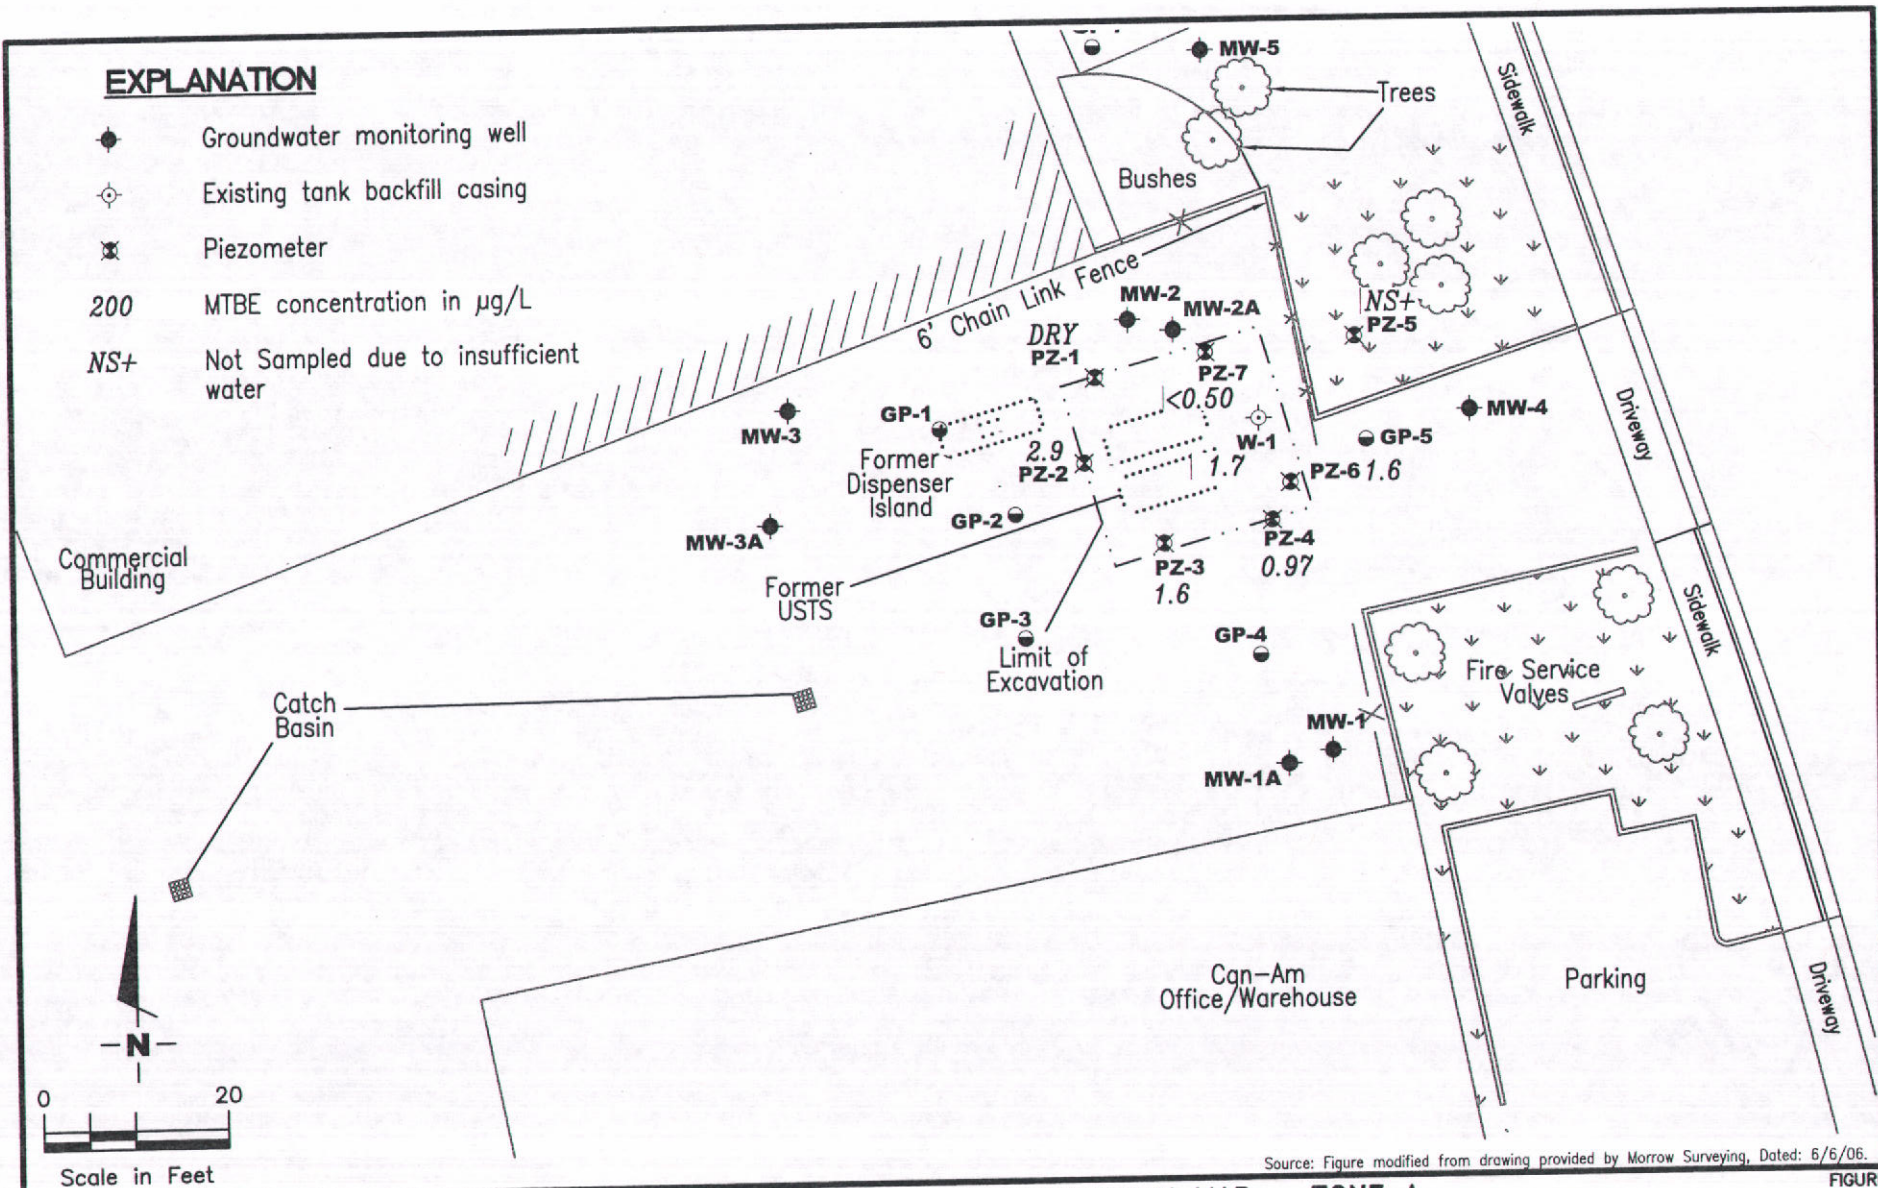

Source: Figure modified from drawing provided by Morrow Surveying, Dated: 6/6/06.

MTBE CONCENTRATION MAP - ZONE A

Can-Am Plumbing Inc.
151 Wyoming Street
Pleasanton, California

FIGURE

6

GETTLER - RYAN INC.
6747 Sierra Court, Suite J
Dublin, CA 94568 (925) 551-7555

JOB NUMBER
948162

REVIEWED BY


DATE
June 7, 2011

REVISED DATE

FILE NAME: P:\Enviro\Can-Am Plumbing\Q11AB-Can-Am Plumbing.dwg | Layout Tab: Mtbe2-A

EXPLANATION

- Groundwater monitoring well
- ⊙ Existing tank backfill casing
- ⊗ Piezometer
- 200 MTBE concentration in $\mu\text{g/L}$

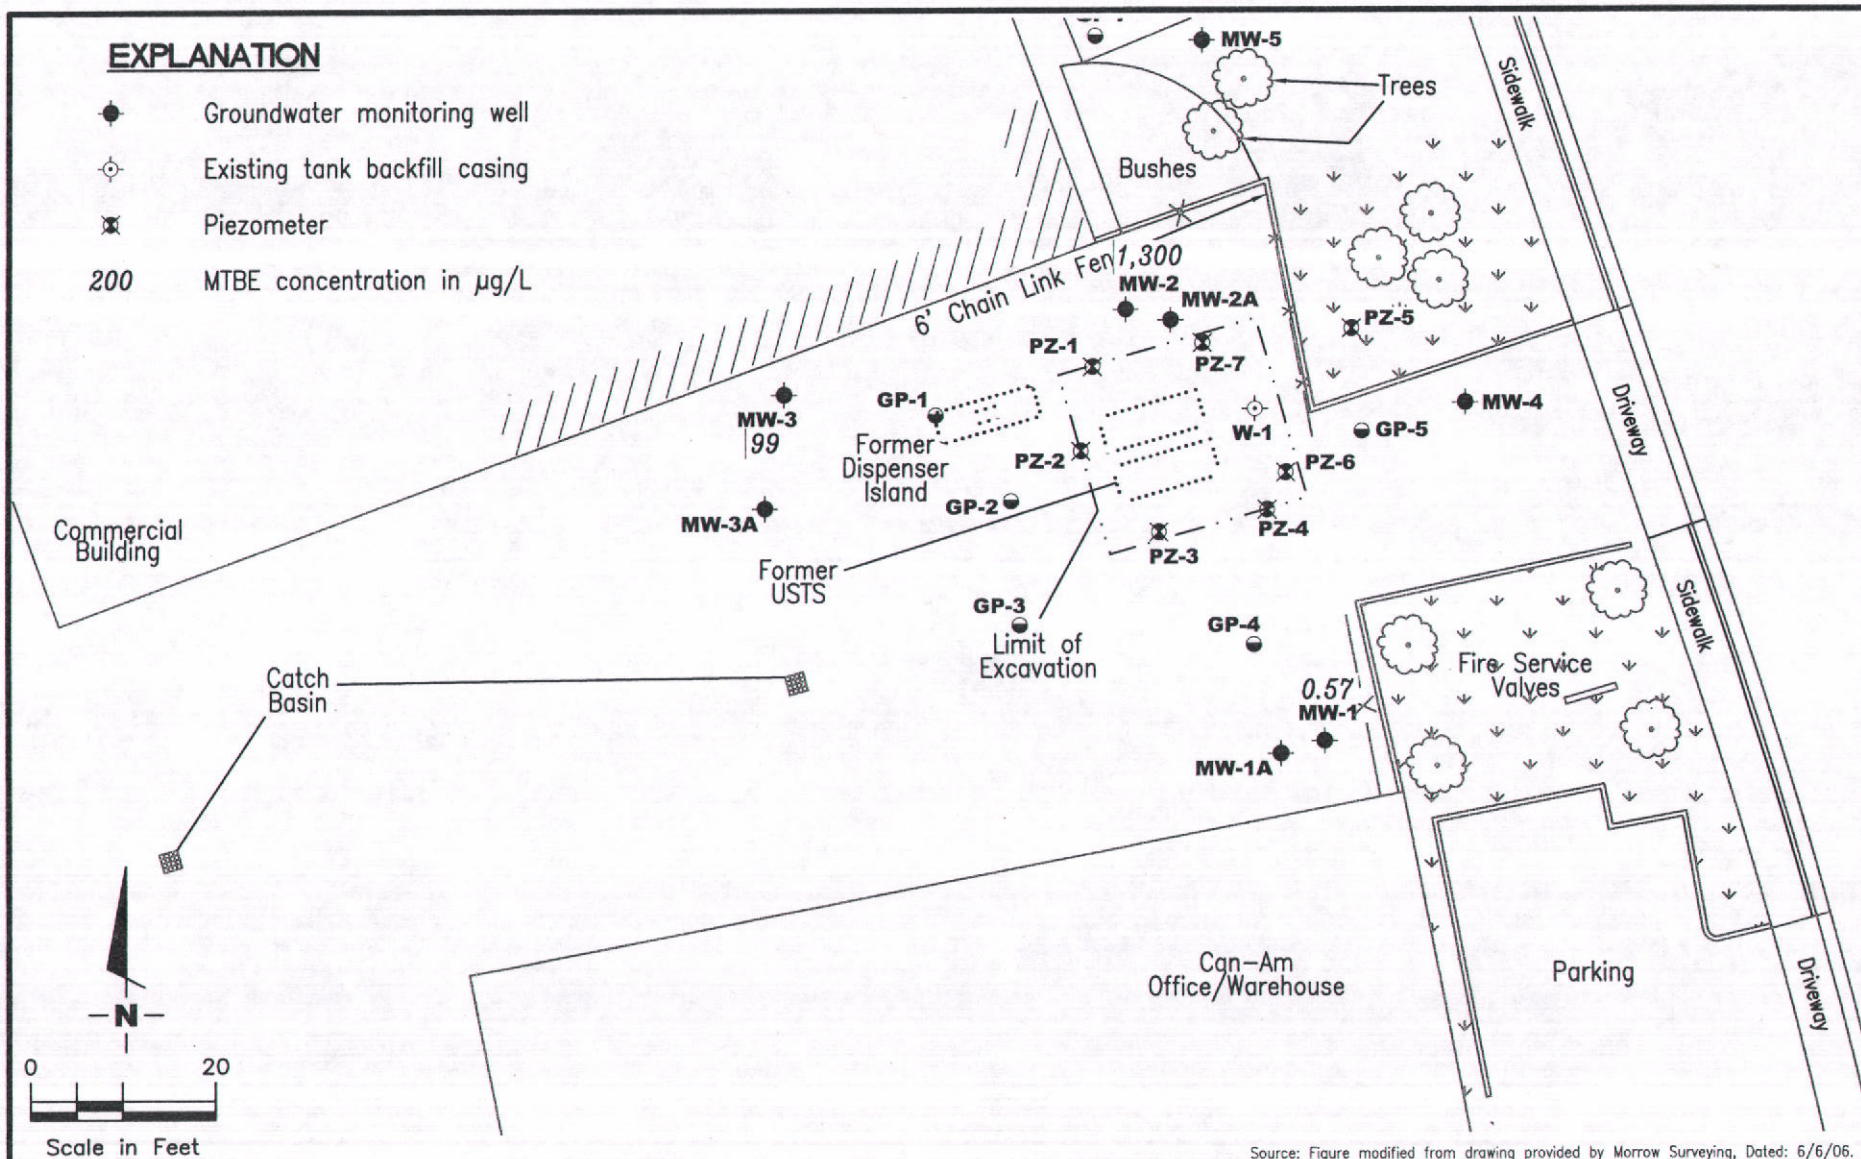

Source: Figure modified from drawing provided by Morrow Surveying, Dated: 6/6/06.



GETTLER - RYAN INC.

6747 Sierra Court, Suite J
Dublin, CA 94568 (925) 551-7555

MTBE CONCENTRATION MAP - ZONE B

Can-Am Plumbing Inc.
151 Wyoming Street
Pleasanton, California

JOB NUMBER
948162

REVIEWED BY


DATE
June 7, 2011

REVISED DATE

FILE NAME: P:\Enviro\Can-Am Plumbing\Q11AB-Can-Am Plumbing.dwg | Layout Tab: Mtbe2-B

FIGURE

7

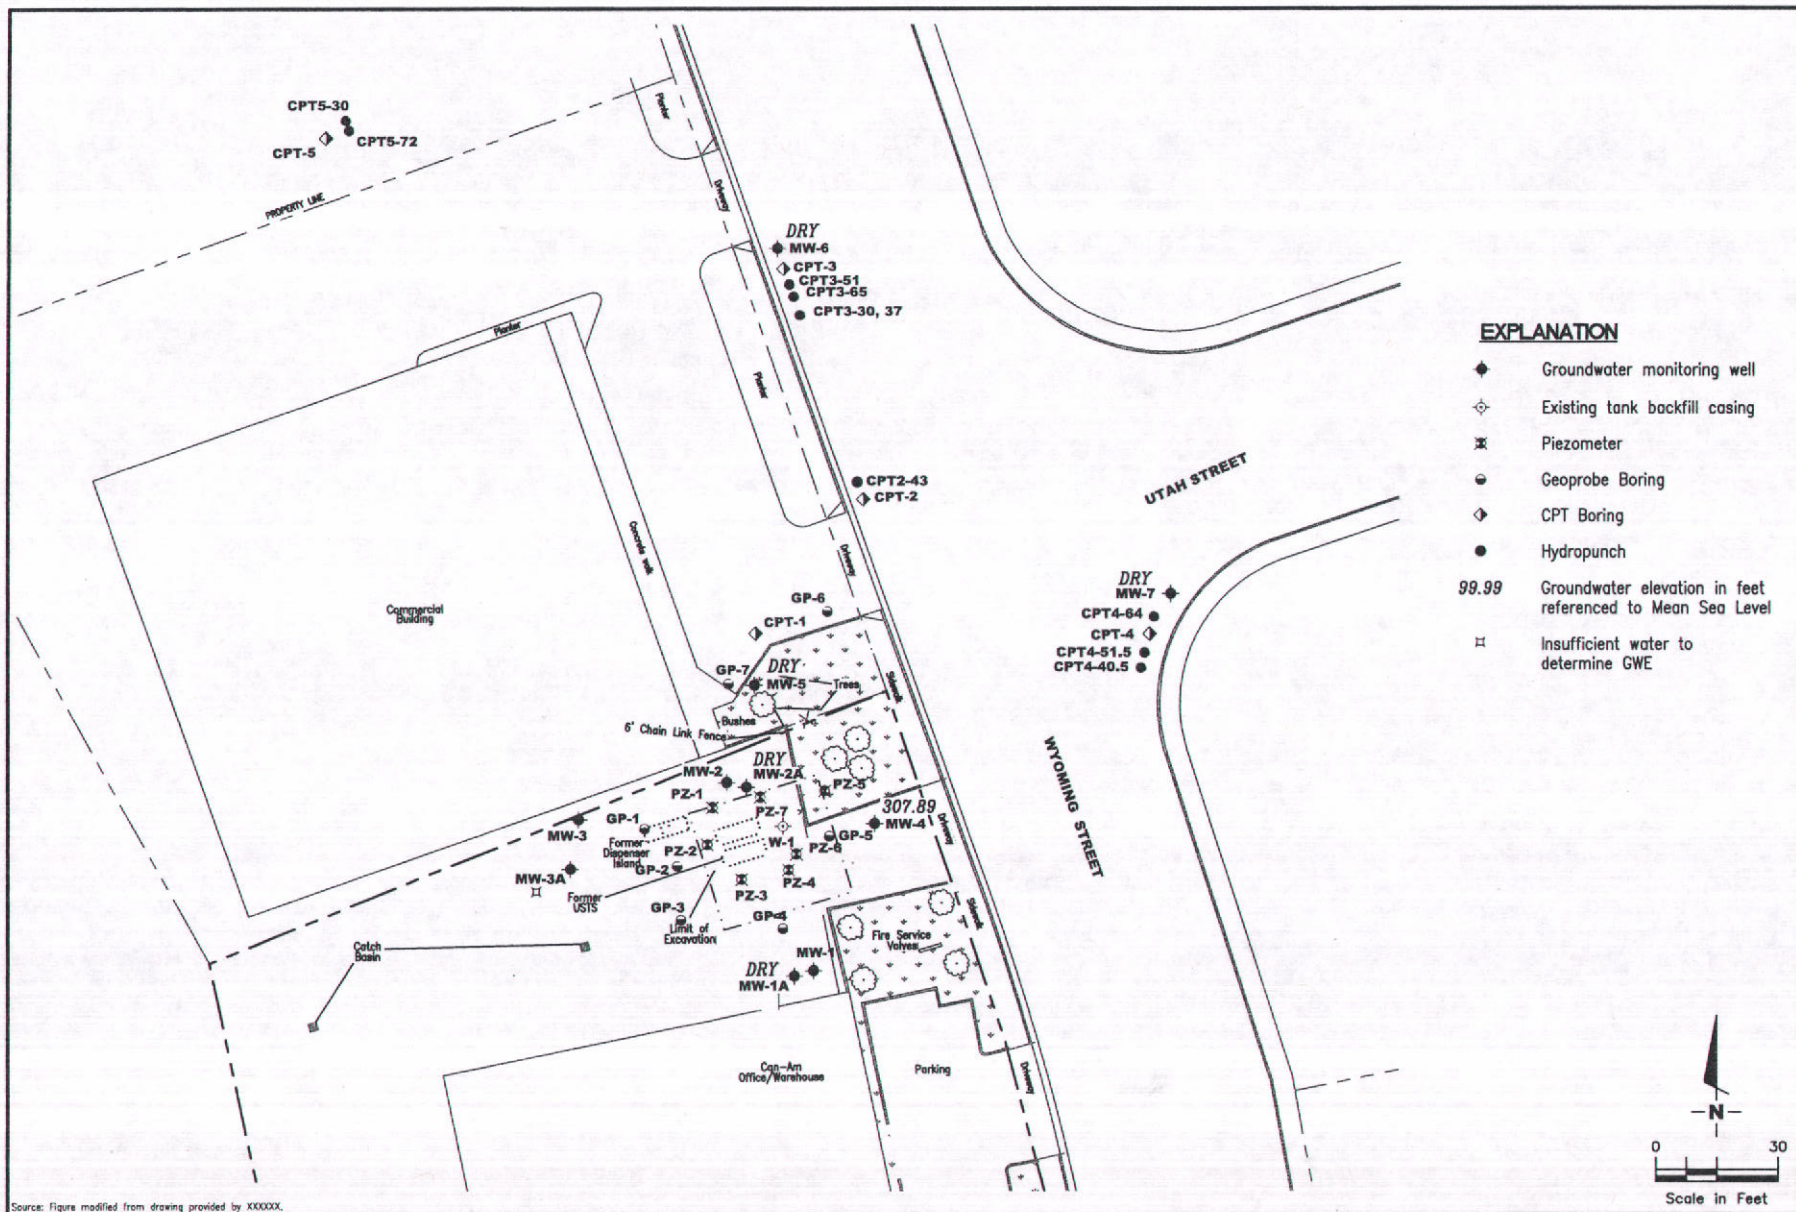

EXPLANATION

- ◆ Groundwater monitoring well
- ◇ Existing tank backfill casing
- ⊠ Piezometer
- Geoprobe Boring
- ◇ CPT Boring
- Hydropunch
- 99.99 Groundwater elevation in feet referenced to Mean Sea Level
- ⊠ Insufficient water to determine GWE

GETTLER - RYAN INC.
 8747 Sierra Court, Suite J
 Dublin, CA 94568
 (925) 551-7555

PROJECT NUMBER
 948162
 FILE NAME: P:\Environ\Can-Am Plumbing\011C-Can-Am Plumbing.dwg | Layout: Job Plot-C

REVIEWED BY

GROUNDWATER ELEVATION MAP - ZONE C

Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

DATE
 June 7, 2011

REVISED DATE

FIGURE
5

Source: Figure modified from drawing provided by XXXXXX.

Table 1 - Soil Chemical Analytical Results

Can-Am Plumbing
151 Wyoming Street
Pleasanton, California

Sample No.	Sample Depth (feet)	Date Collected	TPHg (ppm)	Benzene (ppm)	Toluene (ppm)	Ethyl-benzene (ppm)	Total Xylenes (ppm)	MtBE (ppm)	TBA (ppm)	DIPE (ppm)	ETBE (ppm)	TAME (ppm)	Ethanol (ppm)	1,2-DCA (ppm)	EDB (ppm)	Total Pb (ppm)
UST and Dispenser Excavation																
X-1-3	3.0	6/10/1999	<1.0	0.005	<0.005	<0.005	<0.005	3.3	---	---	---	---	---	---	---	---
X-2-3	3.0	6/10/1999	<1.0	<0.005	<0.005	<0.005	<0.005	4.1	---	---	---	---	---	---	---	---
D-1-3	3.0	6/10/1999	<1.0	<0.005	<0.005	<0.005	0.008	3.6	---	---	---	---	---	---	---	---
Boring B-1																
B-1-20.5	20.5	9/5/2002	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.050	<0.0050	<0.0050	<0.0050	<0.20	<0.0050	<0.0050	---
B-1-23.5	23.5	9/5/2002	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.050	<0.0050	<0.0050	<0.0050	<0.20	<0.0050	<0.0050	---
B-1-27.5	27.5	9/5/2002	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.050	<0.0050	<0.0050	<0.0050	<0.20	<0.0050	<0.0050	---
B-1-35	35	10/31/2002	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.050	<0.0050	<0.0050	<0.0050	<0.20	<0.0050	<0.0050	---
B-1-38 ¹	38	10/31/2002	<0.50	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---	---	---	---	---
Boring B-2																
B-2-36 ²	36	10/31/2002	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.28	0.067	<0.0050	<0.0050	<0.0050	<0.20	<0.0050	<0.0050	---
B-2-40.5 ²	40.5	10/31/2002	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.34	0.17	<0.0050	<0.0050	<0.0050	<0.20	<0.0050	<0.0050	---
Boring B-3																
B-3-23 ²	23	10/31/2002	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.050	<0.0050	<0.0050	<0.0050	<0.20	<0.0050	<0.0050	---
B-3-35	35	10/31/2002	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.050	<0.0050	<0.0050	<0.0050	<0.20	<0.0050	<0.0050	---
B-3-39 ¹	39	10/31/2002	<0.50	<0.0050	<0.0050	<0.0050	<0.0050	0.0052	---	---	---	---	---	---	---	---
Boring MW-1																
MW-1-16	6	1/21/2000	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.050	---	---	---	---	---	---	---	---
MW-1-13.5	13.5	1/21/2000	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.050	---	---	---	---	---	---	---	---
MW-1-19	19	1/21/2000	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.050	---	---	---	---	---	---	---	---
MW-1-25	25	1/21/2000	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.050	---	---	---	---	---	---	---	---
Boring MW-2																
MW-2-6.5	6.5	1/21/2000	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	3.6	---	---	---	---	---	---	---	---
MW-2-11	11	1/21/2000	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.97	---	---	---	---	---	---	---	---
MW-2-15.5	15.5	1/21/2000	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.12	---	---	---	---	---	---	---	---
MW-2-21	21	1/21/2000	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.14	---	---	---	---	---	---	---	---
Boring MW-3																
MW-3-23	23	11/1/2002	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.050	<0.0050	<0.0050	<0.0050	<0.20	<0.0050	<0.0050	---
MW-3-39	39	11/1/2002	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.050	<0.0050	<0.0050	<0.0050	<0.20	<0.0050	<0.0050	---
MW-3-41 ¹	41	11/1/2002	<0.50	<0.0050	<0.0050	<0.0050	<0.0050	0.029	---	---	---	---	---	---	---	---

Table 1 - Soil Chemical Analytical Results

Can-Am Plumbing
151 Wyoming Street
Pleasanton, California

Sample No.	Sample Depth (feet)	Date Collected	TPHg (ppm)	Benzene (ppm)	Toluene (ppm)	Ethyl-benzene (ppm)	Total Xylenes (ppm)	MtBE (ppm)	TBA (ppm)	DIPE (ppm)	ETBE (ppm)	TAME (ppm)	Ethanol (ppm)	1,2-DCA (ppm)	EDB (ppm)	Total Pb (ppm)
Boring MW-1A																
MW1A-10 ³	10	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW1A-14.5 ³	15	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW1A-20 ³	20	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW1A-25 ³	25	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW1A-30 ³	30	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW1A-35 ³	35	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW1A-39 ³	39	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW1A-41.5 ³	41.5	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW1A-45 ³	45	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW1A-50 ³	50	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
Boring MW-2A																
MW2A-10	10	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	1.3	1.0	<0.0050	<0.0050	0.021	---	---	---	---
MW2A-15 ⁴	15	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	1.1	1.7	<0.0050	<0.0050	0.012	---	---	---	---
MW2A-20	20	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.91	0.36	<0.0050	<0.0050	0.0096	---	---	---	---
MW2A-25	25	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.12	0.028 ⁵	<0.0050	<0.0050	<0.0050	---	---	---	---
MW2A-30	30	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.29	0.064 ⁵	<0.0050	<0.0050	<0.0050	---	---	---	---
MW2A-35	35	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.14	0.008 ⁵	<0.0050	<0.0050	<0.0050	---	---	---	---
MW2A-38.5 ³	38.5	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.12	0.038	<0.0050	<0.0050	<0.0050	---	---	---	---
MW2A-40 ³	40	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.18	0.036 ⁵	<0.0050	<0.0050	<0.0050	---	---	---	---
MW2A-42.5	42.5	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.60	0.18	<0.0050	<0.0050	0.0080	---	---	---	---
MW2A-45	45	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.60	0.15 ⁵	<0.0050	<0.0050	0.0078	---	---	---	---
MW2A-50	50	5/9/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.81	0.23 ⁵	<0.0050	<0.0050	0.011	---	---	---	---
Boring MW-3A																
MW3A-10	10	5/8/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.026	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW3A-15	15	5/8/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.0070	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW3A-20	20	5/8/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW3A-25	25	5/8/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW3A-30	30	5/8/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW3A-35	35	5/8/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW3A-40	40	5/8/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW3A-45	45	5/8/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---

Table 1 - Soil Chemical Analytical Results

Can-Am Plumbing
151 Wyoming Street
Pleasanton, California

Sample No.	Sample Depth (feet)	Date Collected	TPHg (ppm)	Benzene (ppm)	Toluene (ppm)	Ethylbenzene (ppm)	Total Xylenes (ppm)	MtBE (ppm)	TBA (ppm)	DIPE (ppm)	ETBE (ppm)	TAME (ppm)	Ethanol (ppm)	1,2-DCA (ppm)	EDB (ppm)	Total Pb (ppm)
Boring MW-3A (con't)																
MW3A-50	50	5/8/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW3A-55	55	5/8/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
Boring PZ-1																
PZ1-10	10	5/8/2006	<1.0	<0.0050	<0.0050	<0.0050	0.023	0.81	0.24	<0.0050	<0.0050	0.022	---	---	---	---
Boring PZ-2																
PZ2-10	10	5/8/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.52	0.17	<0.0050	<0.0050	0.015	---	---	---	---
Boring PZ-3																
PZ3-10	10	5/8/2006	<1.0	<0.0050	<0.0050	<0.0050	0.0071	0.015	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
Boring PZ-4																
PZ4-10	10	5/8/2006	<1.0	<0.0050	<0.0050	<0.0050	0.038	1.9	1.6	<0.0050	<0.0050	0.083	---	---	---	---
Boring PZ-5																
PZ5-10	10	5/10/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	1.0	0.74	<0.0050	<0.0050	0.010	---	---	---	---
Boring PZ-6																
PZ6-10	10	5/10/2006	3.3	<0.0050	<0.0050	0.023	0.034	0.024	0.013	<0.0050	<0.0050	<0.0050	---	---	---	---
Boring PZ-7																
PZ7-10 ¹	10	5/10/2006	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.020	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
Boring MW-4																
MW4-10.5	10.5	4/10/2007	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.087	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW4-20.5	20.5	4/10/2007	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.13	0.0056 ⁵	<0.0050	<0.0050	<0.0050	---	---	---	---
MW4-29.5	29.5	4/10/2007	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW4-39.5	39.5	4/10/2007	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.051	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW4-49.5	49.5	4/10/2007	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.14	0.021 ⁵	<0.0050	<0.0050	<0.0050	---	---	---	---
MW4-53	53	4/10/2007	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.51	0.077 ⁵	<0.0050	<0.0050	0.0082	---	---	---	---
Boring MW-5																
MW5-9.5	9.5	4/11/2007	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW5-20.5	20.5	4/11/2007	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW5-30.0	30.0	4/11/2007	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.0089	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---

Table 1 - Soil Chemical Analytical Results
Can-Am Plumbing
151 Wyoming Street
Pleasanton, California

Sample No.	Sample Depth (feet)	Date Collected	TPHg (ppm)	Benzene (ppm)	Toluene (ppm)	Ethylbenzene (ppm)	Total Xylenes (ppm)	MtBE (ppm)	TBA (ppm)	DIPE (ppm)	ETBE (ppm)	TAME (ppm)	Ethanol (ppm)	1,2-DCA (ppm)	EDB (ppm)	Total Pb (ppm)
<u>Boring MW-5 (con't)</u>																
MW5-40.0	40.0	4/11/2007	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.022	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
MW5-50.5	50.5	4/11/2007	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.29	0.021 ⁵	<0.0050	<0.0050	<0.0050	---	---	---	---
<u>Boring GP-3</u>																
GP3-10	10.0	4/9/2007	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.24	0.0068 ⁵	<0.0050	<0.0050	<0.0050	---	---	---	---
<u>Boring GP-4</u>																
GP4-10	10.0	4/9/2007	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.68	0.061 ⁵	<0.0050	<0.0050	0.0069	---	---	---	---
<u>Boring GP-5</u>																
GP5-10	10.0	4/9/2007	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	0.43	0.23	<0.0050	<0.0050	<0.0050	---	---	---	---
<u>Boring GP-6</u>																
GP6-10	10.0	4/9/2007	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
<u>Boring GP-7</u>																
GP7-10	10.0	4/9/2007	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---
<u>Soil Stockpile</u>																
SP-1(A,B,C,D) ⁶	N/A	4/12/2007	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---	---	---	---	---	6.28

EXPLANATION:

ppm = parts per million

--- = not analyzed

N/A = not applicable

TPHg = Total Petroleum Hydrocarbons as gasoline

BTEX = Benzene, Toluene, Ethylbenzene, and Total Xylenes

MtBE = Methyl tertiary butyl ether

TBA = Tertiary butyl alcohol

DIPE = Di-isopropyl ether

ETBE = Ethyl tertiary butyl ether

TAME = Tertiary amyl methyl ether

1,2-DCA = 1,2-Dichloroethane

EDB = Ethylene dibromide

ANALYTICAL LABORATORY:

UST and Dispenser, B-1, B-2, B-3, MW-1 MW-2 and MW-3: Sequoia Analytical Sacramento (ELAP #1624)

MW-1A, MW-2A, MW-3A, MW-4, MW-5, GP-3 thru GP-7, PZ-1 thru PZ-7, and SP1(A,B,C,D): Kiff Analytical (ELAP #2236)

ANALYTICAL METHODS:

TPHg/BTEX/MtBE/TBA/DIPE/ETBE/TAME/1,2-DCA/EDB/Ethanol by EPA Method 8260B

Total Pb by EPA Method 6010B

Table 1 - Soil Chemical Analytical Results

Can-Am Plumbing
151 Wyoming Street
Pleasanton, California

NOTES:

¹ TPHg, BTEX and MtBE according to EPA Method 8015M/8021

² This sample was originally analyzed within the EPA recommended hold time. Re-analysis for confirmation or dilution was performed past the recommend hold time. The results may still be useful for their intended purpose.

³ Matrix Spike/Matrix Spike Duplicate Results associated with these samples for the analyte MtBE were affected by the analyte concentrations already present in the un-spiked sample.

⁴ Matrix Spike/Matrix Spike Duplicate Results associated with this sample for the analytes TBA and MtBE were affected by the analyte concentrations already present in the un-spiked sample.

⁵ TBA results for these samples may be biased slightly high and are flagged with a "J". A fraction of MtBE (up to 5%) converts to TBA during the analysis of soil samples. The laboratory considers this conversion effect to be mathematically significant in samples than contain MtBE/TBA in ratios of over 3:1.

⁶ Sample SP-1(A,B,C,D) contained a Total Petroleum Hydrocarbons as diesel (TPHd) concentration of 3.4 ppm. The laboratory noted that hydrocarbons reported as TPHd do not exhibit a typical Diesel chromatographic pattern in sample SP-1(A,B,C,D). These hydrocarbons are higher boiling than typical diesel fuel.

Table 1 - Soil Chemical Analytical Results

Can-Am Plumbing
151 Wyoming Street
Pleasanton, California

Sample No.	Sample Depth (feet)	Date Collected	TPHg (ppm)	Benzene (ppm)	Toluene (ppm)	Ethyl-benzene (ppm)	Total Xylenes (ppm)	MtBE (ppm)	TBA (ppm)	DIPE (ppm)	ETBE (ppm)	TAME (ppm)	Total Pb (ppm)
<u>Boring MW-6</u>													
MW6-11.5	11.5	1/13/2009	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---
MW6-21.5	21.5	1/13/2009	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---
MW6-31.5	31.5	1/13/2009	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---
MW6-41.5	41.5	1/13/2009	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---
MW6-50	50	1/13/2009	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---
<u>Boring MW-7</u>													
MW7-11.5	11.5	1/13/2009	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---
MW7-21.5	21.5	1/13/2009	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---
MW7-31.5	31.5	1/13/2009	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---
MW7-41.5	41.5	1/13/2009	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---
MW7-51	51	1/13/2009	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---
<u>Soil Stockpile</u>													
SP1-(A,B,C,D) ^{1,2}	NA	1/13/2009	<1.0	<0.0050	<0.0050	<0.0050	<0.0050	<0.0050	---	---	---	---	11

EXPLANATION:

ppm = parts per million

--- = not analyzed

N/A = not applicable

TPHg = Total Petroleum Hydrocarbons as gasoline

TPHd = Total Petroleum Hydrocarbons as diesel

BTEX = Benzene, Toluene, Ethylbenzene, and Total Xylenes

MtBE = Methyl tertiary butyl ether

TBA = Tertiary butyl alcohol

ANALYTICAL LABORATORY:

Kiff Analytical (ELAP #2236)

ANALYTICAL METHODS:

TPHg/BTEX/MtBE/TBA/DIPE/ETBE/TAME by EPA Method 8260B

TPHd by EPA Method modified 8015

Total Pb by EPA Method 6010B

Table 2 - Soil Sample Analytical Results

Can-Am Plumbing
151 Wyoming Street
Pleasanton, California

Sample Location and ID	Date Collected	Sample Depth (feet)	TPHg (ppm)	Benzene (ppm)	Toluene (ppm)	Ethyl-Benzene (ppm)	Xylenes (ppm)	MtBE (ppm)
Well Boring MW-1								
MW-1-6	1/21/00	6	ND	ND	ND	ND	ND	ND
MW-1-13.5	1/21/00	13.5	ND	ND	ND	ND	ND	ND
MW-1-19	1/21/00	19	ND	ND	ND	ND	ND	ND
MW-1-25	1/21/00	25	ND	ND	ND	ND	ND	ND
Well Boring MW-2								
MW-2-6.5	1/21/00	6.5	ND	ND	ND	ND	ND	3.6
MW-2-11	1/21/00	11	ND	ND	ND	ND	ND	0.97
MW-2-15.5	1/21/00	15.5	ND	ND	ND	ND	ND	0.12
MW-2-21	1/21/00	21	ND	ND	ND	ND	ND	0.14
MW-2-26.5	1/21/00	26.5	ND	ND	ND	ND	ND	0.12
MW-2-31	1/21/00	31	ND	ND	ND	ND	ND	ND
Soil Stockpile Sample								
S-1 comp ¹	1/21/00	--	ND	ND	ND	ND	ND	0.054

EXPLANATION:

ppm = parts per million

ND = Not Detected

-- = not applicable

ANALYTICAL METHODS:

TPHg = Total Petroleum Hydrocarbons as gasoline according to EPA Method 8015 Modified

MtBE = Methyl tertiary butyl ether according to EPA Method 8020

ANALYTICAL LABORATORY:

Sequoia Analytical (ELAP #1271)

¹ = Sample was reported to contain 4.8 ppm of total lead according to EPA Method 6010.

Table 1 - Sample Analytical Results

CanAm Plumbing
151 Wyoming Street
Pleasanton, California

Sample Location and ID	Date Collected	Sample Depth (feet)	TPHg (ppm)	Benzene (ppm)	Toluene (ppm)	Ethyl-Benzene (ppm)	Xylenes (ppm)	MtBE (ppm)	Lead (ppm)
Former UST Excavation									
X-1-3	6/10/99	3	ND	0.0050	ND	ND	ND	3.3	ND
X-2-3	6/10/99	3	ND	ND	ND	ND	ND	4.1	ND
Former Dispenser									
D-1-3	6/10/99	3	ND	ND	ND	ND	0.0080	3.6	ND
UST Soil Stockpile									
S-1	6/10/99	--	3.3	ND	ND	ND	0.11	0.20	ND
S-2	6/10/99	--	ND	ND	ND	ND	0.025	ND	ND

Sample Location and ID	Date Collected	Sample Depth (feet)	TPHg (ppb)	Benzene (ppb)	Toluene (ppb)	Ethyl-Benzene (ppb)	Xylenes (ppb)	MtBE (ppb)
Groundwater W-1	6/10/99	--	39,000	1,100	660	490	18,000	100,000

EXPLANATION:

ppm = parts per million

ppb = parts per billion

ND = Not Detected

-- = not applicable

ANALYTICAL METHODS:

TPHg = Total Petroleum Hydrocarbons as gasoline according to EPA Method 8015 Modified

MtBE = Methyl tertiary butyl ether according to EPA Method 8020

Lead = According to EPA Method 6010

ANALYTICAL LABORATORY:

Sequoia Analytical (ELAP #1271)

Table 2
Groundwater Chemical Analytical Results
Can-Am Plumbing
151 Wyoming Street
Pleasanton, California

Sample ID	Sample Date	TOC (feet)	DTW (feet)	FPP Thickness (feet)	GWE (feet)	TPHg (ppb)	B (ppb)	T (ppb)	E (ppb)	X (ppb)	MtBE (ppb)	DIPE (ppb)	ETBE (ppb)	TAME (ppb)	TBA (ppb)
PZ-7	6/9/2006	354.45	4.05	0.00	350.40						Not Sampled				
W-1	6/9/2006	354.35	4.02	0.00	350.33						Not Sampled				
QA	6/9/2006	NA	NA	NA	NA	<50	<0.50	<0.50	<0.50	<0.50	<0.50	--	--	--	--

Explanations:

ft = feet

-- = not analyzed

NA = not applicable

FPP = Free Phase Product

TOC = Top of Casing elevation

DTW = Depth to Water

GWE = Groundwater Elevation

ppb = parts per billion

TPHg = Total Petroleum Hydrocarbons as gasoline

B = Benzene

T = Toluene

E = Ethylbenzene

X = Total Xylenes

MtBE = Methyl tert-Butyl Ether

DIPE = Di-isopropyl Ether

ETBE = Ethyl Tert-Butyl Ether

TAME = Tert-Amyl Methyl Ether

TBA = Tert-Butyl Alcohol

Analytical Laboratory:

Kiff Analytical (ELAP #2236)

Analytical Methods:

TPHg/BTEX/MtBE/DIPE/ETBE/TAME/TBA by EPA Method 8260B

Table 2
Groundwater Chemical Analytical Results
Can-Am Plumbing
151 Wyoming Street
Pleasanton, California

Sample ID	Sample Date	TOC (feet)	DTW (feet)	FPP Thickness (feet)	GWE (feet)	TPHg (ppb)	B (ppb)	T (ppb)	E (ppb)	X (ppb)	MtBE (ppb)	DIPE (ppb)	ETBE (ppb)	TAME (ppb)	TBA (ppb)
MW-1	6/9/2006	355.33	21.62	0.00	333.71						Not Sampled				
MW-1A	6/9/2006	355.40	31.22	0.00	324.18	<50	<0.50	<0.50	<0.50	<0.50	5.3	<0.50	<0.50	<0.50	<5.0
MW-2	6/9/2006	354.44	22.84	0.00	331.60						Not Sampled				
MW-2A	6/9/2006	354.43	31.22	0.00	323.21	<900	<9.0	<9.0	<9.0	<9.0	5,300	<9.0	<9.0	61	860
MW-3	6/9/2006	354.76	22.18	0.00	332.58						Not Sampled				
MW-3A	6/9/2006	354.52	33.60	0.00	320.92	<50	<0.50	<0.50	<0.50	<0.50	3.9	<0.50	<0.50	<0.50	<5.0
PZ-1	6/9/2006	354.54	6.08	0.00	348.46						Not Sampled				
PZ-2	6/9/2006	354.35	3.91	0.00	350.44						Not Sampled				
PZ-3	6/9/2006	354.14	3.77	0.00	350.37						Not Sampled				
PZ-4	6/9/2006	354.22	3.62	0.00	350.60						Not Sampled				
PZ-5	6/9/2006	354.95	6.46	0.00	348.49						Not Sampled				
PZ-6	6/9/2006	354.39	4.04	0.00	350.35						Not Sampled				

Table 1
Groundwater Chemical Analytical Results
Can-Am Plumbing
151 Wyoming Street
Pleasanton, California

Sample ID	Sample Date	Sample Interval (feet)	TPHg (ppb)	B (ppb)	T (ppb)	E (ppb)	X (ppb)	MtBE (ppb)	DIPE (ppb)	ETBE (ppb)	TAME (ppb)	TBA (ppb)
CPT3-51	2/21/2008	47-51	<50	<0.50	<0.50	<0.50	<0.50	1.4	<0.50	<0.50	<0.50	<5.0
CPT3-65	2/21/2008	61-65	<50	<0.50	<0.50	<0.50	<0.50	<0.50	<0.50	<0.50	<0.50	<5.0
CPT4-51.5	2/22/2008	47.5-51.5	<50	<0.50	<0.50	<0.50	<0.50	0.98	<0.50	<0.50	<0.50	<5.0
CPT4-64	2/22/2008	61-64	<50	<0.50	<0.50	<0.50	<0.50	<0.50	<0.50	<0.50	<0.50	<5.0

Explanations:

ppb = parts per billion

TPHg = Total Petroleum Hydrocarbons as gasoline

B = Benzene

T = Toluene

E = Ethylbenzene

X = Total Xylenes

MtBE = Methyl tert-Butyl Ether

DIPE = Di-isopropyl Ether

ETBE = Ethyl Tert-Butyl Ether

TAME = Tert-Amyl Methyl Ether

TBA = Tert-Butyl Alcohol

Analytical Laboratory:

Kiff Analytical (ELAP #2236)

Analytical Methods:

TPHg/BTEX/MtBE/DIPE/ETBE/TAME/TBA by EPA Method 8260B

Table 2
Groundwater Chemical Analytical Results
Can-Am Plumbing
151 Wyoming Street
Pleasanton, California

Sample ID	Sample Date	TOC (feet)	DTW (feet)	FPP Thickness (feet)	GWE (feet)	TPHg (ppb)	B (ppb)	T (ppb)	E (ppb)	X (ppb)	MtBE (ppb)	DIPE (ppb)	ETBE (ppb)	TAME (ppb)	TBA (ppb)
PZ-5	4/20/2007	354.95	8.80	0.00	346.15						Not Sampled				
PZ-6	4/20/2007	354.39	5.13	0.00	349.26						Not Sampled				
PZ-7	4/20/2007	354.45	5.12	0.00	349.33						Not Sampled				
W-1	4/20/2007	354.35	5.03	0.00	349.32						Not Sampled				
QA	4/20/2007	NA	NA	NA	NA	<50	<0.50	<0.50	<0.50	<0.50	<0.50	--	--	--	--

Sample ID	Sample Date	Sample Interval (feet)	TPHg (ppb)	B (ppb)	T (ppb)	E (ppb)	X (ppb)	MtBE (ppb)	DIPE (ppb)	ETBE (ppb)	TAME (ppb)	TBA (ppb)
CPT1-70	4/17/2007	67-70	<500	<5.0	<5.0	<5.0	<5.0	2,600	<5.0	<5.0	28	280
CPT1-80	4/17/2007	78-80	<50	<0.50	<0.50	<0.50	<0.50	1.8	<0.50	<0.50	<0.50	<5.0

Explanations:

ft = feet

-- = not analyzed

NA = not applicable

Analytical Laboratory:

Kiff Analytical (ELAP #2236)

Table 1
Groundwater Monitoring and Analytical Results
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID/ TOC* (ft)	DATE	DTW (ft)	GWE (msl)	THP (μ g/L)	Benzene (μ g/L)	Toluene (μ g/L)	Ethylbenzene (μ g/L)	Xylene (μ g/L)	MTBE (μ g/L)
MW-1	01/24/00	28.50	--				Not Sampled		
	01/26/00	28.16	--				Not Sampled		
	01/27/00	30.48	--				Not Sampled		
	01/28/00	30.03	--				Not Sampled		
	01/31/00	28.45	--	ND	ND	ND	ND	ND	ND
	02/18/00	21.31	--				Not Sampled		
	02/24/00	21.12	--				Not Sampled		
	05/11/00	22.01	--	ND	ND	ND	ND	ND	ND
	03/01/01	21.45	--	<50	<0.50	<0.50	<0.50	<0.50	<2.0
	06/01/02	24.94	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
352.87*	09/30/02	Dry	--			Well Dry - Not Sampled			
	12/26/02	12.28	340.59	<50	<0.50	<0.50	<0.50	<0.50	0.61
	05/01/03	21.45	331.33	320 ⁷	<10	<10	<10	<10	2,100
	11/05/03	21.91	330.96	<50	<0.50	<0.50	<0.50	<1.0	17
	12/20/05	21.23	331.64	<50	<0.50	<0.50	<0.50	<0.50	<0.50
355.33~	06/09/06	21.62	333.71			Not Sampled			
	09/05/06	23.19	332.14	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	12/15/06	21.37	333.96	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	03/16/07	21.43	333.90	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	04/20/07	22.49	332.84			Not Sampled			
	06/15/07	23.40	331.93	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	09/13/07	26.48	328.85	<50	<0.50	<0.50	<0.50	<0.50	0.65
	12/28/07	21.83	333.50	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	03/28/08	21.99	333.34	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	06/27/08	28.80	326.53	<50	<0.50	<0.50	<0.50	<0.50	0.52
	09/22/08	30.84	-- ⁹			Insufficient Water - Not Sampled			
	12/30/08	21.78	333.55	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	01/19/09	23.59	331.74			Not Sampled			
	03/13/09	21.22	334.11	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	06/18/09	27.53	327.80	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	09/24/09	31.04	-- ⁹			Monitored Only - Sampled Semi-Annually			
	12/16/09	21.46	333.87	<50	<0.50	<0.50	<0.50	<0.50	0.74
	03/22/10	21.95	333.38			Monitored Only - Sampled Semi-Annually			
	06/21/10	25.72	329.61	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	09/28/10	31.13	-- ⁹			Monitored Only - Sampled Semi-Annually			

Table 1
Groundwater Monitoring and Analytical Results
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID/ TOC* (ft)	DATE	DTW (ft)	GWE (msl)	THP g (µg/L)	Benzene (µg/L)	Toluene (µg/L)	Ethylbenzene (µg/L)	Xylene (µg/L)	MTBE (µg/L)
MW-1 (cont)	12/21/10	21.06	334.27	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	03/30/11	19.64	335.69	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	06/07/11	21.63	333.70	<50	<0.50	<0.50	<0.50	<0.50	0.57
MW-1A 355.40~	06/09/06	31.22	324.18	<50	<0.50	<0.50	<0.50	<0.50	5.3
	09/05/06	44.40	311.00	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	12/15/06	39.05	316.35	<50	<0.50	<0.50	<0.50	<0.50	240
	3/16/07	31.91	323.49	<50	<0.50	<0.50	<0.50	<0.50	170
	04/20/07	35.85	319.55			Not Sampled			
	06/15/07	40.56	314.84	<50	<0.50	<0.50	<0.50	<0.50	29
	09/13/07	45.64	309.76	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	12/28/07	37.98	317.42	<50	<0.50	<0.50	<0.50	<0.50	95
	03/28/08	33.83	321.57	<50	<0.50	<0.50	<0.50	<0.50	60
	06/27/08	44.12	311.28	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	09/22/08	Dry				Not Sampled			
	12/30/08	Dry				Not Sampled			
	01/19/09	48.88	-- ⁹			Not Sampled			
	03/13/09	38.80	316.60	<50	<0.50	<0.50	<0.50	<0.50	210
	06/18/09	Dry				Not Sampled			
	09/24/09	Dry				Not Sampled			
	12/16/09	Dry				Not Sampled			
	03/22/10	40.15	315.25	<50	<0.50	<0.50	<0.50	<0.50	190
	06/21/10	Dry				Not Sampled			
	09/28/10	Dry				Not Sampled			
	12/21/10	Dry				Not Sampled			
	03/30/11	41.62	313.78	<50	<0.50	<0.50	<0.50	<0.50	290
	06/07/11	Dry				Not Sampled			
MW-2	01/24/00	Dry	--			Well Dry - Not Sampled			
	01/31/00	Dry	--			Well Dry - Not Sampled			
	02/18/00	25.74	--			Not Sampled			
	02/24/00	22.05				Not Sampled			
	05/11/00	25.42	--	ND ²	ND ²	ND ²	ND ²	ND ²	11,000/12,000 ⁴
	03/01/01	25.24	--	90 ⁵	<0.50	<0.50	<0.50	<0.50	14,000

Table 1
Groundwater Monitoring and Analytical Results
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID/ TOC* (ft.)	DATE	DTW (ft.)	GWE (msl)	THP _g (µg/L)	Benzene (µg/L)	Toluene (µg/L)	Ethylbenzene (µg/L)	Xylene (µg/L)	MTBE (µg/L)
MW-2	06/01/02	30.26	--	16,000	<5.0	<5.0	<5.0	<5.0	19,000
(cont.)	09/30/02	31.03	--			Insufficient Water - Not Sampled			
	12/26/02	21.91	330.04	<10,000	<100	<100	<100	<100	16,000
351.95*	05/01/03	25.86	326.09	16,000 ⁷	<100	<100	<100	<100	16,000
	11/05/03	31.08	320.87			Insufficient Water - Not Sampled			
	12/20/05	28.44	323.51	<2,000	<20	<20	<20	<20	9,400
354.44~	06/09/06	22.84	331.60			Not Sampled			
	09/05/06	30.54	323.90	<900	<9.0	<9.0	<9.0	<9.0	5,300
	12/15/06	27.73	326.71	<500	<5.0	<5.0	<5.0	<5.0	3,100
	03/16/07	21.71	332.73	<500	<5.0	<5.0	<5.0	<5.0	4,800
	04/20/07	27.75	326.69			Not Sampled			
	06/15/07	30.96	323.48	<400	<4.0	<4.0	<4.0	<4.0	2,600
	09/13/07	31.55	-- ⁹			Insufficient Water - Not Sampled			
	12/28/07	27.72	326.72	<90	<0.90	<0.90	<0.90	<0.90	510
	03/28/08	22.50	331.94	<90	<0.90	<0.90	<0.90	<0.90	2,300
	06/27/08	30.96	323.48	<90	<0.90	<0.90	<0.90	<0.90	560
	09/22/08	31.52	-- ⁹			Insufficient Water - Not Sampled			
	12/30/08	29.59	324.85	<50	<0.50	<0.50	<0.50	<0.50	54
	01/19/09	29.58	324.86			Not Sampled			
	03/13/09	21.36	333.08	<50	<0.50	<0.50	<0.50	<0.50	2,400
	06/18/09	30.98	323.46	<90	<0.90	<0.90	<0.90	<0.90	570
	09/24/09	Dry				Monitored Only - Sampled Semi-Annually			
	12/16/09	29.75	324.69	<150	<1.5	<1.5	<1.5	<1.5	700
	03/22/10	21.94	332.50			Monitoring Only - Sampled Semi-Annually			
	06/21/10	29.72	324.72	<150	<1.5	<1.5	<1.5	<1.5	990
	09/28/10	31.08	323.36			Monitoring Only - Sampled Semi-Annually			
	12/21/10	28.44	326.00	<50	<0.50	<0.50	<0.50	<0.50	62
	03/30/11	20.10	334.34	100	<0.50	<0.50	<0.50	<0.50	3,200
	06/07/11	29.09	325.35	<50	<0.50	<0.50	<0.50	<0.50	1,300
MW-2A									
354.43~	06/09/06	31.22	323.21	<900	<9.0	<9.0	<9.0	<9.0	5,300
	09/05/06	46.35	308.08	<900	<9.0	<9.0	<9.0	<9.0	4,500
	12/15/06	40.38	314.05	<900	<9.0	<9.0	<9.0	<9.0	7,300
	03/16/07	32.91	321.52	<500	<5.0	<5.0	<5.0	<5.0	2,300
	04/20/07	37.03	317.40			Not Sampled			

Table 1
Groundwater Monitoring and Analytical Results
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID/ TOC*(μ L)	DATE	DTW (ft.)	GWE (msl)	THP g (μ g/L)	Benzene (μ g/L)	Toluene (μ g/L)	Ethylbenzene (μ g/L)	Xylene (μ g/L)	MTBE (μ g/L)
MW-2A (cont.)	06/15/07	42.08	312.35	<500	<5.0	<5.0	<5.0	<5.0	7,300
	09/13/07	47.03	307.40	<1,500	<15	<15	<15	<15	8,800
	12/28/07	38.77	315.66	<500	<5.0	<5.0	<5.0	<5.0	3,800
	03/28/08	34.13	320.30	<150	<1.5	<1.5	<1.5	<1.5	760
	06/27/08	44.28	310.15	<1,500	<15	<15	<15	<15	7,000
	09/22/08	49.40	-- ⁹			Insufficient Water - Not Sampled			
	12/30/08	Dry				Not Sampled			
	01/19/09	Dry				Not Sampled			
	03/13/09	38.40	316.03	<400	<4.0	<4.0	<4.0	<4.0	2,100
	06/18/09	Dry				Not Sampled			
	09/24/09	Dry				Not Sampled			
	12/16/09	Dry				Not Sampled			
	03/22/10	37.57	316.86	<50	<0.50	<0.50	<0.50	<0.50	23
	06/21/10	Dry				Not Sampled			
	09/28/10	Dry				Not Sampled			
	12/21/10	Dry				Not Sampled			
	03/30/11	39.09	315.34	<50	<0.50	<0.50	<0.50	<0.50	280
	06/07/11	Dry				Not Sampled			
MW-3 352.29* 354.76~	12/26/02 ⁶	21.99	330.30	<50	<0.50	<0.50	<0.50	<0.50	66
	05/01/03	22.11	330.18	<50	<0.50	<0.50	<0.50	<0.50	47
	11/05/03	23.76	328.53			Insufficient Water - Not Sampled			
	12/20/05	22.59	329.70	<50	<0.50	<0.50	<0.50	<0.50	35
	06/09/06	22.18	332.58			Not Sampled			
	09/05/06	23.12	331.64	<50	<0.50	<0.50	<0.50	<0.50	31
	12/15/06	22.42	332.34	<50	<0.50	<0.50	<0.50	<0.50	28
	03/16/07	21.83	332.93	<50	<0.50	<0.50	<0.50	<0.50	37
	04/20/07	22.69	332.07			Not Sampled			
	06/15/07	23.31	331.45	<50	<0.50	<0.50	<0.50	<0.50	30
	09/13/07	23.53	331.23	<50	<0.50	<0.50	<0.50	<0.50	28
	12/28/07	22.39	332.37	<50	<0.50	<0.50	<0.50	<0.50	52
	03/28/08	22.24	332.52	<50	<0.50	<0.50	<0.50	<0.50	90
	06/27/08	23.34	331.42	<50	<0.50	<0.50	<0.50	<0.50	72
	09/22/08	23.44	331.32	<50	<0.50	<0.50	<0.50	<0.50	60
	12/30/08	22.74	332.02	<50	<0.50	<0.50	<0.50	<0.50	71

Table 1
Groundwater Monitoring and Analytical Results
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID/ TOC* (ft)	DATE	DTW (ft)	GWE (msl)	THP (µg/L)	Benzene (µg/L)	Toluene (µg/L)	Ethylbenzene (µg/L)	Xylene (µg/L)	MTBE (µg/L)
MW-3 (cont)	01/19/09	24.36	330.40			Not Sampled			
	03/13/09	21.68	333.08	<50	<0.50	<0.50	<0.50	<0.50	89
	06/18/09	23.35	331.41	<50	<0.50	<0.50	<0.50	<0.50	77
	09/24/09	23.76	331.00			Monitored Only - Sampled Semi-Annually			
	12/16/09	22.80	331.96	<50	<0.50	<0.50	<0.50	<0.50	74
	03/22/10	22.35	332.41			Monitored Only - Sampled Semi-Annually			
	06/21/10	22.99	331.77	<50	<0.50	<0.50	<0.50	<0.50	120
	09/28/10	24.45	-- ⁹			Monitored Only - Sampled Semi-Annually			
	12/21/10	22.43	332.33	<50	<0.50	<0.50	<0.50	<0.50	110
	03/30/11	20.37	334.39	<50	<0.50	<0.50	<0.50	<0.50	130
	06/07/11	22.89	331.87	<50	<0.50	<0.50	<0.50	<0.50	99
MW-3A 354.52~	06/09/06	33.60	320.92	<50	<0.50	<0.50	<0.50	<0.50	3.9
	09/05/06	46.86	307.66	<50	<0.50	<0.50	<0.50	<0.50	4.7
	12/15/06	43.02	311.50	<50	<0.50	<0.50	<0.50	<0.50	9.9
	03/16/07	32.73	321.79	<50	<0.50	<0.50	<0.50	<0.50	5.4
	04/20/07	38.03	316.49			Not Sampled			
	06/15/07	43.42	311.10	<50	<0.50	<0.50	<0.50	<0.50	6.4
	09/13/07	47.73	306.79	<50	<0.50	<0.50	<0.50	<0.50	10
	12/28/07	39.80	314.72	<50	<0.50	<0.50	<0.50	<0.50	36
	03/28/08	34.53	319.99	<50	<0.50	<0.50	<0.50	<0.50	33
	06/27/08	45.04	309.48	<50	<0.50	<0.50	<0.50	<0.50	9.5
	09/22/08	49.65	-- ⁹			Insufficient Water - Not Sampled			
	12/30/08	47.87	306.65	<50	<0.50	<0.50	<0.50	<0.50	37
	01/19/09	49.66	-- ⁹			Not Sampled			
	03/13/09	37.32	317.20	<50	<0.50	<0.50	<0.50	<0.50	12
	06/18/09	49.72	-- ⁹			Insufficient Water - Not Sampled			
	09/24/09	49.90	-- ⁹			Insufficient Water - Not Sampled			
	12/16/09	48.57	305.95	<50	<0.50	<0.50	<0.50	<0.50	48
	03/22/10	35.90	318.62	<50	<0.50	<0.50	<0.50	<0.50	34
	06/21/10	49.78	-- ⁹			Insufficient Water - Not Sampled			
	09/28/10	49.81	-- ⁹			Insufficient Water - Not Sampled			
	12/21/10	45.03	309.49	<50	<0.50	<0.50	<0.50	<0.50	46
	03/30/11	40.81	313.71	<50	<0.50	<0.50	<0.50	<0.50	5.0
	06/07/11	49.84	-- ⁹			Insufficient Water - Not Sampled			

Table 1
Groundwater Monitoring and Analytical Results
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID/ TOC* (L)	DATE	DTW (ft.)	GWE (msl)	THP (µg/L)	Benzene (µg/L)	Toluene (µg/L)	Ethylbenzene (µg/L)	Xylene (µg/L)	MTBE (µg/L)
MW-4 354.81 [#]	04/20/07	35.12	319.69	<500	<5.0	<5.0	<5.0	<5.0	1,700
	06/15/07	41.62	313.19	<90	<0.90	<0.90	<0.90	<0.90	840
	09/13/07	45.89	308.92	<50	<0.50	<0.50	<0.50	<0.50	220
	12/28/07	38.92	315.89	<50	<0.50	<0.50	<0.50	<0.50	340
	03/28/08	34.94	319.87	75	<0.50	<0.50	<0.50	<0.50	2,800
	06/27/08	43.84	310.97	<50	<0.50	<0.50	<0.50	<0.50	570
	09/22/08	50.11	304.70	<50	<0.50	<0.50	<0.50	<0.50	180
	12/30/08	48.72	306.09	<50	<0.50	<0.50	<0.50	<0.50	24
	01/19/09	48.15	306.66			Not Sampled			
	03/13/09	39.28	315.53	<50	<0.50	<0.50	<0.50	<0.50	5.7
	06/18/09	49.76	305.05	<50	<0.50	<0.50	<0.50	<0.50	1.6
	09/24/09	52.55	-- ⁹			Insufficient Water - Not Sampled			
	12/16/09	52.85	-- ⁹			Insufficient Water - Not Sampled			
	03/22/10	42.39	312.42	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	06/21/10	49.76	305.05	<50	<0.50	<0.50	<0.50	<0.50	1.4
	09/28/10	52.36	302.45	<50	<0.50	<0.50	<0.50	<0.50	0.63
	12/21/10	51.33	303.48	<50	<0.50	<0.50	<0.50	<0.50	1.7
	03/30/11	43.31	311.50	<50	<0.50	<0.50	<0.50	<0.50	2.3
	06/07/11	46.92	307.89	<50	<0.50	<0.50	<0.50	<0.50	<0.50
MW-5 355.96 [#]	04/20/07	40.88	315.08	<400	<4.0	<4.0	<4.0	<4.0	1,800
	06/15/07	45.58	310.38	<200	<2.0	<2.0	<2.0	<2.0	1,100
	09/13/07	49.93	306.03	<90	<0.90	<0.90	<0.90	<0.90	680
	12/28/07	44.59	311.37	<100	<1.0	<1.0	<1.0	<1.0	520
	03/28/08	38.83	317.13	<100	<1.0	<1.0	<1.0	<1.0	520
	06/27/08	46.96	309.00	<100	<1.0	<1.0	<1.0	<1.0	1,400
	09/22/08	52.20	-- ⁹			Insufficient Water - Not Sampled			
	12/30/08	Dry				Not Sampled			
	01/19/09	Dry				Not Sampled			
	03/13/09	48.82	307.14	<200	<2.0	<2.0	<2.0	<2.0	960
	06/18/09	Dry				Not Sampled			
	09/24/09	Dry				Not Sampled			
	12/16/09	Dry				Not Sampled			
	03/22/10	50.22	305.74	<50	<0.50	<0.50	<0.50	<0.50	100

Table 1
Groundwater Monitoring and Analytical Results
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID/ TOC* (ft.)	DATE	DTW (ft.)	GWE (msl)	THP (µg/L)	Benzene (µg/L)	Toluene (µg/L)	Ethylbenzene (µg/L)	Xylene (µg/L)	MTBE (µg/L)
MW-5 (cont)	06/21/10	Dry					Not Sampled		
	09/28/10	Dry					Not Sampled		
	12/21/10	Dry					Not Sampled		
	03/30/11	Dry					Not Sampled		
	06/07/11	Dry					Not Sampled		
MW-6 354.62 [@]	01/19/09	Dry					Not Sampled		
	03/13/09	Dry					Not Sampled		
	06/18/09	Dry					Not Sampled		
	09/24/09	Dry					Not Sampled		
	12/16/09	Dry					Not Sampled		
	03/22/10	Dry					Not Sampled		
	06/21/10	Dry					Not Sampled		
	09/28/10	Dry					Not Sampled		
	12/21/10	Dry					Not Sampled		
	03/30/11	Dry					Not Sampled		
	06/07/11	Dry					Not Sampled		
MW-7 354.82 [@]	01/19/09	50.17	-- ⁹				Insufficient Water - Not Sampled		
	03/13/09	49.76	-- ⁹				Insufficient Water - Not Sampled		
	06/18/09	50.24	-- ⁹				Insufficient Water - Not Sampled		
	09/24/09	50.42	-- ⁹				Insufficient Water - Not Sampled		
	12/16/09	48.58	306.24	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	03/22/10	45.85	308.97	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	06/21/10	Dry					Not Sampled		
	09/28/10	Dry					Not Sampled		
	12/21/10	50.29	-- ⁹				Insufficient Water - Not Sampled		
	03/30/11	Dry					Not Sampled		
	06/07/11	Dry					Not Sampled		

Can-Am Plumbing
151 Wyoming Street
Pleasanton, California

354.35~

Table 1
Groundwater Monitoring and Analytical Results
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID/ TOC* (ft)	DATE	DTW (ft)	GWE (msl)	THP (µg/L)	Benzene (µg/L)	Toluene (µg/L)	Ethylbenzene (µg/L)	Xylene (µg/L)	MTBE (µg/L)
PZ-1 354.54~	06/09/06	6.08	348.46				Not Sampled		
	09/05/06	6.35	348.19	<50	0.67	<0.50	<0.50	<0.50	57
	12/15/06	6.51	348.03			Obstruction in well @ 6.53'-Unable to sample well			
	03/16/07	6.28	348.26			Insufficient water - Not Sampled			
	04/20/07	6.45	348.09			Not Sampled			
	06/15/07	6.31	348.23			Insufficient water - Not Sampled			
	09/13/07	Dry				Not Sampled			
	12/28/07	Dry				Not Sampled			
	03/28/08	Dry				Not Sampled			
	06/27/08	Dry				Not Sampled			
	09/22/08	Dry				Not Sampled			
	12/30/08	Dry				Not Sampled			
	01/19/09	Dry				Not Sampled			
	03/13/09	Dry				Not Sampled			
	06/18/09	Dry				Not Sampled			
	09/24/09	Dry				Monitored Only-Sampled Semi-Annually			
	12/16/09	Dry				Not Sampled			
	03/22/10	Dry				Monitored Only-Sampled Semi-Annually			
	06/21/10	Dry				Not Sampled			
	09/28/10	Dry				Monitored Only-Sampled Semi-Annually			
	12/21/10	Dry				Not Sampled			
	03/30/11	Dry				Monitored Only-Sampled Semi-Annually			
	06/07/11	Dry				Not Sampled			
PZ-2 354.35~	06/09/06	3.91	350.44				Not Sampled		
	9/5/06	4.57	349.78	150	<0.50	<0.50	<0.50	<0.50	52
	12/15/06	4.30	350.05	160	<0.50	<0.50	<0.50	<0.50	11
	3/16/07	4.60	349.75	4,000	<0.50	<0.50	<0.50	<0.50	1.6
	04/20/07	5.03	349.32			Not Sampled			
	6/15/07	5.65	348.70	180	<0.50	<0.50	<0.50	<0.50	2.8
	09/13/07	6.54	347.81	<50	<0.50	<0.50	<0.50	<0.50	34
	12/28/07	6.38	347.97			Not Sampled-bailer sticking to side of casing prevented sample collection			
	03/28/08	5.62	348.73	160	<0.50	<0.50	<0.50	<0.50	8.6
	6/27/08	6.59	347.76			Not Sampled-bailer sticking to side of casing prevented sample collection			

Table 1
Groundwater Monitoring and Analytical Results
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID/ TOC* (ft.)	DATE	DTW (ft.)	GWE (msl)	THPg (µg/L)	Benzene (µg/L)	Toluene (µg/L)	Ethylbenzene (µg/L)	Xylene (µg/L)	MTBE (µg/L)
PZ-2 (cont.)	09/22/08	8.90	-- ⁹	Not Sampled-Unable to collect water with pin bailer					
	12/30/08	6.56	347.79	<50	<0.50	<0.50	<0.50	<0.50	1.7
	01/19/09	6.97	347.38	Not Sampled					
	03/13/09	6.02	348.33	<50	<0.50	<0.50	<0.50	<0.50	4.4
	06/18/09	6.73	347.62	<50	<0.50	<0.50	<0.50	<0.50	20
	09/24/09	Dry	Monitored Only - Sampled Semi-Annually						
	12/16/09	4.40	349.95	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	3/22/10	6.05	348.30	Monitored Only - Sampled Semi-Annually					
	6/21/10	5.12	349.23	<50	<0.50	<0.50	<0.50	<0.50	3.2
	09/28/10	6.85	347.50	Monitored Only - Sampled Semi-Annually					
	12/21/10	6.36	347.99	<50	<0.50	<0.50	<0.50	<0.50	0.60
	03/30/11	5.12	349.23	Monitored Only - Sampled Semi-Annually					
	06/07/11	5.30	349.05	<50	<0.50	<0.50	<0.50	<0.50	2.9
PZ-3 354.14~	6/9/06	3.77	350.37	Not Sampled					
	09/05/06	4.30	349.84	<50	<0.50	<0.50	<0.50	<0.50	29
	12/15/06	3.99	350.15	<50	<0.50	<0.50	<0.50	<0.50	35
	03/16/07	4.33	349.81	<50	<0.50	<0.50	<0.50	<0.50	8.6
	04/20/07	5.06	349.08	Not Sampled					
	06/15/07	6.08	348.06	<50	<0.50	<0.50	<0.50	<0.50	130
	09/13/07	7.52	346.62	<50	<0.50	<0.50	<0.50	<0.50	19
	12/28/07	6.31	347.83	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	03/28/08	6.33	347.81	<50	<0.50 ¹⁰	<0.50	<0.50	<0.50	0.74
	06/27/08	7.23	346.91	Not Sampled-bailer sticking to side of casing prevented sample collection					
	09/22/08	8.27	-- ⁹	Not Sampled-Unable to collect water with pin bailer					
	12/30/08	5.49	348.65	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	01/19/09	6.80	347.34	Not Sampled					
	03/13/09	5.64	348.50	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	06/18/09	7.25	346.89	<50	<0.50	<0.50	<0.50	<0.50	4.3
	09/24/09	8.55	-- ⁹	Monitored Only - Sampled Semi-Annually					
	12/16/09	4.40	349.74	<50	<0.05	<0.50	<0.50	<0.50	<0.50
	03/22/10	6.06	348.08	Monitored Only - Sampled Semi-Annually					
	06/21/10	5.10	349.04	<50	<0.50	<0.50	<0.50	<0.50	40
	09/28/10	7.96	346.18	Monitored Only - Sampled Semi-Annually					

Table 1
Groundwater Monitoring and Analytical Results
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID/ TOC*(g/L)	DATE	DTW (ft.)	GWE (msl)	THP (µg/L)	Benzene (µg/L)	Toluene (µg/L)	Ethylbenzene (µg/L)	Xylene (µg/L)	MTBE (µg/L)
PZ-3 (cont.)	12/21/10	5.41	348.73	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	03/30/11	5.12	349.02			Monitored Only - Sampled Semi-Annually		<0.50	1.6
	06/07/11	5.30	348.84	<50	<0.50	<0.50	<0.50	<0.50	
PZ-4 354.22~	06/09/06	3.62	350.60			Not Sampled			32
	09/05/06	4.44	349.78	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	12/15/06	4.17	350.05	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	03/16/07	4.58	349.64	<50	<0.50	<0.50	<0.50	<0.50	
	04/20/07	4.90	349.32			Not Sampled			98
	06/15/07	5.53	348.69	<50	<0.50	<0.50	<0.50	<0.50	7.8
	09/13/07	6.44	347.78	<50	<0.50	<0.50	<0.50	<0.50	0.52
	12/28/07	6.32	347.90	<50	<0.50	<0.50	<0.50	<0.50	4.7
	03/28/08	5.59	348.63	<50	<0.50 ¹⁰	<0.50	<0.50	<0.50	30
	06/27/08	6.52	347.70	<50	<0.50	<0.50	<0.50	<0.50	
	09/22/08	7.90	346.32			Not Sampled-Unable to collect water with pin bailer			<0.50
	12/30/08	6.69	347.53	<50	<0.50	<0.50	<0.50	<0.50	
	01/19/09	6.78	347.44			Not Sampled			2.1
	03/13/09	6.01	348.21	<50	<0.50	<0.50	<0.50	<0.50	6.2
	06/18/09	6.62	347.60	<50	<0.50	<0.50	<0.50	<0.50	
	09/24/09	6.90	347.32			Monitored Only - Sampled Semi-Annually			<0.50
	12/16/09	4.39	349.83	<50	<0.50	<0.50	<0.50	<0.50	
	03/22/10	6.07	348.15	<50	<0.50	<0.50	<0.50	<0.50	5.8
	06/21/10	5.09	349.13	<50	<0.50	<0.50	<0.50	<0.50	
	09/28/10	6.62	347.60			Monitored Only - Sampled Semi-Annually			1.1
	12/21/10	6.36	347.86	<50	<0.50	<0.50	<0.50	<0.50	
	03/30/11	5.14	349.08			Monitored Only - Sampled Semi-Annually			0.97
	06/07/11	5.32	348.90	<50	<0.50	<0.50	<0.50	<0.50	
PZ-5 354.95~	06/09/06	6.46	348.49			Not Sampled			2,900
	09/05/06	8.70	346.25	<500	<5.0	<5.0	<5.0	<5.0	2,600
	12/15/06	8.51	346.44	<500	<5.0	<5.0	<5.0	<5.0	
	03/16/07	8.89	346.06			Insufficient Water - Not Sampled			
	04/20/07	8.80	346.15			Not Sampled			

Table 1
Groundwater Monitoring and Analytical Results
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID/ TOC* (ft.)	DATE	DTW (ft.)	GWE (in/b)	THP _g (µg/L)	Benzene (µg/L)	Toluene (µg/L)	Ethylbenzene (µg/L)	Xylene (µg/L)	MTBE (µg/L)
PZ-5 (cont.)	06/15/07	9.16	345.79			Insufficient Water - Not Sampled			
	09/13/07	Dry	--			Not Sampled			
	12/28/07	Dry	--			Not Sampled			
	03/28/08	9.57	-- ⁹			Insufficient Water - Not Sampled			
	06/27/08	8.83	-- ⁹			Insufficient Water - Not Sampled			
	09/22/08	9.13	-- ⁹			Insufficient Water - Not Sampled			
	12/30/08	9.20	-- ⁹			Insufficient Water - Not Sampled			
	01/19/09	9.20	-- ⁹			Insufficient Water - Not Sampled			
	03/13/09	9.21	-- ⁹			Insufficient Water - Not Sampled			
	06/18/09	9.22	-- ⁹			Insufficient Water - Not Sampled			
	09/24/09	9.37	-- ⁹			Monitored Only - Sampled Semi-Annually			
	12/16/09	9.25	-- ⁹			Insufficient Water - Not Sampled			
	03/22/10	Dry	--			Monitored Only - Sampled Semi-Annually			
	06/21/10	9.41	-- ⁹			Insufficient Water - Not Sampled			
	09/28/10	9.25	-- ⁹			Monitored Only - Sampled Semi-Annually			
	12/21/10	9.31	-- ⁹			Insufficient Water - Not Sampled			
	03/30/11	9.27	-- ⁹			Monitored Only - Sampled Semi-Annually			
	06/07/11	9.45	-- ⁹			Insufficient Water - Not Sampled			
PZ-6 354.39~	06/09/06	4.04	350.35			Not Sampled			
	09/05/06	4.67	349.72	<50	<0.50	<0.50	<0.50	<0.50	62
	12/15/06	4.38	350.01	<50	<0.50	<0.50	<0.50	<0.50	2.7
	3/16/07	4.70	349.69	<50	<0.50	<0.50	<0.50	<0.50	7.4
	04/20/07	5.13	349.26			Not Sampled			
	06/15/07	5.74	348.65	<50	<0.50	<0.50	<0.50	<0.50	88
	9/13/07 ⁸	6.67	347.72	<50	<0.50	<0.50	<0.50	<0.50	51
	12/28/07	6.46	347.93	<50	<0.50	<0.50	<0.50	<0.50	33
	03/28/08	5.71	348.68	<50	<0.50	<0.50	<0.50	<0.50	130
	06/27/08	6.58	347.81	<50	<0.50	<0.50	<0.50	<0.50	24
	09/22/08	7.75	346.64	<50	<0.50	<0.50	<0.50	<0.50	63
	12/30/08	7.22	347.17	<50	<0.50	<0.50	<0.50	<0.50	12
	01/19/09	7.36	347.03			Not Sampled			
	03/13/09	6.12	348.27	<50	<0.50	<0.50	<0.50	<0.50	1.7
	06/18/09	6.75	347.64	<50	<0.50	<0.50	<0.50	<0.50	5.3
	09/24/09	7.91	346.48			Monitored Only - Sampled Semi-Annually			

Table 1
Groundwater Monitoring and Analytical Results
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID/ TOC*(ft)	DATE	DTW (ft)	GWE (msl)	THP (ft)	Benzene (µg/L)	Toluene (µg/L)	Ethylbenzene (µg/L)	Xylene (µg/L)	MTBE (µg/L)
PZ-6 (cont.)	12/16/09	4.49	349.90	<50	<0.50	<0.50	<0.50	<0.50	1.0
	03/22/10	6.47	347.92			Monitored Only - Sampled Semi-Annually			
	06/21/10	5.19	349.20	<50	<0.50	<0.50	<0.50	<0.50	6.3
	09/28/10	6.98	347.41			Monitored Only - Sampled Semi-Annually			
	12/21/10	6.44	347.95	<50	<0.50	<0.50	<0.50	<0.50	3.6
	03/30/11	6.77	347.62			Monitored Only - Sampled Semi-Annually			
	06/07/11	5.37	349.02	<50	<0.50	<0.50	<0.50	<0.50	1.6
PZ-7 354.45~	06/09/06	4.05	350.40			Not Sampled			
	09/05/06	4.65	349.80	<50	<0.50	<0.50	<0.50	<0.50	1.4
	12/15/06	4.32	350.13	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	03/16/07	4.68	349.77	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	04/20/07	5.12	349.33			Not Sampled			
	06/15/07	5.73	348.72	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	09/13/07	6.63	347.82	<50	<0.50	<0.50	<0.50	<0.50	0.68
	12/28/07	6.45	348.00	<50	<0.50	<0.50	<0.50	<0.50	0.85
	03/28/08	5.72	348.73	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	06/27/08	6.67	347.78	<50	<0.50	<0.50	<0.50	<0.50	0.59
	09/22/08	8.11	346.34	<50	<0.50	<0.50	<0.50	<0.50	0.93
	12/30/08	7.20	347.25	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	01/19/09	7.31	347.14			Not Sampled			
	03/13/09	6.13	348.32	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	06/18/09	6.72	347.73	<50	<0.50	<0.50	<0.50	<0.50	0.94
	09/24/09	7.87	346.58			Monitored Only - Sampled Semi-Annually			
	12/16/09	4.48	349.97	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	03/22/10	6.15	348.30			Monitored Only - Sampled Semi-Annually			
	06/21/10	5.20	349.25	<50	<0.50	<0.50	<0.50	<0.50	0.50
	09/28/10	6.77	347.68			Monitored Only - Sampled Semi-Annually			
	12/21/10	6.45	348.00	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	03/30/11	5.21	349.24			Monitored Only - Sampled Semi-Annually			
	06/07/11	5.39	349.06	<50	<0.50	<0.50	<0.50	<0.50	<0.50

Table 1
Groundwater Monitoring and Analytical Results
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID/ TOC* (ft.)	DATE	DTW (ft.)	GWE (msl)	THP (µg/L)	Benzene (µg/L)	Toluene (µg/L)	Ethylbenzene (µg/L)	Xylene (µg/L)	MTBE (µg/L)
QA	09/05/06	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	12/15/06	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	03/16/07	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	6/15/07 ⁸	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	09/13/07	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	12/28/07	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	03/28/08	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	06/27/08	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	09/22/08	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	12/30/08	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	03/13/09	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	06/18/09	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	12/16/09	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	03/22/10	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	06/21/10	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	09/28/10	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	12/21/10	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	03/30/11	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50
	06/07/11	--	--	<50	<0.50	<0.50	<0.50	<0.50	<0.50

Table 1
Groundwater Monitoring and Analytical Results
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

EXPLANATION:

TOC = Top of Casing
 (ft.) = Feet
 DTW = depth to water measured from top of box/grade
 GWE = Groundwater Elevation
 (msl) = Mean sea level
 TPHg = Total Petroleum Hydrocarbons as gasoline

MTBE = Methyl Tertiary Butyl Ether
 (µg/L) = Micrograms per liter
 ND = Not Detected
 -- = not measured or analyzed
 QA = Trip Blank

ANALYTICAL LABORATORY:

Sequoia Analytical (ELAP #1271)
 Severn Trent Laboratory (ELAP #2496)
 Kiff Analytical (ELAP #2236)
 TPHg/BTEX/MTBE by EPA Method 8260B

* Top of Casing (TOC) elevations surveyed to Mean Sea Level (MSL) by Virgil Chavez Land Surveying,
 California-Licensed Land Surveyor No. 6323

~ Top of casing (TOC) elevation surveyed to Mean Sea Level (MSL) by Morrow Surveying (PLS# 5161) on 6/6/06

Top of casing (TOC) elevation surveyed to Mean Sea Level (MSL) by Morrow Surveying (PLS# 5161) on 4/17/07

@ Top of casing (TOC) elevation surveyed to Mean Sea Level (MSL) by Morrow Surveying (PLS#5161) on 1/27/09

¹ Laboratory reported an unidentified hydrocarbon C6-C12.

² Elevated detection limit.

³ Chromatogram pattern: Gasoline C6-C12.

⁴ MtBE by EPA Method 8260.

⁵ Discrete Peaks

⁶ Well Development Performed

⁷ Discrete Peak at MtBE

⁸ Samples were analyzed by EPA Method 8260B using bottles that contained headspace bubbles greater than 1/4-inch in diameter

⁹ Insufficient water to determine GWE

¹⁰ Matrix Spike/Matrix Spike Duplicate Results associated with these samples for the analyte Benzene were affected by the analyte concentrations already present in the un-spiked sample.

Table 2
Groundwater Analytical Results - Oxygenate Compounds
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID	DATE	TBA (µg/L)	MTBE (µg/L)	DIPE (µg/L)	ETBE (µg/L)	TAME (µg/L)	1,2-DCA (µg/L)	EDB (µg/L)	ETHANOL (µg/L)
MW-1	03/01/01	<50	<2.0	<2.0	<2.0	<2.0	---	---	<500
	06/27/02	<5.0	<0.50	<0.50	<0.50	<0.50	<0.50	<0.50	<50
	09/30/02				Well Dry - Not Sampled				
	12/26/02	<5.0	0.61	<0.50	<0.50	<0.50	<0.50	<0.50	<50
	05/01/03	540	2,100	<100	<10	<10	<10	<10	<1,000
	11/05/03	<5.0	17	<1.0	<0.50	<0.50	<0.50	<0.50	---
	06/09/06	--	--	--	--	--	--	--	--
	09/05/06	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	12/15/06	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	03/16/07	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	04/20/07	--	--	--	--	--	--	--	--
	06/15/07	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	09/13/07	<5.0	0.65	<0.50	<0.50	<0.50	--	--	--
	12/28/07	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	03/28/08	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	06/27/08	<5.0	0.52	<0.50	<0.50	<0.50	--	--	--
	09/22/08				Insufficient Water - Not Sampled				
	12/30/08	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	01/19/09				Not Sampled				
	03/13/09	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	06/18/09	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	09/24/09				Monitored Only - Sampled Semi-Annually				
	12/16/09	<5.0	0.74	<0.50	<0.50	<0.50	--	--	--
	03/22/10				Monitored Only - Sampled Semi-Annually				
	06/21/10	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	09/28/10				Monitored Only - Sampled Semi-Annually				
	12/21/10	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	03/30/11	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	06/07/11	<5.0	0.57	<0.50	<0.50	<0.50	--	--	--
MW-1A	06/09/06	<5.0	5.3	<0.50	<0.50	<0.50	--	--	--
	09/05/06	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	12/15/06	9.3 J	240	<0.50	<0.50	3.7	--	--	--
	03/16/07	<5.0	170	<0.50	<0.50	3.0	--	--	--
	04/20/07	--	--	--	--	--	--	--	--
	06/15/07	<5.0	29	<0.50	<0.50	<0.50	--	--	--
	09/13/07	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--

Table 2
Groundwater Analytical Results - Oxygenate Compounds
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID	DATE	TBA (µg/L)	MTBE (µg/L)	DIPE (µg/L)	ETBE (µg/L)	TAME (µg/L)	1,2-DCA (µg/L)	EDB (µg/L)	ETHANOL (µg/L)
MW-1A (cont.)	12/28/07	5.1	95	<0.50	<0.50	1.1	--	--	--
	03/28/08	<5.0	60	<0.50	<0.50	0.60	--	--	--
	06/27/08	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	09/22/08				Insufficient Water - Not Sampled				
	12/30/08				Not Sampled				
	01/19/09				Not Sampled				
	03/13/09	7.3 J	210	<0.50	<0.50	2.7	--	--	--
	06/18/09				Not Sampled				
	09/24/09				Not Sampled				
	12/16/09				Not Sampled				
	03/22/10	<5.0	190	<0.50	<0.50	2.6	--	--	--
	06/21/10				Not Sampled				
	09/28/10				Not Sampled				
	12/21/10				Not Sampled				
	03/30/11	<5.0	290	<0.50	<0.50	2.7	--	--	--
	06/07/11				Not Sampled				
MW-2	03/01/01	2,800	14,000	<100	<100	190	---	---	<25,000
	06/27/02	3,100	19,000	7.0	<5.0	260	<5.0	<5.0	<500
	09/30/02				Insufficient Water - Not Sampled				
	12/26/02	<1,000	16,000	<100	<100	220	<100	<100	<10,000
	05/01/03	4,100	16,000	<100	<100	240	<100	<100	<10,000
	11/05/03				Insufficient Water - Not Sampled				
	06/09/06	--	--	--	--	--	--	--	--
	09/05/06	390	5,300	<9.0	<9.0	56	--	--	--
	12/15/06	<25	3,100	<5.0	<5.0	25	--	--	--
	03/16/07	660	4,800	<5.0	<5.0	76	--	--	--
	04/20/07	--	--	--	--	--	--	--	--
	06/15/07	34 J	2,600	<4.0	<4.0	31	--	--	--
	09/13/07				Insufficient Water - Not Sampled				
	12/28/07	<5.0	510	<0.90	<0.90	4.1	--	--	--
	03/28/08	71 J	2,300	<0.90	<0.90	31	--	--	--
	06/27/08	<5.0	560	<0.90	<0.90	5.5	--	--	--
	09/22/08				Insufficient Water - Not Sampled				
	12/30/08	<5.0	54	<0.50	<0.50	0.62	--	--	--
	03/13/09	200	2,400	<0.50	<0.50	29	--	--	--
	06/18/09	<5.0	570	<0.90	<0.90	8.1	--	--	--

Table 2
Groundwater Analytical Results - Oxygenate Compounds
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID	DATE	TBA (µg/L)	MTBE (µg/L)	DIPE (µg/L)	ETBE (µg/L)	TAME (µg/L)	1,2-DCA (µg/L)	EDB (µg/L)	ETHANOL (µg/L)
MW-2 (cont.)	09/24/09				Monitored Only - Sampled Semi-Annually				
	12/16/09	12 J	700	<1.5	<1.5	9.2	--	--	--
	03/22/10				Monitored Only - Sampled Semi-Annually				
	06/21/10	<7.0	990	<1.5	<1.5	11	--	--	--
	09/28/10				Monitored Only - Sampled Semi-Annually				
	12/21/10	<5.0	62	<0.50	<0.50	0.55	--	--	--
	03/30/11	310	3,200	<0.50	<0.50	52	--	--	--
	06/07/11	80	1,300	<0.50	<0.50	20	--	--	--
MW-2A	06/09/06	860	5,300	<9.0	<9.0	61	--	--	--
	09/05/06	600	4,500	<9.0	<9.0	56	--	--	--
	12/15/06	1,000	7,300	<9.0	<9.0	99	--	--	--
	03/16/07	270	2,300	<5.0	<5.0	32	--	--	--
	04/20/07	--	--	--	--	--	--	--	--
	06/15/07	780	7,300	<5.0	<5.0	86	--	--	--
	09/13/07	830	8,800	<15	<15	140	--	--	--
	12/28/07	300	3,800	<5.0	<5.0	54	--	--	--
	03/28/08	45	760	<1.5	<1.5	11	--	--	--
	06/27/08	100 J	7,000	<15	<15	130	--	--	--
	09/22/08				Insufficient Water - Not Sampled				
	12/30/08				Not Sampled				
	01/19/09				Not Sampled				
	03/13/09	20 J	2,100	<4.0	<4.0	22	--	--	--
	06/18/09				Not Sampled				
	09/24/09				Not Sampled				
	12/16/09				Not Sampled				
	03/22/10	<5.0	23	<0.50	<0.50	<0.50	--	--	--
	06/21/10				Not Sampled				
	09/28/10				Not Sampled				
	12/21/10				Not Sampled				
	03/30/11	36	280	<0.50	<0.50	1.3	--	--	--
	06/07/11				Not Sampled				
MW-3	12/26/02	<5.0	66	<0.50	<0.50	<0.50	<0.50	<0.50	<50
	5/01/03	<5.0	47	<0.50	<0.50	<0.50	<0.50	<0.50	<50
	11/5/03				Insufficient Water - Not Sampled				

Table 2
Groundwater Analytical Results - Oxygenate Compounds
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID	DATE	TBA (µg/L)	MTBE (µg/L)	DIPE (µg/L)	ETBE (µg/L)	TAME (µg/L)	1,2-DCA (µg/L)	EDB (µg/L)	ETHANOL (µg/L)
MW-3 (cont.)	6/9/06	--	--	--	--	--	--	--	--
	9/5/06	<5.0	31	<0.50	<0.50	<0.50	--	--	--
	12/15/06	<5.0	28	<0.50	<0.50	<0.50	--	--	--
	3/16/07	<5.0	37	<0.50	<0.50	<0.50	--	--	--
	4/20/07	--	--	--	--	--	--	--	--
	06/15/07	<5.0	30	<0.50	<0.50	<0.50	--	--	--
	09/13/07	<5.0	28	<0.50	<0.50	<0.50	--	--	--
	12/28/07	<5.0	52	<0.50	<0.50	<0.50	--	--	--
	03/28/08	<5.0	90	<0.50	<0.50	0.83	--	--	--
	06/27/08	<5.0	72	<0.50	<0.50	<0.50	--	--	--
	09/22/08	<5.0	60	<0.50	<0.50	<0.50	--	--	--
	12/30/08	<5.0	71	<0.50	<0.50	0.51	--	--	--
	03/13/09	<5.0	89	<0.50	<0.50	0.63	--	--	--
	06/18/09	<5.0	77	<0.50	<0.50	0.58	--	--	--
	09/24/09				Monitored Only - Sampled Semi-Annually				
	12/16/09	<5.0	74	<0.50	<0.50	0.54	--	--	--
	03/22/10				Monitored Only - Sampled Semi-Annually				
	06/21/10	<5.0	120	<0.50	<0.50	0.78	--	--	--
	09/28/10				Monitored Only - Sampled Semi-Annually				
	12/21/10	<5.0	110	<0.50	<0.50	0.63	--	--	--
	03/30/11	5.7J	130	<0.50	<0.50	0.93	--	--	--
	06/07/11	<5.0	99	<0.50	<0.50	0.74	--	--	--
MW-3A	06/09/06	<5.0	3.9	<0.50	<0.50	<0.50	--	--	--
	09/05/06	<5.0	4.7	<0.50	<0.50	<0.50	--	--	--
	12/15/06	<5.0	9.9	<0.50	<0.50	<0.50	--	--	--
	03/16/07	<5.0	5.4	<0.50	<0.50	<0.50	--	--	--
	04/20/07	--	--	--	--	--	--	--	--
	06/15/07	<5.0	6.4	<0.50	<0.50	<0.50	--	--	--
	09/13/07	<5.0	10	<0.50	<0.50	<0.50	--	--	--
	12/28/07	<5.0	36	<0.50	<0.50	<0.50	--	--	--
	03/28/08	<5.0	33	<0.50	<0.50	<0.50	--	--	--
	06/27/08	<5.0	9.5	<0.50	<0.50	<0.50	--	--	--
	09/22/08				Insufficient Water - Not Sampled				
	12/30/08	<5.0	37	<0.50	<0.50	<0.50	--	--	--
	01/19/09				Not Sampled				
	03/13/09	<5.0	12	<0.50	<0.50	<0.50	--	--	--

Table 2
Groundwater Analytical Results - Oxygenate Compounds
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID	DATE	TBA (µg/L)	MTBE (µg/L)	DIPE (µg/L)	ETBE (µg/L)	TAME (µg/L)	1,2-DCA (µg/L)	EDB (µg/L)	ETHANOL (µg/L)
MW-3A (cont)	06/18/09				Insufficient Water - Not Sampled				
	09/24/09				Insufficient Water - Not Sampled				
	12/16/09	<5.0	48	<0.50	<0.50	<0.50	--	--	--
	03/22/10	<5.0	34	<0.50	<0.50	<0.50	--	--	--
	06/21/10				Insufficient Water - Not Sampled				
	09/28/10				Insufficient Water - Not Sampled				
	12/21/10	<5.0	46	<0.50	<0.50	<0.50	--	--	--
	03/30/11	<5.0	5.0	<0.50	<0.50	<0.50	--	--	--
	06/07/11				Insufficient Water - Not Sampled				
MW-4	04/20/07	300	1,700	<5.0	<5.0	31	--	--	--
	06/15/07	60	840	<0.90	<0.90	10	--	--	--
	09/13/07	16	220	<0.50	<0.50	3.0	--	--	--
	12/28/07	39	340	<0.50	<0.50	4.8	--	--	--
	03/28/08	280	2,800	<0.50	<0.50	44	--	--	--
	06/27/08	7.7 J	570	<0.50	<0.50	8.3	--	--	--
	09/22/08	<5.0	180	<0.50	<0.50	2.3	--	--	--
	12/30/08	<5.0	24	<0.50	<0.50	<0.50	--	--	--
	01/19/09				Not Sampled				
	03/13/09	<5.0	5.7	<0.50	<0.50	<0.50	--	--	--
	06/18/08	<5.0	1.6	<0.50	<0.50	<0.50	--	--	--
	09/24/09				Insufficient Water - Not Sampled				
	12/16/09				Insufficient Water - Not Sampled				
	03/22/10	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	06/21/10	<5.0	1.4	<0.50	<0.50	<0.50	--	--	--
	09/28/10	<5.0	0.63	<0.50	<0.50	<0.50	--	--	--
	12/21/10	<5.0	1.7	<0.50	<0.50	<0.50	--	--	--
	03/30/11	<5.0	2.3	<0.50	<0.50	<0.50	--	--	--
	06/07/11	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
MW-5	04/20/07	130	1,800	<4.0	<4.0	22	--	--	--
	06/15/07	67	1,100	<2.0	<2.0	21	--	--	--
	09/13/07	<5.0	680	<0.90	<0.90	7.1	--	--	--
	12/28/07	<5.0	520	<1.0	<1.0	3.6	--	--	--
	03/28/08	<5.0	520	<1.0	<1.0	3.8	--	--	--

Table 2
Groundwater Analytical Results - Oxygenate Compounds
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID	DATE	TBA (µg/L)	MTBE (µg/L)	DIPE (µg/L)	ETBE (µg/L)	TAME (µg/L)	1,2-DCA (µg/L)	EDB (µg/L)	ETHANOL (µg/L)
MW-5 (cont)	06/27/08	8.1 J	1,400	<1.0	<1.0	19	--	--	--
	09/22/08				Insufficient Water - Not Sampled				
	12/30/08				Not Sampled				
	01/19/09				Not Sampled				
	03/13/09	<9.0	960	<2.0	<2.0	14	--	--	--
	06/18/09				Not Sampled				
	09/24/09				Not Sampled				
	12/16/09				Not Sampled				
	03/22/10	<5.0	100	<0.50	<0.50	<0.50	--	--	--
	06/21/10				Not Sampled				
	09/28/10				Not Sampled				
	12/21/10				Not Sampled				
	03/30/11				Not Sampled				
	06/07/11				Not Sampled				
MW-6	01/19/09				Not Sampled				
	03/13/09				Not Sampled				
	06/18/09				Not Sampled				
	09/24/09				Not Sampled				
	12/16/09				Not Sampled				
	03/22/10				Not Sampled				
	06/21/10				Not Sampled				
	09/28/10				Not Sampled				
	12/21/10				Not Sampled				
	03/30/11				Not Sampled				
	06/07/11				Not Sampled				
MW-7	01/19/09				Insufficient Water - Not Sampled				
	03/13/09				Insufficient Water - Not Sampled				
	06/18/09				Insufficient Water - Not Sampled				
	09/24/09				Insufficient Water - Not Sampled				
	12/16/09	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	03/22/10	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	06/21/10				Not Sampled				
	09/28/10				Not Sampled				

Table 2
Groundwater Analytical Results - Oxygenate Compounds
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID	DATE	TBA (µg/L)	MTBE (µg/L)	DIPE (µg/L)	ETBE (µg/L)	TAME (µg/L)	1,2-DCA (µg/L)	EDB (µg/L)	ETHANOL (µg/L)
PZ-1	06/09/06	--	--	--	--	--	--	--	--
	09/05/06	5.6	57	<0.50	<0.50	2.8	--	--	--
	12/15/06	Obstruction in well @ 6.53'-Unable to sample well							
	03/16/07	Insufficient Water - Not Sampled							
	04/20/07	--	--	--	--	--	--	--	--
	06/15/07				Not Sampled				
	09/13/07				Not Sampled				
	12/28/07				Not Sampled				
	03/28/08				Not Sampled				
	06/27/08				Not Sampled				
	09/22/08				Not Sampled				
	12/30/08				Not Sampled				
	01/19/09				Not Sampled				
	03/13/09				Not Sampled				
	06/18/09				Not Sampled				
	09/24/09				Monitored Only - Sampled Semi-Annually				
	12/16/09				Not Sampled				
	03/22/10				Monitored Only - Sampled Semi-Annually				
	06/21/10				Not Sampled				
	09/28/10				Monitored Only - Sampled Semi-Annually				
	12/21/10				Not Sampled				
	03/30/11				Monitored Only - Sampled Semi-Annually				
	06/07/11				Not Sampled				
PZ-2	06/09/06	--	--	--	--	--	--	--	--
	09/05/06	6.8	52	<0.50	<0.50	1.3	--	--	--
	12/15/06	<5.0	11	<0.50	<0.50	<0.50	--	--	--
	03/16/07	<5.0	1.6	<0.50	<0.50	<0.50	--	--	--
	04/20/07	--	--	--	--	--	--	--	--
	06/15/07	<5.0	2.8	<0.50	<0.50	<0.50	--	--	--
	09/13/07	5.5	34	<0.50	<0.50	1.0	--	--	--
	12/28/07	Not Sampled - bailer sticking to side of casing prevented sample collection							
	03/28/08	<5.0	8.6	<0.50	<0.50	<0.50	--	--	--
	06/27/08	Not Sampled - bailer sticking to side of casing prevented sample collection							
	09/22/08	Not Sampled - Unable to collect water with pin bailer							
	12/30/08	<5.0	1.7	<0.50	<0.50	<0.50	--	--	--
	01/19/09				Not Sampled				

Table 2
Groundwater Analytical Results - Oxygenate Compounds
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID	DATE	TBA (µg/L)	MTBE (µg/L)	DIPE (µg/L)	ETBE (µg/L)	TAME (µg/L)	1,2-DCA (µg/L)	EDB (µg/L)	ETHANOL (µg/L)
PZ-2 (cont.)	03/13/09	<5.0	4.4	<0.50	<0.50	<0.50	--	--	--
	09/24/09				Monitored Only - Sampled Semi-Annually				
	12/16/09	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	03/22/10				Monitored Only - Sampled Semi-Annually				
	06/21/10	<5.0	3.2	<0.50	<0.50	<0.50	--	--	--
	09/28/10				Monitored Only - Sampled Semi-Annually				
	12/21/10	<5.0	0.60	<0.50	<0.50	<0.50	--	--	--
	03/30/11				Monitored Only - Sampled Semi-Annually				
	06/07/11	<5.0	2.9	<0.50	<0.50	<0.50	--	--	--
PZ-3	6/9/06	--	--	--	--	--	--	--	--
	9/5/06	5.1	29	<0.50	<0.50	0.53	--	--	--
	12/15/06	<5.0	35	<0.50	<0.50	<0.50	--	--	--
	3/16/07	<5.0	8.6	<0.50	<0.50	<0.50	--	--	--
	4/20/07	--	--	--	--	--	--	--	--
	06/15/07	15	130	<0.50	<0.50	2.5	--	--	--
	09/13/07	<0.50	19	<0.50	<0.50	0.56	--	--	--
	12/28/07	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	03/28/08	<5.0	0.74	<0.50	<0.50	<0.50	--	--	--
	06/27/08	Not Sampled - Bailer sticking to side of casing prevented sample collection							
	09/22/08	Not Sampled - Unable to collect water with pin bailer							
	12/30/08	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	01/19/09	Not Sampled							
	03/13/09	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	06/18/09	<5.0	4.3	<0.50	<0.50	<0.50	--	--	--
	09/24/09				Monitored Only - Sampled Semi-Annually				
	12/16/09	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	03/22/10				Monitored Only - Sampled Semi-Annually				
	06/21/10	<5.0	40	<0.50	<0.50	0.68	--	--	--
	09/28/10				Monitored Only - Sampled Semi-Annually				
	12/21/10	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	03/30/11				Monitored Only - Sampled Semi-Annually				
	06/07/11	<5.0	1.6	<0.50	<0.50	<0.50	--	--	--

Table 2
Groundwater Analytical Results - Oxygenate Compounds
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID	DATE	TBA (µg/L)	MTBE (µg/L)	DIPE (µg/L)	ETBE (µg/L)	TAME (µg/L)	1,2-DCA (µg/L)	EDB (µg/L)	ETHANOL (µg/L)
PZ-4	6/9/06	--	--	--	--	--	--	--	--
	9/5/06	6.4	32	<0.50	<0.50	0.54	--	--	--
	12/15/06	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	3/16/07	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	4/20/07	--	--	--	--	--	--	--	--
	6/15/07	6.4	98	<0.50	<0.50	1.1	--	--	--
	9/13/07	<5.0	7.8	<0.50	<0.50	<0.50	--	--	--
	12/28/07	<5.0	0.52	<0.50	<0.50	<0.50	--	--	--
	3/28/08	<5.0	4.7	<0.50	<0.50	<0.50	--	--	--
	06/27/08	<5.0	30	<0.50	<0.50	<0.50	--	--	--
	09/22/08	Not Sampled - Unable to collect water with pin bailer							
	12/30/08	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	01/19/09	Not Sampled							
	03/13/09	<5.0	2.1	<0.50	<0.50	<0.50	--	--	--
	06/18/09	<5.0	6.2	<0.50	<0.50	<0.50	--	--	--
	09/24/09	Monitored Only - Sampled Semi-Annually							
	12/16/09	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	03/22/10	Monitored Only - Sampled Semi-Annually							
	06/21/10	<5.0	5.8	<0.50	<0.50	<0.50	--	--	--
	09/28/10	Monitored Only - Sampled Semi-Annually							
	12/21/10	<5.0	1.1	<0.50	<0.50	<0.50	--	--	--
	03/30/11	Monitored Only - Sampled Semi-Annually							
	06/07/11	<5.0	0.97	<0.50	<0.50	<0.50	--	--	--
PZ-5	6/9/06	--	--	--	--	--	--	--	--
	9/5/06	490	2,900	<5.0	<5.0	19	--	--	--
	12/15/06	280	2,600	<5.0	<5.0	17	--	--	--
	3/16/07	Insufficient Water - Not Sampled							
	4/20/07	--	--	--	--	--	--	--	--
	6/15/07	Insufficient Water - Not Sampled							
	09/13/07	Not Sampled							
	12/28/07	Not Sampled							
	03/28/08	Insufficient Water - Not Sampled							
	06/27/08	Insufficient Water - Not Sampled							
	09/22/08	Insufficient Water - Not Sampled							
	12/30/08	Not Sampled							
	01/19/09	Not Sampled							

Table 2
Groundwater Analytical Results - Oxygenate Compounds
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID	DATE	TBA (µg/L)	MTBE (µg/L)	DIPE (µg/L)	ETBE (µg/L)	TAME (µg/L)	1,2-DCA (µg/L)	EDB (µg/L)	ETHANOL (µg/L)
PZ-5 (con't)	03/13/09					Insufficient Water - Not Sampled			
	06/18/09					Insufficient Water - Not Sampled			
	09/24/09					Monitored Only - Sampled Semi-Annually			
	12/16/09					Insufficient Water - Not Sampled			
	03/22/10					Monitored Only - Sampled Semi-Annually			
	06/21/10					Insufficient Water - Not Sampled			
	09/28/10					Monitored Only - Sampled Semi-Annually			
	12/21/10					Insufficient Water - Not Sampled			
	03/30/11					Monitored Only - Sampled Semi-Annually			
	06/07/11					Insufficient Water - Not Sampled			
PZ-6	6/9/06	--	--	--	--	--	--	--	--
	9/5/06	5.9	62	<0.50	<0.50	0.85	--	--	--
	12/15/06	<5.0	2.7	<0.50	<0.50	<0.50	--	--	--
	3/16/07	<5.0	7.4	<0.50	<0.50	<0.50	--	--	--
	4/20/07	--	--	--	--	--	--	--	--
	6/15/07	21	88	<0.50	<0.50	1.6	--	--	--
	09/13/07	10	51	<0.50	<0.50	0.91	--	--	--
	12/28/07	<5.0	33	<0.50	<0.50	0.52	--	--	--
	03/28/08	15	130	<0.50	<0.50	1.9	--	--	--
	06/27/08	<5.0	24	<0.50	<0.50	0.52	--	--	--
	09/22/08	10	63	<0.50	<0.50	0.93	--	--	--
	12/30/08	<5.0	12	<0.50	<0.50	0.93	--	--	--
	01/19/09					Not Sampled			
	03/13/09	<5.0	1.7	<0.50	<0.50	<0.50	--	--	--
	06/18/09	<5.0	5.3	<0.50	<0.50	<0.50	--	--	--
	09/24/09					Monitored Only - Sampled Semi-Annually			
	12/16/09	<5.0	1.0	<0.50	<0.50	<0.50	--	--	--
	03/22/10					Monitored Only - Sampled Semi-Annually			
	06/21/10	<5.0	6.3	<0.50	<0.50	<0.50	--	--	--
	09/28/10					Monitored Only - Sampled Semi-Annually			
	12/21/10	<5.0	3.6	<0.50	<0.50	<0.50	--	--	--
	03/30/11					Monitored Only - Sampled Semi-Annually			
	06/07/11	<5.0	1.6	<0.50	<0.50	<0.50	--	--	--

Table 2
Groundwater Analytical Results - Oxygenate Compounds
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID	DATE	TBA (µg/L)	MTBE (µg/L)	DIPE (µg/L)	ETBE (µg/L)	TAME (µg/L)	1,2-DCA (µg/L)	EDB (µg/L)	ETHANOL (µg/L)
PZ-7	6/9/06	--	--	--	--	--	--	--	--
	9/5/06	<5.0	1.4	<0.50	<0.50	<0.50	--	--	--
	12/15/06	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	03/16/07	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	04/20/07	--	--	--	--	--	--	--	--
	06/15/07	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	09/13/07	<5.0	0.68	<0.50	<0.50	<0.50	--	--	--
	12/28/07	<5.0	0.85	<0.50	<0.50	<0.50	--	--	--
	03/28/08	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	06/27/08	<5.0	0.59	<0.50	<0.50	<0.50	--	--	--
	09/22/08	<5.0	0.93	<0.50	<0.50	<0.50	--	--	--
	12/30/08	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	01/19/09				Not Sampled				
	03/13/09	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	06/18/09	<5.0	0.94	<0.50	<0.50	<0.50	--	--	--
	09/24/09				Monitored Only - Sampled Semi-Annually				
	12/16/09	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	03/22/10				Monitored Only - Sampled Semi-Annually				
	06/21/10	<5.0	0.50	<0.50	<0.50	<0.50	--	--	--
	09/28/10				Monitored Only - Sampled Semi-Annually				
	12/21/10	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	03/30/11				Monitored Only - Sampled Semi-Annually				
	06/07/11	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
QA	12/28/07	<5.0	<0.50	<0.50	<0.50	<0.50	--	--	--
	03/28/08	--	<0.50	--	--	--	--	--	--
	06/27/08	--	<0.50	--	--	--	--	--	--
	09/22/08	--	<0.50	--	--	--	--	--	--
	12/30/08	--	<0.50	--	--	--	--	--	--
	03/13/09	--	<0.50	--	--	--	--	--	--
	06/18/09	--	<0.50	--	--	--	--	--	--
	12/16/09	--	<0.50	--	--	--	--	--	--
	03/22/10	--	<0.50	--	--	--	--	--	--
	06/21/10	--	<0.50	--	--	--	--	--	--

Table 2
Groundwater Analytical Results - Oxygenate Compounds
 Can-Am Plumbing
 151 Wyoming Street
 Pleasanton, California

WELL ID	DATE	TBA (µg/L)	MTBE (µg/L)	DIPE (µg/L)	ETBE (µg/L)	TAME (µg/L)	1,2-DCA (µg/L)	EDB (µg/L)	ETHANOL (µg/L)
QA	09/28/10	--	<0.50	--	--	--	--	--	--
(cont)	03/30/11	--	<0.50	--	--	--	--	--	--
	06/07/11	--	<0.50	--	--	--	--	--	--

Table 2
Groundwater Analytical Results - Oxygenate Compounds
Can-Am Plumbing
151 Wyoming Street
Pleasanton, California

EXPLANATIONS:

TBA = t-Butyl alcohol
MTBE = Methyl Tertiary Butyl Ether
DIPE = di-Isopropyl ether
ETBE = Ethyl t-butyl ether
TAME = t-Amyl methyl ether

1,2-DCA = 1,2-Dichloroethane
EDB = 1,2-Dibromoethane
(µg/L) = Micrograms per liter
--- = Not Analyzed
QA = Trip Blank

ANALYTICAL METHOD:

Oxygenates by EPA Method 8260B
1,2-DCA and EDB by EPA Method 8260B


ANALYTICAL LABORATORY:

Sequoia Analytical CA DHS (ELAP #1271)
Severn Trent Laboratory CA DHS (ELAP #2496)
Kiff Analytical (ELAP #2236)

NOTES:

Tert-Butanol results for samples from MW-1A, MW-2, MW-2A, MW-3, MW-4, and MW-5 may be biased slightly high and are flagged with a "J". A fraction of MTBE (typically less than 1%) converts to Tert-Butanol during the analysis of water samples. The laboratory consider this conversion effect to be mathematically significant in samples that contain MTBE/Tert-Butanol in ratio of over 20:1.

Gettler-Ryan, Inc.		Log of Boring MW-1	
PROJECT: Can-Am Plumbing Inc.		LOCATION: 151 Wyoming Street, Pleasanton, California	
GR PROJECT NO.: 948162.02		CASING ELEVATION:	
DATE STARTED: 01/21/00		WL (ft. bgs): 26	DATE: 01/21/00 TIME: 11:20
DATE FINISHED: 01/21/00		WL (ft. bgs): 30.1	DATE: 01/21/00 TIME: 12:40
DRILLING METHOD: 8 in. Hollow Stem Auger		TOTAL DEPTH: 32 feet	
DRILLING COMPANY: Woodward Drilling		GEOLOGIST: Clyde Galantine	

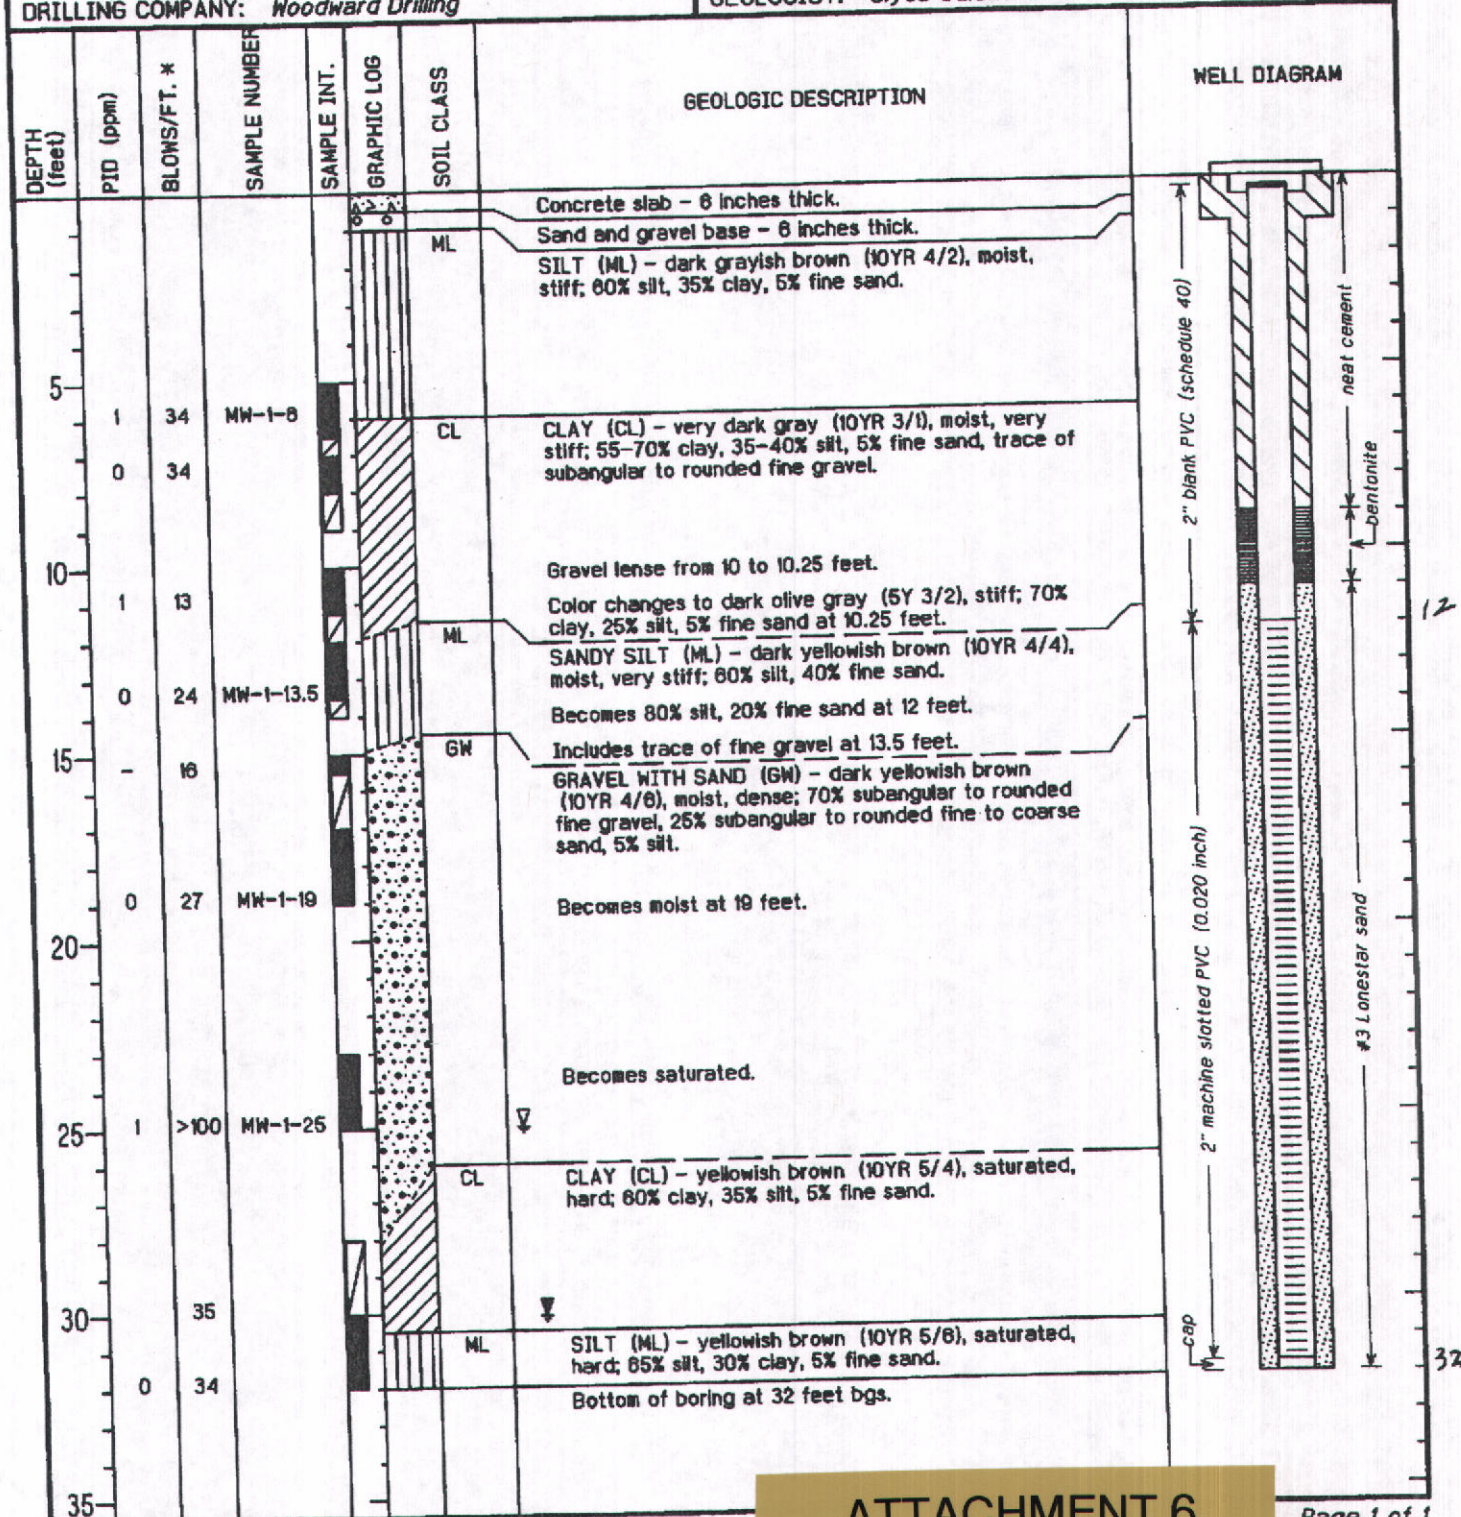

JOB NUMBER: 948162.02

ATTACHMENT 6

Page 1 of 1

Gettler-Ryan, Inc.

Log of Boring MW-2

PROJECT: *Can-Am Plumbing Inc.*

LOCATION: *151 Wyoming Street, Pleasanton, California*

GR PROJECT NO.: *948162.02*

CASING ELEVATION:

DATE STARTED: *01/21/00*

WL (ft. bgs): DATE: TIME:

DATE FINISHED: *01/21/00*


WL (ft. bgs): DATE: TIME:

DRILLING METHOD: *8 in. Hollow Stem Auger*

TOTAL DEPTH: *32 feet*

DRILLING COMPANY: *Woodward Drilling*

GEOLOGIST: *Clyde Galantine*

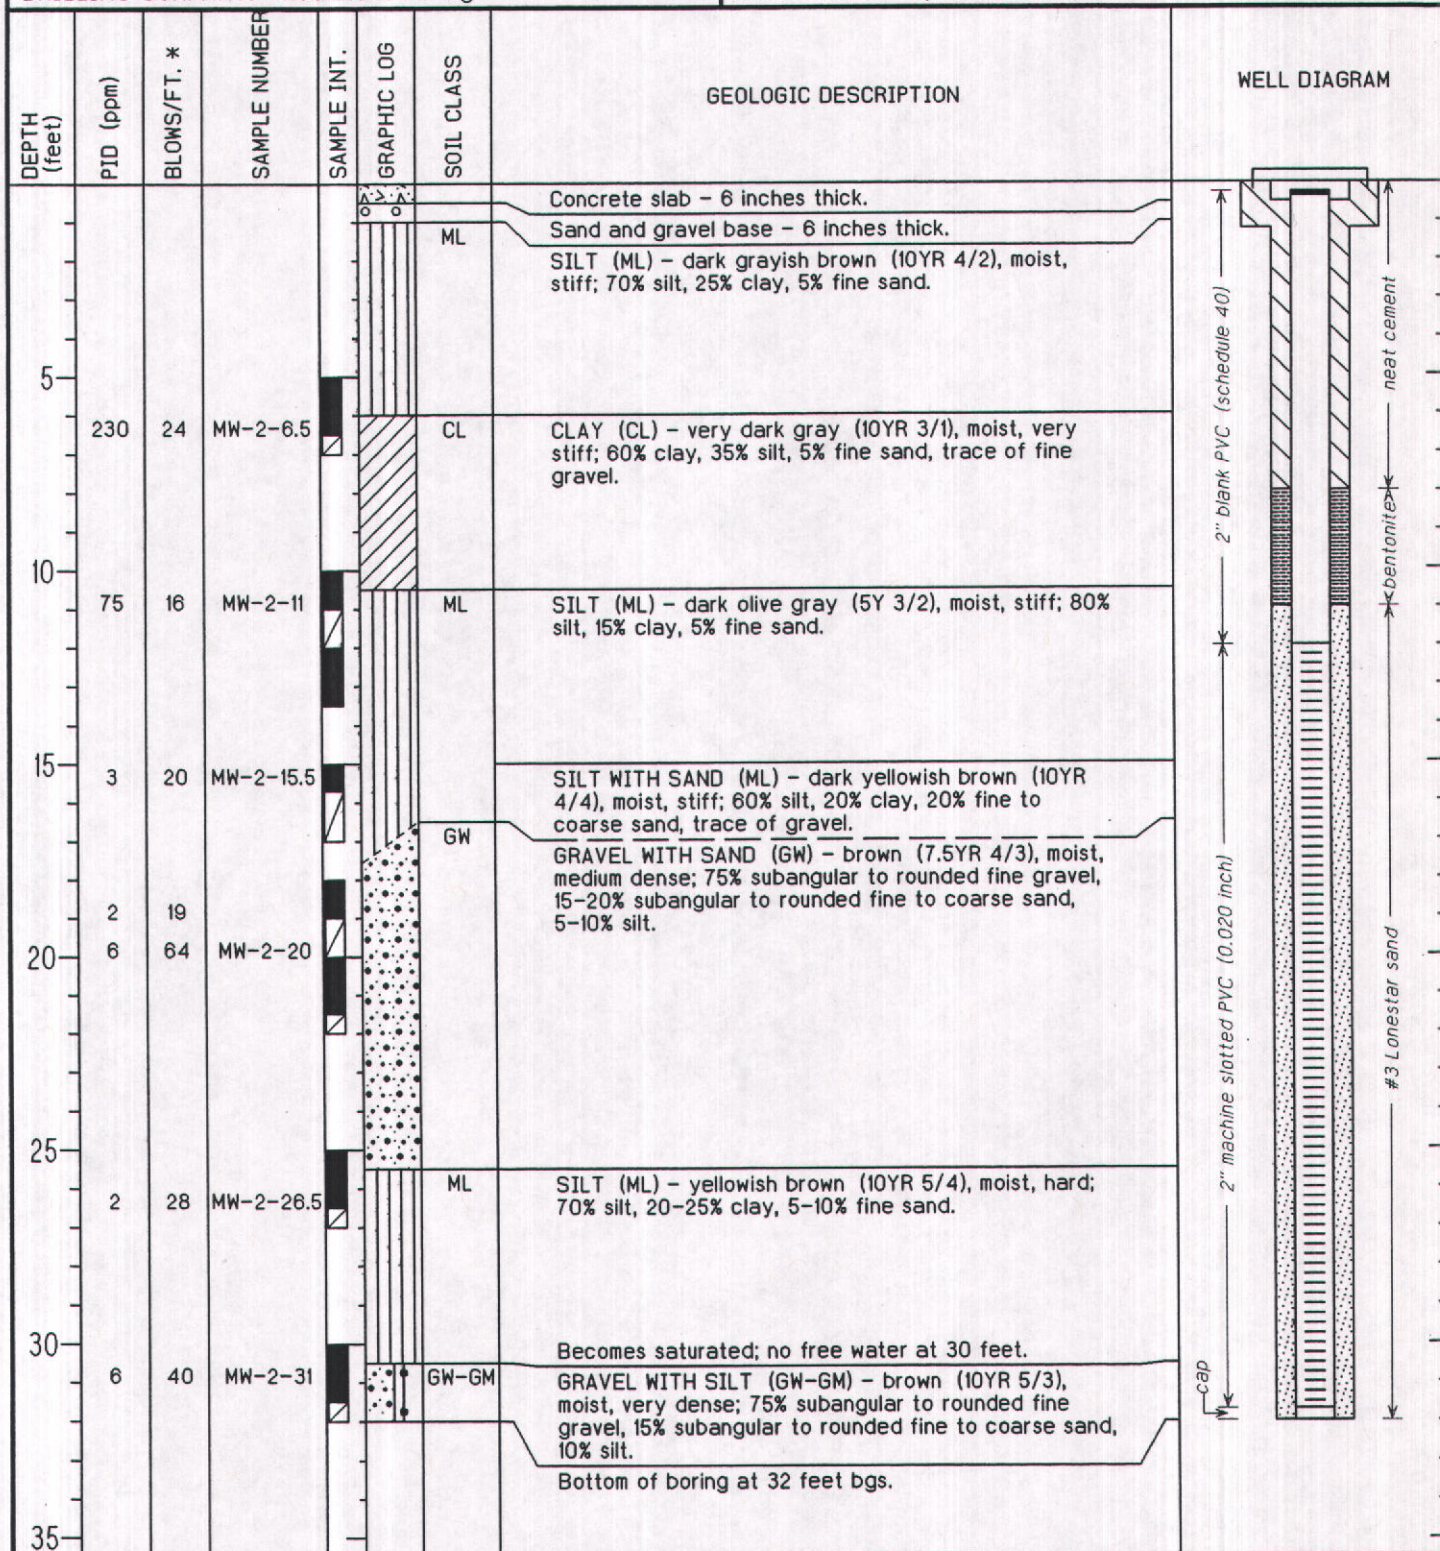

JOB NUMBER: *948162.02*

Page 1 of 1

Gettler-Ryan, Inc.

Log of Boring MW-3

PROJECT: *Can-Am Plumbing*

LOCATION: *Wyoming Street, Pleasanton, California*

GR PROJECT NO.: *948162.3*

CASING ELEVATION:

DATE STARTED: *11/01/02*

WL (ft. bgs): DATE: TIME:

DATE FINISHED: *11/01/02*







WL (ft. bgs): DATE: TIME:

DRILLING METHOD: *8 in. Hollow Stem Auger*

TOTAL DEPTH: *42 feet*

DRILLING COMPANY: *Woodward Drilling*

GEOLOGIST: *Doug Lee*

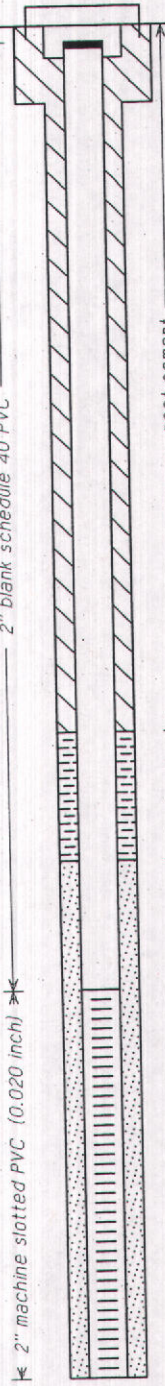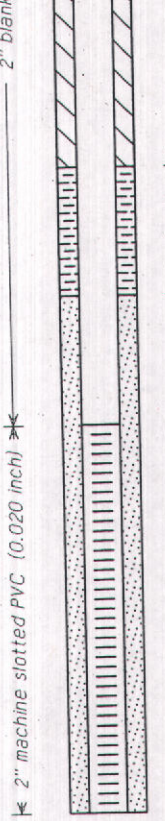DEPTH (feet)	PID (ppm)	BLOWS/FT. *	SAMPLE NUMBER	SAMPLE INT.	GRAPHIC LOG	SOIL CLASS	GEOLOGIC DESCRIPTION	WELL DIAGRAM
							Concrete slab over sand and gravel base.	 2" blank schedule 40 PVC neat cement bentonite #3 Lonestar sand 2" machine slotted PVC (0.020 inch)
3						ML	SILT WITH CLAY (ML) - very dark grayish brown (10YR 3/2), moist, stiff; 75% silt, 20% clay, 5-10% sand, 5-10% gravel (fill and disturbed native soil).	
6	0	13						
9							SANDY SILT (ML) - dark bluish gray (5B 4/1), moist, stiff; 60% silt, 35% sand, 5% clay.	
12	0	19				CL	SILTY CLAY (CL) - dark bluish gray (5B 4/1), moist, very stiff; 60% clay, 40% silt.	
15						SM	SILTY SAND (SM) - dark greenish gray (10BG 4/1) mottled with dark olive brown (2.5Y 3/3), moist, medium dense; 60% sand, 35% silt, 5% gravel.	 #3 Lonestar sand
18	0	18				GW-GM	WELL-GRADED GRAVEL WITH SILT AND SAND (GW-GM) - dark yellowish brown (10YR 4/6), moist, locally wet in voids, medium dense; 60% gravel, 30% sand, 10% silt.	
21	0	23						

Gettler-Ryan, Inc.





Log of Boring MW-3

PROJECT: Can-Am Plumbing

LOCATION: Wyoming Street, Pleasanton, California

DEPTH (feet)	PID (ppm)	BLOWS/FT. *	SAMPLE NUMBER	SAMPLE INT.	GRAPHIC LOG	SOIL CLASS	GEOLOGIC DESCRIPTION	WELL DIAGRAM
24	0	26	MW-3-23			GW-GM	Becomes very moist to wet at 23 feet bgs.	
	0	39				ML	SANDY SILT (ML) - dark yellowish brown (10YR 4/6), moist, hard; 60% silt, 20% sand, 15% gravel, 5% clay.	
27	0	35					SILT WITH CLAY (ML) - dark yellowish brown (10YR 4/6), moist, hard; 85% silt, 15% clay.	
30	0	29				GM	SILTY GRAVEL WITH SAND (GM) - dark yellowish brown (10YR 4/6), moist, very dense; 65% gravel, 20% sand, 15% silt.	
33	0	>100						
36						GW-GM	WELL-GRADED GRAVEL WITH SILT AND SAND (GW-GM) - dark yellowish brown (10YR 4/6), moist to wet, very dense; 65% gravel, 25% sand, 10% silt.	
39	0	>100	MW-3-39					
	0	18	MW-3-41			ML	SILT (ML) - dark yellowish brown (10YR 4/6), moist, stiff; 85% silt, 15% clay.	
42							Bottom of boring at 42 feet bgs. (* = Converted to equivalent standard penetration blows/foot.)	
45								

Gettler-Ryan, Inc.							Log of Boring B-1		
PROJECT: <i>Can-Am Plumbing</i>							LOCATION: <i>Wyoming Street, Pleasanton, California</i>		
GR PROJECT NO. : <i>948162.3</i>							SURFACE ELEVATION:		
DATE STARTED: <i>09/05/02</i>							WL (ft. bgs):	DATE:	TIME:
DATE FINISHED: <i>10/31/02</i>							WL (ft. bgs):	DATE:	TIME:
DRILLING METHOD: <i>8 in. Hollow Stem Auger - Geoprobe</i>							TOTAL DEPTH: <i>41.5 feet</i>		
DRILLING COMPANY: <i>Fisch/Woodward Drilling</i>							GEOLOGIST: <i>Doug Lee</i>		

DEPTH (feet)	PID (ppm)	BLOWS/FT. *	SAMPLE NUMBER	SAMPLE INT.	GRAPHIC LOG	SOIL CLASS	GEOLOGIC DESCRIPTION	REMARKS
							Concrete pavement over sand and gravel base.	Boring backfilled with neat cement from the bottom to ground surface.
3						ML	SILT WITH CLAY (ML) - very dark grayish brown (10YR 3/2), moist, stiff; 70% silt, 15% clay, 10% sand, 5% gravel.	
6								
9								
12								
15	1.2						SILT (ML) - dark grayish brown (10YR 4/2), moist, very stiff; 70-80% silt, 10-20% clay, 10% sand and very fine gravel to 1/3 inch diameter.	
18						SM	SILTY SAND (SM) - dark grayish brown (10YR 4/2) mottled with olive (5Y 4/4), moist, dense; 75-80% sand, 10-20% silt, trace clay.	
21	1.1		B-1-20.5			GM	SILTY GRAVEL WITH SAND (GM) - brown (10YR 5/3), slightly moist to moist, very dense; 55% gravel, 30% sand, 15% silt.	
21						GW-GM	See description on next sheet.	

Gettler-Ryan, Inc.

Log of Boring B-1

PROJECT: *Can-Am Plumbing*

LOCATION: *Wyoming Street, Pleasanton, California*

DEPTH (feet)	PID (ppm)	BLOWS/FT. *	SAMPLE NUMBER	SAMPLE INT.	GRAPHIC LOG	SOIL CLASS	GEOLOGIC DESCRIPTION	REMARKS
24	1.6		B-1-23.5			GW-GM	WELL-GRADED GRAVEL WITH SILT AND SAND (GW-GM) - dark yellowish brown (10YR 4/4), moist, very dense; 55-60% gravel, 30% sand, 10-15% silt. Becomes very moist to wet at 22.5 feet bgs.	
27	3.1		B-1-27.5			ML	CLAYEY SILT (ML) - dark brown (10YR 3/3), moist, hard; 70% silt, 30% clay.	
30							SANDY SILT (ML) - dark yellowish brown (10YR 4/6), moist, hard; 60% silt, 30% sand, 10% gravel. Gravel increasing with depth, 1.5 inch diameter gravel clasts blocking sampler - geoprobe refusal.	
33	0	26				SM	SILTY SAND (SM) - dark yellowish brown (10YR 4/6), moist, medium dense; 80% sand, 20% silt.	
36	0	29	B-1-35			GW-GM	WELL-GRADED GRAVEL WITH SILT AND SAND (GW-GM) - brown (10YR 4/3), moist, medium dense; 65% gravel to 2 inches diameter. 25% sand, 10% silt.	
39	0	21	B-1-38			ML	CLAYEY SILT (ML) - dark yellowish brown (10YR 4/6), moist, very stiff; 70% silt, 30% clay.	
42	0	18					Bottom of boring at 41.5 feet bgs. (* = Converted to equivalent standard penetration blows/foot.)	
45								

Gettler-Ryan, Inc.**Log of Boring B-2**PROJECT: *Can-Am Plumbing*LOCATION: *Wyoming Street, Pleasanton, California*GR PROJECT NO. : *948162.3*

SURFACE ELEVATION:

DATE STARTED: *10/31/02*

WL (ft. bgs): DATE: TIME:

DATE FINISHED: *10/31/02*

WL (ft. bgs): DATE: TIME:

DRILLING METHOD: *8 in. Hollow Stem Auger - Geoprobe*TOTAL DEPTH: *41.5 feet*DRILLING COMPANY: *Woodward Drilling*GEOLOGIST: *Doug Lee*

DEPTH (feet)	PID (ppm)	BLOWS/FT. *	SAMPLE NUMBER	SAMPLE INT.	GRAPHIC LOG	SOIL CLASS	GEOLOGIC DESCRIPTION	REMARKS
3							Not logged or sampled due to proximity of MW-2.	Boring backfilled with neat cement from the bottom to ground surface.
6								
9								
12								
15								
18								
21								

Gettler-Ryan, Inc.

Log of Boring B-2

PROJECT: *Can-Am Plumbing*


LOCATION: *Wyoming Street, Pleasanton, California*

DEPTH (feet)	PID (ppm)	BLOWS/FT. *	SAMPLE NUMBER	SAMPLE INT.	GRAPHIC LOG	SOIL CLASS	GEOLOGIC DESCRIPTION	REMARKS
20.7		43				GW-GM	WELL-GRADED GRAVEL WITH SILT AND SAND (GW-GM) - dark yellowish brown (10YR 4/6), wet to moist, dense; 60% gravel, 30% sand, 10% silt.	
24								
6.4		38				ML	SILT WITH CLAY (ML) - dark yellowish brown (10YR 4/6), moist, hard; 80% silt, 25% clay.	
27								
						SM	SILTY SAND (SM) - dark yellowish brown (10YR 4/6), moist, dense; 85% fine to coarse sand, 15% silt, trace clay.	
2.9		40						
30						GM	SILTY GRAVEL WITH SAND (GM) - dark yellowish brown (10YR 4/6), moist, very dense; 60% gravel, 25% sand, 15% silt, silty sand lenses. No silty sand lenses at 32 feet bgs.	
2.0		>100						
33								
2.2		53						
36								
4.1		>100	B-2-36					
						ML	CLAYEY SILT (ML) - olive brown (2.5Y 4/3) mottled with dark yellowish brown (10YR 4/6), moist, very stiff; 70% silt, 30% clay.	
10.9		24						
39								
3.8		20	B-2-40.5				SILT (ML) - dark yellowish brown (10YR 4/6), moist, very stiff; 90% silt, 10% clay.	
42							Bottom of boring at 41.5 feet bgs. (* = Converted to equivalent standard penetration blows/foot.)	
45								

JOB NUMBER: 948162.3

Page 2 of 2

Gettler-Ryan, Inc.							Log of Boring B-3	
PROJECT: <i>Can-Am Plumbing</i>							LOCATION: <i>Wyoming Street, Pleasanton, California</i>	
GR PROJECT NO. : <i>948162.3</i>							SURFACE ELEVATION:	
DATE STARTED: <i>10/31/02</i>							WL (ft. bgs):	DATE:
DATE FINISHED: <i>10/31/02</i>							WL (ft. bgs):	DATE:
DRILLING METHOD: <i>8 in. Hollow Stem Auger - Geoprobe</i>							TOTAL DEPTH: <i>40 feet</i>	
DRILLING COMPANY: <i>Woodward Drilling</i>							GEOLOGIST: <i>Doug Lee</i>	

DEPTH (feet)	PID (ppm)	BLOWS/FT. *	SAMPLE NUMBER	SAMPLE INT.	GRAPHIC LOG	SOIL CLASS	GEOLOGIC DESCRIPTION	REMARKS
							Concrete pavement over sand and gravel base.	Boring backfilled with neat cement from the bottom to ground surface.
3						ML	SILT (ML) - very dark grayish brown (10YR 3/2), moist, very stiff; 90% silt, 10% fine sand.	
6	0	28						
9							Color changes to dark greenish gray (5GY 3/1), becomes 95% silt, 5% sand.	
12	0	16				SW-SM	WELL-GRADED SAND WITH SILT AND GRAVEL (SW-SM) - dark olive gray (5Y 3/2), moist, medium dense; 65% sand, 25% gravel, 10% silt.	
15	0	38				GW-GM	WELL-GRADED GRAVEL WITH SILT AND SAND (GW-GM) - olive gray (5Y 4/2) grades to olive brown (2.5Y 4/3), moist, dense; 60-65% gravel, 25% sand, 10-15% silt.	
18								
21	0	40					Color changes to dark yellowish brown (10YR 4/6), becomes 65% gravel, 25% sand, 10% silt.	

Gettler-Ryan, Inc.

Log of Boring B-3

PROJECT: *Can-Am Plumbing*

LOCATION: *Wyoming Street, Pleasanton, California*

DEPTH (feet)	PID (ppm)	BLOWS/FT. *	SAMPLE NUMBER	SAMPLE INT.	GRAPHIC LOG	SOIL CLASS	GEOLOGIC DESCRIPTION	REMARKS
24	0	>100	B-3-23			GW-GM	Becomes very dense.	
27	0	27				ML	SILT WITH CLAY (ML) - dark yellowish brown (10YR 4/6), moist, very stiff; 80% silt, 20% clay.	
30	0	18				SM	SILTY SAND (SM) - dark yellowish brown (10YR 4/6), moist, medium dense; 60% sand, 40% silt.	
33	0	22	B-3-35			SW-SM	WELL-GRADED SAND WITH SILT (SW-SM) - dark yellowish brown (10YR 4/6), very moist, medium dense; 90% sand, 10% silt, silty sand lenses.	
36	0	25	B-3-39			ML	SILT (ML) - olive brown (2.5Y 4/3) mottled with dark yellowish brown (10YR 4/6), very stiff; 85-90% silt, 10-15% clay.	
39							Bottom of boring at 40 feet bgs.	
42							(* = Converted to equivalent standard penetration blows/foot.)	
45								



Gettler - Ryan Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of MW-1A

DATE STARTED: 05-09-06

PROJECT NUMBER: 948162.5

DATE COMPLETED: 05-09-06

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: 25 feet DATE: 05-09-06 TIME: 11:55

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 50 feet TOC Elevation: 355.40

DRILLING METHOD: Hollow Stem Auger - 8"

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD: 2" Split Spoon Sampler

DRILLER: Gregg Drilling

DEPTH (ft. bgl)	BLOWS / 12 ft	PDI (ppm)	SAMPLE NO.	RECOVERY	GRAPHIC LOG	U.S.C.S.	GEOLOGIC DESCRIPTION	WELL DIAGRAM
								Concrete Vault
							6" Thick Concrete	
5	17	0	MW1A-5			ML	SILT (ML), dark brown (7.5YR 3/2), dry, very stiff, 90% silt, 10% fine sand	
10	18	0	MW1A-10			ML	color changes to grayish brown (10YR 5/2) becomes moist	
15	20	0	MW1A-15			ML	same as above	
20	22	0	MW1A-20			ML	SILT with SAND (ML), brown (7.5YR 4/2), moist, very stiff, 80% silt, 20% fine sand	
25	44	0	MW1A-25			GP	Poorly graded GRAVEL with SAND (GP), brown (7.5YR 4/2), saturated, dense, 75% fine gravel, 20% medium sand, 5% silt	
30	34	0	MW1A-30			ML	SILT (ML), light brown (7.5YR 6/3), moist, hard, 90% silt, 10% fine sand	
35	34	0	MW1A-35			SP	Poorly graded SAND with SILT (SP), brown (10YR 4/3), saturated, dense, 75% medium sand, 20% silt, 5% fine gravel	
								2" PVC (Sch. 40) Blank Casing
								neat cement



Gettler - Ryan Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of MW-1A

DATE STARTED: 05-09-06

PROJECT NUMBER: 948162.5

DATE COMPLETED: 05-09-06

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: 25 feet DATE: 05-09-06 TIME: 11:55

LOCATION: 151 Wyoming St., Pleasanton, CA


TOTAL DEPTH: 50 feet TOC Elevation: 355.40

DRILLING METHOD: Hollow Stem Auger - 8"

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD: 2" Split Spoon Sampler

DRILLER: Gregg Drilling

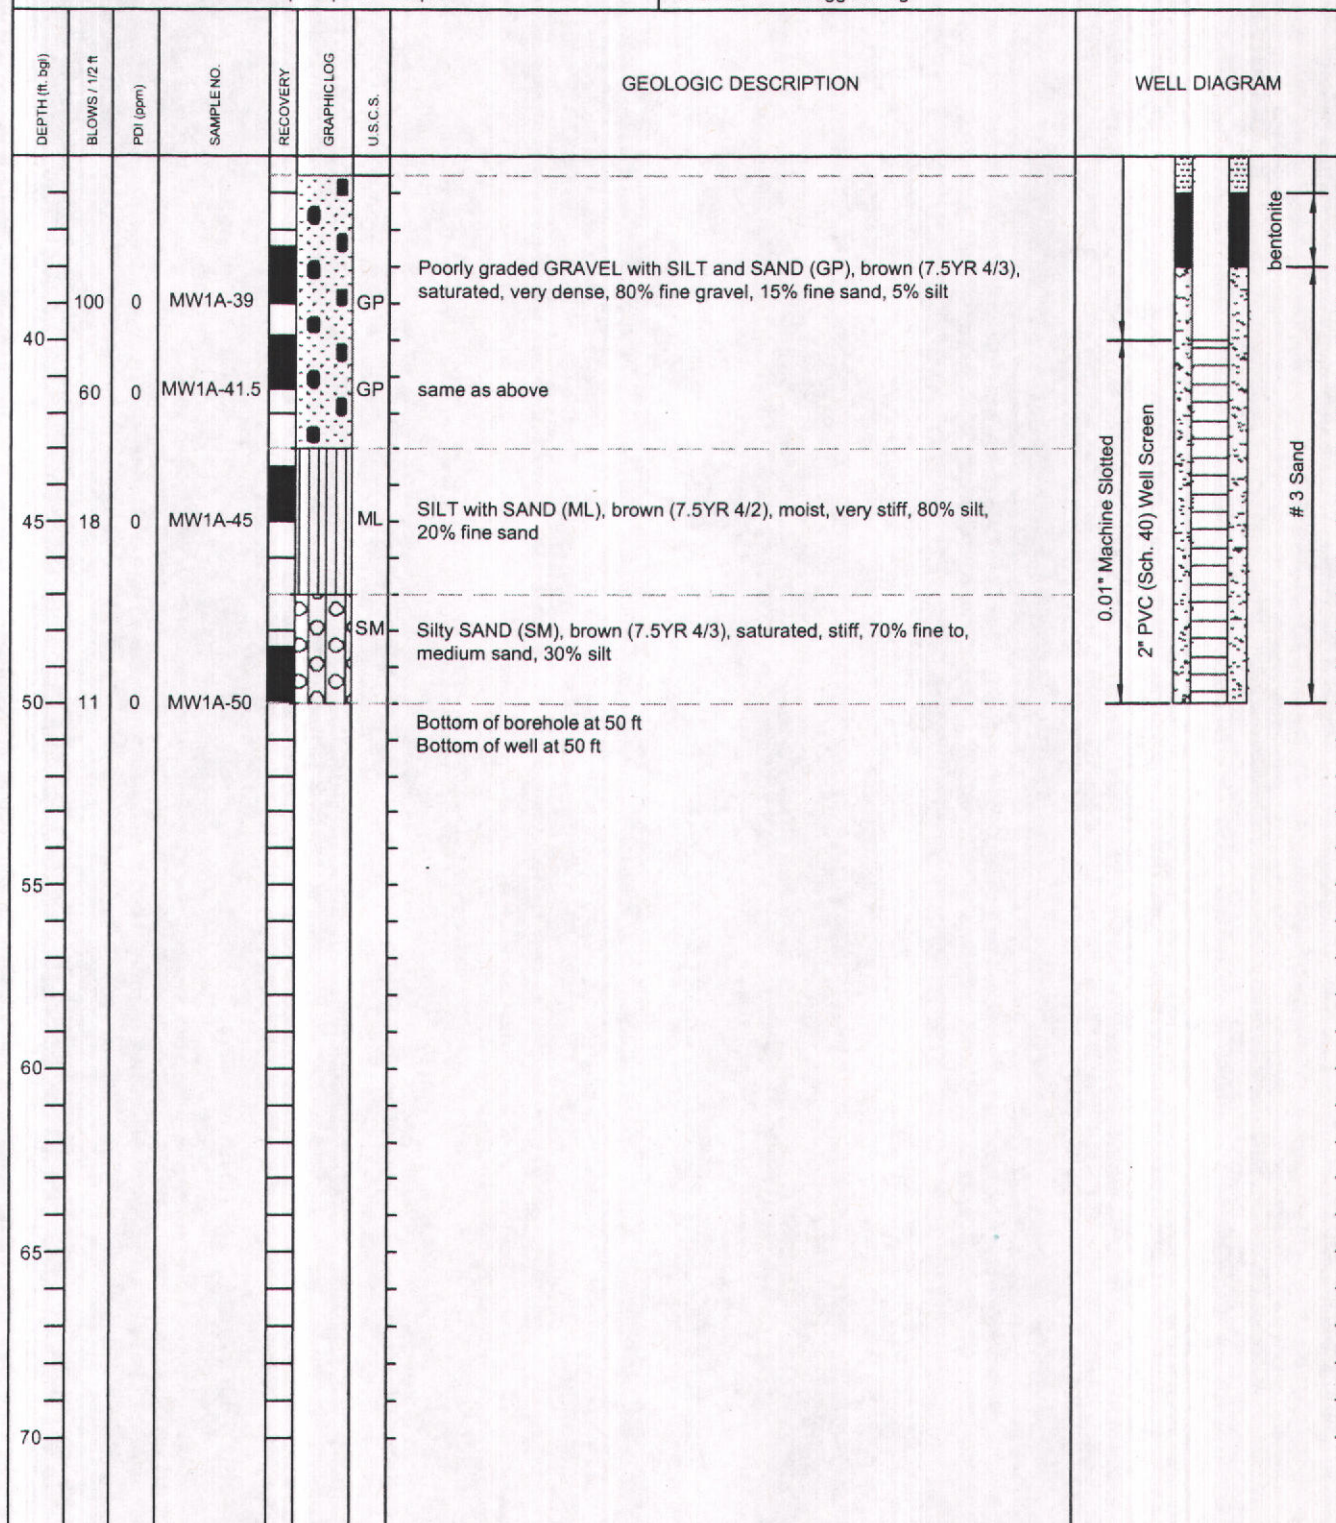



Gettler - Ryan Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of MW-2A

DATE STARTED: 05-09-06

PROJECT NUMBER: 948162.5

DATE COMPLETED: 05-09-06

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: 25 feet DATE: 05-09-06 TIME: 08:05

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 50 feet TOC Elevation: 354.43

DRILLING METHOD: Hollow Stem Auger - 8"

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD: 2" Split Spoon Sampler

DRILLER: Gregg Drilling

DEPTH (ft. bgl)	BLOWS / 12 ft	PDI (ppm)	SAMPLE NO.	RECOVERY	GRAPHIC LOG	U.S.C.S.	GEOLOGIC DESCRIPTION	WELL DIAGRAM
							6" Thick Concrete	Concrete Vault
5	21	0	MW2A-5			ML	SILT (ML), dark brown (7.5YR 3/2), dry, very stiff, 90% silt, 10% fine sand	
10	18	0	MW2A-10			ML	SILT with SAND (ML), dark brown (7.5YR 3/3), moist, very stiff, 80% silt, 20% fine sand	
15	23	0	MW2A-15			ML	SILT with SAND (ML), brown (7.5YR 4/2), moist, very stiff, 85% silt, 15% fine sand	
20	58	0	MW2A-20			SM	Silty SAND (SM), light brown (7.5YR 6/3), moist, very dense, 80% fine to medium sand, 20% silt, trace gravel	
25	100	0	MW2A-25			SP	Poorly graded SAND (SP), brown (7.5YR 4/2), saturated, very dense, 70% medium sand, 25% fine gravel, 5% silt	
30	28	0	MW2A-30			ML	SILT with SAND (ML), brown (7.5YR 4/3), saturated, very stiff, 80% silt, 20% fine sand	
35	43	0	MW2A-35			GM	Silty GRAVEL (GM), brown (7.5YR 4/2), saturated, dense, 80% fine gravel, 15% silt, 5% medium sand	

2" PVC (Sch. 40) Blank Casing

neat cement



Gettler - Ryan Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE (925) 551-7555
FAX: (925) 551-7888

Log of MW-2A

DATE STARTED: 05-09-06

PROJECT NUMBER: 948162.5

DATE COMPLETED: 05-09-06

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: 25 feet DATE: 05-09-06 TIME: 08:05

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 50 feet TOC Elevation: 354.43

DRILLING METHOD: Hollow Stem Auger - 8"

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD: 2" Split Spoon Sampler

DRILLER: Gregg Drilling

DEPTH (ft. bgl)	BLOWS / 12 ft	PD (ppm)	SAMPLE NO.	RECOVERY	GRAPHIC LOG	U.S.C.S.	GEOLOGIC DESCRIPTION	WELL DIAGRAM
						GM	becomes very dense	
100	0		MW2A-38.5			ML	SILT with SAND (ML), brown (7.5YR 4/3), moist, hard, 85% silt, 15% fine sand	
40	55	0	MW2A-40					
						SM	Silty SAND (SM), brown (7.5YR 4/2), saturated, medium dense, 80% medium sand, 20% silt	
12	0		MW2A-42.5					
45	14	0	MW2A-45			SM	same as above	
						SM	same as above	
50	14	0	MW2A-50				Bottom of borehole at 50 ft Bottom of well at 50 ft	
55								
60								
65								
70								



Gettler - Ryan Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of MW-3A

DATE STARTED: 05-08-06

PROJECT NUMBER: 948162.5

DATE COMPLETED: 05-08-06

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: 25 feet DATE: 05-08-06 TIME: 09:22

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 55 feet TOC Elevation: 354.52

DRILLING METHOD: Hollow Stem Auger - 8"

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD: 2" Split Spoon Sampler

DRILLER: Gregg Drilling

DEPTH (ft. bgl)	BLOWS / 1/2 ft	PDI (ppm)	SAMPLE NO	RECOVERY	GRAPHIC LOG	U.S.C.S.	GEOLOGIC DESCRIPTION	WELL DIAGRAM
							6" Thick Concrete	Concrete Vault
5	12	0	MW3A-5			ML	SILT (ML), dark brown (7.5YR 3/2), moist, stiff, 90% silt, 10% fine sand	
10	13	0	MW3A-10			ML	color changes to brown (7.5YR 4/3)	
15	15	0	MW3A-15			ML	same as above	
20	22	0	MW3A-20			ML	SILT with SAND (ML), reddish brown (7.5YR 4/3), moist, very stiff, 60% silt, 40% fine sand, trace gravel	
25	44	0	MW3A-25			SM	Silty SAND (SM), brown (7.5YR 4/3), saturated, dense, 85% medium sand, 15% silt, trace gravel	
30	22	0	MW3A-30			ML	SILT with SAND (ML), brown (7.5YR 4/2), moist, very stiff, 80% silt, 20% fine sand	
35	33	0	MW3A-35			ML	color changes to light brown (7.5YR 6/3), becomes hard	

2" PVC (Sch. 40) Blank Casing

neat cement



Gettler - Ryan Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of MW-3A

DATE STARTED: 05-08-06

PROJECT NUMBER: 948162.5

DATE COMPLETED: 05-08-06

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: 25 feet DATE: 05-08-06 TIME: 09:22

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 50 feet TOC Elevation: 354.52

DRILLING METHOD: Hollow Stem Auger - 8"

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD: 2" Split Spoon Sampler

DRILLER: Gregg Drilling

DEPTH (ft. bgl)	BLOWS / 1/2 ft	PDI (ppm)	SAMPLE NO.	RECOVERY	GRAPHIC LOG	U.S.C.S.	GEOLOGIC DESCRIPTION	WELL DIAGRAM
40	10	0	MW3A-40			ML	SILT with SAND (ML), brown (7.5YR 4/3), moist, stiff, 70% silt, 30% fine sand	0.01" Machine Slotted 2" PVC (Sch. 40) Well Screen # 3 Sand bentonite bentonite
45	16	0	MW3A-45			ML	becomes very stiff	
50	16	0	MW3A-50			ML	same as above	
55	18	0	MW3A-55			ML	same as above Bottom of borehole at 50 ft Bottom of well at 50 ft	
60								
65								
70								



Gettler - Ryan Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of MW-4

DATE STARTED: 04-10-07

PROJECT NUMBER: 948162.6

DATE COMPLETED: 04-11-07

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: 33.69 feet DATE: 04-12-07 TIME: 07:40

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 53.5 feet TOC Elevation: 354.81

DRILLING METHOD: Hollow Stem Auger - 8"

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD: 2" Split Spoon Sampler

DRILLER: Gregg Drilling

DEPTH (ft. bgl)	BLOWS / 12 ft	PID (ppm)	SAMPLE NO.	RECOVERY	GRAPHIC LOG	U.S.C.S.	GEOLOGIC DESCRIPTION	WELL DIAGRAM
							6" Thick Concrete	Concrete Vault
5	18	0	MW4-5.5			ML	SILT (ML), dark brown (7.5YR 3/2), dry, very stiff, 85% silt, 15% fine sand	
10	16	0	MW4-10.5			ML	SILT (ML), dark brown (2.5YR 4/1), moist, stiff to very stiff, 80%-85% silt, 15%-20% fine sand	
15	14	0	MW4-15.5			ML	SILT (ML), reddish brown (5YR 4/4), moist, stiff, 80%-90% silt, 10% to 20% fine sand to medium sand	
20	18	0	MW4-20.5			ML	SILT (ML), reddish brown (5YR 4/4), moist, very stiff, 75%-80% silt, 20%-25% silt, 40% fine to medium sand	
25	50	0	MW4-25.5			GW	Well graded gravel (GW) dark brown (7.5YR 4/3), saturated, very dense, 60%-65% gravel (0.5" Dia.), 20%-25% sand, 5%-10% silt	
30	26	0	MW4-29.5			ML	SILT (ML), dark brown (7.5YR 4/3), moist, very stiff, 70%-75% silt, 25%-30% fine sand	
29						ML	SILT (ML), same as above	
35	27	0	MW4-35.5			ML	SILT (ML), same as above	

2" PVC (Sch. 40) Blank Casing

neat cement



Gettler - Ryan Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of MW-4

DATE STARTED: 04-10-07

PROJECT NUMBER: 948162.6

DATE COMPLETED: 04-11-07

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: 33.69 feet DATE: 04-12-07 TIME: 07:40

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 53.5 feet TOC Elevation: 354.81

DRILLING METHOD: Hollow Stem Auger - 8"

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD: 2" Split Spoon Sampler

DRILLER: Gregg Drilling

DEPTH (ft. bgl)	BLOWS / 1/2 ft	PID (ppm)	SAMPLE NO.	RECOVERY	GRAPHIC LOG	U.S.C.S.	GEOLOGIC DESCRIPTION	WELL DIAGRAM
34						ML	SILT (ML), same as above	
						SM	Silty sand (SM), brown (7.5YR 5/3), dense to very dense, saturated, 65%-75% medium to coarse sand, 15%-20% silt, 10%-15% gravel (1"Ø)	
<50						GW	Well graded gravel (GW) dark brown (7.5YR 3/2), dense to very hard, saturated, 70%-85% gravel (1/4"Ø), 10%-20% fine to medium sand, 5%-10% silt	
46			MW4-39.5			ML	SILT (ML) dark brown (7.5YR 3/3), saturated, very stiff, 80%-90% silt, 10%-20% medium sand	
40		0				ML	SILT (ML) dark brown (7.5YR 3/3), saturated, very stiff, 80%-90% silt, 10%-20% medium sand	
28						ML	SILT (ML) dark brown (7.5YR 3/3), saturated, very stiff, 70%-80% silt, 20%-30% medium sand	
23			MW4-44.5			SM	Silty sand (SM) dark brown (7.5YR 3/4), medium dense, saturated, 65%-75% medium to coarse sand, 15%-20% silt, 10%-20% gravel (1.5"Ø)	
18						ML	SILT (ML) brown (7.5YR 4/2), stiff, saturated, 75%-80% silt, 20%-25% fine to coarse sand	
15						SW	Well graded sand (SW) brown (7.5YR 5/2), medium dense, saturated, 75%-80% fine to coarse sand, 20%-25% silt	
25			MW4-49.5			ML	SILT (ML) brown (7.5YR 4/2), stiff, saturated, 75%-80% silt, 20%-25% fine to coarse sand	
50		0				SW	Well graded sand (SW) brown (7.5YR 5/2), dense, saturated, 95% medium to coarse sand, 5% silt	
33						SW	Well graded sand (SW) brown (7.5YR 5/2), dense, saturated, trace silt, trace gravel, (1/4"Ø), "clean sand"	
43		0	MW4-53			ML	SILT (ML) dark yellowish (10YR 4/4), hard, saturated, 80%-90% silt, 5%-10% fine to medium sand, localized 5%-10% gravel (0.5"Ø)	
							Bottom of borehole at 53.5 ft Bottom of well at 53.5 ft	



Gettler - Ryan Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of MW-5

DATE STARTED: 04-10-07

PROJECT NUMBER: 948162.6

DATE COMPLETED: 04-11-07

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: 40.47 feet DATE: 04-12-07 TIME: 08:07

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 52 feet TOC Elevation: 356.64

DRILLING METHOD: Hollow Stem Auger - 8"

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD: 2" Split Spoon Sampler

DRILLER: Gregg Drilling

DEPTH (ft. bgl)	BLOWS / 1/2 ft	PID (ppm)	SAMPLE NO.	RECOVERY	GRAPHIC LOG	U.S.C.S.	GEOLOGIC DESCRIPTION	WELL DIAGRAM
								Concrete Vault
							6" Top Soil	
5		0	MW5-5.5			ML	SILT (ML), dark greyish brown (10YR 4/2), stiff, moist, 90% silt, 10% fine to medium sand	
10		0	MW5-9.5			ML	SILT (ML), dark greenish grey (5GYR 3/1), stiff, moist, 90% silt, 10% fine sand	
15		0	MW5-15			ML	SILT (ML), same as above except color changes to greyish brown, (10YR 4/2)	
20		0	MW5-20.5			ML	SILT (ML), dark brown (7.5YR 3/2), soft, moist, 80%-85% silt, 15%-20% fine sand	
25		0	MW5-25.5			SW	Well graded sand (SW) dark brown (7.5YR 3/2), saturated, medium dense, 65%-75% medium to coarse sand, 15% to 20% gravel (0.5"Ø), 10%-15% silt	
30		0	MW5-30.0			ML	SILT (ML), yellowish brown (10YR 5/4), saturated, very stiff to hard, 85%-90% silt, 10%-15% fine sand	
35		0	MW5-35.0			GP	Poorly graded gravel (GP), yellowish brown (10YR 5/6), saturated, medium dense to dense, 80% gravel (0.5"Ø), 10% silt, 10% sand	

2" PVC (Sch. 40) Blank Casing

neat cement



Gettler - Ryan Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of MW-5

DATE STARTED: 04-10-07

PROJECT NUMBER: 948162.6

DATE COMPLETED: 04-11-07

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: 40.47 feet DATE: 04-12-07 TIME: 08:07

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 52 feet TOC Elevation: 356.64

DRILLING METHOD: Hollow Stem Auger - 8"

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD: 2" Split Spoon Sampler

DRILLER: Gregg Drilling

DEPTH (ft. bgl)	BLOWS / 1/2 ft	PID (ppm)	SAMPLE NO.	RECOVERY	GRAPHIC LOG	U.S.C.S.	GEOLOGIC DESCRIPTION	WELL DIAGRAM
						GP	Poorly graded gravel (GP) same as above except loose to med dense	
						GW	Well graded gravel (GW), yellowish brown (10YR 5/4), moist, medium dense to dense, 85% gravel (0.5"Ø), 10% fine sand, 5% clay	
						GW	Well graded gravel (GW), yellowish brown (10YR 5/4), saturated, medium dense, 90%-95% gravel, 5%-10% fine sand	
40	0		MW5-40			GM		
						ML	Silt (ML) dark yellowish brown (10YR 4/4), moist, stiff to medium stiff, 85%-90% silt, 10%-15% clay	
45	0		MW5-45.5			ML	Silt (ML) dark yellowish brown (10YR 4/4), moist, stiff to medium stiff, 85%-90% silt, 10%-15% clay	
						SM	Silty sand (SM-ML), dark yellowish brown (10YR 4/6), saturated, medium dense, 70%-80% fine to coarse sand, 20%-30% silt silt-sand mixture	
50	0		MW5-50.5			ML	Silt (ML) dark yellowish brown (10YR 3/4), saturated, soft to medium stiff, 80%-85% silt, 15%-20% fine to coarse sand, traces of clay	
							Bottom of borehole at 52 ft Bottom of well at 52 ft	
55								
60								
65								
70								



Gettler-Ryan, Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
Telephone: (925) 551-7555
Fax: (925) 551-7888

LOG OF MW-6

PAGE 1 OF 2

PROJECT NUMBER 25-948162.8 DATE STARTED 1/13/09
PROJECT NAME Can-Am Plumbing DATE COMPLETED 1/13/09
PROJECT ADDRESS 151 Wyoming St., Pleasanton, CA CASING TYPE/DIAMETER PVC Sch. 40 / 2"
DRILLING METHOD Hollow Stem Auger - 8" SCREEN TYPE/SLOT PVC Sch. 40 / 0.020"
SAMPLING METHOD 2" Split Spoon Sampler GRAVEL PACK TYPE #3 Sand
CASING ELEVATION 354.62 GROUT TYPE/QUANTITY Neat Cement/0'-40' Below Ground Surface
GROUND ELEVATION ---- DEPTH TO WATER -----
LOGGED BY Geoffrey Risse GROUND WATER ELEVATION -----
DRILLER Gregg Drilling and Testing, Inc.

LOG/Well BORINGS - GETTLER-RYAN-MASTER.GDT - 3/6/09 08:31 - Q:\PROJECTS DT 1.23.04\ENVIRONMENTAL-ENVIRONMENTAL-GINT\PROJECTS\CAN-AM PLUMBING.GPJ

PID (ppm)	BLOW COUNTS/6"	RECOVERY (inches)	SAMPLE ID.	EXTENT	DEPTH (ft. BGL)	U.S.C.S.	GRAPHIC LOG	LITHOLOGIC DESCRIPTION	CONTACT DEPTH	WELL DIAGRAM
								3" Asphalt	0.3	
								24" Aggregate Base (gravel)	2.3	
72		12	MW6 (5.5)	5		ML		Silt (ML) - Dark Brown (7.5YR 3/2) moist, soft to medium stiff, 90-95% silt, 5 to 10% fine sand		
20		18	MW6 (11.5)	10		ML		Silt (ML) - Grey (5Y3/1) moist, medium stiff, 90-95% silt, 5-10% fine sand		
1		18	MW6 (16.5)	15		ML		Silt (ML) - Dark Brown (7.5YR3/2) moist, medium stiff, 90-95% silt, 5-10% fine sand		
2		18	MW6 (21.5)	20		ML		Silt (ML) - Dark Brown (7.5YR3/2) moist, medium stiff, 90-95% silt, 5-10% fine sand		Neat cement
3		18	MW6 (26.5)	25		ML		Silt (ML) - Reddish Brown (7.5YR4/3) slightly moist, stiff to very stiff, 90-95% silt, 5-10% gravel (1/4" dia.)		
1		18	MW6 (31.5)	30		ML		Silt (ML) - Reddish Brown (7.5YR4/3) moist, stiff, 85-95% silt, 5-15% fine sand		



Gettler-Ryan, Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
Telephone: (925) 551-7555
Fax: (925) 551-7888

LOG OF MW-6

PAGE 2 OF 2

PROJECT NUMBER 25-948162.8 DATE STARTED 1/13/09
PROJECT NAME Can-Am Plumbing DATE COMPLETED 1/13/09
PROJECT ADDRESS 151 Wyoming St., Pleasanton, CA CASING TYPE/DIAMETER PVC Sch. 40 / 2"
DRILLING METHOD Hollow Stem Auger - 8" SCREEN TYPE/SLOT PVC Sch. 40 / 0.020"
SAMPLING METHOD 2" Split Spoon Sampler GRAVEL PACK TYPE #3 Sand
CASING ELEVATION 354.62 GROUT TYPE/QUANTITY Neat Cement/0'-40' Below Ground Surface
GROUND ELEVATION ---- DEPTH TO WATER -----
LOGGED BY Geoffrey Risse GROUND WATER ELEVATION -----
DRILLER Gregg Drilling and Testing, Inc.

LOGWELL BORINGS - GETTLER-RYAN-MASTER.GDT - 3/5/09 15:09 - C:\PROJECTS DT 1.23.04\ENVIRONMENTAL\ENVIRONMENTAL-GINT\PROJECTS\CAN-AM PLUMBING.GPJ

PID (ppm)	BLOW COUNTS/6"	RECOVERY (inches)	SAMPLE ID.	EXTENT	DEPTH (ft. BGL)	U.S.C.S.	GRAPHIC LOG	LITHOLOGIC DESCRIPTION	CONTACT DEPTH	WELL DIAGRAM
0		18	MW6 (36.5)			ML		Silt with gravel (ML) - Dark Brown (7.5YR3/2) moist, stiff, 80% silt, 15% gravel, 5% sand		
1		18	MW6 (41.5)		40	ML		Silt (ML) - Dark Brown (7.5YR3/2) moist, soft to medium stiff, 95% silt, 5% fine sand		Bentonite
0		18	MW6 (46.5)		45	SM		Silty sand (SM) - Dark Brown (7.5YR3/2) wet, loose 80-90% medium to coarse sand, 10-20% silt, trace of fine gravel	45.0	#3 sand
0		18	MW6 (50)		50	ML		Silt (ML) - Reddish Brown (7.5YR4/3) wet, soft to medium stiff, 90-95% silt, 5-10% fine sand	48.0	PVC Sch. 40/0.020" slot
								Bottom of borehole at 50.0 feet. Bottom of well at 50.0 feet.	50.0	



Gettler-Ryan, Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
Telephone: (925) 551-7555
Fax: (925) 551-7888

LOG OF MW-7

PAGE 1 OF 2

PROJECT NUMBER 25-948162.8 DATE STARTED 1/13/09
PROJECT NAME Can-Am Plumbing DATE COMPLETED 1/13/09
PROJECT ADDRESS 151 Wyoming St., Pleasanton, CA CASING TYPE/DIAMETER PVC Sch. 40 / 2"
DRILLING METHOD Hollow Stem Auger - 8" SCREEN TYPE/SLOT PVC Sch. 40 / 0.020"
SAMPLING METHOD 2" Split Spoon Sampler GRAVEL PACK TYPE #3 Sand
CASING ELEVATION 354.82 GROUT TYPE/QUANTITY Neat Cement/0'-42' Below Ground Surface
GROUND ELEVATION ---- DEPTH TO WATER -----
LOGGED BY Geoffrey Risse GROUND WATER ELEVATION -----
DRILLER Gregg Drilling and Testing, Inc.

PID (ppm)	BLOW COUNTS/6"	RECOVERY (inches)	SAMPLE ID.	EXTENT	DEPTH (ft. BGL)	U.S.C.S.	GRAPHIC LOG	LITHOLOGIC DESCRIPTION	CONTACT DEPTH	WELL DIAGRAM
								3" Asphalt	0.3	
								24" Aggregate Base (gravel)	2.3	
0	18	MW7 (6.5)		5	ML			Silt (ML) - Brown (7.5YR4/2) Dry, stiff, 90-95% silt, 5-10% fine sand		
0	18	MW7 (11.5)		10	ML			Silt (ML) - Grey (5YR3/1) moist, soft to medium stiff, 90-95% silt, 5-10% fine sand		
0	18	MW7 (16.5)		15	ML			Silt (ML) - Greyish Brown (5Y6/2) moist, soft to medium stiff, 80-90% silt, 10-20% fine sand		
5	18	MW7 (21.5)		20	ML			Silt (ML) - Brown (7.5YR4/2) slightly moist, stiff, 80-90% silt, 10-20% sand		
2	18	MW7 (26.5)		25	ML			Silt (ML) - Brown (7.5YR4/2) slightly moist, stiff, 80-90% silt, 10-20% sand		
1	18	MW7 (31.5)		30	ML			Silt (ML) - Brown (7.5YR4/2) slightly moist, stiff, 80-90% silt, 10-20% sand		
									34.5	Neat cement

LOG/WEEL BORINGS - GETTLER-RYAN-MASTER.GDT - 3/5/09 14:44 - Q:\PROJECTS DT 1.23.04\ENVIRONMENTAL\IRONMENTAL-GINTYPROJECTS\CAN-AM PLUMBING.GPJ



Gettler-Ryan, Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
Telephone: (925) 551-7555
Fax: (925) 551-7888

LOG OF MW-7

PAGE 2 OF 2

PROJECT NUMBER 25-948162.8 DATE STARTED 1/13/09
PROJECT NAME Can-Am Plumbing DATE COMPLETED 1/13/09
PROJECT ADDRESS 151 Wyoming St., Pleasanton, CA CASING TYPE/DIAMETER PVC Sch. 40 / 2"
DRILLING METHOD Hollow Stem Auger - 8" SCREEN TYPE/SLOT PVC Sch. 40 / 0.020"
SAMPLING METHOD 2" Split Spoon Sampler GRAVEL PACK TYPE #3 Sand
CASING ELEVATION 354.82 GROUT TYPE/QUANTITY Neat Cement/0'-42' Below Ground Surface
GROUND ELEVATION ---- DEPTH TO WATER -----
LOGGED BY Geoffrey Risse GROUND WATER ELEVATION -----
DRILLER Gregg Drilling and Testing, Inc.

LOGWELL BORINGS - GETTLER-RYAN-MASTER.GDT - 3/5/09 14:44 - Q:\PROJECTS DT 1.23 04\ENVIRONMENTAL\ENVIRONMENTAL-GINT\PROJECTS\CAN-AM PLUMBING.GPJ

PID (ppm)	BLOW COUNTS/6"	RECOVERY (Inches)	SAMPLE ID.	EXTENT	DEPTH (ft. BGL)	U.S.C.S.	GRAPHIC LOG	LITHOLOGIC DESCRIPTION	CONTACT DEPTH	WELL DIAGRAM
0		18	MW7 (36.5)		35	SM		Silty Sand (SM) - Reddish Brown (7.5YR3/2) wet, loose, 70-80% sand, 20-30% silt, trace of gravel (1/4" dia.)		
10		18	MW7 (41.5)		40	ML		Silt (ML) - Greyish Brown (7.5YR5/2) moist, soft to medium stiff, 85-95% silt, 5-15% sand	39.5	
17		18	MW7 (46.5)		45	ML		Silt (ML) - Brown (7.5YR4/2) moist, stiff, 80-95% silt, 5-15% fine sand		Bentonite
5		18	MW7 (49)			SM		Silty Sand (SM) - Reddish Brown, wet, loose, 70-80% medium to coarse sand, 20-30% silt	48.5	#3 sand
3		18	MW7 (51)		50	SM		Silty Sand (SM) - Reddish Brown (7.5YR3/2) moist, loose, 60-70% medium to coarse sand, 30-40% silt	49.5	PVC Sch. 40/0.020" slot
								Bottom of borehole at 51.0 feet. Bottom of well at 51.0 feet.	51.0	



Gettler - Ryan Inc
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE (925) 551-7555
FAX: (925) 551-7888

Log of PZ-1

DATE STARTED: 05-08-06

PROJECT NUMBER: 948162.5

DATE COMPLETED: 05-08-06

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: 5 feet DATE: 05-08-06 TIME: 12:50

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 10 feet TOC Elevation: 354.54

DRILLING METHOD: Hollow Stem Auger - 7"

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD: 2" Split Spoon Sampler

DRILLER: Gregg Drilling

DEPTH (ft. bgl)	BLOWS / 1/2 ft	PD (ppm)	SAMPLE NO	RECOVERY	GRAPHIC LOG	USCS	GEOLOGIC DESCRIPTION	WELL DIAGRAM
								Concrete Vault
							6" Thick Concrete	
							Fill (GRAVEL)	
5						ML		
10	19	0	PZ1-10			ML	SILT (ML), grayish brown (10YR 5/2), saturated, very stiff, 90% silt, 10% fine sand Bottom of borehole at 10 ft Bottom of well at 10 ft	0.01" Machine Slotted 3/4" PVC (Sch. 40) Well Casing 3/4" PVC (Sch. 40) Well Screen neat cement bentonite # 3 Sand
15								
20								
25								
30								
35								



Gettler - Ryan Inc
6747 Sierra Ct. Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of PZ-2

DATE STARTED: 05-08-06

PROJECT NUMBER: 948162 5

DATE COMPLETED: 05-08-06

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: 5 feet DATE: 05-08-06 TIME: 12:30

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 10 feet TOC Elevation: 354.35

DRILLING METHOD: Hollow Stem Auger - 7"

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD: 2" Split Spoon Sampler

DRILLER: Gregg Drilling

DEPTH (# of ft)	BLOWS / 12 ft	PC (ppm)	SAMPLE NO	RECOVERY	GRAPHIC LOG	USCS	GEOLOGIC DESCRIPTION	WELL DIAGRAM
								Concrete Vault
							6" Thick Concrete	
							Fill (GRAVEL)	
5						ML		
10	16	0	PZ2-10			ML	SILT (ML), grey (10YR 5/1), saturated, stiff, 90% silt, 10% fine sand	
							Bottom of borehole at 10 ft	
							Bottom of well at 10 ft	
15								
20								
25								
30								
35								



Gettler - Ryan Inc
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE (925) 551 7555
FAX (925) 551-7888

Log of PZ-3

DATE STARTED: 05-08-06

PROJECT NUMBER: 948162.5

DATE COMPLETED: 05-08-06

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: 5 feet DATE: 05-08-06 TIME: 14:10

LOCATION: 151 Wyoming St., Pleasanton, CA


TOTAL DEPTH: 10 feet TOC Elevation: 354.14

DRILLING METHOD: Hollow Stem Auger - 7"

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD: 2" Split Spoon Sampler

DRILLER: Gregg Drilling

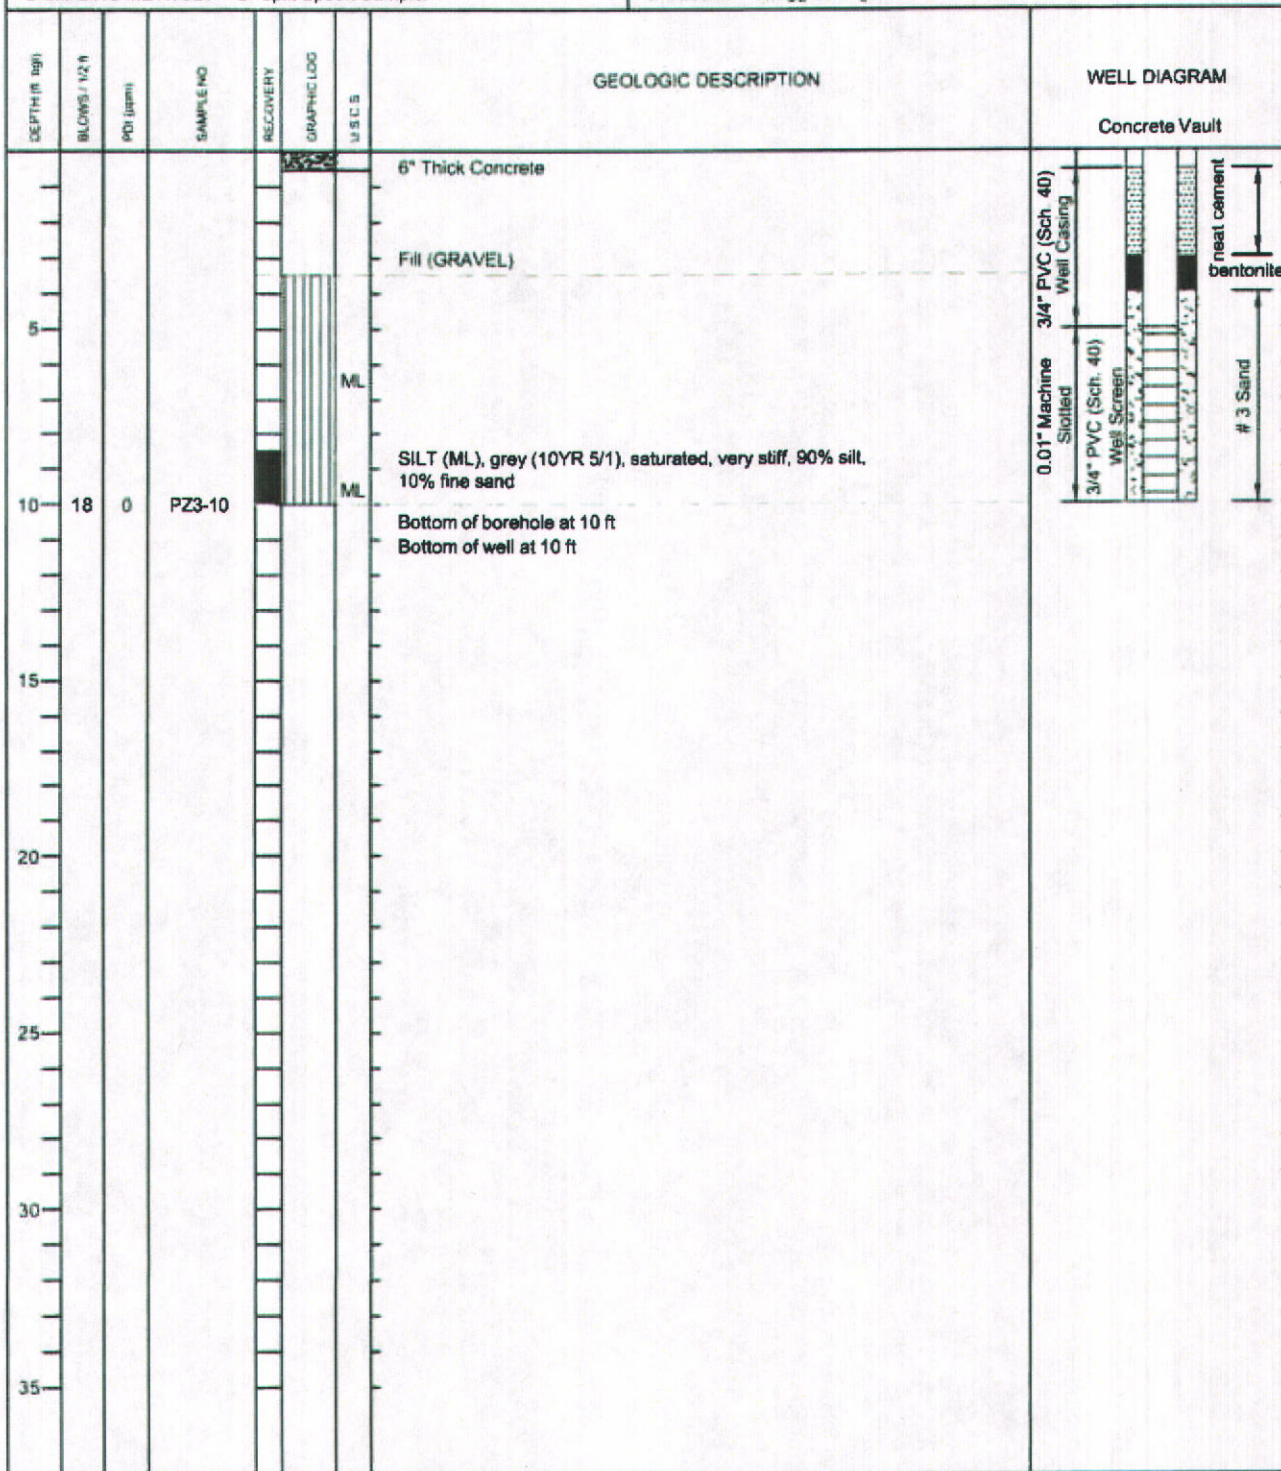



Gettler - Ryan Inc
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of PZ-4

DATE STARTED: 05-08-06

PROJECT NUMBER: 948162 5

DATE COMPLETED: 05-08-06

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: 5 feet DATE: 05-08-06 TIME: 14:50

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 10 feet TOC Elevation: 354.22

DRILLING METHOD: Hollow Stem Auger - 7"

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD: 2" Split Spoon Sampler

DRILLER: Gregg Drilling

DEPTH (ft. bgl)	BLOWS / 12" R	POI (ppm)	SAMPLE NO	RECOVERY	GRAPHIC LOG	USCS	GEOLOGIC DESCRIPTION	WELL DIAGRAM
								Concrete Vault
							6" Thick Concrete	
							Fill (GRAVEL)	
5						ML		
10	13	0	PZ4-10			ML	SILT (ML), grey (10YR 5/1), saturated, stiff, 95% silt, 5% fine sand	
							Bottom of borehole at 10 ft	
							Bottom of well at 10 ft	
15								
20								
25								
30								
35								



Gettler Ryan Inc.
6747 Sierra Ct Suite J
Dublin, CA 94568
TELEPHONE (925) 551-7555
FAX (925) 551-7888

Log of PZ-5

DATE STARTED: 05-08-06

PROJECT NUMBER: 948162 5

DATE COMPLETED: 05-08-06

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: 5 feet DATE: 05-10-06 TIME: 07:10

LOCATION: 151 Wyoming St., Pleasanton, CA


TOTAL DEPTH: 10 feet TOC Elevation: 354.95

DRILLING METHOD: Hollow Stem Auger - 7"

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD: 2" Split Spoon Sampler (Direct Push)

DRILLER: Gregg Drilling

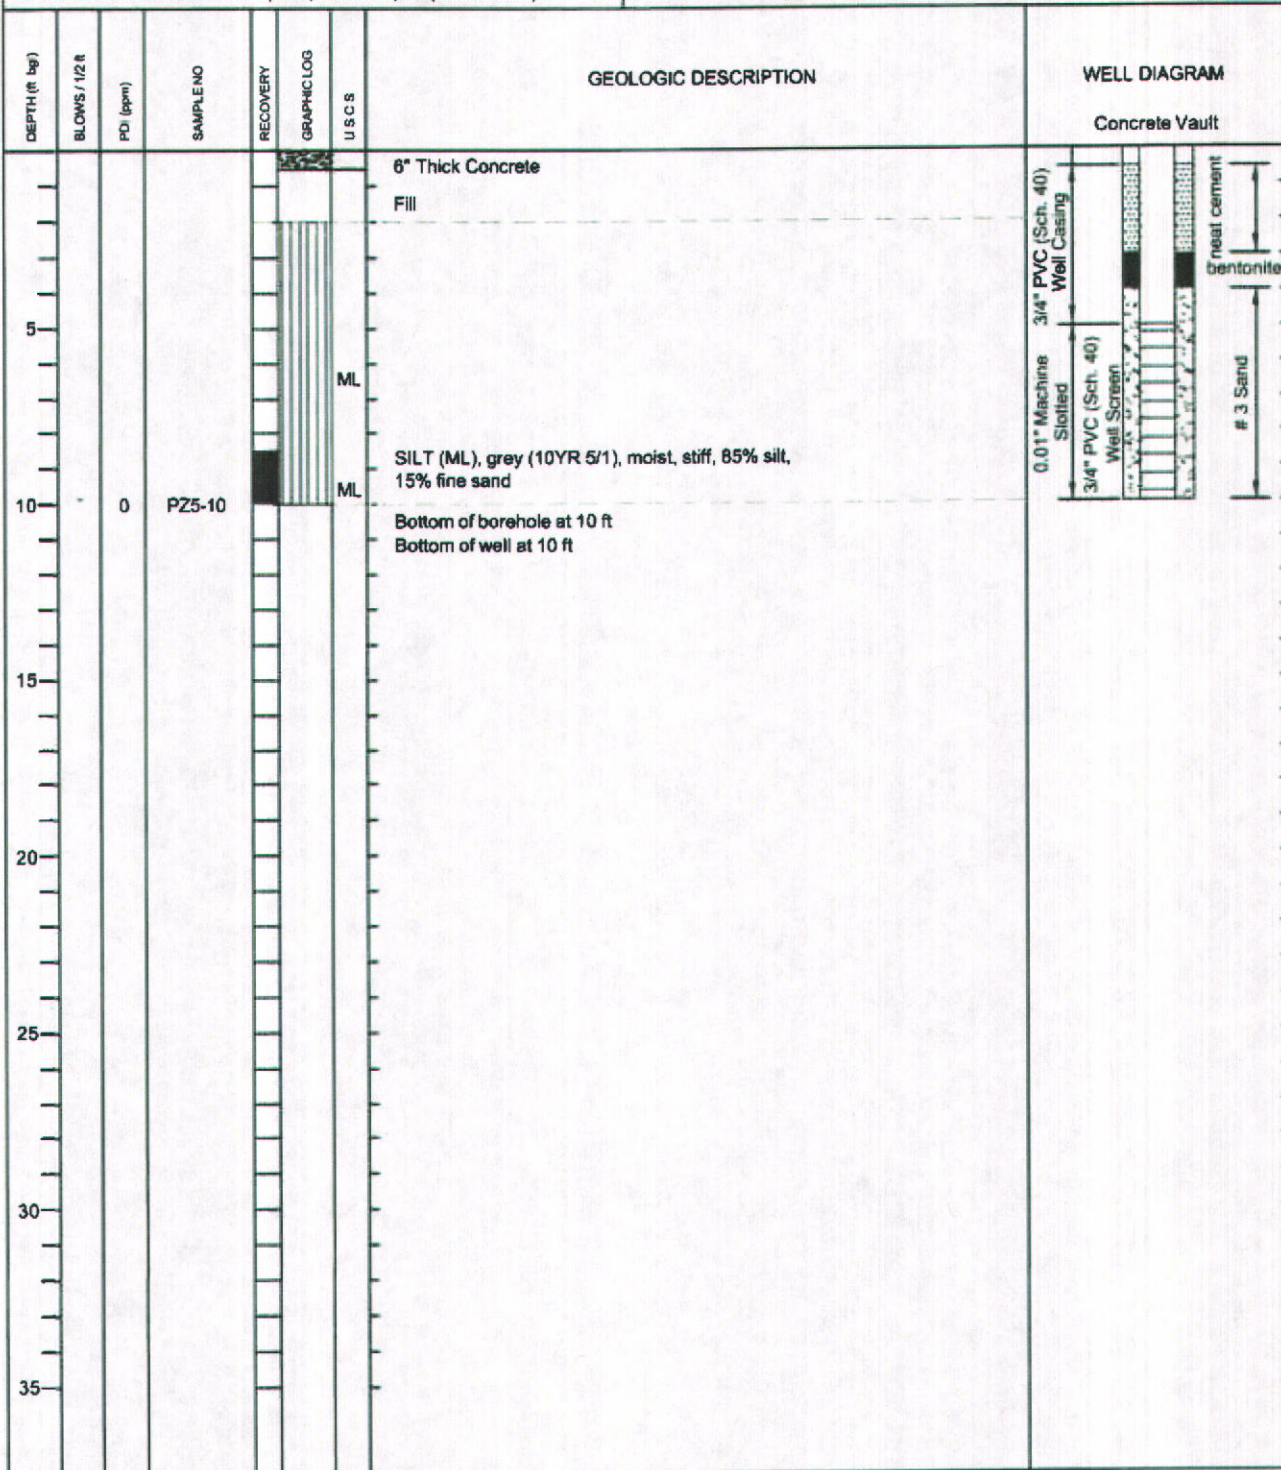



Gettler - Ryan Inc.
6747 Sierra Ct. Suite J
Dublin, CA 94568
TELEPHONE (925) 551 7555
FAX (925) 551-7888

Log of PZ-6

DATE STARTED: 05-08-06

PROJECT NUMBER: 948162 5

DATE COMPLETED: 05-08-06

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: 5 feet DATE: 05-10-06 TIME: 07:50

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 10 feet TOC Elevation: 354.39

DRILLING METHOD: Hollow Stem Auger - 7"

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD: 2" Split Spoon Sampler (Direct Push)

DRILLER: Gregg Drilling

DEPTH (# log)	BLOWS / 1/2"	POI (ppm)	SAMPLE NO	RECOVERY	GRAPHIC LOG	U.C.S.	GEOLOGIC DESCRIPTION	WELL DIAGRAM
								Concrete Vault
							6" Thick Concrete Fill (GRAVEL)	
5						ML		
10	0		PZ6-10			ML	SILT with SAND (ML) grey (10YR 5/1), saturated, stiff, 85% silt, 15% fine sand Bottom of borehole at 10 ft Bottom of well at 10 ft	0.01" Machine Slotted Well Casing 3/4" PVC (Sch. 40) Well Screen neat cement bentonite # 3 Sand
15								
20								
25								
30								
35								



Gettler Ryan Inc
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of PZ-7

DATE STARTED: 05-08-06

PROJECT NUMBER: 948162.5

DATE COMPLETED: 05-08-06

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: 5 feet DATE: 05-10-06 TIME: 08:20

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 10 feet TOC Elevation: 354.45

DRILLING METHOD: Hollow Stem Auger - 7"

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD: 2" Split Spoon Sampler (Direct Push)

DRILLER: Gregg Drilling

DEPTH (ft log)	BLOWS / 12 ft	POI (ppm)	SAMPLE NO	RECOVERY	GRAPHIC LOG	USCS	GEOLOGIC DESCRIPTION	WELL DIAGRAM
								Concrete Vault
							6" Thick Concrete	
							Fill (GRAVEL)	
5						ML		
10	0		PZ7-10			ML	SILT with SAND (ML) grey (10YR 5/1), saturated, stiff, 85% silt, 15% fine sand	
							Bottom of borehole at 10 ft	
							Bottom of well at 10 ft	
15								
20								
25								
30								
35								



Gettler - Ryan Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of GP-1

DATE STARTED: 04-09-07

PROJECT NUMBER: 948162.6

DATE COMPLETED: 04-09-07

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: -- DATE: -- TIME: --

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 10 feet TOC Elevation: --

DRILLING METHOD: 1-1/4" Direct Push

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD:

DRILLER: Gregg Drilling

DEPTH (ft. bgt)	BLOWS / 1/2 ft	PID (ppm)	SAMPLE NO.	RECOVERY	GRAPHIC LOG	U.S.C.S.	GEOLOGIC DESCRIPTION	WELL DIAGRAM
							5.5" Thick Concrete	Boring backfilled to 1 Foot bgs with neat cement completed to surface with concrete
							Fill (GRAVEL)	
5	0		GP1-5			ML	SILT (ML), dark brown (7.5YR 4/3), moist, stiff, 85%-90% silt, 10% - 15% fine sand	
10						ML	No sample recovery at 10' Total Depth of borehole 10'	
15								
20								
25								
30								
35								



Gettler - Ryan Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of GP-2

DATE STARTED: 04-09-07

PROJECT NUMBER: 948162.6

DATE COMPLETED: 04-09-07

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: --

DATE: --

TIME: --

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 10 feet

TOC Elevation: --

DRILLING METHOD: 1-1/4" Direct Push

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD:

DRILLER: Gregg Drilling

DEPTH (ft. bgl)	BLOWS / 1/2 ft	PID (ppm)	SAMPLE NO.	RECOVERY	GRAPHIC LOG	U.S.C.S.	GEOLOGIC DESCRIPTION	WELL DIAGRAM
							5.5" Thick Concrete	Boring backfilled to 1 Foot bgs with neat cement completed to surface with concrete
							Fill (GRAVEL)	
5							ML	
							SILT (ML), dark brown (7.5YR 4/4), moist, stiff 90% silt, 10% fine sand	
10	4	0	GP2-10			ML	Bottom of borehole at 10'	
15								
20								
25								
30								
35								



Gettler - Ryan Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of GP-3

DATE STARTED: 04-09-07

PROJECT NUMBER: 948162.6

DATE COMPLETED: 04-09-07

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: --

DATE: --

TIME: --

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 10 feet

TOC Elevation: --

DRILLING METHOD: 1-1/4" Direct Push

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD:

DRILLER: Gregg Drilling

DEPTH (ft bgl)	BLOWS / 12 ft	FDI (ppm)	SAMPLE NO.	RECOVERY	GRAPHIC LOG	U.S.C.S.	GEOLOGIC DESCRIPTION	WELL DIAGRAM
							5.5" Thick Concrete	Boring backfilled to 1 Foot bgs with neat cement completed to surface with concrete
							Fill (GRAVEL)	
5	0		GP3-6			ML	SILT (ML), dark brown (7.5YR 4/4), moist, stiff 80%-90% silt, 10%-20% sand	
10	0		GP3-10			ML	SILT (ML), grey (10YR 5/1), moist, very stiff, 90% silt, 10% fine sand	
							Bottom of borehole at 10'	
15								
20								
25								
30								
35								



Gettler - Ryan Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of GP-4

DATE STARTED: 04-09-07

PROJECT NUMBER: 948162.6

DATE COMPLETED: 04-09-07

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: --

DATE: --

TIME: --

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 10 feet

TOC Elevation: --

DRILLING METHOD: 1-1/4" Direct Push

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD:

DRILLER: Gregg Drilling

DEPTH (ft. bgl)	BLOWS / 1/2 ft	PID (ppm)	SAMPLE NO.	RECOVERY	GRAPHIC LOG	U.S.C.S.	GEOLOGIC DESCRIPTION	WELL DIAGRAM
							5.5" Thick Concrete	Boring backfilled to 1 Foot bgs with neat cement completed to surface with concrete
							Fill (GRAVEL)	
5		0	GP4-5			ML	SILT (ML), dark brown (7.5YR 4/4), moist, medium, stiff to stiff, 80%-90% silt, 10-20% sand	
10		0	GP4-10			ML	SILT (ML), grey (10YR 5/1), saturated, stiff, 90% silt, 10% fine sand	
							Bottom of borehole at 10'	
15								
20								
25								
30								
35								



Gettler - Ryan Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of GP-5

DATE STARTED: 04-09-07

PROJECT NUMBER: 948162.6

DATE COMPLETED: 04-09-07

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: --

DATE: --

TIME: --

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 10 feet

TOC Elevation: --

DRILLING METHOD: 1-1/4" Direct Push

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD:

DRILLER: Gregg Drilling

DEPTH (ft bgl)	BLOWS / 12 ft	PID (ppm)	SAMPLE NO.	RECOVERY	GRAPHIC LOG	U.S.C.S.	GEOLOGIC DESCRIPTION	WELL DIAGRAM
							6" Thick Concrete	Boring backfilled to 1 Foot bgs with neat cement completed to surface with concrete
							Fill (GRAVEL)	
5	0		GP5-5			ML	SILT (ML), dark brown (7.5YR 4/4), moist, medium stiff to stiff, 80%-90% silt 10-20% fine sand	
10	0		GP5-10			ML	SILT (ML), dark grey (7.5YR 4/1), moist, medium stiff to stiff, 80%-90% silt, 10-20% fine sand	
							Bottom of borehole at 10'	
15								
20								
25								
30								
35								



Gettler - Ryan Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of GP-6

DATE STARTED: 04-09-07

PROJECT NUMBER: 948162.6

DATE COMPLETED: 04-09-07

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: --

DATE: --

TIME: --

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 15 feet

TOC Elevation: --

DRILLING METHOD: 1-1/4" Direct Push

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD:

DRILLER: Gregg Drilling

DEPTH (ft. bgl)	BLOWS / 1/2 ft	PID (ppm)	SAMPLE NO.	RECOVERY	GRAPHIC LOG	U.S.C.S.	GEOLOGIC DESCRIPTION	WELL DIAGRAM
							3" Thick Asphalt 6" Base Gravel	Boring backfilled to 1 Foot bgs with neat cement completed to surface with concrete
							Fill (GRAVEL)	
5	0		GP6-5			ML	SILT (ML), dark brown (7.5YR 4/3), moist, medium stiff to stiff, 80%-90% silt, 10-20% fine sand	
10	0		GP6-10			ML	SILT (ML), dark grey (7.5YR 4/1), moist, medium stiff to stiff, 80%-90% silt, 10-20% fine sand	
15	0		GP6-15			ML	SILT (ML), dark grey (7.5YR 4/1), moist, medium stiff to stiff, 80%-90% silt, 10-20% fine sand	
							Bottom of borehole at 15'	
20								
25								
30								
35								



Gettler - Ryan Inc.
6747 Sierra Ct., Suite J
Dublin, CA 94568
TELEPHONE: (925) 551-7555
FAX: (925) 551-7888

Log of GP-7

DATE STARTED: 04-09-07

PROJECT NUMBER: 948162.6

DATE COMPLETED: 04-09-07

PROJECT NAME: Can-Am Plumbing

DEPTH TO WATER: --

DATE: --

TIME: --

LOCATION: 151 Wyoming St., Pleasanton, CA

TOTAL DEPTH: 10 feet

TOC Elevation: --

DRILLING METHOD: 1-1/4" Direct Push

LOGGED BY: Geoffrey D. Risse

SAMPLING METHOD:

DRILLER: Gregg Drilling

DEPTH (ft. bgs)	BLOWS / 1/2 ft	PID (ppm)	SAMPLE NO.	RECOVERY	GRAPHIC LOG	U.S.C.S.	GEOLOGIC DESCRIPTION	WELL DIAGRAM
							3" Thick Asphalt 6" Base Gravel	Boring backfilled to 1 Foot bgs with neat cement completed to surface with concrete
							Fill (GRAVEL)	
5	0		GP7-5			ML	SILT (ML), dark brown (7.5YR 4/4), moist, medium stiff to stiff, 90% silt, 10% fine sand	
10	0		GP7-10			ML	SILT (ML), grey (10.5YR 5/1), saturated, stiff, 80%-90% silt, 10 to 20% fine sand	
							Bottom of borehole at 10'	
15								
20								
25								
30								
35								




GETTLER-RYAN

Site: CAN-AM PLUMBING

Sounding: cpt-1

Engineer: G.RISSE

Date: 4/17/2007 07:51

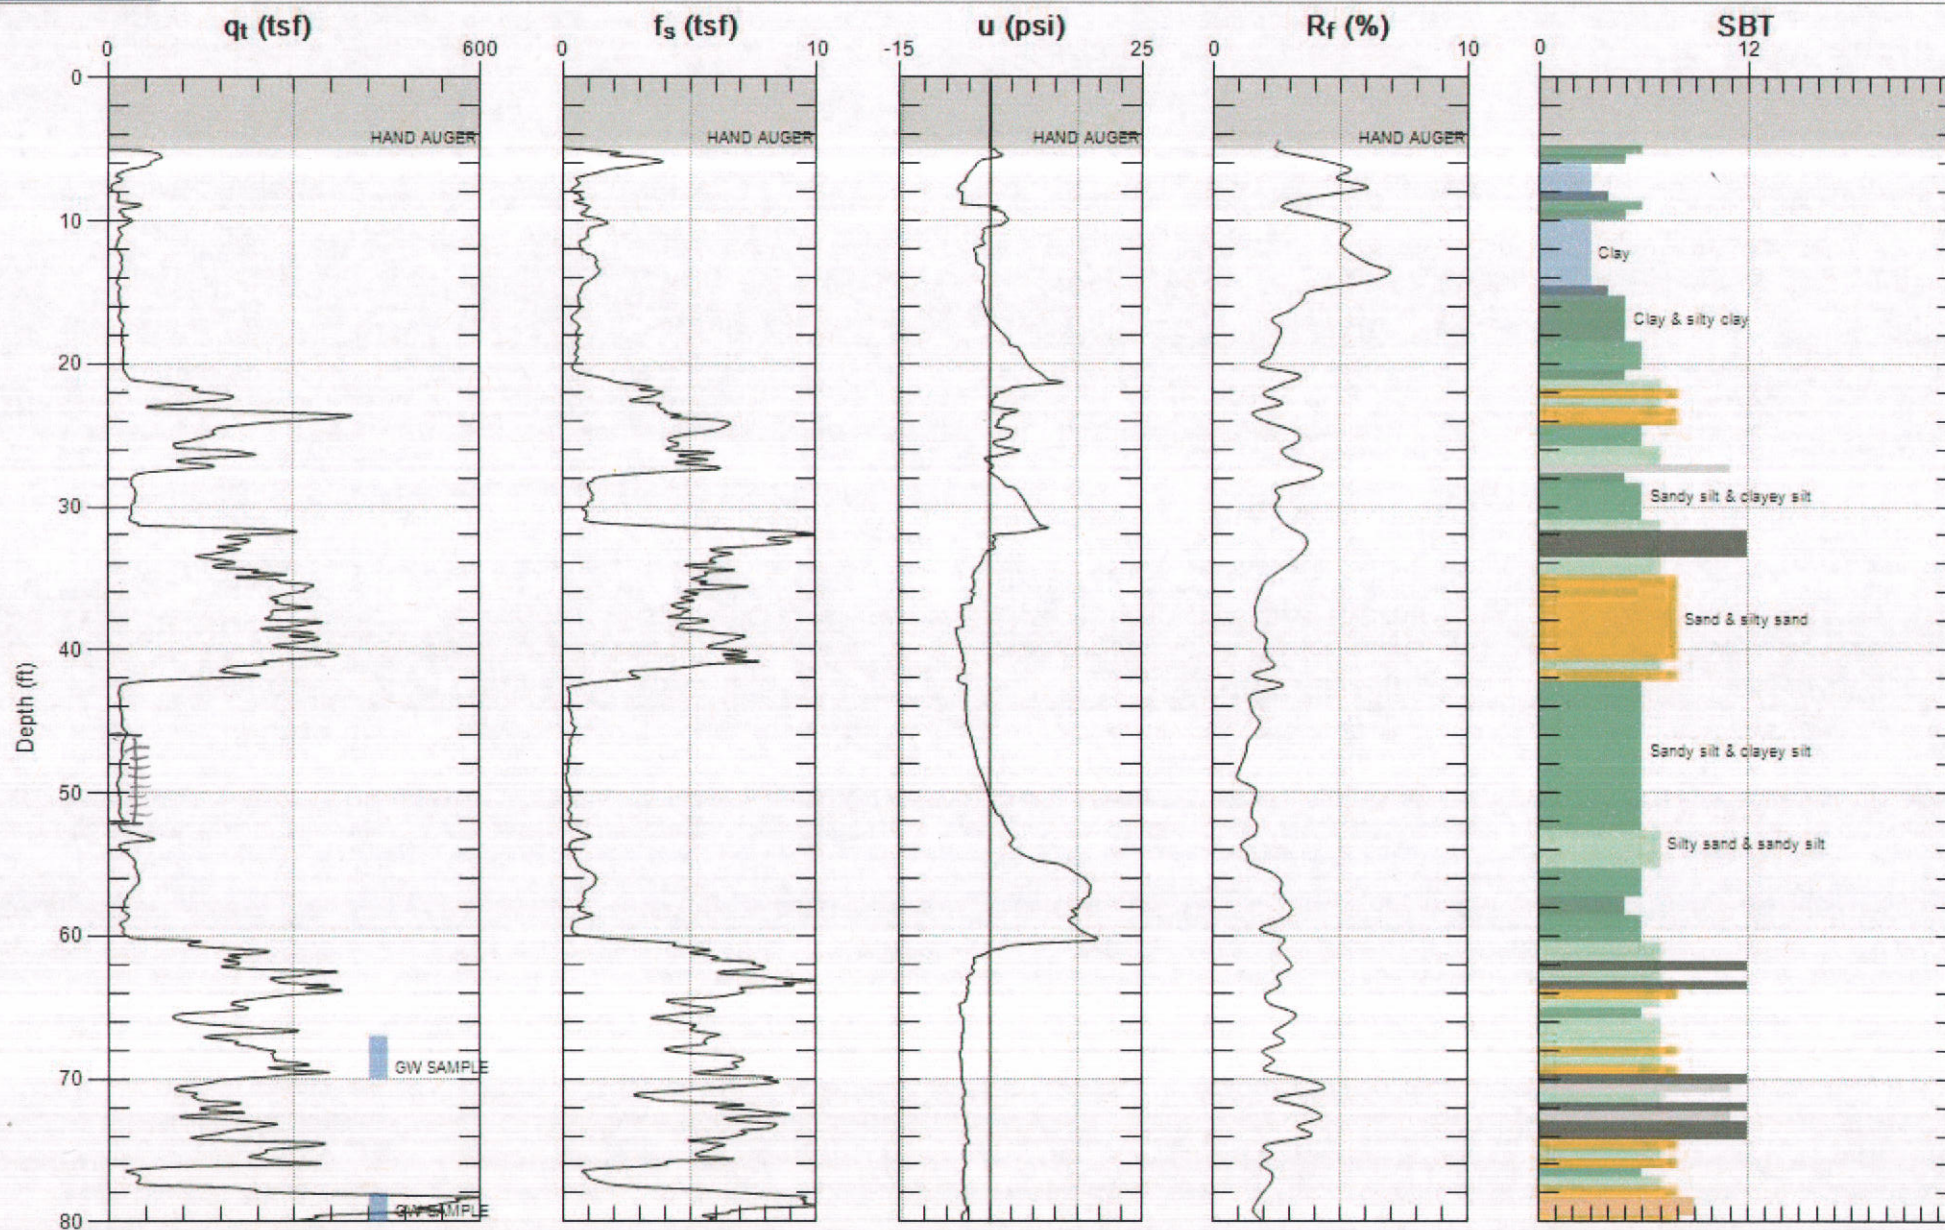

Max. Depth: 80.217 (ft)
Avg. Interval: 0.656 (ft)

SBT: Soil Behavior Type (Robertson 1990)




GETTLER-RYAN

Site: CAN-AM PLUMBING

Engineer: G.RISSE

Sounding: CPT-02

Date: 2/21/2008 08:32

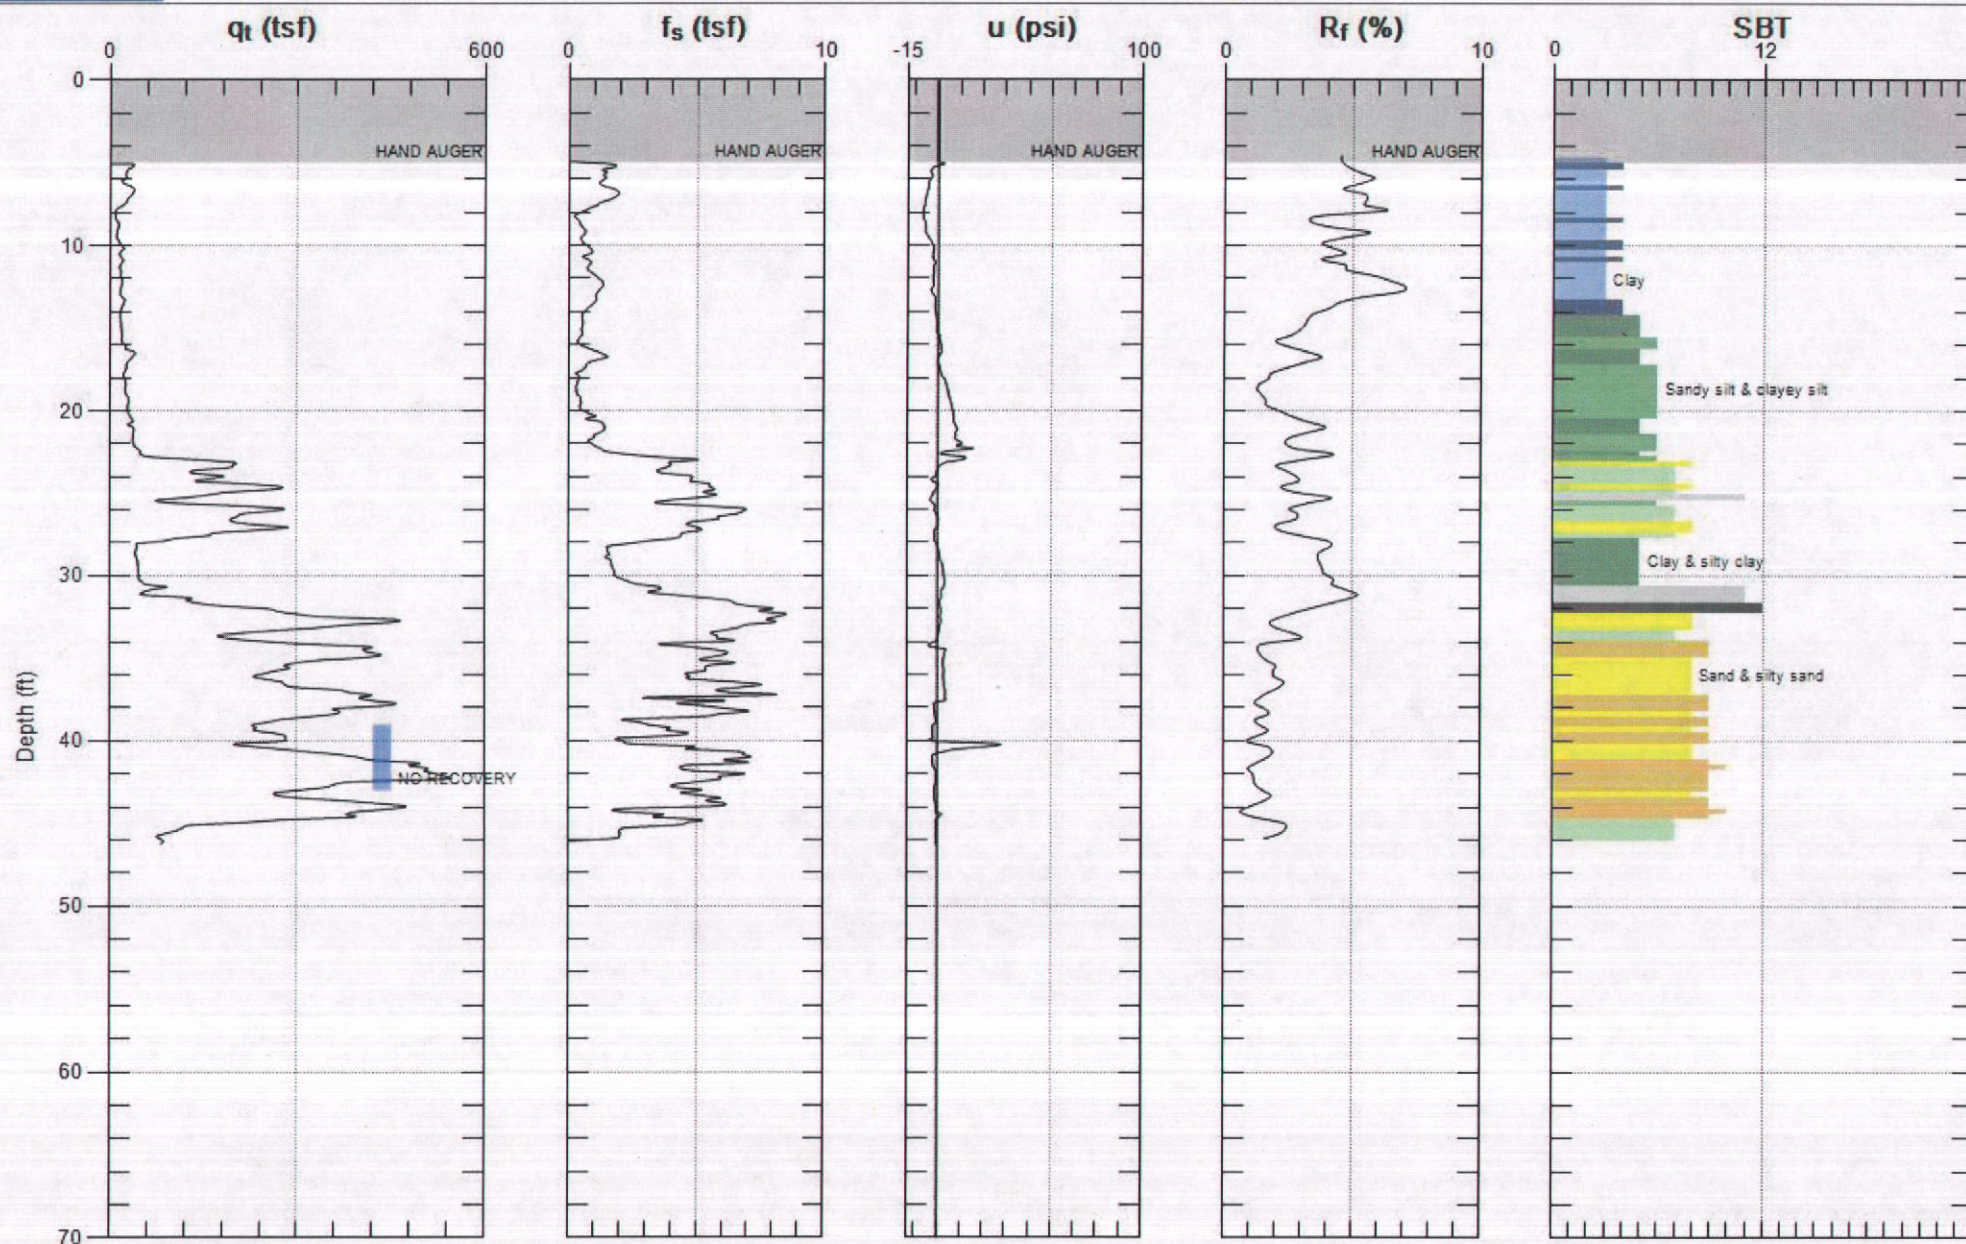

Max. Depth: 46.260 (ft)
Avg. Interval: 0.328 (ft)

SBT: Soil Behavior Type (Robertson 1990)




GETTLER-RYAN

Site: CAN-AM PLUMBING

Sounding: CPT-03

Engineer: G.RISSE

Date: 2/21/2008 12:59

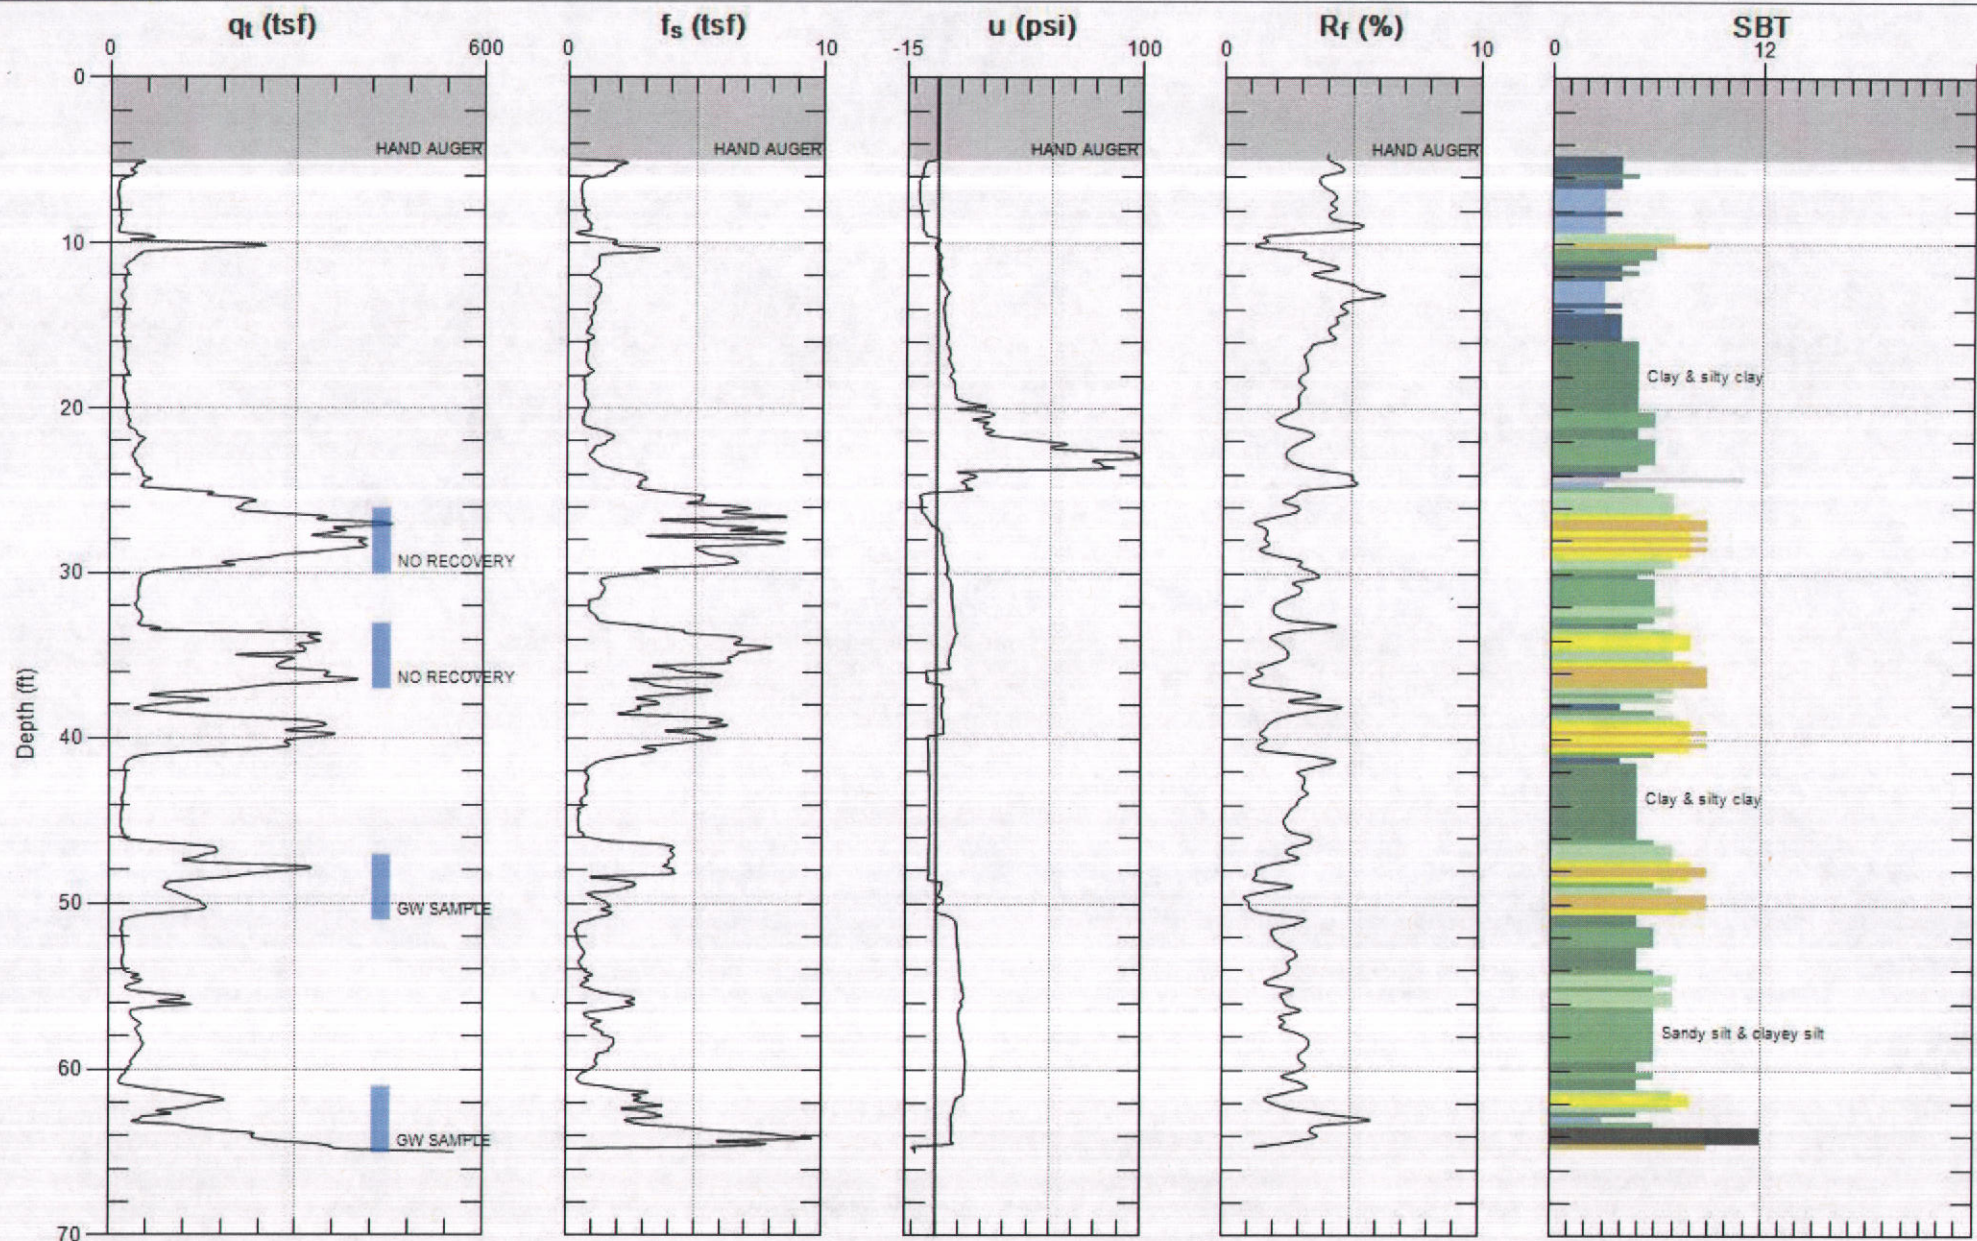

Max. Depth: 64.961 (ft)
Avg. Interval: 0.328 (ft)

SBT: Soil Behavior Type (Robertson 1990)




GETTLER-RYAN

Site: CAN-AM PLUMBING

Sounding: CPT-04

Engineer: G.RISSE

Date: 2/22/2008 08:33

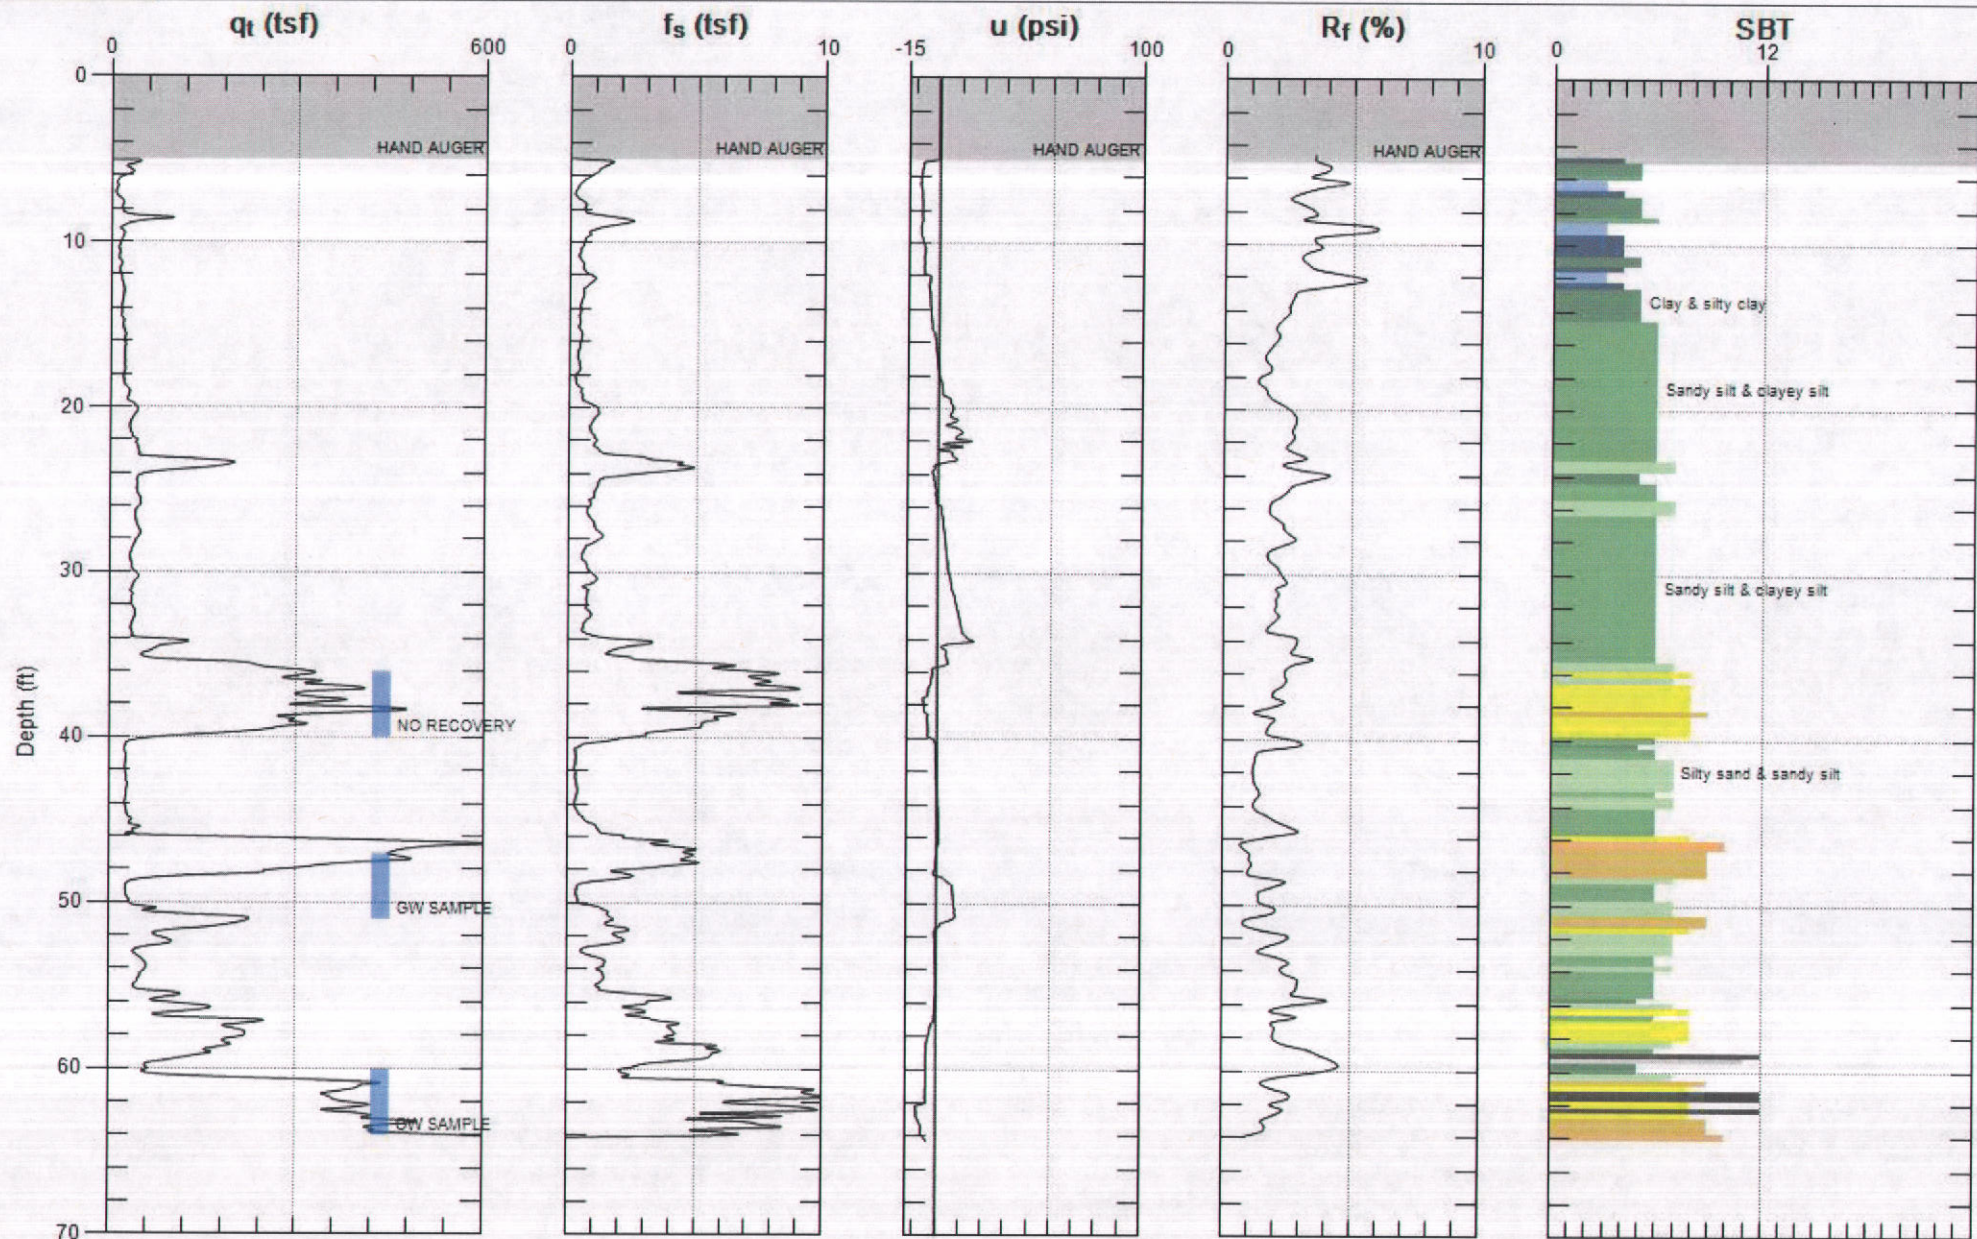

Max. Depth: 64.304 (ft)
Avg. Interval: 0.328 (ft)

SBT: Soil Behavior Type (Robertson 1990)




GETTLER-RYAN

Site: CAN-AM PLUMBING

Sounding: CPT-05

Engineer: G. RISSE

Date: 4/11/2008 07:58

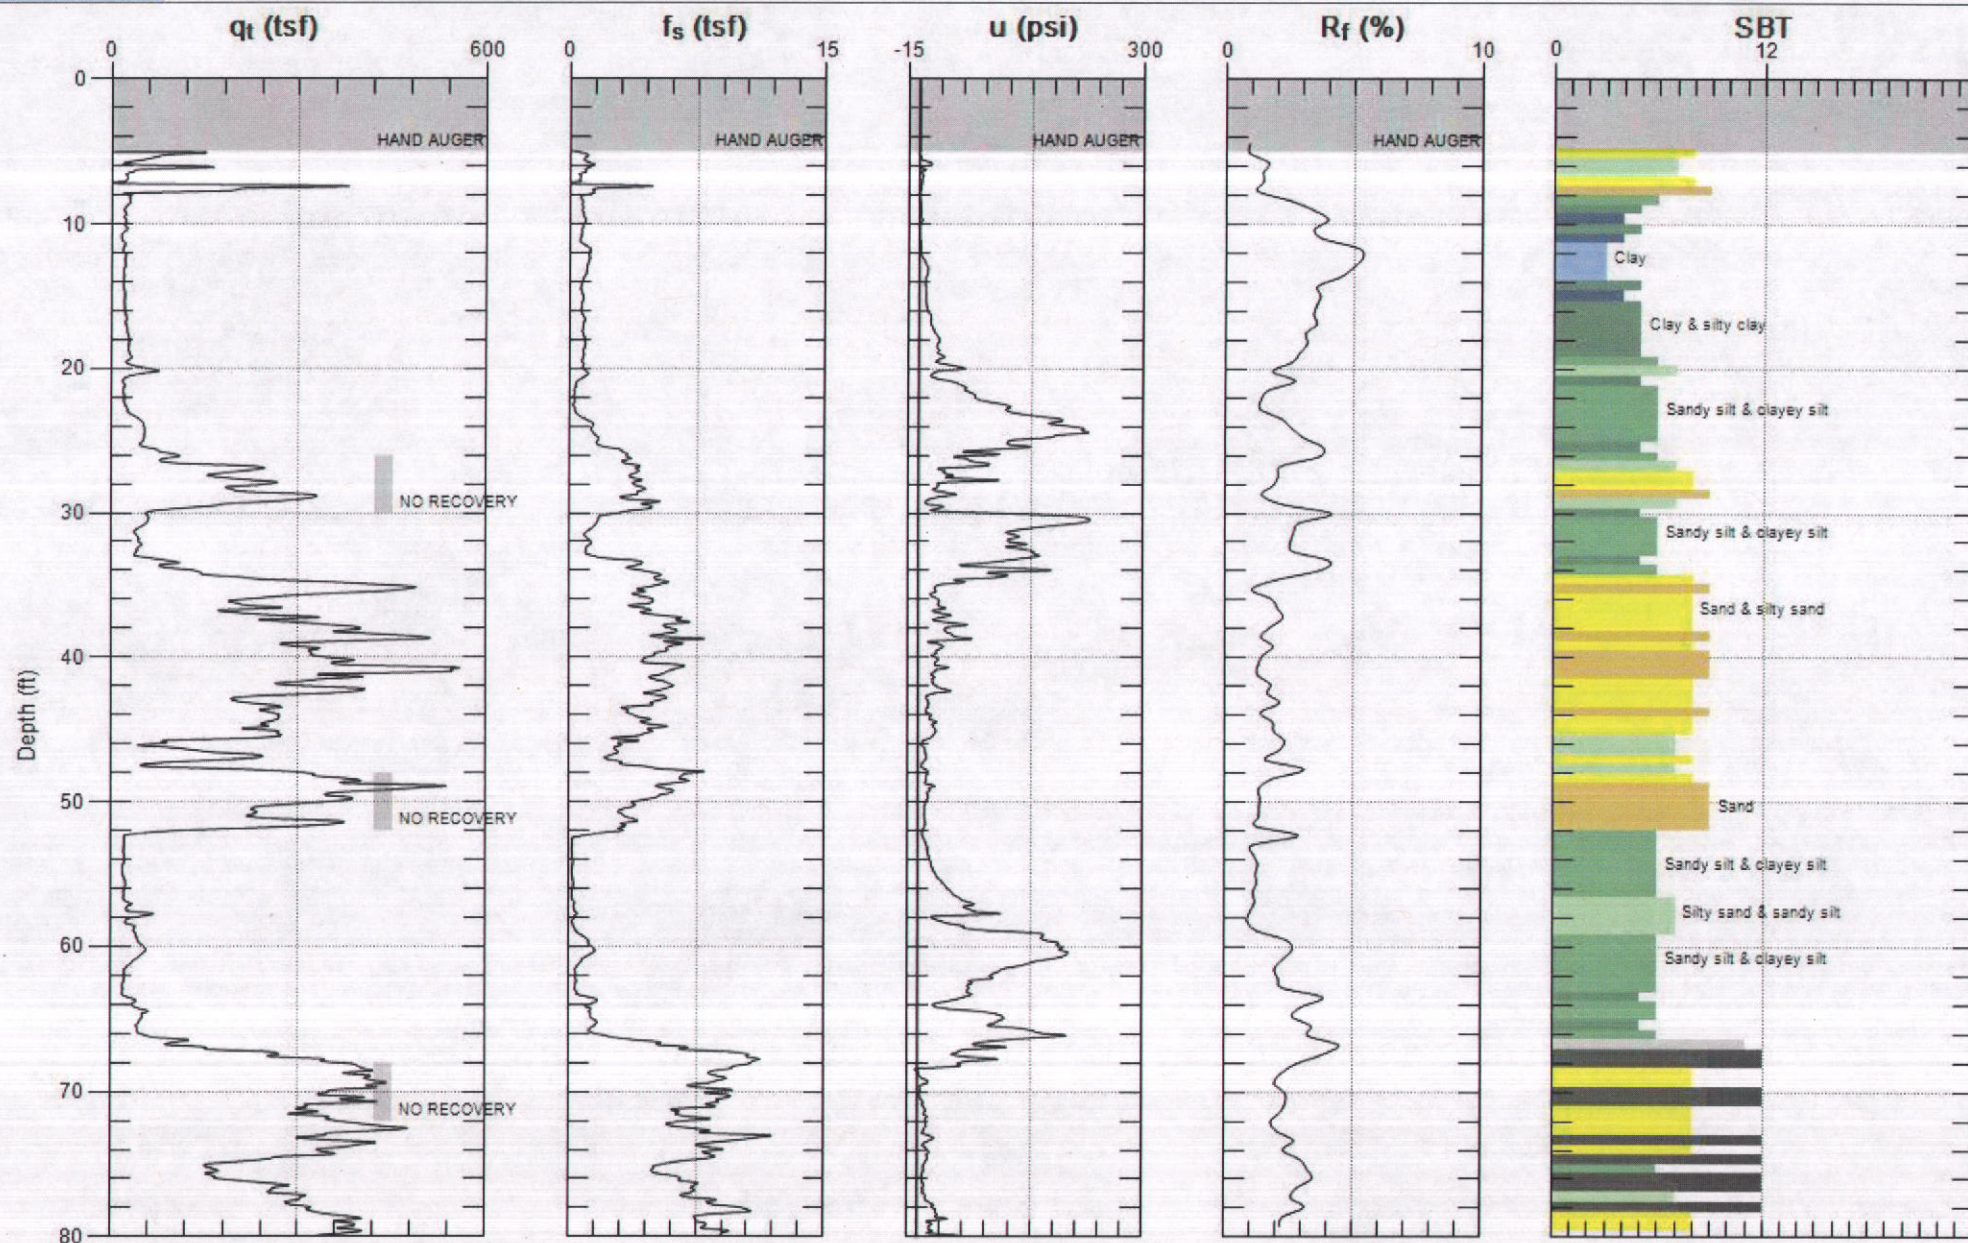

Max. Depth: 80.052 (ft)
Avg. Interval: 0.656 (ft)

SBT: Soil Behavior Type (Robertson 1990)