

ENGINEERING-SCIENCE, INC.

290 Elwood Davis Road, Suite 312 • Liverpool, New York 13088 • (315) 451-9560 • Fax: (315) 451-9570

July 23, 1993

93 JUL 26 PM 12:25

Ms. Susan Hugo
Alameda County Department of Environmental Health
80 Swan Way, Room 200
Oakland, California 94621

Re: Greyhound Terminal
Location 8934
Oakland, California

Dear Ms. Hugo:

On behalf of Greyhound Lines, Inc., Engineering-Science, Inc. (ES) is pleased to submit the June 1993 monthly monitoring report for the Greyhound Terminal in Oakland. Attached you will find Table 1 which lists the measured water levels and free-product thicknesses from on-site wells monitored during our site visit. Figure 1 shows the locations of the monitoring wells.

During our site visit on June 10, free phase hydrocarbons were observed in recovery wells BC-1, and ES-2 and ES-5. A hydrocarbon sheen was present in recovery well ES-1. The hydrocarbon recovery system in operation at this facility continues to work effectively, reducing product thicknesses in recovery wells ES-1, ES-2, ES-5 and BC-1 to 0.06 feet or less. A total of 615 gallons of diesel fuel and contaminated groundwater have been recovered to date.

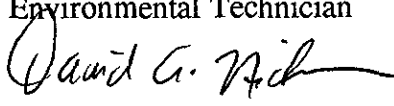
The July 1993 site visit was completed during the week of July 4, 1993. Greyhound gratefully acknowledges ACDEH approval (telephone conversation with Susan Hugo, June 15, 1993) of the supplemental site assessment work plan, the closure documentation submitted in December 1992, and the current remediation program in progress at this facility. As we discussed, Greyhound implemented the supplemental site assessment investigation during the week of July 19, 1993.

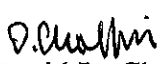
If you have any questions or require additional information, please feel free to contact us at (315) 451-9560.

Sincerely,

ENGINEERING-SCIENCE, INC.


Martin N. Miller
Environmental Technician


David A. Nickerson
Project Manager


David L. Chaffin, R.G.
California Registered Geologist (No. 4885)

cc: Mr. Richard Hiatt, RWQCB
Tom Portele, GLI, Dallas, TX

TABLE 1
 MONITORING SUMMARY
 GREYHOUND LINES, INC.
 OAKLAND, CA
 JUNE 10, 1993

Location	Depth to Liquid (feet)	Depth to Water (feet)	Product Thickness (feet)	Remarks
ES-1*	18.60	18.60	0	Sheen
ES-2*	19.10	19.11	.01	Free Product
ES-3	NA	NA	NA	NA
ES-4	17.93	17.93	0	Clear
ES-5*	18.31	18.36	.05	Free Product
BC-1*	18.85	18.91	.06	Free Product
BC-2	16.58	16.58	0	Clear
BC-3	16.71	16.71	0	Clear

* Recovery Well

NA = Not accessible due to automobile parked over well.

FIGURE 1

