

February 3, 2000

Don Hwang
Alameda County Health Care Services Agency
1131 Harbor Bay Parkway, Suite 250
Alameda, California 94502-6577

Re: **Letter Response and Work Plan**
Shell-branded Service Station
999 San Pablo Avenue
Albany, California
Incident #98995143
Cambria Project # 242-0366

Dear Mr. Hwang:

On behalf of Equiva Services LLC (Equiva), Cambria Environmental Technology, Inc. (Cambria) is submitting this response to the Alameda County Health Care Services Agency (ACHCSA) November 16, 1999 letter to Equiva. Following is summary of the site background and previous investigations, and a response to specific items requested in the ACHCSA letter in order to further develop a site conceptual model.

BACKGROUND

Site Location: The subject site is located on the northeast corner of the intersection of San Pablo Avenue and Marin Avenue in Albany, California (Figure 1). The neighborhood in the immediate vicinity of the site is mixed commercial and residential.

Soil Lithology: The soil beneath the site consists primarily of silty clay to clayey silt to a depth of approximately 8 to 9 feet below grade (fbg), beneath which a saturated silty gravelly sand layer was encountered at a depth of approximately 9 to 10 fbg. These units overlie an unsaturated sandy silt unit to the maximum explored depth of 20.5 fbg.

Groundwater Depth and Flow Direction: Groundwater was initially encountered onsite during drilling activities at depths of approximately 10 to 11 fbg. Static water levels onsite, gauged quarterly since 1991 during groundwater monitoring events, have ranged from approximately 5.5 fbg to approximately 11 fbg. Considering the site lithology as well as the difference in the initial versus the static groundwater depths, it is likely that a confined or semi-confined aquifer exists at this site. The groundwater gradient is generally to the west in the vicinity of the site, but varies across the site, likely due to the existence of an underground creek (now running in a large reinforced concrete pipe culvert) flowing west down Marin Avenue. Previous groundwater contour maps are included in Attachment A.

Oakland, CA
Sonoma, CA
Portland, OR
Seattle, WA

Cambria
Environmental
Technology, Inc.

1144 65th Street
Suite B
Oakland, CA 94608
Tel (510) 420-0700
Fax (510) 420-9170

00 FEB 8 AM 10
PROTOLATION
78 NOV 2001
RECEIVED
CAMBRIA



C A M B R I A


Mr. Don Hwang
February 3, 2000

1990 Soil Boring and Monitoring Well Installations: During three separate drilling events in 1999, GeoStrategies Inc. (GSI) of Hayward California installed a total of 14 exploratory soil borings at the subject site. Seven of the soil borings were completed as groundwater monitoring wells (S-1 through S-7).

On January 29 and 30, 1990, ten exploratory borings were installed using a hollow-stem auger drill rig, three of which were completed as groundwater monitoring wells (S-1 through S-3, shown on Figure 1). Total petroleum hydrocarbons as gasoline (TPHg) were detected in all of the soil borings with the highest concentrations detected at approximately 10 feet below grade (fbg). TPHg concentrations at the 10 fbg sample interval ranged from below laboratory detection limits to 1,900 ppm. Only one of the borings had detectable levels of TPHg at the 15 fbg sample interval. TPHg and benzene were detected in groundwater monitoring wells S-1, S-2, and S-3. Results of this investigation are summarized in GSI's March 23, 1990 *Well Installation and Soil Boring Report*.

On April 16, 1990, GSI installed two additional soil borings to approximately 20.5 fbg and completed them as groundwater monitoring wells (S-4 and S-5) to depths of approximately 14 fbg (Figure 1). Soil and groundwater samples from S-4 were below laboratory detection limits for TPHg and benzene. S-5, constructed in a location across Marin Avenue to the south of the site and directly adjacent to another fuel sales facility showed detectable levels of TPHg and benzene in soil samples at 12 fbg and 15 fbg. In addition, S-5 contained 0.62 feet of separate phase hydrocarbons (SPHs). The results of this investigation are summarized in GSI's June 28, 1990 *Well Installation Report*.

On August 28, 1990, GSI installed the final two wells involved in this phase of investigation for the site (S-6 and S-7). These two soil borings were completed to 19.5 fbg and then completed as groundwater monitoring wells to 15 fbg (Figure 1). TPHg and benzene were detected in soil samples from S-6 at 6 fbg and 9 fbg. No petroleum hydrocarbons were detected in soil samples collected from S-7. Groundwater samples from S-6 indicated the presence of TPHg and benzene. Groundwater samples collected from S-7 were below laboratory detection limits for TPHg and benzene.



1996 Underground Storage Tank Removal and Soil Sampling: On October 21, 1996, Paradiso Mechanical (Paradiso) of San Leandro, California removed three underground storage tanks (USTs), five product dispensers and associated product piping. Cambria collected 12 soil samples from the UST excavation and 11 soil samples from beneath the product dispensers, vent lines and product lines. Petroleum hydrocarbons were detected in the UST excavation and in the dispenser/piping areas. Three backfill wells were installed in the former UST excavation for potential use as remediation wells in the future. The results of this investigation are summarized in Cambria's October 3, 1997 *Underground Storage Tank Removal and Soil Sampling Report*.




SITE CONCEPTUAL MODEL DEVELOPMENT

In the November 8, 1999 letter to Equiva, the ACHCSA requested further characterization of the extent of offsite MTBE in the area downgradient of S-2. Also to be addressed is the potential for contaminant migration from the site via under ground utility conduit trenches or nearby creeks. It is Cambria's intent to address these issues in an attempt to develop a site conceptual model (SCM) for the subject site.

Contaminant Delineation in the Downgradient Direction From S-2

The extent of dissolved hydrocarbons and MTBE in groundwater has not been fully defined at this site. Concentrations of MTBE in downgradient monitoring well S-2 were 597 parts per billion (ppb) by EPA method 8020 in the September 1999 sampling event. Confirmation analysis for MTBE by EPA Method 8260 was performed once in 1996 from well S-2 only. Well S-2 showed a concentration of 11,000 ppb in 1996 by EPA method 8260. Cambria proposes conducting confirmation analysis of MTBE by EPA Method 8260 for the highest detected concentration of MTBE onsite by EPA Method 8020 for all future sampling events. Additionally, during the first quarter 1999 sampling event, any MTBE detected by EPA Method 8020 will be confirmed using EPA Method 8260. Data obtained from EPA Method 8260 analyses for MTBE will provide a more accurate understanding of impacts to groundwater and will aid in further development of a SCM for the subject facility.



C A M B R I A

Mr. Don Hwang
February 3, 2000

Sensitive Receptors

During January, 2000, Cambria began identifying potential sensitive receptors within a $\frac{1}{4}$ -mile radius of the site. Field visits to the area were conducted in order to locate surface water bodies or water production wells which may be impacted by petroleum hydrocarbons migrating from the site. Cambria also submitted a request to the California Department of Water Resources (DWR) to obtain well construction records for wells within a $\frac{1}{4}$ -mile radius from the site. Once these records are available they will be used to map and tabulate any existing wells in the area. This information will be presented to the ACHCSA once Cambria has received the well records and compiled the information.

Cambria did not identify any water production wells within a $\frac{1}{4}$ -mile radius of the site during field reconnaissance visits. DWR records will likely provide the most accurate information on the type and number of wells existing in the area.

Cambria performed a search for nearby surface water bodies after reviewing available maps of the area including the USGS Richmond, California 7.5 minute quadrangle map, the Oakland-Berkeley Area Watershed Map, City of Albany Creek Map, and the City of Albany Department of Public Works Engineering Maps. According to the City of Albany Creek Map, Marin Creek once flowed down the watershed now occupied by Marin Avenue and now runs under the roadway as part of the storm drain system in a large reinforced concrete culvert (69-75 inch diameter - Figure 1). Village Creek, flowing generally from east to west, is located crossgradient from the site and approximately 400 feet to the south. Cordonices Creek, flowing generally from east to west, is also located crossgradient from the site approximately 1,300 feet to the south of the site. Both Marin Creek and Village Creek discharge into San Francisco Bay approximately $\frac{3}{4}$ -mile to the west of the site.

It appears unlikely that hydrocarbons migrating from the site will impact the creeks, as the nearby creeks are crossgradient from the site to the south and the historical groundwater flow has been predominantly to the northwest. Groundwater contour maps from the last eight quarterly monitoring events are included as Attachment A.





C A M B R I A

Mr. Don Hwang
February 3, 2000

Contaminant Plume Stability

Following are plots of concentrations of benzene and MTBE (EPA Method 8020) versus time for site wells S-2, S-3, and S-6, the wells onsite which historically have had the highest concentrations onsite. Per ASTM Standard E 1943-98, the natural log of concentration values was used so that the trends could be differentiated from random concentration fluctuations.

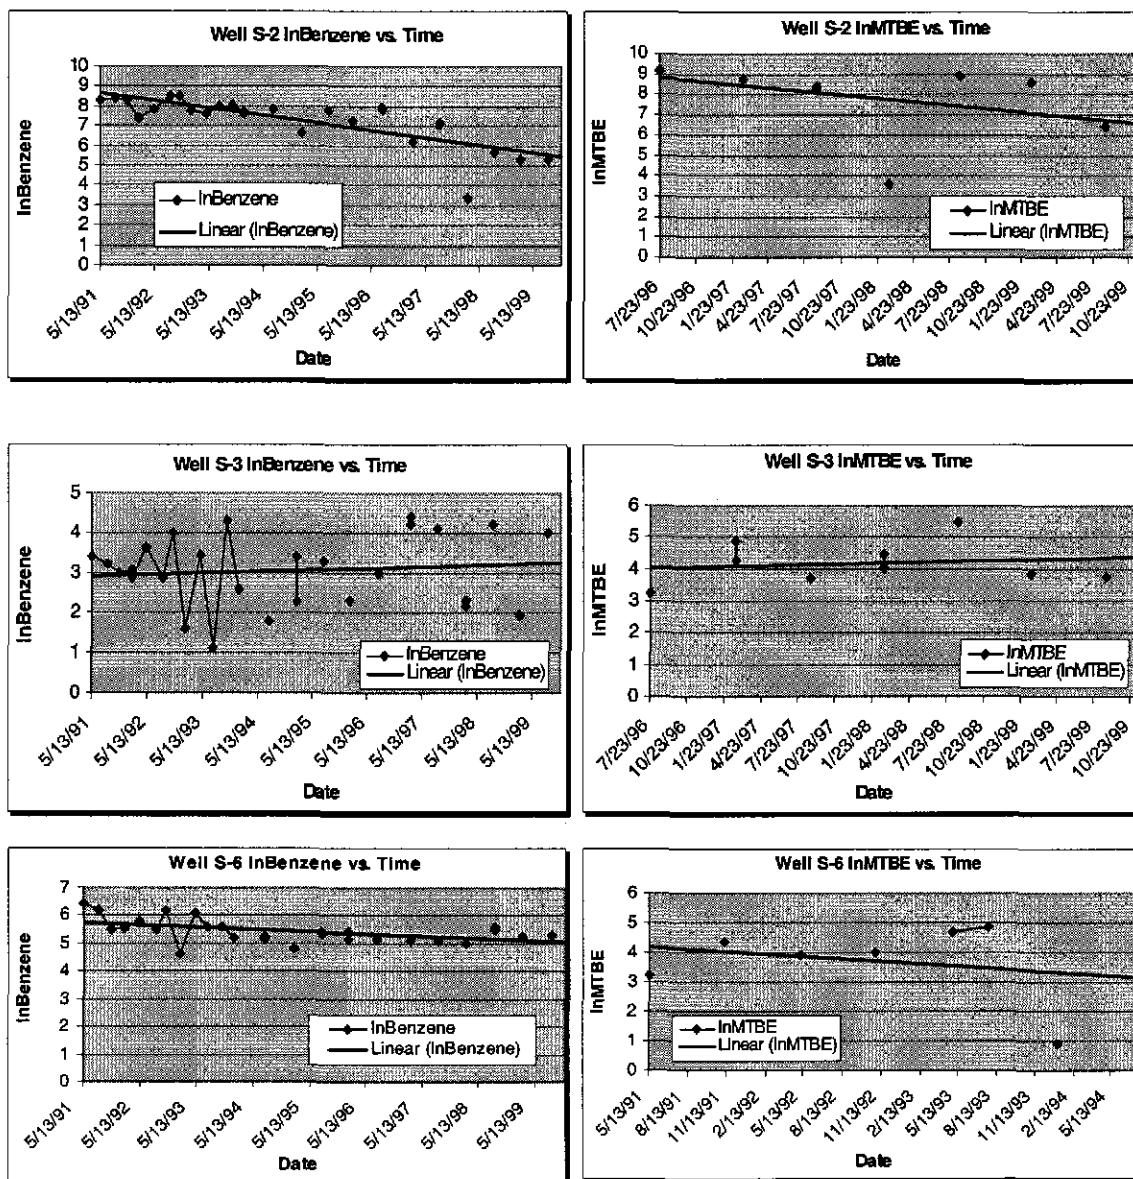



The above figures illustrate stable to decreasing concentration trends for benzene in wells S-2 and S-6 and slightly increasing concentration trends for S-3, however, benzene concentrations in S-3 have remained relatively low over time.

Concentration trends of MTBE in wells S-2 and S-6 appear stable to decreasing. Well S-3 shows an increasing concentration trend for MTBE; however, concentrations of MTBE in well S-3 have been moderate to low and therefore the increasing trend does not appear significant.

The existing monitoring well network of wells onsite does not present a center line of monitoring points through the contaminant plume, therefore, concentration versus distance plots are not presented.

Preferential Migration Pathways


Cambria performed a site reconnaissance and reviewed City of Albany engineering maps to identify utility conduits in the vicinity and of the site. Storm drain and sanitary sewer conduit trench locations and their respective flow line elevations are shown on Figure 1. A sanitary sewer line and a storm drain line run down the eastern side of San Pablo Avenue, adjacent to the site as well as down the south side of Marin Avenue.

Flowline elevations of all the utility conduits adjacent to the site are approximately 26 to 29 feet above mean sea level (msl). Historical groundwater monitoring data suggests that the elevation of the nearby utility conduits lie at an elevation below that of the groundwater, approximately 29 to 34 feet msl historically. Therefore, the potential does exist for contaminant migration from the site within the utility conduit trenches. However, impact to sensitive receptors is unlikely due to the distance from the source area to the discharge area of the sanitary sewer and storm drain systems.

Risk Management Plan

In summary, Cambria proposes the following activities to minimize any potential risk to human health and environment associated with the contaminant release originating from the subject site:

- Obtain confirmation analysis of MTBE in groundwater using EPA Method 8260 for any MTBE detected by EPA Method 8020 (**during the first quarter 2000 sampling**),



C A M B R I A

Mr. Don Hwang
February 3, 2000

- Obtain confirmation analysis of MTBE in groundwater using EPA Method 8260 for the highest MTBE detected by EPA Method 8020 for all future monitoring events,
- Complete a well survey (using DWR well construction records) in order to completely define any sensitive receptors in the area,
- Perform an environmental file review for the Arco station located across Marin Avenue from the site and using this information to in a SCM for the subject facility,
- As requested in our fourth quarter 1998 monitoring report, Cambria recommends the transfer of ownership for well S-5 to the Arco site across Marin Avenue. It is likely that the separate-phase hydrocarbons repeatedly measured in S-5 are a product of a past or ongoing release at the Arco facility,

CLOSING


We appreciate the opportunity to work with you on this project. Please call Darryk Ataide at (510) 420-3339 if you have any questions or comments.

Sincerely,

Cambria Environmental Technology, Inc



Darryk Ataide, REA I
Project Manager

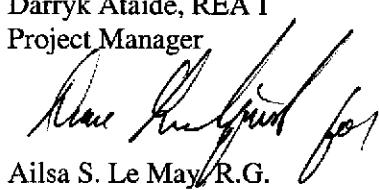

Ailsa S. Le May, R.G.
Senior Geologist




Attachments: A- Previous Groundwater Contour Maps

cc: Karen Petryna, Equiva Services LLC, P.O. Box 7869 Burbank, California 91501-7869

G:\Oakland\5755 Broadway\1999-2000 Investigation\5755OakWPdraft.doc



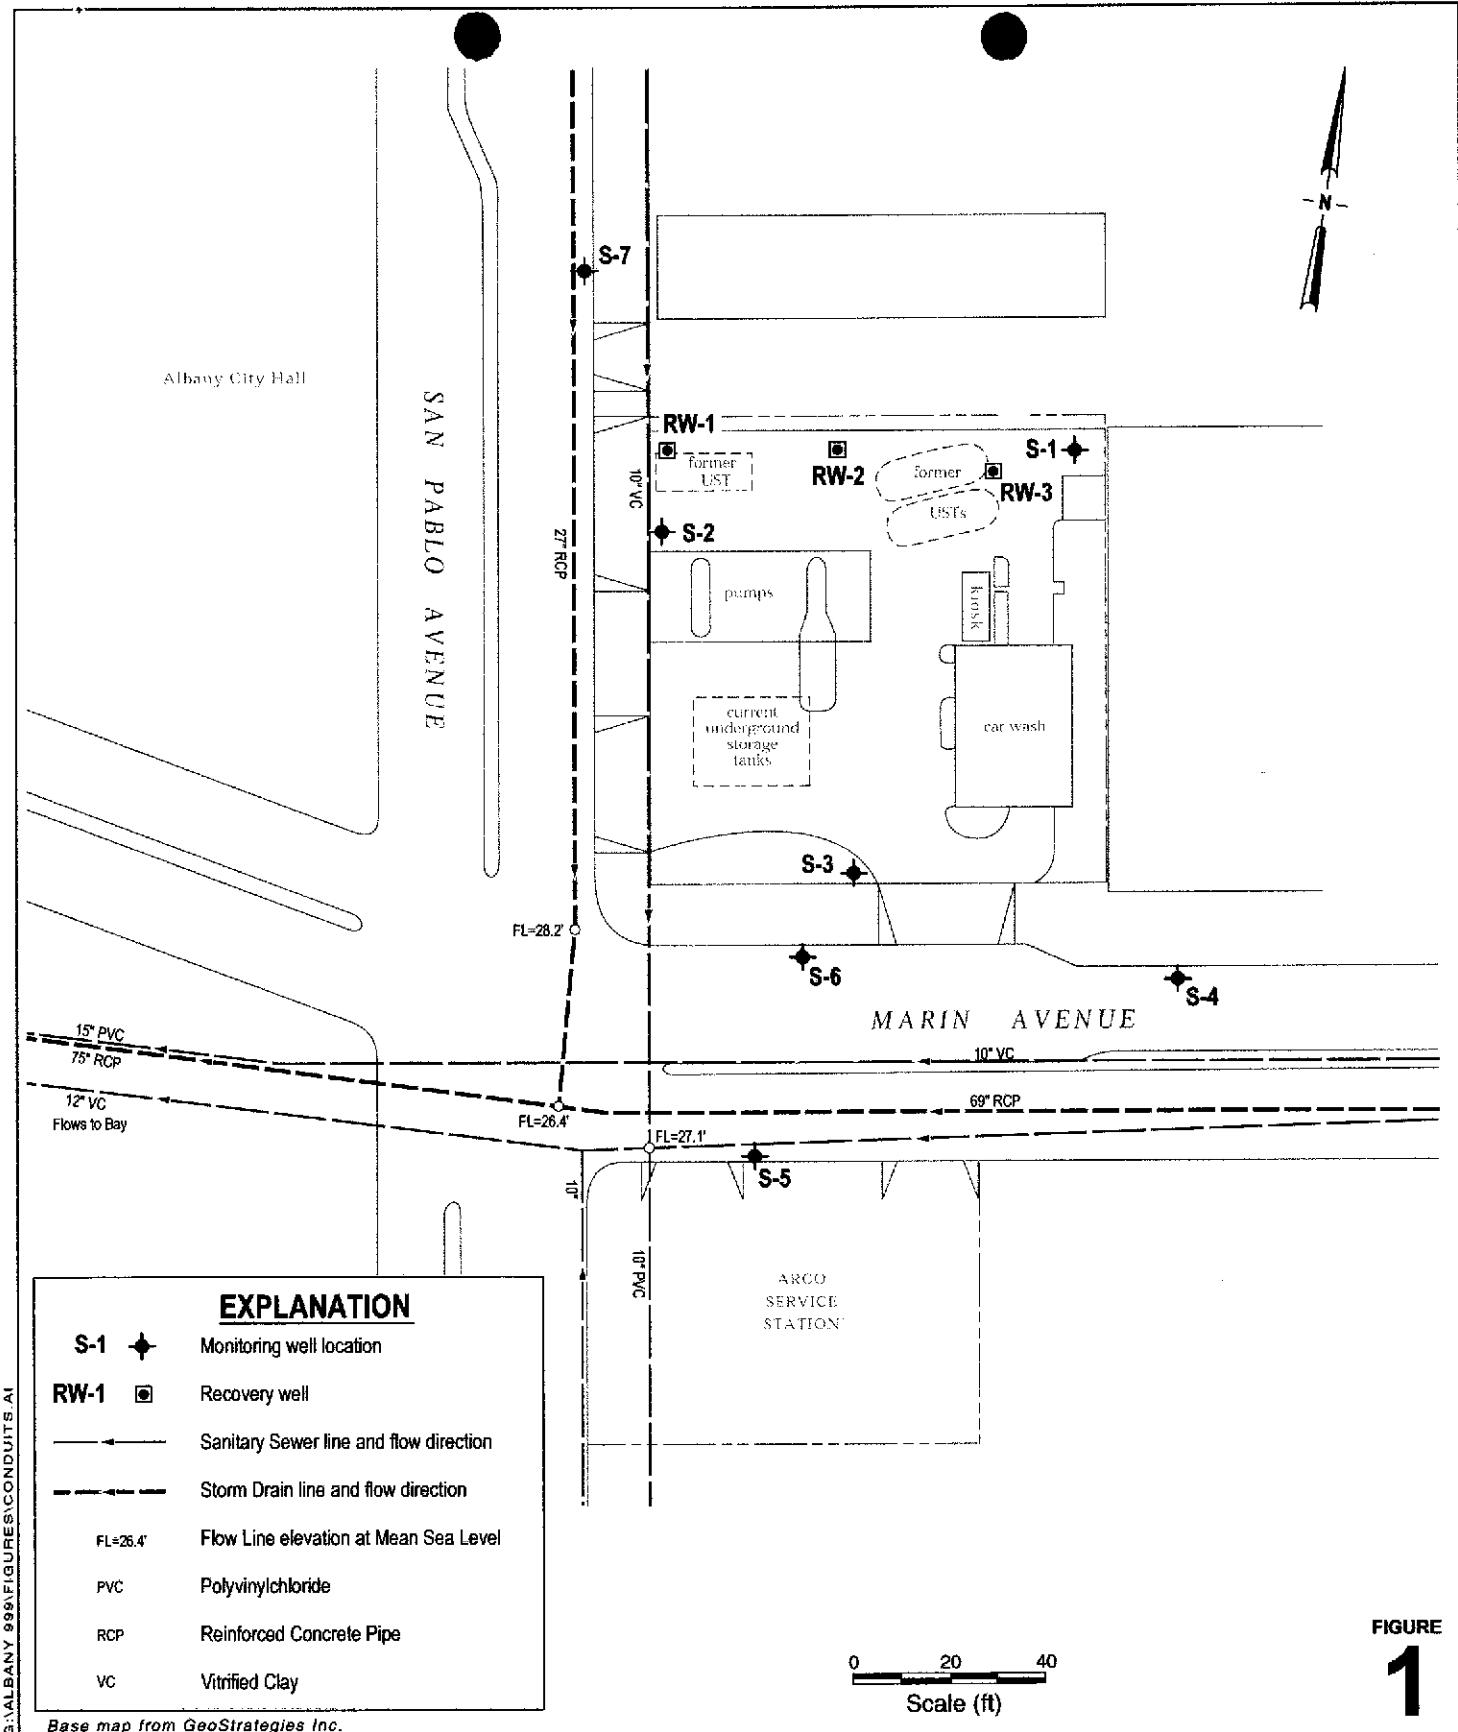

Shell-branded Service Station
999 San Pablo Avenue
Albany, California
Incident #98995143



Underground Conduit Locations



WELL CONCENTRATIONS
Shell-branded Service Station
999 San Pablo Avenue
Albany, CA

Wic #204-0079-0109

Well ID	Date	TPPH (ug/L)	B (ug/L)	T (ug/L)	E (ug/L)	X (ug/L)	MTBE 8020 (ug/L)	MTBE 8260 (ug/L)	TOB (MSL)	Depth to Water (ft.)	GW Elevation (MSL)	SPH Thickness (ft.)	DO Reading (ppm)
---------	------	----------------	-------------	-------------	-------------	-------------	------------------------	------------------------	--------------	----------------------------	--------------------------	---------------------------	------------------------

S-1	05/13/1991	1,500	20	2.6	86	74	NA	NA	42.73	8.24	34.49	NA	NA
S-1	08/23/1991	2,900	27	<2.5	75	18	NA	NA	42.73	8.37	34.36	NA	NA
S-1	11/07/1991	2,900	8	2.5	46	26	NA	NA	42.73	8.30	34.43	NA	NA
S-1	01/28/1992	2,000	11	<2.5	60	20	NA	NA	42.73	7.84	34.89	NA	NA
S-1	05/06/1992	1,200	5.5	<2.5	80	36	NA	NA	42.73	7.95	34.78	NA	NA
S-1	08/26/1992	2,000	9.4	<2.5	130	<2.5	NA	NA	42.73	8.24	34.49	NA	NA
S-1	10/28/1992	1,300	27	3.2	72	13	NA	NA	42.73	8.52	34.21	NA	NA
S-1	01/19/1993	1,500	13	3	29	31	NA	NA	42.73	6.54	36.19	NA	NA
S-1	04/29/1993	2,000	15	<2.5	82	<65	NA	NA	42.73	7.93	34.80	NA	NA
S-1	07/22/1993	620	1.1	4.2	3.5	13	NA	NA	42.73	8.09	34.64	NA	NA
S-1	10/21/1993	1,200	34	25	15	9.5	NA	NA	42.73	9.43	33.30	NA	NA
S-1	01/04/1994	860	<2.5	<2.5	5.7	5.3	NA	NA	42.73	8.25	34.48	NA	NA
S-1	04/13/1994	NA	NA	NA	NA	NA	NA	NA	42.73	8.02	34.71	NA	NA
S-1	07/25/1994	1,200	8.3	7.4	15	20	NA	NA	42.73	8.22	34.51	NA	NA
S-1	10/10/1994	NA	NA	NA	NA	NA	NA	NA	42.73	8.29	34.44	NA	NA
S-1	01/26/1995	1,000	12	0.6	12	420	NA	NA	42.73	6.88	35.85	NA	NA
S-1	04/21/1995	NA	NA	NA	NA	NA	NA	NA	42.73	7.65	35.08	NA	NA
S-1	07/28/1995	660	7.2	1	11	8.9	NA	NA	42.73	7.90	34.83	NA	4
S-1	10/31/1995	NA	NA	NA	NA	NA	NA	NA	42.73	7.72	35.01	NA	NA
S-1	01/10/1996	1,100	3.5	7	5.1	9.4	NA	NA	42.73	8.24	34.49	NA	7.4
S-1	04/25/1996	NA	NA	NA	NA	NA	NA	NA	42.73	7.74	34.99	NA	NA
S-1	07/23/1996	<50	<0.5	<0.5	<0.5	<0.5	<2.5	NA	42.73	7.92	34.81	NA	2.7
S-1	12/10/1996	NA	NA	NA	NA	NA	NA	NA	42.73	7.56	35.17	NA	0.6
S-1	02/20/1997	<50	<0.50	<0.50	<0.50	<0.50	<2.5	NA	42.73	7.95	34.78	NA	3



WELL CONCENTRATIONS
Shell-branded Service Station
999 San Pablo Avenue
Albany, CA

WIC #204-0079-0109

Well ID	Date	TPPH (ug/L)	B (ug/L)	T (ug/L)	E (ug/L)	X (ug/L)	MTBE (ug/L)	8020 (ug/L)	MTBE (ug/L)	TOB (MSL)	Depth to Water (ft.)	GW Elevation (MSL)	SPH Thickness (ft.)	DO Reading (ppm)
S-1	05/22/1997	NA	NA	NA	NA	NA	NA	NA	NA	42.73	8.11	34.62	NA	0.5
S-1	08/22/1997	810	18	<2.0	5.1	4.4	18	NA	NA	42.73	7.86	34.87	NA	3
S-1	11/03/1997	NA	NA	NA	NA	NA	NA	NA	NA	42.73	8.35	34.38	NA	1.1
S-1	02/20/1998	<50	<0.50	<0.50	<0.50	<0.50	<2.5	NA	NA	42.73	6.09	36.64	NA	2.9
S-1	05/18/1998	NA	NA	NA	NA	NA	NA	NA	NA	42.73	7.69	35.04	NA	1.1
S-1	08/20/1998	390	6.7	<0.50	0.64	<0.50	14	NA	NA	42.73	8.20	34.53	NA	1.9
S-1	11/06/1998	NA	NA	NA	NA	NA	NA	NA	NA	42.73	8.23	34.50	NA	NA
S-1	02/16/1999	<50	<0.50	<0.50	<0.50	<0.50	<2.5	NA	NA	42.73	7.47	35.26	NA	1.5
S-1	05/28/1999	NA	NA	NA	NA	NA	NA	NA	NA	42.73	7.60	35.13	NA	1.3
S-1	08/24/1999	72.4	<0.500	<0.500	<0.500	<0.500	<0.500	<2.50	NA	42.73	7.95	34.78	NA	1.4
S-1	11/16/1999	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
S-2	05/13/1991	23,000	3,900	230	1,100	3,200	NA	NA	NA	40.73	8.50	32.23	NA	NA
S-2	08/23/1991	23,000	4,400	260	1,900	2,400	NA	NA	NA	40.73	8.80	31.93	NA	NA
S-2	11/07/1991	40,000	4,000	160	1,020	3,400	NA	NA	NA	40.73	8.61	32.12	NA	NA
S-2	01/28/1992	22,000	1,600	70	420	1,700	NA	NA	NA	40.73	7.80	32.93	NA	NA
S-2	05/06/1992	20,000	2,600	110	860	1,900	NA	NA	NA	40.73	8.10	32.63	NA	NA
S-2	08/26/1992	42,000	5,000	160	1,100	3,500	NA	NA	NA	40.73	8.37	32.36	NA	NA
S-2	10/28/1992	34,000	4,800	330	1,600	2,900	NA	NA	NA	40.73	8.64	32.09	NA	NA
S-2	01/19/1993	20,000	2,300	370	660	1,300	NA	NA	NA	40.73	5.82	34.91	NA	NA
S-2	04/29/1993	40,000	2,000	67	900	1,900	NA	NA	NA	40.73	7.70	33.03	NA	NA
S-2	07/22/1993	22,000	3,000	120	1,000	1,600	NA	NA	NA	40.73	8.38	32.35	NA	NA
S-2(D)	07/22/1993	17,000	3,000	110	1,000	1,500	NA	NA	NA	40.73	8.38	32.35	NA	NA
S-2	10/21/1993	14,000	2,800	74	870	1,100	NA	NA	NA	40.73	8.58	32.15	NA	NA
S-2(D)	10/21/1993	13,000	3,200	53	960	820	NA	NA	NA	40.73	8.58	32.15	NA	NA


Well ID	Date	TPPH (ug/L)	B (ug/L)	T (ug/L)	E (ug/L)	X (ug/L)	MTBE (ug/L)	8020 (ug/L)	MTBE (ug/L)	TOB (MSL)	Depth to Water (ft.)	GW Elevation (MSL)	SPH Thickness (ft.)	DO Reading (ppm)
S-2	05/13/1991	23,000	3,900	230	1,100	3,200	NA	NA	NA	40.73	8.50	32.23	NA	NA
S-2	08/23/1991	23,000	4,400	260	1,900	2,400	NA	NA	NA	40.73	8.80	31.93	NA	NA
S-2	11/07/1991	40,000	4,000	160	1,020	3,400	NA	NA	NA	40.73	8.61	32.12	NA	NA
S-2	01/28/1992	22,000	1,600	70	420	1,700	NA	NA	NA	40.73	7.80	32.93	NA	NA
S-2	05/06/1992	20,000	2,600	110	860	1,900	NA	NA	NA	40.73	8.10	32.63	NA	NA
S-2	08/26/1992	42,000	5,000	160	1,100	3,500	NA	NA	NA	40.73	8.37	32.36	NA	NA
S-2	10/28/1992	34,000	4,800	330	1,600	2,900	NA	NA	NA	40.73	8.64	32.09	NA	NA
S-2	01/19/1993	20,000	2,300	370	660	1,300	NA	NA	NA	40.73	5.82	34.91	NA	NA
S-2	04/29/1993	40,000	2,000	67	900	1,900	NA	NA	NA	40.73	7.70	33.03	NA	NA
S-2	07/22/1993	22,000	3,000	120	1,000	1,600	NA	NA	NA	40.73	8.38	32.35	NA	NA
S-2(D)	07/22/1993	17,000	3,000	110	1,000	1,500	NA	NA	NA	40.73	8.38	32.35	NA	NA
S-2	10/21/1993	14,000	2,800	74	870	1,100	NA	NA	NA	40.73	8.58	32.15	NA	NA
S-2(D)	10/21/1993	13,000	3,200	53	960	820	NA	NA	NA	40.73	8.58	32.15	NA	NA



WELL CONCENTRATIONS
Shell-branded Service Station
999 San Pablo Avenue
Albany, CA

Wic #204-0079-0109

Well ID	Date	TTPH (ug/L)	B (ug/L)	T (ug/L)	E (ug/L)	X (ug/L)	MTBE 8020 (ug/L)	MTBE 8260 (ug/L)	TOB (MSL)	Depth to Water (ft.)	GW Elevation (MSL)	SPH Thickness (ft.)	DO Reading (ppm)
S-2	01/04/1994	21,000	2,100	67	990	770	NA	NA	40.73	7.70	33.03	NA	NA
S-2 (D)	01/04/1994	22,000	2,000	64	910	750	NA	NA	40.73	7.70	33.03	NA	NA
S-2	04/13/1994	NA	NA	NA	NA	NA	NA	NA	40.73	7.62	33.11	NA	NA
S-2	07/25/1994	43,000	2,600	490	990	1,300	NA	NA	40.73	7.86	32.87	NA	NA
S-2	10/10/1994	NA	NA	NA	NA	NA	NA	NA	40.73	8.12	32.61	NA	NA
S-2	01/26/1995	21,000	790	12	290	570	NA	NA	40.73	6.38	34.35	NA	5.5
S-2	04/21/1995	NA	NA	NA	NA	NA	NA	NA	40.73	7.01	33.72	NA	NA
S-2	07/28/1995	14,000	2,400	360	960	370	NA	NA	40.73	7.82	32.91	NA	4
S-2	10/31/1995	NA	NA	NA	NA	NA	NA	NA	40.73	7.57	33.16	NA	NA
S-2	01/10/1996	17,000	1,400	<50	480	170	NA	NA	40.73	8.13	32.60	NA	7.2
S-2	04/25/1996	NA	NA	NA	NA	NA	NA	NA	40.73	7.72	33.01	NA	NA
S-2	07/23/1996	16,000	2,700	68	1,100	110	9,500	NA	40.73	8.10	32.63	NA	2.2
S-2 (D)	07/23/1996	11,000	2,600	68	1,000	96	10,000	11,000	40.73	8.10	32.63	NA	2.2
S-2	12/10/1996	NA	NA	NA	NA	NA	NA	NA	40.73	8.57	32.16	NA	0.5
S-2	02/20/1997	10,000	500	<10	90	130	6,400	NA	40.73	8.15	32.58	NA	4
S-2	05/22/1997	NA	NA	NA	NA	NA	NA	NA	40.73	8.79	31.94	NA	1.1
S-2	08/22/1997	23,000	1,300	65	740	290	4,500	NA	40.73	8.05	32.68	NA	3.2
S-2 (D)	08/22/1997	20,000	1,200	<100	630	250	3,900	NA	40.73	8.05	32.68	NA	3.2
S-2	11/03/1997	NA	NA	NA	NA	NA	NA	NA	40.73	8.75	31.98	NA	1.2
S-2	02/20/1998	450	28	1.3	7.4	12	35	NA	40.73	6.34	34.39	NA	0.4
S-2	05/18/1998	NA	NA	NA	NA	NA	NA	NA	40.73	7.95	32.78	NA	0.8
S-2	08/20/1998	22,000	290	44	420	410	7,300	NA	40.73	7.73	33.00	NA	1.9
S-2	11/06/1998	NA	NA	NA	NA	NA	NA	NA	40.73	8.47	32.26	NA	NA
S-2	02/16/1999	27,000	200	<200	770	840	5,400	NA	40.73	7.24	33.49	NA	1.4
S-2	05/28/1999	NA	NA	NA	NA	NA	NA	NA	40.73	7.82	32.91	NA	1.3



WELL CONCENTRATIONS
Shell-branded Service Station
999 San Pablo Avenue
Albany, CA

Wic #204-0079-0109

Well ID	Date	TPPH (ug/L)	B (ug/L)	T (ug/L)	E (ug/L)	X (ug/L)	MTBE (ug/L)	MTBE 8260 (ug/L)	TOB (MSL)	Depth to Water (ft.)	GW Elevation (MSL)	SPH Thickness (ft.)	DO Reading (ppm)
S-2	08/24/1999	13,400	196	<25.0	439	113	597	NA	40.73	8.61	32.12	NA	1.2

Well ID	Date	TPPH (ug/L)	B (ug/L)	T (ug/L)	E (ug/L)	X (ug/L)	MTBE (ug/L)	MTBE 8260 (ug/L)	TOB (MSL)	Depth to Water (ft.)	GW Elevation (MSL)	SPH Thickness (ft.)	DO Reading (ppm)
S-3	05/13/1991	3,300	30	3.6	26	13	NA	NA	41.46	7.90	33.56	NA	NA


S-3	08/23/1991	2,000	25	4	9.3	4.5	NA	NA	41.46	8.14	33.32	NA	NA
S-3	11/07/1991	4,000	20	3.9	5	4.9	NA	NA	41.46	7.91	33.55	NA	NA
S-3	01/28/1992	2,100	21	7.6	6.7	15	NA	NA	41.46	7.53	33.93	NA	NA
S-3 (D)	01/28/1992	2,100	18	6.1	7.1	14	NA	NA	41.46	7.53	33.93	NA	NA
S-3	05/06/1992	6,600	38	51	45	65	NA	NA	41.46	7.55	33.91	NA	NA
S-3	08/26/1992	5,800	18	12	29	60	NA	NA	41.46	7.53	33.93	NA	NA
S-3	10/28/1992	3,000	55	11	16	32	NA	NA	41.46	7.95	33.51	NA	NA
S-3	01/19/1993	3,100	<5	5.1	11	16	NA	NA	41.46	6.12	35.34	NA	NA
S-3	04/29/1993	3,000	31	22	<5	14	NA	NA	41.46	7.27	34.19	NA	NA
S-3	07/22/1993	2,600	3.1	43	23	53	NA	NA	41.46	7.62	33.84	NA	NA
S-3	10/21/1993	2,500	73	14	16	32	NA	NA	41.46	7.81	33.65	NA	NA
S-3	01/04/1994	4,800	13	21	<12.5	33	NA	NA	41.46	7.49	33.97	NA	NA
S-3	04/13/1994	NA	NA	NA	NA	NA	NA	NA	41.46	7.32	34.14	NA	NA
S-3	07/25/1994	2,600	6.1	4	3.8	12	NA	NA	41.46	7.66	33.80	NA	NA
S-3	10/10/1994	NA	NA	NA	NA	NA	NA	NA	41.46	7.49	33.97	NA	NA
S-3	01/26/1995	3,600	30	6.8	5.6	19	NA	NA	41.46	6.50	34.96	NA	NA
S-3 (D)	01/26/1995	2,200	9.9	15	14	22	NA	NA	41.46	6.50	34.96	NA	NA
S-3	04/21/1995	NA	NA	NA	NA	NA	NA	NA	41.46	6.79	34.67	NA	NA
S-3	07/28/1995	3,700	27	9.3	20	34	NA	NA	41.46	7.28	34.18	NA	4
S-3	10/31/1995	NA	NA	*NA	NA	NA	NA	NA	41.46	6.74	34.72	NA	NA
S-3	01/10/1996	4,000	10	<0.5	13	28	NA	NA	41.46	7.48	33.98	NA	6.1

WELL CONCENTRATIONS
Shell-branded Service Station
999 San Pablo Avenue
Albany, CA

Wic #204-0079-0109

Well ID	Date	TPPH (ug/L)	B (ug/L)	T (ug/L)	E (ug/L)	X (ug/L)	MTBE 8020 (ug/L)	MTBE 8260 (ug/L)	TOB (MSL)	Depth to Water (ft.)	GW Elevation (MSL)	SPH Thickness (ft.)	DO Reading (ppm)
S-3	04/25/1996	NA	NA	NA	NA	NA	NA	NA	NA	41.46	6.90	34.56	NA
S-3	07/23/1996	2,100	20	<0.5	<0.5	<0.5	<25	NA	NA	41.46	7.04	34.42	NA
S-3	12/10/1996	NA	NA	NA	NA	NA	NA	NA	NA	41.46	7.96	33.50	NA
S-3	02/20/1997	3,500	83	<5.0	18	16	130	NA	NA	41.46	7.44	34.02	NA
S-3 (D)	02/20/1997	3,000	69	<5.0	14	12	70	NA	NA	41.46	7.44	34.02	NA
S-3	05/22/1997	NA	NA	NA	NA	NA	NA	NA	NA	41.46	7.13	34.33	NA
S-3	08/22/1997	4,700	60	12	19	21	40	NA	NA	41.46	6.81	34.65	NA
S-3	11/03/1997	NA	NA	NA	NA	NA	NA	NA	NA	41.46	7.40	34.06	NA
S-3	02/20/1998	3,400	<10	<10	14	18	85	NA	NA	41.46	6.55	34.91	NA
S-3 (D)	02/20/1998	3,100	8.6	7.8	12	16	57	NA	NA	41.46	6.55	34.91	NA
S-3	05/18/1998	NA	NA	NA	NA	NA	NA	NA	NA	41.46	6.81	34.65	NA
S-3	08/20/1998	4,400	67	23	9.8	22	240	NA	NA	41.46	6.98	34.48	NA
S-3	11/06/1998	NA	NA	NA	NA	NA	NA	NA	NA	41.46	6.96	34.50	NA
S-3	02/16/1999	2,000	6.9	6.2	3.7	4.8	47	NA	NA	41.46	6.93	34.53	NA
S-3	05/28/1999	NA	NA	NA	NA	NA	NA	NA	NA	41.46	6.74	34.72	NA
S-3	08/24/1999	4,170	54.8	14.2	6.65	13.7	43.4	NA	NA	41.46	9.05	32.41	NA
<hr/>													
<hr/>													

S-4	05/13/1991	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	41.10	7.44	33.66	NA
S-4	08/23/1991	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	41.10	8.32	32.78	NA
S-4	11/07/1991	260	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	41.10	8.32	32.78	NA
S-4	01/28/1992	110c	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	41.10	7.40	33.70	NA
S-4	05/06/1992	54	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	41.10	7.21	33.89	NA
S-4	08/26/1992	67	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	41.10	8.13	32.97	NA
S-4	10/28/1992	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	41.10	8.73	32.37	NA



WELL CONCENTRATIONS
Shell-branded Service Station
999 San Pablo Avenue

Albany, CA

WIC #204-0079-0109

Well ID	Date	TPPH (ug/L)	B (ug/L)	T (ug/L)	E (ug/L)	X (ug/L)	MTBE 8020 (ug/L)	MTBE 8260 (ug/L)	TOB (MSL)	Depth to Water (ft.)	GW Elevation (MSL)	SPH Thickness (ft.)	DO Reading (ppm)
S-4	01/19/1993	86	1.2	0.7	2.7	15	NA	NA	41.10	5.86	35.24	NA	NA
S-4	04/29/1993	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	41.10	7.02	34.08	NA	NA
S-4 (D)	04/29/1993	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	41.10	7.02	34.08	NA	NA
S-4	07/22/1993	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	41.10	7.76	33.34	NA	NA
S-4	10/21/1993	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	41.10	8.53	32.57	NA	NA
S-4	01/04/1994	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	41.10	7.92	33.18	NA	NA
S-4	04/13/1994	NA	NA	NA	NA	NA	NA	NA	41.10	7.71	33.39	NA	NA
S-4	07/25/1994	NA	NA	NA	NA	NA	NA	NA	41.10	7.82	33.28	NA	NA
S-4	10/10/1994	NA	NA	NA	NA	NA	NA	NA	41.10	8.15	32.95	NA	NA
S-4	01/26/1995	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	41.10	5.73	35.37	NA	NA
S-4	04/21/1995	NA	NA	NA	NA	NA	NA	NA	41.10	6.26	34.84	NA	NA
S-4	07/28/1995	NA	NA	NA	NA	NA	NA	NA	41.10	7.80	33.30	NA	NA
S-4	10/31/1995	NA	NA	NA	NA	NA	NA	NA	41.10	8.45	32.65	NA	NA
S-4	01/10/1996	<50	1	2.8	<0.5	2.1	NA	NA	41.10	8.26	32.84	NA	2.8
S-4	04/25/1996	NA	NA	NA	NA	NA	NA	NA	41.10	7.14	33.96	NA	NA
S-4	07/23/1996	<50	<0.5	<0.5	<0.5	<2.5	NA	NA	41.10	8.18	32.92	NA	3.8
S-4	12/10/1996	NA	NA	NA	NA	NA	NA	NA	41.10	7.04	34.06	NA	3.9
S-4	02/20/1997	<50	<0.50	<0.50	<0.50	6.7	NA	NA	41.10	7.07	34.03	NA	5
S-4	05/22/1997	NA	NA	NA	NA	NA	NA	NA	41.10	6.63	34.47	NA	0.8
S-4	08/22/1997	NA	NA	NA	NA	NA	NA	NA	41.10	7.69	33.41	NA	3.7
S-4	11/03/1997	NA	NA	NA	NA	NA	NA	NA	41.10	8.26	32.84	NA	1.3
S-4	02/20/1998	130	6.9	4.6	5.2	17	2.8	NA	41.10	5.57	35.53	NA	1.8
S-4	05/18/1998	NA	NA	NA	NA	NA	NA	NA	41.10	7.13	33.97	NA	1.4
S-4	08/20/1998	NA	NA	NA	NA	NA	NA	NA	41.10	7.77	33.33	NA	4.0
S-4	11/06/1998	NA	NA	NA	NA	NA	NA	NA	41.10	7.85	33.25	NA	NA




WELL CONCENTRATIONS
Shell-branded Service Station
999 San Pablo Avenue
Albany, CA

Wic#204-0079-0109

Well ID	Date	TPPH (ug/L)	B (ug/L)	T (ug/L)	E (ug/L)	X (ug/L)	MTBE (ug/L)	8260 (ug/L)	TOB (MSL)	Depth to Water (ft.)	GW Elevation (MSL)	SPH Thickness (ft.)	DO Reading (ppm)
S-4	02/16/1999	<50	<0.50	<0.50	<0.50	<0.50	23	NA	41.10	6.51	34.59	NA	3.6
S-4	05/28/1999	NA	NA	NA	NA	NA	NA	NA	41.10	7.00	34.10	NA	3.2
S-4	08/24/1999	NA	NA	NA	NA	NA	NA	NA	41.10	9.13	31.97	NA	1.9
S-5	05/13/1991	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
S-5	08/23/1991	NA	NA	NA	NA	NA	NA	NA	39.99	15.14	29.25	5.50	NA
S-5	11/07/1991	NA	NA	NA	NA	NA	NA	NA	39.99	15.10	29.17	5.35	NA
S-5	01/28/1992	NA	NA	NA	NA	NA	NA	NA	39.99	14.05	29.86	4.90	NA
S-5	05/06/1992	NA	NA	NA	NA	NA	NA	NA	39.99	14.31	30.21	5.66	NA
S-5	08/26/1992	NA	NA	NA	NA	NA	NA	NA	39.99	14.26	28.77	3.80	NA
S-5	10/28/1992	NA	NA	NA	NA	NA	NA	NA	39.99	14.22	28.82	3.81	NA
S-5	01/19/1993	NA	NA	NA	NA	NA	NA	NA	39.99	12.36	30.80	3.96	NA
S-5	04/29/1993	NA	NA	NA	NA	NA	NA	NA	39.99	9.64	31.07	0.90	NA
S-5	07/22/1993	NA	NA	NA	NA	NA	NA	NA	39.99	9.56	31.16	0.90	NA
S-5	10/21/1993	NA	NA	NA	NA	NA	NA	NA	39.99	11.23	29.34	0.73	NA
S-5	01/04/1994	NA	NA	NA	NA	NA	NA	NA	39.99	11.69	29.82	1.90	NA
S-5	04/13/1994	NA	NA	NA	NA	NA	NA	NA	39.99	11.42	29.87	1.62	NA
S-5	07/25/1994	NA	NA	NA	NA	NA	NA	NA	39.99	12.01	29.41	1.79	NA
S-5	10/10/1994	NA	NA	NA	NA	NA	NA	NA	39.99	12.05	29.38	1.80	NA
S-5	01/26/1995	NA	NA	NA	NA	NA	NA	NA	39.99	8.42	32.95	1.72	NA
S-5	04/21/1995	NA	NA	NA	NA	NA	NA	NA	39.99	10.03	30.90	1.17	NA
S-5	07/28/1995	NA	NA	NA	NA	NA	NA	NA	39.99	11.42	30.07	1.87	NA
S-5	10/31/1995	NA	NA	NA	NA	NA	NA	NA	39.99	13.21	27.21	0.54	NA
S-5	01/10/1996	NA	NA	NA	NA	NA	NA	NA	39.99	12.05	28.04	0.13	NA

Well ID	Date	TPPH (ug/L)	B (ug/L)	T (ug/L)	E (ug/L)	X (ug/L)	MTBE (ug/L)	8260 (ug/L)	TOB (MSL)	Depth to Water (ft.)	GW Elevation (MSL)	SPH Thickness (ft.)	DO Reading (ppm)
S-5	05/13/1991	NA	NA	NA	NA	NA	NA	NA	NA	39.99	14.60	30.57	6.48
S-5	08/23/1991	NA	NA	NA	NA	NA	NA	NA	NA	39.99	15.14	29.25	5.50
S-5	11/07/1991	NA	NA	NA	NA	NA	NA	NA	NA	39.99	15.10	29.17	5.35
S-5	01/28/1992	NA	NA	NA	NA	NA	NA	NA	NA	39.99	14.05	29.86	4.90
S-5	05/06/1992	NA	NA	NA	NA	NA	NA	NA	NA	39.99	14.31	30.21	5.66
S-5	08/26/1992	NA	NA	NA	NA	NA	NA	NA	NA	39.99	14.26	28.77	3.80
S-5	10/28/1992	NA	NA	NA	NA	NA	NA	NA	NA	39.99	14.22	28.82	3.81
S-5	01/19/1993	NA	NA	NA	NA	NA	NA	NA	NA	39.99	12.36	30.80	3.96
S-5	04/29/1993	NA	NA	NA	NA	NA	NA	NA	NA	39.99	9.64	31.07	0.90
S-5	07/22/1993	NA	NA	NA	NA	NA	NA	NA	NA	39.99	9.56	31.16	0.90
S-5	10/21/1993	NA	NA	NA	NA	NA	NA	NA	NA	39.99	11.23	29.34	0.73
S-5	01/04/1994	NA	NA	NA	NA	NA	NA	NA	NA	39.99	11.69	29.82	1.90
S-5	04/13/1994	NA	NA	NA	NA	NA	NA	NA	NA	39.99	11.42	29.87	1.62
S-5	07/25/1994	NA	NA	NA	NA	NA	NA	NA	NA	39.99	12.01	29.41	1.79
S-5	10/10/1994	NA	NA	NA	NA	NA	NA	NA	NA	39.99	12.05	29.38	1.80
S-5	01/26/1995	NA	NA	NA	NA	NA	NA	NA	NA	39.99	8.42	32.95	1.72
S-5	04/21/1995	NA	NA	NA	NA	NA	NA	NA	NA	39.99	10.03	30.90	1.17
S-5	07/28/1995	NA	NA	NA	NA	NA	NA	NA	NA	39.99	11.42	30.07	1.87
S-5	10/31/1995	NA	NA	NA	NA	NA	NA	NA	NA	39.99	13.21	27.21	0.54
S-5	01/10/1996	NA	NA	NA	NA	NA	NA	NA	NA	39.99	12.05	28.04	0.13



WELL CONCENTRATIONS
Shell-branded Service Station
999 San Pablo Avenue
Albany, CA

WIC #204-0079-0109

Well ID	Date	TPPH (ug/L)	B (ug/L)	T (ug/L)	E (ug/L)	X (ug/L)	MTBE 8020 (ug/L)	MTBE 8260 (ug/L)	TOB (MSL)	Depth to Water (ft.)	GW Elevation (MSL)	SPH Thickness (ft.)	DO Reading (ppm)
S-5	04/25/1996	NA	NA	NA	NA	NA	NA	NA	NA	39.99	9.68	30.33	0.03
S-5	07/23/1996	NA	NA	NA	NA	NA	NA	NA	NA	39.99	9.82	30.20	0.04
S-5	12/10/1996	270,000	8,800	29,000	5,200	37,000	<2,500	NA	NA	39.99	9.10	30.91	0.03
S-5 (D)	12/10/1996	400,000	9,200	32,000	7,200	50,000	<2,500	NA	NA	39.99	9.10	30.91	0.03
S-5	02/20/1997	88,000	2,000	11,000	1,600	19,000	<500	NA	NA	39.99	8.93	31.06	NA
S-5	05/22/1997	NA	NA	NA	NA	NA	NA	NA	NA	39.99	10.07	29.94	0.02
S-5	08/22/1997	NA	NA	NA	NA	NA	NA	NA	NA	39.99	10.24	29.77	0.02
S-5	11/03/1997	NA	NA	NA	NA	NA	NA	NA	NA	39.99	10.91	29.10	0.02
S-5	02/20/1998	NA	NA	NA	NA	NA	NA	NA	NA	39.99	7.81	32.20	0.03
S-5	05/18/1998	NA	NA	NA	NA	NA	NA	NA	NA	39.99	9.64	30.37	0.02
S-6	05/13/1991	13,000	600	140	210	310	NA	NA	NA	40.12	7.82	32.30	NA
S-6	08/23/1991	9,800	480	80	120	150	NA	NA	NA	40.12	9.58	30.54	NA
S-6	11/07/1991	6,200	240	23	25	27	NA	NA	NA	40.12	10.86	29.26	NA
S-6	01/28/1992	5,600	250	15	41	36	NA	NA	NA	40.12	8.97	31.15	NA
S-6	05/06/1992	7,100	330	29	110	210	NA	NA	NA	40.12	8.27	31.85	NA
S-6	08/26/1992	13,000	240	<50	56	780	NA	NA	NA	40.12	9.57	31.55	NA
S-6	10/28/1992	10,000	470	210	67	170	NA	NA	NA	40.12	8.90	32.22	NA
S-6	01/19/1993	4,800	100	26	27	45	NA	NA	NA	40.12	4.84	35.28	NA
S-6	04/29/1993	7,000	430	20	<12.5	42	NA	NA	NA	40.12	5.61	34.51	NA
S-6	07/22/1993	5,800	260	120	65	150	NA	NA	NA	40.12	6.56	33.56	NA
S-6	10/21/1993	5,500	270	69	120	140	NA	NA	NA	40.12	8.73	31.39	NA
S-6	01/04/1994	7,100	180	58	63	62	NA	NA	NA	40.12	7.14	32.98	NA
S-6	04/13/1994	NA	NA	NA	NA	NA	NA	NA	NA	40.12	7.21	32.91	NA
S-6	07/25/1994	12,000	190	52	30	39	NA	NA	NA	40.12	6.85	33.27	NA

Well ID	Date	TPPH (ug/L)	B (ug/L)	T (ug/L)	E (ug/L)	X (ug/L)	MTBE 8020 (ug/L)	MTBE 8260 (ug/L)	TOB (MSL)	Depth to Water (ft.)	GW Elevation (MSL)	SPH Thickness (ft.)	DO Reading (ppm)
S-6	05/13/1991	13,000	600	140	210	310	NA	NA	NA	40.12	7.82	32.30	NA
S-6	08/23/1991	9,800	480	80	120	150	NA	NA	NA	40.12	9.58	30.54	NA
S-6	11/07/1991	6,200	240	23	25	27	NA	NA	NA	40.12	10.86	29.26	NA
S-6	01/28/1992	5,600	250	15	41	36	NA	NA	NA	40.12	8.97	31.15	NA
S-6	05/06/1992	7,100	330	29	110	210	NA	NA	NA	40.12	8.27	31.85	NA
S-6	08/26/1992	13,000	240	<50	56	780	NA	NA	NA	40.12	9.57	31.55	NA
S-6	10/28/1992	10,000	470	210	67	170	NA	NA	NA	40.12	8.90	32.22	NA
S-6	01/19/1993	4,800	100	26	27	45	NA	NA	NA	40.12	4.84	35.28	NA
S-6	04/29/1993	7,000	430	20	<12.5	42	NA	NA	NA	40.12	5.61	34.51	NA
S-6	07/22/1993	5,800	260	120	65	150	NA	NA	NA	40.12	6.56	33.56	NA
S-6	10/21/1993	5,500	270	69	120	140	NA	NA	NA	40.12	8.73	31.39	NA
S-6	01/04/1994	7,100	180	58	63	62	NA	NA	NA	40.12	7.14	32.98	NA
S-6	04/13/1994	NA	NA	NA	NA	NA	NA	NA	NA	40.12	7.21	32.91	NA
S-6	07/25/1994	12,000	190	52	30	39	NA	NA	NA	40.12	6.85	33.27	NA



WELL CONCENTRATIONS
Shell-branded Service Station
999 San Pablo Avenue
Albany, CA

WIC #204-0079-0109

Well ID	Date	TTPH (ug/L)	B (ug/L)	T (ug/L)	E (ug/L)	X (ug/L)	MTBE 8020 (ug/L)	MTBE 8260 (ug/L)	TOB (MSL)	Depth to Water (ft.)	GW Elevation (MSL)	SPH Thickness (ft.)	DO Reading (ppm)
S-6 (D)	07/25/1994	7,200	170	32	31	34	NA	NA	40.12	6.85	33.27	NA	NA
S-6	10/10/1994	NA	NA	NA	NA	NA	NA	NA	40.12	6.20	33.92	NA	NA
S-6	01/26/1995	5,800	120	23	24	44	NA	NA	40.12	4.89	35.23	NA	NA
S-6	04/21/1995	NA	NA	NA	NA	NA	NA	NA	40.12	5.61	34.51	NA	NA
S-6	07/28/1995	4,400	210	23	34	60	NA	NA	40.12	5.30	34.82	NA	3
S-6 (D)	07/28/1995	6,100	230	20	38	59	NA	NA	40.12	5.30	34.82	NA	3
S-6	10/31/1995	NA	NA	NA	NA	NA	NA	NA	40.12	4.98	35.14	NA	NA
S-6	01/10/1996	6,800	170	87	35	105	NA	NA	40.12	5.67	34.45	NA	2.2
S-6 (D)	01/10/1996	7,800	230	120	50	210	NA	NA	40.12	5.67	34.45	NA	2.2
S-6	04/25/1996	NA	NA	NA	NA	NA	NA	NA	40.12	5.23	34.89	NA	NA
S-6	07/23/1996	2,600	170	<0.5	<0.5	8.5	<25	NA	40.12	5.40	34.72	NA	1.4
S-6	12/10/1996	NA	NA	NA	NA	NA	NA	NA	40.12	6.68	33.44	NA	0.7
S-6	02/20/1997	6,300	160	7.7	14	31	77	NA	40.12	5.70	34.42	NA	2
S-6	05/22/1997	NA	NA	NA	NA	NA	NA	NA	40.12	5.49	34.63	NA	0.9
S-6	08/22/1997	6,200	160	26	15	27	49	NA	40.12	5.71	34.41	NA	2.8
S-6	11/03/1997	NA	NA	NA	NA	NA	NA	NA	40.12	6.15	33.97	NA	1.4
S-6	02/20/1998	4,100	150	<10	<10	15	55	NA	40.12	5.25	34.87	NA	0.4
S-6	05/18/1998	NA	NA	NA	NA	NA	NA	NA	40.12	6.69	34.43	NA	0.4
S-6	08/20/1998	7,800	240	38	16	39	110	NA	40.12	6.04	34.08	NA	1.5
S-6 (D) b	08/20/1998	8,400	270	30	19	31	130	NA	40.12	6.04	34.08	NA	1.5
S-6	11/06/1998	NA	NA	NA	NA	NA	NA	NA	40.12	6.10	34.02	NA	NA
S-6	02/16/1999	6,000	190	19	14	20	<2.5	NA	40.12	5.84	34.28	NA	1.7
S-6	05/28/1999	NA	NA	NA	NA	NA	NA	NA	40.12	9.51	30.61	NA	1.9
S-6	08/24/1999	6,870	193	'32.1	18.8	36.4	<25.0	NA	40.12	8.29	31.83	NA	2.7



WELL CONCENTRATIONS
Shell-branded Service Station
999 San Pablo Avenue
Albany, CA

WIC #204-0079-0109

Well ID	Date	TTPH (ug/L)	B (ug/L)	T (ug/L)	E (ug/L)	X (ug/L)	MTBE (ug/L)	8020 (ug/L)	8260 (ug/L)	TOB (MSL)	Depth to Water (ft.)	GW Elevation (MSL)	SPH Thickness (ft.)	DO Reading (ppm)
S-7	05/13/1991	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	40.10	10.56	29.54	NA	NA
S-7	08/23/1991	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	40.10	11.16	28.94	NA	NA
S-7	11/07/1991	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	40.10	11.48	28.62	NA	NA
S-7	01/28/1992	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	40.10	10.72	29.38	NA	NA
S-7	05/06/1992	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	40.10	10.34	29.76	NA	NA
S-7	08/26/1992	160	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	40.10	11.13	28.97	NA	NA
S-7	10/28/1992	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	40.10	11.52	28.58	NA	NA
S-7	01/19/1993	50	1.1	0.6	1.9	9.2	NA	NA	NA	40.10	8.68	31.42	NA	NA
S-7	04/29/1993	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	40.10	9.90	30.20	NA	NA
S-7	07/22/1993	Well Inaccessible	NA	NA	NA	NA	NA	NA	NA	40.10	NA	NA	NA	NA
S-7	10/21/1993	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	40.10	11.10	29.00	NA	NA
S-7	01/04/1994	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	40.10	10.40	29.70	NA	NA
S-7	04/13/1994	<50	1.4	0.61	<0.5	0.64	NA	NA	NA	40.10	10.20	29.90	NA	NA
S-7 (D)	04/13/1994	<50	1.4	0.61	<0.5	0.66	NA	NA	NA	40.10	10.20	29.90	NA	NA
S-7	07/25/1994	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	40.10	10.48	29.62	NA	NA
S-7 a	10/10/1994	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	40.10	10.64	29.46	NA	NA
S-7	01/26/1995	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	40.10	7.75	32.35	NA	4.6
S-7	04/21/1995	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	40.10	8.51	31.59	NA	NA
S-7	07/28/1995	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	40.10	10.20	29.90	NA	3
S-7	10/31/1995	<50	<0.5	<0.5	<0.5	<0.5	NA	NA	NA	40.10	10.86	29.24	NA	4.9
S-7	01/10/1996	<50	<0.5	2	<0.5	2.6	NA	NA	NA	40.10	10.33	29.77	NA	7.6
S-7	04/25/1996	<50	<0.5	<0.5	<0.5	<0.5	<2.5	NA	NA	40.10	9.13	30.97	NA	6.2
S-7	07/23/1996	<50	<0.5	<0.5	<0.5	<0.5	14	NA	NA	40.10	10.18	29.92	NA	3.7
S-7	12/10/1996	<50	<0.5	<0.5	<0.5	<0.5	<2.5	NA	NA	40.10	9.04	31.06	NA	4.6
S-7	02/20/1997	<50	<0.50	<0.50	<0.50	<0.50	<2.5	NA	NA	40.10	9.60	30.50	NA	5



WELL CONCENTRATIONS
Shell-branded Service Station
999 San Pablo Avenue
Albany, CA

Wic #204-0079-0109

Well ID	Date	TPPH (ug/L)	B (ug/L)	T (ug/L)	E (ug/L)	X (ug/L)	MTBE 8020 (ug/L)	MTBE 8260 (ug/L)	TOB (MSL)	Depth to Water (ft.)	GW Elevation (MSL)	SPH Thickness (ft.)	DO Reading (ppm)
S-7	02/20/1997	<50	<0.50	<0.50	<0.50	<0.50	<2.5	NA	40.10	9.60	30.50	NA	5
S-7	05/22/1997	<50	1.3	<0.50	<0.50	<0.50	5.5	NA	40.10	10.63	29.47	NA	0.8
S-7	08/22/1997	<50	<0.50	<0.50	<0.50	<0.50	<2.5	NA	40.10	10.95	29.15	NA	2.6
S-7	11/03/1997	<50	2.2	1.7	0.58	3.4	<2.5	NA	40.10	11.29	28.81	NA	2.6
S-7	02/20/1998	350	23	13	14	42	3.8	NA	40.10	7.73	32.37	NA	4.6
S-7	05/18/1998	<50	<0.50	<0.50	<0.50	<0.50	<2.5	NA	40.10	10.29	29.81	NA	4.4
S-7	08/20/1998	Well inaccessible	NA	NA	NA	NA	NA	NA	40.10	11.00	29.10	NA	5.4
S-7	11/06/1998	<50	<0.50	<0.50	<0.50	<0.50	<2.5	NA	40.10	11.19	28.91	NA	5.2
S-7	02/16/1999	Well inaccessible	NA	NA	NA	NA	NA	NA	40.10	NA	NA	NA	NA
S-7	05/28/1999	<50.0	<0.500	<0.500	<0.500	<0.500	<5.00	NA	40.10	9.76	30.34	NA	2.7
S-7	08/24/1999	<50.0	<0.500	<0.500	<0.500	<0.500	<2.50	NA	40.10	10.61	29.49	NA	2.1
S-7	11/09/1999	<50.0	<0.500	<0.500	<0.500	<0.500	<2.50	NA	40.10	10.61	29.49	NA	2.1

Abbreviations:

TPPH= Total petroleum hydrocarbons as gasoline by modified EPA Method 8015

BTEX = benzene, toluene, ethylbenzene, xylenes by EPA Method 8020

MTBE = methyl-tertiary-butyl ether

TOB = Top of Wellbox Elevation

SPH = Separate-Phase Hydrocarbons

GW = Groundwater

DO = Dissolved Oxygen

ug/L = parts per billion

msl = Mean sea level



WELL CONCENTRATIONS
Shell-branded Service Station
999 San Pablo Avenue
Albany, CA

Wic #204-0079-0109

Well ID	Date	TPPH (ug/L)	B (ug/L)	T (ug/L)	E (ug/L)	X (ug/L)	MTBE (ug/L)	MTBE (ug/L)	TOB (MSL)	Depth to Water (ft.)	GW Elevation (MSL)	SPH Thickness (ft.)	DO Reading (ppm)
---------	------	----------------	-------------	-------------	-------------	-------------	----------------	----------------	--------------	----------------------------	--------------------------	---------------------------	------------------------

< n = Below detection limit

D = Duplicate sample

NA = Not applicable

Notes:

a = Sample analyzed for total dissolved solids (450 mg/L)

b = Surrogate recovery outside QC limits due to matrix effect.

c = Chromatogram pattern indicated an unidentified hydrocarbon.

When separate-phase hydrocarbons are present, ground water elevation is adjusted using the relation:
 Corrected ground water elevation = Top-of-casing elevation - depth to water + (0.8 x hydrocarbon thickness).



Attachment A

Previous Groundwater Contour Maps



Albany City Hall

SAN PABLO AVENUE

MARIN AVENUE

FIGURE
1

EXPLANATION

S-1 • Monitoring well location

RW-1 ☐ Recovery well

→ Inferred ground water flow direction

XX.XX Ground water elevation contour, in feet above mean sea level (msl), approximately located; dashed where inferred

Well designation

Ground water elevation (msl)

Benzene and MTBE concentrations are in parts per billion and are analyzed by EPA Method 8020




Base map from GeoStrategies Inc.

Shell-branded Service Station
999 San Pablo Avenue
Albany, California
Incident #98995143


C A M B R I A

**Ground Water Elevation
Contour Map**


November 16, 1999

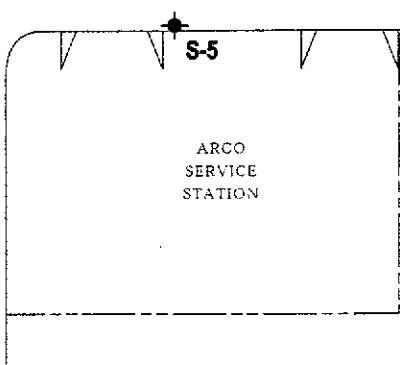

0 20 40
Scale (ft)

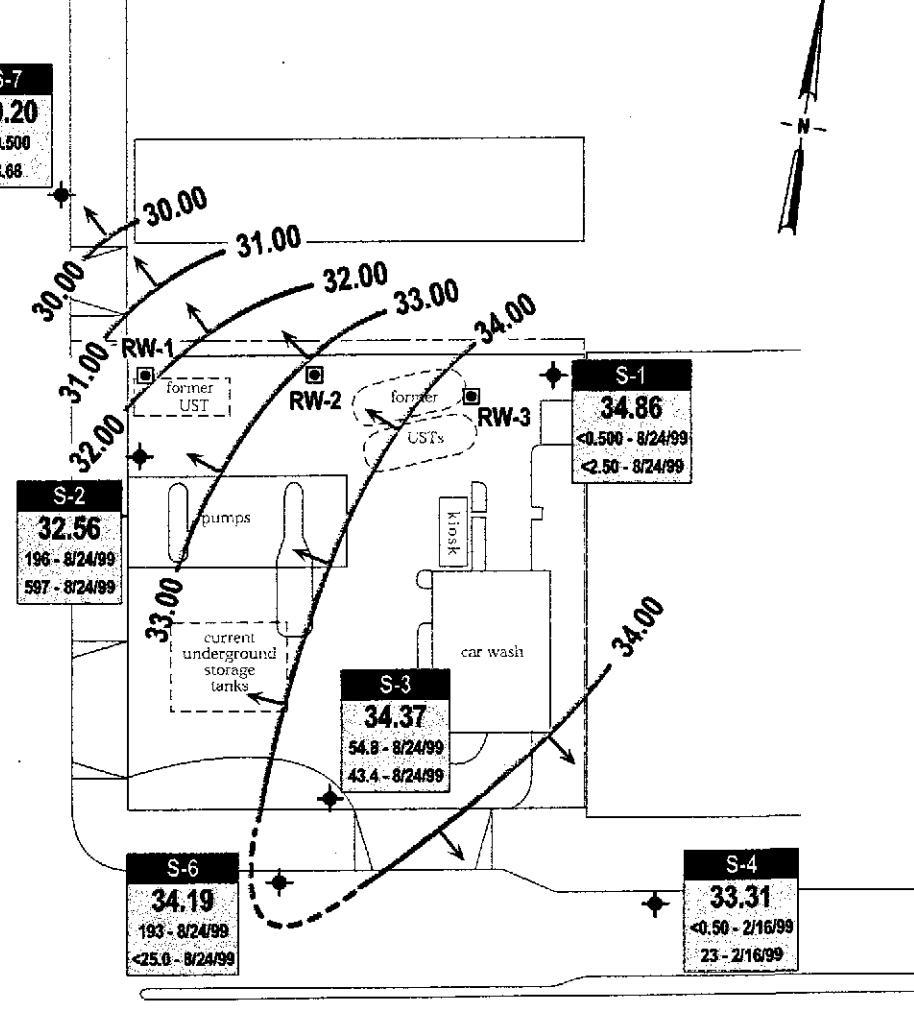



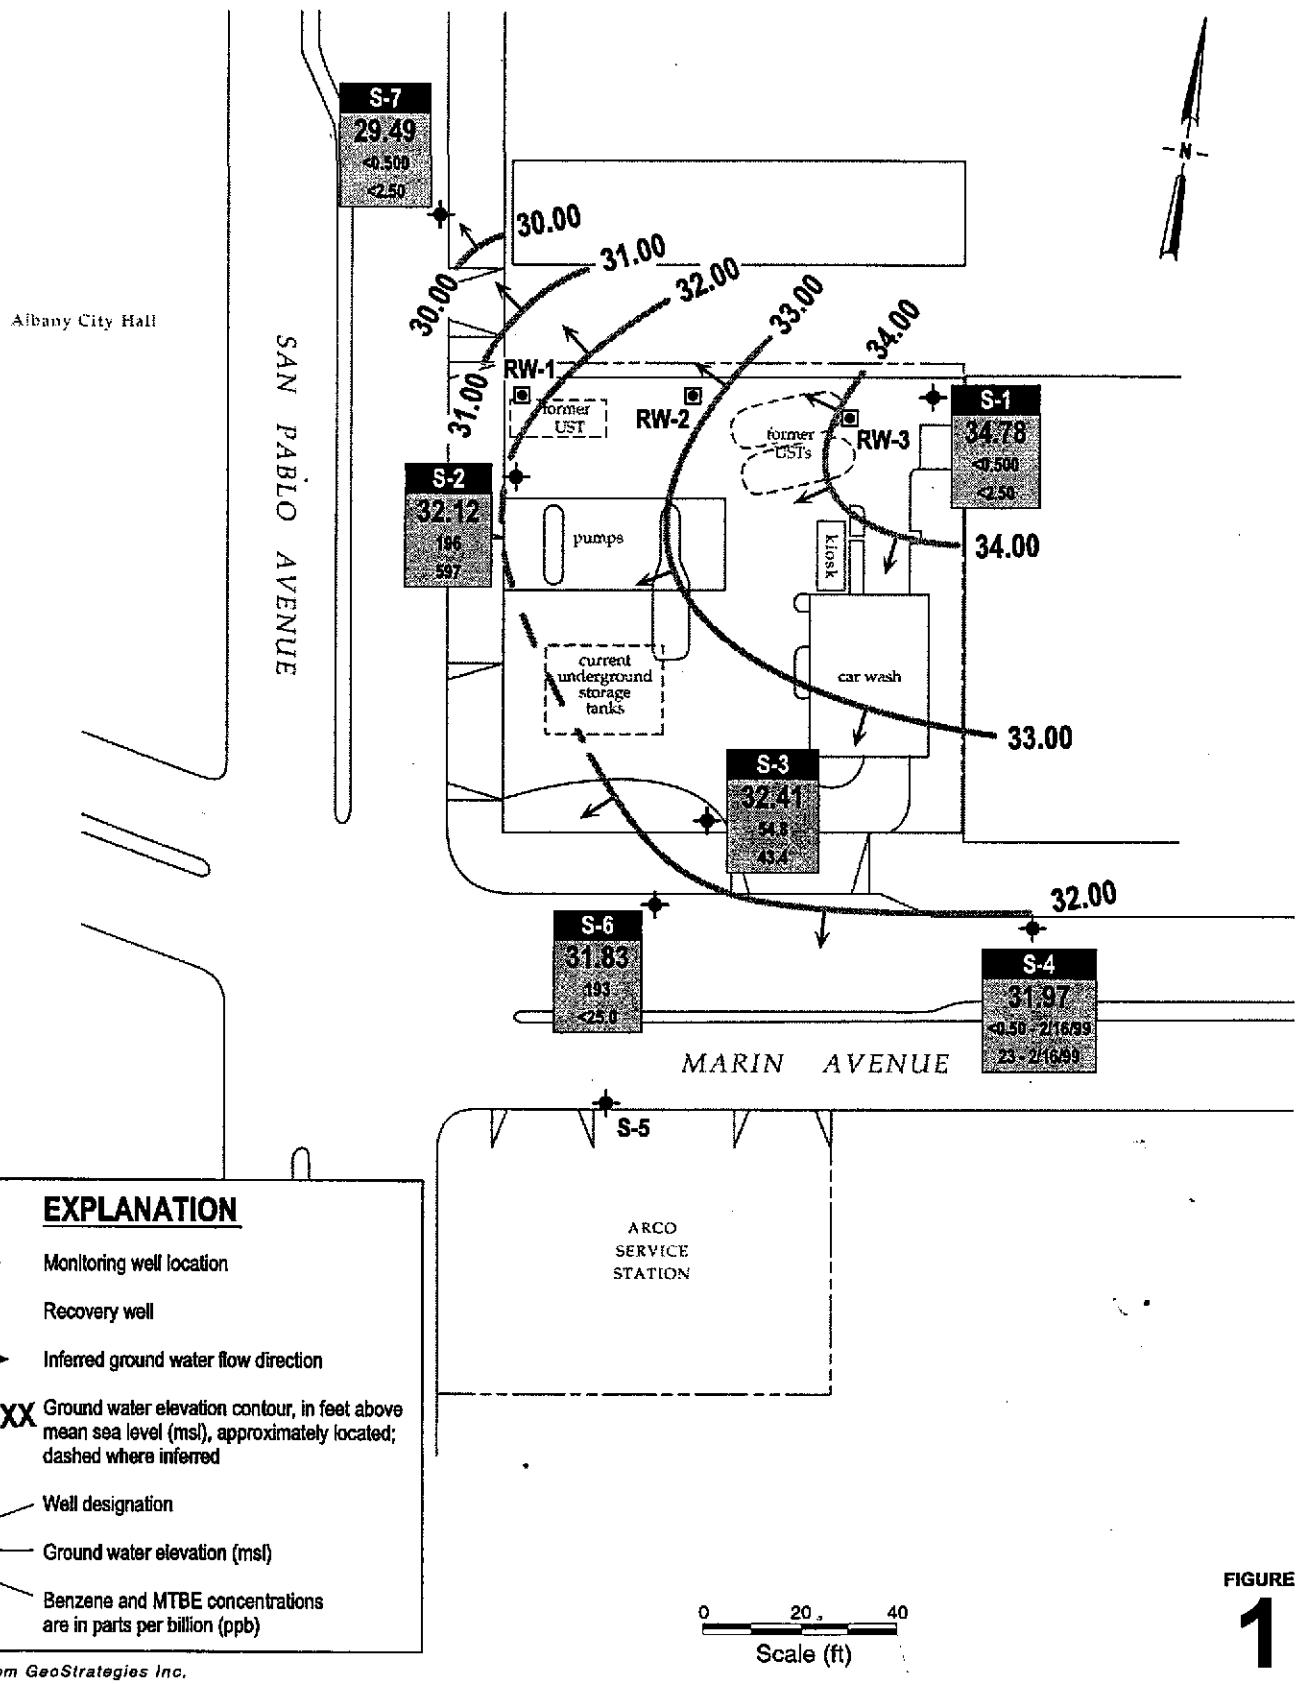

Shell-branded Service Station
999 San Pablo Avenue
Albany, California
Incident #98995143

CAMBRIA

**Ground Water Elevation
Contour Map**

August 24, 1999



Albany City Hall

SAN PABLO AVENUE

MARIN AVENUE

EXPLANATION

S-1 • Monitoring well location

RW-1 ☐ Recovery well

→ Inferred ground water flow direction


— XX.XX Ground water elevation contour, in feet above mean sea level (msl), approximately located; dashed where inferred

Well designation


ELEV Ground water elevation (msl)

Benzene MTBE Benzene and MTBE concentrations are in parts per billion (ppb)

Base map from GeoStrategies Inc.

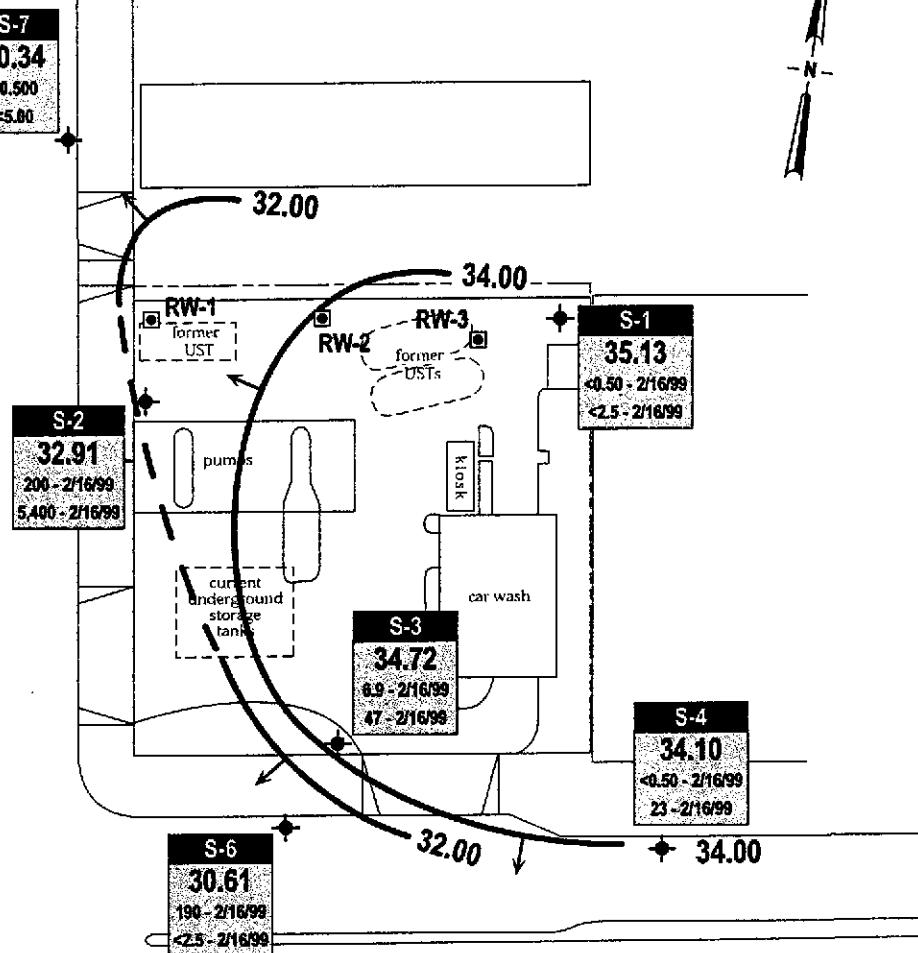
FIGURE
1

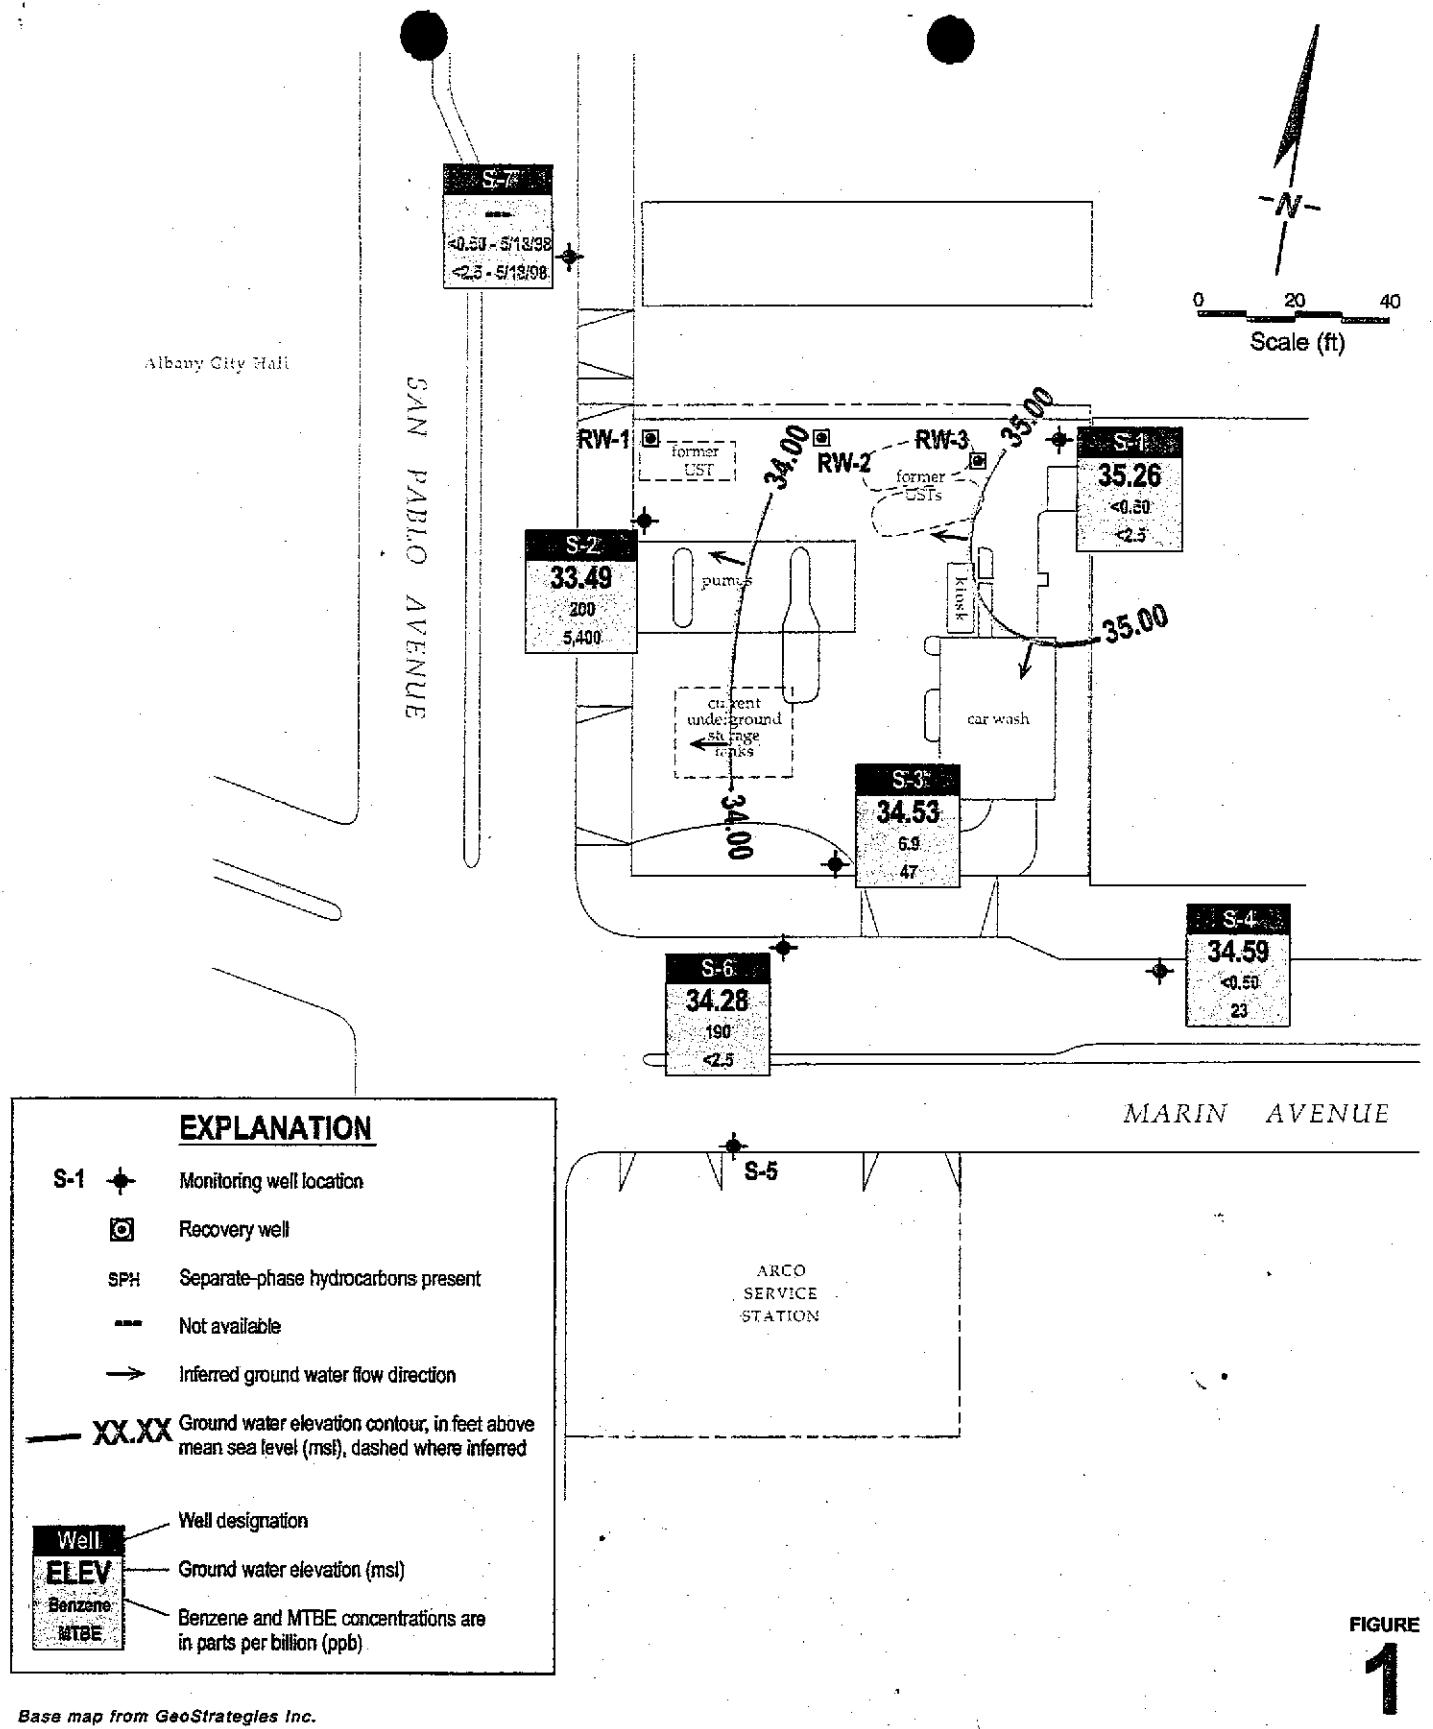

Shell-branded Service Station
999 San Pablo Avenue
Albany, California
Incident #98995143

CAMBRIA


**Ground Water Elevation
Contour Map**
February 16, 1999



Albany City Hall

SAN PABLO AVENUE

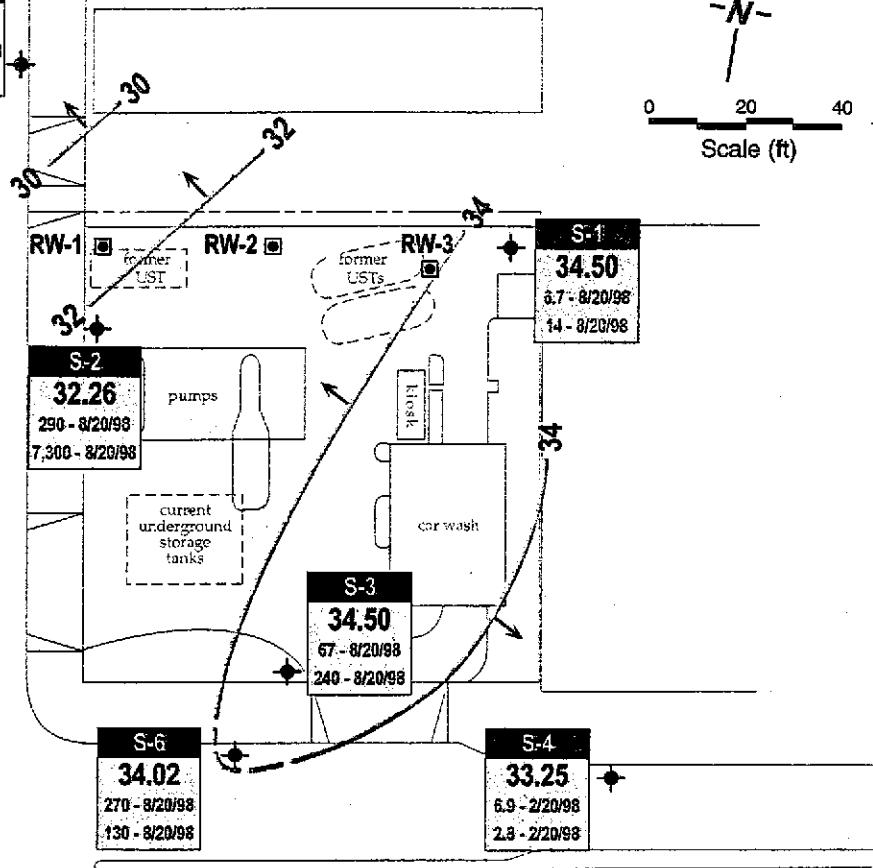

Scale (ft)


MARIN AVENUE

EXPLANATION

- ♦ Monitoring well location
- Recovery well
- SPH Separate-phase hydrocarbons present
- Inferred ground water flow direction
- XX.XX Ground water elevation contour, in feet above mean sea level (msl), dashed where inferred

- Well designation
- ELEV**
- Benzene
MTBE
- Ground water elevation (msl).
- Benzene and MTBE concentrations are measured in parts per billion (ppb)

Base map from GeoStrategies Inc.

FIGURE
1




CAMBRIA

Environmental Technology, Inc.

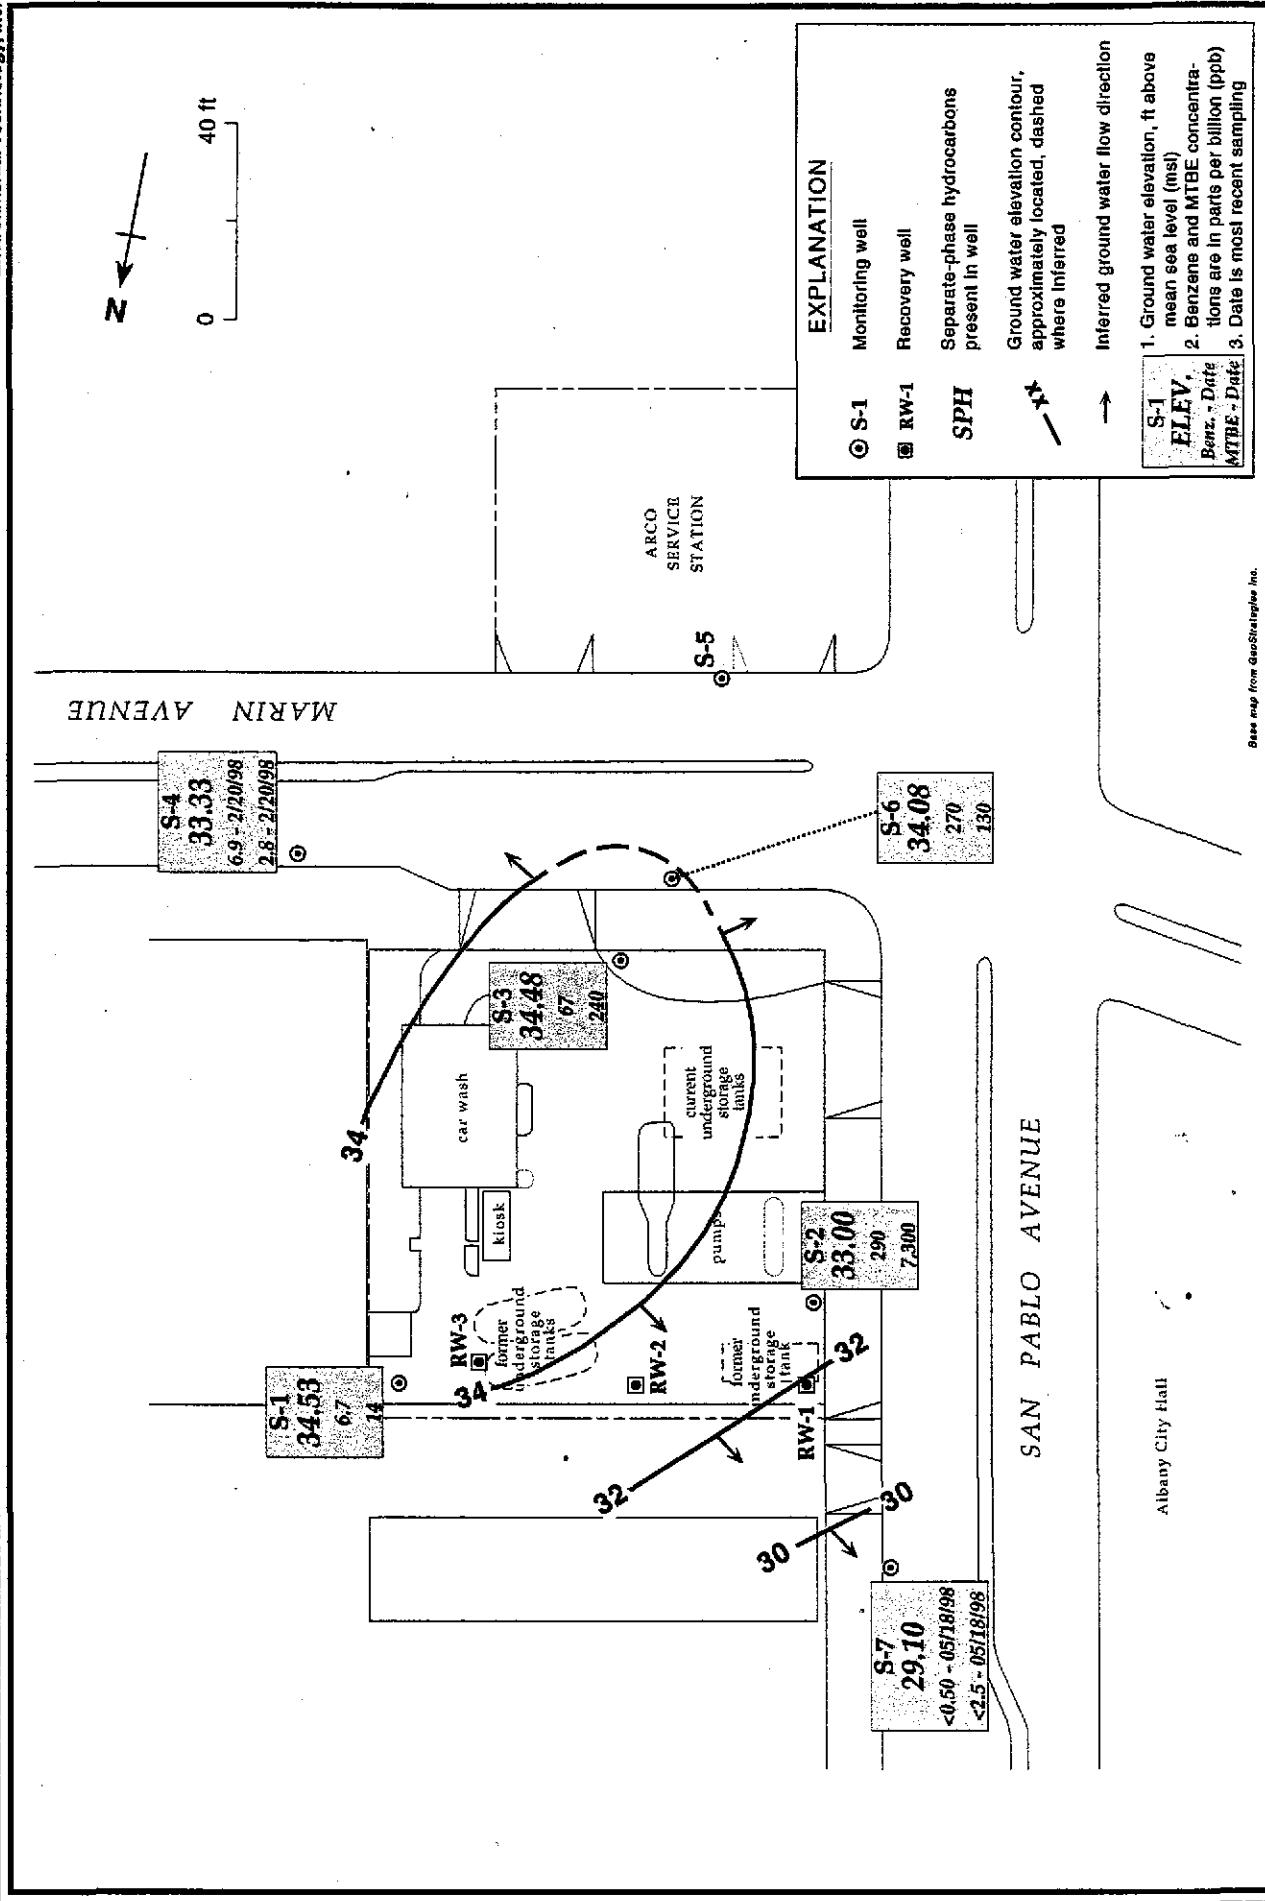


Figure 1. Ground Water Elevation Contours - August 20, 1998 - Shell-branded Service Station WIC #204-0079-0109, 999 San Pablo Avenue, Albany, California



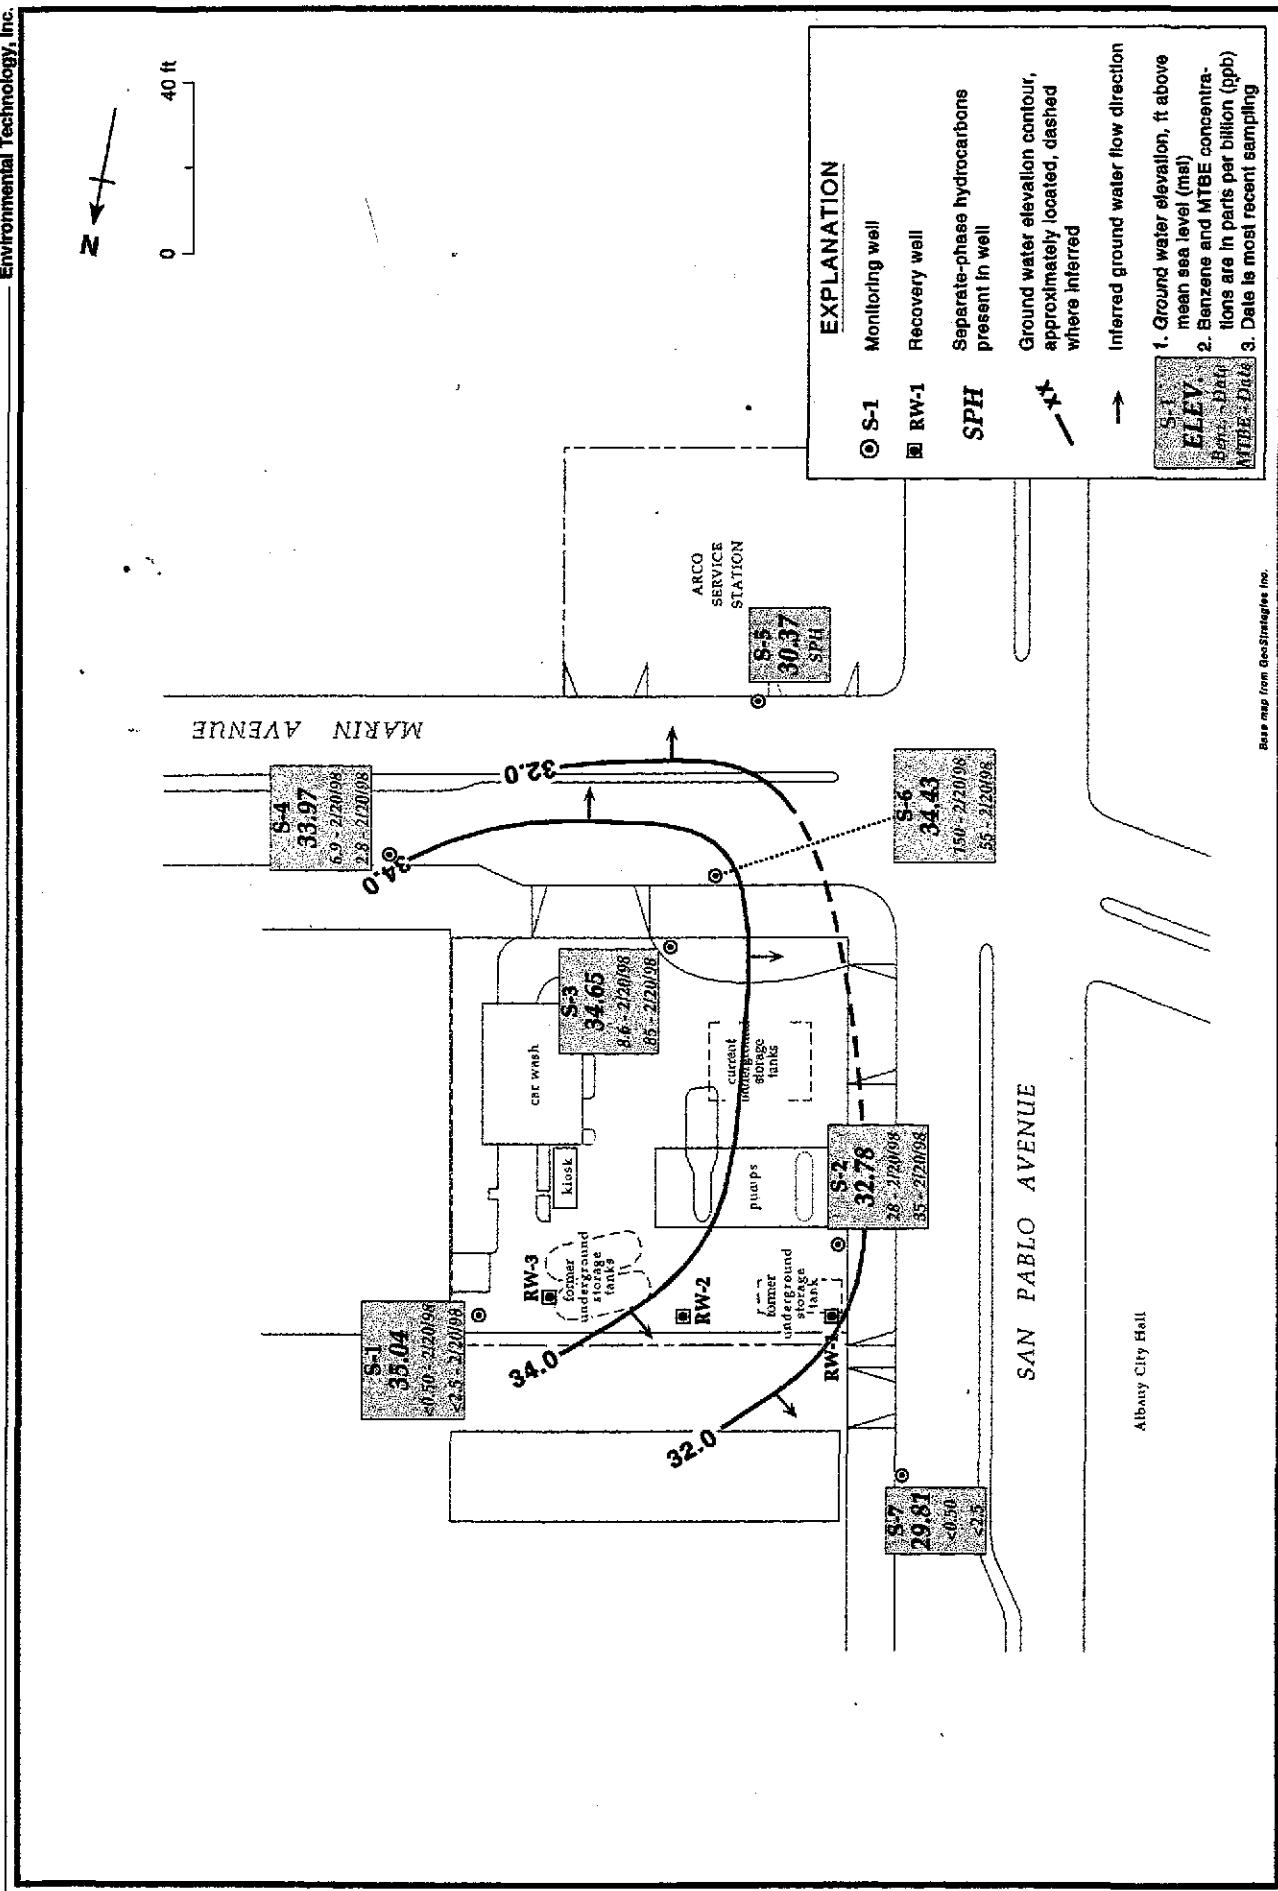


Figure 1. Ground Water Elevation Contours - May 18, 1998 - Shell-branded Service Station WIC #204-0079-0109, 909 San Pablo Avenue, Albany, California



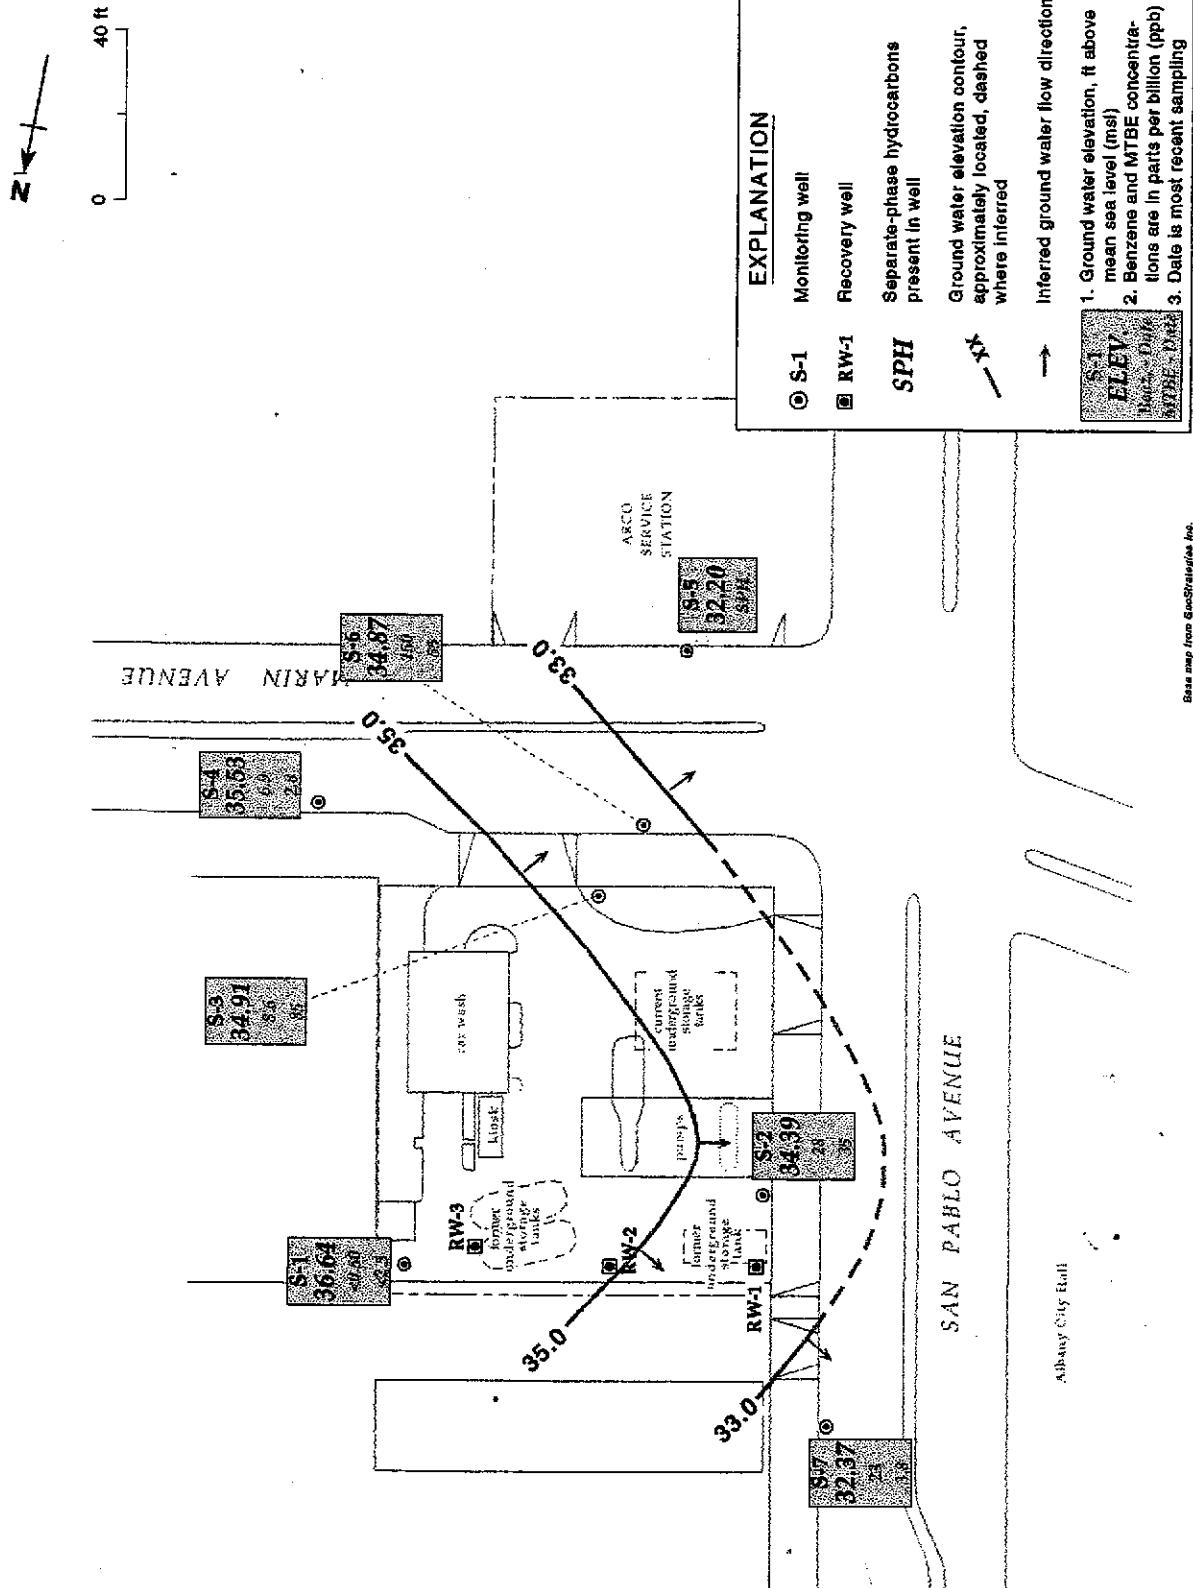


Figure 1. Ground Water Elevation Contours - February 20, 1993 - Shell Service Station WIC #204-0079-0109, 999 San Pablo Avenue, Albany, California

