

Alamanda Tourly

April 12, 2004

APR 1 4 2004

Mr. Barney Chan Hazardous Materials Specialist Alameda County Health Care Services Agency 1131 Harbor Bay Parkway, 2nd Floor Alameda, CA 94502 RE:

1st Quarter 2004, Quarterly Groundwater Monitoring and Product Recovery Report – 2277 Seventh Street, Oakland, CA

Dear Mr. Chan:

Please find enclosed the subject Port of Oakland (Port) groundwater monitoring and product recovery report for 2277 Seventh Street in Oakland, California. This report is being submitted in accordance with Alameda County Health Care Services Agency (ACHCSA) requirements.

The next monitoring event will be performed during the second quarter of 2004, and will be in accordance with the aforementioned requirements. If you have any questions or comments regarding the results, please contact me at (510) 627-1134.

Sincerely,

Jeffrey L. Rubin, CPSS, REA

Port Associate Environmental Scientist

Environmental Health and Safety Compliance

Enclosure: noted

Cc (w encl.):

Michele Heffes

Cc (w/o encl.):

Jeff Jones

Rogerio Leong (Innovative Technical Solutions, Inc.) Rachel B. Hess (Innovative Technical Solutions, Inc.) Jeffrey D. Hess (Innovative Technical Solutions, Inc.)



April 09, 2004

Mr. Jeff Rubin Associate Environmental Scientist Port of Oakland 530 Water Street Oakland, California 94607

First Quarter of 2004 Quarterly Groundwater Monitoring and Product Monitoring Report 2277 Seventh Street Oakland, California

Dear Mr. Rubin:

Innovative Technical Solutions, Inc. (ITSI) is pleased to submit this report to the Port of Oakland (Port) for the groundwater monitoring and sampling program at 2277 7th Street in Oakland, California (Figure 1). This report summarizes the quarterly monitoring of four groundwater-monitoring wells (MW-2, MW-4, MW-5, and MW-8A) at 2277 7th Street. The locations of these wells are shown on Figure 2.

This report also encompasses the operation of the product recovery system at the 2277 7th Street site. The operation of the active product recovery system was stopped since April 2003 when a section of the conveyance system was removed for construction upgrades at the site. Collection of groundwater samples from monitoring wells MW-1 and MW-3 was not performed this quarter due to the presence of separate-phase petroleum hydrocarbons.

BACKGROUND

Monitoring wells were installed to assess groundwater quality following the removal of underground storage tanks (USTs) from the site in September 1993. The former USTs, located on the south side of Building C-401, consisted of two 10,000-gallon gasoline tanks (CF-17 and CF-18), one 500-gallon oil tank (CF-19), and one 300-gallon waste oil tank (CF-20). On April 20, 2000, Harding ESE (Harding) performed oversight of the abandonment of monitoring well MW-8, located at the northern edge of the property. This monitoring well was properly destroyed1 to accommodate the construction of a railroad track associated with the Port of Oakland Vision 2000 improvements. All surface structures, including the well, needed to be removed.

Harding monitored MW-8 from 1998 until it was abandoned. During this time, no groundwater samples were collected because the well contained a thick, viscous, tar-like petroleum product. After the railroad construction was completed, the Port had a replacement well, MW-8A, installed in the same vicinity on October 2, 2001 by ITSI. MW-8A has been sampled since the Fourth quarter of 2001, and no separate phase petroleum has been detected.

www.itsi.com

^{1.} Destruction and abandonment of all monitoring wells were performed in accordance with Alameda County Public Works Agency Guidelines.

Site preparation activities for the construction of a new Harbor Facilities Center (HFC) were initiated in November 2002. The eastern side of Building C-401 was demolished, and the asphalt pavement east of the building was removed in December 2002. A concrete ring was placed around each well for protection and prevention from damage by heavy equipment during site demolition. Two monitoring wells (MW-6 and MW-7) were properly destroyed to facilitate the construction plans at the site, and six monitoring wells (MW-1, MW-2, MW-3, MW-4, MW-5, MW-8A) still remain onsite. The surface grade was raised approximately 2 feet in the vicinity of wells MW-2 and MW-3 during the first quarter of 2003.

On April 16, 2003, ITSI on behalf of the Port oversaw the removal of a 100-foot section of the product recovery conveyance system (refer to Figure 2). The Port contracted Dillard Environmental Services (Dillard) to perform the work. The section of product recovery system was removed to minimize interference with site development. A new product removal system will be installed after development activities are completed. The conveyance system consisted of a PVC conduit pipe containing the pneumatic and product recovery lines. These lines connected the system control box and the recovery tank to the skimmer pump installed in well MW-3. Portions of the surface concrete pieces and asphalt from the trench line were appropriately excavated, removed and stockpiled onsite. Sections of the removed conduit pipes and product line were appropriately disposed of and transported offsite by Dillard as non-RCRA hazardous solid waste material under the Uniform Hazardous Waste Manifest.

Monitoring wells were previously installed at the adjacent 2225 7th Street site to assess groundwater quality following the removal of USTs in 1989 and 1992. The 2225 7th Street site is also currently under modification for the construction of the future HFC. Buildings C-406 and C-407 were demolished and the entire surrounding asphalt pavement was removed in November 2002. The three former monitoring wells (MW-1, MW-2, and MW-3) located at the site were properly destroyed to facilitate the Port's construction plans.

On November 17 and 18, 2003, ITSI personnel raised monitoring wells MW-2 and MW-3 to match the asphalt surface elevation of the future HFC parking lot. New traffic rated well boxes were placed on the two wells and the elevation of the top of each well box was set with a laser level instrument. The elevations of the wells were subsequently surveyed on November 26, 2003 to a relative Port of Oakland datum by PLS Surveys, Inc. (PLS).

GROUNDWATER MONITORING

ITSI personnel performed groundwater monitoring and sampling at the 2277 7th Street site on March 5, 2004. Prior to purging and sampling the monitoring wells, the depth to groundwater below the top of the well casing was measured with a water level indicator. After measuring the depth to water, the wells were purged using a disposable bailer. Conductivity, pH, and temperature were monitored periodically during purging. Collection of groundwater samples was performed after removing a minimum of three well-casing volumes of water and upon stabilization of three consecutive measurements of conductivity, pH, and temperature. The depths to groundwater and field parameter measurements were recorded on the respective Monitoring Well Water Level Measurement and Monitoring Well Purging and Sampling forms included as Appendix A. The purge water was stored onsite in the treatment system's product recovery tank. Dillard Environmental Services Company, Inc. (Dillard) periodically removes and appropriately disposes of the purge water along with the product in the tank.



ITSI collected groundwater samples from the monitoring wells using Teflon disposable bailers and then transferred the groundwater into laboratory-provided containers. A duplicate sample was collected for quality assurance. Sample containers were labeled with the sample number, date and time of collection, and sampler's initials, and then placed in an insulated cooler with ice. The samples were accompanied by a laboratory provided trip blank and delivered under chain-of-custody protocol to Curtis & Tompkins in Berkeley, a California certified analytical laboratory.

The first quarter 2004 groundwater monitoring event at 2277 7th Street involved monitoring and sampling of monitoring wells MW-2, MW-4, MW-5, and MW-8A, and monitoring of the free-phase petroleum product in wells MW-1 and MW-3. Groundwater level measurements are summarized in Table 1 and product thickness measurements are summarized on Table 2. The groundwater gradient direction is presented on Figure 3. Copies of the respective Monitoring Well Water Level Measurement and Monitoring Well Purging and Sampling forms are included in Appendix A.

LABORATORY ANALYSIS OF GROUNDWATER SAMPLES

Curtis and Tompkins of Berkeley, California performed the chemical analyses of the groundwater samples using the following analytical methods:

- Total petroleum hydrocarbons as gasoline (TPHg) in accordance with EPA Method 8015B.
- Benzene, toluene, ethylbenzene, and xylenes (BTEX) and methyl t-butyl ether (MTBE) in accordance with EPA Method 8021B with confirmation of MTBE by EPA Method 8260B.
- TPH as diesel (TPHd) in accordance with EPA Method 8015B following a silica-gel cleanup procedure.
- TPH as motor oil (TPHmo) in accordance with EPA Method 8015B following a silica-gel cleanup procedure.

The laboratory results for 2277 7th Street are summarized in Table 3 and are shown on Figure 4. Copies of the laboratory results and chain-of-custody forms are provided in Appendix B.

FINDINGS

Groundwater measurements were conducted on March 5, 2004. The water levels are presented in Table 1. The groundwater elevation contour map is presented on Figure 3. According to these contours, the groundwater appears to be flowing towards the north-northeast. The groundwater flow direction observed during March 2004 is consistent with the historic flow direction reported in the previous reports.

Results of the March 5, 2004 groundwater sampling at 2277 7th Street are summarized below:

- TPHg was detected in one well at a concentration of 90 µg/L in MW-4. The laboratory, however, classified the result as a sample exhibiting unknown single peak of peaks.
- Benzene was detected in one monitoring wells at a concentration of 190 μg/L in MW-4.
- Toluene was detected in one well at a concentration of 1.1 μg/L in MW-4.



- Ethylbenzene was detected in one well at a concentration of 0.55 μg/L in MW-4.
- Total xylenes was detected in one monitoring well at a concentration of 0.50 μg/L in MW-4.
- MTBE was detected in one well at a concentration of 23 μg/L in MW-4 using EPA method 8021B.
 However, the same sample was not detected above the reporting limit using confirmation by EPA method 8260B.
- TPHd was not detected in any of the wells sampled this quarter.
- TPHmo was not detected above the reporting limit in any of the wells sampled this quarter.

QUALITY ASSURANCE AND QUALITY CONTROL

A duplicate sample was collected simultaneously from monitoring well MW-4 and labeled as MW-4D at 2277 7^{th} Street on March 5, 2004 and submitted to the analytical laboratory to evaluate the precision of the analytical results. Precision is an indication of the reproducibility of results and is assessed by calculating the relative percent difference (RPD) between the primary sample result (X_1) and the duplicate sample result (X_2), as follows:

$$RPD = \frac{X_1 - X_2}{(X_1 + X_2)/2} \times 100$$

For example: A low RPD indicates high precision; a RPD of 67 percent indicates the two results differ by a factor of two. As shown below, the RPD was calculated for chemical compounds detected above the reporting limit in either the duplicate or primary sample.

2277 7th St. MW-4 03/05/04

ANALYTE	X ₁	X ₂	RPD
MTBE*	<0.5	<0.5	
В	190	180	5.41%
T	1.1	0.81	30.37%
E	0.55	<0.50	
X	0.50	<0.50	-
TPHd	<50	<50	
TPHg	90	84	6.89%

^{*} MTBE confirmation results by EPA Method 8260B

• The relative percent difference between the analytical results from MW-4 and its duplicate sample MW-4D ranged from 5.41% to 30.37%. The overall RPD values indicate that the results from the sample and the duplicate analysis are in agreement.



PRODUCT RECOVERY SYSTEM AT 2277 7TH STREET

Until April 16, 2003 the product recovery system at 2277 7th Street consisted of an air-actuated (active) product skimmer in MW-3. The product in MW-3 was discharged to a product recovery 1,000-gallon tank that Foss Environmental Services Company, Inc. (former contractor) emptied at various times throughout a quarter. A passive skimmer was installed in MW-1, although it was removed on May 22, 2000 because no measurable product appeared in the well. The passive skimmer was subsequently replaced in the well during the following months after free product was measured in MW-1. The active and passive product recovery systems are currently interrupted with both skimmers removed from the wells due to the activities related to the construction of the new HFC at the site. Table 2 presents a summary of the product thickness data. A summary of the activities during the past quarters associated with the operation and maintenance of the product recovery system is presented in Table 4.

The free-phase petroleum product has been monitored in wells MW-1 and MW-3 on a quarterly basis during the quarterly groundwater sampling event. Free-phase petroleum product was measured at 0.31 feet and 1.46 feet in MW-1 and MW-3, respectively, this quarter.

We appreciate the opportunity to present this report and trust that this document meets with your approval. Please do not hesitate to contact us at (925) 946-3105 with any questions or comments.

Sincerely yours,

INNOVATIVE TECHNICAL SOLUTIONS, INC.

Rogerio Leong Project Geologist

Rachel B. Hess

Project Manager

Jeffrey D. Hess R.G. Senior Geologist

SATE



Attachments:

Table 1 – Groundwater Elevations Data, 2277 7th Street

Table 2 - Summary of Product Removal and Product Thickness, 2277 7th Street

Table 3 – Groundwater Sample Results, 2277 7th Street

Table 4 - Summary of Operation and Maintenance Activities

Figure 1 - Site Location Map

Figure 2 – Site Plan

Figure 3 – Groundwater Elevations, 2277 7th Street, March 5, 2004

Figure 4 – Groundwater Sample Results, 2277 7th Street, March 5, 2004

Appendix A – Monitoring Well Water Level Measurement Form and Monitoring Well Purging and Sampling Form

Appendix B - Laboratory Reports

Appendix C - Daily Field Activity Report

Table 1
Groundwater Elevations Data
Port of Oakland, 2277 7th Street, Oakland, California

Well Elevation ID Top of Casing (feet)		Date Of Monitoring	Depth to Water (feet)	Groundwater Elevation (feet)		
MW-1	14.14	4/18/2000	8.21	5.93		
		5/22/2000	8.17	5.97		
		7/10/2001	10.00	4.14		
	•	12/12/2001	NA	NA		
		3/8/2002	NA	NA		
		6/13/2002	NA	NA		
		9/26/2002	NA	NA		
		12/12/2002	NA	NA		
		3/17/2003	NA	NA		
		6/18/2003	NA	NA		
	•	9/3/2003	NA	NA		
		11/26/2003	NA	NA		
•		3/5/2004	NA	NA		
MW-2	14.36	12/31/1997	8.73'	5.63		
•		4/13/1998	7.72	6.64		
		11/6/1998	9.43	4.93		
		3/19/1999	8.21	6.15		
		6/24/1999	8.91	5.45		
		9/28/1999	9.42	4.94		
	,	11/12/1999	9.63	4.73		
		2/11/2000	8.54	5.82		
		5/22/2000	8.10	6.26		
		9/6/2000	8.79	5.57		
•		12/19/2000	9.19	5.17		
		2/21/2001	7.99	6.37		
•		4/3/2001	8.23	6.13		
		7/10/2001	8.70	5.66		
		12/12/2001	8.16	6.20		
		1/22/2002	7.64	6.72		
		3/8/2002	8.31	6.05		
		6/13/2002	8.64	5.72		
		9/26/2002	8.95	5.41		
		12/12/2002	9.17	5.19		
		3/17/2003	7.77	6.59		
		6/18/2003	8.44	5.92		
		9/3/2003	8.98	5.38		
	17.21	11/26/2003	12.01	5.20		
	17.4-1	3/5/2004	9.75	7.46		

Table 1
Groundwater Elevations Data
Port of Oakland, 2277 7th Street, Oakland, California

Well ID	Elevation Top of Casing	Date Of Monitoring	Depth to Water	Groundwater Elevation
113	(feet)		(feet)	(feet)
MW-4	13.15	12/31/1997	7.09	6.06
		4/13/1998	7.71	5.44
		11/6/1998	8.69	4.46
		3/19/1999	8.00	5.15
		6/24/1999	8.45	4.70
	•	9/28/1999	8.73	4.42
		11/12/1999	8.83	4.32
	ě	2/11/2000	7 .71	5.44
•	•	5/22/2000	8.09	5.06
•		9/6/2000	8.32	4.83
		12/19/2000	8.47	4.68
		2/21/2001	7.51	5.64
		4/3/2001	8.13	5.02
		7/10/2001	8.12	5.03
		12/12/2001	7.65	5.50
		1/22/2002	7.60	5.55
		3/8/2002	7.96	5 . 1 9
		6/13/2002	8.20	4.95
		9/26/2002	8.21	4.94
		12/12/2002	8.38	4.77
	•	3/17/2003	7.72	5.43
		6/18/2003	8.02	5.13
	•	9/3/2003	8.29	4.86
-		11/26/2003	8.69	4.46
	·	3/5/2004	7.45	5.70
MW-5	13.49	12/31/1997	6.38	7.11
		4/13/1998	5.56	7.93
		11/6/1998	6.59	6.90
		3/19/1999	6.20	7.29
	•	6/24/1999	6.73	6.76
		9/28/1999	6.91	6.58
		11/12/1999	7.06	6.43
		2/11/2000	7.00	6.49
•		5/22/2000	6.21	7.28
		9/6/2000	6,56	6.93
		12/19/2000	6.68	6.81
		2/21/2001	6.08	7.41
		4/3/2001	6.38	7.11
		7/10/2001	6.58	6.91
		12/12/2001	6.40	7.09
		1/22/2002	6.10	7.39
		3/8/2002	6.10·	7.39
	•	6/13/2002	6.31	7.18
		9/26/2002	6.60	6.89
		12/12/2002	6.75	6.74
	•	3/17/2003	5,73	7.76
		6/18/2003	6.10	7.39
		9/3/2003	6.50	6.99
		11/0/1000	6.70	6.79
		11/26/2003 3/5/2004	6.70 5.70	7.79

Table 1
Groundwater Elevations Data
Port of Oakland, 2277 7th Street, Oakland, California

Well ID	Elevation Date Of Top of Casing Monitoring (feet)		Depth to Water (feet)	Groundwater Elevation (feet)		
MW-6	14.00	6/24/1999	8.61	5.39		
		9/28/1999	9.26	4.74		
		11/12/1999	8.01	5.99		
	·	2/11/2000	7.20	6.80		
		5/22/2000	7.13	6.87		
		9/6/2000	7.12	6.88		
		12/19/2000	7.57	6.43		
		2/21/2001	7.50	6.50		
•		4/3/2001	6.88	7.12		
		7/10/2001	7.15	6.85		
		12/12/2001	9.50	4.50		
		1/22/2002	6.69	7.31		
•		3/8/2002	6.98	7.02		
		6/13/2002	7.45	6.55		
		9/26/2002	7.95	6.05		
-		12/12/2002	7.71	6.29		
		12/18/2002	'Monitoring	well was destroyed		
MW-7	14.35	12/31/1997	8.88	5.47		
	4.5	4/13/1998	7.86	6.49		
		11/6/1998	9.55	4.80		
		3/19/1999	8.41	5.94		
		6/24/1999	9.08	5.27		
		9/28/1999	9.60	4.75		
		11/12/1999	9.77	4.58		
		2/11/2000	8.67	5.68		
	•	5/22/2000	8.43	5.92		
		9/6/2000	8.88	5.47		
		12/19/2000	9.21	5.14		
		2/21/2001	8.13	6.22		
		4/3/2001	8.45	5.90		
		7/10/2001	8.87	5.48		
-	•	12/12/2001	8.39	5.96		
		1/22/2002	7.99	6.36		
		3/8/2002	8.51	5.84		
		6/13/2002	8.90	5.45		
		9/26/2002	9.00	5.35		
		12/12/2002	9.28	5.07		
		12/18/2002	Monitoring	well was destroyed		

Table 1
Groundwater Elevations Data
Port of Oakland, 2277 7th Street, Oakland, California

Well ID	Elevation Date Of Depth Top of Casing Monitoring to Water (feet) (feet)		to Water	er Elevation		
MW-8A	12.94	12/12/2001	7.20	NA		
		1/22/2002	7.20	5.74		
	·	3/8/2002	7.70	5,24		
		6/13/2002	7.72	5.22		
		9/26/2002	7.91	5.03		
		12/12/2002	8.15	4.79		
•		3/17/2003	7.28	5.66		
		6/18/2003	7.72	5.22		
	•	9/3/2003	8.18	4.76		
		11/26/2003	8.55	4.39		
		3/5/2004	6.92	6.02		

¹ Elevation data relative to Port of Oakland datum; well surveys performed on September 12, 1996, February 4, 1998, and November 26, 2003, by PLS Surveys.

NA = Not available

⁻ Data prior to November 6, 1998 taken from Groundwater Monitoring, Sampling and Product Removal System O&M Report dated July 21, 1998, by Innovative Technical Solutions, Inc.

⁻ Monitoring MW-8 was abandoned on April 20, 2000 in order to construct a railroad track associated with the Port of Oakland Vision 2000.

Table 2 Summary of Product Removal and Product Thickness Port of Oakland, 2277 7th Street, Oakland, California

Well	Elevation of Top of Casing (feet)	Date Of Monitoring	Depth to Free Product (feet)	Depth to Water (feet)	Product Thickness (feet)	Estimated Product Removed (gallons)	Product Removal Method ²
MW-1	14.14	12/31/1997	-	-	-	0.2	passive skimmer
		1/29/1998	-	-	7 -	0.2	passive skimmer
		3/2/1998	-	-	-	0.018	passive skimmer
		5/11/1998	-	-	-	0.02	passive skimmer
		6/15/1998	-	-	- ,	0.2	passive skimmer
		11/6/1998	9.34	10.3	0.96	1.2	passive skimmer
		1/7/1999	-	-	-	0.2	passive skimmer
		2/11/1999	-		-	0.2	passive skimmer
		3/12/1999	-	. <u>-</u>	-	0.2	passive skimmer
		3/19/1999	NM	8.45	>0.01	0.07	passive skimmer
		4/14/1999		-	_	0.2	passive skimmer
		5/11/1999	-	-	- ,	0.2	passive skimmer
	٠	6/24/1999	8.88	9.63	0.8	0.2	passive skimmer
		7/15/1999			- r i	0.2	passive skimmer
		7/16/1999			·	0.2	passive skimmer
		8/27/1999				0.2	passive skimmer
		9/28/1999	· 		0.65	0.2	passive skimmer
	• •	10/5/1999				0.2	passive skimmer
		11/12/1999	9.38	10.27	0.89	0.2	passive skimmer
		12/21/1999				0.2	passive skimmer
		1/26/2000				0.2	passive skimmer
	4	1/28/2000	9.22	9.24	0.02		passive skimmer
		2/11/2000		7.00	0.00	0.2	passive skimmer
		3/1/2000		7.45	0.00	0.0	passive skimmer
		3/21/2000	NM	7.34	0.00	0.0	passive skimmer
		4/18/2000	NM	8.21	0.00	0.0	passive skimmer
		5/22/2000 ³	NM	8.51	0.00	0.0	passive skimmer
		9/6/2000 4	8.52	9.24	0.72	0.0	passive skimmer
		9/21/2000	8.71	9.26	0.55	0.0	passive skimmer
		10/11/2000				0.0	passive skimmer
		11/30/2000		· 		0.0	passive skimmer
		12/19/2000	9.5	9,89	0.39	0.0	passive skimmer
		2/22/2001	8.3	8.4	0.13	0.0	passive skimmer
		4/3/2001	8.3	8.55	0.25	0.0	passive skimmer
		4/23/2001				0.0	passive skimmer
		5/11/2001			· 	0.0	passive skimmer
		5/30/2001	8.5	8.9	0.40	0.0	passive skimmer
		6/14/2001				0.0	passive skimmer
		7/10/2001	8.8	10	1.20	0.0	passive skimmer
		12/12/2001	NA	NA	NA	1.0	passive skimmer
		3/8/2002	NA	NA	NA	NA	passive skimmer
		4/3/2002	8.3	9.2	0.90		passive skimmer
		4/23/2002	8.5	9.6	1.10		passive skimmer
•		5/10/2002	8.7	9.6	0.90		passive skimmer
		5/24/2002	8.8	10	1.20		passive skimmer

Table 2 Summary of Product Removal and Product Thickness Port of Oakland, 2277 7th Street, Oakland, California

Well	Elevation	Date Of	Depth	Depth	Product	Estimated	Product Removal
ID	of Top of Casing (feet)	Monitoring	to Free Product (feet)	to Water (feet)	Thickness (feet)	Product Removed (gallons)	Method ²
MW-1	14.14	6/13/2002	8.7	10	1.30		passive skimmer
(Cont'd)		6/21/2002	8.8	10	1.20	·	passive skimmer
` ′		7/5/2002	8.5	9.4	0.90	0.2	passive skimmer
		7/19/2002	8.6	9.6	1.00	0.2	passive skimmer
		7/30/2002	8.5	9.3	0.80	0.2	passive skimmer
		8/14/2002	8.5	9.3	0.80	0.2	passive skimmer.
		9/13/2002	8.8	9.6	0.80	0.2	passive skimmer
		9/26/2002	8.6	9.5	0.90	0.2	passive skimmer
		10/14/2002	9.0	10.1	1.10	0.2	passive skimmer
		11/4/2002	9.22	10.12	0.90	0.2	passive skimmer
		11/21/2002	8.48	8.86	0.38	0.2	passive skimmer
		12/6/2002	8.85	9.38	0.53	0.0	passive skimmer
		12/18/2002	8.05	8.26	0.21	0.2	passive skimmer
		12/30/2002	7.61	7.63	0.02	<0.1	passive skimmer
		1/2/2003	7.36	7.36	sheen	<0.1	passive skimmer
		1/3/2003	7.35	7.35	sheen	<0.1	passive skimmer
	4.4	1/14/2003	7.35	7.36	sheen	<0.1	passive skimmer
•		1/30/2003	7.75	7.81	0.06	<0.1	passive skimmer
		2/18/2003	7.81	8.35	0.54	<0.1	passive skimmer
		2/26/2003	7.72	8.62	0.90	< 0.1	passive skimmer
		3/13/2003	7.80	8.11	0.89	0.2	passive skimmer
		3/17/2003	7.61	8.88	1.27	0.2	passive skimmer
		4/16/2003	7.42	8.71	1.29	<0.2	passive skimmer
		6/18/2003	8.20	9.44	1.24	<0.2	passive skimmer
		9/3/2003	8.50	9.40	0.90		8
		11/26/2003	8.85	9.25	0.40		8
		3/5/2004	676	7.07	0.31	-	ŧ
MW-3	14.22	12/31/1997	<u> </u>		-	30	active skimmer
101 44 -0	14.22	1/29/1998					•
				· -	-	. 10	active skimmer
			_	· -	-	10 240	active skimmer
		4/13/1998	- -	-	- - -	240	active skimmer
•		4/13/1998 5/11/1998	- - 	-	- - -	240 1,545	active skimmer active skimmer
		4/13/1998 5/11/1998 6/15/1998	- - - 8 84	- - - 9 94	- - - - 1 1	240 1,545 1,950	active skimmer active skimmer active skimmer
		4/13/1998 5/11/1998 6/15/1998 11/6/1998	- - 8.84	- - - 9.94	- - - - 1.1	240 1,545 1,950 500	active skimmer active skimmer active skimmer active skimmer
		4/13/1998 5/11/1998 6/15/1998 11/6/1998 1/5/1999	- - - 8.84 -	9.94	- - - 1.1	240 1,545 1,950 500 275 ²	active skimmer active skimmer active skimmer active skimmer
		4/13/1998 5/11/1998 6/15/1998 11/6/1998 1/5/1999	8.84 - -	9,94 - - -	- - - 1.1	240 1,545 1,950 500 275 ² 400 ²	active skimmer active skimmer active skimmer active skimmer active skimmer
		4/13/1998 5/11/1998 6/15/1998 11/6/1998 1/5/1999 1/14/1999 2/3/1999	8.84 - -	9.94 - -	- - - - 1.1	240 1,545 1,950 500 275 ² 400 ² 400 ²	active skimmer active skimmer active skimmer active skimmer active skimmer active skimmer
		4/13/1998 5/11/1998 6/15/1998 11/6/1998 1/5/1999 1/14/1999 2/3/1999	- - -	- -	• • •	240 1,545 1,950 500 275 ² 400 ² 400 ² 570 ²	active skimmer active skimmer active skimmer active skimmer active skimmer active skimmer active skimmer
		4/13/1998 5/11/1998 6/15/1998 11/6/1998 1/5/1999 1/14/1999 2/3/1999 2/26/1999 3/19/1999	8.84 - - - 7.52	9.94 - - - - - 8.05	- - - 1.1 - - - 0.5	240 1,545 1,950 500 275 ² 400 ² 400 ² 570 ² 211	active skimmer active skimmer active skimmer active skimmer active skimmer active skimmer active skimmer active skimmer
		4/13/1998 5/11/1998 6/15/1998 11/6/1998 1/5/1999 1/14/1999 2/3/1999 2/26/1999 3/19/1999 6/16/1999	- - - 7.52	- - - 8.05	- - - 0.5	240 1,545 1,950 500 275 ² 400 ² 400 ² 570 ²	active skimmer active skimmer active skimmer active skimmer active skimmer active skimmer active skimmer
		4/13/1998 5/11/1998 6/15/1998 11/6/1998 1/5/1999 1/14/1999 2/3/1999 2/26/1999 3/19/1999 6/16/1999	- - -	- -	- - - 0.5 - 0.2	240 1,545 1,950 500 275 ² 400 ² 400 ² 570 ² 211 310	active skimmer active skimmer active skimmer active skimmer active skimmer active skimmer active skimmer active skimmer active skimmer active skimmer
		4/13/1998 5/11/1998 6/15/1998 11/6/1998 1/5/1999 1/14/1999 2/3/1999 2/26/1999 3/19/1999 6/16/1999 6/24/1999	- - - 7.52	- - - 8.05	- - - 0.5	240 1,545 1,950 500 275 ² 400 ² 400 ² 570 ² 211 310	active skimmer active skimmer active skimmer active skimmer active skimmer active skimmer active skimmer active skimmer active skimmer
		4/13/1998 5/11/1998 6/15/1998 11/6/1998 1/5/1999 1/14/1999 2/3/1999 2/26/1999 3/19/1999 6/16/1999 6/24/1999 7/14/1999 9/28/1999	- - - 7.52	- - - 8.05	- - - 0.5 - 0.2	240 1,545 1,950 500 275 ² 400 ² 570 ² 211 310 50 ²	active skimmer active skimmer
		4/13/1998 5/11/1998 6/15/1998 11/6/1998 1/5/1999 1/14/1999 2/3/1999 2/26/1999 3/19/1999 6/16/1999 6/24/1999	- - - 7.52	- - - 8.05	- - - 0.5 - 0.2	240 1,545 1,950 500 275 ² 400 ² 400 ² 570 ² 211 310	active skimmer active skimmer

Table 2
Summary of Product Removal and Product Thickness
Port of Oakland, 2277 7th Street, Oakland, California

Well	Elevation	Date Of	Depth	Depth	Product	Estimated	Product Removal
ID	of Top of Casing (feet)	Monitoring	to Free Product (feet)	to Water (feet)	Thickness (feet)	Product Removed (gallons)	Method ²
MW-3	14.22	2/11/2000	7.97	8.37	0.40	40	active skimmer
(Cont'd)	14.22	3/1/2000	6.59	7.24	0.65	0.0	active skimmer
(Conta)		3/21/2000	6.50	6.56	0.05	35	active skimmer
		4/18/2000	0.50 				active skimmer
		5/22/2000	7.51	8.05	0.54	40	active skimmer
		6/26/2000	7.82	8.2	0:38	90	active skimmer
. '		7/25/2000	7.90	8.92	1.02	20	active skimmer
		8/31/2000	8.15	9.5	1.35	30	active skimmer
		9/6/2000	8.21	9.42	1.21		active skimmer
		9/21/2000	8.30	8.88	0.58	115	active skimmer
		10/11/2000				170	active skimmer
		11/30/2000				105	active skimmer
		12/19/2000	8,60	9.65	1.05	10	active skimmer
		2/22/2001	6.36	8.15	1.79		active skimmer
		4/3/2001	7.48	8.88	1.40		active skimmer
		4/23/2001	7.85	9.1 .	1.25		active skimmer
		5/11/2001		•			active skimmer
		5/30/2001	7.75	9.1	1.35		active skimmer
		6/14/2001					active skimmer
		7/10/2001	8.10	9.6	1.50		active skimmer
		12/12/2001	NA	NA	NA	1,000 5	active skimmer
		3/8/2002	7.80	8	0.20	1,000 5	active skimmer
		4/3/2002	7.60	7.7	0.10		active skimmer
		4/23/2002	7.90	8.4	0.50		active skimmer
		4/25/2002	7.90	8.8	0.90		active skimmer
		5/10/2002	8.10	8.2	0.10		active skimmer
		5/24/2002	8.05	8.1	0.05		active skimmer
		6/13/2002	8.10	8.7	0.60	1,000 5	active skimmer
		7/5/2002	8.10	8.95	0.85		active skimmer
		7/19/2002	8.10	8.9	0.80		active skimmer
		7/30/2002	8.10	8.9	0.80		active skimmer
		8/14/2002	8.10	8.9	0.80		active skimmer
		9/13/2002	8.30	9.3	1.00		active skimmer
		9/26/2002	8.30	9.0	0.70		active skimmer
		10/14/2002	8.60	9.5	0.90		active skimmer
		11/4/2002	8.75	9.99	1.24		active skimmer
		11/21/2002	8.59	11.29	2.70	150 ⁶	active skimmer
		12/6/2002	8.56	9.3	0.74	150 ⁶	active skimmer
•		12/18/2002	7.35	8.43	1.08	25 6	active skimmer
		12/30/2002	6.50	7.15	0.65	25 ⁶	active skimmer
		1/2/2003	6.20	6.20	sheen		active skimmer
		1/3/2003	6.21	6.21	sheen		active skimmer
		1/14/2003	6.20	6.21	0.01		active skimmer
		1/30/2003	6.81	6.85	0.04	<u></u>	active skimmer
	•	2/18/2002	7.09	7.15	0.06		active skimmer

Table 2
Summary of Product Removal and Product Thickness
Port of Oakland, 2277 7th Street, Oakland, California

Well ID	Elevation of Top of Casing (feet)	Date Of Monitoring	Depth to Free Product (feet)	Depth to Water (feet)	Product Thickness (feet)	Estimated Product Removed (gallons)	Product Removal Method ²
MW-3 (Cont'd)	14.22	2/26/2003 3/13/2003	7.04 7.22	7.11 8.11	0.0 7 0.89		active skimmer active skimmer
		3/17/2003 4/16/2003	7.15 7.27	7.50 8.25	0.35 0.98	5 ⁶	active skimmer active skimmer
		6/18/2003	7.78	9.00	1.22		7
	16.18 ⁹	9/3/2003 11/26/2003	8.31 10.79	9.96 12.85	1.65 2.06	 	7
	10.10	3/5/2004	X 30	985	1.46		
MW-6	14.00	13/31/97 1/29/1998	-	<u>-</u>		0.0014 0.0014	passive skimmer passive skimmer
		3/2/1998 11/6/1998	NM	- 9.62	>0.01	0.0014	passive skimmer passive skimmer passive skimmer
MW-8 1	12.94	3/19/1999 12/31/1997 11/6/1998	NM 8.49 9.25	7.37 8.82 10.3	>0.01 0.33 1.1	0.0 4.38 3.48	passive skininer

- Data prior to November 6, 1998 taken from Groundwater Monitoring, Sampling and Product Removal System O&M Report dated July 21, 1998, by Innovative Technical Solutions, Inc.
- Data prior to November 6, 1998 taken from Groundwater Monitoring, Sampling and Product
- Product removal volumes from 11/6/98 on represent total product removed during that reporting period.
- Free product in well is too viscous to allow product thickness or groundwater level measurements.
- Product removal totals for MW-3 are estimated from documentation of product removal from the treatment system performed by Performance Excavators, Inc.
- The passive skimmer was removed from MW-1 on 5/22/00.
- The passive skimmer replaced MW-1 on 9/6/00.
- Removal total is the volume of both product and wastewater removed from the treatment system by Foss Énvironmental Services Company, Inc.
- Product removed is based on volume measured in the 1,000-gallon holding poly-tank.
- ⁷ The active skimmer was removed from MW-3 on 04/16/2003
- 8 Passive skimmer was removed from MW-1
- Elevation data relative to Port of Oakland datum; well surveys performed on November 26, 2003, by PLS Survey.
- NM Well checked for free product but not able to detect a measurable amount in the well.

 Shaded areas indicate data from this reporting period.

NA - Not Available

Table 3
Groundwater Sample Results
Port of Oakland, 2277 7th Street, Oakland California

Monitoring	Date	TPHg	TPHd	ТРНто	Benzene	Toluene	•	Total Xylenes	MTBE
Well ID		(μg/l)	(μg/1)	(μg/l)	(μ g/l)	(µg/l)	(μg/l)	(μg/1)	(μg/1)
MW-1	05/22/00	3,600	41,000	<3,000	100	13 ⁸	2.9	2.05	3.2 ⁸
MW-2	05/27/94	87	470	NA	<0.5	<0.5	<0.5	<0.5	NA
	03/29/95	<50	110	1,400	<0.4	<0.3	<0.3	<0.4	ΝA
	09/06/95	<50	NA	NA	<0.4	<0.3	<0.3	<0.4	NA
	01/08/96	<50	<50	1200	<0.4	<0.3	<0.3	<0.4	NA
	04/04/96	<50	160	320	<0.5	<0.5	<0.5	<1.0	NA
	07/10/96	<50	120	1400	<0.4	<0.3	<0.3	<0.4	NA
	12/03/96	<50	230 1.2	<250	<0.5	<0.5	<0.5	<1.0	NA
•	03/28/97	<50	714	<250	<0.5	<0.5	<0.5	<1.0	NA
•	06/13/97	51	<50	<250	<0.5	<0.5	<0.5	<1.0	NA
,	09/18/97	82	<50	<250	0.56	<0.5	<0.5	<1.0	NA
•	12/31/97	<50	<47	<280	1.4	<0.5	<0.5	<1.0	NA
•	04/13/98	<50	<50	<300	<0.5	<0.5	<0.5	<1.0	NA
•	11/06/98	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2
	03/19/99	<50	<50	<300	<0.5	<0.5	<0.5	<0.5•	<2
	06/24/99	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2
	09/28/99	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2
	11/12/99	<50	120 ^{2,6}	<300	<0.5	<0.5	<0.5	<0.5	6.3 8,9
	02/11/00	<50	<50	<300	5.4	<0.5	<0.5	<0.5	<2
	05/22/00	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2
	09/06/00	<50	<50	<300	0.76 8	<0.5	<0.5	<0.5	<0.5 10
	12/19/00	200 3,11	<50	<300	39	1.8	<0.5	2.6	<0.5 10,12
	02/21/01	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2.0
	07/10/01	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2.0
	12/05/01	<50	<50	<300	4.4	<0.5	<0.5	<0.5	5.0 14
	03/08/02	<50	<50	<500	<0.5	<0.5	<0.5	<0.5	<5.0
	06/13/02	62 15	<57	<570	<0.5	<0.5	<0.5	<0.5	<5.0
	09/26/02	69 ²	<50	<500	1.8	<0.5	<0.5	<0.5	<5.0
	12/12/02	<50	<50	<300	0.98	<0.5	<0.5	<0.5	<2.0
	03/17/03	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2.0
	06/18/03	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2.0
	09/03/03	<50	<50	<300	3.2	<0.5	<0.5	<0.5	<2.0
	11/26/03	<50	<50	<300	3.0	<0.5	<0.5	<0.5	<2.0
	03/05/04	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2.0
MW-4	09/11/95	150	<200	500	23	<0.3	<0.3	<0.4	NA
•	01/08/96	790	90	400	170	1.2	0.6	0.6	NA
	04/04/96	1,100	180	300	320	1.6	1.1	1.2	NA
	07/10/96	1,200	120	300	470	1.5	0.8	0.8	NA
	12/03/96	990	220 1.2	<250	350	3.3	1.3	1.3	NA
	03/28/97	440 ²	<50	<250	190	1.2	0.64	<1.0	NA
•	06/13/97	1,300	92 ⁵	<250	500	5.5	3.4	2.8	. NA
•	09/18/97	1,300	150	<250	550	4.9	2.1	2.00	NA

Table 3
Groundwater Sample Results
Port of Oakland, 2277 7th Street, Oakland California

Monitoring Well ID	Date	TPHg (μg/l)	TPHd (µg/l)	TPHmo (μg/l)	Benzene (µg/l)	Toluene (µg/l)	Ethylbenzene (μg/l)	Total Xylenes (μg/l)	MTBE (μg/1)
MW-4	12/31/97	73 1.2.3	<47	<280	110 ¹	1.0 1	<0.5	<1.0	NA
(cont'd)	04/13/98	150 ^{2.3}	<50	<300	520	2.9	<2.5	<5.0	NA
•	11/06/98	<50	<50	<300	250	1.7	<1	<1	<4
	03/19/99	81	<50	<300	250	<1	1.2	<1	<4
Dup.	06/24/99	190	<50	<300	360	1.4	2.2	1	24
	09/28/99	750 ^{3,5}	63 ^{3,5}	<300	280	1.5	<1	<1	<4
	11/12/99	330 ³	840 ²	<300	740	<2.5	<2.5	<2.5	42 9
	02/11/00	200 ²	<50	<300	58	0.73	<0.5	<0.5	4.4 ⁸
	05/22/00	240	<5 0.	<300	500	<2.5	<2.5	<2.5	17
	09/06/00	530 ^{2,3}	<50	<300	190	0.93	0.6	0.57	<0.5 10
	12/19/00	960 3,11	70 ⁵	<300	420	<2.5	<u></u>	<2.5	<0.5 10,12
	12/19/00	1,200 3,11	<50	<300	440	<2.5	<2.5	<2.5	<0.5 10,12
	02/21/01	450 ¹³	<50	<300	120	<0.5	<0.5	<0.5	<0.5 10
	07/10/01	<250	110 2,13	<300	620	2.6	2.9	<2.5	<0.5 8,10
	12/05/01	180	<50	<300	61	<0.5	<0.5	<0.5	3.8 14
	03/08/02	490 ²	54 ²	<500	180	<2.5	<2.5	<2.5	<25
	06/13/02	830 ²	<50	<500	250	<5.0	<5.0	<5,0	<50
Dup.	06/13/02	820 ²	<56	<560	240	<5.0	<5.0	<5.0	<50
٠.	09/26/02	390 ²	57	<500	150	2.1	<1.0	<1.0	<10
Dup.	09/26/02	500 ²	<50 ¹⁶	<500 ¹⁶	200	1.5	<1.0	<1.0	<10
	12/12/02	580	<50	<300	240	1.4	0.56	<0.5	<2.0
Dup.	12/12/02	2,400	<50	<300	680	5.0	2.3	1.4	<2.0
	03/17/03	130 ¹⁵	<50	<300	320 ¹⁷	<0.5	<0.5	<0.5	<0.5 10
Dup.	03/17/03	82 15	<50	<300	190	0.64 17	0.56	0.53	<0.5 ¹⁰
	06/18/03	360 ^{11, 15}	<50	<300	150	<0.5	<0.5	<0.5	<2.0
Dup.	06/18/03	330 11, 15	<50	<300	140	<0.5	<0.5	<0.5	<2.0
	09/03/03	140 11, 15	<u><50</u>	<300	240	1.3	<0.5	<0.5	<2.0
Dup.	09/03/03	83 11, 15	<50	<300	130	0.58 17	<0.5	<0.5	<2.0
	11/26/03	160 ¹⁵	68 15	<300	320	0.91 ¹⁷	<0.5	0.53	<2.0
Dup.	11/26/03	120 ¹⁵	<50	<300	210	0.66 17	<0.5	<0.5	<2.0
	03/05/04	90 11	<50	<300	190	1.1	0.55	0.50 17	23 ^{14, 17} , <0.5 ¹⁰
Dup.	03/05/04	84 11	<50	<300	180	0.81	<0.5	<0.5	21 ^{14, 17} , <0.5 ¹⁰
1.611.5	00/11/05		-200	2.500	2.2	-0.3	<0.3	-0 1	NIA .
MW-5	09/11/95	90	<300	2,500	3.3	<0.3		<0.4	NA NA
	04/04/96	<50	. 180	520	<0.5	<0.5	<0.5	<1.0	NA NA
	07/10/96	<50	$\frac{120}{200^{1.2}}$	1,500	<0.4	<0.3	<0.3	<0.4	
	12/03/96	<50		<250	<0.5 <0.5	<0.5 <0.5	<0.5 <0.5	<1.0 <1.0	NA NA
	03/28/97	<50 <50	<50 <50	<250	<0.5	<0.5	<0.5	<1.0	NA NA
	06/13/97			<250	<0.5	<0.5	<0.5	<1.0	NA NA
	09/18/97	<50	<50 <47	<250 <280	<0.5	<0.5	<0.5	<1.0	NA NA
	12/31/97 04/13/98	<50 <50	<47	<280	<0.5	<0.5	<0.5	<1.0	NA NA
	11/06/98	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2
	03/19/99	<50 <50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2
	03/13/33	~50	~0	~500	~0,0	د. ب		-0.5	

Table 3
Groundwater Sample Results
Port of Oakland, 2277 7th Street, Oakland California

Monitoring Well ID	Date	TPHg (µg/l)	TPHd (µg/l)	TPHmo (μg/l)	Benzene (µg/l)	Toluene (μg/l)	Ethylbenzene (µg/I)	Total Xylenes (μg/l)	MTBE (μg/1)
MW-5	06/24/99	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	3.1
(cont'd)	09/28/99	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2
	11/12/99	<50	110 2,6	<300	<0.5	<0.5	<0.5	<0.5	5.5 ⁹
	02/11/00	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2
•	05/22/00	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2
•	09/06/00	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2
•	12/19/00	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2
	02/21/01	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2
	07/10/01	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2
	12/05/01	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2
	03/08/02	<50	<50	<500	<0.5	<0.5	<0.5	<0.5	<5.0
	06/13/02	<50	<50	<500	<0.5	<0.5	<0.5	<0.5	<5.0
	09/26/02	<50	<50	<500	<0.5	<0.5	<0.5	<0.5	<5.0
	12/12/02	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2.0
	03/17/03	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<0.5 10
	06/18/03	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2.0
	09/03/03	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2.0
	11/26/03	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	4.1^{14} , $< 0.5^{10}$
	03/05/04	<5 0	<50	<300	<0.5	<0.5	<0.5	<0.5	<2.0
MW-6	11/06/98	120	12,000	1,200	19	0.65	1.8	<0.5	<2
	03/19/99	170	3,800	580	21	0,86	1.5	2.9	<2
	06/24/99	120	1,7007	<300 ⁷	18	<0.5	1.0	<0.5	54
	09/28/99	130 3,5	820	<300	20	0.51	2.2	<0.5	. <2
	11/12/99	150	11,000 2,6		27	<0.5	2.2	<0.5	13 9
	02/11/00	270 2	2,300	<300	23	0.51	2.7	<0.5	5.8
	05/22/00	350	3,000	<300	18	0.51	<0.5	<0.5	7.7
	09/06/00	190	610	<300	26	<0.5	1.7	<0.5	<0.5 10
	12/19/00	130 3,11	620	<300	24	<0.5	1.6	<0.5	<2
	02/21/01	12013	440	<300	21	<0.5	0.96	<0.5	<2
	07/10/01	120	560	<300	29	<0.5	0.99	<0.5	<2
	12/12/01	53	550	<300	- 27	<0,5	1.3	<0.5	<2.0
	03/08/02	160 ²	640 ²	<500	30	<0.5	<0.5	<0.5	5.0 14
	06/13/02	160 ²	670 ²	<500	34	<0.5	<0.5	<0.5	
		230 ²	1400 ²					<0.5	<5.0 <5.0
	09/26/02			<500	40	0.64	0.8		<2.0
	12/12/02	53	110	<300	43	<0.5	<0.5	<0.5	~2.0
	12/18/02	IVIODITOTI	ng well was	aestroyed					

Table 3
Groundwater Sample Results
Port of Oakland, 2277 7th Street, Oakland California

Monitoring Well ID	Date	TPHg (μg/l)	TPHd (µg/1)	TPHmo (μg/1)	Benzene (μg/l)	Toluene (μg/l)	Ethylbenzene (µg/l)	Total Xylenes (μg/l)	MTBE (μg/1)
MW-7	09/06/95	<50	<300	800	<0.4	<0.3	<0.3	<0.4	NA ·
-	01/08/96	<50	410	110	<0.4	<0.3	<0.3	<0.4	NA
•	04/04/96	<50	530	340	<0.5	<0.5	<0.5	<1.0	NA.
•	07/10/96	80	840	1,700	<0.4	<0.3	<0.3	<0.4	NA
•	12/03/96	<50	280 1.2	<250	<0.5	<0.5	<0.5	<1.0	NA
•	03/28/97	65 ⁶ .	94 ²	<250	<0.5	<0.5	<0.5	<1.0	NA
•	06/13/97	<50	100	<250	<0.5	<0.5	<0.5	<1.0	NA
•	09/18/97	<50	240	<250	<0.5	<0.5	<0.5	<1.0	NA
	12/31/97	<50	53 ^{2.3}	<280	<0.5	<0.5	<0.5	<1.0	NA
•	04/13/98	<50	<48	<290	<0.5	<0.5	<0.5	<1.0	NA
•	11/06/98	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<2
•	03/19/99	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	5.3
•	06/24/99	73	<50	<300	<0.5	<0.5	<0.5	<0.5	12
	09/28/99	<50	<50	<300	<0,5	<0.5	<0.5	<0.5	14
; ·	11/12/99	<50	600 ^{2,6}	420 ³	<0.5	<0.5	<0.5	<0.5	15 °
•	02/11/00	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	51
	05/22/00	110	53 ²	<300	<0.5	<0.5	<0.5	<0.5	75
	09/06/00	50 ⁶	<50	<300	<0.5	<0.5	<0.5	<0.5	40 10
	12/19/00	54 11	51 ⁵	<300	<0.5	<0.5	<0.5	<0.5	47 10,12
	02/21/01	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	66 ¹⁰
Dup.	02/21/01	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	60 ¹⁰
-	07/10/01	<50	51 ²	<300	<0.5	<0.5	<0.5	<0.5	76 ¹⁰
Dup.	07/10/01	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	75 ¹⁰
	12/12/01	51	<50	<300	<0.5	<0.5	<0.5	<0.5	98 14
Dup.	12/12/01	64	52 13, 15	<300	<0.5	<0.5	<0.5	<0.5	96 14
•	03/08/02	52 ²	<50	<500	<0.5	<0.5	<0.5	<0.5	24 14
	06/13/02	87 ²	54 ²	<500	<0.5	<0.5	<0.5	<0.5	51
	09/26/02	83 ²	84 ²	<500	<0.5	<0.5	<0.5	<0.5	75 ¹⁰
	12/12/02	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	58 ¹⁴
	12/18/02	Monitori	ng well was	destroyed					τ
MW-8A	12/12/01	68	720 11,15	<300	<0.5	<0.5	<0.5	<0.5	<2.0
	03/08/02	<50	760 ²	<570	<0.5	<0.5	<0.5	<0.5	<5.0
Dup.	03/08/02	<50	350 ²	<580	<0.5	<0.5	<0.5	<0.5	<5.0
_F -	06/13/02	<50	570 ²	<570	<0.5	<0.5	<0.5	<0.5	<5.0
•	09/26/02	<50	410 ²	<500	<0.5	<0.5	<0.5	<0.5	<5.0
•	12/12/02	<50	160 15	<300	<0.5	<0.5	<0.5	<0.5	<2.0
•	03/17/03	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	<0.5 10
	06/18/03	<50	74 15	<300	<0.5	<0.5	<0.5	<0.5	<2.0
	09/03/03	<50	<50	<300	<0.5	<0.5	<0.5	<0.5	3.0 ¹⁴ , <0.5 ¹⁰
	11/26/03	<50	94 15	<300	<0.5	<0.5	<0.5	<0.5	<2.0
	03/05/04	<50	<50	√300	<0.5	<0.5	<0.5	<0.5	<2.0


Table 3 Groundwater Sample Results

Port of Oakland, 2277 7th Street, Oakland California

Ionitoring Well ID	Date	TPHg (µg/l)	TPHd (μg/l)	TPHmo (μg/1)	Benzene (µg/l)	Toluene (µg/l)	Ethylbenzene (µg/l)	Total Xylenes (μg/l)	MTBE (μg/1)
ı .	Analyte for	ınd in the as	sociated bl	ank as well	as in the sam	ple.		<u> </u>	
2	Hydrocarbo	ons present d	lo not mate	h profile of	laboratory sta	andard.			
3	Low-boilin	g-point/light	ter hydroca	rbons are pr	esent in the s	sample.			
4	Chromatog	raphic patter	m matches	known labo	ratory contar	ninant.	•		
5	Hydrocarbo	ons are prese	nt in the re	quested fue	l quantificati	on range,			
		resemble pat							
б	High-boilir	ng-point/hea	vier hydroc	arbons are p	resent in sar	nple.		J.	
7	Sample did	l not pass lat	oratory QA	VQC and m	ay be biased	low	•	•	
8	Presence of	f this compo	und confir	ned by seco	nd column, l	owever, the	confirmation c	concentration diff	ered
		ported result							•
9	Trip blank	contained M	TBE at a c	oncentration	n of 4.2 μg/l				
10	MTBE det	ections confi	irmed by E	PA Test Me	thod 8260.	3260 results	s displayed.		
11	Sample ext	nibits unkno	wn single p	eak or peak	s				
12	EPA Meth	od 8260 con	firmation a	nalyzed pas	t holding tim	ie.			
13	Lighter hyd	drocarbons c	ontributed	to the quant	titation		1		
14	MTBE res	ults from EP	A Test Me	thod 8021B					
15	Sample ext	hibits fuel pa	attern which	h does not r	esemble stan	dard			
16		tracted out o					4		
	- Data fron	n December	1997 throu	gh April 19	98 taken froi	n <i>Groundw</i>	ater Monitoring	g, Sampling and	
	Product Re	emoval Syste	em O&M R	<i>eport</i> dated	July 21, 199	8, by Innov	ative Technical	Solutions, Inc.	
							sults, Quarterly		
	-						Street, Oakland,		
		ber 24, 199							
17			ut Relative) between	columns exceed	s 40%	

Table 4
Summary of Operation and Maintenance Activities
Port of Oakland, 2277 7th Street, Oakland, California


Date	System Status	Comments
7/5/2002	Off	System is turned off and is in the process of being moved to new location.
7/19/2002	Off	System is moved to new location but is not hooked up to electricity.
7/30/2002	Off	System is moved to new location but is not hooked up to electricity.
8/14/2002	Off	System is moved to new location but is not hooked up to electricity.
9/13/2002	On	System is powered and operating
9/26/2002	On	System operating OK.
10/14/2002	On	System operating OK.
11/4/2002	On	System operating OK.
11/21/2002	On	System operating OK.
12/6/2002	On	System operating OK.
12/18/2002	On	System operating OK.
12/23/2002	On	System operating OK.
12/27/2002	On	System operating OK.
12/30/2002	On	System operating OK.
1/2/2003	Off	System is turned off because no free product was detected in well MW-3
1/3/2003	Off	System is turned off because no free product was detected in well MW-3
1/14/2003	Off	System is turned off because only product sheen was detected in well MW-3
1/30/2003	Off	System is turned off because only product sheen was detected in well MW13
2/18/2003	Off	System is turned off because only product sheen was detected in well MW-3
2/26/2003	Off	System is turned off because only product sheen was detected in well MW-3
3/13/2003	Off	System is kept off because of the expected rainfall during weekend
3/17/2003	On	System is tested to verify that only product is being recovered from well MW-3
4/16/2003	Off	Product recovery line was removed due to Port's construction upgrades at the site
6/18/2003	Off	Product recovery line was removed on 04/16/2003
9/3/2003	Off	Product recovery line was removed on 04/16/2003
11/26/2003	Off	Product recovery line was removed on 04/16/2003
3/5/2004	Off	Product recovery line was removed on 04/16/2003

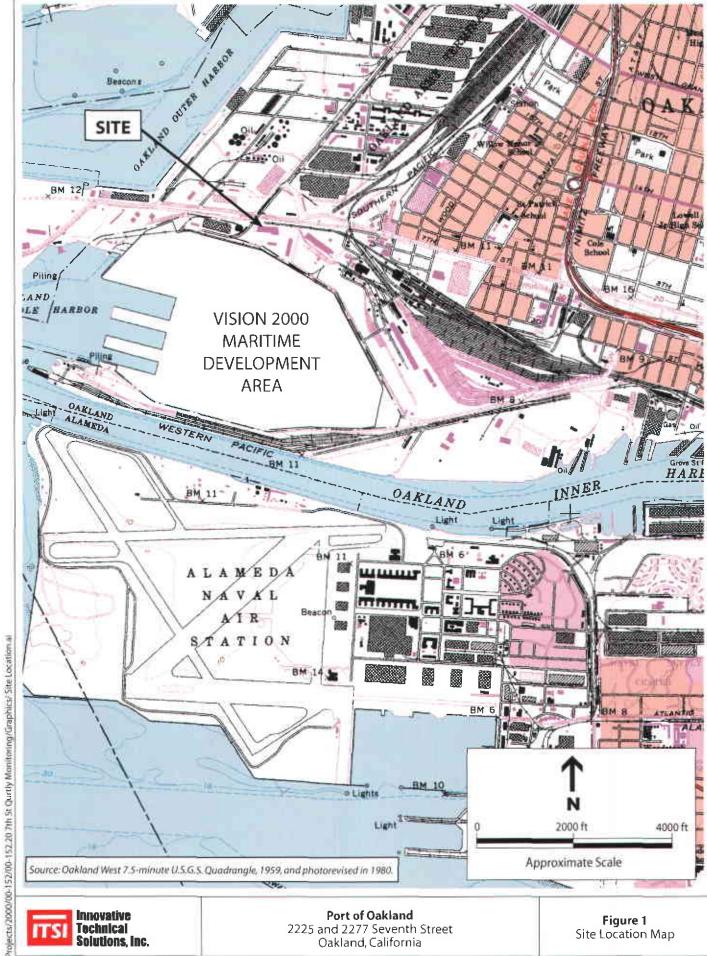



Innovative Technical Solutions, Inc.

Port of Oakland 2225 and 2277 Seventh Street Oakland, California

Figure 1 Site Location Map

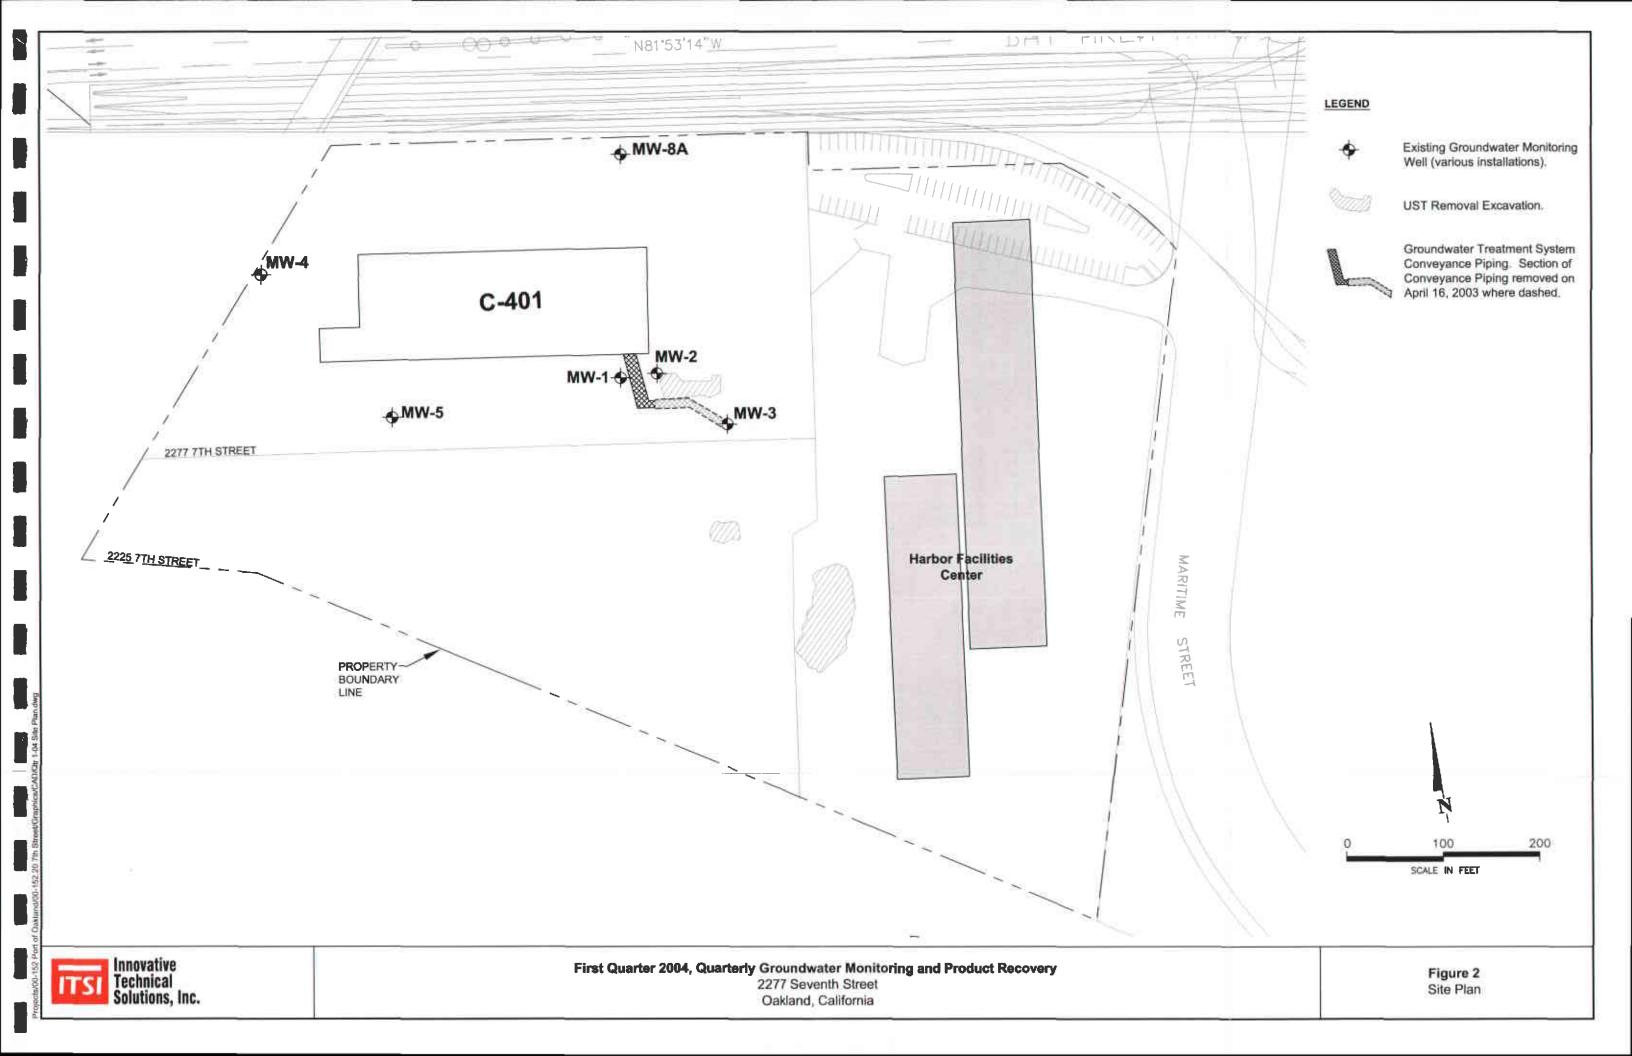

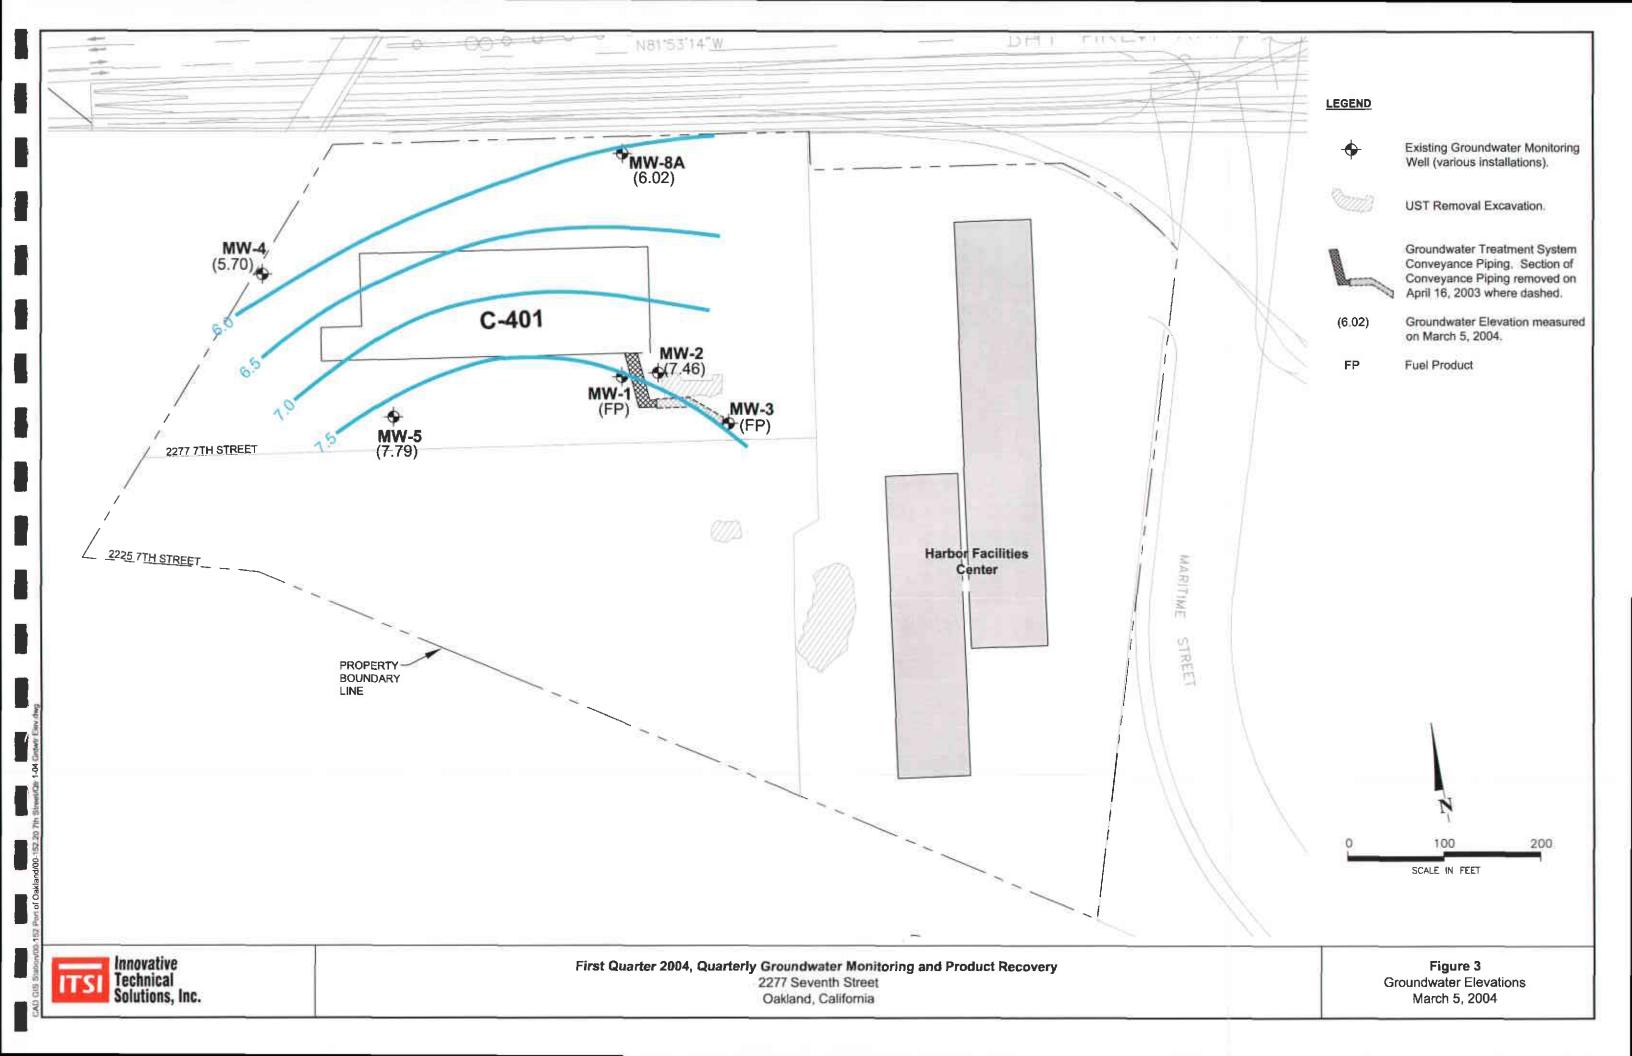

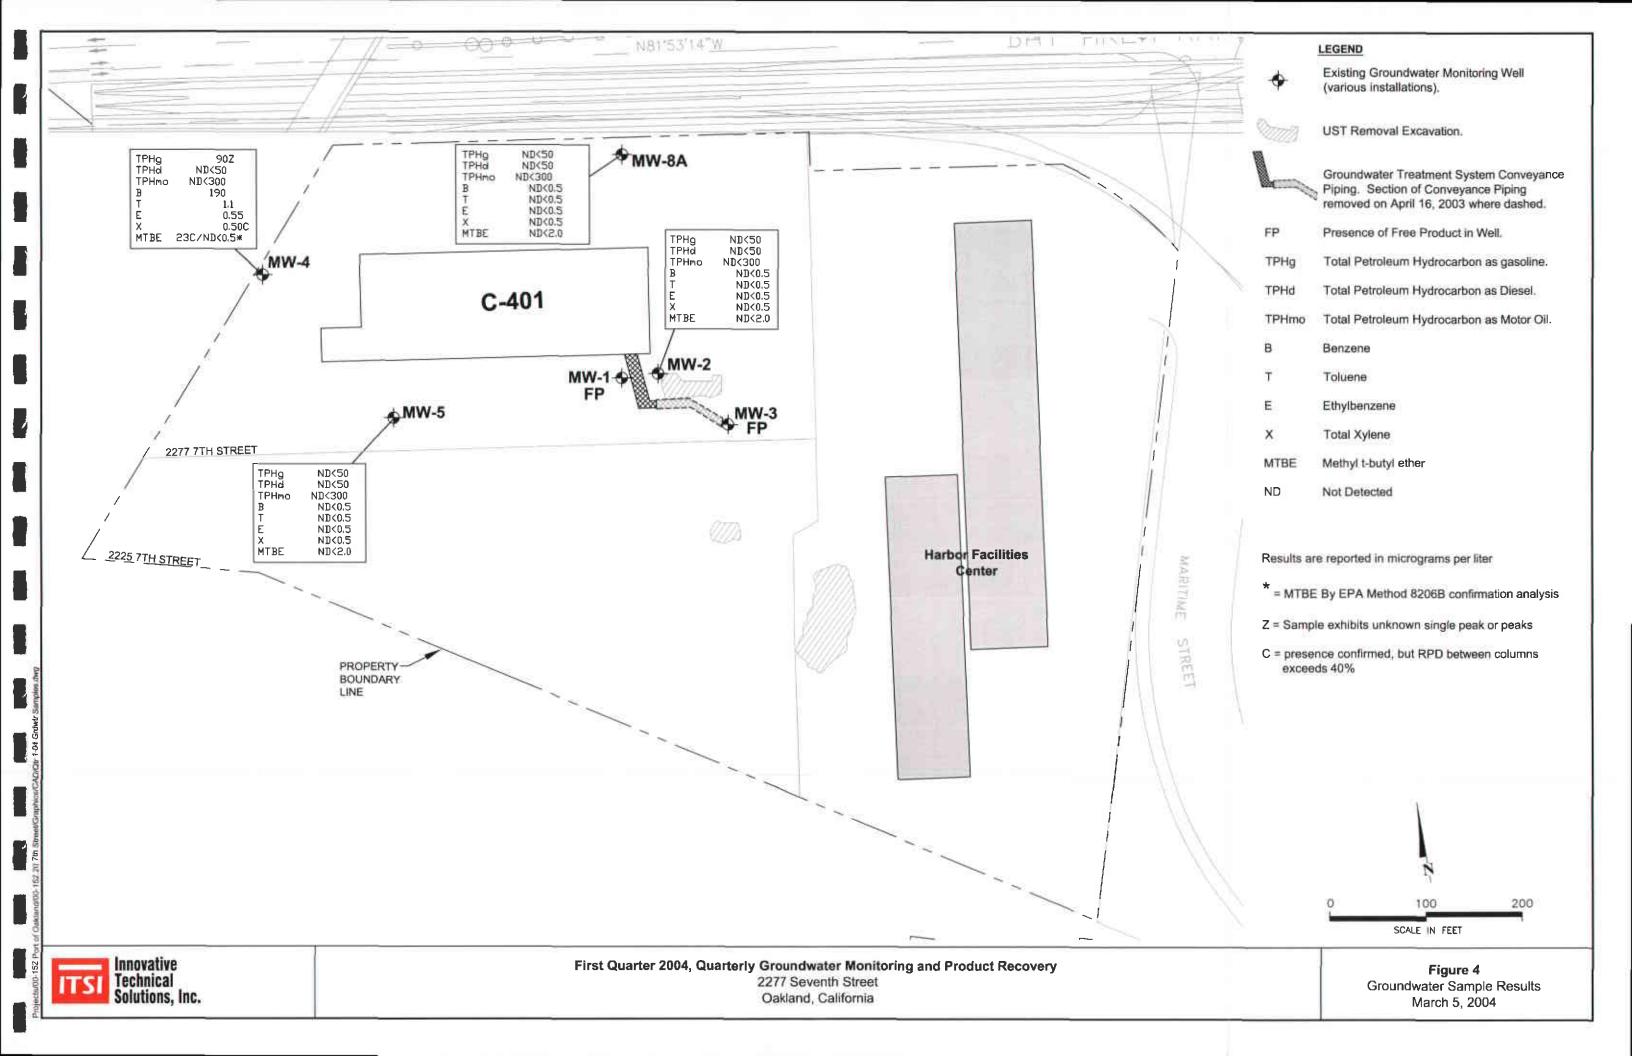

APPENDIX A

MONITORING WELL WATER LEVEL MEASUREMENT FORM
AND
MONITORING WELL PURGING AND SAMPLING FORM



MONITORING WELL WATER LEVEL MEASUREMENT FORM

 PROJECT NAME:
 2277 7th Street
 PROJECT NO.:
 00-152.25

 MEASURED BY:
 \$\begin{align*} \text{Long} \\ \text{DATE} \end{align*}
 DATE:
 \$\mathrm{O}_3 \sqrt{0}_5 \sqrt{2004} \end{align*}

	Dianimate Wing.	Papal Wast Dolani.	
MW-2	9.75	17.90	9:42
MW-4	7.45	18.70	11:55
MW-5	5.70	16.84	11:15
MW-6	Well wa	s destroyed on December	r 18, 2002
MW-7	Well wa	s destroyed on December	r 18, 2002
MW-8A	6.92	20.45	10:38
			
			·
	<u>.</u>		
	·		



MONITORING WELL PURGING AND SAMPLING FORM

PROJECT NAM	ИE.	PORT	OF (OAKLAND	227	77 7th STRE	ET	P	ROJEC	T NO	.: ,		00-	152.25
WELL NO.:	NW	-2	_	TESTED	BY	: RiE	0N	1 _]	DATE	: 0	3 0) Z	04
				W	EL	L PURG	NG							
Measuring Poin	t Descrip	otion:		Top of Casing	; (T	COC)	Sta	tic Wate	r Level	(ft.):	_	<u> </u>	1.73	5
Total Well Dep	th (ft.):			17.90		<u> </u>	Pur	ge Meth	od:		Disp	osal	ole I	Bailer
Water Level Me	easureme	nt Me	thod	: Solins	st V	V. L.	Pur	ge Rate	(gpm):		0.	26)	
Time Start Purg	ge:	. (7:1	įs				e End P						
Comments:													· ·	
Well Volume Calculation	Total I			Depth to Water (ft)		Water Column (ft)			iplier fo				Vo	Casing lume (gal)
(fill in before purging)	17.9	0	-	9.75	=	8,15	×	$\begin{pmatrix} 2 \\ 0.16 \end{pmatrix}$	0.64	1	.44	=	<u> </u>	30
									p					
Time		9:5	50	10:00		10:05	10	1:10						
Cumulative Vo Purged (gals)	lume	12	50	2.60		3,25	3	90						· .
Cumulative Nu of Casing Volu		1		2		2.5	-	}						
Temperature (F	~(C°)	1	0	16		15	<u>ا</u> 	5						
pН	-	6.	7	7.3	_	7.4		7.6			<u> </u>			
Specific Condu (mS/cm)	etivity	2.	В	2.2		2.0	1	.9						_
Turbidity (NTU	J)	27	8	28		36		38			<u> </u>			
				W	EL	L SAMP	LIN	G		,				
Sampling Time	»:	10	1 5	5	_	S	ampi	ing Met	hod:	Disp	osabl	e Ba	<u>iler</u>	
Duplicate Samp	ple & Tir	me:		NONE	· · · ·						•			
Sample I	D	Vo	olum	e/ Container		Analysis l	Requ	ested		Prese	rvativ	es		Lab
MW-2	ر ا		2 (1	L Amber)		TPHd,	ГРН	mo		n	one			C&T
Mu1-2	2,			5 voas		TPHg, MT	BE,	BTEX		Н	CL			C&T



MONITORING WELL PURGING AND SAMPLING FORM

PROJECT NAM	ΛE: _	PORTOF	OAKLAND – 2	277 7th STRE	<u>et</u> pf	ROJECT NO.	:00	-152.25
WELL NO.:	MW	-8A	TESTED I	34: <u>RLE</u>	ONG_	DATE	: 03 05	5 04
			WE	LL PURG	ING	-		
Measuring Poin	t Descrip	otion:	Top of Casing	(TOC)	Static Water	r Level (ft.):	6.9	Z
Total Well Dep	th (ft.):		20.45		Purge Metho	od:	Disposable	Bailer
Water Level Me	easureme	ent Method	d: Solinst	W. L.	Purge Rate	(gpm):	~0.5	
Time Start Purg	ge:		10:40		Time End Pu	ırge:	10:55	
Comments :		Sligt	it hydrorac	ton oda	·<			
Well Volume Calculation	Total I	· 1 1	Depth to Water (ft)	Water Column (ft) D	plier for Casi	\ Vo	Casing olume (gal)
(fill in before purging)	20.4	15	6.92	13.53	$\begin{pmatrix} x & 2 \\ 0.16 \end{pmatrix}$	+ ""	6 = <	2.16
Time		10:4	2 10:45	10:47	10:50	10:55		
Cumulative Vo Purged (gals)	lume	1.0	2.5	3.5	5.0	7.5		
Cumulative Num of Casing Volu		~0.5	>7.0	~ 1.5	~2.0	73.0		
Temperature (F	·(c ₀)	16	16	16	15	15.3		
pН	·	7.9	7.7	7.5	7.4	7.4		ļ. - :
Specific Condu (mS/cm)	ctivity	2.6	2.6	2.6	2.5	2.6		
Turbidity (NTU	J)	380	660	990	>990	>990		<u> </u>
			WF	ELL SAMP	LING			
Sampling Time	: <u>_</u>	1:00		_	Sampling Met	hod: <u>Disp</u>	osable Bailer	
Duplicate Samp	ple & Tir	me:	NONE					
Sample 1	D	Volum	ne/ Container	Analysis	Requested	Preser	vatives	Lab
MW-87	١ .	2 (1	L Amber)	TPHd,	TPHmo	no	one	C&T
MW-8	A		5 voas	ТРНg, М7	BE, BTEX	Н	CL	C&T

APPENDIX B LABORATORY REPORTS





Curtis & Tompkins, Ltd., Analytical Laboratories, Since 1878

2323 Fifth Street, Berkeley, CA 9471O, Phone (510) 486-0900

ANALYTICAL REPORT

Prepared for:

Innovative Technical Solutions, Inc. 2730 Shadelands Drive Suite 100 Walnut Creek, CA 94598-2540

Date: 28-MAR-04 Lab Job Number: 171013 Project ID: 00-152.25

Location: 2277 7th Street POO

This data package has been reviewed for technical correctness and completeness. Release of this data has been authorized by the Laboratory Manager or the Manager's designee, as verified by the following signatures. The results contained in this report meet all requirements of NELAC and pertain only to those samples which were submitted for analysis.

Reviewed by:

roject Manager

Reviewed by:

Operations Manager

This package may be reproduced only in its entirety.

NELAP # 01107CA

Page 1 of 17

1 (7 /					7-1-		tu Str	00+						
Innovative 2730 Shadelands Drive, Suite 10 Walnut Creek, California 94598 (925) 946-3100 - (925) 256-899			Local Addre	ss: <u>2</u>	Elar		14 >11 Ca-		C	hai	n-01	-Cust		
Project Name and Number 18st of Cakland / Project Manager: + achel Hess	<i>0</i> 0-125.	Add	pratory Name ress: 23	e:	5V	urtis UStra	it co	om Kiv ntact Name one: 151	. Ann	a Paze 16-09t	ari Ilo 10	Date: 03 (05 <u>04</u> of <u>1</u>	_
Site Location: 2277 7th Street, Cake	accor Co	<u>``-</u>				Analysis:						Special Instr	uctions/Con	nments
	 			1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	L	80158		BTEXT HIER 80218	MFBE Centrimotion		1	Silica G	el Cleo	nup
	Date	Time	Sample Depth	No. of Containers	Sample Matrix		- Ho	MI40NU	HC1 40wli	1 1		Preservative: Container Type:		
Sample I.D.			<u> </u>			+	tmun 101	A VOA	VOA!		· 	1		
TripBlank MW-2 MW-4 MW-4D	103/05/04	10:15		77777	H20		×		(XXX)	\		reservation Correct		
MW-5 MW-8A	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	11:00	1401	7			X			1	90	Abceived On	tact -	
	1	1 -1	1	 	1 1 - '-	1 1 1	 	- 1 - /		1		. jakara ara ara		
Sampled By: ROGERYO FONG	(ourier/Airbill N	1 10.: N/A	!		<u>.</u> !i			<u> </u>				T	
Sampled By: LOGE LYO LEONE		Relinquished By.	/Affiliation:			_	Date:	Time:	Receive	d By/Affilia	tion:		Date:	Time:
Special instructions - test Public (a) (510) 627 1131	claud	Rogerial		<u>TSI</u>			02/05/04	13:35	120	FEL	mm.			 2:35
Send Results to: Email to rleong (a) itis com (w/fax #) fax to Rogisio (a) (925) 25	68448		 				 					- * <i>-</i>	†	
Turnaround Time: Stational														ITSLS/0

Yellow - Field/Office

Original — Laboratory



	Curtis & Tompkins Labor	atories Ana	
Lab #: Client: Project#:	171013 Innovative Technical Solutions, Inc. 00-152.25	Location: Prep:	2277 7th Street POO EPA 5030B
Matrix: Units: Diln Fac: Batch#:	Water ug/L 1.000 89064	Sampled: Received: Analyzed:	03/05/04 03/05/04 03/05/04

Туре:

BLANK

Lab ID:


QC243239

Analyte	Result	RL	Analysis	
Gasoline C7-C12	ND	50	EPA 8015B	
MTBE	ND	2.0	EPA 8021B	
Benzene	ND	0.50	EPA 8021B	
Toluene	ND	0.50	EPA 8021B	
Ethylbenzene	ND	0.50	EPA 8021B	
m,p-Xylenes	ND	0.50	EPA 8021B	
o-Xylene	ND	0.50	EPA 8021B	


Surrogate	*REC	Cimits	Analysis	
Trifluorotoluene (FID)	100	74-142	EPA 8015B '	Ì
Bromofluorobenzene (FID)	106	80-139	EPA 8015B	- (
Trifluorotoluene (PID)	110	55-139	EPA 8021B	- 1
Bromofluorobenzene (PID)	116	<u>62-134</u>	EPA 8021B	

C= Presence confirmed, but RPD between columns exceeds 40% Z= Sample exhibits unknown single peak or peaks ND= Not Detected RL= Reporting Limit Page 4 of 4


GC04 TVH 'J' Data File FID

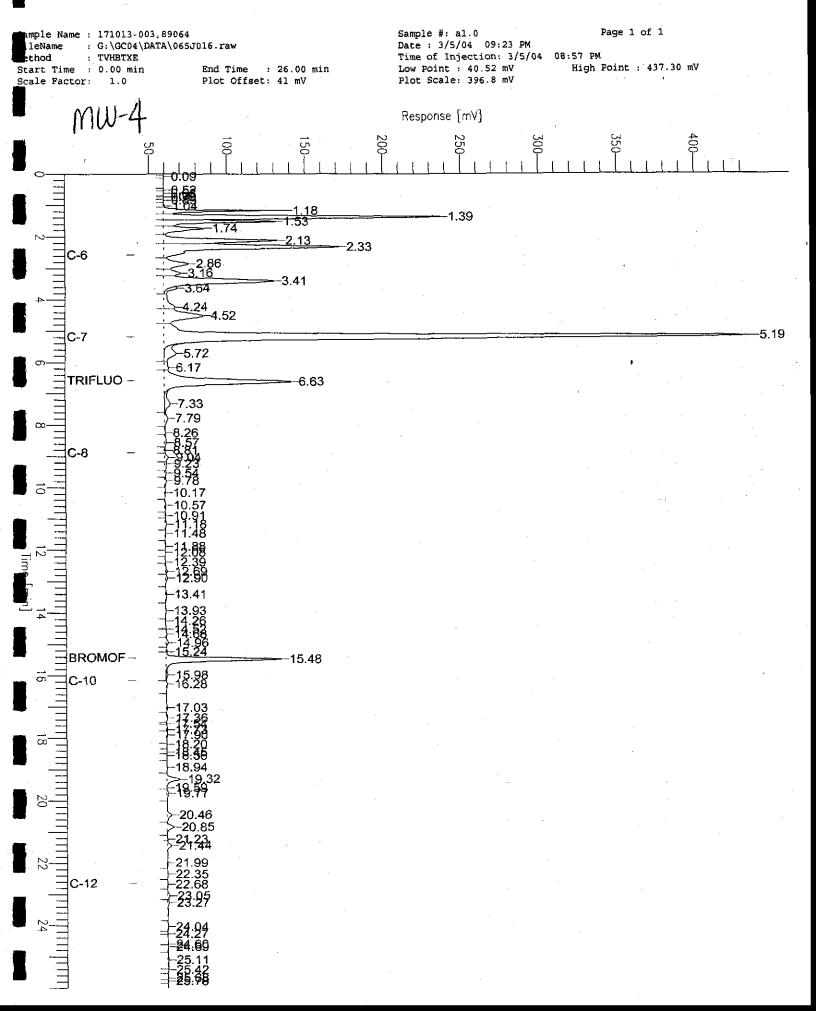

GC04 TVH 'J' Data File FID

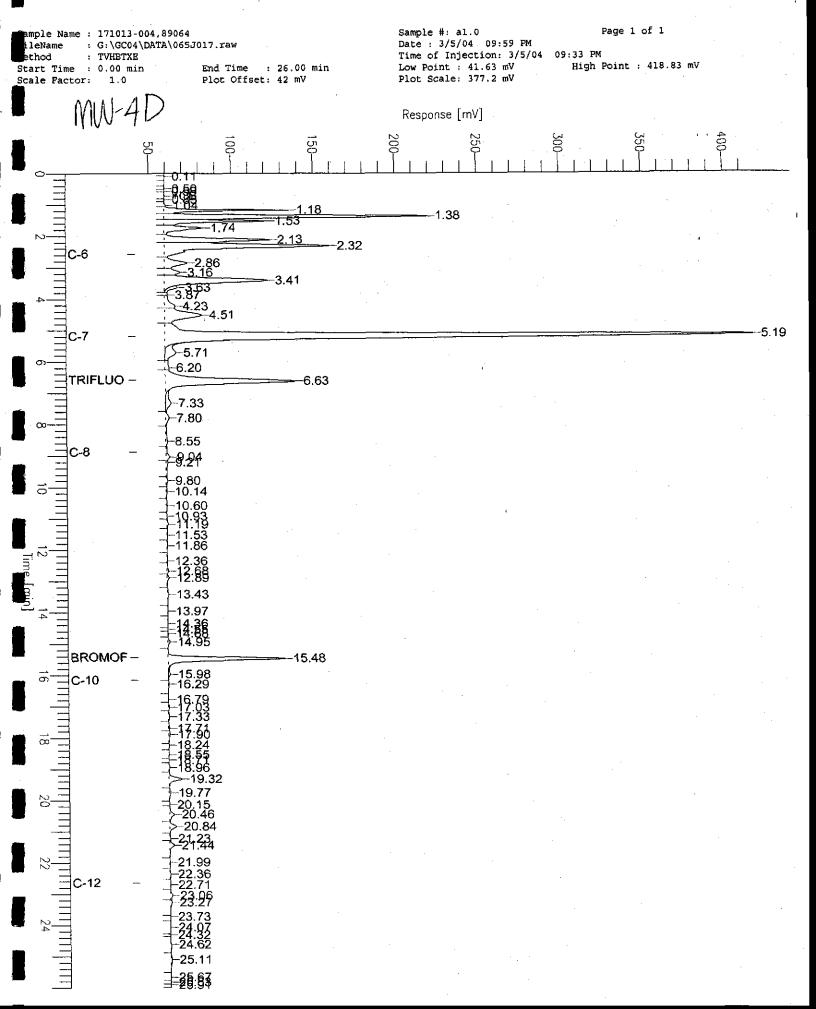

GC04 TVH 'J' Data File FID

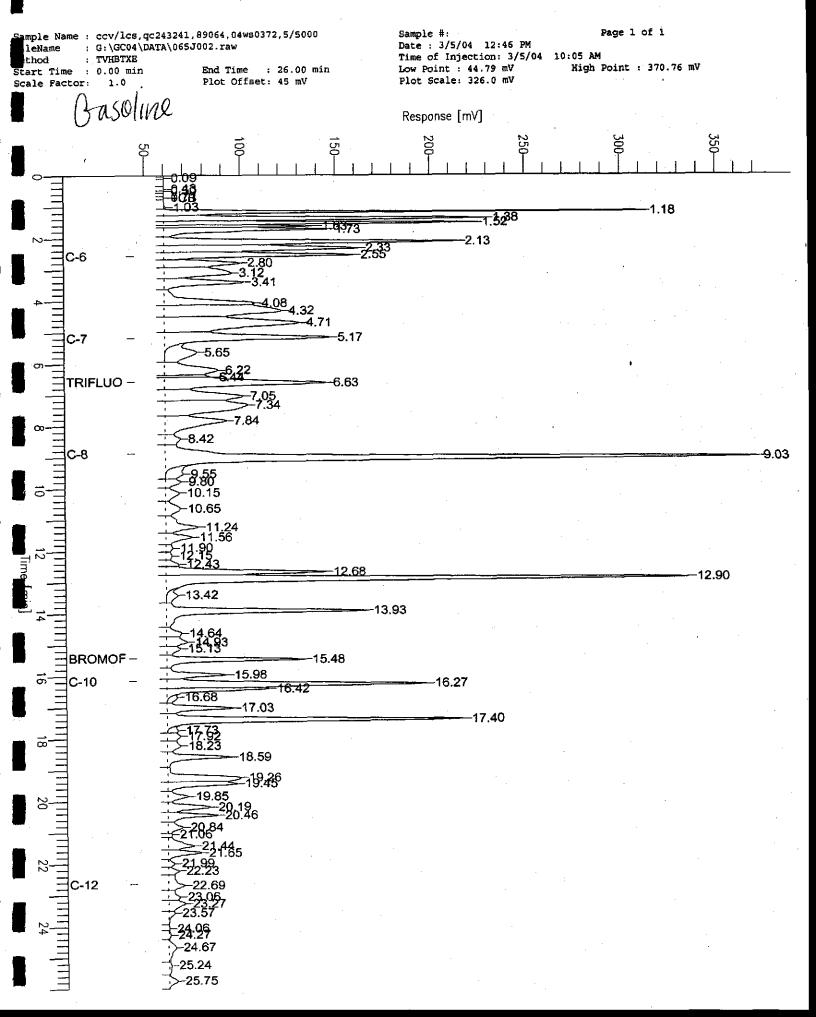



	Curtis & Tompkins Labor	atories Analyt:	ical Report
Lab #:	171013	Location:	2277 7th Street POO'
Client:	Innovative Technical Solutions, Inc.	Prep:	EPA 5030B
Project#:	00-152.25	Analysis:	EPA 8021B
			1 000

Type: LCS Diln Fac: 1.000
Lab ID: QC243240 Batch#: 89064
Matrix: Water Analyzed: 03/05/04
Units: ug/L

Analyte	Spiked	Result	%REC	. Limits	
Gasoline C7-C12		NA			
MTBE	20.00	19.81	99	59-131	
Benzene	20.00	17.81	89	80-120	
Toluene	20.00	, 17.68	88	80-120	
Ethylbenzene	20.00	18.19	91	80-120	
m,p-Xylenes	40.00	35.07	88	80-120	
o-Xylene	20.00	17.18	86	80-120	

Surrogate	Re	esult %REC	Limits			
Trifluorotoluene (FID)	NA				٠	
Bromofluorobenzene (FID)	AИ			•		
Trifluorotoluene (PID)		104	55-139			
Bromofluorobenzene (PID)		108	62-134			



Curtis & Tompkins Laboratories Analytical Report

Lab #: 171013 Location: 2277 7th Street POO

Client: Innovative Technical Solutions, Inc. Prep: EPA 5030B

Type: LCS Diln Fac: 1.000

Lab ID: QC243241 Batch#: 89064
Matrix: Water Analyzed: 03/05/04

Matrix: Water Analyzed: 03/0

Analyte	Spiked	Result	%REC	Limits
Gasoline C7-C12	2,000	2,011	101	80-120
MTBE	•	NA		
Benzene		NA		•
Toluene		NA		
Ethylbenzene		NA	•	
m,p-Xylenes		NA	•	
o-Xylene		NA	·	

Surrogate	Result	%REC	Limits			
Trifluorotoluene (FID)	•	130	74-142			
Bromofluorobenzene (FID)		112	80-139			
Trifluorotoluene (PID)	NA			±*	-	
Bromofluorobenzene (PID)	NA					<u> </u>



	Curtis & Tompkins Labora	atories Analyti	cal Report
Lab #: 171013		Location:	2277 7th Street POO
	tive Technical Solutions, Inc.	Prep:	EPA 5030B
Project#: 00-152	.25	Analysis:	EPA 8021B
Field ID:	ZZZZZZZZZ	Batch#:	89064
MSS Lab ID:	171004-001	Sampled:	03/05/04
Matrix:	Water	Received:	03/05/04
Units:	ug/L	Analyzed:	03/05/04
Diln Fac:	1.000	·	

Гуре:

MŞ

Lab ID:

QC243323

Analyte	MSS Result	Spiked	Result	%REC	Limits
Gasoline C7-C12		N	A		•
MTBE	<0.3700	20.00	23.78	119	63-140
Benzene	<0.1300	20.00	20.52	103	80-120
Toluene	<0.07900	20.00	20.83	104	80-120
Ethylbenzene	<0.05900	20.00	21.02	105	80-120
m,p-Xylenes	<0.1000	40.00	42.11	105	80-120
o-Xylene	<0.05200	20.00	20.95	105	80-120

Surrogate	Resu	lt %REC	Limits	
Trifluorotoluene (FID)	NA			
Bromofluorobenzene (FID)	NA	•		
Trifluorotoluene (PID)	•	115	55-139	
Bromofluorobenzene (PID)		124	62-134	

Type:

MSD

Lab ID:

QC243324

Analyte	Spiked	Result	%rec	Limits	RPD	Lim
Gasoline C7-C12	N	A				
MTBE	20.00	24.42	122	63-140	3	23
Benzene	20.00	20.39	102	80-120	1	20
Toluene	20.00	20.99	105	80-120	1	20
Ethylbenzene	20.00	21.36	107	80-120	2	20
m,p-Xylenes	40.00	41.65	104	80-120	1	20
o-Xylene	20.00	20.85	104	80-120	0	20

Surrogate	Resu	t %REC	Limits	
Trifluorotoluene (FID)	NA			
Bromofluorobenzene (FID)	NA			·
Trifluorotoluene (PID)		121	55 - 139	
Bromofluorobenzene (PID)		131	62-134	

NA= Not Analyzed RPD= Relative Percent Difference Page 1 of 1



Total Extractable Hydrocarbons

2277 7th Street POO Lab #: 171013 Location:

EPA 3520C Client: Innovative Technical Solutions, Inc. Prep: EPA 8015B Project#: 00-152.25 Analysis: Sampled: 03/05/04 Matrix: Water

03/05/04 Received: Units: ug/L 03/08/04 Diln Fac: 1.000 Prepared:

Batch#: 89123

ield ID:

MW - 2

SAMPLE

ype:

171013-002

Analyzed:

03/11/04

EPA 3630C Cleanup Method:

RL Result Analyte

50 Diesel C10-C24 ND 300 ND Motor Oil C24-C36

*REC Limits Surrogate 120 53-142 Hexacosane

Field ID:

MW-4

SAMPLE

Analyzed:

03/11/04

Cleanup Method:

EPA 3630C

уре: ab ID:

171013-003

Analyte	Result	RL	
Diesel C10-C24	ND	50	
Motor Oil C24-C36	ND	300	

Surrogate		Limits	
Hexacosane	119	53-142	

Field ID:

MW-4D

Analyzed:

03/11/04

SAMPLE

Cleanup Method: EPA 3630C

ab ID:

171013-004

· ·		·	
Analyte	Result		
Diesel C10-C24	ND	50	
Motor Oil C24-C36	ND	300	

Surrogate	%REC	Limits
Hexacosane	.86	53-142

ID= Not Detected RL= Reporting Limit Page 1 of 2



Total Extractable Hydrocarbons

2277 7th Street POO Location: Lab #: 171013

EPA 3520C Innovative Technical Solutions, Inc. Prep: Client:

EPA 8015B Project#: 00-152.25 Analysis: 03/05/04 Matrix: Water Sampled:

03/05/04 Received: Units: ug/L

03/08/04 Diln Fac: 1.000 Prepared: Batch#: 89123

Field ID:

MW-5

ype: SAMPLE

ab ID: 171013-005 Analyzed:

03/11/04

Cleanup Method: EPA 3630C

Result Analyte 50 Diesel C10-C24 300 NDMotor Oil C24-C36

Surrogate	%REC	Limits	
Hexacosane	93	53-142	

Field ID:

A8-WM

Analyzed:

03/11/04

ype:

SAMPLE

Cleanup Method: EPA 3630C

ab ID:

171013-006

Analyte	Result	RL	
Diesel C10-C24	ND	50	
Motor Oil C24-C36	ND	300	

	Surrogate	%R		
Ţ	Hexacosane	97	53-142	 1

Type:

BLANK

Analyzed:

03/10/04

ab ID:

QC243474

Cleanup Method: EPA 3630C

Analyte	Result	RL	
Diesel C10-C24	ND	50	
Motor Oil C24-C36	ND	300	
			· ·

Surrogate	%RBC	Limits	
Hexacosane	114	53-142	
			

D= Not Detected L= Reporting Limit Page 2 of 2



atch QC Report

	Total Extracta	ble Hydroca:	rbons
Lab #:	171013	Location:	2277 7th Street POO
Client:	Innovative Technical Solutions, Inc.	Prep:	EPA 3520C
Project#:		Analysis:	EPA 8015B
Matrix:	Water	Batch#:	89123
Units:	ug/L	Prepared:	03/08/04
Diln Fac:	1.000	Analyzed:	03/10/04

Type:

BS

Cleanup Method: EPA 3630C

ab ID:

QC243475

Analyte	Spiked	Result		! Limits	
Diesel C10-C24	2,500	2,300	92	57-128	
			·-··		क्टरकार

Surrogate 110 53-142 Hexacosane

BSD

QC243476

Cleanup Method: EPA 3630C

Analyte	Spiked	Result	%REC	Limits R	PD Lim
Diesel C10-C24	2,500	2,171	87	57-128 6	38_

Surrogate	%REC	Limits
Hexacosane	100	53-142



Curtis & Tompkins Laboratories Analytical Report

Lab #: 171013 Client:

Innovative Technical Solutions, Inc.

Project#: 00-152.25 Water

Matrix: Units:

ug/L Diln Fac: 1.000 Location:

2277 7th Street POO

EPA 5030B Prep:

EPA 8260B Analysis:

Batch#: Sampled: 89312 03/05/04

Received:

03/05/04

Field ID:

Type:

MW-4

SAMPLE

Lab ID:

171013-003

Analyzed:

03/16/04

Analyte MTBE

Result

RL

106

0.50

Surrogate Dibromofluoromethane %REC Limits

80-120

Field ID:

Гуре:

MTBE

MW-4D

SAMPLE

Lab ID:

171013-004

Analyzed:

03/16/04

Result

ND

0.50

Surrogate

Limits %REC

Dibromofluoromethane

105

80-120

Type:

BLANK

Analyzed:

03/15/04

MTBE

QC244192

Analyte

Result ND

0.50

Surrogate Dibromofluoromethane %REC Limits

101

80-120

ND= Not Detected RL= Reporting Limit

Page 1 of 1

7.1



Batch QC Report

Lab #:

Curtis & Tompkins Laboratories Analytical Report

171013 Location: 2277 7th Street POO

Client: Innovative Technical Solutions, Inc. Prep: EPA 5030B

Project#: 00-152.25 Analysis: EPA 8260B

Matrix: Water Batch#: 89312

Units: ug/L Analyzed: 03/15/04
Diln Fac: 1.000

Type: BS

Lab ID: QC244190

 Analyte
 Spiked
 Result
 %RBC Limits

 MTBE
 50.00
 48.59
 97
 76-123

Surrogate #REC Limits
Dibromofluoromethane 100 80-120

Type: BSD Lab ID: QC244191

 Analyte
 Spiked
 Result
 %REC Limits RPD Lim

 MTBE
 50.00
 46.19
 92
 76-123
 5
 20

Surrogate %REC Limits
Dibromofluoromethane 98 80-120

APPENDIX C

DAILY FIELD ACTIVITY REPORT



Field notes for Date 03 05 04 Subject 15T Quarter Groundwater Sampling at 7th Street, Oakland Project No. 00-152.25 Date 03 05/04 7:30 Pickup botten in CFT, Berkeley. 7:45 Purchase Ice. 8:30 At site; get prepared for sampling 9:00 Latel Trip blank 9:10 Calibrate conductivity wefer (HoriBA U-10) · 9:40. Set up on NW-2, 10:15 Samply MW-Z 70:30 Set up on NW-8A Sample MW-8A 11:00 Set up on Sample NW-5 11:10 Set up on NW-5 " 11:35 11:50 Set up on NW-4 12:10 Sample NW-4 Sample NW-4D as duplicate of NW-4. 12:20 Transfer mater Furged water into 1,000-golon holding tank. 12:30 12:40 At MW-3 to monitor free product. Product & 8.39 | Free product Grandwale: 9.85 | Hickness = 1.46 12:55 AT MW-1 & Product = 6.76 / Free product thickness = 0.31'

Groundwater = 7:07

13:00 clean up sik , lock gote.

13:15 Leave site to CST in Berkeley.

03/05/04