April 14, 1998

PROTESTION AL

Messrs. Aaron and Stanley Wong 2200 E. 12th Street Oakland, CA 94606

Re: First Quarter Report, 1998, Credit World Auto Sales, 2345 E. 14th Street, Oakland, CA 94601

Dear Messrs. Wong:

Tank Protect Engineering of Northern California, Inc. (TPE) is pleased to submit this quarterly letter report of environmental services conducted at the subject site. Previous work conducted prior to January 1, 1998 is summarized in TPE's January 14, 1998 Fourth Quarter Report, 1997, Credit World Auto Sales, 2345 E. 14th Street, Oakland, CA 94601. Work conducted after January 1, 1998 is summarized and work conducted during the subject quarter is presented in detail.

WORK PERFORMED BY TPE DURING FIRST QUARTER, 1998

- January 14, 1998 Submitted a Fourth Quarter Report, 1997, Credit World Auto Sales, 2345 E. 14th Street, Oakland, CA 94601 to Messrs. Wong for their approval and delivery to the Alameda County Health Care Services Agency (ACHCSA).
- March 25, 1998 Supervised the removal of 500 gallons of hydrocarbon contaminated groundwater stored in drums.

March 24 and 25, 1998 - Measured depth-to-groundwater and free product thickness in wells MW-1 through TMW-5 for evaluation of groundwater flow direction and gradient and collected groundwater samples from wells MW-1 through TMW-5 for analysis for total petroleum hydrocarbons as gasoline (TPHG) and methyl t-butyl ether, benzene, toluene, ethyl benzene and xylene (MBTEX). Additionally, a trip blank was analyzed for TPHG and MBTEX.

Details of work conducted during the fourth quarter are presented below.

Site Activities

On March 25, 1998 TPE supervised the removal of 500 gallons of groundwater stored in drums at the subject site. Clearwater Environmental Management transported the groundwater under non-hazardous waste manifest (#43799) to Alviso Independent Oil located in Alviso CA (see attached manifest).

Groundwater Gradient

On March 24, 1998 a TPE representative loosened well caps on all wells to allow groundwater levels to stabilize to atmospheric pressure within the wells prior to making depth-to-groundwater measurements for evaluation of groundwater flow direction and gradient.

On March 24 and 25, 1998 depth-to-groundwater was measured from the top of casing (TOC) in all wells to the nearest 0.01 foot using an electronic Keck Instrument, Inc., KIR-89 interface probe. A minimum of 3 repetitive measurements were made for each level determination to ensure accuracy. Depth-to-groundwater was subtracted from the TOC elevation, measured relative to mean sea level, to calculate the elevation of the groundwater level in each well (see attached Table 1). When floating product was present, the groundwater elevation was corrected by multiplying the floating product thickness by a density of .75 and adding the resultant value to the groundwater elevation.

Attached Figure 1 is a groundwater gradient map constructed from the data collected on March 24 and 25, 1998. Groundwater flow direction was to the north-northwest with a gradient about .021-.033 feet per foot, respectively. Average groundwater elevations, changes in average groundwater elevations, groundwater gradients, and groundwater flow directions are tabulated in attached Table 2.

Groundwater Sampling and Analytical Results

On March 24 and 25, 1998 groundwater samples were collected from groundwater monitoring wells MW-1 through TMW-5. Before sampling, the wells were purged of about 24 to 48 liters of water with dedicated polyethylene bailers and until the temperature, conductivity, and pH of the water in the wells had stabilized (see attached Records of Water Sampling). Since dedicated bailers were used for each well sampled, no decontamination was necessary between sampling events. The water samples were collected in laboratory provided, sterilized, 40-milliliter glass vials having Teflon-lined screw caps; measured for turbidity and labeled with project name, date, time collected, sample number, and sampler name. The samples were immediately stored in an iced-cooler for transport to California State Department of Health Services (DHS) certified Entech Analytical Labs, Inc., located in Sunnyvale, California accompanied by chain-of-custody documentation.

All groundwater samples, were analyzed for TPHG by the United States Environmental Protection Agency (EPA) Method 8015M and for MBTEX by the Modified EPA Method 8020.

Floating product was not measured in the monitoring wells during this quarterly period. Attached Table 3 summarizes the thickness of floating product measured in each well. Hydrocarbon odor and/or sheen were observed in all wells, except TMW-4.

Purge water was stored on site in 55-gallon drums labeled to show material stored, known or suspected chemical contaminant, date filled, expected removal date, company name, contact person, and telephone number.

See attached protocols for TPE's sample handling, groundwater monitoring well sampling, and quality assurance and quality control procedures.

TPHG was detected in wells MW-1, MW-2, MW-3 and TMW-5, at concentrations of 24,000 parts per billion (ppb), 8,100 ppb, 2,300 ppb, and 20,000 ppb respectively. Well TMW-4 was nondetectable for TPHG and MBTEX chemicals. Some or all MBTEX chemicals also were detected. The reader is referred to Table 4 for a summary of MBTEX chemical concentrations.

All analytical results are summarized in attached Table 4 and documented in an attached certified analytical report and a chain-of-custody.

RECOMMENDATIONS

TPE recommends that quarterly groundwater sampling of all 5 groundwater monitoring wells be continued to evaluate gradient, to monitor contaminant concentrations and to continue removal of free product from the wells. Concentrations of TPHG and MBTEX remained consistent in all wells.

Floating product was not measured any of the monitoring wells. Floating product has decreased due to rising water levels. Small blobs of product were noticed in wells MW-1 and MW-2.

The next sampling event is due on about June 25, 1998.

An additional copy of this report has been included for your delivery to:

Mr. Barney Chan
Alameda County Health Care Services Agency
Department of Environmental Health
1131 Harbor Bay Parkway
Alameda, CA 94502-6577

TPE recommends that this quarterly report be submitted with a signed cover letter from Messrs. Aaron and Stanley Wong.

If you have any questions, please call TPE at (510) 429-8088.

Sincerely,

Lee Huckins

Registered Geologist

Jef Far hornand

Jeff Farhoomand, M.S.

Principal Engineer



Expiration 5/31/99

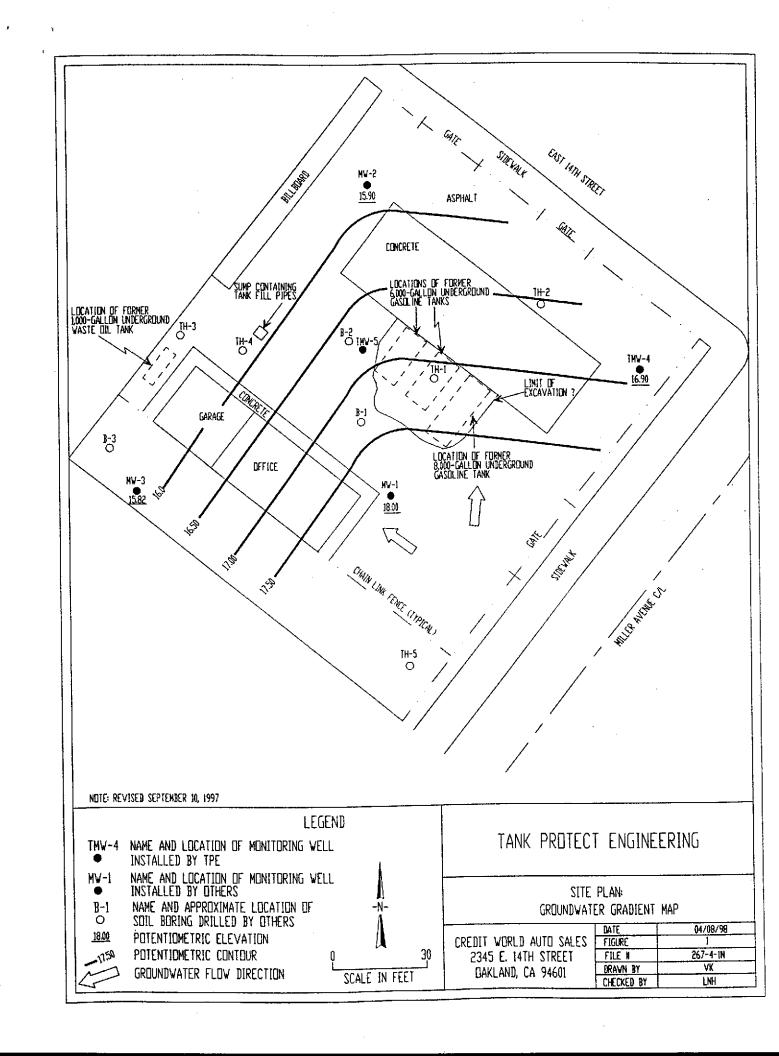


TABLE 1
GROUNDWATER ELEVATION

Well Name	Date	TOC ¹ Elevation (Feet MSL ⁴)	Depth-to-Water From TOC (Feet)	Depth to Product From TOC (Feet)	Corrected ³ Groundwater Elevation (Feet MSL)
MW-1	08/23/91 ⁵	100.00 ²	15.42	NA ⁹	84.58
	04/16/92 ⁶	27.33 ⁷	16.66	11.54	14.51 ⁸
	06/11/93		12.61	12.60	14.73
·	08/17/93		14.40	13.63	13.50 ⁷
······································	03/31/94		12.64	ND	14.69
	06/27/94		14.32	13.16	13.88
	09/16/94		15.86	13.64	13.14
	03/31/95		11.82	9.48	17.27
	06/28/95		13.50	12.60	14.51
	09/28/95		14.27	13.96	13.29
	12/26/95		11.77	11.62	15.67
	03/22/96		10.52	10.44	16.87
	06/20/96		13.38	12.49	14.63
	09/24/96		14.60	13.40	13.63
	12/27/96		9.17	9.08	18.23
	03/06/97		12.35	ND	14.98
	06/28/97		10.93	10.60	16.65
	09/18/97		13.10	12.93	14.36
	12/30/97		10.96	10.79	16.50
	03/24/98		9.33	ND	18.00
MW-2	08/23/915	98.585²	13.77	NA	84.815
	04/16/92 ⁶	25.92 ⁷	15.38	12.57	12.658
	06/11/93		13.185	ND ¹⁰	12.74
	08/17/93		14.04	14.03	11.89
	03/31/94		13.61	13.07	12.728
	06/27/94		14.24	13.44	12.28
	09/16/94		17.82	13.36	11.45
	03/31/95		16.72	9.28	14.78

TABLE 1
GROUNDWATER ELEVATION

Well Name	Date	TOC ¹ Elevation (Feet MSL ⁴)	Depth-to-Water From TOC (Feet)	Depth to Product From TOC (Feet)	Corrected ³ Groundwater Elevation (Feet MSL)
MW-2	06/28/95	25.92 ⁷	13.50	12.77	12.97
	09/28/95		14.63	14.09	11.70
	12/26/95		12.58	11.68	14.01
	03/22/96	-	11.46	11.31	14.57
	06/20/96	•	13.08	12.71	13.12
	09/30/96		16.67	12.92	12.06
	12/27/96		15.74	8.17	15.86
	03/06/97		12.55	ND	13.37
	06/28/97		11.98	11.94	13.97
	09/18/97		13.44	13.44	12.48
	12/30/97		11.31	ND	14.61
	03/25/98		10.02	ND	15.90
MW-3	08/23/915	99.25²	15.07	NA	84.18
	04/16/926	27.57 ⁷	14.14	13.98	13.55 ⁸
	06/11/93		14.275	ND	13.30
	08/17/93		15.77	ND	11.80
	03/31/94		14.35	ND	13.22
	06/27/94		14.77	ND	12.80
	09/16/94		15.42	15.37	12.19
	03/31/95	<u> </u>	12.98	12.52	14.94
	06/28/95		14.20	14.15	13.41
	09/28/95		15.17	ND	12.40
	12/26/95		13.33	13.27	14.28
	03/22/96		12.81	12.77	14.79
	06/20/96		13.95	13.88	13.67
	09/24/96		14.86	14.82	12.74
	12/27/96		11.04	10.98	16.58
	03/07/97		13.80	ND	13.77

TABLE 1
GROUNDWATER ELEVATION

Well Name	Date	TOC ¹ Elevation (Feet MSL ⁴)	Depth-to-Water From TOC (Feet)	Depth to Product From TOC (Feet)	Corrected ³ Groundwater Elevation (Feet MSL)
MW-3	06/28/97	27.57 ⁷	13.72	13.66	13.89
	09/18/97		14.76	ND	12.81
	12/30/97		12.97	ND	14.60
	03/24/98		11.75	ND	15.82
TMW-4	08/17/93	26.50 ⁷	13.26	ND	13.24
<u></u>	03/31/94		12.40	ND	14.10
· · ·	06/27/94		12.84	ND	13.66
	09/16/94	· · · · · · · · · · · · · · · · · · ·	13.58	ND	12.92
	03/31/95		10.23	ND	16.27
	06/28/95		12.21	ND	14.29
	09/28/95		13.38	ND	13.12
	12/26/95		11.32	ND	15.18
	03/22/96		10.54	ND	15.96
	06/20/96		12.14	ND	14.36
	09/24/96		13.01	ND	13.49
	12/27/96		9.51	ND	16.99
	03/07/97		11.92	ND	14.58
	06/28/97		10.70	ND	15.80
	09/18/97		12.94	ND	13.56
	12/30/97		10.92	ND	15.58
	03/25/98		9.60	ND	16.90
TMW-5	08/17/93	26.517	12.98	12.95	13.55
	03/31/94		11.39	ND	15.12
	06/27/94		12.24	ND	14.27
	09/16/94		13.02	12.97	13.53
	03/31/95		7.38	ND	19.13
	06/28/95		11.31	11.25	15.25
	09/28/95		14.42	ND	12.09

TABLE 1
GROUNDWATER ELEVATION

Well Name	Date	TOC ¹ Elevation (Feet MSL ⁴)	Depth-to-Water From TOC (Feet)	Depth to Product From TOC (Feet)	Corrected ³ Groundwater Elevation (Feet MSL)
TMW-5	12/26/95	26.517	10.16	10.11	16.38
	03/22/96		7.59	7.54	18.96
	06/26/96 ¹¹		7.12	ND	NA
	09/30/9611		7.42	ND ¹⁰	NA ⁹
	12/27/9611	·	6.38	ND	NA
	03/07/97 ¹¹		11.12	ND	NA
	08/17/93		12.98	12.95	13.55
	09/18/97 ¹¹		12	ND	
	12/30/97 ¹¹		8.97	ND	
	03/25/98		7.32	ND	

¹ TOP-OF-CASING.

² RELATIVE TO SITE DATUM ESTABLISHED BY ESE.

³ ELEVATION CORRECTED FOR FLOATING PRODUCT USING 0.75 DENSITY FOR GASOLINE.

⁴ MEAN SEA LEVEL.

⁵ WATER LEVEL MEASUREMENTS BY ESE.

⁶ WATER LEVEL MEASUREMENTS BY NKJ.

⁷ TOC SURVEYED 8/10/93 BY PROFESSIONAL ENGINEER.

⁸ CORRECTED GROUNDWATER ELEVATION BY TANK PROTECT ENGINEERING

⁸ CORRECTED GROUNDWATER ELEVATION BY TANK PROTECT ENGINEERING.

⁹ NOT AVAILABLE.

¹⁰ NOT DETECTED.

¹¹ WELL TOP DESTROYED DURING REMEDIATION

¹² NOT MEASURED - WELL OBSTRUCTED

TABLE 2
GROUNDWATER GRADIENTS, FLOW DIRECTIONS,
AND ELEVATION DATA

Date	Average Groundwater Elevation (Feet-MSL ¹)	Change in Average Groundwater Elevation (Feet)	Groundwater Gradient	Groundwater Flow Direction
04/16/92	13.57		.021	NW
06/11/93	13.59	0.02	.026	NW
08/17/93	12.80	-0.79	.029	RADIAL
03/31/94	13.97	+1.17	.050	RADIAL
06/27/94	13.38	-0.59	.020	RADIAL
09/16/94	12.65	-0.73	.01790411	RADIAL
03/31/95	16.48	+3.83	.075	RADIAL
06/28/95	14.09	-2.39	.025053	RADIAL
09/28/95	12.52	-1.57	.025	NW
12/26/95	15.09	+2.57	.048	RADIAL
03/22/96	16.23	+1.14	.034132	RADIAL
06/20/96 ²	13.95	-2.28	.016	NW
09/30/96 ²	12.98	-0.97	.019	NW
12/27/96 ²	16.41	+3.43	.024029	N-NW
03/07/97 ²	14.18	-2.23	.020035	N-NW
06/28/97 ²	15.07	+.89	.02704	NW
09/18/97 ²	13.30	-1.77	.02026	RADIAL
12/30/97 ²	15.32	+2.02	.025030	N-NW
03/25/98 ²	16.65	+1.34	.021033	RADIAL

 $^{^{1}}$ MEAN SEA LEVEL. 2 DOES NOT INCLUDE DATA FOR TMW-5; WELL TOP DESTROYED DURING REMEDIATION ACTIVITIES.

TABLE 3
SUMMARY OF FLOATING PRODUCT THICKNESS

Well Name	Date	Depth-to-Water From TOC ¹ (Feet)	Depth-to-Product From TOC (Feet)	Product Thickness (Feet)	
MW-1	04/16/92 ²	16.66	11.54	5.12	
	06/11/93	12.61	12.60	0.01	
	08/17/93	14.40	13.63	0.77	
	03/31/94	12.64	ND		
	06/27/94	14.32	13.16	1.16	
	09/16/94	15.86	13.64	2.22	
	03/31/95	11.82	9.48	2.34	
	06/28/95	13.50	12.60	0.90	
	09/28/95	14.27	13.96	0.31	
	12/26/95	11.77	11.62	0.15	
	03/22/96	10.52	10.44	0.08	
	06/20/96	13.38	12.49	0.089	
	09/24/96	14.60	13.40	1.20	
	12/27/96	9.17	9.08	0.09	
	03/06/97	12.35	ND		
	06/28/97	10.93	10.60	0.33	
	09/18/97*	13.10	12.93	.17	
·	12/30/97	10.96	10.79	0.17	
	03/24/98	9.33	ND		
MW-2	04/16/92 ²	15.38	12.57	2.81	
	06/11/93	13.185	ND^3		
	08/17/93	14.04	14.03	0.01	
	03/31/94	13.61	13.07	0.54	
	06/27/94	14.24	13.44	0.80	
	09/16/94	17.82	13.36	4.46	
	03/31/95	16.72	9.28	7.44	
	06/28/95	13.50	12.77 .	0.73	
	09/28/95	14.63	14.09	0.54	

TABLE 3
SUMMARY OF FLOATING PRODUCT THICKNESS

Well Name	Date	Depth-to-Water From TOC ¹ (Feet)	Depth-to-Product From TOC (Feet)	Product Thickness (Feet)
MW-2	12/26/95	12.58	11.68	0.90
	03/22/96	11.46	11.31	0.15
	06/20/96	13.08	12.71	0.37
	09/30/96	16.67	12.92	3.75
	12/27/96	15.74	8.17	7.57
	03/06/97	12.55	ND	
	06/28/97	11.98	11.94	0.04
	09/18/97*	13.44	13.44	TRACE
	12/30/97	11.31	ND	
	03/25/98	10.02	ND	
MW-3	04/16/92 ²	14.14	13.98	0.16
	06/11/93	14.275	ND	
	08/17/93	15.77	ND	***
	03/31/94	14.35	ND	
	06/27/94	14.77	ND	
	09/16/94	15.42	15.37	
	03/31/95	12.98	12.52	0.46
	06/28/95	14.20	14.15	0.05
	09/28/95	15.7	ND	
	12/26/95	13.33	13.27	0.06
	03/22/96	12.81	12.77	0.04
	06/20/96	13.95	13.88	0.07
	09/24/96	14.86	14.82	0.04
	12/27/96	11.04	10.98	0.06
	03/07/97	13.80	ND	
	06/28/97	13.72	13.66	0.06
	09/18/97	14.76	ND	
	12/30/97	12.97	ND	

TABLE 3
SUMMARY OF FLOATING PRODUCT THICKNESS

Well Name	Date	Depth-to-Water From TOC ¹ (Feet)	Depth-to-Product From TOC (Feet)	Product Thickness (Feet)
MW-3	03/24/98	11.75	ND	ultrad to:
TMW-4	08/17/93	13.26	ND	
	03/31/94	12.40	ND	
	06/27/94	12.84	ND	
	09/16/94	13.58	ND	***
	03/31/95	10.23	ND	
	06/28/95	12.21	ND	
	09/28/95	13.38	ND	
	12/26/95	11.32	ND	**
	03/22/96	10.54	ND	
	06/20/96	12.14	ND	
	09/24/96	13.01	ND	
	12/27/96	9.51	ND	
	03/07/97	11.92	ND	
	06/28/97	10.70	ND	
	09/18/97*	12.94	ND	
	12/30/97	10.92	ND	
	03/25/98	9.60	ND	
TMW-5	08/17/93	12.98	12.95	0.03
	03/31/94	11.39	ND	
	06/27/94	12.24	ND.	
	09/16/94	13.02	12.97	0.05
	03/31/95	7.38	ND	
	06/28/95	11.31	11.25	0.06
	09/28/95	14.42	ND	
	12/26/95	10.16	10.11	0.05
	03/22/96	7.59	7.54	0.05
	06/20/9611	7.12	ND	

TABLE 3
SUMMARY OF FLOATING PRODUCT THICKNESS

Well Name	Date	Depth-to-Water From TOC ¹ (Feet)	Depth-to-Product From TOC (Feet)	Product Thickness (Feet)	
TMW-5	09/30/9611	7.42	ND		
	12/27/9611	6.38	ND		
	03/07/9711	11.12	ND		
	06/28/9712	NM ¹²	ND ¹²	4.040	
	09/18/97*	12.00	ND		
	12/30/97	8.97	ND		
	03/25/98	7.32	ND		

¹ TOP-OF-CASING.

² RELATIVE TO SITE DATUM ESTABLISHED BY ESE.

³ ELEVATION CORRECTED FOR FLOATING PRODUCT USING 0.75 DENSITY FOR GASOLINE.

⁴ MEAN SEA LEVEL

⁵ WATER LEVEL MEASUREMENTS BY ESE.

⁶ WATER LEVEL MEASUREMENTS BY NKJ.

⁷ TOC SURVEYED 8/10/93 BY PROFESSIONAL ENGINEER.

⁸ CORRECTED GROUNDWATER ELEVATION BY TANK PROTECT ENGINEERING.

⁹ NOT AVAILABLE.

¹⁰ NOT DETECTED.

¹¹ WELL TOP DESTROYED DURING REMEDIATION

¹² NOT MEASURED - WELL OBSTRUCTED

^{*} VISUAL MEASUREMENTS FROM BAILER

TABLE 4
SUMMARY OF GROUNDWATER SAMPLE ANALYTICAL RESULTS (ppb¹)

Sample ID Name	Date	TPHG	Methyl t- Butyl Ether	Benzene	Toluene	Ethyl- benzene	Xylenes
MW-1	08/17/93	110,000	NA ²	270	690	730	3,100
	03/28/94	34,000	NA	4,900	1,800	1,200	4,000
	06/27/94	21,000	NA	12,000	810	760	2,500
	09/16/94	37,000	NA	7,900	2,400	1,300	3,300
	03/31/95	43,000	NA	8,100	1,900	1,000	4,200
	06/28/95	80,000	NA	7,900	3,200	1,800	7,300
	09/28/95	24,000	<1,200	4,900	470	470	1,700
	12/26/95	61,000	<1,200	12,000	4,200	1,500	5,500
	03/22/96	19,000	<2,500	6,000	47	260	<750
	06/20/96	15,000	910	2,900	100	240	98
	09/24/96	20,000	340	4,800	220	300	770
	12/27/96	24,000	< 5.0	5,900	440	310	740
	03/07/97	30,000	< 5.0	5,700	370	290	780
	06/28/97	54,000	< 5.0	5,200	1,300	1,000	4,900
	09/18/97	54,000	<5.0	5,300	1,200	1,100	4,600
	12/30/97	61,000	1,400	4,300	1,800	1,600	6,900
	03/24/98	24,000	2,000	1,000	1,000	1,300	4,300
MW-2	08/17/93	49,000	NA	94	240	250	980
	03/28/94	14,000	NA	4,200	<250	910	1,400
	06/27/94	24,000	NA	4,400	72	1,100	1,700
	09/16/94	40,000	NA	2,300	250	2,000	4,100
	03/31/95	28,000	NA	4,000	< 120	1,100	1,400
	06/28/95	40,000	NA	2,700	130	1,700	2,900
	09/28/95	7,500	<62	420	14	250	190
	12/26/95	22,000	<250	1,300	88	950	1,800
	03/22/96	9,800	<1,200	2,200	<120	400	<380
	06/20/96	35,000	550	770	< 0.50	240	< 0.50
	09/30/96	58,000	<5.0	1,600	230	2,200	4,000

TABLE 4
SUMMARY OF GROUNDWATER SAMPLE ANALYTICAL RESULTS (ppb¹)

Sample ID Name	Date	ТРНС	Methyl t- butyl ether	Benzene	Toluene	Ethyl- benzene	Xylenes
MW-2	12/27/96	29,000	< 5.0	2,100	< 0.50	1,200	1,800
	03/07/97	13,000	< 5.0	1,300	37	290	180
	06/28/97	12,000	<5.0	840	< 0.50	640	360
	09/18/97	12,000	<5.0	680	< 0.50	320	84
	12/30/97	13,000	<5.0)	1,100	40	350	220
	03/25/98	8,100	(676)	1,300	51	410	230
MW-3	08/17/93	9,600	NA	4.1	17	28	54
	03/28/94	8,400	NA	2,400	56	67	200
	06/27/94	9,900	NA	3,300	<22	<25	73
	09/16/94	16,000	NA	2,300	80	620	240
	03/31/95	16,000	NA	2,800	70	< 25	920
	06/28/95	11,000	NA	2,300	32	81	240
	09/28/95	6,300	< 420	1,900	<42	200	< 120
	12/26/95	25,000	<250	3,800	97	94	1,600
	03/22/96	16,000	250	3,100	75	69	350
	06/20/96	8,500	220	1,400	28	140	15
	09/24/96	12,000	<5.0	2,400	87	340	110
	12/27/96	5,800	240	1,700	28	< 0.50	42
	03/10/97	9,000	< 5.0	1,700	< 0.50	110	< 0.50
	06/28/97	15,000	< 5.0	2,200	< 0.50	160	190
	09/18/97	28,000	< 5.0	3,800	< 0.50	100	< 0.50
	12/30/97	21,000	300	2,200	< 0.50	31	< 0.50
	03/24/98	2,300	85	870	7.2	20	< 0.50
TMW-4	08/17/93	150	NA	< 0.50	0.8	1.4	3.7
	03/28/94	<50	NA	< 0.50	< 0.50	< 0.50	<1.5
	06/27/94	< 50	NA	< 0.50	< 0.50	< 0.50	<1.5
	09/16/94	<50	NA	< 0.50	< 0.50	< 0.50	<1.5
	03/31/95	<50	NA	< 0.50	< 0.50	< 0.50	<1.5
	06/28/95	<50	NA	< 0.50	< 0.50	< 0.50	<1.5
	09/28/95	< 50	<5.0	< 0.50	< 0.50	< 0.50	<1.5

TABLE 4
SUMMARY OF GROUNDWATER SAMPLE ANALYTICAL RESULTS (ppb1)

Sample ID Name	Date	ТРНС	Methyl t- butyl ether	Benzene	Toluene	Ethyl- benzene	Xylenes
TMW-4	12/26/95	< 50	<5.0	< 0.50	< 0.50	< 0.50	<1.5
	03/22/96	<50	<5.0	< 0.50	< 0.50	< 0.50	<1.5
	06/20/96	<50	<5.0	< 0.50	< 0.50	< 0.50	< 0.50
	09/24/96	<50	<5.0	< 0.50	< 0.50	< 0.50	< 0.50
	12/27/96	<50	<5.0	< 0.50	< 0.50	< 0.50	< 0.50
	03/10/97	< 50	< 5.0	< 0.50	< 0.50	< 0.50	< 0.50
	06/27/97	< 50	<5.0	< 0.50	< 0.50	< 0.50	< 0.50
	09/18/97	<50	<5.0	< 0.50	< 0.50	,<0.50	< 0.50
	12/30/97	<50	< 5.0	< 0.50	< 0.50	< 0.50	< 0.50
	03/25/98	< 50	<5.0	< 0.50	< 0.50	< 0.50	< 0.50
TMW-5	08/17/93	120,000	NA	640	730	790	3,600
	03/28/94	70,000	NA	23,000	1,500	4,100	15,000
-	06/28/94	56,000	NA	26,000	940	5,500	26,000
	09/16/94	96,000	NA	17,000	720	3,500	12,000
	03/31/95	64,000	NA	13,000	470	3,500	6,100
	06/28/95	65,000	NA	9,000	240	2,600	5,300
	09/28/95	79,000	<1,200	17,000	1,800	2,700	7,000
	12/26/95	110,000	<1,200	11,000	800	2,300	4,500
	06/26/96	30,000	830	4,000	180	1,500	2,500
	09/30/96	6,900	< 5.0	1,600	79	130	370
	12/27/96	78,000	< 5.0	12,000	1,900	2,900	9,700
	03/10/97	84,000	<5.0	9,900	1,100	2,600	8,800
	06/28/97	NA	NA	NA	NA	NA	NA
	09/18/97	65,000	<5.0	8,000	< 0.5	2,000	4,700
	12/30/97	79,000	< 5.0	6,400	340	2,300	5,500
	03/25/98	20,000	(2,400)	6,000	260	2,700	5,800
TMW-6	09/18/97 ³	< 50.0	<5.0	< 0.5	< 0.5	< 0.5	< 0.5
	12/30/97 ³	<50.0	< 5.0	< 0.5	< 0.5	< 0.5	< 0.5

TABLE 4 SUMMARY OF GROUNDWATER SAMPLE ANALYTICAL RESULTS (ppb1)

Sample ID Name	Date	ТРНС	Methyl t- butyl ether	Benzene	Toluene	Ethyl- benzene	Xylenes
TMW-6	03/25/98 ³	< 50.0	<5.0	< 0.5	< 0.5	< 0.5	< 0.5

PARTS PER BILLION.
 NOT ANALYZED.
 TRIP BLANKS.

SAMPLE HANDLING PROCEDURES

Soil and groundwater samples will be packaged carefully to avoid breakage or contamination and will be delivered to the laboratory in an iced-cooler. The following sample packaging requirements will be followed.

- . Sample bottle/sleeve lids will not be mixed. All sample lids will stay with the original containers and have custody seals affixed to them.
- Samples will be secured in coolers to maintain custody, control temperature and prevent breakage during transportation to the laboratory.
- A chain-of-custody form will be completed for all samples and accompany the sample cooler to the laboratory.
- . Ice, blue ice or dry ice (dry ice will be used for preserving soil samples collected for the Alameda County Water District) will be used to cool samples during transport to the laboratory.
- Water samples will be cooled with crushed ice. In the Alameda County Water District, water samples will be buried in the crushed ice with a thermometer, and the laboratory will be requested to record thermometer temperature at the time of receipt.
- Each sample will be identified by affixing a pressure sensitive, gummed label or standardized tag on the container(s). This label will contain the site identification, sample identification number, date and time of sample collection and the collector's initials.
- Soil samples collected in brass tubes will be preserved by covering the ends with Teflon tape and capping with plastic end-caps. The tubes will

be labeled, sealed in quart size bags and placed in an iced-cooler for transport to the laboratory.

All groundwater sample containers will be precleaned and will be obtained from a State Department of Health Services certified analytical laboratory.

Sample Control/Chain-of-Custody: All field personnel will refer to this workplan to verify the methods to be employed during sample collection. All sample gathering activities will be recorded in the site file; all sample transfers will be documented in the chain-of-custody; samples will be identified with labels; all sample bottles will be custody-sealed. All information is to be recorded in waterproof ink. All TPE field personnel are personally responsible for sample collection and the care and custody of collected samples until the samples are transferred or properly dispatched.

The custody record will be completed by the field technician or professional who has been designated by the TPE project manager as being responsible for sample shipment to the appropriate laboratory. The custody record will include, among other things, the following information: site identification, name of person collecting the samples, date and time samples were collected, type of sampling conducted (composite/grab), location of sampling station, number and type of containers used and signature of the TPE person relinquishing samples to a non-TPE person with the date and time of transfer noted. The relinquishing individual will also put all the specific shipping data on the custody record.

Records will be maintained by a designated TPE field employee for each sample: site identification, sampling location, station number, date, time, sampler's name, designation of the sample as a grab or composite, notation of the type of sample (e.g., groundwater, soil boring, etc.), preservatives used, onsite measurement data and other observations or remarks.

GROUNDWATER MONITORING WELL SAMPLING PROCEDURES

Groundwater monitoring wells will not be sampled until at least 24 to 72 hours (according to local regulatory guidelines) after well development. Groundwater samples will be obtained using a bladder pump, clear Teflon bailer or dedicated polyethylene bailer. Prior to collecting samples, the sampling equipment will be thoroughly decontaminated to prevent introduction of contaminants into the well and to avoid cross-contamination. Monitoring wells will be sampled after 3 to 10 wetted casing volumes of groundwater have been evacuated and pH, electrical conductivity and temperature have stabilized as measured with a Hydac Digital Tester. If the well is emptied before 3 to 10 well volumes are removed, the sample will be taken when the water level in the well recovers to 80% or more of its initial water level.

When a water sample is collected, turbidity of the water will be measured and recorded with a digital turbidimeter. Degree of turbidity will be measured and recorded in nephelometric turbidity units (NTU).

TPE will also measure the thickness of any floating product in the monitoring wells using an interface probe or clear Teflon or polyethylene bailer. The floating product will be measured after well development but prior to the collection of groundwater samples. If floating product is present in the well, TPE will recommend to the client that product removal be commenced immediately and reported to the appropriate regulatory agency.

Unless specifically waived or changed by the local, prevailing regulatory agency, water samples will be handled and preserved according to the latest United States Environmental Protection Agency methods as described in the Federal Register (Volume 44, No. 233, Page 69544, Table II) for the type of analysis to be performed.

Development and/or purge water will be stored on site in labeled containers. The disposal of the containers and development and/or purge water is the responsibility of the client.

MEASUREMENTS

<u>Purged Water Parameter</u>: During purging, discharged water will be measured for the following parameters.

<u>Parameter</u>	Units of Measurement
pH Electrical Conductivity Temperature Depth to Water Volume of Water Discharged Turbidity	None Micromhos Degrees F or C Feet/Hundredths Gallons NTU

<u>Documentation:</u> All parameter measurements will be documented in writing on TPE development logs.

QUALITY ASSURANCE AND QUALITY CONTROL PROCEDURES

The overall objectives of the field sampling program include generation of reliable data that will support development of a remedial action plan. Sample quality will be checked by the use of proper sampling, handling and testing methods. Additional sample quality control methods may include the use of background samples, equipment rinsate samples and trip and field blanks. Chain-of-custody forms, use of a qualified laboratory, acceptable detection limits and proper sample preservation and holding times also provide assurance of accurate analytical data.

TPE will follow a quality assurance and quality control (QA/QC) program in the field to ensure that all samples collected and field measurements taken are representative of actual field and environmental conditions and that data obtained are accurate and reproducible. These activities and laboratory QA/QC procedures are described below.

<u>Field Samples</u>: Additional samples may be taken in the field to evaluate both sampling and analytical methods. Three basic categories of QA/QC samples that may be collected are trip blanks, field blanks and duplicate samples.

Trip blanks are a check for cross-contamination during sample collection, shipment, and laboratory analysis. They are water samples that remain with the collected samples during transportation and are analyzed along with the field samples to check for residual contamination. Analytically confirmed organic-free water will be used for organic parameters and deionized water for metal parameters. Blanks will be prepared by the laboratory supplying the sample containers. The blanks will be numbered, packaged and sealed in the same manner as the other samples. One trip blank will be used for sets greater than 20 samples. The trip blank is not to be opened by either the sample collectors or the handlers.

The field blank is a water sample that is taken into the field and is opened and exposed at the sampling point to detect contamination from air exposure. The water

sample is poured into appropriate containers to simulate actual sampling conditions. Contamination due to air exposure can vary considerably from site to site.

The laboratory will not be informed about the presence of trip and field blanks, and false identifying numbers will be put on the labels. Full documentation of these collection and decoy procedures will be made in the site log book.

Duplicate samples are identical sample pairs (collected in the same place and at the same time), placed in identical containers. For soils, adjacent sample liners will be analyzed. For the purpose of data reporting, one is arbitrarily designated the sample, and the other is designated as a duplicate sample. Both sets of results are reported to give an indication of the precision of sampling and analytical methods.

The laboratory's precision will be assessed without the laboratory's knowledge by labeling one of the duplicates with false identifying information. Data quality will be evaluated on the basis of the duplicate results.

Laboratory OA/OC: Execution of a strict QA/QC program is an essential ingredient in high-quality analytical results. By using accredited laboratory techniques and analytical procedures, estimates of the experimental values can be very close to the actual value of the environmental sample. The experimental value is monitored for its precision and accuracy by performing QC tests designed to measure the amount of random and systematic errors and to signal when correction of these errors is needed.

The QA/QC program describes methods for performing QC tests. These methods involve analyzing method blanks, calibration standards, check standards (both independent and the United States Environmental Protection Agency-certified standards), duplicates, replicates and sample spikes. Internal QC also requires adherence to written methods, procedural documentation and the observance of good laboratory practices.

WHITE ORIGINAL (Return to Ge

PROJECT NO	267	DATE.	3-25-6	7,0,	•				WELL NO.:
PROJECT NAME: Y WAS									ELL DIAMETER: Z
									TOC ELEV:
PROJECT LOCATION: 2345 E 14* SAMPLER: LNH									LOCK NO.: 605
				LOCK NO.: BCO					
ANALYSES:									E144-
WELL DEPTH		-							
WELL DEPTH) mail
DEPTH TO V				7		_	·.	7	8
PRESSURE (circle one)?:	YES	OR NO	Derect	3-24	96		8	muz
IF YES, WAS	PRESSURE	(circle	one):	SITIVE	OR NEGA	ATIVE?		13. Magai	•
			_					M	
WATER VOL	UME IN W	/ELL:_	3.19	<u> </u>					
[2-INCH CAS	ING = 0.16	GAL/F	T] [4-I	NCH CA	SING =	0.65 GAL/I	FT]	•	
[6-INCH CAS	SING = 1.47	GAL/F	T] [1 C	GAL = 3.	.78 L]				· .
									LOCATION MAP
			<i>a</i> .	- 11	- L-S			WOL (CAL)	a. 2.0
			GAL):) 4 (L)	: <u>.30</u>			VOL. (GAL):	
PURGE MET	THOD:	Yo	4					HOD:	
				FIE	LD ME	ASUREN	MENTS		
			 	/					
F =	Depth to ater (FT)	Vol (L)	Temp (Deg. F)	pН	EC	Clarity	Turbidity (NTU)		Remarks
	1101 (11)	1		200	200			15/04-01-01	Diegra
7267		1	***	8,02	303		 	Sheen	
1227	1		1	6.73	788		<u> </u>	Sheen	1
1129		34	68.2	6.83	773			, 11	<i>)</i>
1230	·	35	66.7	6.85	752				4
1232		36		6.87	760) 1	٨
1233		37	65.8	686	749) ji	1
- 11 - 1		38	1	687	T	1.		t)	4
235		<u> </u>	65.4	100 (1.10		 		

1240 Well sampled			
		WATER VOL. IN DRUM:	
SIGNATURE:	· ·	NEED NEW DRUM?:	

•								_
PROJECT	NO. 267	DATE:	WELL NO .:) Muy					
PROJECT	NAME:	WAS	WELL DIAMETER:					
PROJECT	LOCATION:	231 5		TOC ELEV:				
	: <u>L</u> _		ř	LOCK NO.: 605				
ANALYSE	s: DA	2¢B						
WELL DE	PTH (from cor	struction		~ 4.				
WELL DE	PTH (measured) <u>33.</u> 3	54_sof	T BOTT	ом?:		·	EH'A
DEPTH T	O WATER:	7.60	TIN	ME: <u>10</u>	16	-		
PRESSUR	E (circle one)?1	YES	OR NO	Spened	3-2	148		3
IF YES, V	VAS PRESSURI	circle	one): PO	SITIVE	OR NEGA	ATIVE?		
				_				
	VOLUME IN V			-		٠		
•	CASING $= 0.16$					0.65 GAL/	FT]	
[6-INCH	CASING = 1.47	GAL/F	T] . [1 (GAL = 3	.78 L]			
								LOCATION MAP
CALCUL	ATED PURGE	VOL. ((GAL) .	49 (L)	: 46	ACTL	JAL PURGE	VOL. (GAL): (L).46
	METHOD:		Zh.			SA	MPLE METH	iod: Poly
			Į.	FIE	LD ME	ASUREN	MENTS	·
					,			
Time	Depth to	Vol	Тетр	pН	EC	Clarity	Turbidity (NTU)	Remarks
	Water (FT)	(L)	(Deg. F)				(1110)	
1012		1	622	3,22			 	Noctor
1110		41	/ <u>65.8</u>	7.16	693			1)
1122		42	92.5	7.00	625		·	<u> </u>
1124		43	166.5	701	696			/!
))25		44	160.60	7.01	592			
1007		مبدد	(A B		107			

		•
		WATER VOLUMENTAL
		WATER VOL. IN DRUM:
		NICED NICHT DEIMO.
SIGNATURE:		NEED NEW DRUM?:
2IQIAVI OKD:		· · · · · · · · · · · · · · · · · · ·

42,8

700

7.67

668

46

1128

•								
PROJECT	NO.: 2/07	DATE:	3-24-	<u> 18</u>			.* •	WELL NO.: Mus
PROJECT	NAME:	AUL.	5					WELL DIAMETER: 2
PROJECT	LOCATION:_	2343	5 E 14#					TOC ELEV:
SAMPLER	- LM	<u></u>						LOCK NO.: 605
	S: TP!		TEX					
WELL DE	PTH (from con	struction	n detail):		-			·
WELL DE	PTH (measured): <u>34 </u>	Oゴ_SOF	т вотт	ом?:			,
DEPTH T	O WATER:	9.3	3 тіл	ие: <u>15</u>	de_	107	and uct	
	E (circle one)?:					'		mul
IF YES, W	AS PRESSURE	E (circle	one): PO	SITIVE	OR NEGA	TIVE?		
WATER VOLUME IN WELL: 4.6/ [2-INCH CASING = 0.16 GAL/FT] [4-INCH CASING = 0.65 GAL/FT] [6-INCH CASING = 1.47 GAL/FT] [1 GAL = 3.78 L]								
								LOCATION MAP
	. TED DIDE	VOI	(at 12	ሰዱ ሙ	42	۵(۳۲	IAT. PURGE	VOL. (GAL): (L): 48
CALCULATED PURGE VOL. (GAL): 12.03 (L): 48 ACTUAL PURGE VOL. (GAL): (L): 48 PURGE METHOD: SAMPLE METHOD:								
PURGE METHOD: SAMPLE METHOD: FIELD MEASUREMENTS								
				FIE	LD ME	MOUNDA		
Time	Depth to Water (FT)	Vol (L)	Temp (Deg. F)	pН	EC	Clarity	Turbidity (NTU)	Remarks
	- ()	1	1	<u> </u>				bbbs of product

Time	Depth to Water (FT)	Vol (L)	Temp (Deg. F)	pН	EC	Clarity	Turbidity (NTU)	Remarks
1540		1	69,2	7.56	1540			bbs of product
1600		43	62.8	6.47	1410			Odor show
1602		44	65.7	6149	1390) /
1604		45	65.7	6.45	1380			D
6016		46			1360			D
407		47	<i>1</i> 5.3	642				11 -
1608		48	65.4	641	430			/)
160	wellsan	Noted					51.6	

SIGNATURE:_

WATER	VOL. II	N DRUM:	·
NEE	D NEW	DRUM?:	<u> 10</u>

PROJECT NO.: 267 DATE 3-24-78	well no.: Mh-3
PROJECT NAME: CLUAS	WELL DIAMETER: ZV
PROJECT LOCATION: 2345 E	TOC ELEV:
SAMPLER: LANA	LOCK NO.: 605
ANALYSES: THO GITTEN	
WELL DEPTH (from construction detail):	
WELL DEPTH (measured): 34.93 SOFT BOTTOM?:	Ottice
DEPTH TO WATER: 11.75 TIME: 1624	
PRESSURE (circle one)?: YES OR NO	
IF YES, WAS PRESSURE (circle one): POSITIVE OR NEGATIVE?	mw3
eriging the state of the state	Miles
WATER VOLUME IN WELL:	
[2-INCH CASING = 0.16GAL/FT] [4-INCH CASING = 0.65GAL/FT]	
[6-INCH CASING = 1.47 GAL/FT] [1 GAL = 3.78 L]	
	LOCATION MAP
11.1.C. 1111	110
CALCULATED PURGE VOL. (GAL): 1.19 (L): 44 ACTUAL PURGE	
PURGE METHOD: SAMPLE METH	IOD: Hay
FIELD MEASUREMENTS	·

Time	Depth to Water (FT)	Vol (L)	Temp (Deg. F)	рН	EC	Člarity	Turbidity (NTU)	Remarks
1633		1	62.7	7.90	1080			ple of product
1657		39	62.6	575	1060			odor sheep
1659		40	63.5	6.72	1080			11
1701		41	63.6	630	1070		1	1)
1702		42	63.7	6.69	1060			1)
1704		43	636	671	1040			11
1706		4	63.6	6.66	1060			1)
1710							2)160	1

	· •
	WATER VOL. IN DRUM:
SIGNATURE:	NEED NEW DRUM?:

•	267							·	
PROJECT	No.: 13-3	_ DATE	: <u>3-</u> 25-	<u> 98</u>			••	WELL NO. MW	-ত
PROJECT	NAME:	24W	<u> </u>	<u>-</u>			•	WELL DIAMETER: Z	···
PROJECT	LOCATION:_	234	SE14	++-				TOC ELEV:	
SAMPLER	<u> 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2</u>	<u> </u>			<u>_</u>			LOCK NO.: LOCK	
ANALYSE	S: TPAC	TP	115 A-				[· · · · · · · · · · · · · · · · · · ·	
WELL DE	PTH (from co	nstruction	n detail):						
WELL DE	EPTH (measure	d): 26 (IL SOI	т вотт	ом?: <u></u>	0		· 	
DEPTH T	O WATER:	7.3z	TI)	ME (9 3	53_	-		CQ TIME	
PRESSUR	E (circle one)?	: YES	OR'NO	Opered	3-24	48		- The second sec	-
IF YES, V	VAS PRESSUR	E (circle	e one): PO	SITIVE	OR NEG	ATIVE?		Garage	
WATER '	VOLUME IN V	VELL:_	2.05	•			. !		
	CASING = 0.1				SING =	0.65 GAL/	FT]		
[6-INCH	CASING = 1.4	7 GAL/F	T] [10	GAL = 3	.78 L]				
							,	LOCATION MAP	
				3 <u>0</u> (L): <u>24</u>	ACTU	JAL PURGE	vol. (GAL): (L): 24 HOD: Poly	
PURGE 1	метноD:		-014					10D: 1 214	
				FIE	LD ME	ASUREN	AEN 15		
Time	Depth to Water (FT)	Vol (L)	Temp (Deg. F)	pН	EC	Clarity	Turbidity (NTU)	Remarks	
7935		1	73.6	7.11	1284			odon steen	
0952		19	67.1	1	834))	
5954		20	67.3		3.89			N	
956		21	67.2	1	879		,	1)	
0158		ZZ	67, 1		879			,	
ルノコンミ									
11		1	, ,,,,	1				L)	
ಾ ೯ છ0		23	67,0	7.03	879			L)	

SIGNATURE:______ WATER VOL. IN DRUM:______
NEED NEW DRUM?:_____

Entech Analytical Labs, Inc.

CA ELAP# 2224

525 Del Rey Avenue, Suite E • Sunnyvale, CA 94086 • (408) 735-1550 • Fax (408) 735-1554

Tank Protect Engineering 2821 Whipple Road Union City, CA 94587 Attn: Lee Huckins

Date:	4/1/98
Date Received:	3/26/98
Date Analyzed:	3/30-31/98
Project #:	267032598
P.O. #:	1465
Sampled By:	Client

Certified Analytical Report

Water Sample Analysis:


Test	MW-1	MW-2	MW-3	TMW-4	Units	PQL	EPA Method #
Sample Matrix	Water	Water	Water	Water			
Sample Date	3/24/98	3/25/98	3/24/98	3/25/98			
Sample Time	1610	1240	1710	1132			
Lab#	E5974	E5975	E5976	E5977			
DF-Gas/BTEX	25	25	10	1			
TPH-Gas	24,000	8,100	2,300	ND	μα/liter	50.0 µg/l	8015M
MTBE	2,000	670	85	ND	µg/liter	5.0 µg/1	8020
Benzene	1,0002	1,300	870	ND	μg/liter	0.5 µg/1	8020
Toluene	1,000	51	7.2	ND	με/liter	0.5 µg/1	8020
Ethyl Benzene	1,300	410	20	ND	ug/liter	0.5 µg/1	8020
Xylenes	4,300	230	ND	ND	μg/liter	0.5 µg/1	8020

- 1. DLR=DF x PQL
- 2. DF=100
- 3. Analysis performed by Entech Analytical Labs, Inc. (CAELAP #2224)

DF=Dilution Factor
DLR=Detection Reporting Limit

PQL=Practical Quantitation Limit ND=None Detected at or above DLR

Environmental Analysis Since 1983

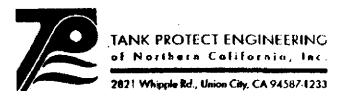

[510] 429-8088 m [800] 523-8088 m Fox [510] 429-8089

LAB: En	-ch
TURNAROUND:	5 day
P.O. #: 1465	

CHAIN OF CUSTODY PAGE

21 WIF	ple 1904	e, wic		CA SKE	SAMPLING LOCATION	CON- TAINER	37			REMARKS
N~	3/21	/40		X	E5974	Schows	X	X		* include MMBE
	3/25	1240		¥	E5971	2-4and	×	7		need results on April 1, 1998
<u>~~3</u>	3/24	1710		X	63916	k-Hornel	Y	y		
Mar #	3 hzs	N32-		X	<i>5</i> 5917	e-Hanne	4	×		
·5	3/25	1002		×	E5978	z-Usme	×	X		
	3/2s	1245		入	85979	Sylven	٧	×		
lagrat at	76	سندر	aters)	1 . –	19140 Du	NU	4		olinquished by	

DATE:____

Ř

0