

ALCO
HAZMAT
93 DEC 10 AH11:03



Chevron

December 9, 1993

Chevron U.S.A. Products Company

2410 Camino Ramon
San Ramon, CA 94583
P.O. Box 5004
San Ramon, CA 94583-0804

Marketing Department

Phone 510 842 9500

Mr. Scott Seery
Alameda County Environmental Health
80 Swan Way, Suite 200
Oakland, CA 94621

Re: Chevron Service Station No. 9-8139
16304 Foothill Rd., San Leandro, California

Dear Mr. Seery :

Monitoring wells MW-7, MW-10, and MW-11 were below the detection limit for total petroleum hydrocarbon as gasoline (TPH-G). Wells MW-1, MW-2, MW-6, and MW-8 had benzene, toluene, ethylbenzene, and xylene ranging from 0.6 to 4 ppb. Well MW-9 had 1100 ppb TPH-G and 21 ppb benzene while MW-3 had 19000 ppb TPH-G and 7800 ppb benzene.

Please refer to the enclosed report dated December 3, 1993 from Sierra Environmental Services for additional information. If you have any questions or comments, please feel free to call me at (510) 842-8752.

Sincerely,

Chevron U.S.A. Products Co.


A handwritten signature in black ink, appearing to read "Kenneth Kan".

Kenneth Kan
Engineer

LKAN/MacFile 9-8139R10

cc : Mr. Lester Feldman
RWQCB-S.F. Bay Region
2101 Webster Str., Suite 500
Oakland, CA 94612

Mr. Steve Willer
Chevron U.S.A. Products Co.

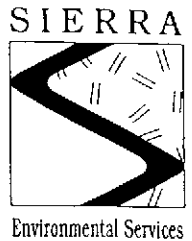

December 3, 1993

Kenneth Kan
Chevron USA Products Company
P.O. Box 5004
San Ramon, CA 94583

Re: Chevron Service Station #9-8139
16304 Foothill Boulevard
San Leandro, California
SES Project #1-289-04


Dear Mr. Kan:

This report presents the results of the quarterly ground water sampling at Chevron Service Station #9-8139, located at 16304 Foothill Boulevard in San Leandro, California. **Nine wells, MW-1 through MW-3 and MW-6 through MW-11 were sampled (Figure 1).**

On October 27, 1993, SES personnel visited the site. Water level measurements were collected in all site wells and all wells were checked for the presence of free-phase hydrocarbons. Free-phase hydrocarbons were not present in any of the site wells. Water level data are shown in Table 1 and ground water elevation contours are included on Figure 1.

The ground water samples were collected on October 27, 1993 in accordance with SES Standard Operating Procedure - Ground Water Sampling (attached). All analyses were performed by GTEL of Concord, California. Analytic results for ground water are presented in Tables 2 & 3. The chain of custody document and laboratory analytic reports are attached. SES is not responsible for laboratory omissions or errors.

Thank you for allowing us to provide services to Chevron. Please call if you have any questions.

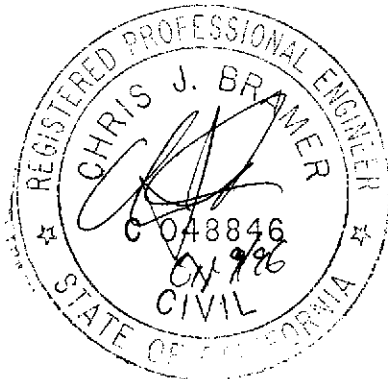


Sincerely,
Sierra Environmental Services

Carol Eaton
Carol Eaton
Staff Environmental Scientist


Chris J. Bramer
Chris J. Bramer
Professional Engineer #C48846

CE/CJB/gb
28904QM.NO3

Attachments - Figure
- Tables
- SES Standard Operating Procedure
- Chain of Custody Document and Laboratory Analytic Reports

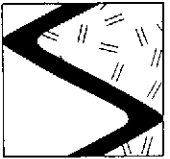

SIERRA

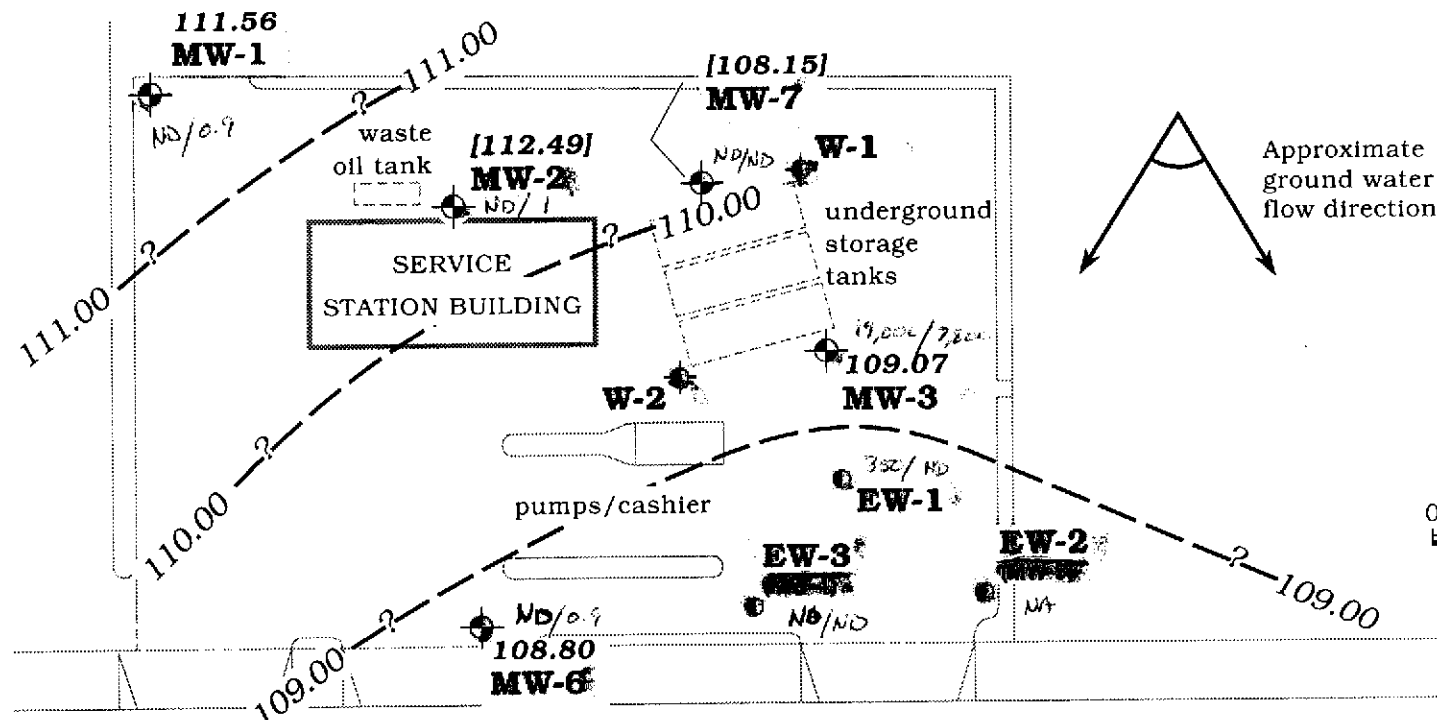

EXPLANATION

- MW-11** Monitoring well
- EW-3** Extraction well (former well designation)
- W-2** Observation well
- 108.57** Ground water elevation, in feet
- [108.15]** Ground water elevation not used in contouring
- 109.00** Ground water elevation contour, dashed where inferred, queried where uncertain

FOOTHILL BOULEVARD

108.57 **MW-8** **MW-9** 108.58 median

dirt sidewalk

108.69 **MW-11** **MW-10** 108.70


TPit / Benzene (ppb)

Figure 1. Monitoring Well Locations and Ground Water Elevation Contour Map - October 27, 1993 - Chevron Service Station #9-8139, 16304 Foothill Boulevard, San Leandro, California



Table 1. Water Level Data and Well Construction Details - Chevron Service Station #9-8139, 16304 Foothill Boulevard, San Leandro, California

Well ID	Date Measured	DTW (ft)	TOC (ft)	GWE (msl)	Product Thickness* (ft)	Screen Interval	Sand Pack Interval	Bentonite/Grout Interval
MW-1	3/23/90	12.92	127.09	114.17	0	25 - 30	22 - 30	20.5 - 22
	9/6/90	14.68		112.41	0			
	9/25/90	15.01		112.08	0			
	11/29/90	14.82		112.27	0			
	2/20/91	14.29		112.80	0			
	4/19/91	12.16		114.93	0			
	5/22/91	13.69		113.40	0			
	8/22/91	15.38		111.71	0			
	11/13/91	15.80		111.29	0			
	1/30/92	14.71		112.38	0			
	4/23/92	12.22		114.87	0			
	7/27/92	14.30		112.79	0			
	10/26/92	15.90		111.19	0			
	1/29/93	10.51		116.58	0			
	4/30/93	9.90		117.19	0			
	7/14/93	12.28		114.81	0			
10/27/93	15.53	111.56	0					
MW-2	3/23/90	12.40	125.98	113.58	0	25 - 30	23 - 31.5	21.5 - 23
	9/6/90	14.85		111.13	0			
	9/25/90	14.80		111.18	0			
	11/29/90	14.40		111.58	0			
	2/20/91	14.09		111.89	0			
	4/19/91	12.62		113.36	0			
	5/22/91	12.98		113.00	0			
	8/22/91	14.93		111.05	0			
	11/13/91	15.42		110.56	0			
	1/30/92	14.70		111.28	0			
	4/23/92	13.83		112.15	0			
	7/27/92	15.30		110.68	0			
	10/26/92	15.62		110.36	0			
	1/29/93	9.26		116.72	0			
	4/30/93	9.66		116.32	0			
	7/14/93	11.90		114.08	0			
10/27/93	13.49	112.49	0					

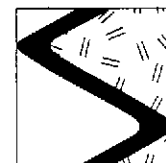

SIERRA


Table 1. Water Level Data and Well Construction Details - Chevron Service Station #9-8139, 16304 Foothill Boulevard, San Leandro, California (continued)

Well ID	Date Measured	DTW (ft)	TOC (ft)	GWE (msl)	Product Thickness* (ft)	Screen Interval	Sand Pack Interval	Bentonite/Grout Interval
						-----feet below grade----->		
MW-3	3/23/90	17.50	127.84	110.34	0	15.5 - 25.5	12.5 - 25.5	10.5 - 12.5
	9/6/90	18.72	126.77	108.05	0			
	9/25/90	18.40		108.37	0			
	11/29/90	18.97		107.80	0			
	2/20/91	19.20		107.57	0			
	4/19/91	17.81		108.96	0			
	5/22/91	17.88		108.89	0			
	8/1/91	19.23		107.54	0			
	8/22/91	20.17		106.60	0			
	11/13/91	19.95		106.82	0			
	1/30/92	19.14		107.63	0			
	4/23/92	17.75		109.02	0			
	7/27/92	19.00		107.77	0			
	10/26/92	19.62		107.15	0			
	1/29/93	15.95		110.82	0			
	4/30/93	15.67		111.10	0			
7/14/93	16.83		109.94	0				
10/27/93	17.70		109.07	0				
MW-4	3/23/90	16.02	125.22	109.20	0	14 - 22	11 - 23	10 - 11
	9/6/90	17.35		107.87	0			
	9/25/90	17.48		107.74	0			
	11/29/90	17.61		107.61	0			
	2/20/91	17.81		107.41	0			
	4/19/91	15.80		109.42	0			
	5/22/91 ²	16.68		108.54	0			
MW-5	3/23/90	16.89	125.85	108.96	0	14.5 - 24	13 - 25.5	11 - 13
	9/7/90	18.46		107.42 ¹	0.04			
	11/29/90	18.87		107.54 ¹	0.71			
	2/20/91	18.91		107.31 ¹	0.47			
	4/19/91	16.99		109.24 ¹	0.48			
	9/25/90	19.30		107.58 ¹	1.3			
5/22/91 ²	17.69		108.42 ¹	0.33				



Table 1. Water Level Data and Well Construction Details - Chevron Service Station #9-8139, 16304 Foothill Boulevard, San Leandro, California (continued)

Well ID	Date Measured	DTW (ft)	TOC (ft)	GWE (msl)	Product Thickness* (ft)	Screen Interval	Sand Pack Interval	Bentonite/Grout Interval
						-----feet below grade----->		
MW-6	3/23/90	18.51	124.18	105.67	0	24.5 - 29.5	23 - 34	21 - 23
	9/7/90	16.18		108.00	0			
	9/25/90	16.42		107.76	0			
	11/29/90	16.11		108.07	0			
	2/20/91	16.09		108.09	0			
	4/19/91	15.15		109.03	0			
	5/22/91	15.41		108.77	0			
	8/23/91	17.80		106.38	0			
	11/14/91	16.52		107.66	0			
	1/30/92	16.48		107.70	0			
	4/23/92	16.20		107.98	0			
	7/27/92	16.52		107.66	0			
	10/26/92	17.12		107.06	0			
	1/29/93	13.13		111.05	0			
	4/30/93	14.86		109.32	0			
	7/14/93	14.61		109.57	0			
	10/27/93	15.38		108.80	0			
MW-7	3/23/90	21.40	126.86	105.46	0	21.5 - 27	20.5 - 26.5	18.5 - 20.5
	9/7/90	18.38		108.48	0			
	9/25/90	19.25		107.61	0			
	11/29/90	18.55		108.31	0			
	2/20/91	18.55		108.31	0			
	4/19/91	17.33		109.53	0			
	5/22/91	17.42		109.44	0			
	8/22/91	19.05		107.81	0			
	11/13/91	21.84		105.02	0			
	1/30/92	22.42		104.44	0			
	4/23/92	22.04		104.82	0			
	7/27/92	22.24		104.62	0			
	10/26/92	22.11		104.75	0			
	1/29/93	17.07		109.79	0			
	4/30/93	14.86		112.00	0			
	7/14/93	16.10		110.76	0			
	10/27/93	18.71		108.15	0			

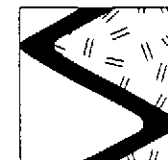

SIERRA

Table 1. Water Level Data and Well Construction Details - Chevron Service Station #9-8139, 16304 Foothill Boulevard, San Leandro, California (continued)

Well ID	Date Measured	DTW (ft)	TOC (ft)	GWE (msl)	Product Thickness* (ft)	Screen Interval	Sand Pack Interval	Bentonite/Grout Interval
						<-----feet below grade----->		
MW-8	9/7/90	16.07	123.61	107.54	0	22 - 30.5	20.5 - 31.5	17.5 - 20.5
	9/25/90	16.20		107.41	0			
	11/29/90	16.30		107.31	0			
	2/20/91	16.32		107.29	0			
	4/19/91	14.71		108.90	0			
	5/22/91	15.42		108.19	0			
	8/22/91	17.15		106.46	0			
	11/14/91	16.99		106.62	0			
	1/30/92	16.30		107.31	0			
	4/23/92	15.05		108.56	0			
	7/27/92	16.08		107.53	0			
	10/26/92	16.72		106.89	0			
	1/29/93	12.82		110.79	0			
	4/30/93	13.54		110.07	0			
	7/14/93	14.65		108.96	0			
	10/27/93	15.04		108.57	0			
MW-9	8/22/91	17.60	124.20	106.60	0	17 - 27	15 - 27	13 - 15
	11/14/91	17.48		106.72	0			
	1/30/92	16.71		107.49	0			
	4/23/92	15.23		108.97	0			
	7/27/92	16.72		107.48	0			
	10/26/92	17.22		106.98	0			
	1/29/93	13.39		110.81	0			
	4/30/93	14.00		110.20	0			
	7/14/93	15.08		109.12	0			
	10/27/93	15.62		108.58	0			
MW-10	7/27/92	17.52	125.03	107.51	0	14.5 - 30	12 - 30	9 - 12
	10/27/92	18.06		106.97	0			
	1/29/93	14.15		110.88	0			
	4/30/93	14.68		110.35	0			
	7/14/93	15.80		109.23	0			
	10/27/93	16.33		108.70	0			



Table 1. Water Level Data and Well Construction Details - Chevron Service Station #9-8139, 16304 Foothill Boulevard, San Leandro, California (continued)

Well ID	Date Measured	DTW (ft)	TOC (ft)	GWE (msl)	Product Thickness* (ft)	Screen Interval	Sand Pack Interval	Bentonite/Grout Interval
						-----feet below grade----->		
MW-11	7/27/92	15.38	122.92	107.54	0	14.5 - 30	11 - 30	8 - 11
	10/26/92	15.97		106.95	0			
	1/29/93	12.24		110.68	0			
	4/30/93	12.77		110.15	0			
	7/14/93	13.84		109.08	0			
	10/27/93	14.23		108.69	0			
EW-1	8/1/91	17.54	124.95	107.41	0	18 - 26.5	17 - 27	15 - 17
EW-2	8/1/91	18.07	125.79	107.72	0	12.5 - 22.5	11.5 - 28	10.5 - 11.5
EW-3	8/1/91	17.49	125.22	107.73	0	12.5 - 22.5	10.5 - 28	10.5 - 11.5

EXPLANATION:

DTW = Depth to water
 TOC = Top of casing elevation
 GWE = Ground water elevation
 msl = Measurements referenced relative to mean sea level
 --- = Not applicable/Not measured

NOTES:


All top of casing elevations compiled from Quarterly Ground Water Monitoring Report prepared for Chevron by Burlington Environmental Inc., December 3, 1992.

Well construction details were compiled from Burlington Environmental, Inc. boring logs dated November 1989, December 1989, May 1990, August 1990, June 1991 and April 1992.

* Product thickness was measured on and after January 29, 1993 with an MMC flexi-dip interface probe.

¹ Ground water elevation level corrected for the presence of free-phase hydrocarbons using assumed density of 0.79. Compiled from the Quarterly Ground Water Monitoring Report prepared for Chevron by Burlington Environmental Inc., December 3, 1992.

² Monitoring well was converted to a ground water extraction well on June 10, 1991. MW-4 was redesignated EW-3. MW-5 was redesignated EW-2.

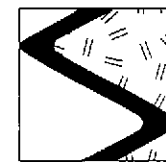

SIERRA

Table 2. Analytic Results for Ground Water - Chevron Service Station #9-8139, 16304 Foothill Boulevard, San Leandro, California

Well ID	Date Sampled	Analytic Lab	Analytic Method	TPPH(G)	B	T	E	X	EDB
				-----ppb----->					
MW-1	12/5/89	UNK	8015/8020/413/504 ^{1,2}	<500	<0.5	<0.5	<0.5	<0.5	<0.5
	5/24/90	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	9/6/90	SAL	8015/8020/504	<50	<0.5	0.8	<0.5	0.5	<0.5
	11/29/90	SAL	8015/8020	<50	0.7	0.9	<0.5	1	---
	2/20/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	5/22/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	8/22/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	11/13/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	1/31/92	SPA	8015/8020	<50	0.5	<0.5	<0.5	0.5	---
	4/23/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	7/27/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	10/26/92	SPA	8015/8020	<50	0.6	<0.5	<0.5	<0.5	---
	1/29/93	GTEL	8015/8020	<50	3	3	0.7	3	---
	4/30/93	GTEL	8015/8020	<50	<0.5	0.7	<0.5	1	---
	7/14/93	GTEL	8015/8020	<50	0.7	1	<0.5	3	---
	10/27/93	GTEL	8015/8020	<50	0.9	2	<0.5	2	---
MW-2	12/5/89	UNK	8015/8020/413/504 ^{1,2}	<500	<0.5	<0.5	<0.5	0.9	<0.5
	5/24/90	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	9/6/90	SAL	8015/8020/504	<50	<0.5	<0.5	<0.5	<0.5	<0.5
	11/29/90	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	2/20/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	5/22/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	8/22/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	11/13/91	SAL	8015/8020	58	<0.5	0.5	<0.5	2.3	---
	1/31/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	4/23/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	7/27/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	1.1	---
	10/26/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	1/29/93	GTEL	8015/8020	<50	3	8	1	5	---
	4/30/93 ³	GTEL	8015/8020	<1,300	<13	<13	<13	<13	---
	7/14/93	GTEL	8015/8020	<50	0.8	2	0.8	4	---
	10/27/93	GTEL	8015/8020	<50	1	2	1	2	---



Table 2. Analytic Results for Ground Water - Chevron Service Station #9-8139, 16304 Foothill Boulevard, San Leandro, California
(continued)

Well ID	Date Sampled	Analytic Lab	Analytic Method	TPPH(G)	B	T	ppb		
							E	X	EDB
MW-3 (d)	12/5/89	UNK	8015/8020/504	24,000	2,400	1,800	360	2,600	<0.5
	12/5/89	UNK	8015/8020/413/504 ²	24,000	2,500	1,900	390	2,600	<0.5
	5/24/90	SAL	8015/8020	9,000	2,600	1,700	250	1,500	---
	5/24/90	SAL	8015/8020	10,000	2,600	1,800	260	1,600	---
	9/6/90	SAL	8015/8020/504	3,500	900	550	110	460	<0.5
	11/29/90	SAL	8015/8020	9,200	1,100	1,100	210	1,100	---
	2/20/91	SAL	8015/8020	8,800	960	780	200	920	---
	5/22/91	SAL	8015/8020	28,000	5,800	1,200	460	2,300	---
	8/22/91	SAL	8015/8020	21,000	3,100	2,000	480	2,000	---
	8/22/91	SAL	8015/8020	19,000	2,700	1,800	420	1,700	---
	11/13/91	SAL	8015/8020	18,000	2,400	1,200	450	2,200	---
	1/31/92	SPA	8015/8020	18,000	3,800	920	700	2,600	---
	4/23/92	SPA	8015/8020	46,000	5,000	1,900	1,000	3,500	---
	7/27/92	SPA	8015/8020	26,000	4,900	1,100	1,200	3,600	---
	10/26/92	SPA	8015/8020	6,600	1,100	41	220	570	---
	1/29/93	GTEL	8015/8020	32,000	5,900	2,900	1,300	5,000	---
	4/30/93	GTEL	8015/8020	14,000 ⁴	6,100	98	870	2,400	---
7/14/93	GTEL	8015/8020	12,000 ⁴	3,100	1,100	720	2,900	---	
10/27/93	GTEL	8015/8020	19,000	7,800	400	1,500	3,400	---	
MW-4**	12/5/89	UNK	8015/8020/504	19,000	390	1,300	460	1,800	<0.5
	5/24/90	SAL	8015/8020	4,500	210	440	140	480	---
	9/6/90	SAL	8015/8020/504	6,000	680	520	170	580	<0.5
	11/29/90	SAL	8015/8020	15,000	800	1,000	430	1,700	---
	2/20/91	SAL	8015/8020	15,000	640	390	420	1,600	---
	2/20/91	SAL	8015/8020	15,000	680	410	430	1,600	---
	5/22/91	SAL	8015/8020	9,800	580	140	310	740	---
(d)	5/22/91	SAL	8015/8020	7,200	520	130	270	670	---
MW-5**	5/25/90	SAL	8015/8020/504	28,000	920	1,100	460	1,300	2.4
	9/7/90	SAL	8015/8020	---	---	---	---	---	---
	11/29/90	SAL	8015/8020	---	---	---	---	---	---
	2/20/91	SAL	8015/8020	---	---	---	---	---	---
	5/22/91	SAL	8015/8020	---	---	---	---	---	---



Table 2. Analytic Results for Ground Water - Chevron Service Station #9-8139, 16304 Foothill Boulevard, San Leandro, California
(continued)

Well ID	Date Sampled	Analytic Lab	Analytic Method	TPPH(G) B T E X EDB					
				-----ppb----->					
MW-6	5/25/90	SAL	8015/8020/504	<50	<2	<3	<3	<3	<0.02
	9/7/90	SAL	8015/8020/504	<50	<2	<3	<3	<3	<0.05
	11/29/90	SAL	8015/8020/504	<50	<0.5	<0.5	<0.5	<0.5	<0.05
	2/20/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	5/22/91	SAL	8015/8020	<50	0.5	0.7	<0.5	1.1	---
	8/23/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	11/14/91	SAL	8015/8020/504	<50	<0.5	<0.5	<0.5	<0.5	<0.02
	11/14/91	SAL	8015/8020/504	<50	<0.5	0.6	<0.5	1.1	<0.05
	1/31/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	(d) 1/31/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	(d) 4/23/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	(d) 4/23/92	SPA	8015/8020	---	---	---	---	---	---
	7/27/92	SPA	8015/8020	<50	1.2	0.6	<0.5	1.9	---
	10/27/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	1/29/93	GTEL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	4/30/93	GTEL	8015/8020	<50	<0.5	<0.5	<0.5	0.6	---
	7/14/93	GTEL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
10/27/93	GTEL	8015/8020	<50	0.9	1	0.6	1	---	
MW-7	5/25/90	SAL	8015/8020/504	<50	<2	<3	<3	<3	<0.02
	9/27/90	SAL	8015/8020/504	<50	<2	<3	<3	<3	<0.05
	(d) 9/27/90	SAL	8015/8020/504	<50	<2	<3	<3	<3	<0.05
	11/29/90	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	2/20/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	5/22/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	8/22/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	11/13/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	1/31/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	4/23/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	7/27/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	10/26/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	1/29/93	GTEL	8015/8020	<50	4	13	2	8	---
	4/30/93	GTEL	8015/8020	<50	<0.5	<0.5	<0.5	0.6	---
	7/14/93	GTEL	8015/8020	<50	<0.5	1	<0.5	2	---
	10/27/93	GTEL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---



Table 2. Analytic Results for Ground Water - Chevron Service Station #9-8139, 16304 Foothill Boulevard, San Leandro, California (continued)

Well ID	Date Sampled	Analytic Lab	Analytic Method	TPPH(G)	B	T	-----ppb-----			EDB
							E	X		
* MW-8 (d)	9/7/90	SAL	8015/8020/504	<50	<0.5	<0.5	<0.5	<0.5	<0.5	<0.05
	11/29/90	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	<0.5	---
	11/29/90	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	<0.5	---
	2/20/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	<0.5	---
	5/22/91	SAL	8015/8020	<50	0.6	<0.5	<0.5	1	---	---
	8/23/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	<0.5	---
	11/14/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	<0.5	---
	1/30/92	SPA	8015/8020	<50	1	0.7	<0.5	1.1	---	---
	4/24/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	<0.5	---
	7/27/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	<0.5	---
	10/27/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	<0.5	---
	1/29/93	GTEL	8015/8020	1,400	470	470	37	160	---	---
	4/30/93 ³	GTEL	8015/8020	1,600	<13	15	18	29	---	---
	7/14/93	GTEL	8015/8020	<50	<0.5	0.7	<0.5	2	---	---
	10/27/93	GTEL	8015/8020	<50	3	4	2	4	---	---
* MW-9	8/22/91	SAL	8015/8020/504	9,600	46	170	98	1,200	<0.05	
	11/14/91	SAL	8015/8020/504	11,000	130	58	86	1,500	<0.05	
	1/30/92	SPA	8015/8020	11,000	210	29	110	1,900	---	
	4/24/92	SPA	8015/8020	17,000	180	25	100	1,900	---	
	7/27/92	SPA	8015/8020	2,800	59	1.6	18	280	---	
	10/27/92	SPA	8015/8020	3,200	38	<0.5	19	200	---	
	1/29/93	GTEL	8015/8020	1,300	23	6	8	100	---	
	4/30/93 ³	GTEL	8015/8020	<1,300	<13	<13	<13	58	---	
	7/14/93	GTEL	8015/8020	1,300	25	4	15	120	---	
	10/27/93	GTEL	8015/8020	1,100	21	10	19	73	---	
	MW-10	7/27/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
10/27/92		SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---	
1/29/93		GTEL	8015/8020	<50	<0.5	<0.5	<0.5	0.7	---	
4/30/93		GTEL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---	
7/14/93		GTEL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---	
10/27/93		GTEL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---	
MW-11	7/27/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---	
	10/27/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---	
	1/29/93	GTEL	8015/8020	<50	8	16	2	10	---	
	4/30/93	GTEL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---	
	7/14/93	GTEL	8015/8020	<50	<0.5	0.7	<0.5	1	---	
	10/27/93	GTEL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---	



Table 2. Analytic Results for Ground Water - Chevron Service Station #9-8139, 16304 Foothill Boulevard, San Leandro, California
(continued)

Well ID	Date Sampled	Analytic Lab	Analytic Method	TPPH(G)	B	T	E	X	EDB
				-----ppb-----					
EW-1	5/25/90	SAL	8015/8020/504	3,900	260	430	64	340	0.03
	10/27/93	GTEL	8015/8020	350	<0.5	<0.5	<0.5	<0.5	---
EW-3	10/27/93	GTEL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
Rinseate	12/5/89	UNK	8015/8020/413/504 ²	<500	<0.5	<0.5	<0.5	<0.5	<0.05
	5/24/90	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	9/7/90	SAL	8015/8020/504	<50	<0.5	<0.5	<0.5	<0.5	<0.05
	2/20/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	5/22/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	8/22/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	11/13/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	1/30/92	SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	4/23/92	SPA	8015/8020	---	---	---	---	---	---
	Trip Blank	2/20/91	SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5
5/22/91		SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
5/22/91		SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
11/13/91		SAL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
1/30/92		SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
4/23/92		SPA	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
7/27/92		SPA	8015/8020	<0.5	<0.5	<0.5	<0.5	<0.5	---
10/26/92		SPA	8015/8020	<0.5	<0.5	<0.5	<0.5	<0.5	---
TB-LB	1/29/93	GTEL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	4/30/93	GTEL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	7/14/93	GTEL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	10/27/93	GTEL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
Bailer Blank BB	1/29/93	GTEL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	4/30/93	GTEL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	7/14/93	GTEL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---
	10/27/93	GTEL	8015/8020	<50	<0.5	<0.5	<0.5	<0.5	---



Table 2. Analytic Results for Ground Water - Chevron Service Station #9-8139, 16304 Foothill Boulevard, San Leandro, California
(continued)

EXPLANATION:

TPPH(G) = Total Purgeable Petroleum Hydrocarbons as Gasoline
TPH(D) = Total Petroleum Hydrocarbons as Diesel
O&G = Oil and Grease
B = Benzene
T = Toluene
E = Ethylbenzene
X = Xylenes
EDB = Ethylene Dibromide
ppb = Parts per billion
--- = Not analyzed/Not applicable
(d) = Duplicate sample

ANALYTIC METHODS:

8015 = EPA Method 8015/5030 for TPPH(G)
8015 = Modified EPA Method 8015 for TPH(D)
8020 = EPA Method 8020 for BTEX
413 = Method 413 for O&G
504 = EPA Method 504 for EDB

ANALYTIC LABORATORY:

UNK = Unknown
SAL = Superior Analytic Precision, Inc. of San Francisco and Martinez, California
SPA = Superior Precision Analytical, Inc. of San Francisco and Martinez, California
GTEL = GTEL Environmental Laboratories, Inc. of Concord, California

NOTES:

Analytic data prior to January 15, 1993 compiled from Quarterly Ground Water Monitoring Report prepared for Chevron by Burlington Environmental Inc., December 3, 1992.

- ** Monitoring well was converted to a ground water extraction well on June 10, 1991. MW-4 redesignated EW-3. MW-5 redesignated EW-2.
- ¹ TPH(D) analyzed during this event. Not detected at detection limits of 1,000 ppb.
- ² O&G analyzed during this event. Not detected at detection limit of 5,000 ppb.
- ³ Detection limit raised due to surfactants in sample.
- ⁴ Uncategorized compound not included in gasoline hydrocarbon concentration.



Table 3. Analytic Results for Halogenated Volatile Organic Compounds - Chevron Service Station #9-8139, 16304 Foothill Boulevard, San Leandro, California

Well ID	Date Sampled	Analytic Lab	Analytic Method	C	BR	BDM	DBM	Other HVOC's
				←-----ppb----->				
MW-2	4/30/93	GTEL	8010	77	<0.5	<0.5	<0.5	ND ¹

EXPLANATION:

C = Chloroform
BR = Bromoform
BDM = Bromodichloromethane
DBM = Dibromochloromethane
HVOC = Halogenated Volatile Organic Compound
ND = Not detectable
--- = Not analyzed/Not applicable
ppb = Parts per billion

ANALYTIC METHODS:

8010 = EPA Method 8010 for HVOC's.

ANALYTIC LABORATORIES:

GTEL = Groundwater Technology Environmental Laboratories, Inc. of Concord and Torrance, California.

NOTES:

¹ Other HVOC's not detected at detection limits of 0.5 to 1.0 ppb.



SES STANDARD OPERATING PROCEDURE GROUND WATER SAMPLING

The following describes sampling procedures used by SES field personnel to collect and handle ground water samples. Before samples are collected, careful consideration is given to the type of analysis to be performed so that precautions are taken to prevent loss of volatile components or contamination of the sample, and to preserve the sample for subsequent analysis. Wells will be sampled no less than 24 hours after well development. Collection methods specific to ground water sampling are presented below.

Prior to sampling, each well is checked for the presence of free-phase hydrocarbons using an MMC flexi-dip interface probe. Product thickness (measured to the nearest 0.01 foot) is noted on the sampling form. Water level measurements are also made using either a water level meter or the interface probe. The water level measurements are also noted on the sampling form.

Prior to sampling, each well is purged of a minimum of three well casing volumes of water using a steam-cleaned PVC bailer, or a pre-cleaned pump. Temperature, pH and electrical conductivity are measured at least three times during purging. Purging is continued until these parameters have stabilized (i.e., changes in temperature, pH or conductivity do not exceed $\pm 0.5^{\circ}\text{F}$, 0.1 or 5%, respectively).

The purge water is taken to Chevron's Richmond Refinery for disposal.

Ground water samples are collected from the wells with steam-cleaned Teflon bailers. The water samples are decanted into the appropriate container for the analysis to be performed. Pre-preserved sample containers may be used or the analytic laboratory may add preservative to the sample upon arrival. Duplicate samples are collected from each well as a back-up sample and/or to provide quality control. The samples are labeled to include the project number, sample ID, date, preservative, and the field person's initials. The samples are placed in polyethylene bags and in an ice chest (maintained at 4°C) for transport under chain of custody to the laboratory.

The chain of custody form includes the project number, analysis requested, sample ID, date analysis and the SES field person's name. The form is signed and dated (with the transfer time) by each person who yields or receives the samples beginning with the field personnel and ending with the laboratory personnel.

A trip blank and bailer blank accompanies each sampling set, or 5% trip blanks and 5% bailer blanks are included for sets of greater than 20 samples. The bailer blank is prepared by pouring previously boiled water into a steam-cleaned Teflon bailer prior to sampling a well. The trip and bailer blanks are analyzed for some or all of the same compounds as the ground water samples.



GTEL

ENVIRONMENTAL
LABORATORIES, INC.

4080 Pike Lane
Concord, CA 94520
(510) 685-7852
(800) 544-3422 Inside CA
(800) 423-7143 Outside CA
(510) 825-0720 FAX

Client Number: SIE01CHV08
Consultant Project Number: 1-289-04
Facility Number: 9-8139
Project ID: 16304 Foothill
San Leandro
Work Order Number: C3-10-0508
Date Reissued: 11-16-93

November 16, 1993

Rick Hilton
Sierra Environmental Services
P.O. Box 2546
Martinez, CA 94553

Enclosed please find the analytical results for samples received by GTEL Environmental Laboratories, Inc. on 10/27/93.

A formal Quality Assurance/Quality Control (QA/QC) program is maintained by GTEL, which is designed to meet or exceed the EPA requirements. Analytical work for this project met QA/QC criteria, unless otherwise stated in the footnotes.

GTEL is certified by the California State Department of Health Services, Laboratory certification number E1075, to perform analyses for drinking water, wastewater, and hazardous waste materials according to EPA protocols.

If you have any questions concerning this analysis or if we can be of further assistance, please call our Customer Service Representative.

Sincerely,

GTEL Environmental Laboratories, Inc.

SVOA Group Manager for
Eileen F. Bullen
Laboratory Director

Client Number: SIE01CHV08
 Consultant Project Number: 1-289-04
 Facility Number: 9-8139
 Project ID: 16304 Foothill
 San Leandro
 Work Order Number: C3-10-0508
 Date Reissued: 11-16-93

Table 1

ANALYTICAL RESULTS

**Aromatic Volatile Organics and
 Total Petroleum Hydrocarbons as Gasoline in Water**

EPA Methods 5030, 8020, and Modified 8015^a

GTEL Sample Number		01	02	03	04
Client Identification		TBLB	BB	MW-1	MW-2
Date Sampled		10/27/93	10/27/93	10/27/93	10/27/93
Date Analyzed		11/04/93	11/04/93	11/04/93	11/05/93
Analyte	Detection Limit, ug/L	Concentration, ug/L			
Benzene	0.5	<0.5	<0.5	0.9	1
Toluene	0.5	<0.5	<0.5	2	2
Ethylbenzene	0.5	<0.5	<0.5	<0.5	1
Xylene, total	0.5	<0.5	<0.5	2	2
BTEX, total	--	--	--	5	6
TPH as Gasoline	50	<50	<50	<50	<50
Detection Limit Multiplier		1	1	1	1
BFB surrogate, % recovery		98.6	89.9	87.1	93.0

a. Test Methods for Evaluating Solid Waste, SW-846, Third Edition, Revision 0, US EPA November 1986. Modification for TPH as gasoline as per California State Water Resources Control Board LUFT Manual protocols, May 1988 revision. Bromofluorobenzene surrogate recovery acceptability limits are 70 - 130%.

Client Number: SIE01CHV08
 Consultant Project Number: 1-289-04
 Facility Number: 9-8139
 Project ID: 16304 Foothill
 San Leandro
 Work Order Number: C3-10-0508
 Date Reissued: 11-16-93

Table 1 (Continued)

ANALYTICAL RESULTS

**Aromatic Volatile Organics and
 Total Petroleum Hydrocarbons as Gasoline in Water**

EPA Methods 5030, 8020, and Modified 8015^a

GTEL Sample Number		05	06	07	08
Client Identification		MW-6	MW-7	MW-8	MW-10
Date Sampled		10/27/93	10/27/93	10/27/93	10/27/93
Date Analyzed		11/04/93	11/04/93	11/05/93	11/04/93
Analyte	Detection Limit, ug/L	Concentration, ug/L			
Benzene	0.5	0.9	<0.5	3	<0.5
Toluene	0.5	1	<0.5	4	<0.5
Ethylbenzene	0.5	0.6	<0.5	2	<0.5
Xylene, total	0.5	1	<0.5	4	<0.5
BTEX, total	--	4	--	13	--
TPH as Gasoline	50	<50	<50	<50	<50
Detection Limit Multiplier		1	1	1	1
BFB surrogate, % recovery		90.6	89.2	92.9	90.3

a. Test Methods for Evaluating Solid Waste, SW-846, Third Edition, Revision 0, US EPA November 1986. Modification for TPH as gasoline as per California State Water Resources Control Board LUFT Manual protocols, May 1988 revision. Bromofluorobenzene surrogate recovery acceptability limits are 70 - 130%.

Client Number: SIE01CHV08
 Consultant Project Number: 1-289-04
 Facility Number: 9-8139
 Project ID: 16304 Foothill
 San Leandro
 Work Order Number: C3-10-0508
 Date Reissued: 11-16-93

Table 1 (Continued)

ANALYTICAL RESULTS

**Aromatic Volatile Organics and
 Total Petroleum Hydrocarbons as Gasoline in Water**

EPA Methods 5030, 8020, and Modified 8015^a

GTEL Sample Number		09	10	11 ^b	12
Client Identification		MW-11	MW-9	MW-3	EW-1
Date Sampled		10/27/93	10/27/93	10/27/93	10/27/93
Date Analyzed		11/05/93	10/31/93	10/31/93	11/05/93
Analyte	Detection Limit, ug/L	Concentration, ug/L			
Benzene	0.5	<0.5	21	7800	<0.5
Toluene	0.5	<0.5	10	400	<0.5
Ethylbenzene	0.5	<0.5	19	1500	<0.5
Xylene, total	0.5	<0.5	73	3400	<0.5
BTEX, total	--	--	120	13000	--
TPH as Gasoline	50	<50	1100	19000	350
Detection Limit Multiplier		1	1	50	1
BFB surrogate, % recovery		87.8	94.7	104	86.5

- a. Test Methods for Evaluating Solid Waste, SW-846, Third Edition, Revision 0, US EPA November 1986. Modification for TPH as gasoline as per California State Water Resources Control Board LUFT Manual protocols, May 1988 revision. Bromofluorobenzene surrogate recovery acceptability limits are 70 - 130%.
- b. Uncategorized compound is not included in gasoline hydrocarbon concentration. (Possibly MTBE).

Client Number: SI01CHV08
 Consultant Project Number: 1-289-04
 Facility Number: 9-8139
 Project ID: 16304 Foothill
 San Leandro
 Work Order Number: C3-10-0508
 Date Reissued: 11-16-93

Table 1 (Continued)

ANALYTICAL RESULTS

**Aromatic Volatile Organics and
 Total Petroleum Hydrocarbons as Gasoline in Water**

EPA Methods 5030, 8020, and Modified 8015^a

GTEL Sample Number		13	S103093	M110493	
Client Identification		EW-3	METHOD BLANK	METHOD BLANK	
Date Sampled		10/27/93	--	--	
Date Analyzed		11/05/93	10/30/93	11/04/93	
Analyte	Detection Limit, ug/L	Concentration, ug/L			
Benzene	0.5	<0.5	<0.5	<0.5	
Toluene	0.5	<0.5	<0.5	<0.5	
Ethylbenzene	0.5	<0.5	<0.5	<0.5	
Xylene, total	0.5	<0.5	<0.5	<0.5	
BTEX, total	--	--	--	--	
TPH as Gasoline	50	<50	<50	<50	
Detection Limit Multiplier		1	1	1	
BFB surrogate, % recovery		87.5	99.6	92.0	

a. Test Methods for Evaluating Solid Waste, SW-846, Third Edition, Revision 0, US EPA November 1986. Modification for TPH as gasoline as per California State Water Resources Control Board LUFT Manual protocols, May 1988 revision. Bromofluorobenzene surrogate recovery acceptability limits are 70 - 130%.

Client Number: SIE01CHV08
 Consultant Project Number: 1-289-04
 Facility Number: 9-8139
 Project ID: 16304 Foothill
 San Leandro
 Work Order Number: C3-10-0508
 Date Reissued: 11-16-93

QC Matrix Spike and Duplicate Spike Results

Matrix: Water

Analyte	Sample ID	Spike Amount	Units	Recovery, %	Duplicate Recovery, %	RPD, %	Control Limits
Modified EPA 8020:							
Benzene	C3100510-16	20.0	ug/L	93.0	91.5	1.6	55 - 129
Toluene	C3100510-16	20.0	ug/L	100	96.5	3.6	72 - 149
Ethylbenzene	C3100510-16	20.0	ug/L	106	101	4.8	75 - 138
Xylene, total	C3100510-16	60.0	ug/L	103	97.0	6.0	74 - 147

Fax copy of Lab Report and COC to Chevron Contact: No

Chain-of-Custody-Recc

Chevron U.S.A. Inc.
P.O. BOX 5004
San Ramon, CA 94583
FAX (415)842-9591

Chevron Facility Number 9-8139
Facility Address 16304 Foothill, San Leandro
Consultant Project Number 1-289-04
Consultant Name SIERRA ENVIRONMENTAL SERVICES
Address PO BOX 2546, MARTINEZ, CA 94553
Project Contact (Name) RICK HILTON/ED MORALES
(Phone) 510-370-1280 (Fax Number) 510-370-7959

Chevron Contact (Name) Mr. Ken Kan
(Phone) 842-8752
Laboratory Name GTEL
Laboratory Release Number 8617900
Samples Collected by (Name) RICK HILTON
Collection Date 10/27/93
Signature [Signature]

Sample Number	Lab Sample Number	Number of Containers	Matrix S = Soil W = Water A = Air C = Charcoal	Type C = Grab C = Composite D = Discrete	Time	Sample Preservation	Iced (Yes or No)	Analyses To Be Performed							DO NOT BILL CHEVRON FOR TB-LB SAMPLES Remarks	
								BTEX + TPH GAS (8020 + 8015)	TPH Diesel (8015)	Oil and Grease (5520)	Purgeable Halocarbons (8010)	Purgeable Aromatics (8020)	Purgeable Organics (8240)	Extractable Organics (8270)		Metals Cd, Cr, Pb, Zn, Ni (ICAP or AA)
TBLB	01	3	W	G	1025	HCl	Y	X								Analyze & Show
BB	02	2	W	G	1042			X								mw3 x 29 mw2 x 29 SEDICHO8 9-8139 70230 50028 *No HCl MW-3 Due to effluence 03140508
MW-1	03				1046			X								
MW-2	04				1126			X								
MW-6	05				1207			X								
MW-7	06				1141			X								
MW-8	07				1241			X								
MW-10	08				1110			X								
MW-11	09				1224			X								
MW-9	10				1255			X								
MW-3	11				1313	None*		X								
EW-1	12				1327			X								
EW-3	13				1342			X								

Relinquished By (Signature) <u>[Signature]</u>	Organization <u>SES</u>	Date/Time <u>10/27/93</u>	Received By (Signature) <u>John Weber</u>	Organization <u>GTEL</u>	Date/Time <u>10-27-93</u>	Turn Around Time (Circle Cholon) 24 Hrs. 48 Hrs. 5 Days 10 Days As Contracted
Relinquished By (Signature) <u>John Weber</u>	Organization <u>GTEL</u>	Date/Time <u>10/27/93</u>	Received By (Signature) <u>[Signature]</u>	Organization	Date/Time	
Relinquished By (Signature)	Organization	Date/Time	Received For Laboratory By (Signature) <u>[Signature]</u>	Organization	Date/Time <u>10/27/93</u>	