



January 9, 2003

Robert Weston
Alameda County Environmental Health Services
1131 Harbor Bay Parkway, Suite 250
Alameda, CA 94502-6577

Re: Additional Excavation & Re-sampling
2515 Blanding Avenue, Alameda, CA

Dear Mr. Weston:

Please find attached the analytical results from the additional excavation work and the re-sampling following the work completed on January 3, 2003, as directed by you.

The excavation was left opened and secured by plywood covering and a security fence around the area following the work completed on November 27, 2002. As directed by you at the site, ~~additional~~ excavation work was completed to outside the boundaries of the original tank excavation. Following the over excavation work, confirmation soil and groundwater samples were collected. ~~Sample no. 8259-E~~ 6FT was collected from the east sidewall in the excavation at 6 feet below grade surface. ~~Sample no.~~ 8259-N-10FT was collected from the north end of the excavation at 10 feet below grade surface. Following the excavation activities and allowing groundwater to enter the excavation, ~~sample no. 8259-W~~ a groundwater sample was collected.

The excavation has been secured with plywood and security fence panels pending your review of the submitted analytical results. The over-excavated impacted soil is being profiled for disposal at Forward, Inc., a Class II Facility, of Manteca, California.

If you have any questions regarding the information, please contact me at your earliest convenience.

Sincerely,



Tracy Wallace
Golden Gate Tank Removal, Inc.

Enc.

255 Shiplay Street • San Francisco, Ca. 94107 • Tel.: 415/512-1555 • Fax: 415/512-0964

General Engineering Contractors License No. 616521

Jan 09 03 01:33p

P.3



North State Labs

CA ELAP# 1733

90 South Spruce Avenue, Suite V - South San Francisco, CA 94080 • (650) 266-4563 • FAX (650) 266-4560

CERTIFICATE OF ANALYSIS

Lab Number: 03-0021
 Client: Golden Gate Tank
 Project: 8259/2515 ~~BLANDING~~ ALAMEDA

Date Reported: 01/09/2003

Post-It* Fax Note	7671	Date	1-10-03	# of pages	5
To	ROBERT WESTON	From	TRACY WALLACE		
Co./Dept.	ACHS	Co.	GGTR		
Phone #	510-567-6781	Phone #	415-512-1555		
Fax #	510-337-9335	Fax #	415-512-0964		

Diesel Range Hydrocarbons by Method CATHF
 Gasoline, BTEX and MTBE by Methods SW8020F

*monitored for 2003
 at 10FT BGS*

*confirm meth w sample
 east side wall 6ft BGS*

Analyte	Method	Result	Unit	Date Sampled	Date Analyzed
Sample: 03-0021-01 Client ID:	8259-E-6FT			01/03/2003	SO
Benzene	SW8020F	ND<5	UG/KG		01/08/2003
Ethylbenzene	SW8020F	9	UG/KG		01/08/2003
Gasoline Range Organics	SW8020F	ND<500	UG/KG	PPM	01/08/2003
Methyl-tert-butyl ether	SW8020F	ND<5	UG/KG		01/08/2003
Toluene	SW8020F	19	UG/KG		01/08/2003
Xylenes	SW8020F	43	UG/KG		01/08/2003
Diesel Fuel #2	CATHF	ND<1	MG/KG	PPM	01/08/2003

Sample: 03-0021-02 Client ID:	8259-N-10FT			01/03/2003	SO
Benzene	SW8020F	ND<5	UG/KG		01/08/2003
Ethylbenzene	SW8020F	ND<5	UG/KG		01/08/2003
Gasoline Range Organics	SW8020F	ND<500	UG/KG		01/08/2003
Methyl-tert-butyl ether	SW8020F	ND<5	UG/KG		01/08/2003
Toluene	SW8020F	ND<5	UG/KG		01/08/2003
Xylenes	SW8020F	ND<10	UG/KG		01/08/2003
Diesel Fuel #2	CATHF	ND<1	MG/KG		01/08/2003

Sample: 03-0021-03 Client ID:	8259-W			01/03/2003	W
Benzene	SW8020F	ND<2.5	UG/L		01/09/2003
Ethylbenzene	SW8020F	24.5	UG/L		01/09/2003
Gasoline Range Organics	SW8020F	ND<500	UG/L		01/09/2003
Methyl-tert-butyl ether	SW8020F	ND<2.5	UG/L		01/09/2003
Diesel Fuel #2	SW8020F	ND<1	UG/L		01/09/2003

Does not match: *-diesel, **-gasoline.

GRAB GW SAMPLE



North State Labs

CA ELAP# 1753

90 South Spruce Avenue, Suite V • South San Francisco, CA 94080 • (650) 266-4563 • FAX (650) 266-4560

C E R T I F I C A T E O F A N A L Y S I S

Lab Number: 03-0021
Client: Golden Gate Tank
Project: B259/2515 BLANDING ALAMEDA

Date Reported: 01/09/2003

Diesel Range Hydrocarbons by Method CATHF
Gasoline, BTEX and MTBE by Methods SW8020F

Analyte	Method	Result	Unit	Date Sampled	Date Analyzed
Sample: 03-0021-03 Client ID: 8259-W				01/03/2003	W
Xylenes	SW8020F	74	UG/L		01/09/2003
Diesel Fuel #2	CATHF	*22.2	MG/L		01/08/2003

Does not match: *-diesel, **-gasoline.

Jan 09 03 01:34p

P.5



North State Labs

CA ELAP # 1753

90 South Spruce Avenue, Suite V • South San Francisco, CA 94080 • (650) 266-4563 • FAX (650) 266-4560

C E R T I F I C A T E O F A N A L Y S I S

Quality Control/Quality Assurance

Lab Number: 03-0021
 Client: Golden Gate Tank
 Project: 8259/2515 BLANDING ALAMEDA

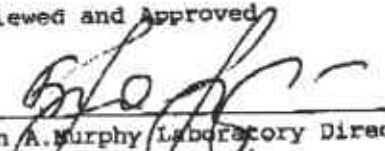
Date Reported: 01/09/2003

Diesel Range Hydrocarbons by Method CATHF
 Gasoline, BTEX and MTBE by Methods SW8020F

Analyte	Method	Reporting Limit	Unit	Blank	Avg MS/MSD Recovery	RPD
Gasoline Range	SW8020F	500	UG/KG	ND	95/94	1
Benzene	SW8020F	5	UG/KG	ND	93/93	0
Toluene	SW8020F	5	UG/KG	ND	95/95	0
Ethylbenzene	SW8020F	5	UG/KG	ND	96/95	1
Xylenes	SW8020F	10	UG/KG	ND	97/97	0
Methyl-tert-butyl	SW8020F	5	UG/KG	ND	88/91	3
Gasoline Range	SW8020F	50	UG/L	ND	95/93	2
Benzene	SW8020F	0.5	UG/L	ND	93/89	4
Toluene	SW8020F	0.5	UG/L	ND	95/91	4
Ethylbenzene	SW8020F	0.5	UG/L	ND	96/92	4
Xylenes	SW8020F	1.0	UG/L	ND	97/94	3
Methyl-tert-butyl	SW8020F	0.5	UG/L	ND	88/86	2
Diesel Fuel #2	CATFH	1	MG/KG	ND	82/80	2
Diesel Fuel #2	CATFH	0.05	MG/L	ND	94/96	2

ELAP Certificate NO:1753

Reviewed and Approved


 John A. Murphy Laboratory Director

Page 3 of 3

Jan 09 03 01:34p

P. 8

Case Narrative

North State Environmental, South San Francisco, CA

Report Date: 01/09/2003	Project: 8259/2515 BLANDING
Report Number: 03-0021	Order #: 03-0021
Two soil and one water samples were analyzed for diesel and gasoline by method 8015M, BTEX and MTBE by method 8021B. No errors occurred during analysis.	

Approved by: 

Date: 01/09/03



North State Labs

90 South Spruce Avenue, Suite W, South San Francisco, CA 94080
Phone: (650) 266-4563 Fax: (650) 266-4580

02-0021

Chain of Custody / Request for Analysis
Lab Job No.: _____ Page 1 of 1

Client: GGTR	Report to: SALVADOR	Phone: 415 512 1555	Turnaround Time
	Billing to: GGTR	Fax: 415 512 0964	
Mailing Address: 255 SHIPLEY ST SF CA 94107		email: DATA@GGTR.com	
PO# 8259		Sampler: Tim Hatten	

Project / Site Address / Global ID: 8059 / 2515 BLANDING (BLANMEDA)					Analysis Requested				EDF <input type="checkbox"/>	Field Point ID
Sample ID	Sample Type	Container No./Type	Pres.	Sampling Date/Time	TPH-D	TPH-G	BTEX/MTBE	8020		
8259-E-6FT	SOIL	1 BRASS		1/3/03 10:20	X	X	X	X		
8259-N-10FT	SOIL	1 BRASS		1/3/03	X	X	X	X		
8259-W	WATER	1 QT 2 TUBS		1/3/03	X	X	X	X		

Relinquished by: Tim Hatten	Date: 1/8/03 Time: 9⁴⁵	Received by:	Lab Comments/ Hazards
Relinquished by:	Date: _____ Time: _____	Received by:	
Relinquished by:	Date: _____ Time: _____	Received by:	

1/21/15/2002 22:59 4155120964
 Jan 09 09 01:33p
 GOLDEN GATE TANK REM
 PAGE 05
 P.2