

2101 Webster Street
12th Floor
Oakland, CA 94612
(510) 663-4100 • FAX (510) 663-4141



November 19, 2002
Project 8367.001

Mr. Dan Carroll
Pulte Home Corporation
7031 Koll Center Parkway
Pleasanton, California 94566

Subject: Environmental Site Assessment
1249 67th Street – Fabco Automotive Corporation
Emeryville, California

Dear Mr. Carroll:

Enclosed is the Environmental Site Assessment for the 1249 67th Street property in Emeryville, California.

We appreciate the opportunity to continue providing you with our environmental consulting services. Please call either of the undersigned if you have questions or require additional information regarding this report.

Sincerely yours,
GEOMATRIX CONSULTANTS, INC.

Robert Cheung

Robert Cheung
Senior Toxicologist

RC/EKW/pp
I:\Project8000s\8367.001\ESA Ltr.doc

Enclosure

Elizabeth K. Wells, P.E. for.

Elizabeth K. Wells, P.E.
Senior Engineer



Environmental Site Assessment

1249 67th Street
Emeryville, California

Prepared for:

Pulte Home Corporation
7031 Knoll Center Parkway, Suite 150
Pleasanton, CA 94566

Prepared by:

Geomatrix Consultants, Inc.
2101 Webster Street, 12th Floor
Oakland, California 94612

November 2002

Project No. 8367.001

Geomatrix Consultants

TABLE OF CONTENTS

	Page
1.0 INTRODUCTION	1
2.0 SITE SETTING AND DESCRIPTION	2
2.1 PHYSICAL SETTING.....	2
3.0 SITE HISTORY	2
3.1 AERIAL PHOTOGRAPHS.....	3
3.2 SANBORN FIRE INSURANCE MAPS	4
4.0 SITE RECONNAISSANCE	5
4.1 OBSERVATIONS AND CONDITIONS ADJACENT TO THE SITE	8
5.0 REVIEW OF AGENCY FILES	8
5.1 SEARCH RESULTS	9
6.0 AREAS OF POTENTIAL ENVIRONMENTAL CONCERN	13
7.0 LIMITATIONS	14

TABLES

Table 1 Aerial Photograph Review Summary

FIGURES

Figure 1 Site Location Map
Figure 2 Site Layout

APPENDIXES

Appendix A EDR Report and Sanborn Map Report
Appendix B Pulte Home Corporation Environmental Checklist

ENVIRONMENTAL SITE ASSESSMENT

1249 67th Street
Emeryville, California

1.0 INTRODUCTION

This report presents the results of a Phase I environmental site assessment (ESA) for the property located at 1249 67th Street in Emeryville, California (the site; Figure 1). Geomatrix Consultants, Inc. (Geomatrix), performed the ESA on behalf of Pulte Home Corporation (Pulte) in accordance with our August 1, 2002 Scope of Services.

The objectives of the ESA were to: 1) evaluate whether past on-site and off-site activities may have affected soil and groundwater quality beneath the site; 2) evaluate whether current on-site activities may affect soil and groundwater quality at the site; and 3) assist Pulte in assessing whether a Phase II program consisting of soil and/or groundwater sampling and chemical analysis is necessary to further evaluate site conditions.

To accomplish these objectives, the ESA was performed in accordance with guidelines for ESAs set forth in American Society for Testing and Materials (ASTM) E 1527-00 entitled *Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process* (ASTM guideline). This preliminary assessment did not include a property title search or identification of all previous tenants; collection and chemical analysis of samples of soil, groundwater, or on-site materials; an evaluation of the presence of asbestos, lead-based paint, or radon; or an evaluation of seismic characteristics. The major components of the ESA were:

- Review of available selected historical aerial photographs;
- Site reconnaissance to observe and document general conditions and activities at the site;
- Interview available personnel familiar with site operations to obtain information regarding current and historical site activities;
- Drive-by “windshield” survey of adjacent properties;
- Review of information that is publicly maintained and available regarding documented on-site and off-site chemical releases that may affect soil or groundwater conditions at the site; and
- Preparation of a report documenting the methods and results of the above services.

2.0 SITE SETTING AND DESCRIPTION

The site is approximately 3 acres and is located in a mixed light industrial, commercial, and residential area in the City of Emeryville, Alameda County, California. The property is bounded by San Pablo Avenue to the east, 66th Street to the south, the Union Pacific (formerly Southern Pacific) railroad tracks and Hollis Street to the west, and 67th Street to the north (Figure 1). Adjacent businesses include the Milan Salami Company and A.A Johnson & Son Construction Company to the east, Meyer's Drum to the south, the George Martin Company to the west, and the University of California Campus Supply storage warehouse to the north. The property is comprised of three single-story buildings totaling approximately 65,000 square feet. The buildings are constructed out of brick, concrete, and corrugated metal and are occupied by the Fabco Automotive Corporation (Fabco).

2.1 PHYSICAL SETTING

The subject property is located one quarter (1/4) mile east of the San Francisco Bay on a western sloping alluvial plain. Soil in the vicinity of the property typically consists of silty clay, Bay Mud and alluvial fan deposits derived from the Bay and erosion of the nearby foothills. The underlying soil consists of lenses of clayey gravel, sandy silty clay and sand-silt-clay mixtures.

The site is located approximately 15 feet above mean sea level. Regional topography slopes gently to the west towards San Francisco Bay. Based on information collected from adjacent properties, depth to groundwater is approximately 8 to 10 feet below ground surface (bgs) and flows to the west.

3.0 SITE HISTORY

As part of this ESA, the following sources of information were used to compile historical information about the site:

- Aerial photographs: 1930, 1949, 1953, 1957, 1959, 1969, 1971, 1975, 1979, 1983, 1988, 1992, 1996, and 1999; and
- Sanborn Fire Insurance (Sanborn) maps – 1911, 1950, 1952, 1967, and 1980.

The objective of reviewing historical information is to develop a history of the previous uses of the property and surrounding area to help identify the likelihood of past uses that may lead to

recognized environmental conditions in connection with the property. A summary of historical information pertaining to the site from the information sources listed above is presented herein.

3.1 AERIAL PHOTOGRAPHS

Geomatrix reviewed historical aerial photographs of the site and vicinity at Pacific Aerial Surveys in Oakland, California. Photographs from the years listed above were reviewed. The approximate scale of the photographs ranged between 1" = 600' to 1" = 1,000'. A general summary is presented below. A detailed description of the observations from the aerial photo review is presented in Table 1.

In the 1930 aerial photograph, the site is unpaved and partially vegetated with one building on the western end and three buildings on the northeast edge of the site. The surrounding area is undeveloped to the north, south, and immediately west of the railroad tracks bounding the site. Houses are present to the east bordering 67th and 66th Streets.

In the 1949 photograph, additions have been added to the western building. The middle of the site is used for parking and storage; rectangular containers are now present in this area. Aboveground storage tanks (ASTs) are present to the west of the site, across the railroad tracks, and the surrounding area (previously undeveloped) is now commercial/ industrial. Between 1953 and 1969 there are no significant changes to the site except for an enlargement of the parking area and storage area in the middle of the site. In the 1953 photograph, both 66th Street and 67th Street have been paved. In the 1957 photograph, a circular structure, possibly an AST or transformer, is present and surrounded on four corners by bushes or trees. Ground discoloration and circular tire tracks surround this structure in the 1959 photograph.

In the 1971 photograph, the parking area has been paved. The 1975 photograph shows a white concrete area (possibly a loading dock) east of the western building, but west of the parking/storage area. In the 1979 photograph, the parking area and storage area are more clearly differentiated with a section of the white concrete extending east between the two. In the south storage area, two long white rectangular structures (possibly trailers) are present in both the 1983 and 1988 photographs. The parking area has been re-paved with asphalt, based on a darker color (pavement) than previous photographs. The long structures are no longer present in the 1988 photograph. The storage area on the south part of the site has been paved in the 1992 photograph. In the 1999 photograph, the ASTs to the west of the railroad tracks have been removed; only what appear to be concrete pads remain.

In summary, the site historically was used for light industrial purposes, with much of the development (structures) completed by 1949. It appears that site paving occurred in stages (asphalt or concrete) between 1971 and 1992. Some evidence of ASTs or other container storage and possible staining/discoloration of the surface area surrounding these structures were observed in the aerial photographs. Adjacent properties have historically been developed for commercial and light industrial use.

3.2 SANBORN FIRE INSURANCE MAPS

Geomatrix retained EDR to identify and supply Sanborn Maps for the site. Sanborn maps were developed in the late 1800s and early 1900s for use as an assessment tool for fire insurance rates in urbanized areas. Sanborn maps listed above were provided and reviewed for this report. Copies of these maps are presented in Appendix A. A summary of the information observed from these maps is presented below.

On the 1911 Sanborn map, no distinguishing features or structures are depicted at the site. In addition, no distinguishing features or structures are depicted on adjacent properties north, east, and south of the site. A north-south boundary line between the Cities of Emeryville and Oakland crosses the eastern portion of the site boundary.

On the 1950 Sanborn map, the facility is present. Offices, a machine shop, warehouse, paint booth, and auto chassis department are depicted. At the southeast corner of the site, a centrifugal pump and what appears to be a description for a 5,000-gallon concrete sump are present. The immediate surrounding areas are primarily industrial. A planing mill, a lumber shed, and the Merchant Circulating Machine Company Plant are located to the north/northeast across 67th Street. A truck and auto body shop are present to the east at 1165 67th Street, the Meyers Barrel Company is located to the southeast, and the Oliver Tire and Rubber Company is located to the south across 66th Street. The railroad tracks and a two-story warehouse border the site's western perimeter.

On the 1952 Sanborn map, no significant changes to the site or the surrounding areas are observed.

On the 1967 Sanborn map, the site appears to be unchanged. A loading dock is present directly north of the site across 67th Street. The property to the northeast is depicted as the Smith Corona Merchant Corporation Data Processing, East Bay Mills Center, Division of Peralta College. A glass blowing and machine shop, storage areas for oxygen and hydrogen gas cylin-

ders, and a storage area for drayage are present east of the site. A gas and oil station is present to the east at the southwest corner of 67th Street and San Pablo Avenue. Properties to the south and east remain relatively unchanged.

On the 1980 Sanborn map, a note describes the map as "identical" to the 1952 Sanborn map. A review of the 1980 map confirms that the site and surrounding areas are the same as the 1952 map.

4.0 SITE RECONNAISSANCE

On October 2, 2002, Geomatrix representatives visited the site. The reconnaissance included observing general conditions of the site with respect to possible environmental concerns; interviewing available on-site personnel regarding activities and material storage at the site; and a drive by windshield survey of adjacent properties. Pulte's Environmental Checklist (Appendix B) and a Geomatrix Environmental Checklist were used as guides during the reconnaissance.

Geomatrix conducted the site reconnaissance with Mr. Jeff Matthews, Plant Superintendent of Fabco. Mr. Matthews, a Fabco employee for approximately four years, provided information about historical and current site operations including Fabco's protocols for hazardous waste storage and elimination.

The property consists of three buildings (Figure 2). The main building, located along the western edge of the property, is divided into areas for manufacturing, storage, and administrative offices. The second building, located to the east, is used as a portable office. The third building is located on the eastern portion of the property and is used as a warehouse and administrative offices. The central portion of the site is paved for parking.

According to Mr. Matthews, Fabco is a privately-held company owned by Transportation Technologies Inc. Fabco has designed and manufactured automotive components on site since its inception in 1918. Fabco's product lines include mufflers, front ends, drive axles, and transfer cases for most major heavy-truck manufacturers. The manufacturing process includes machining, welding, and assembly in the main building where synthetic oils, compressed gases, and waterborne paints are currently used on site.

The following observations were compiled from the site reconnaissance and information derived from conversations between representatives of Geomatrix and Fabco.

Manufacturing Area

The manufacturing area is located in the main building. During the site reconnaissance, various metal machines were observed. Most machines observed were used to cut, file, and drill into metal products. A welding practice takes place within the manufacturing area but was segregated from other machines and could not be observed from the manufacturing walkway because it was surrounded by dividers. Oil staining was observed near an interior floor drain on the concrete floor of the manufacturing area, there was also a slight industrial oil odor throughout the manufacturing area during the site walk.

Synthetic Oil Mixing Station

During Fabco's manufacturing processes, a metal working fluid is used to cool industrial machinery. The metal working fluid is created by pumping synthetic oil through a hose from individual 55-gallon steel drums and diluting it with water (90% water, 10% oil). The metal working fluid is blended in a mixing station located in the southwest corner of the manufacturing facility. It is used throughout the manufacturing area and is stored in 55-gallon steel drums located in the engineering test area, machine practice area, hazardous waste storage area, and the mixing station. Approximately twelve 55-gallon drums of oil waste and two 55-gallon drums of virgin synthetic oil were stored on site at the time of the site reconnaissance. Storage drums containing metal working fluid were located on plastic secondary containment platforms and were observed to be in good condition. Used rags that were soiled with metal working fluid were stored in 55-gallon steel drums and treated as hazardous waste.

Waste Drying area

The waste drying bay area is located in a truck-docking bay at the southwest corner of the manufacturing area adjacent to the synthetic oil mixing station. During the manufacturing process metal waste shavings are produced. Waste shavings, which have been in contact with metal working fluid, are transferred to the waste drying area where they drip dry into a large metal containment tray. The metal working fluid is periodically collected and transported into 55-gallon steel drums as hazardous waste. Standing pools of metal working fluid were observed outside the metal containment tray in the concrete docking bay.

Paint Spray Booth

A paint spray booth is located on the south end of the manufacturing facility. This area is separated from the manufacturing area and is used to paint finished products. According to Mr. Matthews, waterborne paints have been the only types of paints used at the facility since he

has been an employee. Fabco maintains an air permit with the Bay Area Air Quality Management District for the painting operations.

Hazardous Materials Storage Area

The hazardous materials storage area is located on the eastern portion of the main manufacturing building in a large shed. At the time of the site visit, numerous 55-gallon steel drums were in the shed. According to Mr. Matthews, these drums contained both raw materials and waste. All drums had secondary containment consisting of plastic platforms. Metal shavings, compressed welding gasses, and old paint products were stored in this area. According to Mr. Matthews, Asbury Environmental collects and disposes Fabco's hazardous waste approximately every 60 to 90 days. Small volumes of herbicides and janitorial cleaning supplies were also present in this storage area. According to Mr. Matthews, Fabco contracts out their landscaping but their janitor utilizes herbicides to remove weeds from the parking area.

Other

The easternmost building is a large warehouse and office area that contains finished products ready for shipment. The building adjacent to the primary offices and manufacturing area are portable structures that are subdivided into offices. No machine operations, industrial processes, waste, or machine working fluids were observed in these buildings.

The remainder of the site consists of a paved parking area which was observed to be in good condition with minimal cracking and no observed staining. An above ground storage tank containing 250 gallons of propane is located in the center portion of the parking area. Also, an electrical transformer, maintained by Pacific Gas & Electric, is located on the southern portion of the parking area, adjacent to the primary manufacturing building. The transformer was not labeled as to whether polychlorinated biphenyl (PCB) is present. However, no visual evidence of spills or leaks of dielectric fluid was observed.

During the site reconnaissance, one future boring location was marked in the northeastern portion of the parking area. Mr. Matthews indicated that a geotechnical drilling contractor would be on-site the following week. No monitoring wells and no evidence of existing USTs (fill and/or vent pipes) were observed.

Based on the site reconnaissance, areas of staining near an interior floor drain in the manufacturing area and the waste drying area in the loading dock have been identified as areas of

potential environmental concern. In addition, the facility maintains a paint booth; solvent-based paints may have been historically used as part of the manufacturing operations.

4.1 OBSERVATIONS AND CONDITIONS ADJACENT TO THE SITE

Geomatrix conducted a drive-by "windshield" survey of the properties surrounding the site. At 6549 San Pablo Avenue (66th Street and San Pablo), formerly Myers Drum Co., located approximately 150 feet southeast of the site, there was a large trench (approximately 25 feet deep, 30 feet wide and 50–60 feet long) and soil stockpiles. The property was observed to be a large excavation project with an environmental consultant on-site (TRC Environmental). A vacant lot, that may be part of Myers Drum Co. is located to the south. Multi-family residential units are located to the southwest. A building occupied by the George Martin Company is located to the west across the railroad tracks. The University of California storage warehouse is located the north. The Milan Salami Company and A.A. Johnson and Son Construction Company is located to the east northeast.

5.0 REVIEW OF AGENCY FILES

Geomatrix retained EDR to search applicable regulatory databases to identify nearby properties with documented environmental releases and/or those that use, store, or dispose of regulated chemicals. The radii of the database search corresponded to the recommended radii in the ASTM guidelines. A list of the regulatory databases searched is included in the EDR report, dated August 21, 2002, which is provided in Appendix A. The environmental databases that may indicate a spill or release are:

- CERCLIS – the Comprehensive Environmental Response, Compensation, and Liability Information System, which contains data on potential or confirmed hazardous sites that have been reported to the U.S. Environmental Protection Agency (U.S EPA) by the state;
- CORRACTS – contains a list of sites subject to corrective action under the Resource Conservation and Recovery Act (RCRA);
- Cal Sites – contains known and potential hazardous substance sites listed by the State of California Department of Toxic Substances Control (DTSC);
- AWP – California Department of Toxic Substances Control (DTSC) Annual Workplan, formerly known as the Bond Expenditure Plan (BEP), identifies known hazardous substance sites targeted for cleanup.

- CHMIRS – the California Hazardous Material Incident Report System, which contains information on reported hazardous materials incidents;
- Cortese – identifies public drinking water wells with detectable concentrations of constituents, hazardous substances sites selected for remedial action, and other release sites;
- LUST – contains leaking underground storage tank (UST) sites; and
- SLIC – contains spill, leaks, and industrial cleanup sites from the California Regional Water Quality Control Board, San Francisco Bay (RWQCB).

5.1 SEARCH RESULTS

Based on this list of key environmental databases, Geomatrix reviewed the EDR report to identify cases that may affect soil and groundwater underlying the site. The information provided in the EDR report is limited to what has been reported or registered in each database. According to the EDR report, the site is listed in several of these databases. In addition, 19 facilities, which are in a presumed up- or crossgradient direction, are located within $\frac{1}{4}$ mile of the site. Of these, seven were listed as “closed” or not requiring further action by the regulating agency (Appendix A). The following is a summary of the subject site and the remaining adjacent sites that are located in a presumed up- or crossgradient direction. A map depicting the locations of these sites with respect to the subject site is presented in the EDR report in Appendix A.

- *Fabco Automotive Division. 1249 67th Street,* is listed in the Cortese, HAZNET, UST, and historical UST databases. According to the EDR report, the facility maintained one 1,000-gallon unleaded fuel UST installed in 1974 and one UST for waste oil. The size and installation date of the waste oil UST were not reported, nor was there information regarding decommissioning of the USTs. Records from the EDR report also indicate that approximately 1.7 tons of “asbestos-containing waste” was disposed at a landfill. No violations were found with respect to waste disposal. No additional information was provided in the EDR report.
- *Myers Drum Co. (Oakland – Tighthead), 6549 San Pablo Avenue, Map ID T78,* is listed in the CERCLIS-NFRAP, RCRIS-LQG, AWP, Cal-Sites, Cortese, LUST, UST, SLIC, CA FID, and historical UST databases. This facility is located approximately 1/8 mile to the southeast. According to the EDR records, the facility was used as a drum reconditioning plant and maintained several USTs ranging from 1,000 to 40,000-gallons for the storage of fuel and waste. The tanks were installed between 1942 and 1977.
- *St. Francis Pie Shop, 1125 67th Street, Map ID G33,* is listed in the UST database and is located 1/8 mile to the northeast. No information regarding the UST(s) was provided in the EDR report.

- *Copper and Brass Sales, Inc., 1295 67th Street, Map ID C12*, is listed in the LUST and UST databases and is located 1/8 mile to the southwest. Records from the EDR report indicate that the facility maintained one 2,000-gallon diesel UST installed in 1974. No additional information regarding the UST was provided in the EDR report.
- *Geo M Martin Company (Granco Pump/Div Challenge Manufacturer), 1308 67th Street, Map ID C21*, is listed in the HAZNET, Cortese, LUST, and historical UST databases and is located 1/8 mile to the southwest. Records from the EDR report indicate that the facility maintained two USTs for "waste." A diesel release was reported in November 1996 and a preliminary assessment was undertaken.
- *Weatherford BMW, 735 Ashby Avenue, Map ID M51*, is listed in the HAZNET, RCRIS-SQG, LUST and Cortese databases and is located ¼ mile to the north. Records from the EDR report indicate that a leak was reported in July 1993 and only soil was considered affected. A Pollution Assessment Report was completed; no dates or follow up information was reported.
- *Known, 6400 San Pablo Avenue, Map ID 79*, is listed in the Cortese database and is located ¼ mile to the southeast. No information was provided in the EDR report.
- *Union Oil of California (Tosco, Super-7, 7-Eleven), 901 Ashby Avenue, Map ID AC112* is listed in the HAZNET, LUST, Cortese, SLIC databases and is located ¼ mile to the northeast. Records from the EDR report indicate that four 12,000-gallon USTs installed in 1983 were located on the property. Groundwater is reportedly affected, free product is present on the water table, methyl-tert-butyl-ether is present in groundwater, and remedial cleanup is in progress.
- *Asphalt Products Oil Corporation, 1001 Ashby Avenue, Map ID U84*, is listed in the SLIC and Cortese databases and is located ¼ mile to the northeast. Records from the EDR report indicate diesel releases in March 1990 and April 1995; soil and groundwater were reportedly affected. Post remedial action monitoring was implemented and the facility received closure for one of the USTs in December 2001.
- *John Nady, 1137-1167 65th Street, Map ID N58*, is listed in the HAZNET, RCRIS-SQG, FINDS, and LUST databases, and is located ¼ mile to the southeast. No violations were reported regarding waste disposal. No additional information regarding the LUST was provided in the EDR report. *Standard USTs*
- *AA Johnson and Son, 1164 66th Street, Map ID E16*, is listed in the LUST and the CHMIRS databases and is located directly southeast of the subject site. Records from the EDR report indicate that approximately 40-gallons of diesel fuel was released to the ground in June 1991. A release of gasoline from a LUST was reported in September 1991. A preliminary site assessment was undertaken; no additional information regarding the UST was provided in the EDR report.
- *Calag Products, 1275 66th Street, Map ID D24*, is listed in the historical UST database and is located 1/8 mile to the southwest. Records from the EDR report indicate

the facility maintained two 2,000-gallon USTs for unleaded fuel and one 10,000-gallon UST for diesel.

- *Not Reported, 6623 San Pablo Avenue, Map ID O53*, is listed in the LUST database and is located $\frac{1}{4}$ mile to the east. No additional information regarding the LUST was provided from the EDR report.

Geomatrix requested permission to review agency files for the sites listed above, including the subject site, to obtain available information regarding documented on-site and off-site features that may affect soil and/or groundwater conditions at the site. The Alameda County Department of Environmental Health (ACDEH), the RWQCB, the DTSC, and the Emeryville Fire Department were contacted regarding available information. Although the Myers Drum property is under the oversight of the DTSC, no DTSC files were available at the time of this report. In addition, Mr. Mike Roberts of the Emeryville Fire Department could not find information pertaining to inspections or environmental incidents at the subject site. Regulatory agency files were available for the subject site and eight of the facilities. Information relating to each specific property is summarized below.

- *Fabco Automotive Division, 1249 67th Street*. Files pertaining to the subject site were available from the ACDEH. Records reviewed indicate that the facility maintained storage bins for scrap metal. In 1988, the bins leaked small amounts of cutting oils onto the underlying asphalt in the parking lot of the property. Subsequently, the IT Corporation (IT) removed approximately 4-6 inches of sludge from the surface of the asphalt, 2-3 inches of deteriorated asphalt, and 3-4 inches of base rock underlying the asphalt and transported and disposed the material at the PWI disposal facility in Buttonwillow, California. Following removal, three soil composites were collected and analyzed for oil and grease using U.S. EPA Method 3550. With the exception of one composite, the concentrations of oil and grease were less than 1,000 parts per million (ppm). IT collected two additional discrete soil samples to composite; analytical results from resampling showed that the concentration of oil and grease was below the 1,000 ppm. IT indicated in their report that during excavation, an array of debris (wood chunks, concrete, red brick, and roofing shingles) was present below the base rock and suggested that these materials may have contributed to the high levels of oil and grease in one of the composite soil sample. The ACDEH, Hazardous Materials Division gave clearance to backfill and resurface the excavation following receipt of the analytical results in November 1988. Additional records reviewed indicated that one 4,000-gallon cutting oil UST and one 1,000-gallon gasoline UST were removed from the property in March 1988. No additional information regarding tank location or closure was available from ACDEH.
- *Copper & Brass Sales, 1295 67th Street*. One 2,000-gallon UST was removed in 1992 and *Preliminary Site Assessment* report was submitted to ACDEH on August

30, 1993. In September 1994, 90 cubic yards of soil were removed. The facility, which is located 1/8 mile southwest of the subject site, received no further action (NFA) from the ACDEH on October 16, 1994. Based on the closed regulatory status of this facility, it is unlikely that this site could impact environmental conditions at the subject site.

- *Geo M. Martin Co., 1308 67th Street.* One 700-gallon diesel UST was removed on September 20, 1996 and a *Report of Soil and Groundwater Assessment* was prepared on February 6, 1997. The ACDEH provided a Fuel Leak Site Case Closure Letter on December 31, 1997. Based on the closed regulatory status of this facility, it is unlikely that this site could impact environmental conditions at the subject site
- *Unocal, 901 Ashby Avenue.* Four 12,000-gallon fuel USTs were installed in 1983; the tanks were replaced and upgraded in November of 1998. This facility is located approximately ¼ mile northeast of the site. Based on the distance of this property to the subject site, it is unlikely that this site could impact environmental conditions at the subject site.
- *Asphalt Products Oil Corp., 1001 Ashby Avenue.* No technical reports regarding USTs were available in the RWQCB file. The RWQCB requested a tank closure report, among others, to be submitted in a letter dated April 10, 1995, but only a scaled drawing of indoor processing sumps was included in the file. This facility is located to ¼ mile to the northeast. Based on the distance of this property to the subject site, it is unlikely that this site could impact environmental conditions at the subject site.
- *Nady Systems, 1137-1167 65th Street.* A UST removal report was prepared on May 17, 2002. Four exterior USTs associated with previous dry cleaning operations were removed from the property in February 2002. One interior UST also was removed and another was left in place with cement slurry; both USTs were associated with the former dry cleaning operations. In 1998 a 750-gallon heating oil tank and 18 cubic yards of soil were removed. A soil and groundwater investigation workplan was submitted on July 12, 2002 in which soil and groundwater samples from nine borings are proposed. This property is located ¼ mile to the southeast. Based on the location of this property, it is unlikely that this site could impact environmental conditions at the subject site.
- *AA Johnson and Son, 1164 66th Street.* One 1,000-gallon and one 8,000-gallon gasoline USTs were removed from the property in September 1991. The size of the excavations was expanded based on sample results from the sides of the excavation. Approximately 100 cubic yards of soil was excavated, stockpiled on site, transported, and disposed at Redwood Landfill. No records of closure from the regulatory agency were on file. No additional information was available from the records review. This property is located to the southeast and is adjacent to the subject site. Due to the proximity of this property, the possible presence of chemicals in groundwater underling this property may pose an environmental risk to the subject site.

- *Not Reported, 6623 San Pablo Avenue.* Records reviewed at ACDEH indicate that this property was used as a fuel service station between 1962 and 1978. At least five groundwater monitoring wells are located on the property. Groundwater levels measured from these wells suggest that the gradient is to the southeast. Benzene has been detected in one groundwater monitoring well at concentrations ranging from 3.9 to 6.7 ppm. A passive gore sorber soil gas investigation was conducted in September 2001. ACDEH requested additional characterization to define the up-gradient extent of the groundwater impacts. This property is located $\frac{1}{4}$ mile to the east at the intersection of 67th and San Pablo Avenue. Due to the proximity of this property to the subject site, the possible presence of chemicals in groundwater underlying this property may pose an environmental risk to the subject site.

6.0 AREAS OF POTENTIAL ENVIRONMENTAL CONCERN

Based on the data reviewed during this ESA, several Recognized Environmental Conditions (RECs) were identified in association with the site, as defined in ASTM E 1527-00. RECs include the potential for release of chemicals in the areas where they are used or stored and the potential for undetected past releases of chemicals from historical operations. Areas or structures where RECs (potential, known, or historical) were identified during the ESA include:

- Since 1918, the property has been used by Fabco to develop and manufacture components for heavy-duty commercial trucks and vehicles. Evidence of storage in unpaved areas and staining/discoloration near possible tank structures were observed visible in historical aerial photographs. Historical practices may have contributed to the presence of chemicals in the subsurface;
- Based on a review of historical Sanborn maps, the possible presence of a concrete sump may be a potential environmental concern;
- Releases of cutting oils from storage bins of scrap metal have occurred on the property and affected soil was removed in 1988. Releases could have occurred in other areas of the subject site, particularly in unpaved areas. In addition, the presence of wood chunks, concrete, bricks, and roofing shingles in the subsurface during soil removal in 1988 are indicative of anthropogenic fill;
- Records reviewed indicate that one 4,000-gallon cutting oil UST and one 1,000-gallon gasoline UST were removed from the property. The locations of these former tanks and regulatory closure documents were not available at the local county offices. The potential presence of residual chemicals from these tanks is a potential environmental concern;
- Based on the site reconnaissance, areas of staining near an interior floor drain in the manufacturing area and the waste drying area in the loading dock have been identified as areas of potential environmental concern. The presence of interior drains

and associated piping in manufacturing areas represents a potential environmental concern. Subsurface conditions may be affected in the waste drying docking bay;

- The facility maintains a paint booth; solvent-based paints and/or cleaners may have been historically used as part of the manufacturing operations; and
- Regulatory agency file reviews indicated the presence of several adjacent properties, which are either upgradient or in the immediate proximity of the site, may affect environmental conditions at the site. The primary concern is that affected ground-water from these properties could migrate and affect soil and groundwater beneath the site.

7.0 LIMITATIONS

Within the limitations of the agreed-upon scope of work, this assessment has been undertaken and performed in a professional manner in accordance with generally accepted practices, using the degree of skill and care ordinarily exercised by environmental consultants under similar circumstances. Due to physical limitations inherent to this or any environmental assessment, Geomatrix expressly does not warrant that the site is free of pollutants or that all pollutants have been identified. No other warranties, express or implied, are made.

In preparing this report, Geomatrix has relied upon certain information and representations provided by government and site employees, documents provided by the site owner and/or operator, and upon government data base searches provided by others. Except as discussed, Geomatrix did not attempt to independently verify the accuracy or completeness of that information, but Geomatrix did not detect any inconsistency or omission of a nature that might call into question the validity of any of the information. To the extent that the conclusions in this report are based in whole or in part on such information, those conclusions are contingent on its accuracy and validity. Geomatrix assumes no responsibility for any consequence arising from any information or condition that was concealed, withheld, misrepresented, or otherwise not fully disclosed or available to Geomatrix.

This report has been prepared for the express use of Pulte. No other person or organization is entitled to rely upon any part of this report without the prior written consent of Geomatrix. Pulte may release all or part(s) of this report to third parties; however, such third party in using this report agrees that it shall have no legal recourse against Geomatrix or its parent or subsidiaries, and shall indemnify and defend Geomatrix or its parent or subsidiaries from and against all claims arising out of or in conjunction with such use or reliance.

TABLE 1
AERIAL PHOTOGRAPH REVIEW SUMMARY
1249 67th Street
Emeryville, California

Aerial Photograph Date	Scale	1249 67 th Street	Surrounding Area
1930	1"=790'	Unpaved, partially vegetated. Four (4) buildings, one of which is immediately east of railroad tracks with dirt driveway between 67 th and 66 th Streets.	Vacant to north and south. Houses to east on 67 th and 66 th . Vacant/vegetated west of railroad tracks. Industrial/commercial further west.
9/16/49	1"=600'	Additions to original building east of railroad tracks; unpaved parking, cars and trucks on site, rectangular bins/containers on site.	67 th Street being paved, commercial/industrial to north and west; mixed commercial/industrial and residential (houses remain on 67 th & 66 th Streets) to east; ASTs to west of railroad tracks, material storage to south and northwest.
8/14/53	1"=833'	No changes to structures; site parking and storage more clearly defined.	No significant changes; 67 th and 66 th Streets paved.
5/3/57	1"=1000'	No changes to structures; aboveground storage tank (AST) or transformer visible and surrounded by trees or bushes in the middle of the site	No significant changes.
7/7/59	1"=800'	No changes to structures; on-site discoloration, circular tire tracks. AST feature remains.	Paved parking lot to northwest (previously material storage) and a larger building has been constructed to north.
5/2/69	1"=1000'	No changes to structures; on-site parking area enlarged.	No significant changes.
5/19/71	1"=1000'	No changes to structures; on-site parking paved and more extensive (trucks parked in south area where previously storage).	No significant changes.
5/19/75	1"=1000'	White concrete/paved area east of main building, north area remains parking, south area may be unpaved storage again.	No significant changes.
9/14/79	1"=1000'	Trailers on south storage area, north/south parking and storage better defined and separated.	No significant changes, except area to northwest storage/railyard rather than parking.
6/21/83	1"=1000'	On-site parking re-paved (darker pavement)	No significant changes.

TABLE 1
AERIAL PHOTOGRAPH REVIEW SUMMARY
1249 67th Street
Emeryville, California

Aerial Photograph Date	Scale	1249 67th Street	Surrounding Area
3/30/88	1"=1000'	No significant changes; white trailer/storage no longer south of paved parking lot.	No significant changes.
4/8/92	1"=1000'	No changes to structures; south storage area paved.	Paved parking again, NW of site. South of site now cleared out.
8/16/96	1"=1000'	No significant changes.	No significant changes.
12/15/99	1"=1000'	No significant change.	ASTs to west have been removed.

¹Aerial photographs reviewed by Geomatrix Consultants, Inc., at Pacific Aerial Surveys in Oakland, California.



Base map from the U.S. Geological Survey, Oakland West Quadrangle, 7.5 minute series (topographic), 1959 (photo revised 1980).


0 2000 Feet



SITE LOCATION MAP
Fabco Automotive Corporation
1249 67th Street
Emeryville, California

Project No.
8367.001

**Figure
1**

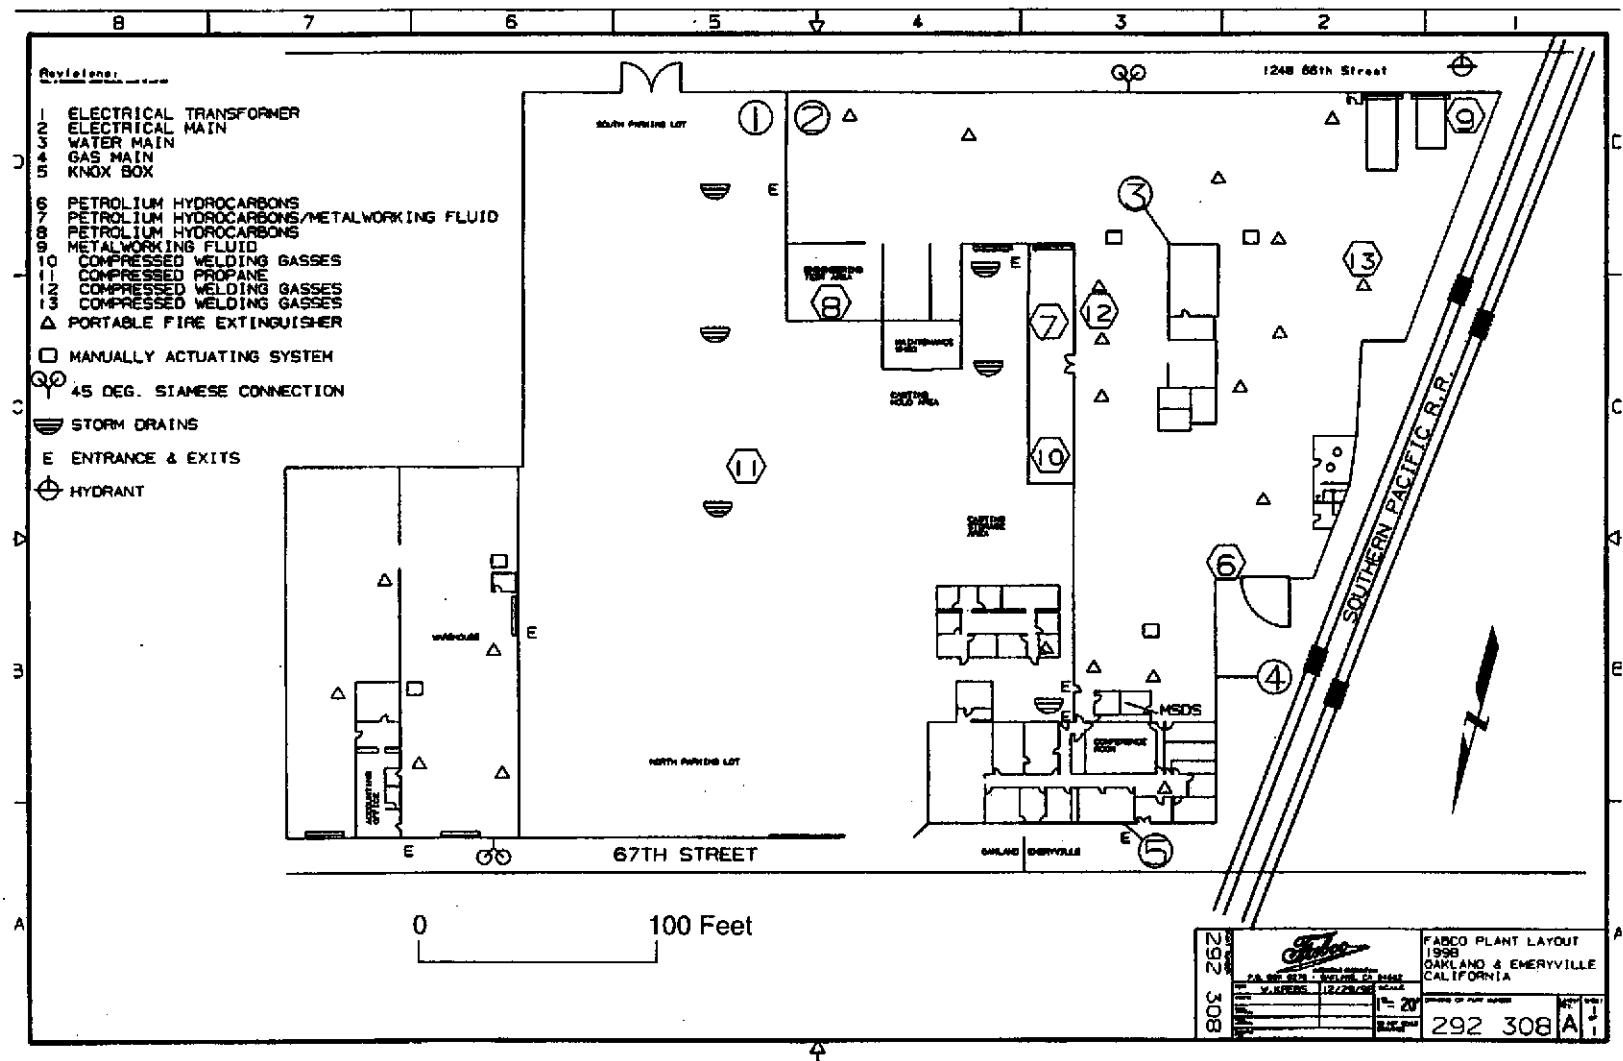

SITE LAYOUT
Fabco Automotive Corporation
1249 67th Street
Emeryville, California

Project No.
8367.001
Figure
2



Appendix A

EDR Report and Sanborn Map Report

The EDR Radius Map™ Report

1249 67th Street
1249 67th Street
Emeryville, CA 94608

Inquiry Number: 834561.1s

August 21, 2002



The Source For Environmental Risk Management Data

3530 Post Road
Southport, Connecticut 06890

Nationwide Customer Service

Telephone: 1-800-352-0050
Fax: 1-800-231-6802
Internet: www.edrnet.com

TABLE OF CONTENTS

SECTION	PAGE
Executive Summary.....	ES1
Overview Map.....	2
Detail Map.....	3
Map Findings Summary.....	4
Map Findings.....	5
Orphan Summary.....	277
EPA Waste Codes.....	EPA-1
Government Records Searched/Data Currency Tracking.....	GR-1

GEOCHECK ADDENDUM

GeoCheck - Not Requested

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer
Copyright and Trademark Notice

This report contains information obtained from a variety of public and other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL EDR BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES.

Entire contents copyright 2001 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and the EDR logo are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc. (EDR). The report meets the government records search requirements of ASTM Standard Practice for Environmental Site Assessments, E 1527-00. Search distances are per ASTM standard or custom distances requested by the user.

TARGET PROPERTY INFORMATION

ADDRESS

1249 67TH STREET
EMERYVILLE, CA 94608

COORDINATES

Latitude (North): 37.849600 - 37° 50' 58.6"
Longitude (West): 122.288500 - 122° 17' 18.6"
Universal Transverse Mercator: Zone 10
UTM X (Meters): 562597.1
UTM Y (Meters): 4189161.2

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property: 2437122-G3 OAKLAND WEST, CA
Source: USGS 7.5 min quad index

TARGET PROPERTY SEARCH RESULTS

The target property was identified in the following government records. For more information on this property see page 8 of the attached EDR Radius Map report:

Site	Database(s)	EPA ID
FABCO 1249 67TH ST OAKLAND, CA 94662	Cortese	N/A
FABCO DIVISION 1249 67TH ST OAKLAND, CA 94608	HAZNET CA FID UST HIST UST	N/A
FABCO AUTOMOTIVE CORPORATION 1249 67TH STREET OAKLAND, CA 94608	FINDS	060010113033

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable") government records either on the target property or within the ASTM E 1527-00 search radius around the target property for the following databases:

FEDERAL ASTM STANDARD

NPL.....	National Priority List
Proposed NPL.....	Proposed National Priority List Sites
CERCLIS.....	Comprehensive Environmental Response, Compensation, and Liability Information System

EXECUTIVE SUMMARY

CORRACTS..... Corrective Action Report
RCRIS-TSD..... Resource Conservation and Recovery Information System
ERNS..... Emergency Response Notification System

STATE ASTM STANDARD

Toxic Pits..... Toxic Pits Cleanup Act Sites
SWFILF..... Solid Waste Information System
WMUDS/SWAT..... Waste Management Unit Database

FEDERAL ASTM SUPPLEMENTAL

CONSENT..... Superfund (CERCLA) Consent Decrees
ROD..... Records Of Decision
Delisted NPL..... National Priority List Deletions
HMIRS..... Hazardous Materials Information Reporting System
MLTS..... Material Licensing Tracking System
MINES..... Mines Master Index File
NPL Liens..... Federal Superfund Liens
PADS..... PCB Activity Database System
RAATS..... RCRA Administrative Action Tracking System
TRIS..... Toxic Chemical Release Inventory System
TSCA..... Toxic Substances Control Act
SSTS..... Section 7 Tracking Systems
FTTS..... FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

STATE OR LOCAL ASTM SUPPLEMENTAL

AST..... Aboveground Petroleum Storage Tank Facilities
CLEANERS..... Cleaner Facilities
CA WDS..... Waste Discharge System
DEED..... List of Deed Restrictions

EDR PROPRIETARY HISTORICAL DATABASES

Coal Gas..... Former Manufactured Gas (Coal Gas) Sites

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified.

Elevations have been determined from the USGS 1 degree Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. EDR's definition of a site with an elevation equal to the target property includes a tolerance of +/- 10 feet. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property (by more than 10 feet). Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in **bold italics** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

EXECUTIVE SUMMARY

FEDERAL ASTM STANDARD

CERCLIS-NFRAP: As of February 1995, CERCLIS sites designated "No Further Remedial Action Planned" (NFRAP) have been removed from CERCLIS. NFRAP sites may be sites where, following an initial investigation, no contamination was found, contamination was removed quickly without the need for the site to be placed on the NPL, or the contamination was not serious enough to require Federal Superfund Action or NPL consideration. EPA has removed approximately 25,000 NFRAP sites to lift the unintended barriers to the redevelopment of these properties and has archived them as historical records so EPA does not needlessly repeat the investigations in the future. This policy change is part of the EPA's Brownfields Redevelopment Program to help cities, states, private investors and affected citizens to promote economic redevelopment of unproductive urban sites.

A review of the CERC-NFRAP list, as provided by EDR, and dated 05/15/2002 has revealed that there is 1 CERC-NFRAP site within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
MYERS DRUM CO	6549 SAN PABLO AVE	1/8 - 1/4 ESE	T78	70

RCRIS: The Resource Conservation and Recovery Act database includes selected information on sites that generate, store, treat, or dispose of hazardous waste as defined by the Act. The source of this database is the U.S. EPA.

A review of the RCRIS-LQG list, as provided by EDR, and dated 06/10/2002 has revealed that there are 3 RCRIS-LQG sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
U C BERKELEY MARCHANT	6701 SAN PABLO AVE UNIT	0 - 1/8 ENE	G39	37
OLIVER LOFTS	1200 65TH ST	1/8 - 1/4 SSE	L48	42
MYERS DRUM CO	6549 SAN PABLO AVE	1/8 - 1/4 ESE	T78	70

RCRIS: The Resource Conservation and Recovery Act database includes selected information on sites that generate, store, treat, or dispose of hazardous waste as defined by the Act. The source of this database is the U.S. EPA.

A review of the RCRIS-SQG list, as provided by EDR, and dated 06/10/2002 has revealed that there are 15 RCRIS-SQG sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
GEORG M MARTIN CO	1250 67TH STREET	0 - 1/8 WSW A4	7	
AALBORG CISERV SAN FRANCISCO	1295 67TH ST	0 - 1/8 WSW C9	14	
BACCHUS PRESS	1287 65TH ST	0 - 1/8 SW H35	33	
ABMS INC	1052 MURRAY	1/8 - 1/4 NNE J42	38	
ADVANCED GENETIC SCIENCES	6701 SAN PABLO AVE	1/8 - 1/4 E K45	40	
FIVE PRIME THERAPEUTICS INC	6701 SAN PABLO AVE	1/8 - 1/4 E K47	42	
WEATHERFORD B M W	735 ASHBY AVE	1/8 - 1/4 N M50	49	
NADY SYSTEMS INC	1145 65TH ST	1/8 - 1/4 SE N57	55	
AUTUMN PRESS	1280 65TH ST	1/8 - 1/4 SSW Q61	56	

<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
AALBORG CISERV	1315 67TH ST	0 - 1/8 WSW F30	30	
KNOOP INC	1307 65TH ST	1/8 - 1/4 SW H43	38	
CONVERSION TECHNIQUES	1309 65TH ST	1/8 - 1/4 SW H44	39	

EXECUTIVE SUMMARY

Lower Elevation

<u>VETERANS AFFAIRS OUTPATIENT CL</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
ROCHE DIAGNOSTICS CORPORATION	841 FOLGER AVE	1/8 - 1/4 W	P55	54
B E P EMERYVILLE TECH L L C	2929 7TH ST	1/8 - 1/4 NW	AA105	95
	9529 HOLLIS ST	1/8 - 1/4 SW	AB109	97

STATE ASTM STANDARD

AWP: California DTSC's Annual Workplan, formerly known as BEP, identifies known hazardous substance sites targeted for cleanup. The source is the California Environmental Protection Agency.

A review of the AWP list, as provided by EDR, and dated 07/05/2002 has revealed that there is 1 AWP site within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
MYERS DRUM - OAKLAND	6549 SAN PABLO AVENUE	1/8 - 1/4 ESE	T77	69

CAL-SITES: Formerly known as ASPS, this database contains both known and potential hazardous substance sites. The source is the California Department of Toxic Substance Control.

A review of the Cal-Sites list, as provided by EDR, has revealed that there are 20 Cal-Sites sites within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
MYERS DRUM - OAKLAND	6549 SAN PABLO AVENUE	1/8 - 1/4 ESE	T77	69
LIFELONG MEDICAL CARE	3250 SACRAMENTO STREET	1/2 - 1 E	AZ206	203

Lower Elevation

<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
KRENZ INC	ASHBY AT 6TH STREET	1/8 - 1/4 WNW W103	93
ITT GRIMMELL PROPERTY	8121 HOLLIS STREET	1/4 - 1/2 SSW AN182	154
MIKE ROBERTS COLOR PRODUCTIONS	5707 BAY STREET	1/4 - 1/2 WSW AP168	160
BERKELEY INDUSTRIAL COURT	729 HEINZ AVENUE	1/4 - 1/2 WNW AU185	180
TRANSO/LACOSTE SITE	1600 64TH STREET/B401 B	1/4 - 1/2 SW 193	188
WAREHAM PROPERTIES	700 HEINZ AVENUE	1/4 - 1/2 WNW AY198	192
COLGATE PALMOLIVE CO	2700 7TH ST	1/2 - 1 NNW BB212	210
ELECTRO-COATING INC - PLANT 21	683 CARLETON STREET	1/2 - 1 NNW BB213	215
WESTINGHOUSE ELECTRIC CO - EME	5899 PELEADEAU STREET	1/2 - 1 S BC217	222
MILES INC CUTTER BIOLOGICAL FA	4TH / PARKER STREETS	1/2 - 1 NW 226	229
CHEVRON ASPHALT PLANT & TERMIN	1520 POWELL STREET	1/2 - 1 S 228	230
EMERYVILLE MARKETPLACE	BTW 64TH / POWELL ST	1/2 - 1 SSW 229	231
BAY STREET EXTENSION	64TH / POWELL STREETS	1/2 - 1 SSW 232	234
EBMUD	4300 EASTSHORE HIGHWAY	1/2 - 1 SW 233	234
POWELL STREET PLAZA	5500 EASTSHORE HIGHWAY	1/2 - 1 SSW B126	285
ST ALBANS SENIOR CENTER	I-80 FRONTAGE ROAD, NOR	1/2 - 1 SW 268	267
SHELLMOUND VENTURE PROJECT	SHELLMOUND STREET	1/2 - 1 SSW 274	274
INTERSTATE HIGHWAY 80/EMERYVIL	INTERSTATE 80	1/2 - 1 SSW 275	275

EXECUTIVE SUMMARY

CHMIRS: The California Hazardous Material Incident Report System contains information on reported hazardous material incidents, i.e., accidental releases or spills. The source is the California Office of Emergency Services.

A review of the CHMIRS list, as provided by EDR, and dated 12/31/1994 has revealed that there are 16 CHMIRS sites within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
Not reported	1164 68TH STREET	0 - 1/8 SE	E15	20
Not reported	1121 OCEAN	1/8 - 1/4 SSE	B1	74
Not reported	987 GRACE AVENUE	1/2 - 1 SE	234	236
Not reported	F/O 967 GRACE STREET	1/2 - 1 SE	241	242
Not reported	2515 NINTH ST.	1/2 - 1 NNW	243	244
Not reported	2501 TENTH STREET	1/2 - 1 NNW	BE245	247
Not reported	3108 KING STREET	1/2 - 1 E	BF247	248
Not reported	900 STANFORD AVENUE	1/2 - 1 ESE	248	249
Not reported	F/O 5425 SAN PABLO	1/2 - 1 SSE	257	259
Not reported	1321 DWIGHT	1/2 - 1 NNE	258	260
Not reported	A/O 1090 53RD STREET	1/2 - 1 SSE	BH261	262
Not reported	R/O 1084 53RD STREET	1/2 - 1 SSE	BH262	263
Not reported	ASHBY/MARTIN LUTHER KIN	1/2 - 1 ENE	264	264
Lower Elevation	Address	Dist / Dir	Map ID	Page
Not reported	WEST FRONTAGE ROAD - 16	1/2 - 1 W	224	228
Not reported	2427 4TH ST.	1/2 - 1 NW	BJ270	269
Not reported	2424 4TH STREET	1/2 - 1 NW	BJ272	272

CORTESE: This database identifies public drinking water wells with detectable levels of contamination, hazardous substance sites selected for remedial action, sites with known toxic material identified through the abandoned site assessment program, sites with USTs having a reportable release and all solid waste disposal facilities from which there is known migration. The source is the California Environmental Protection Agency/Office of Emergency Information.

A review of the Cortese list, as provided by EDR, has revealed that there are 98 Cortese sites within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
GEO M MARTIN COMPANY	1308 87TH ST	0 - 1/8 WSW C17	22	
FOLGER MURPHY PROPERTY	1020 MURRAY ST	0 - 1/8 NNW B37	35	
OLIVER LOFTS	1200 65TH ST	1/8 - 1/4 SSE L48	42	
WEATHERFORD BMW	735 ASHY AVE	1/8 - 1/4 N MS1	49	
ASHBY TEXACO	840 ASHY AVE	1/8 - 1/4 NNE S70	64	
MYERS DRUM CO	6549 SAN PABLO AVE	1/8 - 1/4 ESE T78	70	
KNOWN	6400 SAN PABLO	1/8 - 1/4 ESE 79	73	
ASPHALT PRODUCTS OIL CORPORATION	1001 ASHY AVE	1/8 - 1/4 NWW U84	78	
WAREHAM PROPERTY GROUP	999 ANTHONY	1/8 - 1/4 NWW U86	79	
ALTAIR GASES & EQUIPMENT INC.	1171 OCEAN AVE	1/8 - 1/4 SSE V91	84	
UNION OIL CO, CALIF.	901 ASHY AVE	1/8 - 1/4 NE AC112	100	
MACBETH HARDWARE COMPANY	930 ASHY AVE	1/4 - 1/2 NE 127	115	
BOLINS SERVICE GARAGE	6335 SAN PABLO AVE	1/4 - 1/2 SE AH140	129	
CARS RENT A CAR	6301 SAN PABLO AVE	1/4 - 1/2 SE AH148	138	
ARCO K & V GAS	6211 SAN PABLO AVE	1/4 - 1/2 SE AO158	151	
EMERALD PACKAGING	2821 107TH ST	1/4 - 1/2 N AR175	168	
DUTRO COMPANY	1333 62ND STREET	1/4 - 1/2 S AS178	172	
PROEN PRODUCTS	2777 9TH ST	1/4 - 1/2 NNW B83	177	

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
BREKENRIDGE AUTO SHOP	6045 SAN PABLO AVE	1/4 - 1/2 SSE AW191	188	
COBURN CONSTRUCTION	1006 PARDEE ST	1/4 - 1/2 N 200	194	
GATEWAY LIQUORS	5944 SAN PABLO	1/2 - 1 SSE 203	195	
BERKELEY HUMANE SOCIETY	2700 9TH ST	1/2 - 1 HNW 204	200	
MOORE PROPERTY	3155 SACRAMENTO ST	1/2 - 1 E 205	202	
CHEVRON	3250 SACRAMENTO ST	1/2 - 1 E AZ207	204	
STUDIO COMPLEX	1025 CARLETON ST	1/2 - 1 N BA209	206	
OLIVER COMPANY	1035 CARLETON ST	1/2 - 1 N BA210	207	
GARY JENSEN	5813 FREMONT ST	1/2 - 1 SSE 220	224	
CONSOLIDATED PRINTERS INC	2630 8TH ST	1/2 - 1 HNW 222	226	
FACILITY 6015-1	1212 POWELL	1/2 - 1 SSE 225	229	
SUPER-7 #25670	5714 SAN PABLO AVE	1/2 - 1 SSE 227	230	
WEST COAST PROPERTY MGMT/	2547 8TH ST	1/2 - 1 HNW 231	233	
CM SERVICE STATION	1441 ASHY AVE	1/2 - 1 ENE BD235	237	
MEADOWS PROPERTY	1440 ASHY AVE	1/2 - 1 ENE BD236	238	
CONSOLIDATED FREIGHTWAYS	2515 9TH ST	1/2 - 1 HNW BE242	243	
BERKELEY UNIFIED SCHOOL DISTRI	1500 DERBY STREET	1/2 - 1 NE 244	245	
RESIDENCE	2160 LAKE STREET	1/2 - 1 S BG249	250	
FORDHAM PROPERTIES	5515 DOYLE ST.	1/2 - 1 S BG251	252	
MALCOM X SCHOOL	1734 PRINCE ST	1/2 - 1 ENE BF252	252	
CALIFORNIA SYRUP & EXTRAC	1355 55TH	1/2 - 1 S BG253	254	
THOROUGHBRED BUILDING	1397 55TH ST	1/2 - 1 S BG254	255	
KEITH PROPERTY	2598 SACRAMENTO ST	1/2 - 1 NNE 255	257	
PARINA ENTERPRISES	5433 SAN PABLO AVE	1/2 - 1 SSE 258	258	
90194	2995 SAN PABLO AVE	1/2 - 1 N 260	261	
ALTERNATIVE INVESTMENTS	5829 ADELINE ST	1/2 - 1 ESE 263	264	
JOE'S UNOCAL 76	2501 SACRAMENTO	1/2 - 1 NNE 265	265	
CHASE PROPERTY	2366 78 SAN PABLO AVE	1/2 - 1 N 271	270	
MAXWELL CAMERON	1336 CHANNING WAY	1/2 - 1 NNE 273	273	
Lower Elevation	Address	Dist / Dir	Map ID	Page
COPPER & BRASS SALES	1295 65TH	1/8 - 1/4 SSW Q65	60	
OAKLAND DIESEL DISTRIBUTORS IN	1301 65TH STREET	1/8 - 1/4 SSW R67	60	
PEETS COFFEE AND TEA	1310 65TH ST	1/8 - 1/4 SSW R72	65	
MCGRATH STEEL CO.	8655 HOLLIS ST	1/8 - 1/4 WSW X95	89	
RIX INDUSTRIES-FRANK DEWOLF	8460 HOLLIS ST	1/4 - 1/2 SW AD123	111	
GRIND PEST CONTROL SERVICE, IN	741 FOLGER AVE	1/4 - 1/2 W AE126	115	
HFH LIMITED	8400 HOLLIS ST	1/4 - 1/2 SW 129	118	
J. T. THORPE & SON, INC.	1351 OCEAN AVE	1/4 - 1/2 SSW AF132	120	
GRAPHIC COATING INC	6355 HOLLIS ST	1/4 - 1/2 SSW 133	121	
WEATHERFORD MITSUBISHI	759 POTTER ST	1/4 - 1/2 WNW AG134	121	
PLANT INSULATION COMPANY	1372 OCEAN AVE	1/4 - 1/2 SSW AF137	125	
EMERYVILLE FIRE DEPARTMENT	6303 HOLLIS ST	1/4 - 1/2 SSW AI141	129	
FOLGER AVENUE PROPERTY	722 FOLGER	1/4 - 1/2 W AJ144	133	
DYNAVAX TECHNOLOGIES CORPORATI	717 POTTER	1/4 - 1/2 WNW AK147	136	
RYERSON STEEL	1485 65TH ST	1/4 - 1/2 SW AM151	143	
CLEARPRINT PAPER COMPANY	1482 65TH	1/4 - 1/2 SW AM155	149	
MISSION TAYLOR PROPERTIES	1410 64TH ST	1/4 - 1/2 SSW AN156	149	
COULTER STEEL & FORGE COM	1494 65TH	1/4 - 1/2 SW 160	153	
CHIRON CORPORATION	6121 HOLLIS	1/4 - 1/2 SSW AN163	156	
MIKE ROBERTS COLOR PROD I	6707 BAY	1/4 - 1/2 WSW AP167	161	
ABBOT, COLE & DEGRAF, INC.	6603 BAY ST	1/4 - 1/2 WSW AQ168	161	
VACANT FACILITY	6601 BAY ST	1/4 - 1/2 WSW AQ171	164	
HOLLIS STREET PROJECT	6050 HOLLIS ST	1/4 - 1/2 SSW 173	165	
CHRONICLE DEPOT	2817 7TH ST	1/4 - 1/2 NNW 179	173	

EXECUTIVE SUMMARY

Lower Elevation	Address	Dist / Dir	Map ID	Page
PETERSON MANUFACTURING CO., I	1600 - 63RD STREET	1/4 - 1/2 SSW	AT180	174
BERKELEY INDUSTRIAL COMPL	729 HEINZ	1/4 - 1/2WNW	AU186	182
POST OFFICE	1505 62ND AVE	1/4 - 1/2SSW	AV189	185
TRANSOLACOSTE SITE	1600 54TH STREET/6401 B	1/4 - 1/2SW	183	186
EMERY BAY PLAZA	1650 65TH ST	1/4 - 1/2WSW	AX194	189
WAREHAM PROPERTIES	700 HEINZ AVENUE	1/4 - 1/2WNW	AY198	192
BAY CENTER PROJECT	1665 65TH ST	1/4 - 1/2WSW	AX199	193
PQ CORP THE	801 GRAYSON ST	1/2 - 1 NW	201	195
OWENS TRUCKING AND CONCRETE SA	5812 HOLLIS ST	1/2 - 1 SSW	202	196
IX MARKET PLACE C/O THE MARTIN	5800 SHELLMOUND ST	1/2 - 1 SSW	206	204
CARLETON BUSINESS CENTER	2703 7TH AVE	1/2 - 1 NNW	BB211	209
ELECTRO-COATINGS	893 CARLETON STREET	1/2 - 1 NNW	BB214	216
WESTYACO ENVELOPE DIV	5650 HOLLIS ST	1/2 - 1 S	215	221
EBMD-EAST BAY MUNICIPAL DISTRI	5770 SHELLMOUND DR	1/2 - 1 SSW	216	221
WESTINGHOUSE ELECTRIC CORP	5899 PELADEAU ST PO BOX	1/2 - 1 S	BC218	223
MACAULAY FOUNDRY	811 CARLETON	1/2 - 1 NW	221	224
IX IVAN WILLIAMS	6202 CHRISTIE	1/2 - 1 SW	223	228
EMERYVILLE MARKETPLACE	BTW 64TH / POWELL ST	1/2 - 1 SSW	229	231
GARY STEEL COMPANY	2580 7TH ST	1/2 - 1 NNW	230	231
A & J TRUCKING CO., INC.	5600 SHELLMOUND ST	1/2 - 1 SSW	237	239
BP OIL CO FAC SITE NO 11126	1700 POWELL ST	1/2 - 1 SSW	238	240
SCHWABACKER FREY	5733 PELLEDEAU	1/2 - 1 S	239	240
WEATHERFORD BMW, INC.	5903 CHRISTIE AVE E BA	1/2 - 1 SSW	240	240
SHELL	1800 POWELL	1/2 - 1 SSW	246	248
POWELL STREET PLAZA	5500 EASTSHORE HIGHWAY	1/2 - 1 SSW	BI266	265
POWELL STREET PLAZA	UNKNOWN POWELL ST / S	1/2 - 1 SSW	BI267	266
CHAPMAN PROPERTY	1400 53RD ST	1/2 - 1 S	269	268

NOTIFY 65: Notify 65 records contain facility notifications about any release that could impact drinking water and thereby expose the public to a potential health risk. The data come from the State Water Resources Control Board's Proposition 65 database.

A review of the Notify 65 list, as provided by EDR, has revealed that there are 5 Notify 65 sites within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
KNOWN	6400 SAN PABLO	1/8 - 1/4SE	79	73
JOE'S UNOCAL 76	2501 SACRAMENTO	1/2 - 1 NNE	265	265
Lower Elevation	Address	Dist / Dir	Map ID	Page
WEATHERFORD BMW, INC.	5903 CHRISTIE AVE E BA	1/2 - 1 SSW	240	240
A & J TRUCKING, INC.	5600 SHELLMOND AVENUE	1/2 - 1 SSW	250	252
MOBIL SERVICE STATION #10 LTV	1700 POWELL STREET	1/2 - 1 SSW	259	261

LUST: The Leaking Underground Storage Tank Incident Reports contain an inventory of reported leaking underground storage tank incidents. The data come from the State Water Resources Control Board Leaking Underground Storage Tank Information System.

A review of the LUST list, as provided by EDR, and dated 01/17/2002 has revealed that there are 79 LUST sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
MARK HOPKINS HOTEL	999 CALIFORNIA STREET	0 - 1/8	WSW A5	7

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
PRIVATE RESIDENCE	1100 CABRILLO STREET	0 - 1/8	WSW C10	15
COPPER AND BRASS SALES INC.	1295 67TH ST	0 - 1/8	WSW C12	17
Not reported	1164 66TH ST	0 - 1/8	SE E14	20
AA JOHNSON & SON	1164 66TH ST	0 - 1/8	SE E16	21
GEO M MARTIN COMPANY	1308 67TH ST	0 - 1/8	WSW C21	24
Not reported	1308 67TH ST	0 - 1/8	SSW D22	25
LIQUID SUGAR	1275 66TH ST	0 - 1/8	SSW D25	27
Not reported	1275 66TH ST	0 - 1/8	SSW D27	29
FOLGER MURPHY PROPERTY	1020 MURRAY ST	0 - 1/8	NNW I37	35
OLIVER LOFTS	1200 65TH ST	1/8 - 1/4 SSE	L48	42
WEATHERFORD BMW	735 ASHBY AVE	1/8 - 1/4N	M51	49
Not reported	6823 SAN PABLO AVE	1/8 - 1/4E	N53	52
Not reported	1137 65TH (-1167) ST	1/8 - 1/4E	N58	55
TEXACO	840 ASHBY AVE	1/8 - 1/4 NNE	S69	62
ASPHALT PRODUCTS OIL CORP	1001 ASHBY AVE	1/8 - 1/4NNW	U62	75
ASPHALT PRODUCT OIL CORP	1001 ASHBY AVE	1/8 - 1/4 NNW	U63	77
E.H. MORRILL COMPANY	999 ANTHONY ST	1/8 - 1/4NNW	U67	79
DR. MARTIN LUTHER KING SCHOOL	350 GIRARD STREET	1/8 - 1/4 SSE	V90	82
Not reported	1171 OCEAN AVE	1/8 - 1/4 SSE	V92	84
UNION OIL CO. CALIF.	901 ASHBY AVE	1/8 - 1/4 NE	AC112	100
SUPER 7	901 ASHBY AVE	1/8 - 1/4 NE	AC116	106
MACBETH HARDWARE COMPANY	930 ASHBY AVE	1/4 - 1/2 NE	I27	115
PCC	6400 SAN PABLO AVE	1/4 - 1/2 SE	AH138	127
BOLINS SERVICE GARAGE	6335 SAN PABLO AVE	1/4 - 1/2 SE	AH138	127
Not reported	6335 SAN PABLO AVE	1/4 - 1/2 SE	AH139	128
CARS RENT A CAR	6301 SAN PABLO AVE	1/4 - 1/2 SE	AH148	138
Not reported	6301 SAN PABLO AVE	1/4 - 1/2 SE	AH149	139
ARCO K & V GAS	6211 SAN PABLO AVE	1/4 - 1/2 SE	AO158	151
ALASKA GASOLINE	6211 SAN PABLO AVE	1/4 - 1/2 SE	AO159	152
EMERALD PACKAGING	2621 10TH ST	1/4 - 1/2 N	AR175	166
PARK MERED APARTMENTS	50 CHUMASERO DRIVE	1/4 - 1/2 S	AS177	170
PROEN PRODUCTS	2777 9TH ST	1/4 - 1/2 NNW	I83	177
BREKENRIDGE AUTO SHOP	6045 SAN PABLO AVE	1/4 - 1/2 SSE	AW181	186
Not reported	6045 SAN PABLO AVE	1/4 - 1/2 SSE	AW192	188
COBURN CONSTRUCTION	1066 PARDEE ST	1/4 - 1/2 N	200	194
Lower Elevation	Address	Dist / Dir	Map ID	Page
Not reported	1301 65TH ST	1/8 - 1/4 SSW	R66	60
OAKLAND DIESEL DISTRIBUTORS IN	1301 65TH STREET	1/8 - 1/4 SSW	R67	60
KLEINEN CO. INC.	1414 WALLACE AVENUE	1/8 - 1/4 WSW	X94	85
MCGRATH STEEL CO.	8895 HOLLIS ST	1/8 - 1/4 WSW	X95	89
HOLLIS STREET INVESTORS	6500 HOLLIS ST	1/8 - 1/4 SW	AB118	108
HOLLIS STREET INVESTORS	6500 HOLLIS ST	1/8 - 1/4 SW	AB119	108
RIX INDUSTRIES-FRANK DEWOLF	6440 HOLLIS ST	1/4 - 1/2 SW	AD123	111
RIX INDUSTRIES	6460 HOLLIS ST	1/4 - 1/2 SW	AD124	113
GRING PEST CONTROL	741 FOLGER AVE	1/4 - 1/2 W	AE125	113
HFH LIMITED	6400 HOLLIS ST	1/4 - 1/2 SW	AE125	113
Not reported	1351 OCEAN AVE	1/4 - 1/2 SSW	AF130	119
HFH LIMITED	1351 OCEAN AVE	1/4 - 1/2 SSW	AF131	119
KRENZ LIMITED	750 POTTER ST	1/4 - 1/2 NNW	AG135	123
PLANT INSULATION COMPANY	1372 OCEAN AVE	1/4 - 1/2 SSW	AF137	125
EMERYVILLE FIRE DEPARTMENT	6303 HOLLIS ST	1/4 - 1/2 SSW	AI141	129
EMERYVILLE FIRE STATION #2	6303 HOLLIS STREET	1/4 - 1/2 SSW	AI142	129
DIESEL FUEL TANK AREA FORMER	722 FOLGER AVENUE	1/4 - 1/2 W	AI143	131
FOLGER AVENUE PROPERTY	722 FOLGER	1/4 - 1/2 W	AI144	133

EXECUTIVE SUMMARY

Lower Elevation	Address	Dist / Dir	Map ID	Page
BAY EXPORT SERVICES	717 POTTER ST	1/4 - 1/2WNW AK145		135
BAY EXPORT SERVICES	717 POTTER ST	1/4 - 1/2WNW AK146		135
CLEARPRINT PAPER CO	1482 67TH ST	1/4 - 1/2WSW AL150		139
RYERSON STEEL	1485 65TH ST	1/4 - 1/2SW AM151		143
RYERSON STEEL & ALUMINUM	1485 65TH ST	1/4 - 1/2SW AM152		143
COULTER STEEL & FORGE COMPANY	1494 67TH STREET	1/4 - 1/2WSW AL153		144
COULTER STEEL & FORCE CO.	1494 67TH ST	1/4 - 1/2WSW AL154		149
MISSION TAYLOR PROPERTIES	1410 64TH ST	1/4 - 1/2SSW AN156		149
Not reported	1410 64TH ST	1/4 - 1/2SSW AN157		151
Not reported	6121 HOLLIS ST	1/4 - 1/2SSW AN151		154
ITT GRINNELL PROPERTY	6121 HOLLIS STREET	1/4 - 1/2SSW AN162		154
MIKE ROBERTS COLOR PROD INC	6707 BAY ST	1/4 - 1/2WSW AP164		158
ABBOT, COLE & DEGRAF, INC.	6803 BAY ST	1/4 - 1/2WSW AQ168		161
VACANT FACILITY	6603 BAY ST	1/4 - 1/2WSW AQ169		161
VACANT FACILITY	6601 BAY ST	1/4 - 1/2WSW AC170		163
CHRONICLE DEPOT	2817 77TH ST	1/4 - 1/2NNW T79		173
PETERSON MANUFACTURING COMPANY	1600 63RD ST	1/4 - 1/2SSW AT181		175
Not reported	1600 63RD ST	1/4 - 1/2SSW AT182		177
BERKELEY INDUSTRIAL COURT	729 HEINZ AVENUE	1/4 - 1/2NNW AU185		180
BERKELEY IND COURT	729 HEINZ AVE	1/4 - 1/2NNW AU187		183
POST OFFICE	1505 62ND AVE	1/4 - 1/2SSW AV188		184
Not reported	1650 65TH ST	1/4 - 1/2WSW AX195		189
EMERY BAY PLAZA	1650 65TH ST	1/4 - 1/2WSW AX196		189
DURKEE WAREHAM	700 HEINZ ST	1/4 - 1/2WNW AY197		190
BAY CENTER PROJECT	1665 65TH ST	1/4 - 1/2WSW AX199		193

BEP: Bond Expenditure Plan comes from the Department of Health Services.

A review of the CA BOND EXP. PLAN list, as provided by EDR, has revealed that there is 1 CA BOND EXP. PLAN site within approximately 1 mile of the target property.

Lower Elevation	Address	Dist / Dir	Map ID	Page
WESTINGHOUSE ELECTRIC COMPANY	5899 PELADEAU STREET	1/2 - 1 S	BC219	224

UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the State Water Resources Control Board's Hazardous Substance Storage Container Database.

A review of the UST list, as provided by EDR, and dated 01/17/2002 has revealed that there are 14 UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
MARK HOPKINS HOTEL	999 CALIFORNIA STREET	0 - 1/8 WSW A5		7
PRIVATE RESIDENCE	1100 CARRILLO STREET	0 - 1/8 WSW C10		15
GOLDEN GATE DRAYAGE	175 DE HARO STREET	0 - 1/8 WSW C23		26
THE DOW CHEMICAL COMPANY	305 CRENSHAW BLVD	0 - 1/8 SSW D26		28
ORIENTAL WAREHOUSE	600 01ST STREET	0 - 1/8 ENE G32		31
ST. FRANCIS PIE SHOP	1125 67TH ST	0 - 1/8 ENE G33		31
OLIVER LOFTS	1200 65TH ST	1/8 - 1/4SSE L48		42
PRIVATE RESIDENCE	149 URBANO DRIVE	1/8 - 1/4SE N52		52
RESIDENCE	2710 BROADWAY STREET	1/8 - 1/4ESE T73		65
MYERS DRUM CO	6549 SAN PABLO AVE	1/8 - 1/4ESE T78		70

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
DR. MARTIN LUTHER KING SCHOOL	350 GIRARD STREET	1/8 - 1/4 SSE V90		82
UNOCAL - HONG DU'S #731	901 ASHBY AVE	1/8 - 1/4 NE AC117		108
Lower Elevation	Address	Dist / Dir	Map ID	Page
KLEINEN CO. INC	1414 WALLACE AVENUE	1/8 - 1/4 WSW X94		85
RESIDENCE	2100 GREEN STREET	1/8 - 1/4 WSW X99		91

CA FID: The Facility Inventory Database contains active and inactive underground storage tank locations. The source is the State Water Resource Control Board.

A review of the CA FID UST list, as provided by EDR, has revealed that there are 11 CA FID UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
COPPER AND BRASS SALES INC.	1295 67TH ST	0 - 1/8 WSW C12		17
OLIVER LOFTS	1200 65TH ST	1/8 - 1/4 SSE L48		42
ASHBY TEXACO	840 ASHBY AVE	1/8 - 1/4 NNE S70		64
MYERS DRUM CO	6549 SAN PABLO AVE	1/8 - 1/4 ESE T78		70
ASPHALT PRODUCTS OIL CORPORATION	1001 ASHBY AVE	1/8 - 1/4 NWW U84		78
AA.JOHNSON & SON, INC.	1164 068TH ST	1/8 - 1/4 E S65		78
E.H. MORRILL COMPANY	999 ANTHONY ST	1/8 - 1/4 NWW U87		79
UNION OIL CO, CALIF.	901 ASHBY AVE	1/8 - 1/4 NE AC112		100
CALAG PRODUCTS, INC.	1275 668TH ST	1/8 - 1/4 E		109

Lower Elevation	Address	Dist / Dir	Map ID	Page
CHALLENGE MANUFACTURING CO.	1308 067TH ST	1/8 - 1/4 W		80
MCGRATH STEEL CO.	6855 HOLLIS ST	1/8 - 1/4 WSW X95		89

HIST UST: Historical UST Registered Database.

A review of the HIST UST list, as provided by EDR, and dated 10/15/1990 has revealed that there are 10 HIST UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
COPPER AND BRASS SALES INC.	1295 67TH ST	0 - 1/8 WSW C11		17
CHALLENGE MANUFACTURING CO.	1308 67TH ST	0 - 1/8 WSW C20		24
CALAG PRODUCTS, INC.	1275 668TH ST	0 - 1/8 SSW D24		26
OLIVER LOFTS	1200 65TH ST	1/8 - 1/4 SSE L48		42
ASHBY TEXACO	840 ASHBY AVE	1/8 - 1/4 NNE S71		64
OAKLAND - TIGHTHEAD	6549 SAN PABLO AVE	1/8 - 1/4 ESE T74		86
MYERS DRUM CO	6549 SAN PABLO AVE	1/8 - 1/4 ESE T78		70
SUPER-7 #24302	901 ASHBY AVE	1/8 - 1/4 NE AC114		105

Lower Elevation	Address	Dist / Dir	Map ID	Page
KLEINEN CO. INC	1414 WALLACE AVENUE	1/8 - 1/4 WSW X94		85
MCGRATH STEEL CO.	6855 HOLLIS ST	1/8 - 1/4 WSW X96		89

EXECUTIVE SUMMARY

STATE OR LOCAL ASTM SUPPLEMENTAL

CA SLIC: SLIC Region comes from the California Regional Water Quality Control Board.

A review of the CA SLIC list, as provided by EDR, has revealed that there are 18 CA SLIC sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
LIQUID SUGARS INC	1268 65TH ST	0 - 1/8 SSW	D13	18
OLIVER LOFTS	1200 65TH ST	1/8 - 1/4 SSE	L48	42
MYERS DRUM CO	6349 SAN PABLO AVE	1/8 - 1/4 ESE	T78	70
ASPHALT PRODUCTS OIL CORP	1001 ASHBY AVE	1/8 - 1/4 NNW	U82	75
UNION OIL CO, CALIF.	901 ASHBY AVE	1/8 - 1/4 NE	AC112	100
EMERALD PACKAGING	2821 10TH ST	1/4 - 1/2 N	AR174	165
PROEN PRODUCTS	2777 9TH ST	1/4 - 1/2 NNW	183	177

Lower Elevation	Address	Dist / Dir	Map ID	Page
UC BERKELEY	MURRAY ST/FOLGER ST/7TH	1/8 - 1/4 WNW	W93	84
B/E/P EMERYVILLE TECH L L C	6529 HOLLIS ST	1/8 - 1/4 SW	AB109	97
REDEVELOPMENT AGENCY	1265 / 1269 OCEAN AVE	1/4 - 1/2 SSW	122	110
KERNZ LIMITED	750 POTTER STREET	1/4 - 1/2 VNW	AG136	125
DIESEL FUEL TANK AREA FORMER	722 FOLGER AVENUE	1/4 - 1/2 W	AJ143	131
ITT GRINNELL PROPERTY	6121 HOLLIS STREET	1/4 - 1/2 SSW	AN162	154
UNKNOWN	6707 BAY STREET	1/4 - 1/2 WSW	AP165	159
TEMESCAL	2850 7TH ST	1/4 - 1/2 NNW	172	164
REDEVELOPMENT AGENCY TRANSOL L	6401 BAY ST	1/4 - 1/2 SW	176	169
BERKELEY INDUSTRIAL COMPLEX	729 HERNZ ST	1/4 - 1/2 VNW	AU184	179
TRANSOL LANCASTE SITE	1600 64TH ST	1/4 - 1/2 SW	190	185

HAZNET: The data is extracted from the copies of hazardous waste manifests received each year by the DTSC. The annual volume of manifests is typically 700,000-1,000,000 annually, representing approximately 350,000-500,000 shipments. Data from non-California manifests & continuation sheets are not included at the present time. Data are from the manifests submitted without correction, and therefore many contain some invalid values for data elements such as generator ID, TSD ID, waste category, & disposal method. The source is the Department of Toxic Substance Control is the agency

A review of the HAZNET list, as provided by EDR, has revealed that there are 54 HAZNET sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
MARK HOPKINS HOTEL	999 CALIFORNIA STREET	0 - 1/8 WSW	A5	7
GEO M MARTIN CO	1250 67TH STREET	0 - 1/8 WSW	A6	11
MORAN MOTORSPORT	1019 FOLGER ST	0 - 1/8 N	B7	12
TABS TOMORROW	1041A FOLGER AVE	0 - 1/8 N	B8	13
LIQUID SUGARS INC	1268 65TH ST	0 - 1/8 SSW	D13	18
1X GEO M MARTIN COMPANY	1308 67TH STREET	0 - 1/8 WSW	C18	22
GRANCO PUMP/DIV CHALLENGE MANU	1308 67TH STREET	0 - 1/8 WSW	C19	23
L.S.I LIQUID SUGARS INTERNATIO	1277 66TH ST	0 - 1/8 SSW	D28	29
PRAXIS PRODUCT DESIGN INC	1285 66TH ST	0 - 1/8 SW	D31	30
BACCHUS PRESS INC	1287 66TH ST	0 - 1/8 SW	H34	32
BERKELEY MILL & FURNITURE	1028 MURRAY ST	0 - 1/8 N	I38	38
BERKELEY MILL AND FURNITURE	1034 MURRAY ST	0 - 1/8 N	I40	37
TABS TOMMOROW	1050 MURRAY ST	1/8 - 1/4 N	J41	37
DNA PLANT TECHNOLOGY	6701 SAN PABLO AVE	1/8 - 1/4 E	K46	41

EXECUTIVE SUMMARY

Equal/Higher Elevation

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
OLIVER LOFTS	1200 65TH ST	1/8 - 1/4 SSE	L48	42
OLIVER RUBBER COMPANY	1200 65TH ST	1/8 - 1/4 SSE	L49	47
WEATHERFORD BMW	735 ASHBY AVE	1/8 - 1/4 N	M51	49
JOHN NADY	1137-1167 65TH ST	1/8 - 1/4 SE	N58	54
LIQUID SUGARS INC	1274 65TH ST	1/8 - 1/4 SSW	Q59	55
1X EDWIN V WARREN TRUST	1280 65TH STREET	1/8 - 1/4 SSW	Q60	56
AUTUMN PRESS	1280 65TH ST	1/8 - 1/4 SSW	Q61	56
QUALITY TUNE UP #36	6598 SAN PABLO AVENUE	1/8 - 1/4 ESE	Q63	59
OAKLAND DIESEL DISTRIBUTORS IN	1289 65TH	1/8 - 1/4 SSW	Q64	59
RINEHART OIL COMPANY	840 ASHBY AVE.	1/8 - 1/4 NNE	S68	62
DOROTHY WARBURTON	6549 SAN PABLO AVE	1/8 - 1/4 ESE	T75	67
MYERS CONTAINER CORP	6549 SAN PABLO AVE	1/8 - 1/4 ESE	T76	68
WAREHAM PROPERTY GROUP	999 ANTHONY	1/8 - 1/4 NNW	U86	79
WAREHAM PROP	999 ANTHONY ST	1/8 - 1/4 NNE	U88	81
PRAXAIR	1171 OCEAN AVE	1/8 - 1/4 SSE	V89	81
ALTAIR GASES & EQUIPMENT INC.	1171 OCEAN AVE	1/8 - 1/4 SSE	V91	84
EMERYVILLE REDEVELOPMENT AGENC	1285-1289 OCEAN AVENUE	1/8 - 1/4 S	W98	91
UNION OIL CO, CALIF.	901 ASHBY AVE	1/8 - 1/4 NE	AC112	100
TOSCO CORPORATION SS#31305	901 ASHBY AVE	1/8 - 1/4 NE	AC113	104
7 ELEVEN STORE 24302	901 ASHBY AVE	1/8 - 1/4 NE	AC115	105

Lower Elevation

Lower Elevation	Address	Dist / Dir	Map ID	Page
AALBORG CISERV SAN FRANCISCO	1315 67TH STREET	0 - 1/8 WSW	F29	30
BASIC LIVING PRODUCTS	1321 67TH STREET	0 - 1/8 WSW	F38	33
CONVERSION TECHNIQUES	1389 66TH ST	1/8 - 1/4 SW	H44	39
EAST BAY STEEL PRODUCTS	900 MURRAY ST	1/8 - 1/4 WNW	M54	53
PRINT MIT PRESS	830 FOLGER AVE	1/8 - 1/4 W	P62	58
OAKLAND DIESEL DISTRIBUTORS IN	1301 65TH STREET	1/8 - 1/4 SSW	R67	60
PEETS COFFEE AND TEA	1310 65TH ST	1/8 - 1/4 SSW	R72	65
KLEINEN CO, INC	1414 WALLACE AVENUE	1/8 - 1/4 WSW	X94	85
ROLLER PRESS INC	6647 HOLLIS ST	1/8 - 1/4 WSW	X97	90
UNITECH AUTO SERVICE	753 FOLGER AVE	1/8 - 1/4 W	Y100	92
HILLHOUSE CONSTRUCTION	1401 66TH ST	1/8 - 1/4 WSW	Z101	93
ELLIS PARTNER	6589 HOLLIS ST	1/8 - 1/4 WSW	Z102	93
WAREHAM DEVELOPMENT	2929 7TH ST	1/8 - 1/4 NW	AA104	94
ROCHE DIAGNOSTICS	2929 7TH ST	1/8 - 1/4 NW	AA106	95
PIC GROUP	2929 7TH ST STE 130	1/8 - 1/4 NW	AA107	96
TIRE AND ALIGNMENT CENTER	751 FOLGER	1/8 - 1/4 W	Y108	98
B/E/P EMERYVILLE TECH L L C	8529 HOLLIS ST	1/8 - 1/4 SW	AB109	97
TULIP PUBLISHING & GRAPHICS IN	2920 7TH STREET	1/8 - 1/4 NW	AA110	99
TAYLOR & NG	2919 7TH STREET	1/8 - 1/4 NW	AA111	100
HOWLETT WORKS	746 FOLGER AVE	1/8 - 1/4 W	Y121	109


EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped:

Site Name	Database(s)
OLIVER RUBBER COMPANY	LUST, FTTS
SHELLMOUND STREET	Cal-Sites, Cortese, DEED
IKEA (FORMER BARBARY COAST)	Cal-Sites, DEED
63RD STREET TRUNK SEWER PROJECT	Cal-Sites
OCROVILLE TEXACO	Notify 65, LUST, Cortese
3455 ETIE STREET	HAZNET, CHMIRS
BERKELEY BUSINESS CENTER	LUST, Cortese
ELECTRO COATINGS INC	LUST, Cortese
DAYS INN HOTEL	Cortese, LOS ANGELES CO. HMS
GOLDSMITH LATHROP	LUST, Cortese
EMERY BAY MARKETPLACE	LUST, Cortese
SOUTHERN PACIFIC RAILWAY-EMERYVILL	CERCIS
IDEAL PAINT CO., INC.	LUST, UST
1081 85 EASTSHORE HIGHWAY	LUST
SHELL	LUST
UNKNOWN	LUST
6601 BAY ST	LUST
6707 BAY ST	LUST
MARKET PLACE MARTIN COMPANY	LUST, CA SLIC
4300 EASTSHORE HWY	LUST
6050 HOLLIS ST ST	LUST
5813 15 SHELLMOUND ST	LUST
ANOTHER TREE EMERYVILLE PROJECT	LUST
UNKNOWN	LUST
2901 SAN PABLO AVE	HIST UST
O.C. JONES AND SONS (BACK YARD	HIST UST
DELTA LINES.	HIST UST
JUDSON STEEL CORPORATION	HIST UST
P'ME NATIONWIDE, INC.	HIST UST
RYDER/PIE NATIONWIDE, INC.	HIST UST
METRIC MOTION	HAZNET
D&M AUTO BODY SHOP	HAZNET
STEVES AUTO CARE	HAZNET
TERRANOVA INDUSTRIES	HAZNET
EXXON CO USA #78465	HAZNET
CITY OF EMERYVILLE /PUBLICWORKS	HAZNET
CHIRON CORPORATION	RCRIS-SQG, FINDS, HAZNET
CITY OF EMERYVILLE	HAZNET
CALTRANS POWELL ST PROJECT	HAZNET
MYERS CONTAINER CORP	HAZNET
EQUILON ENTERPRISES LLC	HAZNET
UC BERKELEY MARCHANT BLDG	HAZNET
UC BERKELEY-MARCHANT	HAZNET
DTSC/SAN LEANDRO PLUME	HAZNET
CALTRANS BERKELEY	RCRIS-SQG, FINDS
UNKNOWN	CA SLIC


TC834561.1s EXECUTIVE SUMMARY 13

OVERVIEW MAP - 834561.1s - Geomatrix Consultants

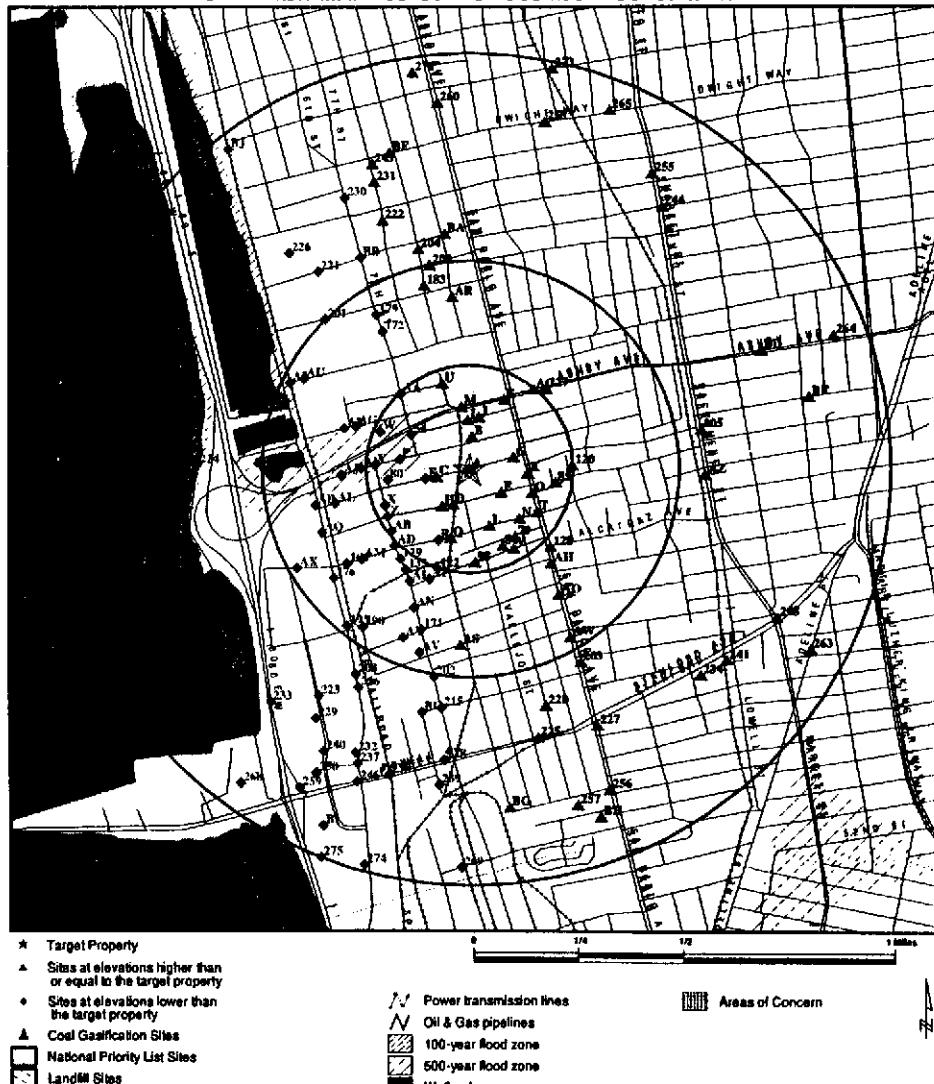

TARGET PROPERTY: ADDRESS: CITY/STATE/ZIP: LAT/LONG:	1249 67th Street 1249 67th Street Emeryville CA 94608 37.8496 / 122.2885	CUSTOMER: CONTACT: INQUIRY #: DATE:	Geomatrix Consultants Caryn Kelly 834561.1s August 21, 2002 11:50 am
--	---	--	---

DETAIL MAP - 834561.1s - Geomatrix Consultants

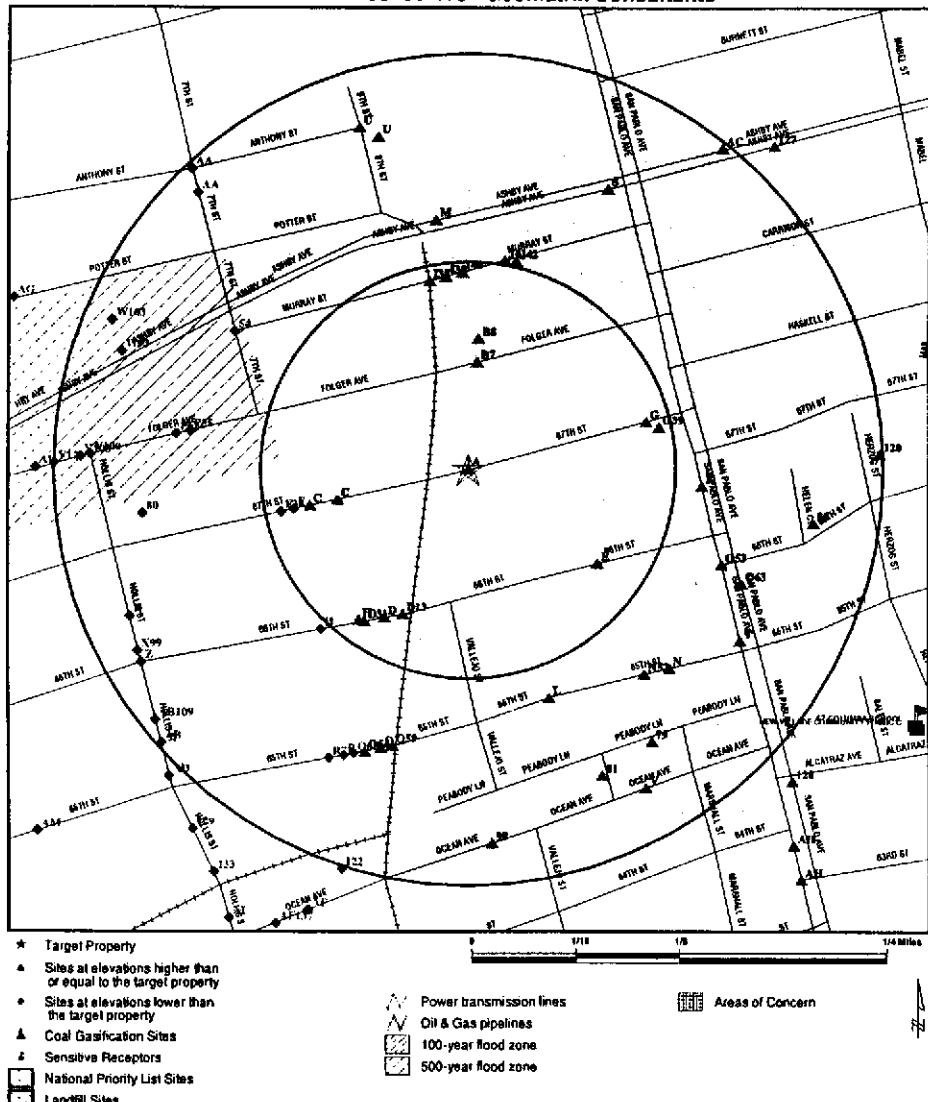

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
FEDERAL ASTM STANDARD								
NPL		1.000	0	0	0	0	NR	0
Proposed NPL		1.000	0	0	0	0	NR	0
CERCLIS		0.500	0	0	1	0	NR	0
CERC-NFRAP		0.250	0	0	1	0	NR	1
CORRACTS		1.000	0	0	0	0	NR	0
RCRIS-TSD		0.500	0	0	0	0	NR	0
RCRIS Lg. Quan. Gen.		0.250	1	2	0	0	NR	3
RCRIS Sm. Quan. Gen.		0.250	4	11	0	0	NR	15
ERNS		TP	NR	NR	NR	NR	NR	0
STATE ASTM STANDARD								
AWP		1.000	0	1	0	0	NR	1
Cal-Sites		1.000	0	2	5	13	NR	20
CHMIRS		1.000	1	1	0	14	NR	16
Cortese	X	1.000	2	13	36	47	NR	98
Notify 65		1.000	0	1	0	4	NR	5
Toxic Pits		1.000	0	0	0	0	NR	0
State Landfill		0.500	0	0	0	0	NR	0
WMUDS/SWAT		0.500	0	0	0	0	NR	0
LUST		0.500	10	18	51	NR	NR	79
CA Bond Exp. Plan		1.000	0	0	0	1	NR	1
UST		0.250	6	8	NR	NR	NR	14
CA FID UST	X	0.250	1	10	NR	NR	NR	11
HIST UST	X	0.250	3	7	NR	NR	NR	10
FEDERAL ASTM SUPPLEMENTAL								
CONSENT		1.000	0	0	0	0	NR	0
ROD		1.000	0	0	0	0	NR	0
Delisted NPL	X	1.000	0	0	0	0	NR	0
FINDS		TP	NR	NR	NR	NR	NR	0
HMIRS		TP	NR	NR	NR	NR	NR	0
MLTS		TP	NR	NR	NR	NR	NR	0
MINES		0.250	0	0	0	0	NR	0
NPL Liens		TP	NR	NR	NR	NR	NR	0
PADS		TP	NR	NR	NR	NR	NR	0
RAATS		TP	NR	NR	NR	NR	NR	0
TRIS		TP	NR	NR	NR	NR	NR	0
TSCA		TP	NR	NR	NR	NR	NR	0
SSTS		TP	NR	NR	NR	NR	NR	0
FTTS		TP	NR	NR	NR	NR	NR	0
STATE OR LOCAL ASTM SUPPLEMENTAL								
AST		TP	NR	NR	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
CLEANERS		0.250	0	0	NR	NR	NR	0
CA WOS		TP	NR	NR	NR	NR	NR	0
DEED		TP	NR	NR	NR	NR	NR	0
CA SLIC		0.500	1	6	11	NR	NR	18
HAZNET	X	0.250	14	40	NR	NR	NR	54

EDR PROPRIETARY HISTORICAL DATABASES

Coal Gas	1.000	0	0	0	0	NR	0
----------	-------	---	---	---	---	----	---

TP = Target Property

NR = Not Requested at this Search Distance

* Sites may be listed in more than one database

Map ID Direction Distance Elevation (ft.) Elevation	Site	Database(s)	EDR ID Number EPA ID Number
---	------	-------------	--------------------------------

Coal Gas Site Search: No site was found in a search of Real Property Scan's ENVIROHAZ database.

A1 Target Property	FABCO 1249 87TH ST OAKLAND, CA 94662	Cortese	1001264218 N/A
-----------------------	--	---------	-------------------

Site 1 of 6 in cluster A

CORTESE:
 Reg Id: 01-0608
 Region: CORTESE
 Reg By: Leaking Underground Storage Tanks

Reg Id: 3046
 Region: CORTESE
 Reg By: Leaking Underground Storage Tanks

A2 Target Property	FABCO DIVISION 1249 87TH ST OAKLAND, CA 94608
-----------------------	---

HAZNET 1000175745
 CA FID UST
 HIST UST N/A

Site 2 of 6 in cluster A

HAZNET:
 Geapid: CAL000124120
 Tepaid: CAL000027741
 Gen County: 1
 Tsd County: 5
 Tons: 1.8858
 Category: Asbestos-containing waste
 Disposal Method: Disposal, Land Fill
 Contact: FABCO AUTOMOTIVE CORP.
 Telephone: (510) 596-2700
 Mailing Address: P.O. BOX 8278
 OAKLAND, CA 94682
 County: 1

FID:
 Facility ID: 01002087
 Reg By: Inactive Underground Storage Tank Location
 Cortese Code: Not reported
 Status: Inactive
 Mail To: Not reported
 P O BOX
 OAKLAND, CA 94608
 Contact: Not reported
 DUNS No: Not reported
 Creation: 10/22/93
 EPA ID: Not reported
 Comments: Not reported

Regulate ID: 000003673
 SIC Code: Not reported
 Facility Tel: (415) 658-7070

Contact Tel: Not reported
 NPDES No: Not reported
 Modified: 00/00/00

UST HIST:
 Facility ID: 3673
 Tank Num: 1
 Tank Capacity: 0
 Tank Used for: WASTE
 Type of Fuel: WASTE OIL
 Leak Detection: None
 Contact Name: M. NIEMELA, GENERAL MANAGER
 Total Tanks: 2

Container Num: 2
 Year Installed: Not reported
 Tank Construction: Not reported
 Telephone: (415) 658-7070
 Region: STATE

Map ID Direction Distance Distance (ft.) Elevation	Site	MAP FINDINGS		Map ID Direction Distance Distance (ft.) Elevation	Site	MAP FINDINGS	
		Database(s)	EDR ID Number EPA ID Number			Database(s)	EDR ID Number EPA ID Number
FABCO DIVISION (Continued)							
			1000175745				
Facility Type:	2	Other Type:	MANUFACTURING PLANT				
Facility ID:	3673	Container Num:	1				
Tank Num:	2	Year Installed:	1974				
Tank Capacity:	1000						
Tank Used for:	PRODUCT						
Type of Fuel:	UNLEADED	Tank Construction:	Not reported				
Leak Detection:	None						
Contact Name:	M. NIEMELA, GENERAL MANAGER	Telephone:	(415) 658-7070				
Total Tanks:	2	Region:	STATE				
Facility Type:	2	Other Type:	MANUFACTURING PLANT				
A3	FABCO AUTOMOTIVE CORPORATION 1249 67TH STREET OAKLAND, CA 94608	FINDS	1004442858 060010113033				
Target Property	Site 3 of 5 in cluster A						
FINDS:							
Other Pertinent Environmental Activity Identified at Site:							
AIRS Facility System (AIRS/AFS)							
Facility Registry System (FRS)							
National Emissions Trends (NET)							
A4	GEORG M MARTIN CO 1250 67TH STREET EMERYVILLE, CA 94608	RCRIS-SQG	1000357185 FINDS CAD981457229				
WSW <1/8 9 ft. Higher	Site 4 of 6 in cluster A						
RCRIS:							
Owner:	GEO M MARTIN CO INC (415) 555-1212						
EPA ID:	CAD981457229						
Contact:	ENVIRONMENTAL MANAGER (415) 652-2200						
Classification:	Small Quantity Generator						
Used Oil Recyc:	No						
TSDF Activities:	Not reported						
Violation Status:	No violations found						
FINDS:							
Other Pertinent Environmental Activity Identified at Site:							
Facility Registry System (FRS)							
National Emissions Trends (NET)							
National Toxics Inventory (NTI)							
Resource Conservation and Recovery Act Information system (RCRAINFO)							
Toxic Chemical Release Inventory System (TRIS)							
AS	MARK HOPKINS HOTEL 999 CALIFORNIA STREET , CA	HAZNET	1001613994				
WSW <1/8 9 ft. Higher	Site 5 of 6 in cluster A	LUST	N/A				
		UST					
MARK HOPKINS HOTEL (Continued)							
			1001613994				
Map ID Direction Distance Distance (ft.) Elevation	Site	Database(s)	EDR ID Number EPA ID Number			Database(s)	EDR ID Number EPA ID Number

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

MARK HOPKINS HOTEL (Continued)

Distance To Lust: 5217.5023306853917480842879375
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

HAZNET:

Gepaid: CAD981389398
Tepaid: CAD080011059
Gen County: 1
Tsd County: Los Angeles
Tons: 1.7467
Category: Unspecified oil-containing waste
Disposal Method: Disposal, Other
Contact: TRUCK COMPONENTS INC
Telephone: (815) 984-3301
Mailing Address: 1249 67TH ST
EMERYVILLE, CA 94608 - 1120
County 1

Gepaid: CAD981389398
Tepaid: CAD044003556
Gen County: 1
Tsd County: Yolo
Tons: 2.2184
Category: Unspecified oil-containing waste
Disposal Method: Transfer Station
Contact: TRUCK COMPONENTS INC
Telephone: (815) 984-3301
Mailing Address: 1249 67TH ST
EMERYVILLE, CA 94608 - 1120
County 1

Gepaid: CAD981389398
Tepaid: CAD059494310
Gen County: 1
Tsd County: Santa Clara
Tons: 1.3125
Category: Other organic solids
Disposal Method: Disposal, Other
Contact: TRUCK COMPONENTS INC
Telephone: (815) 984-3301
Mailing Address: 1249 67TH ST
EMERYVILLE, CA 94608 - 1120
County 1

Gepaid: CAD981389398
Tepaid: CAD044003556
Gen County: 1
Tsd County: Yolo
Tons: 1.5012
Category: Unspecified oil-containing waste
Disposal Method: Transfer Station
Contact: TRUCK COMPONENTS INC
Telephone: (815) 984-3301
Mailing Address: 1249 67TH ST
EMERYVILLE, CA 94608 - 1120
County 1

1001813994

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

MARK HOPKINS HOTEL (Continued)

Gepaid: CAD981389398
Tepaid: CAD083166726
Gen County: 1
Tsd County: Stanislaus
Tons: 6.9863
Category: Unspecified oil-containing waste
Disposal Method: Recycler
Contact: TRUCK COMPONENTS INC
Telephone: (815) 984-3301
Mailing Address: 1249 67TH ST
EMERYVILLE, CA 94608 - 1120
County 1

The CA HAZNET database contains 4 additional records for this site.
Please contact your EDR Account Executive for more information.

UST San Francisco County:

Facility ID: 350 Case Number: Not reported
Tank ID: Not reported Tank Capacity: Not reported
Manufacturer: Not reported Date Installed: Not reported
Other Interior Lining: Not reported
Receive Date: 11/28/88 0:00:00 Close Date: Not reported
Owner Name: Not reported
Certified Date: Not reported
Flag: CLOSED Dispenser: Not reported
Other Corrosion Protection: Not reported
Drop Tube: Not reported
Striker Plate: Not reported
Contents A: Not reported
Contents B: Not reported
Contents C: Not reported
Mailing Name: Not reported
Mailing Address: Not reported
Other Substance: Not reported
Tank Construction Type: Not reported
Tank Material: Not reported
Interior Lining: Not reported
Corrosion Protection: Not reported
Spill Contamination Installed Date: Not reported
Overfill Prevention Installed Date: Not reported
Piping Type: Not reported
Piping Aboveground: Not reported
Piping Underground: Not reported
Piping Construction: Not reported
Piping Construction Aboveground: Not reported
Piping Construction Underground: Not reported
Piping Material: Not reported
Other Piping Material: Not reported
Piping Material Aboveground: Not reported
Piping Material Underground: Not reported
Pipe Leak Detection: Not reported
Estimated Last Date Used: Not reported
Estimated Quantity Remaining: Not reported
Inert Filing: Not reported
Jurisdiction: Not reported
Other Tank System: Not reported
Other Tank Leak Detection: Not reported

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction			Direction		
Distance			Distance (ft.)		
Elevation	Site		Elevation	Site	
	Database(s)	EDR ID Number		Database(s)	EDR ID Number
		EPA ID Number			EPA ID Number
		1001613994			8104574267
	MARK HOPKINS HOTEL (Continued)			GEO M MARTIN CO (Continued)	
	Other Pipe Leak Detection:	Not reported		County	1
	Methanol Compatible:	Not reported		Gepaid:	CAD981457228
A6	GEO M MARTIN CO			Tepaid:	CAD000088252
WSW	1250 67TH STREET			Gen County:	1
< 1/8	EMERYVILLE, CA 94608			Tsd County:	Los Angeles
9 ft.				Tons:	.2293
Higher	Site 6 of 8 in cluster A			Category:	Oxygenated solvents (acetone, butanol, ethyl acetate, etc.)
	HAZNET:			Disposal Method:	Transfer Station
	Gepaid:	CAD981457229		Contact:	MERRIL D MARTIN
	Tepaid:	CAD059494310		Telephone:	(415) 652-2200
	Gen County:	1		Mailing Address:	1250 67TH ST EMERYVILLE, CA 94608 - 1121
	Tsd County:	Santa Clara		County	1
	Tons:	.6173			
	Category:	Unspecified solvent mixture Waste		The CA HAZNET database contains 22 additional records for this site. Please contact your EDR Account Executive for more information.	
	Disposal Method:	Disposal, Other			
	Contact:	MERRIL D MARTIN			
	Telephone:	(415) 652-2200			
	Mailing Address:	1250 67TH ST EMERYVILLE, CA 94608 - 1121			
	County	1			
	Gepaid:	CAD981457229			
	Tepaid:	CAD083166728			
	Gen County:	1			
	Tsd County:	Stanislaus			
	Tons:	4.3785			
	Category:	Unspecified oil-containing waste			
	Disposal Method:	Recycler			
	Contact:	MERRIL D MARTIN			
	Telephone:	(415) 652-2200			
	Mailing Address:	1250 67TH ST EMERYVILLE, CA 94608 - 1121			
	County	1			
	Gepaid:	CAD981457229			
	Tepaid:	CAD080011059			
	Gen County:	1			
	Tsd County:	Los Angeles			
	Tons:	.0000			
	Category:	Off-specification, aged, or surplus organics			
	Disposal Method:	Recycler			
	Contact:	MERRIL D MARTIN			
	Telephone:	(415) 652-2200			
	Mailing Address:	1250 67TH ST EMERYVILLE, CA 94608 - 1121			
	County	1			
	Gepaid:	CAD981457229			
	Tepaid:	CAD000088252			
	Gen County:	1			
	Tsd County:	Los Angeles			
	Tons:	.2293			
	Category:	Paint sludge			
	Disposal Method:	Transfer Station			
	Contact:	MERRIL D MARTIN			
	Telephone:	(415) 652-2200			
	Mailing Address:	1250 67TH ST EMERYVILLE, CA 94608 - 1121			
	County	1			
	Gepaid:	CAD981457229			
	Tepaid:	CAD000088252			
	Gen County:	1			
	Tsd County:	Los Angeles			
	Tons:	.2293			
	Category:	Paint sludge			
	Disposal Method:	Transfer Station			
	Contact:	MERRIL D MARTIN			
	Telephone:	(415) 652-2200			
	Mailing Address:	1250 67TH ST EMERYVILLE, CA 94608 - 1121			
	County	1			
	B7			MORAN MOTORSPORT	
	North			1019 FOLGER ST	
	< 1/8			BERKELEY, CA 94702	
	341 ft.				
	Higher			Site 1 of 2 in cluster B	
	HAZNET:				
	Gepaid:	CAL000007900			
	Tepaid:	CAD009452857			
	Gen County:	1			
	Tsd County:	San Mateo			
	Tons:	.6871			
	Category:	Unspecified organic liquid mixture			
	Disposal Method:	Recycler			
	Contact:	STEPHEN MORAN			
	Telephone:	(510) 548-7171			
	Mailing Address:	1019 FOLGER ST BERKELEY, CA 94702			
	County	1			
	Gepaid:	CAL000007900			
	Tepaid:	CAD009452857			
	Gen County:	1			
	Tsd County:	San Mateo			
	Tons:	.6871			
	Category:	Unspecified organic liquid mixture			
	Disposal Method:	Recycler			
	Contact:	STEPHEN MORAN			
	Telephone:	(510) 548-7171			
	Mailing Address:	1019 FOLGER ST BERKELEY, CA 94702			
	County	1			
	Gepaid:	CAL000007900			
	Tepaid:	CAD009452857			
	Gen County:	1			
	Tsd County:	San Mateo			
	Tons:	.4170			
	Category:	Unspecified organic liquid mixture			
	Disposal Method:	Recycler			
	Contact:	STEPHEN MORAN			
	Telephone:	(510) 548-7171			

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance		EPA ID Number	Distance		EPA ID Number
Distance (ft.)			Distance (ft.)		
Elevation	Site		Elevation	Site	
MORAN MOTORSPORT (Continued)			TABS TOMORROW (Continued)		
Mailing Address:	1019 FOLGER ST BERKELEY, CA 94702	8104575400	Mailing Address:	1041A FOLGER AVE BERKELEY, CA 94710 - 2819	8100946153
County	1		County	1	
Gepaid:	CAL000007900		Gepaid:	CAL000112303	
Tepaid:	CAD093459485		Tepaid:	CA0000064517	
Gen County:	1		Gen County:	1	
Tsd County:	Fresno		Tsd County:	Sacramento	
Tons:	.0208		Tons:	.2502	
Category:	Unspecified solvent mixture/Waste		Category:	Photochemicals/photoprocessing waste	
Disposal Method:	Transfer Station		Disposal Method:	Transfer Station	
Contact:	STEPHEN MORAN		Contact:	STEVE BERGER	
Telephone:	(510) 548-7171		Telephone:	(510) 841-0775	
Mailing Address:	1019 FOLGER ST BERKELEY, CA 94702		Mailing Address:	1041A FOLGER AVE BERKELEY, CA 94710 - 2819	
County	1		County	1	
Gepaid:	CAL000007900		Gepaid:	CAL000112303	
Tepaid:	CAD009452857		Tepaid:	CAD070148432	
Gen County:	1		Gen County:	1	
Tsd County:	San Mateo		Tsd County:	1	
Tons:	.7922		Tons:	.1251	
Category:	Unspecified organic liquid mixture		Category:		
Disposal Method:	Recycler		Disposal Method:	Not reported	
Contact:	STEPHEN MORAN		Contact:	STEVE BERGER	
Telephone:	(510) 548-7171		Telephone:	(510) 841-0775	
Mailing Address:	1019 FOLGER ST BERKELEY, CA 94702		Mailing Address:	1041A FOLGER AVE BERKELEY, CA 94710 - 2819	
County	1		County	1	
The CA HAZNET database contains 4 additional records for this site. Please contact your EDR Account Executive for more information.			The CA HAZNET database contains 4 additional records for this site. Please contact your EDR Account Executive for more information.		
B8	TABS TOMORROW		HAZNET	8100946153	
North	1041A FOLGER AVE			N/A	
< 1/8	BERKELEY, CA 94710				
415 ft.					
Higher	Sites 2 of 2 in cluster B				
HAZNET:					
Gepaid:	CAL000112303				
Tepaid:	CAD070148432				
Gen County:	1				
Tsd County:	1				
Tons:	.1458				
Category:	Photochemicals/photoprocessing waste				
Disposal Method:	Treatment, Incineration				
Contact:	STEVE BERGER				
Telephone:	(510) 841-0775				
Mailing Address:	1041A FOLGER AVE BERKELEY, CA 94710 - 2819				
County	1				
The CA HAZNET database contains 4 additional records for this site. Please contact your EDR Account Executive for more information.					
C8	AALBORG CISERV SAN FRANCISCO				
WSW	1295 67TH ST				
< 1/8	EMERYVILLE, CA 94608				
426 ft.					
Higher	Sites 1 of 1 in cluster C				

RCRIS-SQG 1006857120
 FINDS CA8000047274

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

AALBORG CISERV SAN FRANCISCO (Continued)

1000857120

RCRIS:
Owner: AALBORG CISERV SAN FRANCISCO
(510) 655-7377
EPA ID: CA000047274
Contact: ROBERT MCCLAREN
(510) 655-7377
Classification: Small Quantity Generator
Used Oil Recyc: No
TSDF Activities: Not reported
Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:
Facility Registry System (FRS)
Resource Conservation and Recovery Act Information system (RCRAINFO)

C10 PRIVATE RESIDENCE
WSW 1100 CABRILLO STREET
< 1/8 , CA
428 ft.
Higher Site 2 of 11 in cluster C

State LUST:
Cross Street: Not reported
Qty Leaked: Not reported
Case Number: 01-0726
Reg Board: San Francisco Bay Region
Chemical: Diesel
Lead Agency: Local Agency
Local Agency: 01000
Case Type: Soil only
Status: Signed off, remedial action completed or deemed unnecessary
County: Alameda
Abate Method: Excavate and Dispose - remove contaminated soil and dispose in approved site
Review Date: Not reported Confirm Leak: Not reported
Workplan: Not reported Prelim Assess: Not reported
Pollution Char: Not reported Remed Plan: Not reported
Remed Action: Not reported Monitoring: Not reported
Close Date: 10/6/1994
Release Date: 2/24/1993
Cleanup Fund Id: Not reported
Discover Date: 2/24/1993
Enforcement Dt: Not reported
Enf Type: Not reported
Enter Date: 4/27/1993
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank
Interim: Yes
Leak Cause: Corrosion
Leak Source: Tank
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Not Required to be Tested.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

PRIVATE RESIDENCE (Continued)

U003713265

Priority: Not reported
Local Case #: 3932
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Sol: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgrm: Local Oversight Program UST
Oversight Prgrm: LOP
Review Date: 6/20/1995
Stop Date: 12/14/1993
Work Suspended: N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T08001D00670
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mtbe Fuel: 0
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 6975.0184415524909946682883316
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

LUST Region 2:

Region: 2
Facility Id: 01-0726
Entered Date: 04/27/1993
Facility Status: Signed off, remedial action completed or deemed unnecessary
Maximum Soil Concentration: 1800
Maximum Groundwater Impact: 0
County: Alameda
Current Benzene: Not reported
MTBE Detected In GW: No
MTBE Detected In Soil: Not reported
MTBE: 0
MTBE Qualify: Not reported

UST San Francisco County:

Facility ID: 3932	Case Number: Not reported
Tank ID: Not reported	Tank Capacity: Not reported
Manufacturer: Not reported	Date Installed: Not reported
Other Interior Lining: Not reported	Close Date: 4/6/00 0:00:00
Receive Date: 3/28/00 0:00:00	
Owner Name: Not reported	
Certified Date: 10/4/00 0:00:00	
Flag: CLOSED	
Other Corrosion Protection: Not reported	
Drop Tube: Not reported	
Striker Plate: Not reported	
Contents A: Not reported	
Contents B: Not reported	
Contents C: Not reported	
Mailing Name: Not reported	
Mailing Address: Not reported	

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

PRIVATE RESIDENCE (Continued)

Other Substance: Not reported
Tank Construction Type: Not reported
Tank Material: Not reported
Interior Lining: Not reported
Corrosion Protection: Not reported
Spill Contamination Installed Date: Not reported
Overfill Prevention Installed Date: Not reported
Piping Type: Not reported
Piping Aboveground: Not reported
Piping Underground: Not reported
Piping Construction: Not reported
Piping Construction Aboveground: Not reported
Piping Construction Underground: Not reported
Piping Material: Not reported
Other Piping Material: Not reported
Piping Material Aboveground: Not reported
Piping Material Underground: Not reported
Pipe Leak Detection: Not reported
Estimated Last Date Used: Not reported
Estimated Quantity Remaining: Not reported
Inert Filling: Not reported
Jurisdiction: Not reported
Other Tank System: Not reported
Other Tank Leak Detection: Not reported
Other Pipe Leak Detection: Not reported
Methanol Compatible: Not reported

U003713265

C11 COPPER AND BRASS SALES INC.
WSW 1295 87TH ST
< 1/8 EMERYVILLE, CA 94608
426 ft.
Higher

Site 3 of 11 In cluster C

UST HIST:
Facility ID: 53963
Tank Num: 1 Container Num: 2000
Tank Capacity: 2000 Year Installed: 1974
Tank Used for: PRODUCT
Type of Fuel: DIESEL Tank Construction: 3/16 inches
Leak Detection: None
Contact Name: LANCE E. HADSELL Telephone: (415) 858-7212
Total Tanks: 1 Region: STATE
Facility Type: 2 Other Type: METAL DIST.

HIST UST U001599265
N/A

C12 COPPER AND BRASS SALES INC.
WSW 1295 87TH BT
< 1/8 EMERYVILLE, CA 94608
426 ft.
Higher

Site 4 of 11 In cluster C

LUST Alameda County:
Region: ALAMEDA
Facility ID: R00000963

LUST B101624419
CA FID UST N/A

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

D13 LIQUID SUGARS INC

SSW 1266 86TH ST
< 1/8
500 ft.
Higher

Site 1 of 7 In cluster D

HAZNET:
Gepid: CAL000056918
Tepid: CAT080011059
Gen County: 1
Tsd County: Los Angeles
Tons: .2293
Category: Unspecified oil-containing waste
Disposal Method: Recycler
Contact: LIQUID SUGARS INC
Telephone: (000) 000-0000
Mailing Address: 1266 86TH ST
EMERYVILLE, CA 94608 - 1117
County 1
Gepid: CAL000056918
Tepid: Not reported
Gen County: 1
Tsd County: 0
Tons: .0000
Category: Asbestos-containing waste
Disposal Method: Not reported
Contact: LIQUID SUGARS INC
Telephone: (000) 000-0000
Mailing Address: 1266 86TH ST
EMERYVILLE, CA 94608 - 1117
County 1
Gepid: CAL000056918
Tepid: CAT080014079
Gen County: 1
Tsd County: 7
Tons: .0675
Category: Laboratory waste chemicals
Disposal Method: Not reported
Contact: LIQUID SUGARS INC
Telephone: (000) 000-0000
Mailing Address: 1266 86TH ST
EMERYVILLE, CA 94608 - 1117
County 1
Gepid: CAL000056918
Tepid: CAT080011059
Gen County: 1
Tsd County: Los Angeles
Tons: .1868
Category: Unspecified oil-containing waste
Disposal Method: Recycler
Contact: LIQUID SUGARS INC
Telephone: (000) 000-0000
Mailing Address: 1266 86TH ST
EMERYVILLE, CA 94608 - 1117
County 1

Map ID	MAP FINDINGS			Map ID	MAP FINDINGS		
Direction	Database(s)	EDR ID Number	EPA ID Number	Direction	Database(s)	EDR ID Number	EPA ID Number
Distance				Distance			
Distance (ft.)				Elevation			
Elevation	Site			Site			
LIQUID SUGARS INC (Continued)		8102813808		LIQUID SUGARS INC (Continued)		8102813808	
Gepaid:	CAL000056918			Approved Remediation Plan:		Not reported	
Tepaid:	CAT080011059			Begun Final Remedial Action:		Not reported	
Gen County:	1			Completed Final Remedial Action:		Not reported	
Tad County:	Los Angeles			Facility Desc:	Processing corn syrup and sugar products.		
Tons:	.2502			Comment:	PCE and TCE contaminations up to 11 and 0.65 ppm.		
Category:	Hydrocarbon solvents (benzene, hexane, Stoddard, etc.)						
Disposal Method:	Recycler						
Contact:	LIQUID SUGARS INC						
Telephone:	(000) 000-0000						
Mailing Address:	1266 66TH ST EMERYVILLE, CA 94608 - 1117						
County:	1						
The CA HAZNET database contains 7 additional records for this site. Please contact your EDR Account Executive for more information.							
SLIC Region 2:							
Facility ID:	01S0523						
Region:	2						
Facility Status:	Active		Not reported				
Staff:	BG		Not reported				
Last Site Update:	05/21/19						
NPL Status:	Not reported						
Case List:	SLIC						
Date Closed:	Not reported						
Abata Method:	Not reported						
Case Type:	NT						
Contamination:	Not determined.						
Lead:	RWQCB						
Contamination Level:							
Number of Municipal Wells Contaminated by Site:	0						
Number of Private Wells Contaminated by Site:	0						
Soil Removal Action Taken/Needed:	Not Determined						
Soil Removal or Contaminant Action Started:							
Soil Removal or Contaminant Action Completed:							
On-Site Groundwater Extraction or Containment is Needed:							
On-Site Groundwater Extraction or Containment Started:							
Off-Site Groundwater Extraction or Containment is Needed:							
Off-Site Groundwater Extraction or Containment Started:							
Length of Contamination Plume (Feet):	0						
Depth of Contamination Plume (Feet):	0						
Wells Closed Due To Contamination of Site:							
Date of Wells Closure:							
Nearest Public or Private Drinking Water Well (Feet):	0						
Under Jurisdiction of Lead Agency Date:							
Latitude/Longitude:	0 / 0						
Flow Rate:	0						
Flow Date:							
Percent of Contaminants Contained:	0						
Contaminant Type:	GW						
EPA ID:							
Stages of Site Investigation Process Initiated:							
Begun Characterization:	Not reported						
Completed Characterization:	Not reported						
Begun Remediation:	Not reported						
Completed Remediation:	Not reported						
Submitted Remediation Plan:	Not reported						

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance (ft.)		EPA ID Number	Distance (ft.)		EPA ID Number
Elevation	Site		Elevation	Site	
(Continued)		S100278802	AA JOHNSON & SON (Continued)		S102423617
Others Number Of Decontaminated :	0		GW Qualifies :	Not reported	
Others Number Of Injuries :	0		Max MTBE Sol :	Not reported	
Others Number Of Fatalities :	0		Soil Qualifies :	Not reported	
Vehicle Make/year :	Not reported		Hydr Basin #:	Not reported	
Vehicle License Number :	Not reported		Operator :	Not reported	
Vehicle State :	Not reported		Oversight Prgm:	Local Oversight Program UST	
Vehicle Id Number :	Not reported		Oversight Date :	7/17/1992	
CA/DOT/PUC/CC Number :	Not reported		Stop Date :	9/18/1991	
Company Name :	Not reported		Work Suspended N		
Reporting Officer Name/ID :	DAVID FLETCHER		Responsible Party:	BLANK RP	
Report Date :	17-JUN-91		RP Address:	Not reported	
Comments :	Ybs		Global Id:	T0800101593	
Facility Telephone Number :	415 273-3866		Org Name:	Not reported	
E16 AA JOHNSON & SON	LUST	S102423617	Contact Person:	Not reported	
SE 1164 86TH ST		N/A	MTBE Conc:	0	
< 1/8 OAKLAND, CA 94608			Mtbe Fuel:	1	
507 R.			Water System Name:	Not reported	
Higher Site 3 of 3 in cluster E			Well Name:	Not reported	
State LUST:			Distance To Lust:	6429.42533444550741453012071	
Cross Street:	Not reported		Waste Discharge Global ID:	Not reported	
City Leaked:	Not reported		Waste Ditch Assigned Name:	Not reported	
Case Number:	01-1722		LUST Region 2:		
Reg Board:	San Francisco Bay Region		Region:	2	
Chemical:	Gasoline		Facility Id:	01-1722	
Lead Agency:	Local Agency		Entered Date:	08/22/1993	
Local Agency :	01000		Facility Status:	Preliminary site assessment underway	
Case Type:	Undefined		Maximum Soil Concentration:	0	
Status:	Preliminary site assessment underway		Maximum Groundwater Impact:	0	
County:	Alameda		County :	Alameda	
Above Method:	Excavate and Dispose - remove contaminated soil and dispose in approved site. Excavate and Treat - remove contaminated soil and treat (includes spreading or land farming)		Current Benzene:	Not reported	
Review Date:	2/27/1998	Confirm Leak:	MTBE Detected in GW:	No	
Workplan:	1/2/1965	Prelim Assess:	MTBE Detected in Sol:	Not reported	
Pollution Char:	Not reported	Remed Plan:	MTBE:	0	
Remed Action:	Not reported	Monitoring:	MTBE Quality:	Not reported	
Close Date:	Not reported				
Release Date:	11/11/1991				
Cleanup Fund Id :	Not reported				
Discover Date :	9/18/1991				
Enforcement Dt :	Not reported				
Env Type:	Not reported				
Enter Date :	8/22/1993				
Funding:	Federal Funds				
Staff Initials:	UNK				
How Discovered:	Tank Closure				
How Stopped:	Close Tank				
Interim :	Yes				
Leak Cause:	Unknown				
Leak Source:	Unknown				
MTBE Data :	Not reported				
Max MTBE GW :	Not reported				
MTBE Tested:	Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.				
Priority:	Not reported				
Local Case # :	4248				
Beneficial:	Not reported				
Staff:	CTH				
C17 WSW < 1/8 515 R. Same					
GEO M MARTIN COMPANY 1308 87TH ST EMERYVILLE, CA 94608					
Site 8 of 11 in cluster C					
CORTESE Reg Id: 01-2191 Region: CORTESE Reg By: Leaking Underground Storage Tanks					
C18 WSW < 1/8 519 R. Same					
1X GEO M MARTIN COMPANY 1308 87TH STREET EMERYVILLE, CA 94608					
Site 9 of 11 in cluster C					
HAZNET S103627851 N/A					

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS				
Direction	Database(s)	EDR ID Number	Distance (ft.)	Elevation	Site	Database(s)	EDR ID Number	Distance (ft.)	Elevation	Site
C19 WSW < 1/8 515 ft. Same	HAZNET: Gepaid: CAC001074856 Tepaid: CAD009466392 Gen County: 1 Tsd County: 7 Tons: .3500 Category: Other empty containers 30 gallons or more Disposal Method: Recycler Contact: CORPORATION Telephone: (800) 000-0000 Mailing Address: 1250 67TH STREET EMERYVILLE, CA 94608 County 1 Gepaid: CAC001074856 Tepaid: CAL000046571 Gen County: 1 Tsd County: Santa Clara Tons: 2.7105 Category: Waste oil and mixed oil Disposal Method: Recycler Contact: CORPORATION Telephone: (800) 000-0000 Mailing Address: 1250 67TH STREET EMERYVILLE, CA 94608 County 1	S103627851			C20 WSW < 1/8 515 ft. Same	CHALLENGE MANUFACTURING CO. 1308 67TH ST OAKLAND, CA 94608 Site 8 of 11 in cluster C				LUST UST N/A
	HAZNET: Gepaid: CAL000106743 Tepaid: CAD000086252 Gen County: 1 Tsd County: Los Angeles Tons: .2293 Category: Oxygenated solvents (acetone, butanol, ethyl acetate, etc.) Disposal Method: Transfer Station Contact: ARTHUR SOUR & SONS Telephone: (318) 226-9332 Mailing Address: 1308 67TH ST EMERYVILLE, CA 94608 County 1 Gepaid: CAL000106743 Tepaid: NVD982358483 Gen County: 1 Tsd County: 99 Tons: .0625 Category: Unspecified oil-containing waste Disposal Method: Recycler Contact: ARTHUR SOUR & SONS Telephone: (318) 226-9332 Mailing Address: 1308 67TH ST EMERYVILLE, CA 94608 County 1	HAZNET S10366523 N/A			C21 WSW < 1/8 515 ft. Same	GEO M MARTIN COMPANY 1308 67TH ST EMERYVILLE, CA 94608 Site 9 of 11 in cluster C				LUST N/A
	State LUST: Cross Street: Not reported City Leaked: Not reported Case Number: 01-2191 Reg Board: San Francisco Bay Region Chemical: Diesel Lead Agency: Local Agency Local Agency: 01000 Case Type: Soil only Status: Preliminary site assessment underway County: Alameda Review Date: 11/11/1996 Workplan: 1/2/1985 Pollution Char: Not reported Remed Action: Not reported Close Date: Not reported Release Date: 10/1/1996 Cleanup Fund Id: Not reported Discover Date: 2/9/1996 Enforcement D: Not reported Enf Type: Not reported Enter Date: 11/11/1996 Funding: Federal Funds Staff Initials: UNK How Discovered: Tank Closure How Stopped: Remove Contents Interim: Not reported Leak Cause: Corrosion									

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

GEO M MARTIN COMPANY (Continued)

Leak Source: Tank
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Not Required to be Tested.
Priority:
Local Case #: 318
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgm: Local Oversight Program UST
Oversight Prgm: LOP
Review Date: 12/31/1997
Stop Date: 9/20/1996
Work Suspended N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T0600102013
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mtbe Fuel: 0
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 7091.7493449303943084484031632
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

LUST Region 2:

Region: 2
Facility Id: 01-2191
Entered Date: 11/11/1996
Facility Status: Preliminary site assessment underway
Maximum Soil Concentration: 3400
Maximum Groundwater Impact: 0
County: Alameda
Current Benzene: Not reported
MTBE Detected in GW: No
MTBE Detected in Soil: Not reported
MTBE: 0
MTBE Quality: Not reported

C22
WSW
< 1/8
515 ft.
Same
1308 6TH ST
EMERYVILLE, CA

Site 10 of 11 in cluster C

LUST Alameda County:
Region: ALAMEDA
Facility ID: R00000747

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

S102430709

Map ID
Direction
Distance
Distance (ft.)
Elevation Site
C23
WSW
< 1/8
515 ft.
Same

GOLDEN GATE DRAYAGE
175 DE HARO STREET
, CA

Site 11 of 11 in cluster C

UST San Francisco County:

Facility ID: 318
Tank ID: Not reported
Manufacturer: Not reported
Other Interior Lining: Not reported
Receive Date: 10/25/88 0:00:00
Owner Name: Not reported
Certified Date: Not reported
Flag: CLOSED
Other Corrosion Protection: Not reported
Drop Tube: Not reported
Strike Plate: Not reported
Contents A: Not reported
Contents B: Not reported
Contents C: Not reported
Mailing Name: Not reported
Mailing Address: Not reported
Other Substance: Not reported
Tank Construction Type: Not reported
Tank Material: Not reported
Interior Lining: Not reported
Corrosion Protection: Not reported
Spill Contamination Installed Date: Not reported
Overflow Prevention Installed Date: Not reported
Piping Type: Not reported
Piping Aboveground: Not reported
Piping Underground: Not reported
Piping Construction: Not reported
Piping Construction Aboveground: Not reported
Piping Construction Underground: Not reported
Piping Material: Not reported
Other Piping Material: Not reported
Piping Material Aboveground: Not reported
Piping Material Underground: Not reported
Pipe Leak Detection: Not reported
Estimated Last Date Used: Not reported
Estimated Quantity Remaining: Not reported
Inert Filling: Not reported
Jurisdiction: Not reported
Other Tank System: Not reported
Other Tank Leak Detection: Not reported
Other Pipe Leak Detection: Not reported
Methanol Compatible: Not reported

Case Number: Not reported
Tank Capacity: Not reported
Date Installed: Not reported
Close Date: 11/16/88 0:00:00
Dispenser: Not reported

UST U003802272
N/A

LUST S105483404
N/A

D24
SSW
< 1/8
536 ft.
Higher

CALAG PRODUCTS, INC.
1215 6TH ST
EMERYVILLE, CA 94608

Site 2 of 7 in cluster D

UST HIST:
Facility ID: 53253
Tank Num: 1
Tank Capacity: 2000
Tank Used for: PRODUCT

Container Num: 7
Year Installed: Not reported

HIST UST U001599256
N/A

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

CALAG PRODUCTS, INC. (Continued)

U001599258

Type of Fuel: REGULAR
Leak Detection: Stock Inventor
Contact Name: R. MOONEY
Total Tanks: 3
Facility Type: 2

Facility ID: 53253
Tank Num: 2
Tank Capacity: 10000
Tank Used for: PRODUCT
Type of Fuel: DIESEL
Leak Detection: Stock Inventor
Contact Name: R. MOONEY
Total Tanks: 3
Facility Type: 2

Facility ID: 53253
Tank Num: 3
Tank Capacity: 2000
Tank Used for: PRODUCT
Type of Fuel: REGULAR
Leak Detection: Stock Inventor
Contact Name: R. MOONEY
Total Tanks: 3
Facility Type: 2

Tank Construction: 1/4 inches
Telephone: (415) 420-7181
Region: STATE
Other Type: Not reported

Container Num: 2
Year Installed: Not reported

Tank Construction: 1/4 inches

Telephone: (415) 420-7181
Region: STATE
Other Type: Not reported

Container Num: 3
Year Installed: Not reported

Tank Construction: 1/4 inches

Telephone: (415) 420-7181
Region: STATE
Other Type: Not reported

D25 LIQUID SUGAR
SSW 1275 66TH ST
< 1/8 EMERYVILLE, CA 94608
536 ft.
Higher

Site 3 of 7 in cluster D

State LUST:
Cross Street: Not reported
Qty Leaked: Not reported
Case Number: 01-0917
Reg Board: San Francisco Bay Region
Chemical: Diesel
Lead Agency: Local Agency
Local Agency: D1000
Case Type: Other ground water affected
Status: Signed off, remedial action completed or deemed unnecessary
County: Alameda
Abate Method: No Action Taken - no action has as yet been taken at the site
Review Date: Not reported Confirm Leak: Not reported
Workplan: 1/26/1991 Prelim Assess: 1/26/1991
Pollution Char: Not reported Remed Plan: Not reported
Remed Action: Not reported Monitoring: Not reported
Close Date: 9/7/2001
Release Date: 1/25/1991
Cleanup Fund Id: Not reported
Discover Date: 1/25/1991
Enforcement Dt: Not reported
Enf Type: Not reported
Enter Date: 2/19/1991
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank

LUST S101293468
N/A

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

LIQUID SUGAR (Continued)

S101293468

Interim: No
Leak Cause: Structure Failure
Leak Source: Tank
MTBE Date: 1/2/1995
Max MTBE GW: 40
MTBE Tested: MTBE Detected. Site tested for MTBE & MTBE detected
Priority: Not reported
Local Case #: 537
Beneficiar: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Sol: 1
Soil Qualifies: <
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgrm: Local Oversight Program UST
Oversight Prgrm: LOP
Review Date: 8/30/2001
Stop Date: 1/25/1991
Work Suspended: N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T0800100842
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 2
Mtrb Fuel: 0
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 7127.4786841486501061886165724
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

D26 THE DOW CHEMICAL COMPANY
SSW 305 CRENSHAW BLVD
< 1/8 , CA
536 ft.
Higher

UST U003802218
N/A

Site 4 of 7 in cluster D

UST San Francisco County:
Facility ID: 537
Tank ID: Not reported
Manufacturer: Not reported
Other Interior Lining: Not reported
Receive Date: 3/16/86 0:00:00
Owner Name: Not reported
Certified Date: Not reported
Flag: CLOSED
Other Corrosion Protection: Not reported
Drop Tube: Not reported
Striker Plate: Not reported
Contents A: Not reported
Contents B: Not reported
Contents C: Not reported
Mailing Name: Not reported
Mailing Address: Not reported
Other Substance: Not reported
Tank Construction Type: Not reported
Tank Material: Not reported

Map ID Direction Distance Distance (ft.) Elevation	Site	MAP FINDINGS		Map ID Direction Distance Distance (ft.) Elevation	Site	MAP FINDINGS	
		Database(s)	EDR ID Number EPA ID Number			Database(s)	EDR ID Number EPA ID Number
THE DOW CHEMICAL COMPANY (Continued)			U003802216	F28 WSW < 1/8 568 ft. Lower	AALBORG CISERV SAN FRANCISCO 1315 67TH STREET EMERYVILLE, CA 94600 Site 1 of 3 in cluster F		HAZNET 5102813655 N/A
Interior Lining:	Not reported			HAZNET: Gepaid: CAL000056003 Tepaid: NVT330010000 Gen County: 1 Tsd County: 99 Tons: 1.2642 Category: Unspecified oil-containing waste Disposal Method: Not reported Contact: Not reported Telephone: (000) 000-0000 Mailing Address: 1315 67TH STREET EMERYVILLE, CA 94600 County 1			
Corrosion Protection:	Not reported			F30 WSW < 1/8 568 ft. Lower	AALBORG CISERV 1315 67TH ST EMERYVILLE, CA 94608 Site 2 of 3 in cluster F		RCRIS-SQG 1000595771 FINDS CAD983597261
Spill Contamination Installed Date:	Not reported			RCRIS: Owner: CISERV SAN FRANCISCO (415) 555-1212 EPA ID: CAD983597261 Contact: ROBERT MCLAREN (415) 555-7377 Classification: Small Quantity Generator Used Oil Recyc: No TSDF Activities: Not reported Violation Status: No violations found			
Overflow Prevention Installed Date:	Not reported				FINDS: Other Pertinent Environmental Activity Identified at Site: Facility Registry System (FRS) Resource Conservation and Recovery Act Information system (RCRAINFO)		
Piping Type:	Not reported						
Piping Aboveground:	Not reported						
Piping Underground:	Not reported						
Piping Construction:	Not reported						
Piping Construction Aboveground:	Not reported						
Piping Construction Underground:	Not reported						
Piping Material:	Not reported						
Other Piping Material:	Not reported						
Piping Material Aboveground:	Not reported						
Piping Material Underground:	Not reported						
Pipe Leak Detection:	Not reported						
Estimated Last Date Used:	Not reported						
Estimated Quantity Remaining:	Not reported						
Inert Filling:	Not reported						
Jurisdiction:	Not reported						
Other Tank System:	Not reported						
Other Tank Leak Detection:	Not reported						
Other Pipe Leak Detection:	Not reported						
Methanol Compatible:	Not reported						
UST TORRANCE:							
Facility ID:	537						
Facility Status:	Inactive						
D27 SSW < 1/8 536 ft. Higher	1275 66TH ST EMERYVILLE, CA	LUST	S105482985 N/A	D31 SW < 1/8 580 ft. Higher	PRAXIS PRODUCT DESIGN INC 1285 66TH ST EMERYVILLE, CA 94608 Site 7 of 7 in cluster D	HAZNET S105083893 N/A	
	Site 5 of 7 in cluster D				HAZNET: Gepaid: CAC002215281 Tepaid: CAD982042475 Gen County: 1 Tsd County: Solano Tons: 16.856 Category: Asbestos-containing waste Disposal Method: Disposal, Land Fill Contact: L.S.I LIQUID SUGARS INT'L Telephone: (510) 777-4711 Mailing Address: 7801 EDGEWATER DR OAKLAND, CA 94521 County 1		
D28 SSW < 1/8 545 ft. Higher	L.S.I LIQUID SUGARS INTERNATIONAL 1277 66TH ST EMERYVILLE, CA 94608 Site 6 of 7 in cluster D	HAZNET	S104572113 N/A		HAZNET: Gepaid: CAC001479712 Tepaid: CAD982042475 Gen County: 1 Tsd County: Solano Tons: 18.5416 Category: Asbestos-containing waste Disposal Method: Disposal, Land Fill Contact: PRAXIS PRODUCT DESIGN INC Telephone: (650) 345-1555		

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction			Direction		
Distance			Distance (ft.)		
Distance (ft.)			Elevation	Site	
Elevation	Site		Database(s)	EDR ID Number	EPA ID Number
PRAKIS PRODUCT DESIGN INC (Continued)			S105083893		
Mailing Address: 730 POLHEMUS RD SAN MATEO, CA 94402					
County 1					
G32 ENE < 1/8 585 ft. Higher	ORIENTAL WAREHOUSE 600 01ST STREET , CA		UST U003650349 N/A	H34 SW < 1/8 585 ft. Higher	BACCHUS PRESS INC 1287 68TH ST EMERYVILLE, CA 94608
	Sites 1 of 3 in cluster G				HAZNET S100930389 N/A
UST San Francisco County:					
Facility ID: 1694		Case Number: Not reported			
Tank ID: Not reported		Tank Capacity: Not reported			
Manufacturer: Not reported		Date Installed: Not reported			
Other Interior Lining:	Not reported				
Receive Date: 5/9/94 0:00:00		Close Date: 5/26/94 0:00:00			
Owner Name: Not reported					
Certified Date: Not reported					
Flag: CLOSED					
Other Corrosion Protection:	Not reported				
Drop Tube: Not reported					
Striker Plate: Not reported					
Content A: Not reported		Dispenser: Not reported			
Content B: Not reported					
Contents C: Not reported					
Mailing Name: Not reported					
Mailing Address: Not reported					
Other Substance: Not reported					
Tank Construction Type:	Not reported				
Tank Material:	Not reported				
Interior Lining:	Not reported				
Corrosion Protection:	Not reported				
Spill Contamination Installed Date:	Not reported				
Overflow Prevention Installed Date:	Not reported				
Piping Type:	Not reported				
Piping Aboveground:	Not reported				
Piping Underground:	Not reported				
Piping Construction:	Not reported				
Piping Construction Aboveground:	Not reported				
Piping Construction Underground:	Not reported				
Piping Material:	Not reported				
Other Piping Material:	Not reported				
Piping Material Aboveground:	Not reported				
Piping Material Underground:	Not reported				
Pipe Leak Detection:	Not reported				
Estimated Last Date Used:	Not reported				
Estimated Quantity Remaining:	Not reported				
Inert Filing:	Not reported				
Jurisdiction:	Not reported				
Other Tank System:	Not reported				
Other Tank Leak Detection:	Not reported				
Other Pipe Leak Detection:	Not reported				
Methanol Compatible:	Not reported				
G33 ENE < 1/8 585 ft. Higher	ST. FRANCIS PIE SHOP 1125 68TH ST EMERYVILLE, CA 94608		UST U003805073 N/A		
	Sites 2 of 3 in cluster G				

Map ID Direction Distance Distance (ft.) Elevation Site	MAP FINDINGS		Map ID Direction Distance Distance (ft.) Elevation Site	MAP FINDINGS	
	Database(s)	EDR ID Number EPA ID Number		Database(s)	EDR ID Number EPA ID Number
BACCHUS PRESS INC (Continued)					
		S100030389			8100030514
Gepaid: CAL922484140 Tepaid: CAT000813976 Gen County: 1 Tsd County: Orange Tons: .0417 Category: Photochemicals/photoprocessing waste Disposal Method: Not reported Contact: MANSOOR ASSADI Telephone: (510) 482-5373 Mailing Address: 1287 66TH ST EMERYVILLE, CA 94608 - 1116 County 1					
Gepaid: CAL922484140 Tepaid: CAD053044053 Gen County: 1 Tsd County: 1 Tons: .1417 Category: Liquids with halogenated organic compounds > 1000 mg/l Disposal Method: Transfer Station Contact: MANSOOR ASSADI Telephone: (510) 482-5373 Mailing Address: 1287 66TH ST EMERYVILLE, CA 94608 - 1116 County 1					
The CA HAZNET database contains 8 additional records for this site. Please contact your EDR Account Executive for more information.					
H35 SW < 1/8 585 ft. Higher	BACCHUS PRESS 1287 66TH ST EMERYVILLE, CA 94608 Site 2 of 4 in cluster H	RCRIS-SQG FINDS	1000136401 CAD085335354	HAZNET	CAL922892642 CAL000121946 Gen County: 1 Tsd County: Marin Tons: .1878 Category: Photochemicals/photoprocessing waste Disposal Method: Recycler Contact: GENE FARB Telephone: (000) 000-0000 Mailing Address: 1321 67TH STREET EMERYVILLE, CA 94608 County 1
	RCRIS: Owner: MANSOOR ASSADI (510) 420-5800 EPA ID: CAD085335354 Contact: ENVIRONMENTAL MANAGER (415) 653-8633 Classification: Small Quantity Generator Used Oil Recyc: No TSDF Activities: Not reported Violation Status: No violations found	FINDS:	Other Pertinent Environmental Activity Identified at Site: Facility Registry System [FRS] Resource Conservation and Recovery Act Information system (RCRAINFO)	Gepaid: CAL922892642 Tepaid: CAD085335354 Gen County: 1 Tsd County: Marin Tons: .5629 Category: Photochemicals/photoprocessing waste Disposal Method: Recycler Contact: GENE FARB Telephone: (000) 000-0000 Mailing Address: 1321 67TH STREET EMERYVILLE, CA 94608 County 1	
F36 WSW < 1/8 608 ft. Lower	BASIC LIVING PRODUCTS 1321 67TH STREET EMERYVILLE, CA 94608 Site 3 of 3 in cluster F	HAZNET	S100030514 N/A	Gepaid: CAL922892642 Tepaid: CAD085335354 Gen County: 1 Tsd County: Marin Tons: .5004 Category: Photochemicals/photoprocessing waste Disposal Method: Recycler Contact: GENE FARB Telephone: (000) 000-0000 Mailing Address: 1321 67TH STREET EMERYVILLE, CA 94608 County 1	

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

BASIC LIVING PRODUCTS (Continued)

S100930514

Gepaid: CAL922892842
Tepaid: CAD9811B1367
Gen County: 1
Tad County: Marin
Tons: .1876
Category: Photochemicals/photoprocessing waste
Disposal Method: Not reported
Contact: GENE FARB
Telephone: (000) 000-0000
Mailing Address: 1321 87TH STREET
EMERYVILLE, CA 94606
County: 1

The CA HAZNET database contains 3 additional records for this site.
Please contact your EDR Account Executive for more information.

I37 FOLGER MURPHY PROPERTY
NNW 1020 MURRAY ST
< 1/8 BERKELEY, CA
611 ft.
Higher Site 1 of 3 in cluster I

State LUST:
Cross Street: Not reported
City Leaked: Not reported
Case Number: 01-0648
Reg Board: San Francisco Bay Region
Chemical: Gasoline
Lead Agency: Local Agency
Local Agency: D1020
Case Type: Soil only
Status: Signed off, remedial action completed or deemed unnecessary
County: Alameda
Abate Method: No Action Taken - no action has as yet been taken at the site
Review Date: Not reported Confirm Leak: Not reported
Workplan: Not reported Prelim Assess: Not reported
Pollution Char: Not reported Remed Plan: Not reported
Remed Action: Not reported Monitoring: Not reported
Close Date: 1/11/1995
Release Date: 10/3/1988
Cleanup Fund Id: Not reported
Discover Date: 10/3/1988
Enforcement Dt: Not reported
Env Type: Not reported
Enter Date: 10/3/1988
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank
Interim: No
Leak Cause: Structure Failure
Leak Source: Tank
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.
Priority: Not reported
Local Case #: 01-0648
Beneficial: Not reported

LUST S101306319
Cortese N/A

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

S101306319

FOLGER MURPHY PROPERTY (Continued)

Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgm: Local Implementing Agency UST (Includes non-LOP cases within LOP jurisdiction)
Oversight Prgm: LIA
Review Date: 1/11/1995
Stop Date: 10/3/1988
Work Suspended: N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: TD600100598
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mibe Fuel: 1
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 6055.9684329000885368048930812
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

LUST Region 2:
Region: 2
Facility Id: 01-0648
Entered Date: 10/03/1988
Facility Status: Signed off, remedial action completed or deemed unnecessary
Maximum Soil Concentration: 1500
Maximum Groundwater Impact: 0
County: Alameda
Current Benzene: Not reported
MTBE Detected in GW: No
MTBE Detected in Soil: Not reported
MTBE: 0
MTBE Qualify: Not reported

CORTESE:
Reg Id: 01-0648
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

I38
North
< 1/8
617 ft.
Higher

Site 2 of 3 in cluster I

HAZNET:
Gepaid: CAL000111728
Tepaid: CAD009452657
Gen County: 1
Tad County: San Mateo
Tons: .2293
Category: Liquids with lead > 500 mg/l
Disposal Method: Disposal, Other
Contact: MR AGRESS
Telephone: (000) 000-0000

HAZNET S100930697
N/A

		MAP FINDINGS				MAP FINDINGS	
Map ID Direction Distance Distance (ft.) Elevation	Site	Database(s)	EDR ID Number EPA ID Number	Map ID Direction Distance Distance (ft.) Elevation	Site	Database(s)	EDR ID Number EPA ID Number
BERKELEY MILL & FURNITURE (Continued)			S100630697	TABS TOMMOROW (Continued)			B105092060
Mailing Address: 1806 4TH ST BERKELEY, CA 94710 County 1				HAZNET: Gepaid: CAL000204749 Tepaid: CA0000084517 Gen County: 1 Tad County: Sacramento Tons: .1251 Category: Photochemicals/photoprocessing waste Disposal Method: Transfer Station Contact: HOANG(DORIAN) TRAN Telephone: (510) 841-0775 Mailing Address: 1050 MURRAY ST BERKELEY, CA 94710 County 1			
G39 ENE < 1/8 619 ft. Higher	UC BERKELEY MERCHANT 6701 SAN PABLO AVE UNIT 5602 OAKLAND, CA 94608	RCRIS-LQG	1001967427 CAR000066916	J42 NNE 1/8-1/4 578 ft. Higher	ABMS INC 1052 MURRAY BERKELEY, CA 94709	RCRIS-SQG	1000376316 FINDS CAD981168826
RCRIS: Owner: REGENTS OF THE UNIV OF CALIF (510) 642-3073 EPA ID: CAR000066916 Contact: ENVIRONMENTAL MANAGER Classification: Large Quantity Generator Used Oil Recyc: No TSDF Activities: Not reported BIENNIAL REPORTS: Last Biennial Reporting Year: 1999 Waste Quantity (Lbs) D008 39154.00 Violation Status: No violations found				Site 2 of 2 in cluster J			
I40 North < 1/8 627 ft. Higher	BERKELEY MILL AND FURNITURE 1034 MURRAY ST BERKELEY, CA 94710	HAZNET	S103621013 N/A	RCRIS: Owner: MARCELLO BARBERO (415) 555-1212 EPA ID: CAD981168826 Contact: ENVIRONMENTAL MANAGER (415) 841-8385 Classification: Small Quantity Generator Used Oil Recyc: No TSDF Activities: Not reported Violation Status: No violations found			
	Site 3 of 3 in cluster I			FINDS: Other Pertinent Environmental Activity Identified at Site: Facility Registry System (FRS) Resource Conservation and Recovery Act Information system (RCRAINFO)			
J41 North 1/8-1/4 674 ft. Higher	TABS TOMMOROW 1050 MURRAY ST BERKELEY, CA 94710	HAZNET	S105092060 N/A	H43 SW 1/8-1/4 888 ft. Lower	KNOPP INC 1307 68TH ST EMERYVILLE, CA 94608	RCRIS-SQG	1000349371 FINDS CAD982010597
	Site 1 of 2 in cluster J			Site 3 of 4 in cluster H			
				RCRIS: Owner: ALEX FINLAY (415) 555-1212 EPA ID: CAD982010597 Contact: ENVIRONMENTAL MANAGER (415) 853-1661 Classification: Small Quantity Generator Used Oil Recyc: No TSDF Activities: Not reported			

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

KNOPP INC (Continued)

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:
Facility Registry System (FRS)
Resource Conservation and Recovery Act Information system (RCRAINFO)

H44 CONVERSION TECHNIQUES
SW 1309 86TH ST
1/8-1/4 EMERYVILLE, CA 94608
696 ft.
Lower Site 4 of 4 in cluster H

RCRIS:

Owner: JOHN SIAU
(415) 555-1212
EPA ID: CAD982027872

Contact: ENVIRONMENTAL MANAGER
(415) 654-9292

Classification: Small Quantity Generator
Used Oil Recyc: No
TSDF Activities: Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:
Facility Registry System (FRS)
Resource Conservation and Recovery Act Information system (RCRAINFO)

HAZNET:

Gepaid: CAD982027872
Tepaid: CAT000613893
Gen County: 1
Tsd County: Los Angeles
Tons: .0270
Category: Oxygenated solvents (acetone, butanol, ethyl acetate, etc.)
Disposal Method: Not reported

Contact: Not reported
Telephone: (000) 000-0000
Mailing Address: 1309 86TH ST

EMERYVILLE, CA 94608 - 1116
County 1

Gepaid: CAD982027872
Tepaid: CAT000613893
Gen County: 1
Tsd County: Los Angeles
Tons: .1380
Category: Oxygenated solvents (acetone, butanol, ethyl acetate, etc.)
Disposal Method: Transfer Station

Contact: Not reported
Telephone: (000) 000-0000
Mailing Address: 1309 86TH ST

EMERYVILLE, CA 94608 - 1116
County 1

Database(s) EDR ID Number
EPA ID Number

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

CONVERSION TECHNIQUES (Continued)

1000431872

Gepaid: CAD982027872
Tepaid: CAT000613950
Gen County: 1
Tsd County: Sacramento
Tons: .0900
Category: Oxygenated solvents (acetone, butanol, ethyl acetate, etc.)
Disposal Method: Transfer Station

Contact: Not reported
Telephone: (000) 000-0000
Mailing Address: 1309 86TH ST
EMERYVILLE, CA 94608 - 1116
County 1

Gepaid: CAD982027872
Tepaid: CAT000613950
Gen County: 1
Tsd County: Sacramento
Tons: .0180
Category: Oxygenated solvents (acetone, butanol, ethyl acetate, etc.)
Disposal Method: Transfer Station

Contact: Not reported
Telephone: (000) 000-0000
Mailing Address: 1309 86TH ST
EMERYVILLE, CA 94608 - 1116
County 1

Gepaid: CAD982027872
Tepaid: CA0000084517
Gen County: 1
Tsd County: Sacramento
Tons: .2540
Category: Oxygenated solvents (acetone, butanol, ethyl acetate, etc.)
Disposal Method: Transfer Station

Contact: Not reported
Telephone: (000) 000-0000
Mailing Address: 1309 86TH ST
EMERYVILLE, CA 94608 - 1116
County 1

The CA HAZNET database contains 8 additional records for this site.
Please contact your EDR Account Executive for more information.

K45 ADVANCED GENETIC SCIENCES

6701 SAN PABLO AVE
OAKLAND, CA 94608

East
1/8-1/4
745 ft.
Higher Site 1 of 3 in cluster K

RCRIS-SQG 1000151477
FINDS CAD981451046

Map ID Direction Distance Distance (ft.) Elevation	Site	MAP FINDINGS		Database(s)	EDR ID Number EPA ID Number	Map ID Direction Distance Distance (ft.) Elevation	Site	MAP FINDINGS		Database(s)	EDR ID Number EPA ID Number
ADVANCED GENETIC SCIENCES (Continued)				1000151477		DNA PLANT TECHNOLOGY (Continued)					S103668727
RCRIS:						Gepid:	CAD981451040				
Owner:	ADVANCED GENETIC SCIENCES					Tepid:	CAD008252405				
(415) 555-1212						Gen County:	1				
EPA ID:	CAD981451040					Tsd County:	Los Angeles				
Contact:	ENVIRONMENTAL MANAGER					Tons:	.1251				
(415) 547-2395						Category:	Laboratory waste chemicals				
Classification:	Small Quantity Generator					Disposal Method:	Recycler				
Used Oil Recyc:	No					Contact:	DNA PLANT TECHNOLOGY				
TSDF Activities:	Not reported					Telephone:	(510) 450-9304				
Violation Status:	No violations found					Mailing Address:	6701 SAN PABLO AVE				
FINDS:						EMERYVILLE, CA 94608 - 1239					
Other Pertinent Environmental Activity Identified at Site:						County	1				
Facility Registry System (FRS)											
Resource Conservation and Recovery Act Information system (RCRAINFO)											
K48 DNA PLANT TECHNOLOGY		HAZNET	S103668727			K47	FIVE PRIME THERAPEUTICS INC				
East 6701 SAN PABLO AVE			N/A			East	6701 SAN PABLO AVE				
1/8-1/4 OAKLAND, CA 94608						1/8-1/4	OAKLAND, CA 94608				
745 ft.						745 ft.					
Higher Site 2 of 3 in cluster K						Higher	Site 3 of 3 in cluster K				
HAZNET:											
Gepid:	CAD981451040										
Tepid:	CAT080022148										
Gen County:	1										
Tsd County:	San Bernardino										
Tons:	0.0125										
Category:	Other organic solids										
Disposal Method:	Transfer Station										
Contact:	DNA PLANT TECHNOLOGY										
Telephone:	(510) 450-9304										
Mailing Address:	6701 SAN PABLO AVE										
EMERYVILLE, CA 94608 - 1239											
County	1										
Gepid:	CAD981451040					L48	OLIVER LOFTS				
Tepid:	CAD044429835					SSE	1200 65TH ST				
Gen County:	1					1/8-1/4	EMERYVILLE, CA 94608				
Tsd County:	Los Angeles					768 ft.					
Tons:	.3125					Higher	Site 1 of 2 in cluster L				
Category:	Laboratory waste chemicals										
Disposal Method:	Disposal, Other										
Contact:	DNA PLANT TECHNOLOGY										
Telephone:	(510) 450-9304										
Mailing Address:	6701 SAN PABLO AVE										
EMERYVILLE, CA 94608 - 1239											
County	1										
FINDS	1000921885										
HAZNET	CAD008113473										
LUST											
Cortesa											
RCRIS-LQG											
UST											
CA SLIC											
CA FID UST											
HIST UST											
FTTS											
FTTS Insp:											
Region:	08										
Inspected Date:	08/31/90										
Insp Number:	08/31/90										
Violation occurred:	Yes										
Inspector:	CZAJKOWSKI										
Investigation Type:	Section 6 PCB Federal Conducted										
Facility Function:	User										
Investig Reason:	Neutral Scheme, Region										
Legislation Code:	TSCA										

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance		EPA ID Number	Distance (ft.)		EPA ID Number
Elevation	Site		Elevation	Site	
OLIVER LOFTS (Continued)		1000921585	OLIVER LOFTS (Continued)		1000921585
RCRIS:			HAZNET:		
Owner: OLIVER LOFTS L L C			Gepaid: CAC001217800		
(510) 548-4159			Tepaid: CAD009466392		
EPA ID: CAD009113473			Gen County: 1		
Contact: NICHOLAS HARALAMBIDES			Tsd County: 7		
(510) 548-4159			Tons: 1.0000		
Classification: Large Quantity Generator			Category: Other empty containers 30 gallons or more		
Used Oil Recyc: No			Disposal Method: Recycler		
TSDF Activities: Not reported			Contact: OLIVER RUBBER CO		
Violation Status: Violations exist			Telephone: (510) 654-7711		
Regulation Violated: Not reported			Mailing Address: 1200 65TH ST OAKLAND, CA 94662		
Area of Violation: GENERATOR-GENERAL REQUIREMENTS			County: 1		
Date Violation Determined: 01/16/1985			Gepaid: CAC001217800		
Actual Date Achieved Compliance: 11/14/1985			Tepaid: CAL000048571		
There are 1 violation record(s) reported at this site:			Gen County: 1		
Evaluation: Area of Violation: Date of Compliance:	Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	Tsd County: Santa Clara		
		19851114	Tons: 1.2510		
			Category: Waste oil and mixed oil		
FINDS:			Disposal Method: Recycler		
Other Pertinent Environmental Activity Identified at Site:			Contact: OLIVER RUBBER CO		
Enforcement Docket System (DOCKET)			Telephone: (510) 654-7711		
Facility Registry System (FRS)			Mailing Address: 1200 65TH ST OAKLAND, CA 94662		
National Compliance Database (NCDB)			County: 1		
National Emissions Trends (NET)			Gepaid: CAC002251521		
National Toxic Inventory (NTI)			Tepaid: CAD009466392		
Resource Conservation and Recovery Act Information system (RCRAINFO)			Gen County: 1		
Toxic Chemical Release Inventory System (TRIS)			Tsd County: 7		
LUST Region 2:			Tons: .7500		
Region: 2			Category: Other empty containers 30 gallons or more		
Facility Id: 01-1091			Disposal Method: Recycler		
Entered Date: 03/08/1985			Contact: OLIVE LOFTS LLC		
Facility Status: Signed off, remedial action completed or deemed unnecessary			Telephone: (510) 783-2163		
Maximum Soil Concentration: 1500			Mailing Address: 490 MANDARA BLVD #7 OAKLAND, CA 94610		
Maximum Groundwater Impact: 0			County: 1		
County: Alameda			Gepaid: CAC002251521		
Current Benzene: Not reported			Tepaid: CAL000161743		
MTBE Detected in GW: No			Gen County: 1		
MTBE Detected in Soil: Not reported			Tsd County: Santa Clara		
MTBE: 0			Tons: 3.8572		
MTBE Quality: Not reported			Category: Waste oil and mixed oil		
LUST Alameda County:			Disposal Method: Recycler		
Region : ALAMEDA			Contact: OLIVE LOFTS LLC		
Facility ID : RO0000608			Telephone: (510) 783-2163		
			Mailing Address: 490 MANDARA BLVD #7 OAKLAND, CA 94610		
			County: 1		
CORTESE:					
Reg Id: 01-1091					
Region: CORTESE					
Reg By: Leaking Underground Storage Tanks					

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS			
Direction	Database(s)	EDR ID Number	Elevation	Site	Direction	Database(s)	EDR ID Number	Elevation	Site
Distance (ft.)									
Elevation Site									
OLIVER LOFTS (Continued)		1000921585			OLIVER LOFTS (Continued)		1000921545		
FID:					Completed Final Remedial Action:				
Facility ID:	01001207	Regulate ID:	00050156		Facility Desc:	Not reported			
Reg By:	Active Underground Storage Tank Location	SIC Code:	Not reported		Comment:	010599 - NO FURTHER ACTION/COMFORT LETTER			
Contess Code:	Not reported	Facility Tel:	(415) 654-7711		UST HST:				
Status:	Active				Facility ID:	50156			
Mail To:	Not reported				Tank Num:	1	Container Num:	#1	
	1200 65TH ST				Tank Capacity:	5000	Year Installed:	1956	
	EMERYVILLE, CA 94608				Tank Used for:	PRODUCT			
Contact:	Not reported	Contact Tel:	Not reported		Type of Fuel:	Not Reported	Tank Construction:	1/4" Inches	
DUNs No:	Not reported	NPDES No:	Not reported		Leak Detection:	None			
Creation:	10/22/93	Modified:	00/00/00		Contact Name:	NEIL ARNOLD, MANUFACTURING MAN	Telephone:	(415) 654-7711	
EPA ID:	Not reported				Total Tanks:	5	Region:	STATE	
Comments:	Not reported				Facility Type:	2	Other Type:	RUBBER MANUFACTURER	
SLIC Region 2:					Facility ID:	50156			
Facility ID:	01S0069				Tank Num:	2	Container Num:	#2	
Region:	2				Tank Capacity:	5000	Year Installed:	1956	
Facility Status:	Inactive				Tank Used for:	PRODUCT			
Staff:	BG				Type of Fuel:	Not Reported	Tank Construction:	1/4 inches	
Last Site Update:	01/05/19				Leak Detection:	None			
NPL Status:	Not an NPL site	Discovery Date:	Not reported		Contact Name:	NEIL ARNOLD, MANUFACTURING MAN	Telephone:	(415) 654-7711	
Case List:	SLIC	Imaged:	No		Total Tanks:	5	Region:	STATE	
Dele Closed:	Not reported	Cost Recovery:	No		Facility Type:	2	Other Type:	RUBBER MANUFACTURER	
Abate Method:	Not reported	Substance:	Not reported		Facility ID:	50156			
Case Type:	NT	Sample Date:	Not reported		Tank Num:	3	Container Num:	#3	
Contamination:	Not reported				Tank Capacity:	5000	Year Installed:	1956	
Lead:	RWQCB				Tank Used for:	PRODUCT			
Contamination Level:					Type of Fuel:	Not Reported	Tank Construction:	1/4 inches	
Number of Municipal Wells Contaminated by Site:	0				Leak Detection:	None			
Number of Private Wells Contaminated by Site:	0				Contact Name:	NEIL ARNOLD, MANUFACTURING MAN	Telephone:	(415) 654-7711	
Soil Removal Action Taken/Needed:	0				Total Tanks:	5	Region:	STATE	
Soil Removal or Contaminant Action Started:					Facility Type:	2	Other Type:	RUBBER MANUFACTURER	
Soil Removal or Contaminant Action Completed:	0				Facility ID:	50156			
On-Site Groundwater Extraction or Containment is Needed:	0				Tank Num:	4	Container Num:	#4	
On-Site Groundwater Extraction or Containment Started:					Tank Capacity:	8000	Year Installed:	Not reported	
Off-Site Groundwater Extraction or Containment is Needed:					Tank Used for:	PRODUCT			
Off-Site Groundwater Extraction or Containment Started:					Type of Fuel:	Not Reported	Tank Construction:	1/4 inches	
Length of Contamination Plume (Feet):	0				Leak Detection:	None			
Depth of Contamination Plume (Feet):	0				Contact Name:	NEIL ARNOLD, MANUFACTURING MAN	Telephone:	(415) 654-7711	
Wells Closed Due To Contamination of Site:					Total Tanks:	5	Region:	STATE	
Date of Wells Closure:					Facility Type:	2	Other Type:	RUBBER MANUFACTURER	
Nearest Public or Private Drinking Water Well (Feet):	0				Facility ID:	50156			
Under Jurisdiction of Lead Agency Date:					Tank Num:	5	Container Num:	#5	
Latitude/Longitude:	38/-122				Tank Capacity:	5000	Year Installed:	Not reported	
Flow Rate:	0				Tank Used for:	PRODUCT			
Flow Date:					Type of Fuel:	REGULAR	Tank Construction:	Not reported	
Percent of Contaminants Contained:	0				Leak Detection:	None			
Contaminant Type:					Contact Name:	NEIL ARNOLD, MANUFACTURING MAN	Telephone:	(415) 654-7711	
EPA ID:					Total Tanks:	5	Region:	STATE	
Stages of Site Investigation Process Initiated:					Facility Type:	2	Other Type:	RUBBER MANUFACTURER	
Begin Characterization :		Not reported			Facility ID:	50156			
Completed Characterization :		Not reported			Tank Num:	5	Container Num:	#5	
Begin Remediation:		Not reported			Tank Capacity:	5000	Year Installed:	Not reported	
Completed Remediation:		Not reported			Tank Used for:	PRODUCT			
Submitted Remediation Plan:		Not reported			Type of Fuel:	REGULAR	Tank Construction:	Not reported	
Approved Remediation Plan:		Not reported			Leak Detection:	None			
Begin Final Remedial Action:		Not reported			Contact Name:	NEIL ARNOLD, MANUFACTURING MAN	Telephone:	(415) 654-7711	
					Total Tanks:	5	Region:	STATE	
					Facility Type:	2	Other Type:	RUBBER MANUFACTURER	
UST San Francisco County:					Facility ID:	1330	Case Number:	Not reported	
					Tank ID:	Not reported	Tank Capacity:	Not reported	

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS			
Direction					Direction				
Distance (ft.)					Distance (ft.)				
Elevation	Site				Elevation	Site			
Database(s)	EDR ID Number	EPA ID Number	Database(s)	EDR ID Number	EPA ID Number	Database(s)	EDR ID Number	EPA ID Number	Database(s)
OLIVER LOFTS (Continued)			1000921585			OLIVER RUBBER COMPANY (Continued)			1003061282
Manufacturer: Not reported			Date Installed: Not reported			County: 1			
Other Interior Lining: Not reported			Close Date: 8/11/93 0:00:00			Gepaid: CAD009113473			
Receive Date: 5/28/93 0:00:00						Tepaid: CAD009452657			
Owner Name: Not reported						Gen County: 1			
Certified Date: 7/8/93 0:00:00						Ted County: San Mateo			
Flag: CLOSED						Tons: 3,000			
Other Corrosion Protection: Not reported						Category: Other organic solids			
Drop Tube: Not reported						Disposal Method: Treatment, Incineration			
Striker Plate: Not reported						Contact: THE STANDARD PRODUCTS COMPANY			
Contents A: Not reported			Dispenser: Not reported			Telephone: (810) 299-7798			
Contents B: Not reported						Mailing Address: 165 DOUGHERTY STREET			
Contents C: Not reported						ATHENS, GA 30601 - 1111			
Mailing Name: Not reported						County: 1			
Mailing Address: Not reported						Gepaid: CAD009113473			
Other Substance: Not reported						Tepaid: CAD980887418			
Tank Construction Type: Not reported						Gen County: 1			
Tank Material: Not reported						Ted County: 1			
Interior Lining: Not reported						Tons: .4170			
Corrosion Protection: Not reported						Category: Waste oil and mixed oil			
Spill Contamination Installed Date: Not reported						Disposal Method: Recycler			
Overflow Prevention Installed Date: Not reported						Contact: THE STANDARD PRODUCTS COMPANY			
Piping Type: Not reported						Telephone: (810) 299-7798			
Piping Aboveground: Not reported						Mailing Address: 165 DOUGHERTY STREET			
Piping Underground: Not reported						ATHENS, GA 30601 - 1111			
Piping Construction: Not reported						County: 1			
Piping Construction Aboveground: Not reported						Gepaid: CAD009113473			
Piping Construction Underground: Not reported						Tepaid: CAD028409019			
Piping Material: Not reported						Gen County: 1			
Other Piping Material: Not reported						Ted County: Los Angeles			
Piping Material Aboveground: Not reported						Tons: .2085			
Piping Material Underground: Not reported						Category: Unspecified oil-containing waste			
Pipe Leak Detection: Not reported						Disposal Method: Transfer Station			
Estimated Last Date Used: Not reported						Contact: THE STANDARD PRODUCTS COMPANY			
Estimated Quantity Remaining: Not reported						Telephone: (810) 299-7798			
Inert Filing: Not reported						Mailing Address: 165 DOUGHERTY STREET			
Jurisdiction: Not reported						ATHENS, GA 30601 - 1111			
Other Tank System: Not reported						County: 1			
Other Tank Leak Detection: Not reported						Gepaid: CAD009113473			
Other Pipe Leak Detection: Not reported						Tepaid: CAD028409019			
Methanol Compatible: Not reported						Gen County: 1			
L49 OLIVER RUBBER COMPANY SSE 1200 65TH ST 1/8-1/4 OAKLAND, CA 94682 766 R. Higher Site 2 of 2 in cluster L	HAZNET	1003061282	N/A			Ted County: Los Angeles			
HAZNET: Gepaid: CAD009113473 Tepaid: AZD982465866 Gen County: 1 Ted County: 89 Tons: .7989 Category: Liquids with polychlorinated biphenyls > 50 mg/l Disposal Method: Treatment, incineration Contact: THE STANDARD PRODUCTS COMPANY Telephone: (810) 299-7798 Mailing Address: 165 DOUGHERTY STREET ATHENS, GA 30601 - 1111						Tons: .4170			
						Category: Aqueous solution with 10% or more total organic residues			
						Disposal Method: Treatment, tank			
						Contact: THE STANDARD PRODUCTS COMPANY			
						Telephone: (810) 299-7798			
						Mailing Address: 165 DOUGHERTY STREET			
						ATHENS, GA 30601 - 1111			
						County: 1			
						The CA HAZNET database contains 22 additional records for this site.			
						Please contact your EDR Account Executive for more information.			

MAP FINDINGS	
Map ID	
Direction	
Distance	
Distance (ft.)	
Elevation	Site

M50	WEATHERFORD BMW	RCRIS-SQG	1000409181
North	735 ASHBY AVE	FINDS	CAD981658503
1/8-1/4	BERKELEY, CA 94710		
799 ft.			
Higher	Site 1 of 2 in cluster M		
RCRIS:			
Owner:	N I MOTORS USA INC		
EPA ID:	CAD981658503		
Contact:	JAMES SCHEINER (510) 854-8280		
Classification:	Small Quantity Generator		
Used Oil Recyc:	No		
TSDF Activities:	Not reported		
Violation Status:	No violations found		
FINDS:			
Other Pertinent Environmental Activity Identified at Site:			
Facility Registry System (FRS)			
Resource Conservation and Recovery Act Information system (RCRAINFO)			

M51	WEATHERFORD BMW	HAZNET	\$101306293
North	735 ASHBY AVE	LUST	N/A
1/8-1/4	BERKELEY, CA 94710	Cortessa	
799 ft.			
Higher	Site 2 of 2 in cluster M		
State LUST:			
Cross Street:	Not reported		
City Leaked:	Not reported		
Case Number:	01-1803		
Reg Board:	San Francisco Bay Region		
Chemical:	Waste Oil		
Lead Agency:	Local Agency		
Local Agency:	01020		
Case Type:	Soil only		
Status:	Pollution Assessment Report Completed		
County:	Alameda		
Abate Method:	No Action Taken - no action has as yet been taken at the site		
Review Date:	7/14/1993	Confirm Leak:	7/14/1993
Workplan:	Not reported	Prelim Assess:	Not reported
Pollution Char:	Not reported	Remed Plan:	Not reported
Remed Action:	Not reported	Monitoring:	Not reported
Close Date:	Not reported		
Release Date:	7/14/1993		
Cleanup Fund Id:	Not reported		
Discover Date:	7/14/1993		
Enforcement Dt:	Not reported		
Enf Type:	Not reported		
Enter Date:	7/14/1993		
Funding:	Federal Funds		
Staff Initials:	UNK		
How Discovered:	Tank Closure		
How Stopped:	Close Tank		
Interim:	No		
Leak Cause:	Unknown		
Leak Source:	Unknown		
MTBE Date:	Not reported		
Max MTBE GW:	Not reported		

Database(s)	EDR ID Number
	EPA ID Number

Map ID		MAP FINDINGS		EDR ID Number
Direction				EPA ID Number

WEATHERFORD BMW (Continued) S101306293

MTBE Tested: Not Required to be Tested.
 Priority: Not reported
 Local Case #: 01-1803
 Beneficial: Not reported
 Staff: CTH
 GW Qualifies: Not reported
 Max MTBE Soil: Not reported
 Soil Qualifies: Not reported
 Hydr Basin #: Not reported
 Operator: Not reported
 Oversight Prgm: Local Implementing Agency UST (Includes non-LOP cases within LOP jurisdiction)
 Oversight Prgm: LIA
 Review Date: 7/14/1993
 Stop Date: 7/14/1993
 Work Suspended N
 Responsible Party:BLANK RP
 RP Address: Not reported
 Global Id: T0800101871
 Org Name: Not reported
 Contact Person: Not reported
 MTBE Conc: 0
 Mibe Fuel: 0
 Water System Name: Not reported
 Well Name: Not reported
 Distance To Lust: 7158.4323331019298032889468546
 Waste Discharge Global ID: Not reported
 Waste Disch Assigned Name: Not reported

LUST Region 2:
 Region: 2
 Facility Id: 01-1803
 Entered Date: 07/14/1993
 Facility Status: Pollution Assessment Report Completed
 Maximum Soil Concentration: 2100
 Maximum Groundwater Impact: 0
 County: Alameda
 Current Benzene: Not reported
 MTBE Detected in GW: No
 MTBE Detected in Soil: Not reported
 MTBE: 0
 MTBE Qualify: Not reported

HAZNET:
 Gepaid: CAD981658503
 Tepaid: CAD009452657
 Gen County: 1
 Tad County: San Mateo
 Tons: 1.7930
 Category: Unspecified organic liquid mixture
 Disposal Method: Not reported
 Contact: N I MOTORS
 Telephone: (415) 788-6202
 Mailing Address: 735 ASHBY AVE
 BERKELEY, CA 94710 - 2803
 County: 1

Map ID	MAP FINDINGS			Map ID	MAP FINDINGS		
Direction				Direction			
Distance				Distance (ft.)			
Elevation	Site	Database(s)	EDR ID Number	Elevation	Site	Database(s)	EDR ID Number
EPA ID Number	EPA ID Number						
WEATHERFORD BMW (Continued)		B101306293		N52 SE 1/8-1/4 856 ft. Higher	PRIVATE RESIDENCE 149 URBANO DRIVE , CA Site 1 of 4 in cluster N		UST U003802954 N/A
Gepaid:	CAD981658503						
Tepaid:	CAD009452657						
Gen County:	1						
Tsd County:	San Mateo						
Tons:	3.879						
Category:	Unspecified organic liquid mixture						
Disposal Method:	Recycler						
Contact:	N I MOTORS						
Telephone:	(415) 788-6202						
Mailing Address:	735 ASHBY AVE BERKELEY, CA 94710 - 2803						
County	1						
Gepaid:	CAD981658503						
Tepaid:	CAD009452657						
Gen County:	1						
Tsd County:	1						
Tons:	.5421						
Category:	Aqueous solution with less than 10% total organic residues						
Disposal Method:	Transfer Station						
Contact:	N I MOTORS						
Telephone:	(415) 788-6202						
Mailing Address:	735 ASHBY AVE BERKELEY, CA 94710 - 2803						
County	1						
Gepaid:	CAD981658503						
Tepaid:	CAD009452657						
Gen County:	1						
Tsd County:	San Mateo						
Tons:	7.5266						
Category:	Unspecified organic liquid mixture						
Disposal Method:	Recycler						
Contact:	N I MOTORS						
Telephone:	(415) 788-6202						
Mailing Address:	735 ASHBY AVE BERKELEY, CA 94710 - 2803						
County	1						
Gepaid:	CAD981658503						
Tepaid:	CAD009452657						
Gen County:	1						
Tsd County:	San Mateo						
Tons:	0.2293						
Category:	Hydrocarbon solvents (benzene, hexene, Stoddard, etc.)						
Disposal Method:	Recycler						
Contact:	N I MOTORS						
Telephone:	(415) 788-6202						
Mailing Address:	735 ASHBY AVE BERKELEY, CA 94710 - 2803						
County	1						
The CA HAZNET database contains 9 additional records for this site. Please contact your EDR Account Executive for more information.							LUST S105483028 N/A
CORTESE:							
Reg Id:	01-1803						
Region:	CORTESE						
Reg By:	Leaking Underground Storage Tanks						
OS3 ERF 1/8-1/4 861 ft. Higher	6523 SAN PABLO AVE OAKLAND, CA Site 1 of 2 in cluster O						
	LUST Alameda County: Region : ALAMEDA Facility ID : R00000116						

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS				Map ID	MAP FINDINGS			
Direction	Database(s)	EDR ID Number	Elevation	Site	Direction	Database(s)	EDR ID Number	Elevation	Site	Direction	Database(s)	EDR ID Number	EPA ID Number	
54 WWW 1/8-1/4 863 ft. Lower	EAST BAY STEEL PRODUCTS 900 MURRAY ST BERKELEY, CA 94710	HAZNET N/A	1001810995		P55 West 1/8-1/4 894 ft. Lower	VETERANS AFFAIRS OUTPATIENT CLINIC 841 FOLGER AVE BERKELEY, CA 94710				RCRIS-SOG FINDS	1001075564 CAR000006528			
	HAZNET: Gepaid: CAC00217500B Tepaid: CAD0008252405 Gen County: 1 Tsd County: Los Angeles Tons: 0.4587 Category: Off-specification, aged, or surplus organics Disposal Method: Recycler Contact: EAST BAY STEEL PRODUCTS Telephone: (510) 452-0122 Mailing Address: PO BOX 23711 OAKLAND, CA 94623 County 1 Gepaid: CAP982451676 Tepaid: CAL000181741 Gen County: 0 Tsd County: 1 Tons: 4.1700 Category: Unspecified oil-containing waste Disposal Method: Recycler Contact: EAST BAY STEEL PRODUCTS Telephone: (000) 000-0000 Mailing Address: 900 MURRAY ST BERKELEY, CA 94710 - 2815 County 0 Gepaid: CAP982451678 Tepaid: CAT080013352 Gen County: 0 Tsd County: Los Angeles Tons: 0.4587 Category: Off-specification, aged, or surplus organics Disposal Method: Not reported Contact: EAST BAY STEEL PRODUCTS Telephone: (000) 000-0000 Mailing Address: 900 MURRAY ST BERKELEY, CA 94710 - 2815 County 0 Gepaid: CAP982451676 Tepaid: HAHQ36009791 Gen County: 0 Tsd County: 0 Tons: 0.45 Category: Other organic solids Disposal Method: Disposal, Land Fill Contact: EAST BAY STEEL PRODUCTS Telephone: (000) 000-0000 Mailing Address: 900 MURRAY ST BERKELEY, CA 94710 - 2815 County 0						Site 1 of 2 in cluster P		RCRIS: Owner: VETERANS AFFAIRS (510) 372-4520 EPA ID: CAR000006528 Contact: CYNTHIA CASALINA (510) 372-4520 Classification: Small Quantity Generator Used Oil Recyc: No TSDF Activities: Not reported Violation Status: No violations found					
									FINDS: Other Pertinent Environmental Activity Identified at Site: Facility Registry System (FRS) Resource Conservation and Recovery Act Information system (RCRAINFO)					
					N56 SE 1/8-1/4 897 ft. Higher	JOHN NADY 1137-1167 85TH ST OAKLAND, CA 94608							HAZNET N/A	
						Site 2 of 4 in cluster N			HAZNET: Gepaid: CAC001465504 Tepaid: CAL000161743 Gen County: 1 Tsd County: Santa Clara Tons: 1.2510 Category: Unspecified oil-containing waste Disposal Method: Transfer Station Contact: JOHN NADY Telephone: (510) 652-2411 Mailing Address: 6701 BAY ST EMERYVILLE, CA 94608 County 1 Gepaid: CAC001465504 Tepaid: CAD009466392 Gen County: 1 Tsd County: 7 Tons: .3750 Category: Other empty containers 30 gallons or more Disposal Method: Recycler Contact: JOHN NADY Telephone: (510) 852-2411 Mailing Address: 6701 BAY ST EMERYVILLE, CA 94608 County 1					

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS			
Direction					Direction				
Distance					Distance (ft.)				
Elevation	Site				Elevation	Site			
		Database(s)	EDR ID Number	EPA ID Number		Database(s)	EDR ID Number	EPA ID Number	
	JOHN NADY (Continued)		S103972477			LIQUID SUGARS INC (Continued)		S103627189	
Gepaid:	CAC001485504				HazNet:	Gepaid:	CAC000773448		
Tepaid:	CAT000546117				Tepaid:	CAD982042475			
Gen County:	1				Gen County:	1			
Tsd County:	Kings				Tsd County:	Solano			
Tons:	12.842				Tons:	11.7892			
Category:	Contaminated soil from site clean-ups				Category:	Asbestos-containing waste			
Disposal Method:	Disposal, Land Fill				Disposal Method:	Disposal, Land Fill			
Contact:	JOHN NADY				Contact:	LIQUID SUGARS INC			
Telephone:	(510) 652-2411				Telephone:	(510) 420-7180			
Mailing Address:	5701 BAY ST EMERYVILLE, CA 94608				Mailing Address:	1274 65TH ST EMERYVILLE, CA 94608			
County	1				County	1			
N57	NADY SYSTEMS INC	RCRIS-SQG	1000446812		Q60	1X EDWIN V WARREN TRUST			
SE	1145 65TH ST	FINDS	CAD083790699		SSW	1280 65TH STREET			
1/8-1/4	OAKLAND, CA 94608				1/8-1/4	EMERYVILLE, CA 94608			
897 ft.					922 ft.				
Higher	Site 3 of 4 in cluster N				Higher				
RCRIS:									
Owner:	JOHN NADY								
	(415) 555-1212								
EPA ID:	CAD083790699								
Contact:	ENVIRONMENTAL MANAGER								
	(415) 652-2411								
Classification:	Small Quantity Generator								
Used Oil Recyc:	No								
TSDF Activities:	Not reported								
Violation Status:	No violations found								
FINDS:									
Other Pertinent Environmental Activity Identified at Site:									
Facility Registry System (FRS)									
Resource Conservation and Recovery Act Information system (RCRAINFO)									
N58		LUST	S105463063		Q61	AUTUMN PRESS			
SE	1137 65TH (-1167) ST		N/A		SSW	1280 65TH ST			
1/8-1/4	OAKLAND, CA				1/8-1/4	EMERYVILLE, CA 94608			
897 ft.					922 ft.				
Higher	Site 4 of 4 in cluster N				Higher				
LUST Alameda County:									
Region :	ALAMEDA								
Facility ID :	RO0000082								
Q59	LIQUID SUGARS INC	HAZNET	S103627189		RCRIS-SQG	1000819740			
SSW	1274 65TH ST		N/A		FINDS	CAD983857388			
1/8-1/4	EMERYVILLE, CA 94608				HAZNET				
905 ft.									
Higher	Site 1 of 5 in cluster Q								

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

AUTUMN PRESS (Continued)

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:
Facility Registry System (FRS)
Resource Conservation and Recovery Act Information system (RCRAINFO)

HAZNET:

Gepaid: CAD983657388
Tepaid: CA0000084517
Gen County: 1
Tsd County: Sacramento
Tons: 0.9381
Category: Photochemicals/photoprocessing waste
Disposal Method: Transfer Station
Contact: MIGUAL ALSON
Telephone: (000) 000-0000
Mailing Address: 1280 65TH ST
EMERYVILLE, CA 94608
County 1
Gepaid: CAD983657388
Tepaid: CAD070148432
Gen County: 1
Tsd County: 1
Tons: .2502
Category: Photochemicals/photoprocessing waste
Disposal Method: Recycler
Contact: MIGUAL ALSON
Telephone: (000) 000-0000
Mailing Address: 1280 65TH ST
EMERYVILLE, CA 94608
County 1
Gepaid: CAD983657388
Tepaid: CA0000084517
Gen County: 1
Tsd County: Sacramento
Tons: .5004
Category: Photochemicals/photoprocessing waste
Disposal Method: Transfer Station
Contact: MIGUAL ALSON
Telephone: (000) 000-0000
Mailing Address: 1280 65TH ST
EMERYVILLE, CA 94608
County 1
Gepaid: CAD983657388
Tepaid: CA0000084517
Gen County: 1
Tsd County: Sacramento
Tons: .3753
Category: Photochemicals/photoprocessing waste
Disposal Method: Transfer Station
Contact: MIGUAL ALSON
Telephone: (000) 000-0000
Mailing Address: 1280 65TH ST
EMERYVILLE, CA 94608
County 1

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

AUTUMN PRESS (Continued)

1000619740

Gepaid: CAD983657388
Tepaid: CAD061181367
Gen County: 1
Tsd County: Marin
Tons: .6672
Category: Photochemicals/photoprocessing waste
Disposal Method: Recycler
Contact: MIGUAL ALSON
Telephone: (000) 000-0000
Mailing Address: 1280 65TH ST
EMERYVILLE, CA 94608
County 1

The CA HAZNET database contains 4 additional records for this site.
Please contact your EDR Account Executive for more information.

P62
West
1B/14
936 ft.
Lower

PRINT MTR PRESS
830 FOLGER AVE
BERKELEY, CA 94710

Site 2 of 2 in cluster P

HAZNET:
Gepaid: CAL000157059
Tepaid: CAD070148432
Gen County: 1
Tsd County: 1
Tons: .0208
Category: Photochemicals/photoprocessing waste
Disposal Method: Recycler
Contact: MARGARET RITA
Telephone: (000) 000-0000
Mailing Address: 830 FOLGER AVE
BERKELEY, CA 94710
County 1
Gepaid: CAL000157059
Tepaid: CA0000084517
Gen County: 1
Tsd County: Sacramento
Tons: .0416
Category: Photochemicals/photoprocessing waste
Disposal Method: Recycler
Contact: MARGARET RITA
Telephone: (000) 000-0000
Mailing Address: 830 FOLGER AVE
BERKELEY, CA 94710
County 1
Gepaid: CAL000157059
Tepaid: CA0000084517
Gen County: 1
Tsd County: Sacramento
Tons: .0416
Category: Photochemicals/photoprocessing waste
Disposal Method: Transfer Station
Contact: MARGARET RITA
Telephone: (000) 000-0000
Mailing Address: 830 FOLGER AVE

HAZNET 8103673709
N/A

Map ID Direction Distance Distance (ft.) Elevation	MAP FINDINGS		Map ID Direction Distance Distance (ft.) Elevation	MAP FINDINGS	
Site	Database(s)	EDR ID Number EPA ID Number	Site	Database(s)	EDR ID Number EPA ID Number
PRINT MIT PRESS (Continued)			OAKLAND DIESEL DISTRIBUTORS INC (Continued)		
BERKELEY, CA 94710			EMERYVILLE, CA 94662 - 0215		
County 1	S103673709		Gen County: 1		S103979755
D63 ESE 6396 SAN PABLO AVENUE OAKLAND, CA 94608 941 ft. Higher Site 2 of 2 in cluster D	HAZNET	S100871583 WA	Tepaid: CAL000161741		
HAZNET: Gepaid: CAL922044745 Tepaid: CAD980887418 Gen County: 1 Tad County: 1 Tons: .0625 Category: Aqueous solution with less than 10% total organic residues Disposal Method: Transfer Station Contact: DARRYL ANDERSON Telephone: (510) 654-6513 Mailing Address: 288 E HAMILTON AVE STE A CAMPBELL, CA 95008	Q63 SSW 18-1/4 949 ft. Same		Gepaid: CAL000083275 Tepaid: CAT000846117 Gen County: 1 Tad County: Kings Tons: 0.8 Category: Other inorganic solid waste Disposal Method: Disposal, Land Fill Contact: OAKLAND INC Telephone: (000) 000-0000 Mailing Address: PO BOX 88215 EMERYVILLE, CA 94662 - 0215		
County 1 Gepaid: CAL922044745 Tepaid: CAD980887418 Gen County: 1 Tad County: 1 Tons: .0634 Category: Aqueous solution with less than 10% total organic residues Disposal Method: Transfer Station Contact: DARRYL ANDERSON Telephone: (510) 654-6513 Mailing Address: 288 E HAMILTON AVE STE A CAMPBELL, CA 95008	Q64 SSW 18-1/4 949 ft. Same		Q65 SSW 18-1/4 967 ft. Lower	COPPER & BRASS SALES 1295 65TH EMERYVILLE, CA 94608	Cortese S105023683 N/A
County 1 HAZNET: Gepaid: CAL000083275 Tepaid: CAD0097030993 Gen County: 1 Tad County: Los Angeles Tons: .8131 Category: Liquids with pH <UN>-2 Disposal Method: Recycler Contact: OAKLAND INC Telephone: (000) 000-0000 Mailing Address: PO BOX 88215 EMERYVILLE, CA 94662 - 0215	R65 SSW 18-1/4 968 ft. Lower		R65 SSW 18-1/4 968 ft. Lower	1301 65TH ST EMERYVILLE, CA	LUST S105483342 N/A
Site 4 of 5 in cluster Q	HAZNET	S103979755 N/A	Site 1 of 3 in cluster R	OAKLAND DIESEL DISTRIBUTORS INC 1301 65TH STREET EMERYVILLE, CA 94608	HAZNET S100940988 LUST N/A Cortese
HAZNET: Gepaid: CAL000083275 Tepaid: CAD0097030993 Gen County: 1 Tad County: Los Angeles Tons: .8131 Category: Liquids with pH <UN>-2 Disposal Method: Recycler Contact: OAKLAND INC Telephone: (000) 000-0000 Mailing Address: PO BOX 88215 EMERYVILLE, CA 94662 - 0215	R67 SSW 18-1/4 968 ft. Lower		Site 2 of 3 in cluster R	State LUST: Cross Street: Not reported City Leaked: Not reported Case Number: 01-0753 Reg Board: San Francisco Bay Region	

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

OAKLAND DIESEL DISTRIBUTORS IN (Continued)

S100940966

Chemical: Gasoline
Lead Agency: Local Agency
Local Agency: 01000
Case Type: Other ground water affected
Status: Signed off, remedial action completed or deemed unnecessary
County: Alameda
Abate Method: Excavates and Treat - remove contaminated soil and treat (includes spreading or land farming)
Review Date: Not reported Confirm Leak: Not reported
Workplan: 6/8/1988 Prelim Assess: 6/8/1988
Pollution Char: Not reported Remed Plan: Not reported
Remed Action: Not reported Monitoring: Not reported
Close Date: 11/17/1995
Release Date: 7/15/1988
Cleanup Fund Id: Not reported
Discover Date: 7/15/1988
Enforcement Dl: Not reported
Enf Type: Not reported
Enter Date: 3/24/1994
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank
Inferior: Yes
Leak Cause: Structure Failure
Leak Source: Tank
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Site NOT Tested for MTBE Includes Unknown and Not Analyzed.
Priority: Not reported
Local Case #: 363
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgm: Local Oversight Program UST
Oversight Prgm: LOP
Review Date: 8/7/1996
Stop Date: 7/15/1988
Work Suspended N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: TDB00100694
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mtbe Fuel: 1
Wafer System Name: Not reported
Well Name: Not reported
Distance To Lust: 7481.8245113552771961894789244
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

LUST Region 2:
Region: 2

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

OAKLAND DIESEL DISTRIBUTORS IN (Continued)

S100940966

Facility Id: 01-0753
Entered Date: 03/24/1994
Facility Status: Signed off, remedial action completed or deemed unnecessary
Maximum Soil Concentration: 220
Maximum Groundwater Impact: 9999999
County: Alameda
Current Benzene: 31
MTBE Detected in GW: 9999999
MTBE Detected in Soil: Not reported
MTBE: 0
MTBE Quality: Not reported

HAZNET:
Gepid: CAL000039583
Tepaid: CAT080010101
Gen County: 1
Tsd County: San Diego
Tons: .3544
Category: Alkaline solution without metals (pH > 12.5)
Disposal Method: Treatment, Tank
Contact: CORPORATION
Telephone: (510) 652-1890
Mailing Address: PO BOX 88215
EMERYVILLE, CA 94662
County: 1

CORTESE:
Reg Id: 01-0753
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

S68 RINEHART OIL COMPANY
NNE 840 ASHY AVE.
1/8-1/4 BERKELEY, CA 94710
985 ft.
Higher

Site 1 of 4 in cluster S

HAZNET:
Gepid: CAL000073129
Tepaid: CAD028409019
Gen County: 1
Tsd County: Los Angeles
Tons: .9174
Category: Aqueous solution with less than 10% total organic residues
Disposal Method: Transfer Station
Contact: ROBERT RINEHART
Telephone: (000) 000-0000
Mailing Address: PO BOX 725
UKIAH, CA 95462
County: 1

HAZNET S103873962
N/A

S69 TEXACO
NNE 840 ASHY AVE.
1/8-1/4 BERKELEY, CA 94704
985 ft.
Higher

Site 2 of 4 in cluster S

State LUST:
Cross Street: Not reported

LUST S102438626
N/A

Map ID	Direction	MAP FINDINGS		Map ID	Direction	MAP FINDINGS		Map ID	Direction	MAP FINDINGS	
Distance	Distance (ft.)	Database(s)	EDR ID Number	Elevation	Distance (ft.)	Database(s)	EDR ID Number	Elevation	Distance (ft.)	Database(s)	EDR ID Number
Site	Site	Site	Site	Site	Site	Site	Site	Site	Site	Site	Site
TEXACO (Continued)				5102438628	TEXACO (Continued)				5102438628		
Qty Leaked:	Not reported				Waste Discharge Global ID:	Not reported				Cortese	B101623575
Case Number:	01-1243				Waste Disch Assigned Name:	Not reported				CA FID UST	N/A
Reg Board:	San Francisco Bay Region				LUST Region 2:						
Chemical:	Gasoline				Region:	2					
Lead Agency:	Local Agency				Facility Id:	01-1243					
Local Agency:	01020				Entered Date:	02/26/1991					
Case Type:	Other ground water affected				Facility Status:	Signed off, remedial action completed or deemed unnecessary					
Status:	Signed off, remedial action completed or deemed unnecessary				Maximum Soil Concentration:	480					
County:	Alameda				Maximum Groundwater Impact:	999999					
Abate Method:	Excavate and Dispose - remove contaminated soil and dispose in approved site				County:	Alameda					
Review Date:	2/26/1991	Confirm Leak:	2/28/1991		Current Benzene:	14000					
Workplan:	6/30/1989	Prelim Assess:	6/30/1989		MTBE Detected In GW:	999999					
Pollution Char:	5/25/1994	Remed Plan:	5/25/1994		MTBE Detected In Soil:	Not reported					
Remed Action:	Not reported	Monitoring:	Not reported		MTBE:	0					
Close Date:	11/16/1999				MTBE Qualify:	Not reported					
Release Date:	3/27/1986										
Cleanup Fund Id:	Not reported										
Discover Date:	3/27/1986										
Enforcement Dt:	5/23/1990										
Enf Type:	Not reported										
Enter Date:	2/28/1991										
Funding:	Federal Funds										
Staff Initials:	UNK										
How Discovered:	Tank Closure										
How Stopped:	Close Tank										
Interim:	Yes										
Leak Cause:	Structure Failure										
Leak Source:	Tank										
MTBE Date:	Not reported										
Max MTBE GW:	Not reported										
MTBE Tested:	Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.										
Priority:	Not reported										
Local Case #:	01-1243										
Beneficial:	Not reported										
Staff:	CTH										
GW Qualifies:	Not reported										
Max MTBE Soil:	Not reported										
Soil Qualifies:	Not reported										
Hydr Basin #:	Not reported										
Operator:	Not reported										
Oversight Prgm:	Local Implementing Agency UST (includes non-LOP cases within LOP jurisdiction)										
Oversight Prgm:	LIA										
Review Date:	11/17/1999										
Stop Date:	3/27/1986										
Work Suspended:	N										
Responsible Party:	BLANK RP										
RP Address:	Not reported										
Global Id:	T0600101142										
Org Name:	Not reported										
Contact Person:	Not reported										
MTBE Conc:	0										
Mtbe Fuel:	1										
Water System Name:	Not reported										
Well Name:	Not reported										
Distance To Lust:	6985.7766866881926581320431037										
					570	ASHBY TEXACO				HIST UST	U001586678
					NNE	840 ASHBY AVE					N/A
					1/8-1/4	BERKELEY, CA 94528					
					995 R.						
					Higher	Site 3 of 4 in cluster S					
						CORTESE:					
						Reg Id:	01-1243				
						Region:	CORTESE				
						Reg By:	Leaking Underground Storage Tanks				
					571	ASHBY TEXACO					
					NNE	840 ASHBY AVE					
					1/8-1/4	BERKELEY, CA 94528					
					995 R.						
					Higher	Site 4 of 4 in cluster S					
						UST HIST:					
						Facility ID:	87656				
						Tank Num:	1				
						Tank Capacity:	8000				
						Tank Used for:	WASTE				
						Type of Fuel:	Not Reported				
						Leak Detection:	Stock Inventor				
						Contact Name:	DIABLO AUTO PARTS				
						Total Tanks:	4				
						Facility Type:	1				
						Facility ID:	87656				
						Tank Num:	2				
						Tank Capacity:	4000				
						Tank Used for:	PRODUCT				
						Type of Fuel:	UNLEADED				
						Leak Detection:	Stock Inventor				
						Contact Name:	DIABLO AUTO PARTS				
						Total Tanks:	4				
						Facility Type:	1				
						Facility ID:	87656				
						Tank Num:	3				
						Tank Capacity:	2000				
						Tank Used for:	PRODUCT				
						Container Num:	3				
						Year Installed:	Not reported				

Map ID	Direction	MAP FINDINGS		Map ID	Direction	MAP FINDINGS	
Distance	Distance (ft.)	Database(s)	EDR ID Number	Elevation	Distance	Database(s)	EDR ID Number
	Elevation	Site			Site		
ASHBY TEXACO (Continued)							
Type of Fuel:	UNLEADED	Tank Construction:	Not reported	U001598876	RESIDENCE (Continued)		
Leak Detection:	Stock Inventor	Telephone:	(415) 540-9702		Facility ID:	1740	U003802899
Contact Name:	DIABLO AUTO PARTS	Region:	STATE		Tank ID:	Not reported	
Total Tanks:	4	Other Type:	Not reported		Manufacturer:	Not reported	
Facility Type:	1				Other Interior Lining:	Not reported	
Facility ID:	87656	Container Num:	4		Receive Date:	6/22/94 0:00:00	
Tank Num:	4	Year Installed:	Not reported		Owner Name:	Not reported	
Tank Capacity:	4000	Tank Construction:	Not reported		Certified Date:	6/22/94 0:00:00	
Tank Used for:	PRODUCT	Telephone:	(415) 540-9702		Flag:	CLOSED	
Type of Fuel:	DIESEL	Region:	STATE		Other Corrosion Protection:	Not reported	
Leak Detection:	Stock Inventor	Other Type:	Not reported		Drop Tube:	Not reported	
Contact Name:	DIABLO AUTO PARTS				Striker Plate:	Not reported	
Total Tanks:	4				Contents A:	Not reported	
Facility Type:	1				Contents B:	Not reported	
R72 SSW 1/8-1/4 1014 ft. Lower	PEETS COFFEE AND TEA 1310 65TH ST EMERYVILLE, CA 94608	HAZNET Cortese	S103628006 N/A		Contents C:	Not reported	
Site 3 of 3 In cluster R					Mailing Name:	Not reported	
HAZNET: Gepaid: CAP600927646 Tepaid: CAD000088252 Gen County: 0 Tsd County: Los Angeles Tons: .1251 Category: Unspecified solvent mixture Waste Disposal Method: Transfer Station Contact: Not reported Telephone: (000) 000-0000 Mailing Address: 00000 County: 0					Mailing Address:	Not reported	
Gepaid: CAP600927848 Tepaid: CAD000088252 Gen County: 0 Tsd County: Los Angeles Tons: .0208 Category: Latex waste Disposal Method: Transfer Station Contact: Not reported Telephone: (000) 000-0000 Mailing Address: 00000 County: 0					Other Substance:	Not reported	
CORTES: Reg Id: 3004 Region: CORTESE Reg By: Leaking Underground Storage Tanks					Tank Construction Type:	Not reported	
T74 ESE 1/8-1/4 1020 ft. Higher	OAKLAND - TIGHTHEAD 6549 SAN PABLO AVE OAKLAND, CA 94608	HIST UST	U001599288 N/A		Tank Material:	Not reported	
Site 2 of 6 In cluster T					Interior Lining:	Not reported	
UST HIST: Facility ID: 41770 Tank Num: 1 Tank Capacity: 10000 Tank Used for: PRODUCT Type of Fuel: DIESEL Leak Detection: None Contact Name: THURMAN CRABTREE Total Tanks: 5 Facility Type: 2					Corrosion Protection:	Not reported	
T73 ESE 1/8-1/4 1020 ft. Higher	RESIDENCE 2710 BROADWAY STREET , CA	UST	U003802699 N/A		Spill Contamination Installed Date:	Not reported	
Site 1 of 6 In cluster T UST San Francisco County:					Overflow Prevention Installed Date:	Not reported	
TC834561.1s Page 65					Piping Type:	Not reported	
TC834561.1s Page 66					Piping Aboveground:	Not reported	

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS				
Direction	Database(s)	EDR ID Number	EPA ID Number	Site	Direction	Database(s)	EDR ID Number	EPA ID Number	Site	
Distance										
Distance (ft.)										
Elevation	Site					Site				
OAKLAND - TIGHTHEAD (Continued)	U001599288				DOROTHY WARBURTON (Continued)	S104570284				
Facility ID:	41770	Container Num:	OCW 1		T76	MYERS CONTAINER CORP				HAZNET
Tank Num:	2	Year Installed:	1975		ESE	6548 SAN PABLO AVE				1003059989
Tank Capacity:	40000	Tank Construction:	9 inches		1/8-1/4	OAKLAND, CA 94608				N/A
Tank Used for:	WASTE	Telephone:	(415) 652-8847		1020 ft.					
Type of Fuel:	Not Reported	Region:	STATE		Higher					
Leak Detection:	None	Other Type:	DRUM RECONDITIONER			Site 4 of 8 in cluster T				
Contact Name:	THURMAN CRABTREE					HAZNET:				
Total Tanks:	5					Gepaid:	CAD009123217			
Facility Type:	2					Tepaid:	CAD0092042475			
Facility ID:	41770	Container Num:	OWO 1			Gen County:	1			
Tank Num:	3	Year Installed:	Not reported			Tsd County:	Solano			
Tank Capacity:	1000	Tank Construction:	Not reported			Tons:	32.8892			
Tank Used for:	WASTE	Telephone:	(415) 652-8847			Category:	Asbestos-containing waste			
Type of Fuel:	WASTE OIL	Region:	STATE			Disposal Method:	Disposal, Land Fill			
Leak Detection:	None	Other Type:	DRUM RECONDITIONER			Contact:	IMACE CORP			
Contact Name:	THURMAN CRABTREE					Telephone:	(510) 652-8847			
Total Tanks:	5					Mailing Address:	900 BROOKSIDE DR			
Facility Type:	2					RICHMOND, CA 94801 - 1309				
Facility ID:	41770	Container Num:	ODL 1			County:	1			
Tank Num:	4	Year Installed:	Not reported			Gepaid:	CAD009123217			
Tank Capacity:	4000	Tank Construction:	Not reported			Tepaid:	CAD009452657			
Tank Used for:	PRODUCT	Telephone:	(415) 652-8847			Gen County:	1			
Type of Fuel:	DIESEL	Region:	STATE			Tsd County:	San Mateo			
Leak Detection:	Stock Inventor	Other Type:	DRUM RECONDITIONER			Tons:	2.8770			
Contact Name:	THURMAN CRABTREE					Category:	Alkaline solution without metals (pH > 12.5)			
Total Tanks:	5					Disposal Method:	Recycler			
Facility Type:	2					Contact:	IMACE CORP			
Facility ID:	41770	Container Num:	OGA 1			Telephone:	(510) 652-8847			
Tank Num:	5	Year Installed:	1977			Mailing Address:	900 BROOKSIDE DR			
Tank Capacity:	10000	Tank Construction:	Not reported			RICHMOND, CA 94801 - 1309				
Tank Used for:	PRODUCT	Telephone:	(415) 652-8847			County:	1			
Type of Fuel:	REGULAR	Region:	STATE			Gepaid:	CAD009123217			
Leak Detection:	Stock Inventor	Other Type:	DRUM RECONDITIONER			Tepaid:	CAD009468392			
Contact Name:	THURMAN CRABTREE					Gen County:	1			
Total Tanks:	5					Tsd County:	7			
Facility Type:	2					Tons:	11.5000			
T75	DOROTHY WARBURTON	HAZNET	S104570284			Category:	Other empty containers 30 gallons or more			
ESE	6548 SAN PABLO AVE					Disposal Method:	Recycler			
1/8-1/4	OAKLAND, CA 94608					Contact:	IMACE CORP			
1020 ft.						Telephone:	(510) 652-8847			
Higher	Site 3 of 6 in cluster T					Mailing Address:	900 BROOKSIDE DR			
	HAZNET:					RICHMOND, CA 94801 - 1309				
	Gepaid:	CAC002134897				County:	1			
	Tepaid:	CAD0092042475				Gepaid:	CAD009123217			
	Gen County:	1				Tepaid:	CAD009452657			
	Tsd County:	Solano				Gen County:	1			
	Tons:	5.8996				Tsd County:	San Mateo			
	Category:	Asbestos-containing waste				Tons:	1.8054			
	Disposal Method:	Disposal, Land Fill				Category:	Unspecified oil-containing waste			
	Contact:	DOROTHY WARBURTON				Disposal Method:	Recycler			
	Telephone:	(000) 000-0000				Contact:	IMACE CORP			
	Mailing Address:	10 CREST RD				Telephone:	(510) 652-8847			
		OAKLAND, CA 94611				Mailing Address:	900 BROOKSIDE DR			
						RICHMOND, CA 94801 - 1309				
						County:	1			

Map ID	MAP FINDINGS			
Direction				
Distance				
Distance (ft.)				
Elevation				
Site				

Database(s) EDR ID Number
EPA ID Number

MYERS CONTAINER CORP (Continued)

100365998

Gepaid: CAD009123217
Tepaid: CAT080013352
Gen County: 1
Tsd County: Los Angeles
Tons: 3.5445
Category: Oil/water separation sludge
Disposal Method: Recycler
Contact: IMACE CORP
Telephone: (510) 652-6847
Mailing Address: 900 BROOKSIDE DR
RICHMOND, CA 94801 - 1309
County: 1

The CA HAZNET database contains 6 additional records for this site.
Please contact your EDR Account Executive for more information.

T78
ESE
1/8-1/4
1020 ft.
Higher

MYERS DRUM - OAKLAND
8549 SAN PABLO AVENUE
OAKLAND, CA 94608

Site 5 of 8 in cluster T

Cal-Sites S101272686
AWP N/A

CAL-SITES:
Facility ID: 01340111
Status: AWP - ANNUAL WORKPLAN (AWP) - ACTIVE SITE
Status Date: 01/01/1990
Lead: DTSC
Region: 2 - BERKELEY
Branch: NC - NORTH COAST
File Name: Not reported
Status Name: ANNUAL WORKPLAN - ACTIVE SITE
Lead Agency: DEPT OF TOXIC SUBSTANCES CONTROL
NPL: Not Listed
SIC: 34 MANU - FABRICATED METAL PRODUCTS
Facility Type: RESPONSIBLE PARTY
Type Name: RP
Staff Member Responsible for Site: TPARK
Supervisor Responsible for Site: Not reported
Region Water Control Board: SF - SAN FRANCISCO BAY
Access: Uncontrolled
Cortese: U
Hazardous Ranking Score: 38.33
Date Site Hazard Ranked: Not reported
Groundwater Contamination: Suspected
No. of Contamination Sources: 1
Lat/Long: 37° 50' 52.00" / 122° 17' 3.00"
Lat/Long Method: TEALE ADDRESS MATCH
State Assembly District Code: 14
State Senate District: 9

The CAL-SITES database may contain additional details for this site.
Please contact your EDR Account Executive for more information.

AWP Facility ID: 1340111
Facility Type: AWP

Map ID	MAP FINDINGS			
Direction				
Distance				
Distance (ft.)				
Elevation				
Site				

Database(s) EDR ID Number
EPA ID Number

T78
ESE
1/8-1/4
1020 ft.
Higher

MYERS DRUM CO
8549 SAN PABLO AVE
OAKLAND, CA 94608

Site 6 of 8 in cluster T

FINDS 1000369037
Cortese CAD009123217
RCRIS-LOG UST
CA SLIC
CA FID UST
CERC-NFRAP
HIST UST

CERCLIS-NFRAP Classification Data:
Site Incident Category: Not reported
Non NPL Code: NFRAP
Ownership Status: Private
CERCLIS-NFRAP Assessment History:
Assessment: DISCOVERY
Assessment: ARCHIVE SITE
Assessment: PRELIMINARY ASSESSMENT

Federal Facility: Not a Federal Facility
NPL Status: Not on the NPL
Completed: 10/18/1993
Completed: 09/15/1994
Completed: 09/15/1994

RCRIS:
Owner: KAISER STEEL CORPORATION
(415) 555-1212
EPA ID: CAD009123217
Contact: ENVIRONMENTAL MANAGER
(415) 233-4865

Classification: Large Quantity Generator
Used Oil Recyc: No
TSDF Activities: Not reported
Violation Status: Violations exist
Regulation Violated: Not reported
Area of Violation: GENERATOR-GENERAL REQUIREMENTS
Data Violation Determined: 11/19/1984
Actual Date Achieved Compliance: 11/30/1984

There are 1 violation record(s) reported at this site:

Evaluation: Area of Violation:
Compliance Evaluation Inspection: GENERATOR-GENERAL REQUIREMENTS

Date of
Compliance:
19841130

FINDS:
Other Pertinent Environmental Activity Identified at Site:
Facility Registry System (FRS)
National Compliance Database (NCDB)
Resource Conservation and Recovery Act Information system (RCRAINFO)

CORTESE:
Reg Id: 01340111
Region: CORTESE
Reg By: CALSI

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS			
Direction					Direction				
Distance (ft.)					Distance (ft.)				
Elevation	Site		Database(s)	EDR ID Number	Elevation	Site	Database(s)	EDR ID Number	EPA ID Number
	MYERS DRUM CO (Continued)			1000369037		MYERS DRUM CO (Continued)			1000369037
FID:									
Facility ID:	01002689	Regulate ID:	00041770			Completed Final Remedial Action:			
Reg By:	Active Underground Storage Tank Location					Facility Desc:	Not reported		
Contessa Code:	Not reported	SIC Code:	Not reported			Comment:	Not reported		
Status:	Active	Facility Tel:	(415) 852-6847						
Mail To:	Not reported					UST HIST:			
	8549 SAN PABLO AVE					Facility ID:	14527		
	OAKLAND, CA 94608					Tank Num:	1	Container Num:	1
Contact:	Not reported	Contact Tel:	Not reported			Tank Capacity:	8000	Year Installed:	Not reported
DUNS No:	Not reported	NPDES No:	Not reported			Tank Used for:	PRODUCT		
Creation:	10/22/93	Modified:	00/00/00			Type of Fuel:	REGULAR		
EPA ID:	Not reported					Leak Detection:	Stock Inventor	Tank Construction:	1/4 inches
Comments:	Not reported					Contact Name:	THURMAN CRABTREE	Telephone:	(415) 271-6200
SLIC Region 2:						Total Tanks:	4	Region:	STATE
Facility ID:	01S0201					Facility Type:	2	Other Type:	DRUM RECONDITIONING
Region:	2								
Facility Status:	Active		Not reported			Facility ID:	14527		
Staff:	BG		Not reported			Tank Num:	2	Container Num:	2
Last Site Update:	01/24/19					Tank Capacity:	25000	Year Installed:	Not reported
NPL Status:	Not an NPL site	Discovery Date:	Not reported			Tank Used for:	WASTE		
Case List:	SLIC	Imaged:	No			Type of Fuel:	Not Reported	Tank Construction:	6 inches
Date Closed:	Not reported	Cost Recovery:	No			Leak Detection:	None	Telephone:	(415) 271-6200
Abate Method:	Not reported	Substance:	Not reported			Contact Name:	THURMAN CRABTREE	Region:	STATE
Case Type:	NT	Sample Date:	Not reported			Total Tanks:	4	Other Type:	DRUM RECONDITIONING
Contamination:	Not reported					Facility Type:	2		
Lead:	RWQCB								
Contamination Level:						Facility ID:	14527		
Number of Municipal Wells Contaminated by Site:	0					Tank Num:	3	Container Num:	3
Number of Private Wells Contaminated by Site:	0					Tank Capacity:	16000	Year Installed:	Not reported
Soil Removal Action Taken/Needed:	0					Tank Used for:	WASTE		
Soil Removal or Contaminant Action Started:						Type of Fuel:	Not Reported	Tank Construction:	6 inches
Soil Removal or Contaminant Action Completed:	0					Leak Detection:	None	Telephone:	(415) 271-6200
On-Site Groundwater Extraction or Containment is Needed:	0					Contact Name:	THURMAN CRABTREE	Region:	STATE
On-Site Groundwater Extraction or Containment Started:						Total Tanks:	4	Other Type:	DRUM RECONDITIONING
Off-Site Groundwater Extraction or Containment is Needed:						Facility Type:	2		
Off-Site Groundwater Extraction or Containment Started:									
Length of Contamination Plume (Feet):	0					Facility ID:	14527		
Depth of Contamination Plume (Feet):	0					Tank Num:	4	Container Num:	4
Wells Closed Due To Contamination of Site:						Tank Capacity:	1000	Year Installed:	Not reported
Date of Wells Closure:						Tank Used for:	WASTE		
Nearest Public or Private Drinking Water Well (Feet):	0					Type of Fuel:	WASTE OIL	Tank Construction:	1/4 inches
Under Jurisdiction of Lead Agency Date:						Leak Detection:	None	Telephone:	(415) 271-6200
Latitude/Longitude:	38/-122					Contact Name:	THURMAN CRABTREE	Region:	STATE
Flow Rate:	0					Total Tanks:	4	Other Type:	DRUM RECONDITIONING
Flow Date:						Facility Type:	2		
Percent of Contaminants Contained:	0								
Contaminant Type:						State UST:			
EPA ID:						Facility ID:	174		
Stages of Site Investigation Process Initiated:						Total Tanks:	1		
Begin Characterization:	Not reported					Region:	RIVERSIDE		
Completed Characterization:	Not reported					Total Tanks:	3		
Begin Remediation:	Not reported								
Completed Remediation:	Not reported					UST Riverside County:			
Submitted Remediation Plan:	Not reported					Facility ID:	174		
Approved Remediation Plan:	Not reported					Region:	RIVERSIDE		
Begin Final Remedial Action:	Not reported					Case Number:	Not reported		

Map ID Direction Distance Distance (ft.) Elevation	MAP FINDINGS		Map ID Direction Distance Distance (ft.) Elevation	MAP FINDINGS	
Site	Database(s)	EDR ID Number EPA ID Number	Site	Database(s)	EDR ID Number EPA ID Number
MYERS DRUM CO (Continued)		1000388037	CHALLENGE MANUFACTURING CO.		CA FID UST S101624415 N/A
Other Interior Lining:	Not reported		60		
Receive Date:	12/21/88 0:00:00		West		
Owner Name:	Not reported		1308 06TH ST		
Certified Date:	Not reported		OAKLAND, CA 94608		
Flag:	CLOSED		1045 ft.		
Other Corrosion Protection:	Not reported		Lower		
Drop Tube:	Not reported				
Striker Plate:	Not reported				
Contents A:	Not reported				
Contents B:	Not reported				
Contents C:	Not reported				
Mailing Name:	Not reported				
Mailing Address:	Not reported				
Other Substance:	Not reported				
Tank Construction Type:	Not reported				
Tank Material:	Not reported				
Interior Lining:	Not reported				
Corrosion Protection:	Not reported				
Spill Contamination Installed Date:	Not reported				
Overflow Prevention Installed Date:	Not reported				
Piping Type:	Not reported				
Piping Aboveground:	Not reported				
Piping Underground:	Not reported				
Piping Construction:	Not reported				
Piping Construction Aboveground:	Not reported				
Piping Construction Underground:	Not reported				
Piping Material:	Not reported				
Other Piping Material:	Not reported				
Piping Material Aboveground:	Not reported				
Piping Material Underground:	Not reported				
Pipe Leak Detection:	Not reported				
Estimated Last Date Used:	Not reported				
Estimated Quantity Remaining:	Not reported				
Inert Filling:	Not reported				
Jurisdiction:	Not reported				
Other Tank System:	Not reported				
Other Tank Leak Detection:	Not reported				
Other Pipe Leak Detection:	Not reported				
Methanol Compatible:	Not reported				
79	KNOWN SE 1041 ft. Higher	Notify 65 S100178895 Cortese N/A	CHMIRS: 81 SSE 1041 ft. Higher	CHMIRS: OES Control Number: 9100113 DOT ID: Not reported DOT Hazard Class: Not Reported Chemical Name: LIQUID NITROGEN Extent of Release: Not reported CAS Number: Not reported Quantity Released: 0 Environmental Contamination: None Reported Property Use: Industrial, Utility Incident Date: 04-FEB-91 Date Completed: 05-FEB-91 Time Completed: 15 Physical State Stored: Not reported Physical State Released: Not reported Release Unit: Not reported Container Description: Not reported Container Type: Not reported Container Material: Not reported Level Of Container: Not reported Container Capacity: 0 Container Capacity Units (code): Not reported Extent Of Release (code): Not reported Agency Id Number: 1075 Agency Incident Number: UNKNOWN OES Incident Number: 9100113 Time Notified: 2215 Surrounding Area: 400 Estimated Temperature: Not reported Property Management: Not reported More Than Two Substances Involved?: Not reported Special Studies 1: Not reported Special Studies 2: Not reported Special Studies 3: Not reported Special Studies 4: Not reported Special Studies 5: Not reported Special Studies 6: Not reported Responding Agency Personnel # Of Injuries: 0 Responding Agency Personnel # Of Fatalities: 0 Resp Agency Personnel # Of Decontaminated: 0 Others Number Of Decontaminated: 0 Others Number Of Injuries: 0 Others Number Of Fatalities: 0 Vehicle Make/year: Not reported Vehicle License Number: Not reported Vehicle State: Not reported Vehicle Id Number: Not reported CA/DOT/PUC/ICC Number: Not reported Company Name: Not reported Reporting Officer Name/ID: DAVID FLETCHER Report Date: 05-FEB-91 Comments: Yes	CHMIRS: S100276593 N/A
NOTIFY 65:					
Date Reported:	Not reported	Staff Initials: Not reported			
Board File Number:	Not reported				
Facility Type:	Not reported				
Discharge Date:	Not reported				
Incident Description:	92626				
CORTESE:					
Reg Id:	01-1142				
Region:	CORTESE				
Reg By:	Leaking Underground Storage Tanks				

Map ID	Direction	MAP FINDINGS		Map ID	Direction	MAP FINDINGS	
Distance	Distance (ft.)	Database(s)	EDR ID Number	Elevation	Distance	Database(s)	EDR ID Number
Elevation	Site				Distance (ft.)		
(Continued)			5100276593	ASPHALT PRODUCTS OIL CORP (Continued)		8105035460	
Facility Telephone Number :	415 273-3856						
UB2 NNW 1/8-1/4 1094 ft. Higher	ASPHALT PRODUCTS OIL CORP 1001 ASHBY AVE BERKELEY, CA Site 1 of 6 in cluster U	LUST CA SLIC	8105035460 N/A				
State LUST:				LUST Region 2:			
Cross Street:	Not reported			Region:	2		
City Leaked:	0			Facility Id:	01S0404		
Case Number:	01S0404			Entered Date:	/ /		
Reg Board:	San Francisco Bay Region			Facility Status:	Leak being confirmed		
Chemical:	Diesel			Maximum Soil Concentration:	0		
Lead Agency:	Regional Board			Maximum Groundwater Impact:	0		
Local Agency:	01020			County:	Alameda		
Case Type:	Soil only			Current Benzene:	0		
Status:	Leak being confirmed			MTBE Detected In GW:	No		
County:	Alameda			MTBE Detected In Soil:	Not reported		
Review Date:	0/11/1995	Confirm Leak:	6/1/1995	MTBE:	0		
Workplan:	Not reported	Prelim Assess:	Not reported	MTBE Qualify:	0		
Pollution Char:	Not reported	Remed Plan:	Not reported				
Remed Action:	Not reported	Monitoring:	Not reported				
Close Date:	Not reported						
Release Date:	4/10/1995						
Cleanup Fund Id:	Not reported						
Discover Date:	Not reported						
Enforcement Dl:	Not reported						
Env Type:	Not reported						
Enter Date:	Not reported						
Funding:	Not reported						
Staff Initials:	UNK						
How Discovered:	Tank Closure						
How Stopped:	Close Tank						
Interim:	Not reported						
Leak Cause:	Unknown						
Leak Source:	Unknown						
MTBE Date:	Not reported						
Max MTBE GW:	Not reported						
MTBE Tested:	Not Required to be Tested.						
Priority:	Not reported						
Local Case #:	Not reported						
Beneficial:	Not reported						
Staff:	CTH						
GW Qualifies:	Not reported						
Max MTBE Sol:	Not reported						
Sol Qualifies:	Not reported						
Hydr Basin #:	Not reported						
Operator:	Not reported						
Oversight Prgm:	Local Implementing Agency UST (includes non-LOP cases within LOP jurisdiction)						
Oversight Prgm:	LIA						
Review Date:	Not reported						
Stop Date:	Not reported						
Work Suspended:	N						
Responsible Party:	BLANK RP						
RP Address:	Not reported						
Global Id:	T0600181540						
Org Name:	Not reported						

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

ASPHALT PRODUCTS OIL CORP (Continued)

Stages of Site Investigation Process Initiated:
 Begun Characterization: Not reported
 Completed Characterization: Not reported
 Begun Remediation: Not reported
 Completed Remediation: Not reported
 Submitted Remediation Plan: Not reported
 Approved Remediation Plan: Not reported
 Begun Final Remedial Action: Not reported
 Completed Final Remedial Action: Not reported
 Facility Desc: Not reported
 Comment: Not reported

S105035460

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

ASPHALT PRODUCT OIL CORP (Continued)

Operator: Not reported
 Oversight Prgm: Local Implementing Agency UST (includes non-LOP cases within LOP jurisdiction)
 Oversight Prgm: LIA
 Review Date: 4/9/2001
 Stop Date: 3/7/1990
 Work Suspended N
 Responsible Party: BLANK RP
 RP Address: Not reported
 Global Id: T0800100054
 Org Name: Not reported
 Contact Person: Not reported
 MTBE Conc: 0
 Mibe Fuel: 0
 Water System Name: Not reported
 Well Name: Not reported
 Distance To Lust: 6049.9646922742915526932885751
 Waste Discharge Global ID: Not reported
 Waste Disch Assigned Name: Not reported

U83 ASPHALT PRODUCT OIL CORP
NNW 1001 ASHBY AVE
1/8-1/4 BERKELEY, CA 94710
1094 R.
Higher Site 2 of 6 In cluster U

LUST S104162522
N/A

State LUST:
 Cross Street: Not reported
 Qty Leaked: Not reported
 Case Number: 01-0060
 Reg Board: San Francisco Bay Region
 Chemical: Diesel
 Lead Agency: Local Agency
 Local Agency: 01020
 Case Type: Other ground water affected
 Status: Post remedial action monitoring in progress
 County: Alameda
 Abate Method: No Action Taken - no action has as yet been taken at the site
 Review Date: 10/19/1990 Confirm Leak: 10/19/1990
 Workplan: Not reported Prelim Assess: Not reported
 Pollution Char: Not reported Remed Plan: Not reported
 Remed Action: 1/2/1985 Monitoring: 1/2/1985
 Close Date: 12/17/2001
 Release Date: 3/7/1990
 Cleanup Fund Id: Not reported
 Discover Date: 3/7/1990
 Enforcement Dt: Not reported
 Enf Type: Not reported
 Enter Date: 10/19/1990
 Funding: Federal Funds
 Staff Initials: UNK
 How Discovered: Tank Closure
 How Stopped: Close Tank
 Interim: No
 Leak Cause: Structure Failure
 Leak Source: Tank
 MTBE Data: Not reported
 Max MTBE GW: Not reported
 MTBE Tested: Not Required to be Tested.
 Priority: Not reported
 Local Case #: 01-0060
 Beneficial: Not reported
 Staff: CTH
 GW Qualifies: Not reported
 Max MTBE Soil: Not reported
 Soil Qualifies: Not reported
 Hydr Basin #: Not reported

LUST Region 2:
 Region: 2
 Facility Id: D1-0060
 Entered Date: 10/19/1990
 Facility Status: Signed off, remedial action completed or deemed unnecessary
 Maximum Soil Concentration: 0
 Maximum Groundwater Impact: 8800
 County: Alameda
 Current Benzene: Not reported
 MTBE Detected in GW: 8800
 MTBE Detected in Soil: Not reported
 MTBE: 0
 MTBE Quality: Not reported

U84
NNW
1/8-1/4
1094 ft.
Higher

ASPHALT PRODUCTS OIL CORPORATION
1001 ASHBY AVE
BERKELEY, CA 94710

Cortese S101624588
CA FID UST N/A

Site 3 of 8 In cluster U

CORTESE:
 Reg Id: D1-0060
 Region: CORTESE
 Reg By: Leaking Underground Storage Tanks

85
East
1/8-1/4
1112 R.
Higher

AA JOHNSON & SON, INC.
1164 666TH ST
OAKLAND, CA 94608

CA FID UST S101586389
N/A

Map ID Direction Distance Distance (ft.) Elevation	MAP FINDINGS		Map ID Direction Distance Distance (ft.) Elevation	MAP FINDINGS	
	Database(s)	EDR ID Number EPA ID Number		Database(s)	EDR ID Number EPA ID Number
		\$101580389			5101580084
AA JOHNSON & SON, INC. (Continued)			E.H. MORRILL COMPANY (Continued)		
FID: Facility ID: D1002732 Reg By: Active Underground Storage Tank Location Cortese Code: Not reported Status: Active Mail To: Not reported 1164 068TH ST OAKLAND, CA 94608 Contact: Not reported DUNS No: Not reported Creation: 10/22/93 EPA ID: Not reported Comments: Not reported	Regulae ID: 00052190 SIC Code: Not reported Facility Tel: (415) 658-9798 Contact Tel: Not reported NPDES No: Not reported Modified: 00/00/00		Workplan: Not reported Pollution Char: Not reported Remed Action: Not reported Close Date: 4/13/1995 Release Date: 5/11/1992 Cleanup Fund Id: Not reported Discover Date: 5/11/1992 Enforcement Dt: Not reported Enf Type: Not reported Enter Date: 8/18/1992 Funding: Federal Funds Staff Initials: UNK How Discovered: Tank Closure How Stopped: Close Tank Interim: No Leak Cause: Structure Failure Leak Source: Tank MTBE Date: Not reported Max MTBE GW: Not reported MTBE Tested: Site NOT Tested for MTBE, Includes Unknown and Not Analyzed. Priority: Not reported Local Case #: 01-0612 Beneficial: Not reported Staff: CTH GW Qualifies: Not reported Max MTBE Sol: Not reported Soil Qualifies: Not reported Hydr Basin #: Not reported Operator: Not reported Oversight Prgm: Local Implementing Agency UST (Includes non-LOP cases within LOP jurisdiction) Oversight Prgm: LIA Review Date: 4/11/1995 Stop Date: 5/11/1992 Work Suspended: N Responsible Party/BLANK RP RP Address: Not reported Global Id: T0600100748 Org Name: Not reported Contact Person: Not reported MTBE Conc: 0 Mtbe Fuel: 1 Water System Name: Not reported Well Name: Not reported Distance To Lust: 6164.033038789846744743118481 Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported		
U86 NNW 1/8-1/4 1139 ft. Higher	WAREHAM PROPERTY GROUP 999 ANTHONY BERKELEY, CA 94710 Site 4 of 8 in cluster U	HAZNET S103895034 Cortese N/A			
HAZNET: Gepaid: CAC001313176 Tepaid: CAL00027741 Gen County: 1 Tsd County: 5 Tons: 2.1070 Category: Asbestos-containing waste Disposal Method: Disposal, Land Fill Contact: WAREHAM PROPERTY GROUP Telephone: (415) 457-4964 Mailing Address: 1120 NYE STE 400 SAN RAFAEL, CA 94901 County: 1			CORTESE: Reg Id: 01-0812 Region: CORTESE Reg By: Leaking Underground Storage Tanks		
U87 NNW 1/8-1/4 1139 ft. Higher	E.H. MORRILL COMPANY 999 ANTHONY ST BERKELEY, CA 94710 Site 5 of 8 in cluster U	LUST S101580084 CA FID UST N/A	State LUST: Cross Street: Not reported Qty Leaked: Not reported Case Number: 01-0812 Reg Board: San Francisco Bay Region Chemical: Gasoline Lead Agency: Local Agency Local Agency: 01020 Case Type: Other ground water affected Status: Signed off, remedial action completed or deemed unnecessary County: Alameda Abate Method: No Action Taken - no action has as yet been taken at the site Review Date: 6/18/1992 Confirm Leak: 6/18/1992	LUST Region 2: Region: 2 Facility Id: 01-0812 Entered Date: 08/18/1992 Facility Status: Signed off, remedial action completed or deemed unnecessary Maximum Soil Concentration: 5 Maximum Groundwater Impact: 22000 County: Alameda Current Benzene: 0 MTBE Detected in GW: 22000	

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS			
Direction					Direction				
Distance					Distance				
Distance (ft.)					Distance (ft.)				
Elevation					Elevation				
Site					Site				
	Database(s)					Database(s)			
	EDR ID Number					EDR ID Number			
	EPA ID Number					EPA ID Number			
	E.H. MORRILL COMPANY (Continued)					DR. MARTIN LUTHER KING SCHOOL			
	S101580064					S1003713702			
	MTBE Detected in Soil: Not reported					LUST UST N/A			
	MTBE: 0								
	MTBE Quality: Not reported								
	Facility ID: 01000930 Regulate ID: Not reported								
	Reg By: Active Underground Storage Tank Location								
	Coffease Code: Not reported SIC Code: Not reported								
	Status: Active Facility Tel: (415) 845-4100								
	Mail To: Not reported								
	59 BOWLING DR BERKELEY, CA 94710								
	Contact: Not reported Contact Tel: Not reported								
	DUNS No: Not reported NPDES No: Not reported								
	Creation: 10/22/93 Modified: 00/00/00								
	EPA ID: Not reported								
	Comments: Not reported								
U88	WAREHAM PROP				HAZNET	S103985033			
NNW	998 ANTHONY ST					N/A			
1/8-1/4	BERKELEY, CA 94710								
1139 ft.									
Higher	Site 8 of 8 in cluster U								
	HAZNET:					State LUST:			
	Gepid: CAC001370980					Cross Street: Not reported			
	Tepaid: CAL000027741					Qty Leaked: Not reported			
	Gen County: 1					Case Number: 01-0165			
	Tsd County: 5					Reg Board: San Francisco Bay Region			
	Tons: 8.4280					Chemical: Diesel			
	Category: Asbestos-containing waste					Lead Agency: Local Agency			
	Disposal Method: Disposal, Land Fill					Local Agency: 01000			
	Contact: WAREHAM PROP					Case Type: Soil only			
	Telephone: (415) 457-4984					Status: Signed off, remedial action completed or deemed unnecessary			
	Mailing Address: 1120 NYE ST SAN RAFAEL, CA 94901					County: Alameda			
	County: 1					Abate Method: No Action Taken - no action has as yet been taken at the site			
	HAZNET:					Review Date: Not reported			
	Gepid: CAC001370980					Confirm Leak: Not reported			
	Tepaid: CAL000027741					Workplan: 12/28/1989			
	Gen County: 1					Pollution Char: Not reported			
	Tsd County: 5					Remed Action: Not reported			
	Tons: 8.4280					Close Date: 5/2/1996			
	Category: Asbestos-containing waste					Release Date: 2/1/1988			
	Disposal Method: Disposal, Land Fill					Cleanup Fund Id: Not reported			
	Contact: WAREHAM PROP					Discover Date: 2/1/1988			
	Telephone: (415) 457-4984					Enforcement Dt: Not reported			
	Mailing Address: 1120 NYE ST SAN RAFAEL, CA 94901					Enf Type: Not reported			
	County: 1					Enter Date: 7/17/1992			
V89	PRAXAIR				HAZNET	S104580314			
SSE	1171 OCEAN AVE					Funding: Federal Funds			
1/8-1/4	OAKLAND, CA 94608					Staff Initials: UNK			
1157 ft.						How Discovered: Tank Closure			
Higher	Site 1 of 4 in cluster V					How Stopped: Close Tank			
	HAZNET:					Interim: No			
	Gepid: CALD00170927					Leak Cause: Structure Failure			
	Tepaid: CAD059494310					Leak Source: Tank			
	Gen County: 1					MTBE Data: Not reported			
	Tsd County: Santa Clara					Max MTBE GW: Not reported			
	Tons: 1.2					MTBE Tested: Not Required to be Tested.			
	Category:					Priority: Not reported			
	Disposal Method: Not reported					Local Case #: 307			
	Contact: PRAXAIR CORPORATION					Beneficial: Not reported			
	Telephone: (510) 964-5535					Staff: CTH			
	Mailing Address: 1171 OCEAN AVE OAKLAND, CA 94608					GW Qualifiers: Not reported			
	County: 1					Max MTBE Sol: Not reported			
	HAZNET:					Soil Qualifiers: Not reported			
	Gepid: CAC001370980					Hydr Basis: Not reported			
	Tepaid: CAL000027741					Operator: Not reported			
	Gen County: 1					Oversight Prgm: Local Oversight Program UST			
	Tsd County: Santa Clara					Oversight Prgm: LOP			
	Tons: 1.2					Review Date: 8/7/1996			
	Category:					Stop Date: 2/1/1988			
	Disposal Method: Not reported					Work Suspended: N			
	Contact: PRAXAIR CORPORATION					Responsible Party: BLANK RP			
	Telephone: (510) 964-5535					RP Address: Not reported			
	Mailing Address: 1171 OCEAN AVE OAKLAND, CA 94608					Global Id: T0600100153			
	County: 1					Org Name: Not reported			
	HAZNET:					Contact Person: Not reported			
	Gepid: CAC001370980					MTBE Conc: 0			

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance		EPA ID Number	Distance		EPA ID Number
Distance (ft.)			Distance (ft.)		
Elevation	Site		Elevation	Site	
Site	DR. MARTIN LUTHER KING SCHOOL (Continued)	U003713702	Site	DR. MARTIN LUTHER KING SCHOOL (Continued)	U003713702
Mibe Fuel:	0		Inert Filing:	Not reported	
Water System Name:	Not reported		Jurisdiction:	Not reported	
Well Name:	Not reported		Other Tank System:	Not reported	
Distance To Lust:	6829.9312112717184500905723403		Other Tank Leak Detection:	Not reported	
Waste Discharge Global ID:	Not reported		Other Pipe Leak Detection:	Not reported	
Waste Disch Assigned Name:	Not reported		Methanol Compatible:	Not reported	
LUST Region 2:					
Region:	2		V81	ALTAIR GASSES & EQUIPMENT INC.	HAZNET S102425028
Facility Id:	01-0185		SSE	1171 OCEAN AVE	Cortese N/A
Entered Date:	07/17/1992		1/8-1/4	OAKLAND, CA 94606	
Facility Status:	Signed off, remedial action completed or deemed unnecessary		1157 ft.		
Maximum Soil Concentration:	2		Higher	Site 3 of 4 in cluster V	
Maximum Groundwater Impact:	0			HAZNET:	
County :	Alameda			Gepaid:	CAL000019302
Current Benzene:	Not reported			Tapaid:	CAT000648117
MTBE Detected in GW:	No			Gen County:	1
MTBE Detected in Soln:	Not reported			Tsd County:	Kings
MTBE:	0			Tons:	1.2000
MTBE Quality:	Not reported			Category:	Other inorganic solid waste
UST San Francisco County:				Disposal Method:	Disposal, Land Fill
Facility ID:	307	Case Number:	Not reported	Contact:	ALTAIR GASSES & EQUIPMENT INC
Tank ID:	Not reported	Tank Capacity:	Not reported	Telephone:	(510) 277-2100
Manufacturer:	Not reported	Date Installed:	Not reported	Mailing Address:	4000 EXECUTIVE PKWY STE 520 SAN RAMON, CA 94583 - 4257
Other Interior Lining:	Not reported	Close Date:	Not reported	County:	1
Receive Date:	4/18/88 0:00:00	Dispenser:	Not reported	CORTESE:	
Owner Name:	Not reported			Reg Id:	01-0185
Certified Date:	Not reported			Region:	CORTESE
Flag:	CLOSED			Reg By:	Leaking Underground Storage Tanks
Other Corrosion Protection:	Not reported				
Drop Tube:	Not reported		V82	1171 OCEAN AVE	LUST S105463480
Striker Plate:	Not reported		SSE	OAKLAND, CA	N/A
Contents A:	Not reported		1/8-1/4		
Contents B:	Not reported		1157 ft.		
Contents C:	Not reported		Higher	Site 4 of 4 in cluster V	
Mating Name:	Not reported			LUST Alameda County:	
Mailing Address:	Not reported			Region :	
Other Substance:	Not reported			Facility ID :	
Tank Construction Type:	Not reported				
Tank Material:	Not reported		W83	UC BERKELEY	CA SLIC S102002458
Interior Lining:	Not reported		WNW	MURRAY ST/FOLGER ST/TTH ST	N/A
Corrosion Protection:	Not reported		1/8-1/4	BERKELEY, CA	
Spill Contamination Installed Date:	Not reported		1165 ft.		
Overfill Prevention Installed Date:	Not reported		Lower		
Piping Type:	Not reported			Site 1 of 2 in cluster W	
Piping Aboveground:	Not reported			SLIC Region 2:	
Piping Underground:	Not reported			Facility ID:	0150129
Piping Construction:	Not reported			Region:	2
Piping Construction Aboveground:	Not reported			Facility Status:	Inactive
Piping Construction Underground:	Not reported			Staff:	8G
Piping Material:	Not reported			Last Site Update:	09/17/19
Other Piping Material:	Not reported			NPL Status:	Not an NPL site
Piping Material Aboveground:	Not reported			Discovery Date:	Not reported
Piping Material Underground:	Not reported			Imaged:	No
Pipe Leak Detection:	Not reported			Cost Recovery:	No
Estimated Last Date Used:	Not reported			Substance:	Not reported
Estimated Quantity Remaining:	Not reported				

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

UC BERKELEY (Continued)

Case Type: NT Sample Date: Not reported
Contamination: Not reported
Lead: RWQCB
Contamination Level:
Number of Municipal Wells Contaminated by Site: 0
Number of Private Wells Contaminated by Site: 0
Soil Removal Action Taken/Needed: 0
Soil Removal or Contaminant Action Started:
Soil Removal or Contaminant Action Completed: 0
On-Site Groundwater Extraction or Containment is Needed: 0
On-Site Groundwater Extraction or Containment Started:
Off-Site Groundwater Extraction or Containment is Needed:
Off-Site Groundwater Extraction or Containment Started:
Length of Contamination Plume (Feet): 0
Depth of Contamination Plume (Feet): 0
Wells Closed Due To Contamination of Site:
Date of Wells Closure:
Nearest Public or Private Drinking Water Well (Feet): 0
Under Jurisdiction of Lead Agency Date:
Latitude/Longitude: 38/-122
Flow Rate: 0
Flow Date:
Percent of Contaminants Contained: 0
Contaminant Type:
EPA ID:
Stages of Site Investigation Process Initiated:
 Begun Characterization: Not reported
 Completed Characterization: Not reported
 Begun Remediation: Not reported
 Completed Remediation: Not reported
 Submitted Remediation Plan: Not reported
 Approved Remediation Plan: Not reported
 Begun Final Remedial Action: Not reported
 Completed Final Remedial Action: Not reported
Facility Desc: Not reported
Comment: Not reported

S102002458

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

KLEINEN CO. INC (Continued)

Remed Action: Not reported
Close Date: Not reported
Release Date: 7/3/1998
Cleanup Fund Id: Not reported
Discover Date: 7/3/1998
Enforcement Dk: Not reported
Env Type: Not reported
Enter Date: 3/16/1998
Funding: Not reported
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank
Interim: Not reported
Leak Cause: Unknown
Leak Source: Unknown
MTBE Date: 1/2/1985
Max MTBE GW: 59000
MTBE Tested: MTBE Detected. Site tested for MTBE & MTBE detected
Priority: Not reported
Local Case #: 789
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgrm: Local Oversight Program UST
Oversight Prgrm: LOP
Review Date: 9/6/2000
Stop Date: 7/3/1998
Work Suspended N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T0600102099
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 1
Mtbe Fuel: 0
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 7814.898883081688981058582891
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

X94 KLEINEN CO. INC
WSW 1414 WALLACE AVENUE
18-1/4 CA
1171 R.
Lower Site 1 of 5 in cluster X

HAZNET U001599294
LUST N/A
UST
HIST UST

State LUST:
Cross Street: Not reported
Qty Leaked: Not reported
Case Number: 01-2283
Reg Board: San Francisco Bay Region
Chemical: Diesel
Lead Agency: Local Agency
Local Agency: 01000
Case Type: Other ground water affected
Status: Preliminary site assessment underway
County: Alameda
Abate Method: Excavate and Dispose - remove contaminated soil and dispose in approved site
Review Date: Not reported
Confirm Leak: Not reported
Workplan: 3/16/1998
Prelim Assess: 3/16/1998
Pollution Char: Not reported
Remed Plan: Not reported

LUST Region 2:
Region: 2
Facility Id: 01-2283
Entered Date: 03/16/1998
Facility Status: Preliminary site assessment underway
Maximum Soil Concentration: 0
Maximum Groundwater Impact: 59000
County: Alameda
Current Benzene: Not reported
MTBE Detected in GW: 59000
MTBE Detected in Soil: Not reported
MTBE: 59000
MTBE Qualify: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EDR ID Number EPA ID Number

KLEINEN CO. INC (Continued)

U001599294

HAZNET:
 Gepaid: CAL000148441
 Tepaid: CAD009466392
 Gen County: 1
 Tsd County: 7
 Tons: 2.0000
 Category: Other empty containers 30 gallons or more
 Disposal Method: Recycler
 Contact: MCGRATH STREET CO
 Telephone: (000) 000-0000
 Mailing Address: PO BOX 8036
 EMERYVILLE, CA 94682
 County 1

Gepaid: CAL000148441
 Tepaid: CAD059494310
 Gen County: 1
 Tsd County: Santa Clara
 Tons: .5000
 Category: Unspecified oil-containing waste
 Disposal Method: Disposal, Other
 Contact: MCGRATH STREET CO
 Telephone: (000) 000-0000
 Mailing Address: PO BOX 8036
 EMERYVILLE, CA 94682
 County 1

Gepaid: CAL000148441
 Tepaid: CAD980887418
 Gen County: 1
 Tsd County: 1
 Tons: .0188
 Category: Waste oil and mixed oil
 Disposal Method: Recycler
 Contact: MCGRATH STREET CO
 Telephone: (000) 000-0000
 Mailing Address: PO BOX 8036
 EMERYVILLE, CA 94682
 County 1

Gepaid: CAL000148441
 Tepaid: CAD059494310
 Gen County: 1
 Tsd County: Santa Clara
 Tons: .2919
 Category: Liquids with halogenated organic compounds > 1000 mg/l
 Disposal Method: Disposal, Other
 Contact: MCGRATH STREET CO
 Telephone: (000) 000-0000
 Mailing Address: PO BOX 8036
 EMERYVILLE, CA 94682
 County 1

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EDR ID Number EPA ID Number

KLEINEN CO. INC (Continued)

U001599294

Gepaid: CAL000148441
 Tepaid: CAD059494310
 Gen County: 1
 Tsd County: Santa Clara
 Tons: .5000
 Category: Unspecified oil-containing waste
 Disposal Method: Disposal, Other
 Contact: MCGRATH STREET CO
 Telephone: (000) 000-0000
 Mailing Address: PO BOX 8036
 EMERYVILLE, CA 94682
 County 1

The CA HAZNET database contains 4 additional records for this site.
 Please contact your EDR Account Executive for more information.

UST HIST:
 Facility ID: 1598
 Tank Num: 1
 Tank Capacity: 2000
 Tank Used for: PRODUCT
 Type of Fuel: UNLEADED
 Leak Detection: Stock Inventor
 Contact Name: Not reported
 Total Tanks: 2
 Facility Type: 2

Container Num: 1
 Year Installed: 1981
 Tank Construction: Not reported
 Telephone: (415) 658-1877
 Region: STATE
 Other Type: INSTALL/FABRICATE ST

Facility ID: 1598
 Tank Num: 2
 Tank Capacity: 2000
 Tank Used for: PRODUCT
 Type of Fuel: DIESEL
 Leak Detection: None
 Contact Name: Not reported
 Total Tanks: 2
 Facility Type: 2

Container Num: 2
 Year Installed: Not reported
 Tank Construction: Not reported
 Telephone: (415) 658-1877
 Region: STATE
 Other Type: INSTALL/FABRICATE ST

UST San Francisco County:
 Facility ID: 789
 Tank ID: Not reported
 Manufacturer: Not reported
 Other Interior Lining: Not reported
 Receive Date: 11/28/90 0:00:00
 Owner Name: Not reported
 Certified Date: Not reported
 Flag: CLOSED
 Other Corrosion Protection: Not reported
 Drop Tube: Not reported
 Striker Plate: Not reported
 Contents A: Not reported
 Contents B: Not reported
 Contents C: Not reported
 Mailing Name: Not reported
 Mailing Address: Not reported
 Other Substance: Not reported
 Tank Construction Type: Not reported
 Tank Material: Not reported
 Interior Lining: Not reported

Case Number: Not reported
 Tank Capacity: Not reported
 Date Installed: Not reported
 Close Date: Not reported
 Dispenser: Not reported

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS			
Direction					Direction				
Distance					Distance				
(ft.)					(ft.)				
Elevation	Site				Elevation	Site			
		Database(s)	EDR ID Number	EPA ID Number		Database(s)	EDR ID Number	EPA ID Number	
KLEINEN CO. INC (Continued)			U001599294		MCGRATH STEEL CO. (Continued)				U001599293
Corrosion Protection:	Not reported				Type of Fuel:	UNLEADED			
Spill Contamination Installed Date:	Not reported				Leak Detection:	None	Tank Construction:	Not reported	
Overflow Prevention Installed Date:	Not reported				Contact Name:	WILLIAM THOMAS	Telephone:	(415) 658-1677	
Piping Type:	Not reported				Total Tanks:	2	Region:	STATE	
Piping Aboveground:	Not reported				Facility Type:	2	Other Type:	REINF. STEEL FABRICA	
Piping Underground:	Not reported								
Piping Construction:	Not reported								
Piping Construction Aboveground:	Not reported								
Piping Construction Underground:	Not reported								
Piping Material:	Not reported								
Other Piping Material:	Not reported								
Piping Material Aboveground:	Not reported								
Piping Material Underground:	Not reported								
Pipe Leak Detection:	Not reported								
Estimated Last Date Used:	Not reported								
Estimated Quantity Remaining:	Not reported								
Inert Filing:	Not reported								
Jurisdiction:	Not reported								
Other Tank System:	Not reported								
Other Tank Leak Detection:	Not reported								
Other Pipe Leak Detection:	Not reported								
Methanol Compatible:	Not reported								
X95 MCGRATH STEEL CO.	WSW 6655 HOLLIS ST EMERYVILLE, CA 94608	LUST Cortese CA FID UST	B101824441 N/A	X97 ROLLER PRESS INC	WSW 6647 HOLLIS ST 1B-1/4 1175 ft. Lower	EMERYVILLE, CA 94608	HAZNET	B102816311 N/A	
1B-1/4 1171 ft.									
Lower	Site 2 of 5 in cluster X				Site 4 of 5 in cluster X				
	LUST Alameda County: Region : ALAMEDA Facility ID : RD0000063								
	CORTESE: Reg Id: 01-2283 Region: CORTESE Reg By: Leaking Underground Storage Tanks								
X96 MCGRATH STEEL CO.	WSW 6655 HOLLIS ST EMERYVILLE, CA 94608	HIST UST	U001599293 N/A						
1B-1/4 1171 ft.									
Lower	Site 3 of 5 in cluster X								
	UST HIST: Facility ID: 67530 Tank Num: 1 Tank Capacity: 2000 Tank Used for: WASTE Type of Fuel: Not Reported Leak Detection: None Contact Name: WILLIAM THOMAS Total Tanks: 2 Facility Type: 2	Container Num: 1 Year Installed: 1981 Telephone: (415) 658-1677 Region: STATE Other Type: REINF. STEEL FABRICA							
	Facility ID: 67530 Tank Num: 2 Tank Capacity: 2000 Tank Used for: PRODUCT	Container Num: 2 Year Installed: 1981							

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS		
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number	
Distance		EPA ID Number	Distance (ft.)		EPA ID Number	
Elevation	Site		Elevation	Site		
ROLLER PRESS INC (Continued)		S102B16311	RESIDENCE (Continued)		U003802885	
Gepaid:	CAL000087622		Manufacturer:	Not reported		
Tepaid:	CAD070146432		Other Interior Lining:	Not reported	Data Installed:	Not reported
Gen County:	1		Receive Date:	1/27/93 0:00:00	Close Date:	2/10/93 0:00:00
Tad County:	1		Owner Name:	Not reported		
Tons:	.0625		Certified Date:	12/2/93 0:00:00		
Category:	Photochemicals/photoprocessing waste		Flag:	CLOSED		
Disposal Method:	Treatment, Incineration		Other Corrosion Protection:	Not reported		
Contact:	ROBERT WALE		Drop Tube:	Not reported		
Telephone:	(510) 654-2426		Strike Plate:	Not reported	Dispenser:	Not reported
Mailing Address:	6647 HOLLIS ST EMERYVILLE, CA 94608 - 1031		Contents A:	Not reported		
County	1		Contents B:	Not reported		
Gepaid:	CAL000087622		Contents C:	Not reported		
Tepaid:	CAD070146432		Mailing Name:	Not reported		
Gen County:	1		Mailing Address:	Not reported		
Tad County:	1		Other Substance:	Not reported		
Tons:	.0625		Tank Construction Type:	Not reported		
Category:	Photochemicals/photoprocessing waste		Tank Material:	Not reported		
Disposal Method:	Treatment, Incineration		Interior Lining:	Not reported		
Contact:	ROBERT WALE		Corrosion Protection:	Not reported		
Telephone:	(510) 654-2426		Spill Contamination Installed Date:	Not reported		
Mailing Address:	6647 HOLLIS ST EMERYVILLE, CA 94608 - 1031		Overflow Prevention Installed Date:	Not reported		
County	1		Piping Type:	Not reported		
The CA HAZNET database contains 1 additional record for this site. Please contact your EDR Account Executive for more information.			Piping Aboveground:	Not reported		
			Piping Underground:	Not reported		
			Piping Construction:	Not reported		
			Piping Construction Aboveground:	Not reported		
			Piping Construction Underground:	Not reported		
			Piping Material:	Not reported		
			Other Piping Material:	Not reported		
			Piping Material Aboveground:	Not reported		
			Piping Material Underground:	Not reported		
			Pipe Leak Detection:	Not reported		
			Estimated Leak Date Used:	Not reported		
			Estimated Quantity Remaining:	Not reported		
			Inert Filling:	Not reported		
			Jurisdiction:	Not reported		
			Other Tank System:	Not reported		
			Other Tank Leak Detection:	Not reported		
			Other Pipe Leak Detection:	Not reported		
			Methanol Compatible:	Not reported		
98 South 1265-1269 OCEAN AVENUE 1/8-1/4 EMERYVILLE, CA 94608 Higher	EMERYVILLE REDEVELOPMENT AGENCY	HAZNET S103962776 N/A	Y100 West 1/8-1/4 1203 ft. Lower	UNITECH AUTO SERVICE 753 FOLGER AVE BERKELEY, CA 94710 Site 1 of 3 in cluster Y	HAZNET S104576233 N/A	
HAZNET: Gepaid: Tepaid: Gen County: Tad County: Tons: Category: Disposal Method: Contact: Telephone: Mailing Address: County	CAC000924384 CAD962042475 1 Solano 25.2640 Asbestos-containing waste Disposal Land Fill Not reported (000) 000-0000 2200 POWELL ST. #1200 EMERYVILLE, CA 94608 1					
X99 WSW 2100 GREEN STREET 1/8-1/4 , CA 1197 ft. Lower	RESIDENCE UST San Francisco County: Facility ID: 1207 Tank ID: Not reported	UST U003802885 N/A				
	Case Number: Not reported	Tank Capacity: Not reported				

Map ID Direction Distance Distance (ft.) Elevation	MAP FINDINGS		Map ID Direction Distance Distance (ft.) Elevation	MAP FINDINGS			
Site	Database(s)	EDR ID Number EPA ID Number	Site	Database(s)	EDR ID Number EPA ID Number		
UNITECH AUTO SERVICE (Continued)				S104576233			
County	1				S102008199		
Z101 WSW 1/8-1/4 1294 ft. Lower	HILLHOUSE CONSTRUCTION 1401 88TH ST EMERYVILLE, CA 94608 HAZNET: Gepaid: CAC002193089 Tepaid: CAD028409019 Gen County: 1 Tsd County: Los Angeles Tons: .2293 Category: Unspecified oil-containing waste Disposal Method: Transfer Station Contact: HILLHOUSE CONSTRUCTION Telephone: (408) 784-0250 Mailing Address: 376 MARTIN AVE SANTA CLARA, CA 95050 County	HAZNET	S105084214 N/A	KRENZ INC (Continued) Lead Agency: N/A NPL: Not reported SIC: 34 MANU - FABRICATED METAL PRODUCTS Facility Type: N/A Type Name: Not reported Staff Member Responsible for Site: RJONES1 Supervisor Responsible for Site: Not reported Region Water Control Board: SF - SAN FRANCISCO BAY Access: Uncontrolled Contess: U Hazardous Ranking Score: Not reported Date Site Hazard Ranked: Not reported Groundwater Contamination: Unknown No. of Contamination Sources: 1 Lat/Long: 0° 0' 0.00" / 0° 0' 0.00" Le/Mong Method: Not reported State Assembly District Code: Not reported State Senate District: Not reported	Not reported		
The CAL-SITES database may contain additional details for this site. Please contact your EDR Account Executive for more information.							
Z102 WSW 1/8-1/4 1212 ft. Lower	ELLIS PARTNER 6589 HOLLIS ST EMERYVILLE, CA 94608 HAZNET: Gepaid: CAC001189104 Tepaid: CAL000027741 Gen County: 1 Tsd County: 5 Tons: 32.0264 Category: Asbestos-containing waste Disposal Method: Disposal, Land Fill Contact: ELLIS PARTNER Telephone: (415) 391-9800 Mailing Address: 433 CALIFORNIA ST STE 610 SAN FRANCISCO, CA 94101 County	HAZNET	S103962707 N/A	AA104 NW 1/8-1/4 1231 ft. Lower	WAREHAM DEVELOPMENT 2928 7TH ST BERKELEY, CA 94704 Site 1 of 2 in cluster AA HAZNET: Gepaid: CAC001268248 Tepaid: CAL000027741 Gen County: 1 Tsd County: 5 Tons: 15.1704 Category: Asbestos-containing waste Disposal Method: Disposal, Land Fill Contact: WAREHAM DEVELOPMENT Telephone: (000) 000-0000 Mailing Address: 1120 NYE STE 400 SAN RAFAEL, CA 94901 County	HAZNET S103650090 N/A	
W103 WNW 1/8-1/4 1229 ft. Lower	KRENZ INC ASHBY AT 8TH STREET BERKELEY, CA 94710 Site 2 of 2 in cluster W CAL-SITES: Facility ID: 01340101 Status: REFOA - DOES NOT REQUIRE DTSC ACTION OR OVERSITE ACTIVITY. REFERRED TO OTHER AGENCY LEAD Status Date: 06/23/1994 Lead: Not reported Region: 2 - BERKELEY Branch: NC - NORTH COAST File Name: Not reported Status Name: PROPERTY/SITE REFERRED TO ANOTHER AGENCY	CAL-SITES	S102008199 N/A	Tons: 63.2100 Category: Asbestos-containing waste Disposal Method: Disposal, Land Fill Contact: WAREHAM DEVELOPMENT Telephone: (000) 000-0000 Mailing Address: 1120 NYE STE 400 SAN RAFAEL, CA 94901 County			

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance (ft.)		EPA ID Number	Distance (ft.)		EPA ID Number
Elevation	Site		Elevation	Site	
AA105 NW 1/8-1/4 1231 ft. Lower	ROCHE DIAGNOSTICS CORPORATION 2929 7TH ST BERKELEY, CA 94710 Site 2 of 6 In cluster AA RCRIS: Owner: DR PETER KASPAR (510) 883-7979 EPA ID: CAR000073387 Contact: MONIQUE VANHOEK (510) 883-7958 Classification: Small Quantity Generator Used Oil Recyc: No TSDF Activities: Not reported Violation Status: No violations found	RCRIS-SQG	1004675480 CAR000073387	ROCHE DIAGNOSTICS (Continued) Mailing Address: 2929 7TH ST., STE. 100 BERKELEY, CA 94710 County: 1 Gepaid: CAL000194549 Tepaid: CAD044429835 Gen County: 1 Tsd County: Los Angeles Tons: 0.25 Category: Other organic solids Disposal Method: Disposal, Other Contact: ROCHE DIAGNOSTICS Telephone: (925) 730-8000 Mailing Address: 2929 7TH ST., STE. 100 BERKELEY, CA 94710 County: 1 Gepaid: CAL000194549 Tepaid: CAD044429835 Gen County: 1 Tsd County: Los Angeles Tons: 0.1125 Category: Laboratory waste chemicals Disposal Method: Disposal, Other Contact: ROCHE DIAGNOSTICS Telephone: (925) 730-8000 Mailing Address: 2929 7TH ST., STE. 100 BERKELEY, CA 94710 County: 1	B104581989
AA106 NW 1/8-1/4 1231 ft. Lower	ROCHE DIAGNOSTICS 2929 7TH ST BERKELEY, CA 94710 Site 3 of 6 In cluster AA HAZNET: Gepaid: CAL000194549 Tepaid: CAD044429835 Gen County: 1 Tsd County: Los Angeles Tons: 0.0025 Category: Off-specification, aged, or surplus inorganics Disposal Method: Disposal, Other Contact: ROCHE DIAGNOSTICS Telephone: (925) 730-8000 Mailing Address: 2929 7TH ST., STE. 100 BERKELEY, CA 94710 County: 1 Gepaid: CAL000194549 Tepaid: CAD044429835 Gen County: 1 Tsd County: Los Angeles Tons: 0.001 Category: Other inorganic solid waste Disposal Method: Disposal, Other Contact: ROCHE DIAGNOSTICS Telephone: (925) 730-8000 Mailing Address: 2929 7TH ST., STE. 100 BERKELEY, CA 94710 County: 1 Gepaid: CAL000194549 Tepaid: CAD044429835 Gen County: 1 Tsd County: Los Angeles Tons: 2.025 Category: Halogenated solvents (chloroform, methyl chloride, perchloroethylene, etc.) Disposal Method: Disposal, Other Contact: ROCHE DIAGNOSTICS Telephone: (925) 730-8000	HAZNET	S104581989 N/A	The CA HAZNET database contains 1 additional record for this site. Please contact your EDR Account Executive for more information.	
AA107 NW 1/8-1/4 1231 ft. Lower	PIC GROUP 2929 7TH ST STE 130 BERKELEY, CA 94710 Site 4 of 6 In cluster AA HAZNET: Gepaid: CAL000182438 Tepaid: CAD009452657 Gen County: 1 Tsd County: San Mateo Tons: .0417 Category: Unspecified organic liquid mixture Disposal Method: Recycler Contact: PIC GROUP Telephone: (510) 646-8266 Mailing Address: 2929 7TH ST STE 130 BERKELEY, CA 94710 County: 1	PIG GROUP	HAZNET	S105091213 N/A	
Y108 West 1/8-1/4 1234 ft. Lower	TIRE AND ALIGNMENT CENTER 751 FOLGER BERKELEY, CA 94710 Site 2 of 3 In cluster Y	Y108	HAZNET	S100876093 N/A	

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction			Direction			Direction		
Distance			Distance			Distance (ft.)		
Distance (ft.)			Elevation		Site	Elevation		Site
Elevation			Database(s)	EDR ID Number	EPA ID Number	Database(s)	EDR ID Number	EPA ID Number
TIRE AND ALIGNMENT CENTER (Continued)			S100878095			B E P EMERYVILLE TECH L L C (Continued)		
HAZNET:						Mailing Address: 11100 WEST AIRPORT BLVD STAFFORD, TX 77477		1000429725
Gepaid:	CAL000085632					County 1		
Tepaid:	CAD083168728					Gepaid: CAD066564824		
Gen County:	1					Tepaid: CAD009452857		
Tsd County:	Stanislaus					Gen County: 1		
Tons:	.6255					Tsd County: San Mateo		
Category:	Unspecified oil-containing waste					Tons: .2293		
Disposal Method:	Recycler					Category: Waste oil and mixed oil		
Contact:	TIMS AUTO ELECTRIC					Disposal Method: Recycler		
Telephone:	(000) 000-0000					Contact: GROVE ITALIA SPA		
Mailing Address:	751 FOLGER AVE BERKELEY, CA 94710 - 2809					Telephone: (214) 740-8000		
County	1					Mailing Address: 11100 WEST AIRPORT BLVD STAFFORD, TX 77477		
Gepaid:	CAL000085632					County 1		
Tepaid:	CAD083168728					Gepaid: CAD066564824		
Gen County:	1					Tepaid: CAD059494310		
Tsd County:	Stanislaus					Gen County: 1		
Tons:	.8340					Tsd County: Santa Clara		
Category:	Unspecified oil-containing waste					Tons: .0050		
Disposal Method:	Treatment, Incineration					Category: Other inorganic solid waste		
Contact:	TIMS AUTO ELECTRIC					Disposal Method: Disposal, Other		
Telephone:	(000) 000-0000					Contact: GROVE ITALIA SPA		
Mailing Address:	751 FOLGER AVE BERKELEY, CA 94710 - 2809					Telephone: (214) 740-8000		
County	1					Mailing Address: 11100 WEST AIRPORT BLVD STAFFORD, TX 77477		
AB109 SW 6529 HOLLIS ST EMERYVILLE, CA 94608 1/8-1/4 1271 ft. Lower Site 1 of 3 in cluster AB			RCRIS-SQG 1000429725			County 1		
RCRIS:			FINDS CAD066564824			Gepaid: CAD066564824		
Owner:	B E P EMERYVILLE TECH L P		HAZNET			Tepaid: CAD059494310		
(415) 391-8800			CA SIC			Gen County: 1		
EPA ID:	CAD066564824					Tsd County: Santa Clara		
Contact:	ENVIRONMENTAL MANAGER					Tons: .0200		
Classification:	Small Quantity Generator					Category: Off-specification, aged, or surplus inorganics		
Used Oil Recyc:	No					Disposal Method: Disposal, Other		
TSDF Activities:	Not reported					Contact: GROVE ITALIA SPA		
Violation Status:	No violations found					Telephone: (214) 740-8000		
FINDS:						Mailing Address: 11100 WEST AIRPORT BLVD STAFFORD, TX 77477		
Other Pertinent Environmental Activity Identified at Site:						County 1		
Resource Conservation and Recovery Act Information system (RCRAINFO)						Gepaid: CAD066564824		
HAZNET:						Tepaid: CAD059494310		
Gepaid:	CAD066564824					Gen County: 1		
Tepaid:	CAD009452857					Tsd County: Santa Clara		
Gen County:	1					Tons: 15.5624		
Tsd County:	San Mateo					Category: Unspecified oil-containing waste		
Tons:	1.6545					Disposal Method: Disposal, Other		
Category:	Other organic solids					Contact: GROVE ITALIA SPA		
Disposal Method:	Recycler					Telephone: (214) 740-8000		
Contact:	GROVE ITALIA SPA					Mailing Address: 11100 WEST AIRPORT BLVD STAFFORD, TX 77477		
Telephone:	(214) 740-8000					County 1		
The CA HAZNET database contains 40 additional records for this site. Please contact your EDR Account Executive for more information.								

Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number
Distance		EPA ID Number
(ft.)		
Elevation	Site	

B E P EMERYVILLE TECH L L C (Continued)
1000429725

SLIC Region 2:
 Facility ID: 01S0296
 Region: 2
 Facility Status: Inactive
 Staff: BG
 Last Site Update: 06/03/19
 NPL Status: Not an NPL site
 Case List: SLIC
 Date Closed: Not reported
 Abate Method: Not reported
 Case Type: NT
 Contamination: Not reported
 Lead: RWQCB
 Contamination Level:
 Number of Municipal Wells Contaminated by Site: 0
 Number of Private Wells Contaminated by Site: 0
 Soil Removal Action Taken/Needed: 0
 Soil Removal or Contaminant Action Started:
 Soil Removal or Contaminant Action Completed: 0
 On-Site Groundwater Extraction or Containment is Needed: 0
 On-Site Groundwater Extraction or Containment Started:
 Off-Site Groundwater Extraction or Containment is Needed:
 Off-Site Groundwater Extraction or Containment Started:
 Length of Contamination Plume (Feet): 0
 Depth of Contamination Plume (Feet): 0
 Wells Closed Due To Contamination of Site:
 Date of Wells Closure:
 Nearest Public or Private Drinking Water Well (Feet): 0
 Under Jurisdiction of Lead Agency Date:
 Latitude/Longitude: 38 / -122
 Flow Rate: 0
 Flow Date:
 Percent of Contaminants Contained: 0
 Contaminant Type:
 EPA ID:
 Stages of Site Investigation Process Initiated:
 Begun Characterization: Not reported
 Completed Characterization: Not reported
 Begun Remediation: Not reported
 Completed Remediation: Not reported
 Submitted Remediation Plan: Not reported
 Approved Remediation Plan: Not reported
 Begun Final Remedial Action: Not reported
 Completed Final Remedial Action: Not reported
 Facility Desc: Not reported
 Comment: Not reported

AA110 TULIP PUBLISHING & GRAPHICS INC
 NW 2920 7TH STREET
 1/8-1/4 BERKELEY, CA 94710
 1298 ft.
 Lower Site 5 of 6 in cluster AA

HAZNET S103992794
 N/A

Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number
Distance		EPA ID Number

TULIP PUBLISHING & GRAPHICS INC (Continued)
S103992794

HAZNET:
 Gepaid: CAL000172396
 Tepaid: CAD003963582
 Gen County: 1
 Tad County: Santa Clara
 Tons: .0417
 Category: Photochemicals/photoprocessing waste
 Disposal Method: Recycler
 Contact: TULIP PUBLISHING & GRAPHICS IN
 Telephone: (510) 696-0000
 Mailing Address: 2920 7TH STREET
 BERKELEY, CA 94710
 County 1

AA111 TAYLOR & NG
 NW 2919 7TH STREET
 BERKELEY, CA 94710
 1/8-1/4
 1298 ft.
 Lower

HAZNET S102805498
 N/A

Site 6 of 6 in cluster AA

HAZNET:
 Gepaid: CAC001133592
 Tepaid: CAT080011059
 Gen County: 1
 Tad County: Los Angeles
 Tons: .3500
 Category: Off-specification, aged, or surplus organics
 Disposal Method: Recycler
 Contact: TAYLOR & NG
 Telephone: (000) 000-0000
 Mailing Address: 2919 7TH STREET
 BERKELEY, CA 94710
 County 1
 Gepaid: CAC001133592
 Tepaid: CAT080011059
 Gen County: 1
 Tad County: Los Angeles
 Tons: .4586
 Category: Unspecified oil-containing waste
 Disposal Method: Recycler
 Contact: TAYLOR & NG
 Telephone: (000) 000-0000
 Mailing Address: 2919 7TH STREET
 BERKELEY, CA 94710
 County 1

AC112 UNION OIL CO, CALIF.
 NE 901 ASHBY AVE
 1/8-1/4 BERKELEY, CA 94710
 1302 ft.
 Higher Site 1 of 6 in cluster AC

HAZNET S101580156
 LUST N/A
 Cortese
 CA SLIC
 CA FID UST
 CA WDS

State LUST:
 Cross Street: Not reported
 City Leaked: 0
 Case Number: 01S0173

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS		
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number	
Distance		EPA ID Number	Distance (ft.)		EPA ID Number	
Distance (ft.)			Elevation			
Elevation	Site		Site			
UNION OIL CO, CALIF. (Continued)		8101580158	UNION OIL CO, CALIF. (Continued)		8101580158	
Reg Board:	San Francisco Bay Region		Facility Id:	01SO173		
Chemical:	Gasoline		Entered Date:	/ /		
Lead Agency:	Regional Board		Facility Status:	Leak being confirmed		
Local Agency:	D1020		Maximum Soil Concentration:	0		
Case Type:	Undefined		Maximum Groundwater Impact:	0		
Status:	Leak being confirmed		County:	Alameda		
County:	Alameda		Current Benzene:	0		
Review Date:	1/29/1997	Confirm Leak:	1/29/1997	MTBE Detected in GW:	No	
Workplan:	Not reported	Prelim Assess:	Not reported	MTBE Detected in Soil:	Not reported	
Pollution Char:	Not reported	Remed Plan:	Not reported	MTBE:	0	
Remed Action:	Not reported	Monitoring:	Not reported	MTBE Qualify:	0	
Close Date:	Not reported					
Release Date:	1/1/1985					
Cleanup Fund Id:	Not reported					
Discover Date:	Not reported					
Enforcement DI:	Not reported					
Enf Type:	Not reported					
Enter Date:	Not reported					
Funding:	Not reported					
Staff Initials:	UNK					
How Discovered:	Tank Closure					
How Stopped:	Close Tank					
Interim:	Not reported					
Leak Cause:	Unknown					
Leak Source:	Unknown					
MTBE Date:	Not reported					
Max MTBE GW:	Not reported					
MTBE Tested:	Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.					
Priority:	Not reported					
Local Case #:	Not reported					
Beneficial:	Not reported					
Staff:	CTH					
GW Qualifies:	Not reported					
Max MTBE Soil:	Not reported					
Soil Qualifies:	Not reported					
Hydr Basin #:	Not reported					
Operator:	Not reported					
Oversight Prgm:	Local Implementing Agency UST (includes non-LOP cases within LOP jurisdiction)					
Oversight Prgm:	LIA					
Review Date:	Not reported					
Stop Date:	Not reported					
Work Suspended:	N					
Responsible Party:	BLANK RP					
RP Address:	Not reported					
Global Id:	T0600191508					
Org Name:	Not reported					
Contact Person:	Not reported					
MTBE Conc:	0					
Mtbe Fuel:	1					
Wstar System Name:	Not reported					
Well Name:	Not reported					
Distance To Lust:	5346.1629304371291805509647057					
Waste Discharge Global ID:	Not reported					
Waste Disch Assigned Name:	Not reported					
LUST Region 2:			CORTESE:			
Region:	2		Reg Id:	01-1444		
			Region:	CORTESE		
			Reg By:	Leaking Underground Storage Tanks		

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS			
Direction	Database(s)	EDR ID Number	EPA ID Number	Distance (ft.)	Database(s)	EDR ID Number	EPA ID Number	Elevation	Site
UNION OIL CO, CALIF. (Continued)					UNION OIL CO, CALIF. (Continued)				
FID:				S101580158					
Facility ID:	01001558	Regulate ID:	00012789						
Reg By:	Active Underground Storage Tank Location								
Contess Code:	Not reported	SIC Code:	Not reported						
Status:	Active	Facility Tel:	(415) 843-6809						
Mail To:	Not reported								
	2175 NORTH CALIFORNIA ST BERKELEY, CA 94710								
Contact:	Not reported	Contact Tel:	Not reported						
DUNS No:	Not reported	NPDES No:	Not reported						
Creation:	10/22/83	Modified:	00/00/00						
EPA ID:	Not reported								
Comments:	Not reported								
SLIC Region 2:									
Facility ID:	01S0173								
Region:	2								
Facility Status:	Active		Not reported						
Staff:	BG		Not reported						
Last Site Update:	01/31/18								
NPL Status:	Not an NPL site	Discovery Data:	Not reported						
Case List:	SLIC	Imaged:	No						
Date Closed:	Not reported	Cost Recovery:	No						
Abate Method:	Not reported	Substance:	Not reported						
Case Type:	TK	Sample Date:	Not reported						
Contamination:	Not reported								
Lead:	RWQCB								
Contamination Level:									
Number of Municipal Wells Contaminated by Site:	0								
Number of Private Wells Contaminated by Site:	0								
Soil Removal Action Taken/Needed:	0								
Soil Removal or Contaminant Action Started:									
Soil Removal or Contaminant Action Completed:	0								
On-Site Groundwater Extraction or Containment is Needed:	0								
On-Site Groundwater Extraction or Containment Started:									
Off-Site Groundwater Extraction or Containment is Needed:									
Off-Site Groundwater Extraction or Containment Started:									
Length of Contamination Plume (Feet):	0								
Depth of Contamination Plume (Feet):	0								
Wells Closed Due To Contamination of Site:									
Data of Wells Closure:									
Nearest Public or Private Drinking Water Well (Feet):	0								
Under Jurisdiction of Lead Agency Date:									
Latitude/Longitude:	38/-122								
Flow Rate:	0								
Flow Date:									
Percent of Contaminants Contained:	0								
Contaminant Type:									
EPA ID:									
Stages of Site Investigation Process Initiated:									
Began Characterization:	Not reported								
Completed Characterization:	Not reported								
Began Remediation:	Not reported								
Completed Remediation:	Not reported								
Submitted Remediation Plan:	Not reported								
Approved Remediation Plan:	Not reported								
Began Final Remedial Action:	Not reported								
					AC113	TOSCO CORPORATION SS#31305		HAZNET	S103881820
					NE	901 ASHBY AVE			N/A
					1/8-1/4	BERKELEY, CA 94702			
					1302 ft.				
					Higher				
						Site 2 of 6 in cluster AC			
						HAZNET:			
						Gepaid:	CAL000181442		
						Tepaid:	CAD009486392		
						Gen County:	1		
						Tsd County:	7		
						Tone:	.5000		
						Category:	Empty containers less than 30 gallons		
						Disposal Method:	Recyclar		
						Contact:	TOSCO MARKETING		
						Telephone:	(602) 728-4180		
						Mailing Address:	P O BOX 52085		
							PHOENIX, AZ 85072 - 2085		
						County:	1		

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS			
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number				
Distance			Distance						
Distance (ft.)			Elevation						
Elevation	Site								
AC114 NE 1/8-1/4 1302 ft. Higher	SUPER-7 #24302 901 ASHBY AVE BERKELEY, CA 94710 Site 3 of 6 in cluster AC	LUST UST N/A	HAZNET UST U001598671 N/A	7 ELEVEN STORE 24302 (Continued)	LUST	8104577446			
	UST HIST: Facility ID: 12769 Tank Num: 1 Container Num: 24302-1-0 Tank Capacity: 12000 Year Installed: 1983 Tank Used for: PRODUCT Type of Fuel: REGULAR Tank Construction: Not reported Leak Detection: Stock Inventor, Vapor Sniff Well, Sensor Instrument, Pressure Test Contact Name: DUANE CHARITY Telephone: (415) 549-2730 Total Tanks: 4 Region: STATE Facility Type: 1 Other Type: Not reported			HAZNET: Facility ID: 12769 Tank Num: 2 Container Num: 24302-2-0 Tank Capacity: 12000 Year Installed: 1983 Tank Used for: PRODUCT Type of Fuel: UNLEADED Tank Construction: Not reported Leak Detection: Stock Inventor, Vapor Sniff Well, Pressure Test Contact Name: DUANE CHARITY Telephone: (415) 549-2730 Total Tanks: 4 Region: STATE Facility Type: 1 Other Type: Not reported	Gepaid: CAL000083224 Tepaid: CAD008452857 Gen County: 1 Tad County: San Mateo Tons: 3.4319 Category: Oil/water separation sludge Disposal Method: Recycler Contact: THE SOUTHLAND CORPORATION Telephone: (208) 251-9155 Mailing Address: PO BOX 711 DALLAS, TX 75221 - 0711 County: 1				
	Facility ID: 12769 Tank Num: 3 Container Num: 24302-3-0 Tank Capacity: 12000 Year Installed: 1983 Tank Used for: PRODUCT Type of Fuel: PREMIUM Tank Construction: Not reported Leak Detection: Stock Inventor, Vapor Sniff Well, Pressure Test Contact Name: DUANE CHARITY Telephone: (415) 549-2730 Total Tanks: 4 Region: STATE Facility Type: 1 Other Type: Not reported			Facility ID: 12769 Tank Num: 4 Container Num: 24302-4-0 Tank Capacity: 12000 Year Installed: 1983 Tank Used for: PRODUCT Type of Fuel: DIESEL Tank Construction: Not reported Leak Detection: Stock Inventor, Vapor Sniff Well, Sensor Instrument, Pressure Test Contact Name: DUANE CHARITY Telephone: (415) 549-2730 Total Tanks: 4 Region: STATE Facility Type: 1 Other Type: Not reported	Gepaid: CAC002291225 Tepaid: CAT080013352 Gen County: 1 Tad County: Los Angeles Tons: .4170 Category: Aqueous solution with less than 10% total organic residues Disposal Method: Recycler Contact: 7 ELEVEN INC Telephone: (503) 977-7713 Mailing Address: 10220 S W GREENBURG RD PORTLAND, OR 97233 County: 1				
AC115 NE 1/8-1/4 1302 ft. Higher	7 ELEVEN STORE 24302 901 ASHBY AVE BERKELEY, CA 94710 Site 4 of 6 in cluster AC	HAZNET N/A	AC116 NE 1/8-1/4 1302 ft. Higher	SUPER 7 901 ASHBY AVE BERKELEY, CA 94704 Site 5 of 6 in cluster AC	LUST	8102438242 N/A			
				State LUST: Cross Street: Not reported Qty Leaked: Not reported Case Number: 01-1444 Reg Board: San Francisco Bay Region Chemical: Gasoline Lead Agency: Local Agency Local Agency: 01020 Case Type: Other ground water affected Status: Remedial action (cleanup) in progress County: Alameda Abate Method: Remove Free Product - remove floating product from water table, Pump and Treat Ground Water - generally employed to remove dissolved contaminants, Vent Soil - bore holes in soil to allow volatilization of contaminants					

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

SUPER 7 (Continued)

Review Date: Not reported Confirm Leak: Not reported
Workplan: 5/8/1986 Prelim Assess: 5/8/1986
Pollution Char: 10/14/1986 Remed Plan: 10/14/1986
Remed Action: Not reported Monitoring: Not reported
Close Date: Not reported
Release Date: 8/20/1986
Cleanup Fund Id: Not reported
Discover Date: 8/20/1986
Enforcement Dt: Not reported
Enf Type: Not reported
Enter Date: 8/20/1986
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank
Interim: Yes
Leak Cause: Structure Failure
Leak Source: Tank
MTBE Date: 8/28/1998
Max MTBE GW: 72000
MTBE Tested: MTBE Detected. Site tested for MTBE & MTBE detected
Priority: Not reported
Local Case #: 01-1444
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgm: Local Implementing Agency UST (Includes non-LOP cases within LOP jurisdiction)
Oversight Prgm: LIA
Review Date: 8/2/2001
Stop Date: 8/20/1986
Work Suspended: N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T0600101333
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 1
Mtbe Fuel: 1
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 6631.4661535155892125206488731
Waste Discharge Global Id: Not reported
Waste Disch Assigned Name: Not reported

LUST Region 2:

Region: 2
Facility Id: 01-1444
Entered Date: 08/20/1986
Facility Status: Remedial action (cleanup) in progress
Maximum Soil Concentration: 820
Maximum Groundwater Impact: 590000
County: Alameda
Current Benzene: 6300

MAP FINDINGS

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

SUPER 7 (Continued)

MTBE Detected in GW: 590000
MTBE Detected in Soil: Not reported
MTBE: 0
MTBE Qualify: 72000

AC117
NE
1/8-1/4
1302 ft.
Higher

UNOCAL - HONG DU'S #7331
901 ASHBY AVE
BERKELEY, CA 94710

UST U003805168
N/A

Site 6 of 6 in cluster AC

State UST:
Facility ID: 181
Total Tanks: f
Region: STATE
Local Agency: 1020

AB118
SW
1/8-1/4
1304 ft.
Lower

HOLLIS STREET INVESTORS
6500 HOLLIS ST
EMERYVILLE, CA

LUST S105194055
N/A

Site 2 of 3 in cluster AB

LUST Region 2:
Region: 2
Facility Id: 01-0773
Entered Date: 03/12/1992
Facility Status: Signed off, remedial action completed or deemed unnecessary
Maximum Soil Concentration: 95
Maximum Groundwater Impact: 1300
County: Alameda
Current Benzene: Not reported
MTBE Detected in GW: 1300
MTBE Detected in Soil: Not reported
MTBE: 0
MTBE Qualify: Not reported

AB119
SW
1/8-1/4
1304 ft.
Lower

HOLLIS STREET INVESTORS
6500 HOLLIS ST
EMERYVILLE, CA 94608

LUST S105191398
N/A

Site 3 of 3 in cluster AB

State LUST:
Cross Street: 84TH ST
City Leaked: Not reported
Case Number: 01-0773
Reg Board: San Francisco Bay Region
Chemical: Gasoline
Lead Agency: Local Agency
Local Agency: 01000
Case Type: Other ground water affected
Status: Signed off, remedial action completed or deemed unnecessary
County: Alameda
Abate Method: Excavate and Treat - remove contaminated soil and treat (includes spreading or land farming)
Review Date: Not reported
Workplan: 3/8/1989

Confirm Leak: Not reported
Prelim Assess: 3/8/1989

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

HOLLIS STREET INVESTORS (Continued)

Pollution Char: Not reported
Remed Action: Not reported
Close Date: 9/25/1997
Release Date: 7/15/1987
Cleanup Fund Id: Not reported
Discover Date: 7/15/1987
Enforcement Dt: Not reported
Env Type: Not reported
Enter Date: 3/12/1992
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank
Interim: Yes
Leak Cause: Structure Failure
Leak Source: Tank
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.
Priority: Not reported
Local Case #: 3792
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgm: Local Oversight Program UST
Oversight Prgm: LOP
Review Date: 6/6/2000
Stop Date: 7/24/1987
Work Suspended: N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T0600100710
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mtns Fuel: 1
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 8740.317859358471503898494126
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

5105181395

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

HOWLETT WORKS (Continued)

HAZNET:
Gepaid: CAC002205849
Tepaid: CAD009468392
Gen County: 1
Tsd County: 7
Tons: 6.2500
Category: Other empty containers 30 gallons or more
Disposal Method: Recyclar
Contact: GEORGE H HOWLETT
Telephone: (000) 000-0000
Mailing Address: 746 FOLGER AVE
BERKELEY, CA 94710
County: 1

122
SSW
1/4-1/2
1329 ft.
Lower

REDEVELOPMENT AGENCY

CA SIC: 5101641318
N/A

SLIC Region 2:
Facility ID: 01SD290
Region: 2
Facility Status: Inactive
Staff: BG
Last Site Update: 02/01/19
NPL Status: Not an NPL site
Case List: SLIC
Date Closed: Not reported
Abata Method: 108952
Case Type: NT
Contamination: Not reported
Lead: RWQCB
Contamination Level:
Number of Municipal Wells Contaminated by Site: 0
Number of Private Wells Contaminated by Site: 0
Soil Removal Action Taken/Needed: 0
Soil Removal or Contaminant Action Started:
Soil Removal or Contaminant Action Completed: 0
On-Site Groundwater Extraction or Containment Is Needed: 0
On-Site Groundwater Extraction or Containment Started:
Off-Site Groundwater Extraction or Containment Is Needed:
Off-Site Groundwater Extraction or Containment Started:
Length of Contamination Plume (Feet): 0
Depth of Contamination Plume (Feet): 0
Wells Closed Due To Contamination of Site:
Data of Wells Closure:
Nearest Public or Private Drinking Water Well (Feet): 0
Under Jurisdiction of Lead Agency Date:
Latitude/Longitude: 38 / -122
Flow Rate:
Flow Date:
Percent of Contaminants Contained: 0
Contaminant Type:
EPA ID:
Stages of Site Investigation Process Initiated:
Begin Characterization: Not reported
Completed Characterization: Not reported

120
East
1/8-1/4
1310 ft.
Higher

CA FID UST 5101624412
N/A

Y121
West
1/8-1/4
1317 ft.
Lower

HAZNET 5105084570
N/A

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS		
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number	
Distance (ft.)	EPA ID Number	Elevation	Distance (ft.)	EPA ID Number	Elevation	
REDEVELOPMENT AGENCY (Continued)						
S101641316						
Begun Remediation:	Not reported		Review Date :	10/26/1999		
Completed Remediation:	Not reported		Stop Date :	7/24/1992		
Submitted Remediation Plan:	Not reported		Work Suspended:	N		
Approved Remediation Plan:	Not reported		Responsible Party:	BLANK RP		
Begun Final Remedial Action:	Not reported		RP Address:	Not reported		
Completed Final Remedial Action:	Not reported		Global Id:	Y0800101778		
Facility Desc:	RESIDENTIAL		Org Name:	Not reported		
Comment:	Not reported		Contact Person:	Not reported		
RIX INDUSTRIES-FRANK DEWOLF (Continued)						
1000119978						
Began Remediation:	Not reported		MTBE Conc.:	0		
Completed Remediation:	Not reported		Mtbe Fuel:	1		
Submitted Remediation Plan:	Not reported		Water System Name:	Not reported		
Approved Remediation Plan:	Not reported		Well Name:	Not reported		
Begun Final Remedial Action:	Not reported		Distance To Lust:	7935.856702443830815499242278		
Completed Final Remedial Action:	Not reported		Waste Discharge Global ID:	Not reported		
Facility Desc:	RESIDENTIAL		Waste Disch Assigned Name:	Not reported		
Comment:	Not reported		LUST Alameda County:			
AD123 RIX INDUSTRIES-FRANK DEWOLF						
SW 6460 HOLLIS ST	HAZNET	1000119978	Region :	ALAMEDA		
1/4-1/2 EMERYVILLE, CA 94608	LUST	N/A	Facility ID :	R00000062		
1360 ft.	Cortese		HAZNET:			
Lower Site 1 of 2 In cluster AD	CA FID UST		Gepaid:	CAD962038770		
State LUST:			Tepaid:	CAD960887418		
Cross Street:	Not reported		Gen County:	1		
City Leaked:	Not reported		Tsd County:	1		
Case Number:	01-1918		Tons:	.8255		
Reg Board:	San Francisco Bay Region		Category:	Waste oil and mixed oil		
Chemical:	Gasoline		Disposal Method:	Recycler		
Lead Agency:	Local Agency		Contact:	BERT OTTERSON		
Local Agency:	01000		Telephone:	(510) 858-5275		
Case Type:	Other ground water affected		Mailing Address:	4900 INDUSTRIAL WAY BENICIA, CA 94510		
Status:	Preliminary site assessment underway		County:	1		
County:	Alameda		CORTESE:			
Abate Method:	No Action Taken - no action has as yet been taken at the site		Reg id:	01-1918		
Review Date:	Not reported	Confirm Leak:	Region:	CORTESE		
Workplan:	9/1/1994	Prelim Assess:	Reg By:	Leaking Underground Storage Tanks		
Polution Char:	Not reported	Remed Plan:	FID:			
Remed Action:	Not reported	Monitoring:	Facility ID:	01002469	Regulate ID:	CAC941635
Close Date:	Not reported		Reg By:	Active Underground Storage Tank Location	SIC Code:	Not reported
Release Date:	11/2/1998		Corse Code:	Not reported	Facility Tel:	(415) 858-5275
Cleanup Fund Id:	Not reported		Status:	Active		
Discover Date:	7/24/1992		Mail To:	Not reported		
Enforcement Dt:	Not reported		Contact:	3 THE PARADE EMERYVILLE, CA 94604		
Enf Type:	Not reported		DUN No:	Not reported	Contact Tel:	Not reported
Enter Date:	2/17/1993		Creation:	Not reported	NPDES No:	Not reported
Funding:	Federal Funds		EPA ID:	Not reported	Modified:	00/00/00
Staff Initials:	UNK		Comments:	Not reported		
How Discovered:	Subsurface Monitoring					
How Stopped:	Close Tank					
Interim :	No					
Leak Cause:	Unknown					
Leak Source:	Piping					
MTBE Date :	Not reported					
Max MTBE GW :	Not reported					
MTBE Tested:	Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.					
Priority:	Not reported					
Local Case #:	376					
Beneficial:	Not reported					
Staff:	CTH					
GW Qualifies :	Not reported					
Max MTBE Soil :	Not reported					
Soil Qualifies :	Not reported					
Hydr Basin #:	Not reported					
Operator :	Not reported					
Oversight Prgm:	Local Oversight Program UST					
Oversight Prgm :	LOP					

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS				
Direction					Direction					
Distance					Distance (ft.)					
Elevation	Site	Database(s)	EDR ID Number	EPA ID Number	Elevation	Site	Database(s)	EDR ID Number	EPA ID Number	
RIX INDUSTRIES-FRANK DEWOLF (Continued)		1000119978			GRING PEST CONTROL (Continued)		ST05036482			
Facility ID: 01002469 Reg By: Active Underground Storage Tank Location Corse Code: Not reported Status: Active Mail To: Not reported PFS REAL EST 6939 42 EMERYVILLE, CA 94608 Contact: Not reported DUNs No: Not reported Creation: 10/22/93 EPA ID: Not reported Comments: Not reported	Regulate ID: D0065207 SIC Code: Not reported Facility Tel: (415) 396-3063				Cleanup Fund Id: Not reported Discover Date: 2/23/1987 Enforcement Dt: Not reported Ent Type: Not reported Enter Date: 1/24/1998 Funding: Federal Funds Staff Initia: UNK How Discovered: Tank Closure How Stopped: Close Tank Interi: No Leak Cause: Structure Failure Leak Source: Tank MTBE Date: Not reported Max MTBE GW: Not reported MTBE Tested: Site NOT Tested for MTBE includes Unknown and Not Analyzed. Priority: Not reported Local Case #: 01-0724 Beneficial: Not reported Staff: CTH GW Qualifies: Not reported Max MTBE Soil: Not reported Soil Qualifies: Not reported Hydr Basin #: Not reported Operator: Not reported Oversight Prgm: Local Implementing Agency UST (Includes non-LOP cases within LOP jurisdiction) Oversight Prgm: LIA Review Date: 1/24/1998 Stop Date: 2/23/1987 Work Suspended: N Responsible Party: BLANK RP RP Address: Not reported Global Id: T0600100668 Org Name: Not reported Contact Person: Not reported MTBE Conc: 0 Mtbe Fuel: 1 Water System Name: Not reported Well Name: Not reported Distance To Lust: 7510.615850831378448754064586 Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported					
AD124 SW 6460 HOLLIS ST 1/4-1/2 EMERYVILLE, CA 1360 ft. Lower	Site 2 of 2 in cluster AD	LUST	S104164016	N/A	LUST Region 2: Region: 2 Facility Id: 01-1816 Entered Date: 02/17/1993 Facility Status: Preliminary site assessment underway Maximum Soil Concentration: 19000 Maximum Groundwater Impact: 62000 County: Alameda Current Benzene: 4 MTBE Detected in GW: 62000 MTBE Detected in Soil: Not reported MTBE: 0 MTBE Qualify: Not reported					
AE125 West 741 FOLGER AVE 1/4-1/2 1376 ft. Lower	Site 1 of 2 in cluster AE	LUST	S105036462	N/A	LUST Region 2: Region: 2 Facility Id: 01-0724 Entered Date: 01/24/1998 Facility Status: Post remedial action monitoring in progress Maximum Soil Concentration: 150 Maximum Groundwater Impact: 933000 County: Alameda Current Benzene: 56800 MTBE Detected in GW: 933000 MTBE Detected in Soil: Not reported MTBE: 0 MTBE Qualify: Not reported					

Map ID Direction Distance Distance (ft.) Elevation	Site	MAP FINDINGS		Map ID Direction Distance Distance (ft.) Elevation	Site	MAP FINDINGS	
		Database(s)	EDR ID Number EPA ID Number			Database(s)	EDR ID Number EPA ID Number
AE128 West 1/4-1/2 1378 ft. Lower	GRING PEST CONTROL SERVICE, INC 741 FOLGER AVE BERKELEY, CA 94710 CORTESSE: Reg Id: 01-0724 Region: CORTESSE Reg By: Leaking Underground Storage Tanks	Cortese CA FID UST	\$101624609 N/A			MACBETH HARDWARE COMPANY (Continued)	5102432856
127 NE 1/4-1/2 1414 ft. Higher	MACBETH HARDWARE COMPANY 930 ASHBY AVE BERKELEY, CA State LUST: Cross Street: Not reported Qty Leaked: Not reported Case Number: 01-0931 Reg Board: San Francisco Bay Region Chemical: Gasoline Lead Agency: Local Agency Local Agency: 01020 Case Type: Soil only Status: Signed off, remedial action completed or deemed unnecessary County: Alameda Abate Method: No Action Taken - no action has as yet been taken at the site Review Date: Not reported Confirm Leak: Not reported Workplan: Not reported Prelim Assess: Not reported Pollution Char: Not reported Remed Plan: Not reported Remed Action: Not reported Monitoring: Not reported	LUST Cortese	5102432856 N/A			Oversight Prgm: LIA Review Date: 10/17/1995 Stop Date: 10/7/1987 Work Suspended: N Responsible Party: BLANK RP RP Address: Not reported Global Id: T0600100856 Org Name: Not reported Contact Person: Not reported MTBE Conc: 0 Mtbe Fuel: 1 Water System Name: Not reported Well Name: Not reported Distance To Lust: 6539.9134113642362387219084548 Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported	
						LUST Region 2: Region: 2 Facility Id: 01-0931 Entered Date: 10/07/1987 Facility Status: Signed off, remedial action completed or deemed unnecessary Maximum Soil Concentration: 30 Maximum Groundwater Impact: 0 County: Alameda Current Benzene: Not reported MTBE Detected In GW: No MTBE Detected In Soil: Not reported MTBE: 0 MTBE Quality: Not reported	
						CORTESSE: Reg Id: 01-0931 Region: CORTESSE Reg By: Leaking Underground Storage Tanks	
				128 SE 1/4-1/2 1428 ft. Higher	PCC 8400 SAN PABLO AVE OAKLAND, CA 94608	LUST N/A	
					State LUST: Cross Street: Not reported Qty Leaked: Not reported Case Number: 01-1142 Reg Board: San Francisco Bay Region Chemical: Gasoline Lead Agency: Local Agency Local Agency: 01000 Case Type: Undefined Status: Signed off, remedial action completed or deemed unnecessary County: Alameda Abate Method: No Action Taken - no action has as yet been taken at the site Review Date: Not reported Confirm Leak: Not reported Workplan: Not reported Prelim Assess: Not reported Pollution Char: Not reported Remed Plan: Not reported Remed Action: Not reported Monitoring: Not reported		
						TC834561.1s Page 115	TC834561.1s Page 116

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

PCC (Continued)
Cleanup Fund Id: Not reported
Discover Date: 1/20/1989
Enforcement Dt: Not reported
Enf Type: Not reported
Enter Date: 3/31/1989
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank
Interim: No
Leak Cause: Structure Failure
Leak Source: Tank
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.
Priority: Not reported
Local Case #: 01-1142
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgm: Local Oversight Program UST
Oversight Prgm: LOP
Review Date: 9/13/1994
Stop Date: 1/20/1989
Work Suspended N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T06001D1052
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mtbe Fuel: 1
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 6431.3400088803390100250469003
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

LUST Region 2:

Region: 2
Facility Id: 01-1142
Entered Date: 03/31/1989
Facility Status: Signed off, remedial action completed or deemed unnecessary
Maximum Soil Concentration: 0
Maximum Groundwater Impact: 0
County: Alameda
Current Benzene: Not reported
MTBE Detected In GW: No
MTBE Detected in Soil: Not reported
MTBE: 0
MTBE Qualify: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

12B HFH LIMITED
SW 8400 HOLLIS ST
1/4-1/2
1438 ft.
Lower

LUST Cortese 5102431110
N/A

State LUST:
Cross Street: Not reported
City Leaked: Not reported
Case Number: 01-0764
Reg Board: San Francisco Bay Region
Chemical: Gasoline
Lead Agency: Local Agency
Local Agency: D1000
Case Type: Soil only
Status: Leak being confirmed
County: Alameda
Abate Method: No Action Taken - no action has as yet been taken at the site
Review Date: 4/18/1986
Workplan: Not reported
Pollution Char: Not reported
Remed Action: Not reported
Close Date: Not reported
Release Date: 5/6/1986
Cleanup Fund Id: Not reported
Discover Date: 5/6/1986
Enforcement Dt: Not reported
Enf Type: Not reported
Enter Date: 5/6/1986
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank
Interim: No
Leak Cause: Structure Failure
Leak Source: Tank
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.
Priority: Not reported
Local Case #: 01-0764
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgm: Local Oversight Program UST
Oversight Prgm: LOP
Review Date: 8/24/1994
Stop Date: 5/6/1986
Work Suspended N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T0600100704
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction			Direction		
Distance			Distance		
Distance (ft.)			Elevation		
Elevation	Site		Site		
Database(s)	EDR ID Number	EPA ID Number	Database(s)	EDR ID Number	EPA ID Number
HFH LIMITED (Continued)	S102431110		HFH LIMITED (Continued)	S103880823	
Mtbe Fuel: 1 Water System Name: Not reported Well Name: Not reported Distance To Lust: 6095.751881904014659916277031 Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported			MTBE Date: Not reported Max MTBE GW: Not reported MTBE Tested: Not Required to be Tested. Priority: Not reported Local Case #: 3739 Beneficial: Not reported Staff: CTH GW Qualifies: Not reported Max MTBE Sol: Not reported Soil Qualifies: Not reported Hydr Basin #: Not reported Operator: Not reported Oversight Prgm: Local Oversight Program UST Oversight Prgm: LOP Review Date: 9/14/1998 Stop Date: 8/1/1988 Work Suspended N Responsible Party: BLANK RP RP Address: Not reported Global Id: T0800100842 Org Name: Not reported Contact Person: Not reported MTBE Conc: 0 Mtbe Fuel: 0 Water System Name: Not reported Well Name: Not reported Distance To Lust: 7774.5107135647403326619398488 Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported		
CORTESE: Reg Id: 01-0694 Region: CORTESE Reg By: Leaking Underground Storage Tanks					
AF130 SSW 1351 OCEAN AVE 1/4-1/2 OAKLAND, CA 1486 ft. Lower Site 1 of 4 in cluster AF	LUST	S105483291 N/A	LUST Region 2: Region: 2 Facility Id: 01-0697 Entered Date: 03/03/1992 Facility Status: Signed off, remedial action completed or deemed unnecessary Maximum Soil Concentration: 930 Maximum Groundwater Impact: 0 County: Alameda Current Benzene: Not reported MTBE Detected in GW: No MTBE Detected in Soil: Not reported MTBE: 0 MTBE Qualify: Not reported		
HFH LIMITED SSW 1351 OCEAN AVE 1/4-1/2 EMERYVILLE, CA 94608 1486 ft. Lower Site 2 of 4 in cluster AF	LUST	S103880823 N/A	J. T. THORPE & SON, INC. 1351 OCEAN AVE EMERYVILLE, CA 94608 Cortese S101624434 CA RID UST N/A		
State LUST: Cross Street: Not reported Qty Leaked: Not reported Case Number: 01-0697 Reg Board: San Francisco Bay Region Chemical: Diesel Lead Agency: Local Agency Local Agency: 01000 Case Type: Soil only Status: Signed off, remedial action completed or deemed unnecessary County: Alameda Abate Method: Replace Supply - provide alternative water supply to affected parties, Replace Supply - provide alternative water supply to affected parties Review Date: Not reported Confirm Leak: Not reported Workplan: 11/3/1988 Prelim Assess: 11/3/1988 Pollution Char: Not reported Remed Plan: Not reported Remed Action: Not reported Monitoring: Not reported	AF132 SSW 1/4-1/2 1486 ft. Lower	Sites 3 of 4 in cluster AF CORTESE: Reg Id: 01-0697 Region: CORTESE Reg By: Leaking Underground Storage Tanks			
Close Date: 1/11/1995 Release Date: 6/6/1988 Cleanup Fund Id: Not reported Discover Date: 6/6/1988 Enforcement Dt: Not reported Env Type: Not reported Enter Date: 3/3/1992 Funding: Federal Funds Staff Initials: UNK How Discovered: Tank Closure How Stopped: Close Tank Interim: Yes Leak Cause: Structure Failure Leak Source: Tank					

Map ID	Direction	Distance	MAP FINDINGS		Map ID	Direction	Distance	MAP FINDINGS	
Elevation (ft.)			Database(s)	EDR ID Number	Elevation			Database(s)	EDR ID Number
Elevation	Site			EPA ID Number	Site				EPA ID Number
133 SSW 1/4-1/2 1512 ft. Lower	GRAPHIC COATING INC 6355 HOLLIS ST EMERYVILLE, CA 94608		RCRIS-SQG FINDS HAZNET Correse	1000347197 CAD981649494				WEATHERFORD MITSUBISHI (Continued)	1000857202
RCRIS:	Owner: WIGNALL BILL (415) 555-1212				RCRIS:	Owner: NISSHO IWA (510) 654-8280			
EPA ID:	CAD981649494				EPA ID:	CAD000072546			
Contact:	ENVIRONMENTAL MANAGER (415) 547-3331				Contact:	DIANA SCHEINER (510) 654-8280			
Classification:	Small Quantity Generator				Classification:	Small Quantity Generator			
Used Oil Recyc:	No				Used Oil Recyc:	No			
TSDF Activities:	Not reported				TSDF Activities:	Not reported			
Violation Status:	No violations found				Violation Status:	No violations found			
FINDS:	Other Pertinent Environmental Activity Identified at Site: Facility Registry System (FRS) Resource Conservation and Recovery Act Information system (RCRAINFO)				FINDS:	Other Pertinent Environmental Activity Identified at Site: Facility Registry System (FRS) Resource Conservation and Recovery Act Information system (RCRAINFO)			
HAZNET:	Gepaid: CAD981649494 Tepaid: UTD048406144 Gen County: 1 Tsd County: 99 Tons: .8173 Category: Unspecified solvent mixture Waste Disposal Method: Recycler Contact: Not reported Telephone: (000) 000-0000 Mailing Address: 25932 EDEN LANDING ROAD HAYWARD, CA 94545 County: 1				HAZNET:	Gepaid: CA0000072546 Tepaid: CAD009452657 Gen County: 1 Tsd County: San Mateo Tons: 2.4166 Category: Unspecified organic liquid mixture Disposal Method: Recycler Contact: N.I. MOTORS USA Telephone: (415) 788-6200 Mailing Address: 750 POTTER ST BERKELEY, CA 94710 County: 1			
	Gepaid: CAD981649494 Tepaid: CAD009452657 Gen County: 1 Tsd County: San Mateo Tons: 5.2750 Category: Unspecified solvent mixture Waste Disposal Method: Disposal, Other Contact: Not reported Telephone: (000) 000-0000 Mailing Address: 25932 EDEN LANDING ROAD HAYWARD, CA 94545 County: 1					Gepaid: CA0000072546 Tepaid: CAD009452657 Gen County: 1 Tsd County: San Mateo Tons: 1.5637 Category: Unspecified organic liquid mixture Disposal Method: Recycler Contact: N.I. MOTORS USA Telephone: (415) 788-6200 Mailing Address: 750 POTTER ST BERKELEY, CA 94710 County: 1			
CORTESE:	Reg Id: 2838 .Region: CORTESE Reg By: Leaking Underground Storage Tanks					Gepaid: CA0000072546 Tepaid: CAD009452657 Gen County: 1 Tsd County: San Mateo Tons: 2.2934 Category: Unspecified organic liquid mixture Disposal Method: Recycler Contact: N.I. MOTORS USA Telephone: (415) 788-6200 Mailing Address: 750 POTTER ST BERKELEY, CA 94710 County: 1			
AG134 WNW 1/4-1/2 1546 ft. Lower	WEATHERFORD MITSUBISHI 750 POTTER ST BERKELEY, CA 94710	Site 1 of 3 in cluster AG	RCRIS-SQG FINDS HAZNET Correse	1000857202 CA0000072546					

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

WEATHERFORD MITSUBISHI (Continued)

Gepaid: CA0000072546
Tepaid: CAD009452657
Gen County: 1
Tsd County: San Mateo
Tons: 3.1275
Category: Unspecified organic liquid mixture
Disposal Method: Recycler
Contact: N.I. MOTORS USA
Telephone: (415) 788-6200
Mailing Address: 750 POTTER ST
BERKELEY, CA 94710
County 1
Gepaid: CA0000072546
Tepaid: CAD009452657
Gen County: 1
Tsd County: San Mateo
Tons: 8340
Category: Unspecified organic liquid mixture
Disposal Method: Recycler
Contact: N.I. MOTORS USA
Telephone: (415) 788-6200
Mailing Address: 750 POTTER ST
BERKELEY, CA 94710
County 1

The CA HAZNET database contains 2 additional records for this site.
Please contact your EDR Account Executive for more information.

CORTESE:

Reg Id: 01-0868
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

AG135 KRENZ LIMITED
WNW 750 POTTER ST
1/4-1/2 BERKELEY, CA 94704
1546 ft.
Lower Site 2 of 3 In cluster AG

State LUST:
Cross Street: Not reported
Qty Leaked: Not reported
Case Number: 01-0868
Reg Board: San Francisco Bay Region
Chemical: Gasoline
Lead Agency: Local Agency
Local Agency: 01020
Case Type: Drinking water wells have been affected
Status: Signed off, remedial action completed or deemed unnecessary
County: Alameda
Abate Method: No Action Taken - no action has as yet been taken at the site
Review Date: 4/27/1992 Confirm Leak: 4/27/1992
Workplan: 9/12/1991 Prelim Assess: 9/12/1991
Pollution Char: 5/19/1994 Remed Plan: 5/19/1994
Remed Action: Not reported Monitoring: Not reported
Close Date: 2/12/1997
Release Date: 4/27/1992
Cleanup Fund Id: Not reported

Database(s) EDR ID Number
EPA ID Number

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

KRENZ LIMITED (Continued)

Discover Date: 4/27/1992
Enforcement Dt: Not reported
Env Type: Not reported
Enter Date: 4/27/1992
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank
Interim: No
Leak Cause: Structural Failure
Leak Source: Tank
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.
Priority: Not reported
Local Case #: 01-0868
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgm: Local Implementing Agency UST (includes non-LOP cases within LOP jurisdiction)
Oversight Prgm: LIA
Review Date: 3/28/1997
Stop Date: 4/27/1992
Work Suspended N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T0600100802
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mtbe Fuel: 1
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 7464.7678872747038842249568389
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

LUST S103890908
N/A

LUST Region 2:
Region: 2
Facility Id: 01-0868
Entered Date: 04/27/1992
Facility Status: Signed off, remedial action completed or deemed unnecessary
Maximum Soil Concentration: 780
Maximum Groundwater Impact: 470000
County: Alameda
Current Benzene: 20
MTBE Detected in GW: 470000
MTBE Detected in Soil: Not reported
MTBE: 0
MTBE Quality: Not reported

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS		
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number	
Distance (ft.)	EPA ID Number		Distance (ft.)	EPA ID Number		
Elevation	Site		Elevation	Site		
AG138 WNW 114-1/2 1546 ft. Lower	KERNZ LIMITED 750 POTTER STREET BERKELEY, CA Site 3 of 3 In cluster AG SLIC Region 2: Facility ID: 01S0484 Region: 2 Facility Status: Not reported Staff: DCL Last Site Update: 08/11/19 NPL Status: Not reported Case List: SLIC Date Closed: Not reported Abata Method: Not reported Case Type: Not reported Contamination: Not reported Lead: CITY OF BERKELEY Contamination Level: Number of Municipal Wells Contaminated by Site: 0 Number of Private Wells Contaminated by Site: 0 Soil Removal Action Taken/Needed: 0 Soil Removal or Contaminant Action Started: Soil Removal or Contaminant Action Completed: 0 On-Site Groundwater Extraction or Containment Is Needed: 0 On-Site Groundwater Extraction or Containment Started: Off-Site Groundwater Extraction or Containment Is Needed: Off-Site Groundwater Extraction or Containment Started: Length of Contamination Plume (Feet): 0 Depth of Contamination Plume (Feet): 0 Wells Closed Due To Contamination of Site: Date of Wells Closure: Nearest Public or Private Drinking Water Well (Feet): 0 Under Jurisdiction of Lead Agency Date: Latitude/Longitude: 0 / 0 Flow Rate: Flow Date: Percent of Contaminants Contained: 0 Contaminant Type: EPA ID: Stages of Site Investigation Process Initiated: Begun Characterization: Not reported Completed Characterization: Not reported Begun Remediation: Not reported Completed Remediation: Not reported Submitted Remediation Plan: Not reported Approved Remediation Plan: Not reported Begun Final Remedial Action: Not reported Completed Final Remedial Action: Not reported Facility Desc: Not reported Comment: WE AGREED TO DTSC LEAD-AGENCY ROLE 10/99	CA SLIC S101306323 N/A		PLANT INSULATION COMPANY (Continued) Cty Leaked: Not reported Case Number: 01-2258 Reg Board: San Francisco Bay Region Chemical: Diesel Lead Agency: Local Agency Local Agency: 01000 Case Type: Other ground water affected Status: Leak being confirmed County: Alameda Review Date: 12/17/1997 Workplan: Not reported Pollution Char: Not reported Remed Action: Not reported Close Date: Not reported Release Date: 6/13/1997 Cleanup Fund Id: Not reported Discover Date: 3/31/1997 Enforcement Dt: Not reported Enf Type: Not reported Enter Date: 12/17/1997 Funding: Federal Funds Staff Initials: UNK How Discovered: Other Means How Stopped: Close Tank Interim: Not reported Leak Cause: Unknown Leak Source: Unknown MTBE Date: 1/2/1985 Max MTBE GW: 8 MTBE Tested: MTBE Detected. Site tested for MTBE & MTBE detected Priority: Not reported Local Case #: 8449 Beneficial: Not reported Staff: CTH GW Qualifies: Not reported Max MTBE Soil: Not reported Soil Qualifies: Not reported Hydr Basin #: Not reported Operator: Not reported Oversight Prgm: Local Oversight Program UST Oversight Prgm: LOP Review Date: 3/31/1999 Stop Date: 3/31/1997 Work Suspended: N Responsible Party: BLANK RP RP Address: Not reported Global Id: T0800102072 Org Name: Not reported Contact Person: Not reported MTBE Conc: 1 Mtbe Fuel: 0 Water System Name: Not reported Well Name: Not reported Distance To Lust: 8041.981807387723012103685215 Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported		5102859749 Confirm Leak: 12/17/1997 Prelim Assess: Not reported Remed Plan: Not reported Monitoring: Not reported
AF137 SSW 114-1/2 1563 ft. Lower	PLANT INSULATION COMPANY 1372 OCEAN AVE EMERYVILLE, CA 94608 Site 4 of 4 In cluster AF State LUST: Cross Street: Not reported	LUST Corraso LOS ANGELES CO. HHS N/A			TC834561.1s Page 125	

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Database(s) EDR ID Number
Site EPA ID Number

PLANT INSULATION COMPANY (Continued)

S102859749

LUST Region 2:
Region: 2
Facility Id: 01-2258
Entered Date: 12/17/1997
Facility Status: Leak being confirmed
Maximum Soil Concentration: 500
Maximum Groundwater Impact: 7000
County: Alameda
Current Benzene: 0
MTBE Detected in GW: 7000
MTBE Detected in Soil: Not reported
MTBE: 0
MTBE Qualify: 0

CORTESE:
Reg Id: 01-2258
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

HMS:
Facility Id: 001853-I01928
Facility Type: Not reported
Permit Number: Not reported
Facility Status: OPEN
Region: Los Angeles County:

Database(s) EDR ID Number
Site EPA ID Number

MAP FINDINGS

Database(s) EDR ID Number
Site EPA ID Number

BOLINS SERVICE GARAGE (Continued)

S103472400

Interim: No
Leak Cause: Structure Failure
Leak Source: Tank
MTBE Data: 12/1985
Max MTBE GW: 50
MTBE Tested: MTBE Detected. Site tested for MTBE & MTBE detected
Priority: Not reported
Local Case #: 1685
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgm: Local Oversight Program UST
Oversight Prgm: LOP
Review Date: 4/3/2001
Stop Date: 5/19/1988
Work Suspended N
Responsible Party: BLANK RP
RF Address: Not reported
Global Id: T0800100198
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 1
Mtbe Fuel: 1
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 8783.1170375490218922381038033
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

AH138 BOLINS SERVICE GARAGE
SE 6335 SAN PABLO AVE
1/4-1/2 OAKLAND, CA 94608
1580 ft.
Higher Site 1 of 5 in cluster AH

LUST S103472400
N/A

State LUST:
Cross Street: Not reported
City Leaked: Not reported
Case Number: 01-0212
Reg Board: San Francisco Bay Region
Chemical: Gasoline
Lead Agency: Local Agency
Local Agency: 01000
Case Type: Other ground water affected
Status: Preliminary site assessment underway
County: Alameda
Abate Method: No Action Taken - no action has as yet been taken at the site
Review Date: Not reported Confirm Leak: Not reported
Workplan: 1/2/1985 Prelim Assess: 1/2/1985
Pollution Char: Not reported Remed Plan: Not reported
Ramed Action: Not reported Monitoring: Not reported
Close Date: Not reported
Release Date: 5/6/1988
Cleanup Fund Id: Not reported
Discover Date: 5/6/1988
Enforcement Dt: Not reported
Enf Type: Not reported
Enter Date: 7/17/1992
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank

LUST Region 2:
Region: 2
Facility Id: 01-0212
Entered Date: 07/17/1992
Facility Status: Preliminary site assessment underway
Maximum Soil Concentration: 0
Maximum Groundwater Impact: 0
County: Alameda
Current Benzene: Not reported
MTBE Detected in GW: No
MTBE Detected in Soil: Not reported
MTBE: 50
MTBE Qualify: Not reported

AH138
SE 6335 SAN PABLO AVE
1/4-1/2 OAKLAND, CA
1580 ft.
Higher Site 2 of 5 in cluster AH

LUST S105483038
N/A

LUST Alameda County:
Region: ALAMEDA
Facility ID: R00000130

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance		EPA ID Number	Distance (ft.)		EPA ID Number
Elevation	Site		Elevation	Site	
AH140 SE 1/4-1/2 1580 ft. Higher	BOLINS SERVICE GARAGE 6335 SAN PABLO AVE OAKLAND, CA 94608	Cortese N/A	LUST Cortese CA FID UST	S102425527 N/A	EMERYVILLE FIRE STATION #2 (Continued) S103890508
	Site 3 of 5 in cluster AH				MTBE Data : 1/2/1985 Max MTBE GW : 720 MTBE Tested: MTBE Detected. Site tested for MTBE & MTBE detected Priority: Not reported Local Case #: 3998 Beneficial: Not reported Staff : CTH GW Qualifies : Not reported Max MTBE Soil : Not reported Soil Qualifies : Not reported Hydr Basin #: Not reported Operator : Not reported Oversight Prgm: Local Oversight Program UST Oversight Prgm: LOP Review Date : 9/8/2000 Stop Date : 3/8/1995 Work Suspended: N Responsible Party:BLANK RP RP Address: Not reported Global Id: T0600101925 Org Name: Not reported Contact Person: Not reported MTBE Conc: 1 Mtbe Fuel: 1 Water System Name: Not reported Well Name: Not reported Distance To Lust: 8295.060791992638363761794753 Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported
AI141 SSW 1/4-1/2 1613 ft. Lower	EMERYVILLE FIRE DEPARTMENT 6303 HOLLIS ST EMERYVILLE, CA 94608	LUST Cortese CA FID UST	S101824425 N/A		
	Site 1 of 2 in cluster AI				LUST Region 2: Region: 2 Facility Id: 01-2094 Entered Date: 07/12/1995 Facility Status: Preliminary site assessment workplan submitted Maximum Soil Concentration: 0 Maximum Groundwater Impact: 720 County : Alameda Current Benzene: Not reported MTBE Detected in GW: 720 MTBE Detected in Soil: Not reported MTBE: 720 MTBE Quality: Not reported
AI142 SSW 1/4-1/2 1613 ft. Lower	EMERYVILLE FIRE STATION #2 6303 HOLLIS STREET EMERYVILLE, CA 94608	HAZNET LUST	S103890508 N/A		HAZNET: Gepid: CAC001081744 Tepaid: CAD026409019 Gan County: 1 Tsd County: Los Angeles Tons: 5.0568 Category: Other inorganic solid waste Disposal Method: Transfer Station Contact: CITY OF EMERYVILLE Telephone: (510) 596-4333 Mailing Address: 2200 POWELL STREET, 12TH FL EMERYVILLE, CA 94608 County: 1
	Site 2 of 2 in cluster AI				
	State LUST: Cross Street: Not reported Qty Leaked: Not reported Case Number: 01-2094 Rep Board: San Francisco Bay Region Chemical: Gasoline Lead Agency: Local Agency Local Agency: 01000 Case Type: Other ground water affected Status: Preliminary site assessment workplan submitted County: Alameda Review Date: Not reported Workplan: Not reported Polution Char: Not reported Remed Action: Not reported Close Date: Not reported Release Date: 5/31/1995 Cleanup Fund Id: Not reported Discover Date: 5/2/1995 Enforcement Dt: Not reported En Type: Not reported Enter Date: 7/12/1995 Funding: Federal Funds Staff Initials: UNK How Discovered: Subsurface Monitoring How Stopped: Remove Contents Interim: Not reported Leak Cause: Unknown Leak Source: Unknown				

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance		EPA ID Number	Distance (ft.)		EPA ID Number
Elevation	Site		Elevation	Site	
EMERYVILLE FIRE STATION #2 (Continued)		S103890508	DIESEL FUEL TANK AREA FORMER (Continued)		S102859668
Gepaid: CAC001238824 Tepaid: CAD028409019 Gen County: 1 Tsd County: Los Angeles Tons: .2283 Category: Unspecified organic liquid mixture Disposal Method: Transfer Station Contact: CITY OF EMERYVILLE Telephone: (000) 000-0000 Mailing Address: 2200 POWELL ST, 12TH FLOOR EMERYVILLE, CA 94608 County: 1			Leak Cause: Unknown Leak Source: Unknown MTBE Date: Not reported Max MTBE GW: Not reported MTBE Tested: Not Required to be Tested. Priority: Not reported Local Case #: Not reported Beneficial: Not reported Staff: CTH GW Qualifies: Not reported Max MTBE Soil: Not reported Soil Qualifies: Not reported Hydr Basin #: Not reported Operator: Not reported Oversight Prgm: Local Oversight Program UST Oversight Prgm: LOP Review Date: Not reported Stop Date: Not reported Work Suspended: N Responsible Party: BLANK RP RP Address: Not reported Global Id: T0800181547 Org Name: Not reported Contact Person: Not reported MTBE Conc: 0 Mtbe Fuel: 0 Water System Name: Not reported Well Name: Not reported Distance To Lust: Not reported Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported		
Gepaid: CAC001238824 Tepaid: CAL000027741 Gen County: 1 Tsd County: 5 Tons: 16.8580 Category: Asbestos-containing waste Disposal Method: Not reported Contact: CITY OF EMERYVILLE Telephone: (000) 000-0000 Mailing Address: 2200 POWELL ST, 12TH FLOOR EMERYVILLE, CA 94608 County: 1					
AJ143 DIESEL FUEL TANK AREA FORMER West 722 FOLGER AVENUE 1/4-1/2 EMERYVILLE, CA 1631 ft. Lower Site 1 of 2 in cluster AJ	LUST CA SLIC	S102859668 N/A	LUST Region 2: Region: 2 Facility Id: 01S0489 Entered Date: / / Facility Status: Signed off, remedial action completed or deemed unnecessary Maximum Soil Concentration: 0 Maximum Groundwater Impact: 0 County: Alameda Current Benzene: 0 MTBE Detected in GW: No MTBE Detected in Soil: Not reported MTBE: 0 MTBE Qualify: 0	SLIC Region 2: Facility ID: 01S0489 Region: 2 Facility Status: Inactive Staff: BG Last Site Update: 08/11/19 NPL Status: Not reported Case List: SLIC Date Closed: Not reported Abata Method: 12034 Case Type: TK Contamination: TEH 10,000	Discovery Date: Not reported Imaged: No Cost Recovery: No Substance: Diesel Sample Data: Not reported
State LUST: Cross Street: Not reported City Leaked: 0 Case Number: 01S0489 Reg Board: San Francisco Bay Region Chemical: Diesel Lead Agency: Regional Board Local Agency: 01000 Case Type: Soil only Status: Signed off, remedial action completed or deemed unnecessary County: Alameda Review Date: Not reported Workplan: Not reported Pollution Char: Not reported Remed Action: Not reported Close Date: 12/17/1996 Release Date: 2/17/1988 Cleanup Fund Id: Not reported Discover Date: Not reported Enforcement Dt: Not reported Enf Type: Not reported Enter Date: Not reported Funding: Not reported Staff Initials: UNK How Discovered: Tank Closure How Stopped: Close Tank Interim: Not reported	Confirm Leak: Not reported Prelim Assess: Not reported Remed Plan: Not reported Monitoring: Not reported				

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance (ft.)		EPA ID Number	Distance (ft.)		EPA ID Number
Elevation	Site		Elevation	Site	
DIESEL FUEL TANK AREA FORMER (Continued)		S102059668	FOLGER AVENUE PROPERTY (Continued)		S101306312
Lead:	Not reported		Release Date:	8/11/1992	
Contamination Level:			Cleanup Fund Id:	Not reported	
Number of Municipal Wells Contaminated by Site:	0		Discover Date:	8/11/1992	
Number of Private Wells Contaminated by Site:	0		Enforcement Id:	Not reported	
Soil Removal Action Taken/Needed:	0		Enf Type:	Not reported	
Soil Removal or Contaminant Action Started:			Enter Date:	8/14/1992	
Soil Removal or Contaminant Action Completed:	0		Funding:	Federal Funds	
On-Site Groundwater Extraction or Containment is Needed:	0		Staff Initials:	UNK	
On-Site Groundwater Extraction or Containment Started:			How Discovered:	Tank Closure	
Off-Site Groundwater Extraction or Containment is Needed:			How Stopped:	Close Tank	
Off-Site Groundwater Extraction or Containment Started:			Interim:	Yes	
Length of Contamination Plume (Feet):	0		Leak Cause:	Structure Failure	
Depth of Contamination Plume (Feet):	0		Leak Source:	Tank	
Wells Closed Due To Contamination of Site:			MTBE Date:	Not reported	
Date of Wells Closure:			Max MTBE GW:	Not reported	
Nearest Public or Private Drinking Water Well (Feet):	0		MTBE Tested:	Not Required to be Tested.	
Under Jurisdiction of Lead Agency Date:			Priority:	Not reported	
Latitude/Longitude:	0 / 0		Local Case #:	01-0460	
Flow Rate:	0		Beneficial:	Not reported	
Flow Date:			Staff:	CTH	
Percent of Contaminants Contained:	0		GW Qualifies:	Not reported	
Contaminant Type:			Max MTBE Soil:	Not reported	
EPA ID:			Soil Qualifies:	Not reported	
Stages of Site Investigation Process Initiated:			Hydr Basin #:	Not reported	
Begun Characterization:	Not reported		Operator:	Not reported	
Completed Characterization:	Not reported		Oversight Prgm:	Local Oversight Program LUST	
Begun Remediation:	Not reported		Oversight Prgm:	LOP	
Completed Remediation:	Not reported		Review Date:	8/11/1992	
Submitted Remediation Plan:	Not reported		Stop Date:	8/11/1992	
Approved Remediation Plan:	Not reported		Work Suspended:	N	
Begun Final Remedial Action:	Not reported		Responsible Party:	BLANK RP	
Completed Final Remedial Action:	Not reported		RP Address:	Not reported	
Facility Desc:	Not reported		Global Id:	T0600100418	
Comment:	Not reported		Org Name:	Not reported	
AJ144 FOLGER AVENUE PROPERTY		LUST S101306312	Contact Person:	Not reported	
West 722 FOLGER		Cortese N/A	MTBE Conc:	0	
1/4-1/2 BERKELEY, CA			Mtbe Fuel:	0	
1831 ft.			Water System Name:	Not reported	
Lower			Well Name:	Not reported	
Site 2 of 2 in cluster AJ			Distance To Lust:	7216.3886737415817708872422488	
State LUST:			Waste Discharge Global ID:	Not reported	
Cross Street:	Not reported		Waste Disch Assigned Name:	Not reported	
City Leaked:	Not reported		LUST Region 2:		
Case Number:	01-0480		Region:	2	
Rag Board:	San Francisco Bay Region		Facility Id:	01-0460	
Chemical:	Diesel		Entered Date:	08/14/1992	
Lead Agency:	Local Agency		Facility Status:	Pollution Assessment Report Completed	
Local Agency:	01000		Maximum Soil Concentration:	12000	
Case Type:	Other ground water affected		Maximum Groundwater Impact:	10000	
Status:	Pollution Assessment Report Completed		County:	Alameda	
County:	Alameda		Current Benzene:	0	
Abate Method:	Excavate and Treat - remove contaminated soil and treat (includes spreading or land farming)		MTBE Detected In GW:	10000	
Review Date:	5/15/1992	Confirm Leak:	MTBE Detected In Soil:	Not reported	
Workplan:	Not reported	Prelim Assess:	MTBE:	0	
Pollution Char:	Not reported	Remed Plan:	MTBE Quality:	Not reported	
Remed Action:	Not reported	Monitoring:			
Close Date:	Not reported		CORTESE:		

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance		EPA ID Number	Distance		EPA ID Number
(ft.)			(ft.)		
Elevation	Site		Elevation	Site	
FOLGER AVENUE PROPERTY (Continued)		S101306312	BAY EXPORT SERVICES (Continued)		S101624597
Reg Id: D1-0460			Leak Cause: Structure Failure		
Region: CORTESE			Leak Source: Tank		
Reg By: Leaking Underground Storage Tanks			MTBE Date: Not reported		
AK145 BAY EXPORT SERVICES	LUST	S105036470	Max MTBE GW: Not reported		
WWW 717 POTTER ST		N/A	MTBE Tested: Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.		
14-1/2			Priority: Not reported		
1676 ft.			Local Case #: 01-0162		
Lower Site 1 of 3 in cluster AK			Beneficial: Not reported		
LUST Region 2:			Staff: CTH		
Region: 2			GW Qualifies: Not reported		
Facility Id: 01-0162			Max MTBE Soil: Not reported		
Entered Date: 04/01/1988			Soil Qualifies: Not reported		
Facility Status: Post remedial action monitoring in progress			Hydr Basin #: Not reported		
Maximum Soil Concentration: 630			Operator: Not reported		
Maximum Groundwater Impact: 8999999			Oversight Prgm: Local Implementing Agency UST (Includes non-LOP cases within LOP jurisdiction)		
County: Alameda			Oversight Prgm: UA		
Current Benzene: 750000			Review Date: 3/20/1990		
MTBE Detected in GW: 8999999			Stop Date: 4/1/1988		
MTBE Detected in Soil: Not reported			Work Suspended: N		
MTBE: 0			Responsible Party: BLANK RP		
MTBE Quality: Not reported			RP Address: Not reported		
AK146 BAY EXPORT SERVICES	LUST	S101624597	Global Id: T0800100150		
WWW 717 POTTER ST	CA FID UST	N/A	Org Name: Not reported		
14-1/2			Contact Person: Not reported		
1676 ft.			MTBE Conc: 0		
Lower Site 2 of 3 in cluster AK			Mtbe Fuel: 1		
State LUST:			Water System Name: Not reported		
Cross Street: Not reported			Well Name: Not reported		
Qty Leaked: Not reported			Distance To Lust: 7537.5662549431613042305390813		
Case Number: 01-0162			Waste Discharge Global ID: Not reported		
Reg Board: San Francisco Bay Region			Waste Disch Assigned Name: Not reported		
Chemical: Gasoline					
Lead Agency: Local Agency					
Local Agency: 01020					
Case Type: Other ground water affected					
Status: Post remedial action monitoring in progress					
County: Alameda					
Above Method: No Action Taken - no action has as yet been taken at the site					
Review Date: Not reported	Confirm Leak:	Not reported			
Workplan: 3/22/1988	Prelim Assess:	3/22/1988			
Pollution Char: Not reported	Remed Plan:	Not reported			
Remed Action: 1/2/1985	Monitoring:	1/2/1985			
Closure Date: Not reported					
Release Date: 4/1/1988					
Cleanup Fund Id: Not reported					
Discover Date: 4/1/1988					
Enforcement Dt: Not reported					
Enf Type: Not reported					
Enter Date: 4/1/1988					
Funding: Federal Funds					
Staff Initials: UNK					
How Discovered: Tank Closure					
How Stopped: Close Tank					
Interim: No					
AK147			DYNAVAX TECHNOLOGIES CORPORATION		HAZNET S104561475
WWW			717 POTTER		Cortese N/A
14-1/2			BERKELEY, CA 94710		
1676 ft.					
Lower Site 3 of 3 in cluster AK					
HAZNET:					
Gepaid: CAL000188347					
Tepaid: CAD059484310					
Gen County: 1					
Ted County: Santa Clara					
Tons: .1878					
Category: Aqueous solution with metals (restricted levels and Alkaline solution (pH <UN-> 12.5) with metals (antimony, arsenic, barium, beryllium, cadmium, chromium, cobalt, copper, lead, mercury, molybdenum, nickel, selenium, silver, thallium, vanadium, and zinc))					
Disposal Method: Disposal, Other					
Contact: DYNAVAX					
Telephone: (610) 848-5100					
Mailing Address: 717 POTTER ST SUITE 100					
County: 1					

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS		LUST	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number	Cortese	N/A
Distance		EPA ID Number	Distance (ft.)		EPA ID Number		
DYNAVAX TECHNOLOGIES CORPORATION (Continued)							
Gepaid:	CAL000188347		AH148	CARS RENT A CAR			
Tepaid:	CAD059494310		SE	6391 SAN PABLO AVE			
Gen County:	1		1/4-1/2	OAKLAND, CA 94606			
Tsd County:	Santa Clara		1678 R.				
Tons:	.1250		Higher	Site 4 of 5 in cluster AH			
Category:	Liquids with pH <UN-2 with metals						
Disposal Method:	Disposal, Other						
Contact:	DYNAVAX						
Telephone:	(510) 846-5100						
Mailing Address:	717 POTTER ST SUITE 100 BERKELEY, CA 94710						
County	1						
Gepaid:	CAL000188347						
Tepaid:	CAD059494310						
Gen County:	1						
Tsd County:	Santa Clara						
Tons:	.1042						
Category:	Hydrocarbon solvents (benzene, hexane, Stoddard, etc.)						
Disposal Method:	Disposal, Other						
Contact:	DYNAVAX						
Telephone:	(510) 846-5100						
Mailing Address:	717 POTTER ST SUITE 100 BERKELEY, CA 94710						
County	1						
Gepaid:	CAL000188347						
Tepaid:	CAD059494310						
Gen County:	1						
Tsd County:	Santa Clara						
Tons:	.4169						
Category:	Aqueous solution with 10% or more total organic residues						
Disposal Method:	Disposal, Other						
Contact:	DYNAVAX						
Telephone:	(510) 846-5100						
Mailing Address:	717 POTTER ST SUITE 100 BERKELEY, CA 94710						
County	1						
Gepaid:	CAL000188347						
Tepaid:	CAD059494310						
Gen County:	1						
Tsd County:	Santa Clara						
Tons:	.0166						
Category:	Aqueous solution with 10% or more total organic residues						
Disposal Method:	Disposal, Other						
Contact:	DYNAVAX						
Telephone:	(510) 846-5100						
Mailing Address:	717 POTTER ST SUITE 100 BERKELEY, CA 94710						
County	1						
The CA HAZNET database contains 5 additional records for this site. Please contact your EDR Account Executive for more information.							
CORTESE:							
Reg Id:	01-0162						
Region:	CORTESE						
Reg By:	Leaking Underground Storage Tanks						

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance		EPA ID Number	Distance (ft.)		EPA ID Number
Distance (ft.)			Elevation		
Elevation	Site		Site		
CARS RENT A CAR (Continued)		S102426380	CLEARPRINT PAPER CO (Continued)		1000156038
MTBE Conc: 1			Release Date: 10/8/1994		
Mibe Fuel: 1			Cleanup Fund Id: Not reported		
Water System Name: Not reported			Discover Date: 9/21/1994		
Well Name: Not reported			Enforcement Id: Not reported		
Distance To Lust: 6802.770495595500923541487328			Enf Type: Not reported		
Waste Discharge Global ID: Not reported			Enter Date: 6/27/1995		
Waste Disch Assigned Name: Not reported			Funding: Federal Funds		
LUST Region 2:			Staff Initiate: UNK		
Region: 2			How Discovered: Other Means		
Facility Id: 01-2008			How Stopped: Other Means		
Entered Date: 09/06/1994			Interim: Not reported		
Facility Status: Preliminary site assessment underway			Leak Cause: Unknown		
Maximum Soil Concentration: 540			Leak Source: Tank		
Maximum Groundwater Impact: 23000			MTBE Date: Not reported		
County: Alameda			Max MTBE GW: Not reported		
Current Benzene: 64			MTBE Tested: Not Required to be Tested.		
MTBE Detected in GW: 23000			Priority: Not reported		
MTBE Detected in Soil: Not reported			Local Case #: 320		
MTBE: 2			Beneficial: Not reported		
MTBE Qualify: <			Staff: CTH		
CORTESE:			GW Qualifies: Not reported		
Reg Id: 01-2008			Max MTBE Soil: Not reported		
Region: CORTESE			Soil Qualifies: Not reported		
Reg By: Leaking Underground Storage Tanks			Hydr Basin: Not reported		
AH149 SE 6301 SAN PABLO AVE 1/4-1/2 OAKLAND, CA 1878 ft. Higher Site 5 of 5 In cluster AH		LUST S105463219 N/A	Operator: Not reported		
LUST Alameda County: Region: ALAMEDA Facility ID: R00000445			Oversight Prgm: Local Oversight Program UST		
HAZNET 1000156038 LUST N/A			Oversight Prgm: LOP		
WSW 1482 67TH ST 1/4-1/2 EMERYVILLE, CA 94608 1787 ft. Lower Site 1 of 3 In cluster AL		CA FID UST HIST UST	Review Date: 10/2/1995		
LUST Region 2: Region: 2 Facility Id: 01-2083 Entered Date: 09/27/1995 Facility Status: Leak being confirmed Maximum Soil Concentration: 0 Maximum Groundwater Impact: 0 County: Alameda Current Benzene: Not reported MTBE Detected in GW: No MTBE Detected in Soil: Not reported MTBE: 0 MTBE Qualify: Not reported			Stop Date: 9/21/1994		
State LUST: Cross Street: Not reported City Leaked: Not reported Case Number: 01-2083 Reg Board: San Francisco Bay Region Chemical: Solvents Lead Agency: Local Agency Local Agency: 01000 Case Type: Undefined Status: Leak being confirmed County: Alameda Review Date: 6/27/1995 Workplan: Not reported Pollution Char: Not reported Remed Action: Not reported Close Date: Not reported		Confirm Leak: 6/27/1995 Prelim Assess: Not reported Remed Plan: Not reported Monitoring: Not reported	Work Suspended: N		
HAZNET 1000156038 LUST N/A			Responsible Party: BLANK RP		
CA FID UST HIST UST			RP Address: Not reported		

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

CLEARPRINT PAPER CO (Continued)

1000156038

LUST Alameda County:
Region : ALAMEDA
Facility ID : RO0000055

HAZNET:
Gepaid: CAD982018772
Tepaid: CAD009452657
Gen County: 1
Tsd County: San Mateo
Tons: .5000
Category: Hydrocarbon solvents (benzene, hexane, Stoddard, etc.)
Disposal Method: Disposal, Other
Contact: CLEARPRINT PAPER COMPANY
Telephone: (510) 652-4762
Mailing Address: 1482 67TH ST
EMERYVILLE, CA 94608
County 1
Gepaid: CAD982018772
Tepaid: CAD009452657
Gen County: 1
Tsd County: San Mateo
Tons: .4500
Category: Laboratory waste chemicals
Disposal Method: Recycler
Contact: CLEARPRINT PAPER COMPANY
Telephone: (510) 652-4762
Mailing Address: 1482 67TH ST
EMERYVILLE, CA 94608
County 1
Gepaid: CAD982018772
Tepaid: CAD009452657
Gen County: 1
Tsd County: San Mateo
Tons: .2550
Category:
Disposal Method: Recycler
Contact: CLEARPRINT PAPER COMPANY
Telephone: (510) 652-4762
Mailing Address: 1482 67TH ST
EMERYVILLE, CA 94608
County 1
Gepaid: CAD982018772
Tepaid: CAD009452657
Gen County: 1
Tsd County: San Mateo
Tons: .1500
Category: Liquids with pH <UN> 2
Disposal Method: Recycler
Contact: CLEARPRINT PAPER COMPANY
Telephone: (510) 652-4762
Mailing Address: 1482 67TH ST
EMERYVILLE, CA 94608
County 1

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

CLEARPRINT PAPER CO (Continued)

1000156038

Gepaid: CAD982018772
Tepaid: CAD009452657
Gen County: 1
Tsd County: San Mateo
Tons: 1.0000
Category: Waste oil and mixed oil
Disposal Method: Recycle
Contact: CLEARPRINT PAPER COMPANY
Telephone: (510) 652-4762
Mailing Address: 1482 67TH ST
EMERYVILLE, CA 94608
County 1

The CA HAZNET database contains 8 additional records for this site.
Please contact your EDR Account Executive for more information.

FID:
Facility ID: 01001626 Regulate ID: 00019866
Reg By: Active Underground Storage Tank Location
Contess Code: Not reported SIC Code: Not reported
Status: Active Facility Tel: (415) 652-4762
Mail To: Not reported
1482 67TH ST
EMERYVILLE, CA 94608
Contact: Not reported Contact Tel: Not reported
DUNS No: Not reported NPDES No: Not reported
Creation: 10/22/93 Modified: 00/00/00
EPA ID: Not reported
Comments: Not reported

LUST HIST:
Facility ID: 19666
Tank Num: 1 Container Num: S1
Tank Capacity: 8000 Year Installed: 1950
Tank Used for: PRODUCT
Type of Fuel: Not Reported
Leak Detection: None
Contact Name: DUANE NORMAN Telephone: (415) 652-4762
Total Tanks: 4 Region: STATE
Facility Type: 2 Other Type: MANUFACTURING

Facility ID: 19666
Tank Num: 2 Container Num: R1
Tank Capacity: 800 Year Installed: 1950
Tank Used for: PRODUCT
Type of Fuel: Not Reported
Leak Detection: None
Contact Name: DUANE NORMAN Telephone: (415) 652-4762
Total Tanks: 4 Region: STATE
Facility Type: 2 Other Type: MANUFACTURING

Facility ID: 19666
Tank Num: 3 Container Num: S2
Tank Capacity: 8450 Year Installed: 1970
Tank Used for: PRODUCT
Type of Fuel: Not Reported
Leak Detection: None
Contact Name: DUANE NORMAN Telephone: (415) 652-4762
Total Tanks: 4 Region: STATE
Facility Type: 2 Other Type: MANUFACTURING

Map ID Direction Distance Distance (ft.) Elevation	MAP FINDINGS		Map ID Direction Distance Distance (ft.) Elevation	MAP FINDINGS	
	Database(s)	EDR ID Number EPA ID Number		Database(s)	EDR ID Number EPA ID Number
CLEARPRINT PAPER CO (Continued)					1000156038
Total Tanks: 4 Facility Type: 2	Region: STATE Other Type: MANUFACTURING		RYERSON STEEL & ALUMINUM (Continued)		8102436119
Facility ID: 19866 Tank Num: 4 Tank Capacity: 1000 Tank Used for: PRODUCT Type of Fuel: Not Reported Leak Detection:	Container Num: R2 Year Installed: 1979		Review Date: Not reported Workplan: 1/2/1985 Pollution Char: Not reported Remed Action: Not reported Close Date: Not reported Release Date: 3/25/1993 Cleanup Fund Id: Not reported Discover Date: 3/25/1993 Enforcement Dt: 4/1/1993 Enf Type: Not reported Enter Date: 8/16/1993 Funding: Federal Funds Staff Initials: UNK How Discovered: Tank Closure How Stopped: Close Tank Interf: No Leak Cause: Unknown Leak Source: Tank MTBE Date: Not reported Max MTBE GW: Not reported MTBE Tested: Not Required to be Tested. Priority: Not reported Local Case #: 799 Beneficial: Not reported Staff: CTH GW Qualifies: Not reported Max MTBE Sol: Not reported Soil Qualifies: Not reported Hydr Basin #: Not reported Operator: Not reported Oversight Prgm: Local Oversight Program UST Oversight Prgm: LOP Review Date: 1/31/1995 Stop Date: 3/25/1993 Work Suspended N Responsible Party: BLANK RP RP Address: Not reported Global Id: T0600101653 Org Name: Not reported Contact Person: Not reported MTBE Conc: 0 Mtbe Fuel: 0 Water System Name: Not reported Well Name: Not reported Distance To Lust: 8389.628871533305736597893765 Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported		
AM151 SW 1/4-1/2 1787 ft. Lower	RYERSON STEEL 1465 65TH ST EMERYVILLE, CA 94608	LUST Cortese CA FID UST	S101560122 N/A		
Site 1 of 3 in cluster AM					
LUST Alameda County: Region: ALAMEDA Facility ID: R00000054					
CORTESE: Reg Id: 01-1785 Region: CORTESE Reg By: Leaking Underground Storage Tanks					
FID: Facility ID: D1001388 Reg By: Active Underground Storage Tank Location Correse Code: Not reported Status: Active Mail To: Not reported P O BOX EMERYVILLE, CA 94608 Contact: Not reported DUNs No: Not reported Creation: 10/22/93 EPA ID: Not reported Comments: Not reported					
Regulate ID: 00037017 SIC Code: Not reported Facility Tel: Not reported Contact Tel: Not reported NPDES No: Not reported Modified: 00/00/00					
AM152 SW 1/4-1/2 1787 ft. Lower	RYERSON STEEL & ALUMINUM 1465 65TH ST EMERYVILLE, CA 94608	LUST	S102436119 N/A	AL153 WSW 1/4-1/2 1558 ft. Lower	COULTER STEEL & FORGE COMPANY 1484 67TH STREET EMERYVILLE, CA 94608 Site 2 of 3 in cluster AL
Site 2 of 3 in cluster AM					
State LUST: Cross Street: Not reported Qty Leaked: Not reported Case Number: 01-1785 Reg Board: San Francisco Bay Region Chemical: Diesel Lead Agency: Local Agency Local Agency: 01000 Case Type: Other ground water affected Status: Preliminary site assessment underway County: Alameda Abate Method: No Action Taken - no action has as yet been taken at the site					
RCRIS-SQG FINDS HAZNET LUST UST HIST UST					

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

COULTER STEEL & FORGE COMPANY (Continued)

1000292582

RCRIS:
Owner: COULTER STEEL & FORGE CO
(415) 555-1212
EPA ID: CAD009114265
Contact: ENVIRONMENTAL MANAGER
(415) 653-2512
Classification: Small Quantity Generator
Used Oil Recyc: No
TSDF Activities: Not reported
Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:
Facility Registry System (FRS)
National Emissions Trends (NET)
National Toxics Inventory (NTI)
Resource Conservation and Recovery Act Information system (RCRAINFO)
Toxic Chemical Release Inventory System (TRIS)

State LUST:
Cross Street: Not reported
City Leaked: Not reported
Case Number: 01-1415
Reg Board: San Francisco Bay Region
Chemical: Diesel
Lead Agency: Local Agency
Local Agency: 01000
Case Type: Undefined
Status: Signed off, remedial action completed or deemed unnecessary
County: Alameda
Abate Method: Excavate and Dispose - remove contaminated soil and dispose in approved site
Review Date: Not reported Confirm Leak: Not reported
Workplan: Not reported Prelim Assess: Not reported
Pollution Char: Not reported Remed Plan: Not reported
Remed Action: Not reported Monitoring: Not reported
Close Date: 5/16/1998
Release Date: 12/27/1991
Cleanup Fund Id: Not reported
Discover Date: 12/27/1991
Enforcement Dt: 4/6/1992
Enf Type: Not reported
Enter Date: 6/17/1993
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank
Interim: Yes
Leak Cause: Unknown
Leak Source: Tank
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Not Required to be Tested.
Priority: Not reported
Local Case #: 1385

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

COULTER STEEL & FORGE COMPANY (Continued)

1000292582

Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgm: Local Oversight Program UST
Oversight Prgm: LOP
Review Date: 6/7/1996
Stop Date: 12/27/1991
Work Suspended N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T0800101307
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mtbe Fuel: 0
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 4329.1807589297301124444500784
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

LUST Region 2:

Region: 2
Facility Id: 01-1415
Entered Date: 06/17/1993
Facility Status: Signed off, remedial action completed or deemed unnecessary
Maximum Soil Concentration: 0
Maximum Groundwater Impact: 0
County: Alameda
Current Benzene: Not reported
MTBE Detected in GW: No
MTBE Detected in Soil: Not reported
MTBE: 0
MTBE Qualify: Not reported

HAZNET:

Gepaid: CAD009114265
Tepaid: CAD980887418
Gen County: 1
Tad County: 1
Tons: .5212
Category: Waste oil and mixed oil
Disposal Method: Recycler
Contact: Not reported
Telephone: (000) 000-0000
Mailing Address: P O BOX 8008
EMERYVILLE, CA 94682
County: 1

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

COULTER STEEL & FORGE COMPANY (Continued)

1000282592

Gepaid: CAD009114265
Tepaid: CAD059484310
Gen County: 1
Tsd County: Santa Clara
Tons: 2.2500
Category: Other organic solids
Disposal Method: Disposal, Other
Contact: Not reported
Telephone: (000) 000-0000
Mailing Address: P O BOX 8008
EMERYVILLE, CA 94662

County 1

Gepaid: CAD009114265
Tepaid: CAL000161743
Gen County: 1
Tsd County: Santa Clara
Tons: .9174
Category: Unspecified oil-containing waste
Disposal Method: Transfer Station
Contact: Not reported
Telephone: (000) 000-0000
Mailing Address: P O BOX 8008
EMERYVILLE, CA 94662

County 1

Gepaid: CAD009114265
Tepaid: CAL000161743
Gen County: 1
Tsd County: Santa Clara
Tons: 1.105
Category: Unspecified oil-containing waste
Disposal Method: Transfer Station
Contact: Not reported
Telephone: (000) 000-0000
Mailing Address: P O BOX 8008
EMERYVILLE, CA 94662

County 1

Gepaid: CAD009114265
Tepaid: CAT000646117
Gen County: 1
Tsd County: Kings
Tons: .8000
Category: Unspecified oil-containing waste
Disposal Method: Disposal, Land Fill
Contact: Not reported
Telephone: (000) 000-0000
Mailing Address: P O BOX 8008
EMERYVILLE, CA 94662

County 1

The CA HAZNET database contains 2 additional records for this site.
Please contact your EDR Account Executive for more information.

UST HIST:

Facility ID: 16801
Tank Num: 1 Container Num: 1
Tank Capacity: 1000 Year Installed: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

COULTER STEEL & FORGE COMPANY (Continued)

1000282592

Tank Used for: PRODUCT
Type of Fuel: REGULAR
Leak Detection: Visual
Contact Name: DANTE A SAMBAJON
Total Tanks: 2
Facility Type: 2

Tank Construction: Not reported
Telephone: (415) 853-2512
Region: STATE
Other Type: FORGING

Facility ID: 16801
Tank Num: 2
Tank Capacity: 10000
Tank Used for: Not Reported
Type of Fuel: Not Reported
Leak Detection: None
Contact Name: DANTE A SAMBAJON
Total Tanks: 2
Facility Type: 2

Tank Construction: Not reported
Telephone: (415) 853-2512
Region: STATE
Other Type: FORGING

UST San Francisco County:
Facility ID: 1385
Tank ID: Not reported
Manufacturer: Not reported
Other Interior Lining: Not reported
Receive Date: 7/19/93 0:00:00
Owner Name: Not reported
Certified Date: 2/1/94 0:00:00
Flag: CLOSED
Other Corrosion Protection: Not reported
Drop Tube: Not reported
Striker Plate: Not reported
Contents A: Not reported
Contents B: Not reported
Contents C: Not reported
Mailing Name: Not reported
Mailing Address: Not reported
Other Substance: Not reported

Case Number: Not reported
Tank Capacity: Not reported
Date Installed: Not reported

Tank Construction Type: Not reported
Tank Material: Not reported
Interior Lining: Not reported
Corrosion Protection: Not reported
Spill Contamination Installed Date: Not reported
Overflow Prevention Installed Date: Not reported
Piping Type: Not reported
Piping Aboveground: Not reported
Piping Underground: Not reported
Piping Construction: Not reported
Piping Construction Aboveground: Not reported
Piping Construction Underground: Not reported
Piping Material: Not reported
Other Piping Material: Not reported
Piping Material Aboveground: Not reported
Piping Material Underground: Not reported
Pipe Leak Detection: Not reported
Estimated Last Date Used: Not reported
Estimated Quantity Remaining: Not reported
Inert Filling: Not reported
Jurisdiction: Not reported
Other Tank System: Not reported
Other Tank Leak Detection: Not reported

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS			
Direction					Direction				
Distance					Distance (ft.)				
Elevation	Site				Elevation	Site			
		Database(s)	EDR ID Number	EPA ID Number		Database(s)	EDR ID Number	EPA ID Number	
	COULTER STEEL & FORGE COMPANY (Continued)		1000282592			MISSION TAYLOR PROPERTIES (Continued)		8103472199	
	Other Pipe Leak Detection:	Not reported							
	Methanol Compatible:	Not reported							
AL154 WSW 1/4-1/2 1858 ft. Lower	COULTER STEEL & FORGE CO. 1494 87TH ST EMERYVILLE, CA 94662 Site 3 of 3 in cluster AL	HAZNET LUST CA FID UST	5101580018 N/A N/A						
	LUST Alameda County: Region : Facility ID :	ALAMEDA RO0000596							
	HAZNET: Gepaid: Tepaid: Gen County: Tad County: Tons: Category: Disposal Method: Contact: Telephone: Mailing Address: County	CAL000219699 CAT000613943 1 Sonoma .0687 Liquid with halogenated organic compounds > 1000 mg/l Transfer Station FRAMATOME TECHNOLOGY (707) 747-7171 5357 INDUSTRIAL WAY BENICIA, CA 94510 1							
	FID: Facility ID: Reg By: Corse Code: Status: Mail To: Contact: DUNs No: Creation: EPA ID: Comments:	01000595 Active Underground Storage Tank Location Not reported Active Not reported 1494 87TH PO BOX 8006 ST EMERYVILLE, CA 94662 Not reported Not reported 10/22/93 Not reported Not reported	Regulate ID: SIC Code: Facility Tel: Contact Tel: NPDES No: Modified:	00016601 Not reported (415) 420-3500 Not reported Not reported 00/00/00					
AM155 SW 1/4-1/2 1898 ft. Lower	CLEARPRINT PAPER COMPANY 1482 65TH EMERYVILLE, CA 94608 Site 3 of 3 in cluster AM	Cortese	S105023685 N/A						
	CORTESE: Reg Id: Region: Reg By:	01-2083 CORTESE Leaking Underground Storage Tanks							
AN156 SSW 1/4-1/2 1896 ft. Lower	MISSION TAYLOR PROPERTIES 1410 64TH ST EMERYVILLE, CA 94608 Site 1 of 5 in cluster AN	LUST Cortese	S103472199 N/A						

Map ID	Direction	MAP FINDINGS		Map ID	Direction	MAP FINDINGS	
Distance	Distance (ft.)	Database(s)	EDR ID Number	Elevation	Site	Database(s)	EDR ID Number
AN157	SSW 1/4-1/2 1806 ft. Lower	1410 64TH ST EMERYVILLE, CA	LUST	S10548325	N/A	AO159	ALASKA GASOLINE 6211 SAN PABLO AVE OAKLAND, CA 94608
AO158	SE 1/4-1/2 1954 ft. Higher	ARCO K & V GAS 6211 SAN PABLO AVE OAKLAND, CA 94608	LUST Cortese CA FID UST	S101580382	N/A	Site 2 of 2 in cluster AO	HAZNET LUST U003209840 N/A
LUST Region 2:		Signed off, remedial action completed or deemed unnecessary		FID: Facility ID: 01002682 Reg By: Active Underground Storage Tank Location Cortese Code: Not reported Status: Active Mail To: Not reported 6211 SAN PABLO OAKLAND, CA 94608 Contact: Not reported DUNS No: Not reported Creation: 10/22/93 EPA ID: Not reported Comments: Not reported		Regulate ID: 00037384 SIC Code: Not reported Facility Tel: (415) 428-9735 Contact Tel: Not reported NPDES No: Not reported Modified: 00/00/00	
MISSION TAYLOR PROPERTIES (Continued)		8103472199		ARCO K & V GAS (Continued)		State LUST: Cross Street: Not reported City Leaked: Not reported Case Number: 01-1951 Reg Board: San Francisco Bay Region Chemical: Gasoline Lead Agency: Local Agency Local Agency: 01000 Case Type: Other ground water affected Status: Preliminary site assessment underway County: Alameda Abate Method: No Action Taken - no action has as yet been taken at the site Review Date: Not reported Workplan: 1/2/1985 Pollution Char: Not reported Remed Action: Not reported Close Date: Not reported Release Date: 5/28/1993 Cleanup Fund Id: Not reported Discover Date: 10/26/1992 Enforcement Dk: Not reported Env Type: Not reported Enter Date: 2/18/1993 Funding: Federal Funds Staff Initials: UNK How Discovered: Other Means How Stopped: Other Means Interim: No Leak Cause: Other Cause Leak Source: Other Source MTBE Data: 1/2/1985 Max MTBE GW: 48000 MTBE Tested: MTBE Detected. Site tested for MTBE & MTBE detected Priority: Not reported Local Case #: 813 Beneficial: Not reported Staff: CTH GW Qualifies: Not reported	
CORTES:		Reg Id: 01-0926 Region: CORTESE Reg By: Leaking Underground Storage Tanks		CORTES:		Reg Id: 01-1951 Region: CORTESE Reg By: Leaking Underground Storage Tanks	

Map ID	Direction	Distance	Distance (ft.)	Elevation	Site	MAP FINDINGS		Map ID	Direction	Distance	Distance (ft.)	Elevation	Site	MAP FINDINGS	
						Database(s)	EDR ID Number							Database(s)	EDR ID Number
							EPA ID Number								EPA ID Number
ALASKA GASOLINE (Continued)						U003299640		AN161	SSW	6121 HOLLIS ST				LUST	S105483220
Max MTBE Soil:	Not reported							14-1/2	14-1/2	EMERYVILLE, CA				N/A	
Soil Qualifies:	Not reported							1972 ft.	1972 ft.						
Hydr Basin #:	Not reported							Lower	Lower	Site 3 of 5 in cluster AN					
Operator:	Not reported									LUST Alameda County:					
Oversight Prgm:	Local Oversight Program UST									Region :	ALAMEDA				
Oversight Prgm:	LOP									Facility ID :	RO0000447				
Review Date:	3/29/2001														
Stop Date:	10/28/1992														
Work Suspended:	N														
Responsible Party:	BLANK RP														
RP Address:	Not reported														
Global Id:	T0800101604														
Org Name:	Not reported														
Contact Person:	Not reported														
MTBE Conc:	1														
Mtbe Fuel:	1														
Water System Name:	Not reported														
Well Name:	Not reported														
Distance To Lust:	7004.3955441853108892803337892														
Waste Discharge Global ID:	Not reported														
Waste Disch Assigned Name:	Not reported														
LUST Region 2:															
Region:	2														
Facility Id:	01-1951														
Entered Date:	02/16/1993														
Facility Status:	Preliminary site assessment underway														
Maximum Soil Concentration:	13000														
Maximum Groundwater Impact:	0														
County:	Alameda														
Current Benzene:	Not reported														
MTBE Detected in GW:	No														
MTBE Detected in Soil:	Not reported														
MTBE:	48000														
MTBE Quality:	Not reported														
HAZNET:															
Gepaid:	CAL000156479														
Tepaid:	CAD028408019														
Gen County:	1														
Tsd County:	Los Angeles														
Tons:	.1668														
Category:	Waste oil and mixed oil														
Disposal Method:	Treatment, Tank														
Contact:	PRITPAUL SAPPAL														
Telephone:	(510) 799-4550														
Mailing Address:	5001 CUTTING BLVD														
	RICHMOND, CA 94804 - 3472														
County:	1														
160	COULTER STEEL & FORGE COM														
SW	1494 8TH														
1/4-1/2	EMERYVILLE, CA 94608														
1970 ft.															
Lower															
CORTESE:															
Reg Id:	01-1415														
Region:	CORTESE														
Reg By:	Leaking Underground Storage Tanks														
	Cortese	S105023646													
		N/A													

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance		EPA ID Number	Distance (ft.)		EPA ID Number
Elevation	Site		Elevation	Site	
ITT GRINNELL PROPERTY (Continued)	S102006239		ITT GRINNELL PROPERTY (Continued)	S102006239	
Stop Date : 4/22/1993			The CAL-SITES database may contain additional details for this site. Please contact your EDR Account Executive for more information.		
Work Suspended N					
Responsible Party:BLANK RP					
RP Address: Not reported					
Global Id: T0600101608					
Org Name: Not reported					
Contact Person: Not reported					
MTBE Conc: 0					
Mtbe Fuel: 0					
Water System Name: Not reported					
Well Name: Not reported					
Distance To Lust: 8593.090311506372296305236492					
Waste Discharge Global ID: Not reported					
Waste Disch Assigned Name:Not reported					
LUST Region 2:					
Region: 2					
Facility Id: 01-1737					
Entered Date: 06/22/1993					
Facility Status: Preliminary site assessment underway					
Maximum Soil Concentration: 0					
Maximum Groundwater Impact: 0					
County : Alameda					
Current Benzene: Not reported					
MTBE Detected in GW: No					
MTBE Detected in Soil: Not reported					
MTBE: 0					
MTBE Quality: Not reported					
CAL-SITES:					
Facility ID 01500101					
Status: REFOA - DOES NOT REQUIRE DTSC ACTION OR OVERTSIGHT ACTIVITY. REFERRED TO OTHER AGENCY LEAD					
Status Date: 01/25/1996					
Lead: Not reported					
Region: 2 - BERKELEY					
Branch: NC - NORTH COAST					
File Name: Not reported					
Status Name: PROPERTY/SITE REFERRED TO ANOTHER AGENCY					
Lead Agency: N/A		Not reported			
NPL: Not reported					
SIC: 50 WHOLESALE TRADE - DURABLE GOODS					
Facility Type: N/A					
Type Name: Not reported					
Staff Member Responsible for Site: Not reported					
Supervisor Responsible for Site: Not reported					
Region Water Control Board: SF - SAN FRANCISCO BAY					
Access: Controlled					
Cortese: C					
Hazardous Ranking Score: Not reported					
Date Site Hazard Ranked: Not reported					
Groundwater Contamination: Not reported					
No. of Contamination Sources: 0					
Lat/Long: 0° 0' 0.00" / 0° 0' 0.00"					
Lat/Long Method: Not reported					
State Assembly District Code: Not reported					
State Senate District: Not reported					
			AN183 CHIRON CORPORATION		
			SSW 6121 HOLLIS		
			1/4-1/2 EMERYVILLE, CA 94608		
			1972 ft.		
			Lower	Site 5 of 5 in cluster AH	
					HAZNET 8103688871
					Cortese N/A

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

CHIRON CORPORATION (Continued)

S103688871

HAZNET:
Gepaid: CAL000125079
Tepaid: CAD009452857
Gen County: 1
Tsd County: San Mateo
Tons: .1459
Category: Aqueous solution with 10% or more total organic residues
Disposal Method: Treatment, Incineration
Contact: HOLLOS R&D ASSOC
Telephone: (415) 457-4964
Mailing Address: 4560 HORTON ST
EMERYVILLE, CA 94608 - 2916
County 1

Gepaid: CAL000125079
Tepaid: CAD009452857
Gen County: 1
Tsd County: San Mateo
Tons: .2501
Category: Aqueous solution with 10% or more total organic residues
Disposal Method: Recycler
Contact: HOLLOS R&D ASSOC
Telephone: (415) 457-4964
Mailing Address: 4560 HORTON ST
EMERYVILLE, CA 94608 - 2916
County 1

Gepaid: CAL000125079
Tepaid: CAD009452857
Gen County: 1
Tsd County: San Mateo
Tons: .6043
Category: Aqueous solution with 10% or more total organic residues
Disposal Method: Recycler
Contact: HOLLOS R&D ASSOC
Telephone: (415) 457-4964
Mailing Address: 4560 HORTON ST
EMERYVILLE, CA 94608 - 2916
County 1

Gepaid: CAL000125079
Tepaid: AZD009015389
Gen County: 1
Tsd County: 99
Tons: .0834
Category: Aqueous solution with 10% or more total organic residues
Disposal Method: Recycler
Contact: HOLLOS R&D ASSOC
Telephone: (415) 457-4964
Mailing Address: 4560 HORTON ST
EMERYVILLE, CA 94608 - 2916
County 1

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

CHIRON CORPORATION (Continued)

S103688871

Gepaid: CAL000125079
Tepaid: CAD009452857
Gen County: 1
Tsd County: San Mateo
Tons: .6878
Category: Aqueous solution with 10% or more total organic residues
Disposal Method: Recycler
Contact: HOLLOS R&D ASSOC
Telephone: (415) 457-4964
Mailing Address: 4560 HORTON ST
EMERYVILLE, CA 94608 - 2916
County 1

CORTESE:
Reg Id: 01-1737
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

AP164
WSW
14-1/2
2018 ft.
Lower

MIKE ROBERTS COLOR PROD INC
6707 BAY ST
EMERYVILLE, CA 94608

LUST N/A
N/A

Site 1 of 4 In cluster AP

State LUST:
Cross Street: Not reported
Qty Leaked: Not reported
Case Number: 01-0971
Reg Board: San Francisco Bay Region
Chemical: Diesel
Lead Agency: Local Agency
Local Agency: 01000
Case Type: Other ground water affected
Status: Signed off, remedial action completed or deemed unnecessary
County: Alameda
Abate Method: Pump and Treat Ground Water - generally employed to remove dissolved
contaminants, Vapor Extraction, Vent Soil - bore holes in soil to allow
volatilization of contaminants

Review Date: 3/9/1992 Confirm Leak: 3/9/1992
Workplan: 1/1/1990 Prelim Assess: 1/1/1990
Pollution Char: Not reported Remed Plan: Not reported
Remed Action: Not reported Monitoring: Not reported
Close Date: 7/1/1993
Release Date: 10/5/1989
Cleanup Fund Id: Not reported
Discover Date: 10/9/1990
Enforcement Dt: 3/6/1992
Enf Type: Not reported
Enter Date: 12/8/1990
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank
Interim: Yes
Leak Cause: Structure Failure
Leak Source: Tank
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Not Required to be Tested.

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance			Distance		
Distance (ft.)			Elevation (ft.)		
Elevation	Site		Site		
MIKE ROBERTS COLOR PROD INC (Continued)		1000198450	UNKNOWN (Continued)		5104241785
Priority:	Not reported		Lead:	0	
Local Case #:	414		Contamination Level:		
Beneficiar:	Not reported		Number of Municipal Wells Contaminated by Site:	0	
Staff:	CTH		Number of Private Wells Contaminated by Site:	0	
GW Qualifies:	Not reported		Soil Removal Action Taken/Needed:		
Max MTBE Soil:	Not reported		Soil Removal or Contaminant Action Started:		
Soil Qualifies:	Not reported		On-Site Groundwater Extraction or Containment is Needed:		
Hydr Basin #:	Not reported		On-Site Groundwater Extraction or Containment Started:		
Operator:	Not reported		Off-Site Groundwater Extraction or Containment is Needed:		
Oversight Prgm:	Local Oversight Program UST		Off-Site Groundwater Extraction or Containment Started:		
Oversight Prgm:	LOP		Length of Contamination Plume (Feet):	0	
Review Date:	12/18/1996		Depth of Contamination Plume (Feet):	0	
Stop Date:	10/9/1990		Wells Closed Due To Contamination of Site:		
Work Suspended:	N		Date of Wells Closure:		
Responsible Party:	BLANK RP		Nearest Public or Private Drinking Water Well (Feet):	0	
RP Address:	Not reported		Under Jurisdiction of Lead Agency Date:		
Global Id:	T0600100894		Latitude/Longitude:	0 / 0	
Org Name:	Not reported		Flow Rate:	0	
Contact Person:	Not reported		Flow Date:		
MTBE Conc:	0		Percent of Contaminants Contained:	0	
Mtbe Fuel:	0		Contaminant Type:		
Water System Name:	Not reported		EPA ID:		
Well Name:	Not reported		Stages of Site Investigation Process Initiated:		
Distance To Lust:	8246.6094747472024754 19151627		Begun Characterization :	Not reported	
Waste Discharge Global ID:	Not reported		Completed Characterization :	Not reported	
Waste Disch Assigned Name:	Not reported		Begun Remediation:	Not reported	
LUST Region 2:			Completed Remediation:	Not reported	
Region:	2		Submitted Remediation Plan:	Not reported	
Facility Id:	01-0971		Approved Remediation Plan:	Not reported	
Entered Date:	12/08/1990		Begun Final Remedial Action:	Not reported	
Facility Status:	Signed off, remedial action completed or deemed unnecessary		Completed Final Remedial Action:	Not reported	
Maximum Soil Concentration:	45000		Facility Desc:	Not reported	
Maximum Groundwater Impact:	103000		Comment:	Not reported	
County:	Alameda				
Current Benzene:	Not reported				
MTBE Detected in GW:	103000				
MTBE Detected in Soil:	Not reported				
MTBE:	0				
MTBE Qualify:	Not reported				
AP165 UNKNOWN	WSW 6707 BAY STREET	CA SLIC S104241785	AP188 MIKE ROBERTS COLOR PRODUCTIONS (MRCP)	CAL-SITES 5102008158	
1/4-1/2	EMERYVILLE, CA	N/A	6707 BAY STREET	N/A	
2019 ft.			EMERYVILLE, CA 94608		
Lower	Site 2 of 4 In cluster AP				
SLIC Region 2:			Site 3 of 4 In cluster AP		
Facility ID:	01S0437		CAL-SITES:		
Region:	2		Facility ID:	01270025	
Facility Status:	Active		Status:	NFA - NO FURTHER ACTION FOR DTSC	
Staff:	BG		Status Date:	03/13/1995	
Last Site Update:	02/06/19		Lead:	Not reported	
NPL Status:	0		Region:	2 - BERKELEY	
Case List:	SLIC		Branch:	NC - NORTH COAST	
Date Closed:	Not reported		File Name:	Not reported	
Abate Method:	78933		Status Name:	NO FURTHER ACTION FOR DTSC	
Case Type:	TK		Lead Agency:	N/A	
Contamination:	0		NPL:	Not reported	
			SIC:	27 MANU - PRINTING & PUBLISHING	
			Facility Type:	N/A	
			Type Name:	Not reported	
			Staff Member Responsible for Site:	Not reported	
			Supervisor Responsible for Site:	Not reported	
			Region Water Control Board:	Not reported	
			Access:	Not reported	

Map ID	Direction	Distance	Distance (ft.)	Elevation	Site	MAP FINDINGS		Map ID	Direction	Distance	Distance (ft.)	Elevation	Site	MAP FINDINGS		
						Database(s)	EDR ID Number	EPA ID Number						Database(s)	EDR ID Number	EPA ID Number
MIKE ROBERTS COLOR PRODUCTIONS (MRCP) (Continued)																
Cortese:	Not reported						S102008158		VACANT FACILITY (Continued)						S103472202	
Hazardous Ranking Score:	Not reported								Review Date:	Not reported					Review Date:	Not reported
Date Site Hazard Ranked:	Not reported								Workplan:	1/2/1985					Prelim Assess:	1/2/1985
Groundwater Contamination:	Not reported								Pollution Char:	Not reported					Remed Plan:	Not reported
No. of Contamination Sources:	0								Remed Action:	Not reported					Monitoring:	Not reported
Lat/Long:	37' 51' 0.00" / 122' 17' 30.00"								Close Date:	Not reported						
Lat/Long Method:	UPLOADED FROM ASPIIS								Release Date:	10/10/1989						
State Assembly District Code:	Not reported								Cleanup Fund Id:	Not reported						
State Senate District:	Not reported								Discover Date:	10/10/1989						
The CAL-SITES database may contain additional details for this site. Please contact your EDR Account Executive for more information.									Enforcement Dt:	Not reported						
AP167	MIKE ROBERTS COLOR PROD I	WSW	6707 BAY	1/4-1/2	EMERYVILLE, CA	2019 ft.	Cortese	S100868691	N/A	Env Type:	Not reported					
Lower	Site 4 of 4 in cluster AP								Enter Date :	3/18/1990						
CORTES:									Funding:	Federal Funds						
Reg Id:	01-0971								Staff Initials:	UNK						
Region:	CORTESE								How Discovered:	Tank Closure						
Reg By:	Leaking Underground Storage Tanks								How Stopped:	Close Tank						
AQ168	ABBOT, COLE & DEGRAF, INC.	WSW	6803 BAY ST	1/4-1/2	EMERYVILLE, CA 94608	2046 ft.	LUST	S101624407	N/A	Interim :	Yes					
Lower	Site 1 of 4 in cluster AQ						Cortese		Leak Cause:	Unknown						
LUST Alameda County:									Leak Source:	Tank						
Region :	ALAMEDA						CA FID UST		MTBE Date :	Not reported						
Facility ID :	RO0000043								Max MTBE GW :	Not reported						
CORTES:									MTBE Tested:	Not Required to be Tested.						
Reg Id:	01-0518								Priority:	Not reported						
Region:	CORTESE								Local Case # :	3710						
Reg By:	Leaking Underground Storage Tanks								Beneficial:	Not reported						
AK169	VACANT FACILITY	WSW	6803 BAY ST	1/4-1/2	EMERYVILLE, CA 94608	2046 ft.	LUST	S103472202	N/A	Staff :	CTH					
Lower	Site 2 of 4 in cluster AQ								GW Qualifies :	Not reported						
State LUST:									Max MTBE Soil :	Not reported						
Cross Street:	Not reported								Soil Qualifies :	Not reported						
Cty Leaked:	Not reported								Hydr Basin #:	Not reported						
Case Number:	01-0516								Operator :	Not reported						
Reg Board:	San Francisco Bay Region								Oversight Prgm:	Local Oversight Program UST						
Chemical:	Diesel								Oversight Prgm :	LOP						
Lead Agency:	Local Agency								Review Date :	6/24/1988						
Local Agency:	01000								Stop Date :	10/10/1989						
Case Type:	Other ground water affected								Work Suspended :	Not reported						
Status:	Preliminary site assessment underway								Responsible Party:	BLANK RP						
County:	Alameda								RP Address:	Not reported						
Abate Method:	Excavate and Treat - remove contaminated soil and treat (includes spreading or land farming)								Global Id:	T0600100470						
LUST Region 2:									Org Name:	Not reported						
Region:	2								Contact Person:	Not reported						
Facility Id:	01-0518								MTBE Conc:	0						
Entered Data:	03/18/1990								Mtbe Fuel:	0						
Facility Status:	Preliminary site assessment underway								Well System Name:	Not reported						
Maximum Soil Concentration:	270								Well Name:	Not reported						
Maximum Groundwater Impact:	9999999								Distance To Lust:	8368.52545988497315837856395						
County:	Alameda								Waste Discharge Global ID:	Not reported						
Current Benzene:	Not reported								Waste Disch Assigned Name:	Not reported						
MTBE Detected in GW:	9999999															

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance (ft.)	EPA ID Number	EPA ID Number	Distance (ft.)	EPA ID Number	EPA ID Number
Elevation	Site		Elevation	Site	
VACANT FACILITY (Continued)				VACANT FACILITY (Continued)	
MTBE Detected In Soil:	Not reported		Global Id:	T0600100825	
MTBE:	0		Org Name:	Not reported	
MTBE Qualify:	Not reported		Contact Person:	Not reported	
AQ170	VACANT FACILITY		MTBE Conc:	0	
WSW	6601 BAY ST		MTbe Fuel:	1	
1/4-1/2	EMERYVILLE, CA 94608		Water System Name:	Not reported	
2050 ft.			Well Name:	Not reported	
Lower	Site 3 of 4 in cluster AQ		Distance To Lust:	8387.829960228722709200641673	
Site LUST:				Waste Discharge Global ID:	
Cross Street:	Not reported		Not reported		
Qty Leaked:	Not reported		Waste Disch Assigned Name:		
Case Number:	01-0896		Not reported		
Reg Board:	San Francisco Bay Region				
Chemicals:	Gasoline				
Lead Agency:	Local Agency				
Local Agency:	01000				
Case Type:	Undefined				
Status:	Preliminary site assessment underway				
County:	Alameda				
Abate Method:	No Action Taken - no action has as yet been taken at the site				
Review Date:	Not reported	Confirm Leak:	Not reported		
Workplan:	1/2/1985	Prelim Assess:	1/2/1985		
Pollution Char:	Not reported	Remed Plan:	Not reported		
Remed Action:	Not reported	Monitoring:	Not reported		
Close Date:	Not reported				
Release Date:	8/23/1988				
Cleanup Fund Id:	Not reported				
Discover Date:	8/23/1988				
Enforcement Dt:	Not reported				
Env Type:	Not reported				
Enter Date:	10/31/1989				
Funding:	Federal Funds				
Staff Initials:	UNK				
How Discovered:	Tank Closure				
How Stopped:	Close Tank				
Interim:	No				
Leak Cause:	Structure Failure				
Leak Source:	Tank				
MTBE Data:	Not reported				
Max MTBE GW:	Not reported				
MTBE Tested:	Site NOT Tested for MTBE Includes Unknown and Not Analyzed.				
Priority:	Not reported				
Local Case #:	3696				
Beneficial:	Not reported				
Staff:	CTH				
GW Qualifies:	Not reported				
Max MTBE Soil:	Not reported				
Soil Qualifies:	Not reported				
Hydr Basin #:	Not reported				
Operator:	Not reported				
Oversight Prgm:	Local Oversight Program UST				
Oversight Prgm:	LOP				
Review Date:	8/24/1998				
Stop Date:	8/11/1989				
Work Suspended N:					
Responsible Party:	BLANK RP				
RP Address:	Not reported				
AQ171	VACANT FACILITY		Region:	2	
WSW	6601 BAY ST		Facility Id:	01-0896	
1/4-1/2	EMERYVILLE, CA 94608		Entered Date:	10/31/1988	
2050 ft.			Facility Status:	Preliminary site assessment underway	
Lower	Site 4 of 4 in cluster AQ		Maximum Soil Concentration:	0	
CORTESE:				Maximum Groundwater Impact:	
Reg Id:	01-0896		County:	Alameda	
Region:	CORTESE		Current Benzene:	Not reported	
Reg By:	Leaking Underground Storage Tanks		MTBE Detected in GW:	No	
CORTESE:				MTBE Detected in Soil:	
Reg Id:	01-0896		MTBE:	0	
Region:	CORTESE		MTBE Quality:	Not reported	
TEMESCAL					
172	TEMESCAL		CA SLIC:	8101007645	
NNW	2850 7TH ST		N/A		
1/4-1/2	BERKELEY, CA				
2064 ft.					
Lower					
TEMESCAL:					
Facility ID:	01S0078		Discovery Date:	Not reported	
Region:	2		Imaged:	No	
Facility Status:	Inactive		Cost Recovery:	No	
Staff:	BG		Substance:	Not reported	
Last Site Update:	02/23/19		Sample Date:	Not reported	
NPL Status:	Not an NPL site				
Case List:	SLIC				
Date Closed:	Not reported				
Abata Method:	Not reported				
Case Type:	NT				
Contamination:	Not reported				
Lead:	RWQCB				
Contamination Level:					
Number of Municipal Wells Contaminated by Site:	0				
Number of Private Wells Contaminated by Site:	0				
Soil Removal Action Taken/Needed:	0				

MAP FINDINGS		
Map ID Direction Distance Distance (ft.) Elevation	Site	
		Database(s)
		EDR ID Number EPA ID Number
TEME8CAI (Continued)		S101007045
Soil Removal or Contaminant Action Started:		
Soil Removal or Contaminant Action Completed: 0		
On-Site Groundwater Extraction or Containment is Needed: 0		
On-Site Groundwater Extraction or Containment Started:		
Off-Site Groundwater Extraction or Containment is Needed:		
Off-Site Groundwater Extraction or Containment Started:		
Length of Contamination Plume (Feet): 0		
Depth of Contamination Plume (Feet): 0		
Wells Closed Due To Contamination of Site:		
Date of Wells Closure:		
Nearest Public or Private Drinking Water Well (Feet): 0		
Under Jurisdiction of Lead Agency Date:		
Latitude/Longitude: 38 / -122		
Flow Rate: 0		
Flow Date:		
Percent of Contaminants Contained: 0		
Contaminant Type:		
EPA ID:		
Stages of Site Investigation Process Initiated:		
Begun Characterization: Not reported		
Completed Characterization: Not reported		
Begun Remediation: Not reported		
Completed Remediation: Not reported		
Submitted Remediation Plan: Not reported		
Approved Remediation Plan: Not reported		
Begun Final Remedial Action: Not reported		
Completed Final Remedial Action: Not reported		
Facility Desc:	Not reported	
Comment:	Not reported	

173 HOLLIS STREET PROJECT
SSW 6050 HOLLIS ST
1/4-1/2 EMERYVILLE, CA 94608
2126 ft.
Lower

CORTESE:
Reg Id: 01-0773
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

Corlese S102431437
N/A

AR174	EMERALD PACKAGING	CA	BLIC	1001611787
North	2821 10TH ST			N/A
1/4-1/2	BERKELEY, CA			
2195 R.				
Higher	Sits 1 of 2 In cluster AR			
	SLIC Region 2:			
	Facility ID:	01S0401		
	Region:	2		
	Facility Status:	Inactive		
	Staff:	BG		
	Last Site Update:	Not reported		
	NPL Status:	Not an NPL site	Discovery Date:	Not reported
	Case List:	SLIC	Imaged:	No
	Date Closed:	Not reported	Coat Recovery:	No
	Abate Method:	71556	Substance:	Trichloroethane
	Case Type:	TK	Sample Date:	Not reported

MAP FINDINGS			
Map ID Direction Distance Distance (ft.) Elevation	Site	Database(s)	EDR ID Number EPA ID Number
EMERALD PACKAGING (Continued)			
Contamination:	Not reported		1001611767
Lead:	RWQCB		
Contamination Level:			
Number of Municipal Wells Contaminated by Site:	0		
Number of Private Wells Contaminated by Site:	0		
Soil Removal Action Taken/Needed:	0		
Soil Removal or Contaminant Action Started:			
Soil Removal or Contaminant Action Completed:	0		
On-Site Groundwater Extraction or Containment is Needed:	0		
On-Site Groundwater Extraction or Containment Started:			
Off-Site Groundwater Extraction or Containment is Needed:			
Off-Site Groundwater Extraction or Containment Started:			
Length of Contamination Plume (Feet):	0		
Depth of Contamination Plume (Feet):	0		
Wells Closed Due To Contamination of Site:			
Date of Wells Closure:			
Nearest Public or Private Drinking Water Well (Faci):	0		
Under Jurisdiction of Lead Agency Date:			
Latitude/Longitude:	38° -122		
Flow Rate:	0		
Flow Date:			
Percent of Contaminants Contained:	0		
Containment Type:			
EPA ID:			
Stages of Site Investigation Process Initiated:			
Begun Characterization :	Not reported		
Completed Characterization :	Not reported		
Begun Remediation:	Not reported		
Completed Remediation:	Not reported		
Submitted Remediation Plan:	Not reported		
Approved Remediation Plan:	Not reported		
Begun Final Remedial Action:	Not reported		
Completed Final Remedial Action:	Not reported		
Facility Desc:	Not reported		
Comment:	Not reported		

AR175 **EMERALD PACKAGING** **LUST** **1000353382**
 North **2821 10TH ST** **Cortese**
 1/4-1/2 **BERKELEY, CA 94710** **N/A**
 2195 ft. **Site 2 of 2 in cluster AR** **CA FID UST**
 Higher
State LUST:
 Cross Street: Not reported
 City Listed: 0
 Case Number: 0150401
 Reg Board: San Francisco Bay Region
 Chemical: Acetone, etc.
 Lead Agency: Regional Board
 Local Agency : D1020
 Case Type: Other ground water affected
 Status: Final Remediation plan Approved
 County: Alameda
 Review Date: Not reported Confirm Leak: Not reported
 Workplan: Not reported Prelim Assess: Not reported
 Pollution Char: 8/20/1993 Remed Plan: 9/20/1993
 Remed Action: Not reported Monitoring: Not reported
 Close Date: Not reported
 Release Date: 1/1/1985

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance		EPA ID Number	Distance (ft.)		EPA ID Number
Elevation	Site		Elevation	Site	
EMERALD PACKAGING (Continued)		1000353362	EMERALD PACKAGING (Continued)		1000353362
Cleanup Fund Id : Not reported			Remed Action: Not reported		Monitoring: Not reported
Discover Date : Not reported			Close Date: Not reported		
Enforcement Dl : Not reported			Release Date: 4/18/1990		
Env Type: Not reported			Cleanup Fund Id : Not reported		
Enter Date : Not reported			Discover Date : 4/18/1990		
Funding: Not reported			Enforcement Dl : Not reported		
Staff Initials: UNK			Env Type: Not reported		
How Discovered: Tank Closure			Enter Date : 3/7/1991		
How Stopped: Close Tank			Funding: Federal Funds		
Interim : Not reported			Staff Initials: UNK		
Leak Cause: Unknown			How Discovered: Tank Closure		
Leak Source: Unknown			How Stopped: Close Tank		
MTBE Date : Not reported			Interim : No		
Max MTBE GW : Not reported			Leak Cause: Structure Failure		
MTBE Tested: Not Required to be Tested.			Leak Source: Tank		
Priority: Not reported			MTBE Date : Not reported		
Local Case # : Not reported			MTBE Tested: Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.		
Beneficial: Not reported			Priority: Not reported		
Staff : CTH			Local Case # : 01-0567		
GW Qualifies : Not reported			Beneficial: Not reported		
Max MTBE Soil : Not reported			Staff : CTH		
Soil Qualifies : Not reported			GW Qualifies : Not reported		
Hydr Basin #: Not reported			Max MTBE Soil : Not reported		
Operator : Not reported			Soil Qualifies : Not reported		
Oversight Prgm: Local Implementing Agency UST (includes non-LOP cases within LOP jurisdiction)			Hydr Basin #: Not reported		
Oversight Prgm : LIA			Operator : Not reported		
Review Date : Not reported			Oversight Prgm: Local Implementing Agency UST (includes non-LOP cases within LOP jurisdiction)		
Stop Date : Not reported			Oversight Prgm : LIA		
Work Suspended N			Review Date : 2/26/1999		
Responsible Party:BLANK RP			Stop Date : 4/18/1990		
RP Address: Not reported			Work Suspended N		
Global Id: T0600191538			Responsible Party:BLANK RP		
Org Name: Not reported			RP Address: Not reported		
Contact Person: Not reported			Global Id: T0600100510		
MTBE Conc: 0			Org Name: Not reported		
Mtbe Fuel: 0			Contact Person: Not reported		
Water System Name: Not reported			MTBE Conc: 0		
Well Name: Not reported			Mtbe Fuel: 1		
Distance To Lust: 5635.6168713142053219892022279			Water System Name: Not reported		
Waste Discharge Global ID: Not reported			Well Name: Not reported		
Waste Disch Assigned Name: Not reported			Distance To Lust: 5372.2425338665341263644717148		
Cross Street: Not reported			Waste Discharge Global ID: Not reported		
Qty Leaked: Not reported			Waste Disch Assigned Name: Not reported		
Case Number: 01-0557			LUST Region 2:		
Rag Board: San Francisco Bay Region			Region: 2		
Chemical: Gasoline			Facility Id: 01-0557		
Lead Agency: Local Agency			Entered Date: 03/07/1991		
Local Agency: 01020			Facility Status: Preliminary site assessment workplan submitted		
Case Type: Other ground water affected			Maximum Soil Concentration: 0		
Status: Preliminary site assessment workplan submitted			Maximum Groundwater Impact: 5600		
County: Alameda			County : Alameda		
Above Method: No Action Taken - no action has as yet been taken at the site			Current Benzene: Not reported		
Review Date: 3/6/1991 Confirm Leak: 3/6/1991			MTBE Detected in GW: 5600		
Workplan: Not reported Prelim Assess: Not reported			MTBE Detected in Soil: Not reported		
Pollution Char: Not reported Remed Plan: Not reported			MTBE: 0		

Map ID	Database(s)	EDR ID Number	MAP FINDINGS	Map ID	Database(s)	EDR ID Number	MAP FINDINGS			
Direction		EPA ID Number		Direction		EPA ID Number				
Distance				Distance						
Distance (ft.)				Distance (ft.)						
Elevation	Site			Elevation	Site					
176 SW 1/4-1/2 2214 ft. Lower	REDEVELOPMENT AGENCY TRANSOL LANCOSLE SLIC Region 2: Facility ID: 01S0245 Region: 2 Facility Status: Inactive Staff: BG Last Site Update: 03/05/98 NPL Status: Not an NPL site Case List: SLIC Date Closed: Not reported Abate Method: Not reported Case Type: ND Contamination: Not reported Lead: RWQCB Contamination Level: Number of Municipal Wells Contaminated by Site: 0 Number of Private Wells Contaminated by Site: 0 Soil Removal Action Taken/Needed: Soil Removal or Contaminant Action Started: Soil Removal or Contaminant Action Completed: 0 On-Site Groundwater Extraction or Containment is Needed: 0 On-Site Groundwater Extraction or Containment Started:	CA SLIC N/A	S101641313 N/A	AB177 South 1/4-1/2 2232 ft. Same	PARK MERCED APARTMENTS 50 CHUMASERO DRIVE , CA	LUST UST N/A	REDEVELOPMENT AGENCY TRANSOL LANCOSLE (Continued) CORTESE: Reg Id: 01-0557 Region: CORTESE Reg By: Leaking Underground Storage Tanks FID: Facility ID: 01000688 Regulate ID: CAD073928 Reg By: Inactive Underground Storage Tank Location Cortese Code: Not reported SIC Code: Not reported Status: Inactive Facility Tel: (415) 841-8343 Mail To: 2821 10TH ST BERKELEY, CA 94710 Contact: Not reported Contact Tel: Not reported DUNS No: Not reported NPDES No: Not reported Creation: 10/29/93 Modified: 00/00/00	1000353362	REDEVELOPMENT AGENCY TRANSOL LANCOSLE (Continued) Off-Site Groundwater Extraction or Containment is Needed: Off-Site Groundwater Extraction or Containment Started: Length of Contamination Plume (Feet): 0 Depth of Contamination Plume (Feet): 0 Wells Closed Due To Contamination of Site: Date of Wells Closure: Nearest Public or Private Drinking Water Well (Feet): 0 Under Jurisdiction of Lead Agency Date: Latitude/Longitude: 38/-122 Flow Rate: 0 Flow Date: Percent of Contaminants Contained: 0 Contaminant Type: EPA ID: Stages of Site Investigation Process Initiated: Begun Characterization : Not reported Completed Characterization : Not reported Begun Remediation: Not reported Completed Remediation: Not reported Submitted Remediation Plan: Not reported Approved Remediation Plan: Not reported Begun Final Remedial Action: Not reported Completed Final Remedial Action: Not reported Facility Desc: Not reported Comment: Not reported	8101641313

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

PARK MERCED APARTMENTS (Continued)

How Stopped: Close Tank
Interim: Yes
Leak Cause: Structure Failure
Leak Source: Tank
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.
Priority: Not reported
Local Case #: 01-0523
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgrm: Local Oversight Program UST
Oversight Prgrm: LOP
Review Date: 8/24/1994
Stop Date: 5/30/1990
Work Suspended N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T0600100477
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mtbe Fuel: 1
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 8198.452346564986598514588033
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

UST San Francisco County:

Facility ID: 328	Case Number: Not reported
Tank ID: Not reported	Tank Capacity: Not reported
Manufacturer: Not reported	Date Installed: Not reported
Other Interior Lining: Not reported	
Receive Date: 10/19/88 0:00:00	Close Date: Not reported
Owner Name: Not reported	
Certified Date: Not reported	
Flag: CLOSED	
Other Corrosion Protection: Not reported	
Drop Tube: Not reported	
Striker Plate: Not reported	
Contents A: Not reported	
Contents B: Not reported	
Contents C: Not reported	
Mailing Name: Not reported	
Mailing Address: Not reported	
Other Substance: Not reported	
Tank Construction Type: Not reported	
Tank Material: Not reported	
Interior Lining: Not reported	
Corrosion Protection: Not reported	
Spill Contamination Installed Date: Not reported	
Overflow Prevention Installed Date: Not reported	

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

PARK MERCED APARTMENTS (Continued)

Piping Type: Not reported
Piping Aboveground: Not reported
Piping Underground: Not reported
Piping Construction: Not reported
Piping Construction Aboveground: Not reported
Piping Construction Underground: Not reported
Piping Material: Not reported
Other Piping Material: Not reported
Piping Material Aboveground: Not reported
Piping Material Underground: Not reported
Pipe Leak Detection: Not reported
Estimated Last Date Used: Not reported
Estimated Quantity Remaining: Not reported
Inert Filling: Not reported
Jurisdiction: Not reported
Other Tank System: Not reported
Other Tank Leak Detection: Not reported
Other Pipe Leak Detection: Not reported
Methanol Compatible: Not reported

AS178
South
1/4-1/2
2232 ft.
Same

DUTRO COMPANY
1333 62ND STREET
EMERYVILLE, CA 94608

RCRIS-BQG 1000000022
FINDS CAD009117387
HAZNET Cortese

Sites 2 of 2 in cluster AS

RCRIS:
Owner: WILLIAM DUTRO AND VICKI DAVIS
(510) 652-9130
EPA ID: CAD009117387
Contact: JOHN BENSON
(510) 652-9130

Classification: Small Quantity Generator
Used Oil Recyc: No
TSDF Activities: Not reported
Violation Status: No violations found

FINDS:
Other Pertinent Environmental Activity Identified at Site:
Facility Registry System (FRS)
Resource Conservation and Recovery Act Information system (RCRAINFO)

HAZNET:
Geapid: CAD009117387
Tepaid: UTD048406144
Gen County: 1
Trd County: 98
Tons: .8880
Category: Unspecified solvent mixture Waste
Disposal Method: Recycle
Contact: CORPORATION
Telephone: (000) 000-0000
Mailing Address: PO BOX 88447
EMERYVILLE, CA 94662 - 0421
County 1

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance		EPA ID Number	Distance		EPA ID Number
Elevation	Site		Elevation	Site	
DUTRO COMPANY (Continued)		1000880922	CHRONICLE DEPOT (Continued)		B101306371
Gapaid:	CAD009117387		Beneficial:	Not reported	
Tepaid:	UTD048406144		Staff:	CTH	
Gen County:	1		GW Qualifies:	Not reported	
Tad County:	99		Max MTBE Soil:	Not reported	
Tons:	.2293		Soil Qualifies:	Not reported	
Category:	Unspecified solvent mixture Waste		Hydr Basin #:	Not reported	
Disposal Method:	Recycler		Operator:	Not reported	
Contact:	CORPORATION		Oversight Prgm:	RB Lead Underground Storage Tank	
Telephone:	(000) 000-0000		Oversight Prgm:	UST	
Mailing Address:	PO BOX 88447		Review Date:	9/27/1996	
	EMERYVILLE, CA 94682 - 0421		Stop Date:	4/23/1985	
County	1		Work Suspended:	Not reported	
CORTESE:			Responsible Party:	BLANK RP	
Reg Id:	01-0523		RP Address:	Not reported	
Region:	CORTESE		Global Id:	T0600100392	
Reg By:	Leaking Underground Storage Tanks		Org Name:	Not reported	
178 CHRONICLE DEPOT	LUST	S101306371	Contact Person:	Not reported	
NNW 1/4-1/2 2288 ft. Lower	Cortese	N/A	MTBE Conc:	0	
State LUST:			Mtbe Fuel:	1	
Cross Street:	Not reported		Water System Name:	Not reported	
Qty Leaked:	Not reported		Well Name:	Not reported	
Case Number:	01-0396		Distance To Lust:	6349.9586272467010481149956283	
Reg Board:	San Francisco Bay Region		Waste Discharge Global ID:	Not reported	
Chemical:	Gasoline		Waste Disch Assigned Name:	Not reported	
Lead Agency:	Regional Board		LUST Region 2:		
Local Agency:	01020		Region:	2	
Case Type:	Undefined		Facility Id:	01-0396	
Status:	Signed off, remedial action completed or deemed unnecessary		Entered Date:	10/08/1992	
County:	Alameda		Facility Status:	Signed off, remedial action completed or deemed unnecessary	
Abate Method:	No Action Taken - no action has as yet been taken at the site		Maximum Soil Concentration:	0	
Review Date:	2/27/1996	Confirm Leak:	Maximum Groundwater Impact:	0	
Workplan:	Not reported	Prelim Assess:	County:	Alamedas	
Pollution Char:	Not reported	Remed Plan:	Current Benzene:	Not reported	
Remed Action:	Not reported	Monitoring:	MTBE Detected in GW:	No	
Close Date:	1/1/1989		MTBE Detected in Soil:	Not reported	
Release Date:	4/23/1985		MTBE:	0	
Cleanup Fund Id:	Not reported		MTBE Qualify:	Not reported	
Discover Date:	4/23/1985		CORTESE:		
Enforcement Dt:	Not reported		Reg Id:	01-0396	
Enf Type:	Not reported		Region:	CORTESE	
Enter Date:	10/8/1992		Reg By:	Leaking Underground Storage Tanks	
Funding:	Federal Funds		AT180	PETERSON MANUFACTURING CO., I	
Staff Initials:	UNK		SSW	1800 - 63RD STREET	
How Discovered:	Tank Closure		1/4-1/2	EMERYVILLE, CA 94680	
How Stopped:	Close Tank		2296 ft.		
Interim:	No		Lower	Site 1 of 3 in cluster AT	
Leak Cause:	Structure Failure		CORTESE:		
Leak Source:	Tank		Reg Id:	01-1159	
MTBE Date:	Not reported		Region:	CORTESE	
Max MTBE GW:	Not reported		Reg By:	Leaking Underground Storage Tanks	
MTBE Tested:	Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.				
Priority:	Not reported				
Local Case #:	01-0396				

Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number
Distance		EPA ID Number
Distance (ft.)		
Elevation	Site	

PETERSON MANUFACTURING CO., I (Continued)

100021831

FID:
 Facility ID: 01002113 Regulate ID: 00010751
 Reg By: Inactive Underground Storage Tank Location
 Contess Code: Not reported SIC Code: Not reported
 Status: Inactive Facility Tel: (415) 654-5772
 Mail To: Not reported
 1600 063RD ST
 EMERYVILLE, CA 94608
 Contact: Not reported Contact Tel: Not reported
 DUNs No: Not reported NPDES No: Not reported
 Creation: 10/22/93 Modified: 00/00/00
 EPA ID: Not reported
 Comments: Not reported

UST HIST:
 Facility ID: 10751 Container Num: 20
 Tank Num: 1 Year Installed: Not reported
 Tank Capacity: 10000
 Tank Used for: PRODUCT
 Type of Fuel: DIESEL
 Leak Detection: Stock Inventor
 Contact Name: C. JONES Telephone: (415) 654-5772
 Total Tanks: 3 Region: STATE
 Facility Type: 2 Other Type: RENDERING

Facility ID: 10751 Container Num: 12
 Tank Num: 2 Year Installed: Not reported
 Tank Capacity: 10000
 Tank Used for: PRODUCT
 Type of Fuel: Not Reported
 Leak Detection: Stock Inventor
 Contact Name: C. JONES Telephone: (415) 654-5772
 Total Tanks: 3 Region: STATE
 Facility Type: 2 Other Type: RENDERING

Facility ID: 10751 Container Num: 11
 Tank Num: 3 Year Installed: Not reported
 Tank Capacity: 10000
 Tank Used for: PRODUCT
 Type of Fuel: DIESEL
 Leak Detection: Stock Inventor
 Contact Name: C. JONES Telephone: (415) 654-5772
 Total Tanks: 3 Region: STATE
 Facility Type: 2 Other Type: RENDERING

AT181 PETERSON MANUFACTURING COMPANY INC
 SSW 1600 63RD ST
 1/4-1/2 EMERYVILLE, CA 94608
 2296 ft.

Lower Site 2 of 3 in cluster AT

State LUST:
 Cross Street: Not reported
 City Leaked: Not reported
 Case Number: 01-1159
 Reg Board: San Francisco Bay Region
 Chemical: Gasoline
 Lead Agency: Local Agency
 Local Agency: 01000

LUST 5103678917
 N/A

Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number
Distance		EPA ID Number
Distance (ft.)		
Elevation	Site	

PETERSON MANUFACTURING COMPANY INC (Continued)

5103678917

Case Type: Other ground water affected
 Status: Pollution Assessment Report Completed
 County: Alameda
 Abate Method: Enhanced Biodegradation - use of any available technology to promote bacterial decomposition of contaminants
 Review Date: Not reported Confirm Leak: Not reported
 Workplan: 6/13/1989 Prelim Assess: 6/13/1989
 Pollution Char: Not reported Remed Plan: Not reported
 Remed Action: Not reported Monitoring: Not reported
 Close Date: Not reported
 Release Date: 2/1/1988
 Cleanup Fund Id: Not reported
 Discover Date: 2/1/1988
 Enforcement Dt: Not reported
 Enf Type: Not reported
 Enter Date: 3/18/1992
 Funding: Federal Funds
 Staff Initials: UNK
 How Discovered: Tank Closure
 How Stopped: Close Tank
 Interim: Yes
 Leak Causes: Structure Failure
 Leak Source: Tank
 MTBE Date: 1/2/1985
 Max MTBE GW: 0
 MTBE Tested: MTBE Detected. Site tested for MTBE & MTBE detected
 Priority: Not reported
 Local Case #: 147
 Beneficial: Not reported
 Staff: CTH
 GW Qualities: Not reported
 Max MTBE Soil: Not reported
 Soil Qualities: Not reported
 Hydr Basin #: Not reported
 Operator: Not reported
 Oversight Prgm: Local Oversight Program UST
 Oversight Prgm: LOP
 Review Date: 3/27/2001
 Stop Date: 2/1/1988
 Work Suspended: N
 Responsible Party: BLANK RP
 RP Address: Not reported
 Global Id: T0600101068
 Org Name: Not reported
 Contact Person: Not reported
 MTBE Conc: 1
 Mibe Fuel: 1
 Water System Name: Not reported
 Well Name: Not reported
 Distance To Lust: 8502.13136628130791544445797
 Waste Discharge Global ID: Not reported
 Waste Disch Assigned Name: Not reported

LUST Region 2:
 Region: 2
 Facility Id: 01-1159
 Entered Date: 03/18/1992
 Facility Status: Pollution Assessment Report Completed

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS		
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number	
Distance (ft.)		EPA ID Number	Distance (ft.)		EPA ID Number	
Elevation	Site		Elevation	Site		
PETERSON MANUFACTURING COMPANY INC (Continued)		S103878917	PROEN PRODUCTS (Continued)		S101007032	
Maximum Soil Concentration: 1300			Local Case #: 01-2329			
Maximum Groundwater Impact: 999999			Beneficial: Not reported			
County: Alameda			Staff: CTH			
Current Benzene: Not reported			GW Qualifies: Not reported			
MTBE Detected In GW: 999999			Max MTBE Soil: Not reported			
MTBE Detected In Soil: Not reported			Soil Qualifies: Not reported			
MTBE: 0			Hydr Basin #: Not reported			
MTBE Qualify: ND			Operator: Not reported			
AT162 SSW 1600 63RD ST 1/4-1/2 EMERYVILLE, CA 2296 ft. Lower	LUST Site 3 of 3 in cluster AT LUST Alameda County: Region : ALAMEDA Facility ID : RO0000052	S105442987 N/A	Oversight Prgm: Local Implementing Agency UST (includes non-LOP cases within LOP jurisdiction)			
183 NNW 2777 9TH ST 1/4-1/2 BERKELEY, CA 94710 2398 ft. Higher	State LUST: Cross Street: Not reported Qty Leaked: Not reported Case Number: 01-2329 Reg Board: San Francisco Bay Region Chemical: Gasoline Lead Agency: Local Agency Local Agency: 01020 Case Type: Undefined Status: Leak being confirmed County: Alameda Review Date: 7/8/1998 Workplan: Not reported Pollution Char: Not reported Remed Action: Not reported Close Date: Not reported Release Date: 7/8/1998 Cleanup Fund Id: Not reported Discover Date: 7/18/1998 Enforcement Dt: Not reported Enf Type: Not reported Enter Date: 7/8/1998 Funding: Federal Funds Staff Initials: UNK How Discovered: Tank Closure How Stopped: Close Tank Interim: Not reported Leak Cause: Unknown Leak Source: Unknown MTBE Date: Not reported Max MTBE GW: Not reported MTBE Tested: Site NOT Tested for MTBE. Includes Unknown and Not Analyzed. Priority: Not reported	LUST Cortese CA SLIC	S101007032 N/A	Responsible Party: BLANK RP RP Address: Not reported Global Id: T0600102142 Org Name: Not reported Contact Person: Not reported MTBE Conc: 0 Mtns Fuel: 1 Water System Name: Not reported Well Name: Not reported Distance To Lust: 5820.2294008228061259787654753 Waste Ditch Global ID: Not reported Waste Ditch Assigned Name: Not reported		
	Confirm Leak: 7/8/1998 Prelim Assess: Not reported Remed Plan: Not reported Monitoring: Not reported		LUST Region 2: Region: 2 Facility Id: 01-2329 Entered Date: 07/08/1998 Facility Status: Leak being confirmed Maximum Soil Concentration: 0 Maximum Groundwater Impact: 0 County: Alameda Current Benzene: Not reported MTBE Detected In GW: No MTBE Detected In Soil: Not reported MTBE: 0 MTBE Qualify: Not reported			
			CORTESE: Reg Id: 01-2329 Region: CORTESE Reg By: Leaking Underground Storage Tanks			
			SLIC Region 2: Facility Id: 01S0237 Region: 2 Facility Status: Inactive Staff: BG Last Site Update: 02/26/10 NPL Status: Not an NPL site Case List: SLIC Date Closed: Not reported Abate Method: Not reported Case Type: ND Contamination: Not reported Lead: RWQCB			
			Discovery Date: Not reported Imaged: No Cost Recovery: No Substance: Not reported Sample Date: Not reported			

Map ID	Direction	MAP FINDINGS		Map ID	Direction	MAP FINDINGS	
Distance	Distance (ft.)	Database(s)	EDR ID Number	Elevation	Site	Database(s)	EDR ID Number
PROEN PRODUCTS	(Continued)		S101007032				S100849420
Contamination Level:							
Number of Municipal Wells Contaminated by Site:	0						
Number of Private Wells Contaminated by Site:	0						
Soil Removal Action Taken/Needed:	0						
Soil Removal or Contaminant Action Started:							
Soil Removal or Contaminant Action Completed:	0						
On-Site Groundwater Extraction or Containment is Needed:	0						
On-Site Groundwater Extraction or Containment Started:							
Off-Site Groundwater Extraction or Containment is Needed:							
Off-Site Groundwater Extraction or Containment Started:							
Length of Contamination Plume (Feet):	0						
Depth of Contamination Plume (Feet):	0						
Wells Closed Due To Contamination of Site:							
Date of Wells Closure:							
Nearest Public or Private Drinking Water Well (Feet):	0						
Under Jurisdiction of Lead Agency Date:							
Latitude/Longitude:	38° -122°						
Flow Rate:	0						
Flow Date:							
Percent of Contaminants Contained:	0						
Contaminant Type:							
EPA ID:							
Stages of Site Investigation Process Initiated:							
Begun Characterization :	Not reported						
Completed Characterization :	Not reported						
Begun Remediation:	Not reported						
Completed Remediation:	Not reported						
Submitted Remediation Plan:	Not reported						
Approved Remediation Plan:	Not reported						
Begun Final Remedial Action:	Not reported						
Completed Final Remedial Action:	Not reported						
Facility Desc:	Not reported						
Comment:	Not reported						
AU184	BERKELEY INDUSTRIAL COMPLEX 728 HEINZ ST BERKELEY, CA	CA SLIC	S100849420	AU185	BERKELEY INDUSTRIAL COURT 728 HEINZ AVENUE BERKELEY, CA 94710	Cal-Sites HAZNET LUST	1000268547 N/A N/A
WWN 1/4-1/2 2405 ft.		N/A		WWN 1/4-1/2 2405 ft. Lower			
Lower	Site 1 of 4 in cluster AU				Site 2 of 4 in cluster AU		
SLIC Region 2:				STATE LUST:			
Facility ID: 01S0387				Cross Street: Not reported			
Region: 2				Qty Leaked: Not reported			
Facility Status: Inactive				Case Number: 01-1935			
Staff: BG				Reg Board: San Francisco Bay Region			
Last Site Update: 07/11/19				Chemical: Misc. Motor Vehicle Fuels			
NPL Status: Undefined				Lead Agency: Local Agency			
Case Ust: SLIC				Local Agency: 01020			
Date Closed: Not reported				Case Type: Other ground water affected			
Abate Method: 79016				Status: Signed off, remedial action completed or deemed unnecessary			
Case type: TK				County: Alameda			
Contamination: Not reported				Abate Method: Excavate and Treat - remove contaminated soil and treat (includes spreading or land farming)			
Lead: RWQCB				Review Date: 10/8/1993	Confirm Leak: 10/8/1993		
Contamination Level:				Workplan: 4/11/1994	Prelim Assess: 4/11/1994		
Number of Municipal Wells Contaminated by Site: 0				Pollution Char: Not reported	Remed Plan: Not reported		
Number of Private Wells Contaminated by Site: 0				Remed Action: Not reported	Monitoring: Not reported		
Soil Removal Action Taken/Needed: 0				Close Date: 1/9/1997			
Soil Removal or Contaminant Action Started:				Release Date: 8/27/1993			
Soil Removal or Contaminant Action Completed:	0			Cleanup Fund Id: Not reported			

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance		EPA ID Number	Distance (ft.)		EPA ID Number
Elevation	Site		Elevation	Site	
BERKELEY INDUSTRIAL COURT (Continued)		1000268547	BERKELEY INDUSTRIAL COURT (Continued)		1000268547
Staff Initials:	UNK		Branch:	NC - NORTH COAST	
How Discovered:	Other Means		File Name:	Not reported	
How Stopped:	Close Tank		Status Name:	PROPERTY/SITE REFERRED TO ANOTHER AGENCY	
Interim:	Yes		Lead Agency:	N/A	Not reported
Leak Cause:	Structure Failure		NPL:	Not reported	
Leak Source:	Piping		SIC:	28 MANU - CHEMICALS & ALLIED PRODUCTS	
MTBE Data :	Not reported		Facility Type:	N/A	
Max MTBE GW :	Not reported		Type Name:	Not reported	
MTBE Tested:	Not Required to be Tested.		Staff Member Responsible for Site:	Not reported	
Priority:	Not reported		Supervisor Responsible for Site:	Not reported	
Local Case #:	01-1935		Region Water Control Board:	SF - SAN FRANCISCO BAY	
Beneficial:	Not reported		Access:	Controlled	
Staff:	CTH		Cortese:	C	
GW Qualifies:	Not reported		Hazardous Ranking Score:	Not reported	
Max MTBE Soil:	Not reported		Date Site Hazard Ranked:	Not reported	
Soil Qualifies:	Not reported		Groundwater Contamination:	Not reported	
Hydr Basin #:	Not reported		No. of Contamination Sources:	0	
Operator:	Not reported		Lat/Long:	0' 0" 0.00' / 0' 0" 0.00"	
Oversight Prgm:	Local Implementing Agency UST (includes non-LOP cases within LOP jurisdiction)		Lat/Long Method:	Not reported	
Oversight Prgm:	LIA		State Assembly District Code:	Not reported	
Review Date:	1/25/1998		State Senate District:	Not reported	
Stop Date:	6/21/1993				
Work Suspended	N				
Responsible Party	BLANK RP				
RP Address:	Not reported				
Global Id:	T0600101792				
Org Name:	Not reported				
Contact Person:	Not reported				
MTBE Conc:	0				
Mtbe Fuel:	0				
Water System Name:	Not reported				
Well Name:	Not reported				
Distance To Lust:	7061.1481058727244581296851737				
Waste Discharge Global ID:	Not reported				
Waste Disch Assigned Name:	Not reported				
LUST Region 2:					
Region:	2				
Facility Id:	01-1935				
Entered Date:	10/08/1993				
Facility Status:	Signed off, remedial action completed or deemed unnecessary				
Maximum Soil Concentration:	4100				
Maximum Groundwater Impact:	140				
County :	Alameda				
Current Benzenes:	1				
MTBE Detected in GW:	140				
MTBE Detected in Soil:	Not reported				
MTBE:	0				
MTBE Qualify:	Not reported				
CAL-SITES:					
Facility ID	01280089		AU186	BERKELEY INDUSTRIAL COMPL	
Status:	REFOA - DOES NOT REQUIRE DTSC ACTION OR OVSERTE ACTIVITY. REFERED TO OTHER AGENCY LEAD		WWN	729 HEINZ	
Status Date:	05/22/1986		114-1/2	BERKELEY, CA 94710	
Lead:	Not reported		2405 ft.		
Region:	2 - BERKELEY		Lower	Site 3 of 4 in cluster AU	
				CORTES:	
				Reg Id:	01-1935

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS			
Direction					Direction				
Distance					Distance				
Elevation	Site				Elevation	Site			
		Database(s)	EDR ID Number	EPA ID Number		Database(s)	EDR ID Number	EPA ID Number	
	BERKELEY INDUSTRIAL COMPL (Continued)		S102068166			BERKELEY IND COURT (Continued)		1003878538	
AU187	Region: CORTESE Reg By: Leaking Underground Storage Tanks				WHW	LUST 1003878538 CERC-NFRAP CAD980637235			
1/4-1/2	BERKELEY IND COURT 729 HEINZ AVE BERKELEY, CA 94710				2405 ft.				
Lower	Site 4 of 4 in cluster AU								
	CERCLIS-NFRAP Classification Data:								
	Site Incident Category: Not reported		Federal Facility: Not a Federal Facility						
	Non NPL Code: NFRAP								
	Ownership Status: Unknown	NPL Status: Not on the NPL							
	CERCLIS-NFRAP Assessment History:								
	Assessment: DISCOVERY	Completed: 06/01/1981							
	Assessment: ARCHIVE SITE	Completed: 10/01/1988							
	Assessment: PRELIMINARY ASSESSMENT	Completed: 10/01/1988							
	Assessment: SITE INSPECTION	Completed: 10/01/1988							
	State LUST:								
	Cross Street: Not reported								
	City Leaked: 0								
	Case Number: 01S0387								
	Reg Board: San Francisco Bay Region								
	Chemical: TCE								
	Lead Agency: Regional Board								
	Local Agency: 01020								
	Case Type: Undefined								
	Status: Preliminary site assessment underway								
	County: Alameda								
	Review Date: Not reported	Confirm Leak: Not reported							
	Workplan: 7/11/1996	Prelim Assess: 7/11/1996							
	Pollution Char: Not reported	Remed Plan: Not reported							
	Remed Action: Not reported	Monitoring: Not reported							
	Close Date: Not reported								
	Release Date: 1/1/1985								
	Cleanup Fund Id: Not reported								
	Discover Date: Not reported								
	Enforcement Dt: Not reported								
	Enf Type: Not reported								
	Enter Date: Not reported								
	Funding: Not reported								
	Staff Initials: UNK								
	How Discovered: Tank Closure								
	How Stopped: Close Tank								
	Interim: Not reported								
	Leak Cause: Unknown								
	Leak Source: Unknown								
	MTBE Data: Not reported								
	Max MTBE GW: Not reported								
	MTBE Tested: Not Required to be Tested.								
	Priority: Not reported								
	Local Case #: Not reported								
	Beneficial: Not reported								
	Staff: CTH								
	GW Qualifies: Not reported								
	Max MTBE Soil: Not reported								
	Soil Qualifies: Not reported								
	Hydr Basin #: Not reported								
	AV188	POST OFFICE 1505 62ND AVE EMERYVILLE, CA 94608							
	SSW								
	1/4-1/2								
	2410 ft.								
	Lower								
	Site 1 of 2 in cluster AV								
	State LUST:								
	Cross Street: HOLLIS								
	City Leaked: Not reported								
	Case Number: 01-2065								
	Reg Board: San Francisco Bay Region								
	Chemical: Gasoline								
	Lead Agency: Local Agency								
	Local Agency: 01000								
	Case Type: Other ground water affected								
	Status: Preliminary site assessment underway								
	County: Alameda								
	Abata Method: No Action Taken - no action has as yet been taken at the site								
	Review Date: Not reported	Confirm Leak: Not reported							
	Workplan: 5/6/1995	Prelim Assess: 5/6/1995							
	Pollution Char: Not reported	Remed Plan: Not reported							
	Remed Action: Not reported	Monitoring: Not reported							
	Close Date: Not reported								
	Release Date: 7/7/1993								
	Cleanup Fund Id: Not reported								

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

POST OFFICE (Continued)

Discover Date : 1/1/1993
Enforcement Dt : Not reported
Enf Type: Not reported
Enter Date : 8/14/1994
Funding: Federal Funds
Staff Initiate: UNK
How Discovered: Other Means
How Stopped: Other Means
Interim : No
Leak Cause: Unknown
Leak Source: Unknown
MTBE Date : Not reported
Max MTBE GW: Not reported
MTBE Tested: Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.
Priority: Not reported
Local Case #: 01-2065
Beneficial: Not reported
Staff : CTH
GW Qualifies : Not reported
Max MTBE Soil : Not reported
Soil Qualifies : Not reported
Hydr Basin #: Not reported
Operator : Not reported
Oversight Prgm: Local Oversight Program UST
Oversight Prgm : LOP
Review Date : 5/16/1995
Stop Date : 1/1/1993
Work Suspended: N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T0600101897
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mtbe Fuel: 1
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 9276.747153594687769140255023
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

AV189 POST OFFICE
SSW 1505 62ND AVE
1/4-1/2 EMERYVILLE, CA 94608
2410 ft. Lower

Sites 2 of 2 in cluster AV

CORTESE:
Reg Id: 01-2065
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

Cortese S103993720
N/A

190 TRANSOL LANCOSTE SITE
SW 1800 64TH ST
1/4-1/2 EMERYVILLE, CA
2422 ft. Lower

CA SLIC S101641319
N/A

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

TRANSOL LANCOSTE SITE (Continued)

SLIC Region 2:
Facility ID: 01S0321
Region: 2
Facility Status: Inactive
Staff: BG
Last Site Update: 08/10/19
NPL Status: Not an NPL site
Case List: SLIC
Date Closed: Not reported
Abate Method: Not reported
Case Type: NT
Contamination: Not reported
Lead: RW/CB
Contamination Level:
Number of Municipal Wells Contaminated by Site: 0
Number of Private Wells Contaminated by Site: 0
Soil Removal Action Taken/Needed: 0
Soil Removal or Contaminant Action Started:
Soil Removal or Contaminant Action Completed: 0
On-Site Groundwater Extraction or Containment is Needed: 0
On-Site Groundwater Extraction or Containment Started:
Off-Site Groundwater Extraction or Containment is Needed:
Off-Site Groundwater Extraction or Containment Started:
Length of Contamination Plume (Feet): 0
Depth of Contamination Plume (Feet): 0
Wells Closed Due To Contamination of Site:
Date of Wells Closure:
Nearest Public or Private Drinking Water Well (Feet): 0
Under Jurisdiction of Lead Agency Date:
Latitude/Longitude: 38 / -122
Flow Rate:
Flow Date:
Percent of Contaminants Contained: 0
Contaminant Type:
EPA ID:
Stages of Site Investigation Process Initiated:
Begin Characterization : Not reported
Completed Characterization : Not reported
Begin Remediation: Not reported
Completed Remediation: Not reported
Submitted Remediation Plan: Not reported
Approved Remediation Plan: Not reported
Begin Final Remedial Action: Not reported
Completed Final Remedial Action: Not reported
Facility Desc: Not reported
Comment: Not reported

AW181
SSE
1/4-1/2
2477 ft.
Higher

BREKENRIDGE AUTO SHOP
6045 SAN PABLO AVE
OAKLAND, CA 94606

LUST S103576594
Cortese N/A

Sites 1 of 2 in cluster AW

State LUST:
Cross Street: Not reported
City Leaked: Not reported
Case Number: 01-2443
Reg Board: San Francisco Bay Region

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance		EPA ID Number	Distance (ft.)		EPA ID Number
Distance (ft.)			Elevation		
Site			Site		
BREKENRIDGE AUTO SHOP (Continued)		S103576384	BREKENRIDGE AUTO SHOP (Continued)		S103576384
Chemical:	Gasoline		Facility Status:	Preliminary site assessment underway	
Lead Agency:	Local Agency		Maximum Soil Concentration:	0	
Local Agency:	01000		Maximum Groundwater Impact:	0	
Case Type:	Other ground water affected		County:	Alameda	
Status:	Preliminary site assessment underway		Current Benzene:	Not reported	
County:	Alameda		MTBE Detected in GW:	No	
Review Date:	1/18/1994	Confirm Leak: 1/18/1994	MTBE Detected in Soil:	Not reported	
Workplan:	1/2/1985	Prelim Assess: 1/2/1985	MTBE:	150	
Pollution Char:	Not reported	Remed Plan: Not reported	MTBE Qualify:	Not reported	
Remed Action:	Not reported	Monitoring: Not reported	CORTESE:		
Close Date:	Not reported		Reg Id:	01-2443	
Release Date:	9/14/1993		Region:	CORTESE	
Cleanup Fund Id:	Not reported		Reg By:	Leaking Underground Storage Tanks	
Discover Date:	7/14/1993				
Enforcement DI:	Not reported				
Env Type:	Not reported				
Enter Date:	10/1/1998				
Funding:	Federal Funds				
Staff Initials:	UNK				
How Discovered:	Tank Closure				
How Stopped:	Clos Tank				
Interim:	Not reported				
Leak Cause:	Unknown				
Leak Source:	Unknown				
MTBE Date:	1/2/1985				
Max MTBE GW:	150				
MTBE Tested:	MTBE Detected. Site tested for MTBE & MTBE detected				
Priority:	Not reported				
Local Case #:	815				
Beneficial:	Not reported				
Staff:	CTH				
GW Qualifies:	Not reported				
Max MTBE Soil:	Not reported				
Soil Qualifies:	Not reported				
Hydr Basin #:	Not reported				
Operator:	Not reported				
Oversight Prgm:	Local Oversight Program UST				
Oversight Prgm:	LOP				
Review Date:	4/3/2001				
Stop Date:	9/14/1993				
Work Suspended N:					
Responsible Party:	BLANK RP				
RP Address:	Not reported				
Global Id:	T0600102251				
Org Name:	Not reported				
Contact Person:	Not reported				
MTBE Conc:	1				
Mtbe Fuel:	1				
Water System Name:	Not reported				
Well Name:	Not reported				
Distance To Lust:	7537.6321793655447013802930504				
Waste Discharge Global ID:	Not reported				
Waste Disch Assigned Name:	Not reported				
LUST Region 2:					
Region:	2				
Facility Id:	01-2443				
Entered Date:	10/01/1998				
AW192					
SSE	8045 SAN PABLO AVE				
1/4-1/2	OAKLAND, CA				
2477 ft.					
Higher					
	Site 2 of 2 In cluster AW				
	LUST Alameda County:				
	Region :	ALAMEDA			
	Facility ID :	R00000227			
193					
SW	TRANSO/LACOSTE SITE				
1/4-1/2	1600 84TH STREET/5401 BAY STREET				
2528 ft.	EMERYVILLE, CA 94608				
Lower					
	Cal-Sites	S103608152			
	Cortese	N/A			
	CAL-SITES:				
	Facility ID:	D1200020			
	Status:	NFA - NO FURTHER ACTION FOR DTSC			
	Status Date:	02/21/1995			
	Lead:	DTSC			
	Region:	2 - BERKELEY			
	Branch:	NC - NORTH COAST			
	File Name:	TRANSO/LACOSTE			
	Status Name:	NO FURTHER ACTION FOR DTSC			
	Lead Agency:	DEPT OF TOXIC SUBSTANCES CONTROL			
	NPL:	Not Listed			
	SIC:	20 MANU - FOOD & KINDRED PRODUCTS			
	Facility Type:	RESPONSIBLE PARTY			
	Type Name:	RP			
	Staff Member Responsible for Site:	AANTONIO			
	Supervisor Responsible for Site:	Not reported			
	Region Water Control Board:	SF - SAN FRANCISCO BAY			
	Access:	Controlled			
	Cortese:	C			
	Hazardous Ranking Score:	Not reported			
	Date Site Hazard Ranked:	Not reported			
	Groundwater Contamination:	Unknown			
	No. of Contamination Sources:	0			
	Lat/Long:	37° 50' 40.00" / 122° 17' 33.00"			
	Lat/long Method:	TEALE			
	State Assembly District Code:	14			
	State Senate District:	09			

Map ID	Direction	Distance	Distance (ft.)	Elevation	Site	Database(s)	EDR ID Number	EPA ID Number	MAP FINDINGS
TRANSO/LACOSTE SITE (Continued)						S102008152			
The CAL-SITES database may contain additional details for this site. Please contact your EDR Account Executive for more information.									
CORTESE: Reg Id: 01200020 Region: CORTESE Reg By: CALSI									
AX194 WSW 1/4-1/2 2531 ft. Lower	EMERY BAY PLAZA 1650 65TH ST EMERYVILLE, CA 94608	Cortese	S103066299 N/A						
Site 1 of 4 in cluster AX CORTESE: Reg Id: 01-0558 Region: CORTESE Reg By: Leaking Underground Storage Tanks									
AX195 WBW 1/4-1/2 2531 ft. Lower	1650 65TH ST EMERYVILLE, CA	LUST	S105483216 N/A						
Site 2 of 4 in cluster AX LUST Alameda County: Region : ALAMEDA Facility ID : R00000440									
AX196 WSW 1/4-1/2 2531 ft. Lower	EMERY BAY PLAZA 1650 65TH ST EMERYVILLE, CA 94608	LUST	S102429212 N/A						
Site 3 of 4 in cluster AX State LUST: Cross Street: Not reported Qty Leaked: Not reported Case Number: 01-0558 Reg Board: San Francisco Bay Region Chemical: Gasoline Lead Agency: Local Agency Local Agency: 01000 Case Type: Other ground water affected Status: Final Remediation plan Approved County: Alameda Abate Method: Excavate and Dispose - remove contaminated soil and dispose in approved site Review Date: Not reported Workplan: 2/27/1987 Pollution Char: 8/24/1990 Remed Action: Not reported Close Date: Not reported Release Date: 5/13/1987 Cleanup Fund Id: Not reported Discover Date: 5/13/1987 Enforcement Dt: Not reported Enf Type: Not reported Confirm Leak: Not reported Prelim Assess: 2/27/1987 Remed Plan: 8/24/1990 Monitoring: Not reported									
EMERY BAY PLAZA (Continued)									
Enter Date : 4/20/1990 Funding: Federal Funds Staff Initials: UNK How Discovered: Tank Closure How Stopped: Close Tank Interim : Yes Leak Cause: Structure Failure Leak Source: Tank MTBE Date : Not reported Max MTBE GW : Not reported MTBE Tested: Site NOT Tested for MTBE. Includes Unknown and Not Analyzed. Priority: Not reported Local Case # : 4352 Beneficial: Not reported Staff : CTH GW Qualifies : Not reported Max MTBE Soil : Not reported Soil Qualifies : Not reported Hydr Basis #: Not reported Operator : Not reported Oversight Prgm: Local Oversight Program UST Oversight Prgm: LOP Review Date : 5/9/1997 Stop Date : 5/13/1987 Work Suspended N Responsible Party:BLANK RP RP Address: Not reported Global Id: T0600100511 Org Name: Not reported Contact Person: Not reported MTBE Conc: 0 Mtbe Fuel: 1 Water System Name: Not reported Well Name: Not reported Distance To Lust: 8834.184028394838007388609754 Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported									
LUST Region 2: Region: 2 Facility Id: 01-0558 Entered Date: 04/20/1990 Facility Status: Final Remediation plan Approved Maximum Soil Concentration: 6600 Maximum Groundwater Impact: 100000 County : Alameda Current Benzene: Not reported MTBE Detected in GW: 100000 MTBE Detected in Soil: Not reported MTBE: 0 MTBE Qualify: Not reported									
AY197 WNW 1/4-1/2 2540 ft. Lower	DURKEE WAREHAM 700 HEINZ ST BERKELEY, CA 94704	LUST	S102429009 N/A						
Site 1 of 2 in cluster AY State LUST:									

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

DURKEE WAREHAM (Continued)

Cross Street: Not reported
Qty Leaked: Not reported
Case Number: 01-0522
Reg Board: San Francisco Bay Region
Chemical: Oil & Grease Waste
Lead Agency: Local Agency
Local Agency: 01020
Case Type: Other ground water affected
Status: Signed off, remedial action completed or deemed unnecessary
County: Alameda
Abate Method: No Action Taken - no action has as yet been taken at the site
Review Date: Not reported Confirm Leak: Not reported
Workplan: Not reported Prelim Assess: Not reported
Pollution Char: Not reported Remed Plan: Not reported
Remed Action: Not reported Monitoring: Not reported
Close Date: 9/29/1998
Release Date: 8/1/1985
Cleanup Fund Id: Not reported
Discover Date: 8/1/1985
Enforcement Dt: Not reported
Env Type: Not reported
Enter Date: 8/1/1985
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank
Interim: No
Leak Cause: Structure Failure
Leak Source: Tank
MTBE Data: Not reported
Max MTBE GW: Not reported
MTBE Tested: Not Required to be Tested.
Priority: Not reported
Local Case #: 01-0522
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgm: Local Implementing Agency UST (includes non-LOP cases within LDP jurisdiction)
Oversight Prgm: LIA
Review Date: 9/7/1990
Stop Date: 8/1/1985
Work Suspended: N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T0800100478
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mtbe Fuel: 0
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 7087.1000220214921185680770503

8102429009

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

DURKEE WAREHAM (Continued)

Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported
LUST Region 2:
Region: 2
Facility Id: 01-0522
Entered Date: 08/01/1988
Facility Status: Signed off, remedial action completed or deemed unnecessary
Maximum Soil Concentration: 4400
Maximum Groundwater Impact: 23000
County: Alameda
Current Benzene: Not reported
MTBE Detected in GW: 23000
MTBE Detected in Soil: Not reported
MTBE: 0
MTBE Qualify: Not reported

8102429009

AY198
700 HEINZ AVENUE
1/4-1/2
2540 R.
Lower

WAREHAM PROPERTIES
700 HEINZ AVENUE
BERKELEY, CA 94710

Cal-Sites: 8102008151
Cortese: N/A

Site 2 of 2 In cluster AY

CAL-SITES:
Facility ID: 01200019
Status: COM - CERTIFIED OPERATION AND MAINTENANCE, ALL PLANNED ACTIVITIES IMPLEMENTED REMEDIATION CONTINUES
Status Date: 02/28/1988
Lead: DTSC
Region: 2 - BERKELEY
Branch: NC - NORTH COAST
File Name: Not reported
Status Name: CERTIFIED / OPERATION & MAINTENANCE
Lead Agency: DEPT OF TOXIC SUBSTANCES CONTROL
NPL: Not Listed
SIC: 20 MANU - FOOD & KINDRED PRODUCTS
Facility Type: RESPONSIBLE PARTY
Type Name: RP
Staff Member Responsible for Site: JSOTO
Supervisor Responsible for Site: KTOTH
Region Water Control Board: SF - SAN FRANCISCO BAY
Access: Controlled
Cortese: C
Hazardous Ranking Score: Not reported
Date Site Hazard Ranked: Not reported
Groundwater Contamination: Not reported
No. of Contamination Sources: 0
Lat/Long: 0° 0' 0.00" / 0° 0' 0.00"
Lat/long Method: Not reported
State Assembly District Code: 14
State Senate District: 09

The CAL-SITES database may contain additional details for this site.
Please contact your EDR Account Executive for more information.

CORTESE:
Reg Id: 01-0522
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS				EDR ID Number
Direction	Distance	Distance (ft.)	Elevation	Site	Database(s)	EDR ID Number	EPA ID Number	Database(s)	EDR ID Number	
AX199	BAY CENTER PROJECT 1685 85TH ST EMERYVILLE, CA				LUST Cortese	S100354725 N/A		BAY CENTER PROJECT (Continued)	S100354725	
114-1/2 2629 R. Lower	Site 4 of 4 In cluster AX							Mtbe Fuel: D Water System Name: Not reported Well Name: Not reported Distance To Lust: 8948.52274739880423080209881 Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported		
State LUST:								CORTESE: Reg Id: 01-0157 Region: CORTESE Reg By: Leaking Underground Storage Tanks		
Cross Street:	Not reported									
Qty Leaked:	Not reported									
Case Number:	01-0157									
Reg Board:	San Francisco Bay Region									
Chemical:	Diesel									
Lead Agency:	Local Agency									
Local Agency:	01000									
Case Type:	Other ground water affected									
Status:	Pollution Assessment Report Completed									
County:	Alameda									
Abate Method:	Remove Free Product - remove floating product from water table									
Review Date:	Not reported	Confirm Leak:	Not reported							
Workplan:	8/4/1986	Prelim Assess:	8/4/1986							
Pollution Char:	Not reported									
Remed Action:	Not reported	Remed Plan:	Not reported							
Close Date:	Not reported	Monitoring:	Not reported							
Release Date:	7/30/1985									
Cleanup Fund Id:	Not reported									
Discover Date:	7/30/1985									
Enforcement Dt:	Not reported									
Enf Type:	Not reported									
Enter Date:	1/12/1991									
Funding:	Federal Funds									
Staff Initials:	UNK									
How Discovered:	Tank Closure									
How Stopped:	Close Tank									
Interim:	Yes									
Leak Cause:	Structure Failure									
Leak Source:	Tank									
MTBE Date:	Not reported									
Max MTBE GW:	Not reported									
MTBE Tested:	Not Required to be Tested.									
Priority:	Not reported									
Local Case #:	01-0157									
Beneficial:	Not reported									
Staff:	CTH									
GW Qualifies:	Not reported									
Max MTBE Soil:	Not reported									
Soil Qualifies:	Not reported									
Hydr Basin #:	Not reported									
Operator:	Not reported									
Oversight Prgm:	Local Oversight Program UST									
Oversight Prgm:	LOP									
Review Date:	8/24/1994									
Stop Date:	7/30/1985									
Work Suspended:	N									
Responsible Party:	BLANK RP									
RP Address:	Not reported									
Global Id:	T0800100145									
Org Name:	Not reported									
Contact Person:	Not reported									
MTBE Conc:	0									
200	COBURN CONSTRUCTION									
North	1008 PARDEE ST									
1/4-1/2	BERKELEY, CA									
2837 ft.										
Higher										
State LUST:										
Cross Street:	Not reported									
Qty Leaked:	Not reported									
Case Number:	01-0436									
Reg Board:	San Francisco Bay Region									
Chemical:	Unleaded Gasoline									
Lead Agency:	Local Agency									
Local Agency:	01020									
Case Type:	Other ground water affected									
Status:	Signed off, remedial action completed or deemed unnecessary									
County:	Alameda									
Abate Method:	Excavate and Dispose - remove contaminated soil and dispose in approved site									
Review Date:	Not reported	Confirm Leak:	Not reported							
Workplan:	5/14/1987	Prelim Assess:	5/14/1987							
Pollution Char:	Not reported	Remed Plan:	Not reported							
Remed Action:	Not reported	Monitoring:	Not reported							
Close Date:	Not reported									
Release Date:	10/1/1992									
Cleanup Fund Id:	Not reported									
Discover Date:	12/18/1986									
Enforcement Dt:	Not reported									
Enf Type:	Not reported									
Enter Date:	12/18/1986									
Funding:	Federal Funds									
Staff Initials:	UNK									
How Discovered:	Tank Closure									
How Stopped:	Close Tank									
Interim:	Yes									
Leak Cause:	Structure Failure									
Leak Source:	Tank									
MTBE Date:	Not reported									
Max MTBE GW:	Not reported									
MTBE Tested:	Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.									
Priority:	Not reported									
Local Case #:	01-0436									
Beneficial:	Not reported									
Staff:	CTH									
GW Qualifies:	Not reported									
Max MTBE Soil:	Not reported									
Soil Qualifies:	Not reported									

Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number
Distance (ft.)	Elevation	EPA ID Number

COBURN CONSTRUCTION (Continued)

Hydr Basin #: Not reported
 Operator : Not reported
 Oversight Prgm: Local Implementing Agency UST (includes non-LOP cases within LOP jurisdiction)
 Oversight Prgm : LIA
 Review Date : 10/1/1992
 Stop Date : 12/18/1986
 Work Suspended N
 Responsible Party BLANK RP
 RP Address: Not reported
 Global Id: T0600100396
 Org Name: Not reported
 Contact Person: Not reported
 MTBE Conc: 0
 Mbbe Fuel: 1
 Water System Name: Not reported
 Well Name: Not reported
 Distance To Lust: 5558.8184090798585899995033835
 Waste Discharge Global ID: Not reported
 Waste Disch Assigned Name: Not reported

S162428180

Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number
Distance (ft.)	Elevation	EPA ID Number

PQ CORP THE (Continued)

RCRIS:
 Owner: THE PQ CORPORATION
 (415) 555-1212
 EPA ID: CAD009146663
 Contact: ENVIRONMENTAL MANAGER
 (415) 845-1048
 Classification: Small Quantity Generator
 Used Oil Recyc: No
 TSDF Activities: Not reported
 Violation Status: No violations found

1000180425

FINDS:

Other Pertinent Environmental Activity Identified at Site:
 Facility Registry System (FRS)
 National Emissions Trends (NET)
 National Toxics Inventory (NTI)
 Resource Conservation and Recovery Act Information System (RCRAINFO)
 Toxic Chemical Release Inventory System (TRIS)

State LUST:

Cross Street: Not reported
 Cty Leaked: Not reported
 Case Number: 01-1203
 Reg Board: San Francisco Bay Region
 Chemical: Diesel
 Lead Agency: Local Agency
 Local Agency : 01020
 Case Type: Soil only
 Status: Signed off, remedial action completed or deemed unnecessary
 County: Alameda
 Abate Method: No Action Taken - no action has as yet been taken at the site
 Review Date: Not reported Confirm Leak: Not reported
 Workplan: Not reported Prelim Assess: Not reported
 Pollution Char: Not reported Remed Plan: Not reported
 Remed Action: Not reported Monitoring: Not reported
 Close Date: 11/8/1994
 Release Date: 11/8/1986
 Cleanup Fund Id: Not reported
 Discover Date: 11/8/1986
 Enforcement Dt: Not reported
 Enf Type: Not reported
 Enter Date : 11/8/1986
 Funding: Federal Funds
 Staff Initials: UNK
 How Discovered: Tank Closure
 How Stopped: Close Tank
 Intern: No
 Leak Cause: Structure Failure
 Leak Source: Tank
 MTBE Date : Not reported
 Max MTBE GW: Not reported
 MTBE Tested: Not Required to be Tested.
 Priority: Not reported
 Local Case #: 01-1203
 Beneficial: Not reported

LUST Region 2:

Region: 2
 Facility Id: 01-0436
 Entered Date: 12/18/1986
 Facility Status: Signed off, remedial action completed or deemed unnecessary
 Maximum Soil Concentration: 1000
 Maximum Groundwater Impact: 31000
 County : Alameda
 Current Benzene: 1
 MTBE Detected in GW: 31000
 MTBE Detected in Soil: Not reported
 MTBE: 0
 MTBE Qualify: Not reported

CORTESE:
 Reg Id: 01-0438
 Region: CORTESE
 Reg By: Leaking Underground Storage Tanks

201 PQ CORP THE
 NW 801 GRAYSON ST
 1/2-1 BERKELEY, CA 94710
 2644 ft.
 Lower

RCRIS-SQG 1000180425
 FINDS CAD009146663
 LUST
 Corse
 TSCA
 CA FID UST
 HIST UST

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS			
Direction	Database(s)	EDR ID Number	EPA ID Number	Site	Direction	Database(s)	EDR ID Number	EPA ID Number	Site
PQ CORP THE (Continued)					PQ CORP THE (Continued)				
1000180425					1000180425				
Staff: CTH GW Qualifies: Not reported Max MTBE Soil: Not reported Soil Qualifies: Not reported Hydr Basin #: Not reported Operator: Not reported Oversight Prgm: Local Implementing Agency UST (includes non-LOP cases within LOP jurisdiction) Oversight Prgm : LIA Review Date : 2/10/1998 Stop Date : 11/8/1986 Work Suspended N Responsible Party:BLANK RP RP Address: Not reported Global Id: T0600101106 Org Name: Not reported Contact Person: Not reported MTBE Conc: 0 Mbbe Fuel: 0 Water System Name: Not reported Well Name: Not reported Distance To Lust: 6977.3145982997526339101176857 Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported					Facility ID: 67591 Tank Num: 1 Tank Capacity: 28600 Tank Used for: PRODUCT Type of Fuel: Not Reported Leak Detection: Stock Inventor Contact Name: ED KOSHETAR Total Tanks: 3 Facility Type: 2 Facility ID: 67591 Tank Num: 2 Tank Capacity: 10000 Tank Used for: PRODUCT Type of Fuel: Not Reported Leak Detection: Stock Inventor Contact Name: ED KOSHETAR Total Tanks: 3 Facility Type: 2 Facility ID: 67581 Tank Num: 3 Tank Capacity: 500 Tank Used for: PRODUCT Type of Fuel: REGULAR Leak Detection: Stock Inventor Contact Name: ED KOSHETAR Total Tanks: 3 Facility Type: 2				
LUST Region 2: Region: 2 Facility Id: 01-1203 Entered Date: 11/06/1986 Facility Status: Signed off, remedial action completed or deemed unnecessary Maximum Soil Concentration: 3300 Maximum Groundwater Impact: 0 County : Alameda Current Benzene: Not reported MTBE Detected in GW: No MTBE Detected in Soil: Not reported MTBE: 0 MTBE Qualify: Not reported					202 South 1/2-1 2668 ft. Lower				
CORTESE: Reg Id: 01-1203 Region: CORTESE Reg By: Leaking Underground Storage Tanks					OWENS TRUCKING AND CONCRETE SA 5812 HOLLIS ST EMERYVILLE, CA 94608				
FID: Facility ID: 01001320 Reg By: Active Underground Storage Tank Location Cortese Code: Not reported Status: Active Mail To: Not reported 801 GRAYSON ST BERKELEY, CA 94710 Contact: Not reported DUNS No: Not reported Creation: 10/22/93 EPA ID: Not reported Comments: Not reported					ALAMEDA Facility ID: R00000201 HAZNET: Gepaid: CAL000057152 Tepaid: CAD053044053 Gen County: 1 Ted County: 1 Tons: .0333 Category: Liquids with halogenated organic compounds > 1000 mg/l Disposal Method: Transfer Station Contact: Not reported Telephone: (000) 000-0000 Mailing Address: 5812 HOLLIS ST EMERYVILLE, CA 94608 - 2016 County: 1				
UST HIST:					CORTESE: Reg Id: 01-1203 Region: CORTESE Reg By: Leaking Underground Storage Tanks				

Map ID	MAP FINDINGS			Map ID	MAP FINDINGS			
Direction	Database(s)	EDR ID Number	EPA ID Number	Direction	Database(s)	EDR ID Number	EPA ID Number	
Distance				Distance				
Distance (ft.)				Distance (ft.)				
Elevation	Site			Elevation	Site			
203	GATEWAY LIQUORS 5944 SAN PABLO 1/2-1 OAKLAND, CA 94608 2815 ft. Higher	HAZNET LUST Cortese	\$102430664 N/A	GATEWAY LIQUORS (Continued) State LUST: Cross Street: Not reported Qty Leaked: Not reported Case Number: 01-2035 Reg Board: San Francisco Bay Region Chemical: Kerosene Lead Agency: Local Agency Local Agency: 01000 Case Type: Soil only Status: Preliminary site assessment underway County: Alameda Review Date: Not reported Workplan: 1/2/1965 Pollution Char: Not reported Remed Action: Not reported Close Date: Not reported Release Date: 12/15/1994 Cleanup Fund Id: Not reported Discover Date: 6/29/1994 Enforcement Dt: Not reported Env Type: Not reported Enter Date: 3/22/1995 Funding: Federal Funds Staff Initials: UNK How Discovered: Other Means How Stopped: Other Means Interim: Not reported Leak Cause: Unknown Leak Source: Unknown MTBE Date: Not reported Max MTBE GW: Not reported MTBE Tested: Not Required to be Tested. Priority: Not reported Local Case #: 4897 Beneficial: Not reported Staff: CTH GW Qualifies: Not reported Max MTBE Soil: Not reported Soil Qualifies: Not reported Hydr Basin #: Not reported Operator: Not reported Oversight Prgm: Local Oversight Program UST Oversight Prgm: LOP Review Date: 6/16/1998 Stop Date: 6/29/1994 Work Suspended: N Responsible Party: BLANK RP RP Address: Not reported Global Id: T0600101680 Org Name: Not reported Contact Person: Not reported MTBE Conc: 0 Mtbe Fuel: 0				
204	NNW 1/2-1 2864 ft. Higher	BERKELEY HUMANE SOCIETY 2700 6TH ST BERKELEY, CA 94702	LUST Cortese N/A	State LUST: Cross Street: Not reported Qty Leaked: Not reported				

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

BERKELEY HUMANE SOCIETY (Continued)

Case Number: 01-0194
 Reg Board: San Francisco Bay Region
 Chemical: Xylene
 Lead Agency: Local Agency
 Local Agency: 01020
 Case Type: Undefined
 Status: Signed off, remedial action completed or deemed unnecessary
 County: Alameda
 Abate Method: No Action Taken - no action has as yet been taken at the site
 Review Date: 8/8/1991 Confirm Leak: 8/8/1991
 Workplan: Not reported Prelim Assess: Not reported
 Pollution Char: Not reported Remed Plan: Not reported
 Remed Action: Not reported Monitoring: Not reported
 Close Date: 7/25/1994
 Release Date: 1/31/1991
 Cleanup Fund Id: Not reported
 Discover Date: 1/31/1991
 Enforcement Dl: Not reported
 Enf Type: Not reported
 Enter Date: 8/8/1991
 Funding: Federal Funds
 Staff Initials: UNK
 How Discovered: Tank Closure
 How Stopped: Close Tank
 Interim: No
 Leak Cause: Structure Failure
 Leak Source: Tank
 MTBE Data: Not reported
 Max MTBE GW: Not reported
 MTBE Tested: Not Required to be Tested.
 Priority: Not reported
 Local Case #: 01-0194
 Beneficial: Not reported
 Staff: CTH
 GW Qualifies: Not reported
 Max MTBE Soil: Not reported
 Soil Qualifies: Not reported
 Hydr Basin #: Not reported
 Operator: Not reported
 Oversight Prgm: Local Implementing Agency UST (includes non-LOP cases within LOP jurisdiction)
 Oversight Prgm: LIA
 Review Date: 1/11/1996
 Stop Date: 1/31/1991
 Work Suspended: N
 Responsible Party: BLANK RP
 RP Address: Not reported
 Global Id: T0500100161
 Org Name: Not reported
 Contact Person: Not reported
 MTBE Conc: 0
 Mtbe Fuel: 0
 Water System Name: Not reported
 Well Name: Not reported
 Distance To Lust: 5558.7382819590673192284894111
 Waste Discharge Global ID: Not reported
 Waste Disch Assigned Name: Not reported

S101293441

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

BERKELEY HUMANE SOCIETY (Continued)

LUST Region 2:
 Region: 2
 Facility Id: 01-0194
 Entered Date: 08/08/1991
 Facility Status: Signed off, remedial action completed or deemed unnecessary
 Maximum Soil Concentration: 0
 Maximum Groundwater Impact: 0
 County: Alameda
 Current Benzene: Not reported
 MTBE Detected in GW: No
 MTBE Detected in Soil: Not reported
 MTBE: 0
 MTBE Qualify: Not reported
 CORTESE:
 Reg Id: 01-0194
 Region: CORTESE
 Reg By: Leaking Underground Storage Tanks

205
East
1/2-1
2855 ft.
Higher

MORE PROPERTY
3155 SACRAMENTO ST
BERKELEY, CA

LUST S100226240
Cortese N/A

State LUST:
 Cross Street: Not reported
 Qty Leaked: Not reported
 Case Number: 01-1016
 Reg Board: San Francisco Bay Region
 Chemical: Gasoline
 Lead Agency: Local Agency
 Local Agency: 01020
 Case Type: Soil only
 Status: Signed off, remedial action completed or deemed unnecessary
 County: Alameda
 Abate Method: No Action Taken - no action has as yet been taken at the site
 Review Date: Not reported Confirm Leak: Not reported
 Workplan: Not reported Prelim Assess: Not reported
 Pollution Char: Not reported Remed Plan: Not reported
 Remed Action: Not reported Monitoring: Not reported
 Close Date: 7/25/1994
 Release Date: 5/8/1987
 Cleanup Fund Id: Not reported
 Discover Date: 5/8/1987
 Enforcement Dl: Not reported
 Enf Type: Not reported
 Enter Date: 5/8/1984
 Funding: Federal Funds
 Staff Initials: UNK
 How Discovered: Tank Closure
 How Stopped: Close Tank
 Interim: No
 Leak Cause: Structure Failure
 Leak Source: Tank
 MTBE Data: Not reported
 Max MTBE GW: Not reported
 MTBE Tested: Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.
 Priority: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

MOORE PROPERTY (Continued)

Local Case #: 01-1018
Beneficiary: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgrm: Local Implementing Agency UST (Includes non-LOP cases within LOP jurisdiction)
Oversight Prgrm: LIA
Review Date: 10/3/1997
Stop Date: 5/8/1987
Work Suspended: N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T0600100538
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mtbe Fuel: 1
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 4467.289499762732111995557157
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

S100226240

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

LIFELONG MEDICAL CARE (Continued)

Status Name: NO ACTION - FOR CALMORTGAGE ONLY
Lead Agency: DEPT OF TOXIC SUBSTANCES CONTROL
NPL: Not reported
SIC: 80 HEALTH SERVICES
Facility Type: CALMORTGAGE ONLY
Type Name: CMORT
Staff Member Responsible for Site: SKARINEN
Supervisor Responsible for Site: BCOLER
Region Water Control Board: SF - SAN FRANCISCO BAY
Access: Not reported
Confess: Not reported
Hazardous Ranking Score: Not reported
Date Site Hazard Ranked: Not reported
Groundwater Contamination: Not reported
No. of Contamination Sources: 0
Lat/Long: 0° 0' 0.00" / 0° 0' 0.00"
Lat/long Method: Not reported
State Assembly District Code: Not reported
State Senate District: Not reported

S102426827

The CAL-SITES database may contain additional details for this site.
Please contact your EDR Account Executive for more information.

LUST Region 2:

Region: 2
Facility Id: 01-1018
Entered Date: 05/08/1984
Facility Status: Signed off, remedial action completed or deemed unnecessary
Maximum Soil Concentration: 2
Maximum Groundwater Impact: 0
County: Alameda
Current Benzene: Not reported
MTBE Detected In GW: No
MTBE Detected In Salt: Not reported
MTBE: 0
MTBE Quality: Not reported

CORTESE:

Reg Id: 01-1018
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

AZ207
East
1/2-1
2970 ft.
Higher

CHEVRON
3250 SACRAMENTO ST
BERKELEY, CA 94705

Cortese S103030489
N/A

Site 2 of 2 in cluster AZ

CORTESE:
Reg Id: 01-0360
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

208
SSW
1/2-1
2976 ft.
Lower

1X MARKET PLACE C/O THE MARTIN CO
5800 SHELLMOUND ST
EMERYVILLE, CA 94608

HAZNET S101306386
LUST N/A
Cortese

State LUST:
Cross Street: Not reported
City Leaked: Not reported
Case Number: 01-1047
Reg Board: San Francisco Bay Region
Chemical: Gasoline
Lead Agency: Local Agency
Local Agency: 01000
Case Type: Undefined
Status: Leak being confirmed
County: Alameda
Abate Method: No Action Taken - no action has as yet been taken at the site
Review Date: 5/5/2000 Confirm Leak: 5/5/2000
Workplan: Not reported Prelim Assess: Not reported
Pollution Char: Not reported Remed Plan: Not reported
Remed Action: Not reported Monitoring: Not reported
Close Date: Not reported Release Date: 5/21/1988

AZ206
East
1/2-1
2970 ft.
Higher

Site 1 of 2 in cluster AZ

CAL-SITES:
Facility ID: 01800001
Status: NA
Status Date: 10/10/1997
Lead: DTSC
Region: 2 - BERKELEY
Branch: CM - CALMORTGAGE
File Name: Not reported

Cal-Sites S102426827
N/A

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance		EPA ID Number	Distance (ft.)		EPA ID Number
Elevation	Site		Elevation	Site	
1X MARKET PLACE C/O THE MARTIN CO (Continued)		8101306386	1X MARKET PLACE C/O THE MARTIN CO (Continued)		8101306386
Cleanup Fund Id : Not reported			Region: CORTESE		
Discover Date : 5/21/1988			Reg By: Leaking Underground Storage Tanks		
Enforcement Dt : Not reported					
Env Type: Not reported					
Enter Date : 5/21/1988					
Funding: Federal Funds					
Staff Initials: UNK					
How Discovered: Tank Closure					
How Stopped: Close Tank					
Interim : No					
Leak Cause: Structure Failure					
Leak Source: Tank					
MTBE Date : Not reported					
Max MTBE GW : Not reported					
MTBE Tested: Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.					
Priority: Not reported					
Local Case #: 01-1047					
Beneficial: Not reported					
Staff : CTH					
GW Qualifies : Not reported					
Max MTBE Soil : Not reported					
Soil Qualifies : Not reported					
Hydr Basin #: Not reported					
Operator : Not reported					
Oversight Prgm: Local Oversight Program UST					
Oversight Prgm: LOP					
Review Date : 5/11/2001					
Stop Date : 5/21/1988					
Work Suspended N					
Responsible Party: BLANK RP					
RP Address: Not reported					
Global Id: T0600100966					
Org Name: Not reported					
Contact Person: Not reported					
MTBE Conc: 0					
Mtbe Fuel: 1					
Water System Name: Not reported					
Well Name: Not reported					
Distance To Lust: 10259.777865890633198503257247					
Waste Discharge Global ID: Not reported					
Waste Disch Assigned Name: Not reported					
HAZNET:					
Gapaid: CAD982319329					
Tepaid: CAT080010101					
Gen County: 1					
Tsd County: San Diego					
Tons: 2250					
Category: Contaminated soil from site clean-ups					
Disposal Method: Transfer Station					
Contact: Not reported					
Telephone: (800) 000-0000					
Mailing Address: 6425 CHRISTIE AVE SUITE 408 EMERYVILLE, CA 94608					
County: 1					
CORTESE:					
Reg Id: 01-1047					
BA209					
North					
1/2-1					
2000 ft.					
Higher					
STUDIO COMPLEX					
1025 CARLETON ST					
BERKELEY, CA 94710					
Site 1 of 2 in cluster BA					
State LUST:					
Cross Street: Not reported					
City Leaked: Not reported					
Case Number: 01-1432					
Reg Board: San Francisco Bay Region					
Chemical: Paint Thinner					
Lead Agency: Local Agency					
Local Agency: D1020					
Case Type: Soil only					
Status: Signed off, remedial action completed or deemed unnecessary					
County: Alameda					
Abate Method: No Action Taken - no action has as yet been taken at the site					
Review Date: 2/8/1989			Confirm Leak: 2/8/1989		
Workplan: Not reported			Prelim Assess: Not reported		
Pollution Char: Not reported			Remed Plan: Not reported		
Remed Action: Not reported			Monitoring: Not reported		
Close Date: 5/3/1994					
Release Date: 2/8/1989					
Cleanup Fund Id : Not reported					
Discover Date : 11/10/1988					
Enforcement Dt : Not reported					
Env Type: Not reported					
Enter Date : 4/13/1989					
Funding: Federal Funds					
Staff Initials: UNK					
How Discovered: Tank Closure					
How Stopped: Close Tank					
Interim : No					
Leak Cause: Structure Failure					
Leak Source: Tank					
MTBE Date : Not reported					
Max MTBE GW : Not reported					
MTBE Tested: Not Required to be Tested.					
Priority: Not reported					
Local Case #: 01-1432					
Beneficial: Not reported					
Staff : CTH					
GW Qualifies : Not reported					
Max MTBE Soil : Not reported					
Soil Qualifies : Not reported					
Hydr Basin #: Not reported					
Operator : Not reported					
Oversight Prgm: Local implementing Agency UST (Includes non-LOP cases within LOP jurisdiction)					
Oversight Prgm: LIA					
Review Date: 5/3/1994					
Stop Date: 11/10/1988					
Work Suspended N					
Responsible Party: BLANK RP					
RP Address: Not reported					
LUST					
Cortese					
N/A					

Map ID Direction Distance Distance (ft.) Elevation	Site	MAP FINDINGS		Map ID Direction Distance Distance (ft.) Elevation	Site	MAP FINDINGS	
		Database(s)	EDR ID Number EPA ID Number			Database(s)	EDR ID Number EPA ID Number
STUDIO COMPLEX (Continued)			S102438167	OLIVER COMPANY (Continued)			S101293398
Global Id:	T0600101322			Funding:	Federal Funds		
Org Name:	Not reported			Staff Initials:	UNK		
Contact Person:	Not reported			How Discovered:	Tank Closure		
MTBE Conc:	0			How Stopped:	Close Tank		
Mtbe Fuel:	0			Interim:	Yes		
Water System Name:	Not reported			Leak Cause:	Structure Failure		
Well Name:	Not reported			Leak Source:	Tank		
Distance To Lust:	5268.3585982573981158224047932			MTBE Date:	Not reported		
Waste Discharge Global ID:	Not reported			Max MTBE GW:	Not reported		
Waste Disch Assigned Name:	Not reported			MTBE Tested:	Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.		
LUST Region 2:				Priority:	Not reported		
Region:	2			Local Case #:	01-1092		
Facility Id:	01-1432			Beneficial:	Not reported		
Entered Date:	04/13/1989			Staff:	CTH		
Facility Status:	Signed off, remedial action completed or deemed unnecessary			GW Qualifies:	Not reported		
Maximum Soil Concentration:	71			Max MTBE Soil:	Not reported		
Maximum Groundwater Impact:	0			Soil Qualifies:	Not reported		
County:	Alameda			Hydr Basin #:	Not reported		
Current Benzene:	Not reported			Operator:	Not reported		
MTBE Detected In GW:	No			Oversight Prgm:	Local Implementing Agency UST (Includes non-LOP cases within LOP jurisdiction)		
MTBE Detected In Soil:	Not reported			Oversight Prgm:	LIA		
MTBE:	0			Review Date:	8/23/1994		
MTBE Qualify:	Not reported			Stop Date:	4/22/1987		
CORTESE:				Work Suspended:	N		
Reg Id:	01-1432			Responsible Party:	BLANK RP		
Region:	CORTESE			RP Address:	Not reported		
Reg By:	Leaking Underground Storage Tanks			Global Id:	T0600101008		
BA210	OLIVER COMPANY			Org Name:	Not reported		
North	1035 CARLETON ST			Contact Person:	Not reported		
1/2-1	BERKELEY, CA 94710			MTBE Conc:	0		
2999 ft.				Mtbe Fuel:	1		
Higher	Site 2 of 2 in cluster BA			Water System Name:	Not reported		
State LUST:				Well Name:	Not reported		
Cross Street:	Not reported			Distance To Lust:	5238.34694088878872023660678		
City Leaked:	Not reported			Waste Discharge Global ID:	Not reported		
Case Number:	01-1092			Waste Disch Assigned Name:	Not reported		
Reg Board:	San Francisco Bay Region						
Chemical:	Gasoline						
Lead Agency:	Local Agency						
Local Agency:	01020						
Case Type:	Soil only						
Status:	Signed off, remedial action completed or deemed unnecessary						
County:	Alameda						
Above Method:	Excavate and Treat - remove contaminated soil and treat (includes spreading or land farming)						
Review Date:	Not reported						
Workplan:	5/16/1987						
Pollution Char:	Not reported						
Remed Action:	Not reported						
Close Date:	8/24/1994						
Release Date:	4/22/1987						
Cleanup Fund Id:	Not reported						
Discover Date:	4/22/1987						
Enforcement Dv:	Not reported						
Enf Type:	Not reported						
Enter Date:	4/22/1987						
LUST	S101293398						
Cortese	N/A						
LUST Region 2:							
Region:	2						
Facility Id:	01-1092						
Entered Date:	04/22/1987						
Facility Status:	Signed off, remedial action completed or deemed unnecessary						
Maximum Soil Concentration:	170						
Maximum Groundwater Impact:	0						
County:	Alameda						
Current Benzene:	Not reported						
MTBE Detected In GW:	No						
MTBE Detected In Soil:	Not reported						
MTBE:	0						
MTBE Qualify:	Not reported						
CORTESE:							
Reg Id:	01-1092						
Region:	CORTESE						
Reg By:	Leaking Underground Storage Tanks						

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS		
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number	
Distance		EPA ID Number	Distance		EPA ID Number	
Elevation	Site		Elevation	Site		
BB211	CARLETON BUSINESS CENTER NNW 1/2-1 3003 ft. Lower	CARLETON BUSINESS CENTER 2703 7TH AVE BERKELEY, CA Site 1 of 4 in cluster BB	LUST Cortese	S102426347 N/A	CARLETON BUSINESS CENTER (Continued) MTBE Conc: 0 Mibe Fuel: 1 Water System Name: Not reported Well Name: Not reported Distance To Lust: 7435.2482229911270369562838846 Waste Discharge Global ID: Not reported Waste Disch Assigned Name: Not reported	S102426347
State LUST:			LUST Region 2:			
Cross Street:	Not reported		Region:	2		
City Leaked:	Not reported		Facility Id:	01-0281		
Case Number:	01-0281		Entered Date:	11/20/1991		
Reg Board:	San Francisco Bay Region		Facility Status:	Signed off, remedial action completed or deemed unnecessary		
Chemical:	Gasoline		Maximum Soil Concentration:	497		
Lead Agency:	Local Agency		Maximum Groundwater Impact:	9999999		
Local Agency:	01020		County:	Alameda		
Case Type:	Other ground water affected		Current Benzene:	Not reported		
Status:	Signed off, remedial action completed or deemed unnecessary		MTBE Detected in GW:	9999999		
County:	Alameda		MTBE Detected in Soil:	Not reported		
Abmts Method:	No Action Taken - no action has as yet been taken at the site		MTBE:	0		
Review Date:	11/20/1991	Confirm Leak: 11/20/1991	MTBE Qualify:	Not reported		
Workplan:	8/13/1991	Prelim Assess: 8/13/1991	CORTES:			
Pollution Char:	Not reported	Remed Plan: Not reported	Reg Id:	01-0281		
Remed Action:	Not reported	Monitoring: Not reported	Region:	CORTESE		
Close Date:	3/6/1992		Reg By:	Leaking Underground Storage Tanks		
Release Date:	9/20/1991					
Cleanup Fund Id:	Not reported					
Discover Date:	9/20/1991					
Enforcement Dt:	Not reported					
Enf Type:	Not reported					
Enter Date:	11/20/1991					
Funding:	Federal Funds					
Staff Initials:	UNK					
How Discovered:	Tank Closure					
How Stopped:	Close Tank					
Interim:	No					
Leak Cause:	Structure Failure					
Leak Source:	Tank					
MTBE Date:	Not reported					
Max MTBE GW:	Not reported					
MTBE Tested:	Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.					
Priority:	Not reported					
Local Case #:	01-0261					
Beneficiat:	Not reported					
Staff:	CTH					
GW Qualifies:	Not reported					
Max MTBE Soll:	Not reported					
Soll Qualifies:	Not reported					
Hydr Basin #:	Not reported					
Operator:	Not reported					
Oversight Prgm:	Local Implementing Agency UST (includes non-LOP cases within LOP jurisdiction)					
Oversight Prgm:	LIA					
Review Date:	11/20/1991					
Stop Date:	9/20/1991					
Work Suspended:	N					
Responsible Party:	BLANK RP					
RP Address:	Not reported					
Global Id:	T0600100261					
Org Name:	Not reported					
Contact Person:	Not reported					
BB212	COLGATE PALMOLIVE CO NNW 1/2-1 3020 ft. Lower	COLGATE PALMOLIVE CO 2700 7TH ST BERKELEY, CA 94710 Site 2 of 4 in cluster BB	Cal-Sites RCRIS-SQG FINDS HAZNET LUST TSCA CA SLIC CA FID UST HIST UST	1000233074 CAD009173733		
RCRIS:						
Owner:	COLGATE-PALMOLIVE COMPANY					
(212) 751-1200						
EPA ID:	CAD009173733					
Contact:	ENVIRONMENTAL MANAGER					
(415) 845-1500						
Classification:	Small Quantity Generator					
Used Oil Recyc:	No					
TSDF Activities:	Not reported					
Violation Status:	Violations exist					
Regulation Violated:	Not reported					
Area of Violation:	GENERATOR-GENERAL REQUIREMENTS					
Date Violation Determined:	12/27/1984					
Actual Date Achieved Compliance:	03/25/1985					
Regulation Violated:	Not reported					
Area of Violation:	GENERATOR-GENERAL REQUIREMENTS					
Date Violation Determined:	01/18/1984					
Actual Date Achieved Compliance:	03/25/1985					

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance		EPA ID Number	Distance (ft.)		EPA ID Number
Elevation	Site		Elevation	Site	
COLGATE PALMOLIVE CO (Continued)		1000233074	COLGATE PALMOLIVE CO (Continued)		1000233074
There are 2 violation record(s) reported at this site:					
Evaluation	Area of Violation	Date of Compliance	Evaluation	Area of Violation	Date of Compliance
Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	19850326	Compliance Evaluation Inspection	GENERATOR-GENERAL REQUIREMENTS	19850325
FINDS:					
Other Pertinent Environmental Activity Identified at Site:					
Facility Registry System (FRS)					
National Compliance Database (NCDB)					
Resource Conservation and Recovery Act Information system (RCRAINFO)					
State LUST:					
Cross Street:	Not reported				
Qty Leaked:	Not reported				
Case Number:	01-0280				
Reg Board:	San Francisco Bay Region				
Chemical:	Gasoline				
Lead Agency:	Local Agency				
Local Agency:	01020				
Case Type:	Soil only				
Status:	Signed off, remedial action completed or deemed unnecessary				
County:	Alameda				
Abate Method:	No Action Taken - no action has as yet been taken at the site				
Review Date:	6/8/1989	Confirm Leak:	6/6/1989		
Workplan:	Not reported	Prelim Assess:	Not reported		
Pollution Char:	Not reported	Remed Plan:	Not reported		
Remed Action:	Not reported	Monitoring:	Not reported		
Close Date:	3/6/1992				
Release Date:	4/27/1989				
Cleanup Fund Id:	Not reported				
Discover Date:	4/27/1989				
Enforcement Dt:	Not reported				
Ent Type:	Not reported				
Enter Date:	6/8/1989				
Funding:	Federal Funds				
Staff Initials:	UNK				
How Discovered:	Tank Closure				
How Stopped:	Close Tank				
Interim:	No				
Leak Cause:	Structure Failure				
Leak Source:	Tank				
MTBE Date:	Not reported				
Max MTBE GW:	Not reported				
MTBE Tested:	Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.				
Priority:	Not reported				
Local Case #:	01-0280				
Beneficiat:	Not reported				
Staff:	CTH				
GW Qualifies:	Not reported				
Max MTBE Soil:	Not reported				
Soil Qualifies:	Not reported				
Hydr Basin #:	Not reported				
Operator:	Not reported				
Oversight Prgm:	Local Implementing Agency UST (includes non-LOP cases within LOP jurisdiction)				
Oversight Prgm: LIA					
Review Date: 11/20/1991					
Stop Date: 4/27/1989					
Work Suspended: N					
Responsible Party: BLANK RP					
RP Address: Not reported					
Global Id: T0600100260					
Org Name: Not reported					
Contact Person: Not reported					
MTBE Conc: 0					
Mtbe Fuel: 1					
Water System Name: Not reported					
Well Name: Not reported					
Distance to Lust: 6345.0752161683328872880989387					
Waste Discharge Global ID: Not reported					
Waste Diech Assigned Name: Not reported					
LUST Region 2:					
Region: 2					
Facility Id: 01-0280					
Entered Date: 06/08/1989					
Facility Status: Signed off, remedial action completed or deemed unnecessary					
Maximum Soil Concentration: 497					
Maximum Groundwater Impact: 0					
County: Alameda					
Current Benzene: Not reported					
MTBE Detected in GW: No					
MTBE Detected in Soil: Not reported					
MTBE: 0					
MTBE Quality: Not reported					
CAL-SITES:					
Facility ID: 01280047					
Status: CERT - CERTIFIED AS HAVING BEEN REMEDIED SATISFACTORILY UNDER DTSC OVERSIGHT					
Status Date: 01/01/1985					
Lead: Not reported					
Region: 2 - BERKELEY					
Branch: NC - NORTH COAST					
File Name: Not reported					
Status Name: CERTIFIED					
Lead Agency: N/A					
NPL: Not reported					
SIC: 26 MANU - CHEMICALS & ALLIED PRODUCTS					
Facility Type: N/A					
Type Name: Not reported					
Staff Member Responsible for Site: Not reported					
Supervisor Responsible for Site: Not reported					
Region Water Control Board: Not reported					
Access: Not reported					
Corridor: Not reported					
Hazardous Ranking Score: Not reported					
Date Site Hazard Ranked: Not reported					
Groundwater Contamination: Not reported					
No. of Contamination Sources: 0					
Lat/Long: 0° 0' 0.00" / 0° 0' 0.00"					
Lat/Long Method: Not reported					
State Assembly District Code: 14					

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS		
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number	
Distance		EPA ID Number	Distance		EPA ID Number	
Elevation	Site		Elevation	Site		
COLGATE PALMOLIVE CO (Continued)		1000233074	COLGATE PALMOLIVE CO (Continued)		1000233074	
State Senate District:	09					
The CAL-SITES database may contain additional details for this site. Please contact your EDR Account Executive for more information.						
HAZNET:						
Gepaid:	CAD981168883		Region:	2		
Tepaid:	NVT330010000		Facility Status:	Closed - No Further Action	Not reported	
Gen County:	1		Staff:	RDB	Not reported	
Tsd County:	99		Last Site Update:	10/10/18		
Tons:	.8816		NPL Status:	Not an NPL site		
Category:	Polychlorinated biphenyls and material containing PCB's		Case List:	SLIC	Discovery Date:	Not reported
Disposal Method:	Not reported		Date Closed:	Not reported	Imaged:	No
Contact:	BERKELEY DEV ASSOCIATES		Abate Method:	Not reported	Cost Recovery:	No
Telephone:	(510) 845-1500		Case Type:	TK	Substance:	Not reported
Mailing Address:	2700 7TH ST BERKELEY, CA 94710		Contamination:	Not reported	Sample Date:	Not reported
County	1		Lead:	RWCBC		
Gepaid:	CAD981168883		Contamination Level:			
Tepaid:	CAD981382732		Number of Municipal Wells Contaminated by Site:	0		
Gen County:	1		Number of Private Wells Contaminated by Site:	0		
Tsd County:	1		Soil Removal Action Taken/Needed:	0		
Tons:	1.0856		Soil Removal or Contaminant Action Started:			
Category:	Asbestos-containing waste		Soil Removal or Contaminant Action Completed:	0		
Disposal Method:	Disposal, Land Fill		On-Site Groundwater Extraction or Containment Is Needed:	0		
Contact:	BERKELEY DEV ASSOCIATES		On-Site Groundwater Extraction or Containment Started:			
Telephone:	(510) 845-1500		Off-Site Groundwater Extraction or Containment Is Needed:			
Mailing Address:	2700 7TH ST BERKELEY, CA 94710		Off-Site Groundwater Extraction or Containment Started:			
County	1		Length of Contamination Plume (Feet):	0		
Gepaid:	CAD981168883		Depth of Contamination Plume (Feet):	0		
Tepaid:	NVT330010000		Wells Cleared Due To Contamination of Site:			
Gen County:	1		Days of Wells Closure:			
Tsd County:	99		Nearest Public or Private Drinking Water Well (Feet):	0		
Tons:	.3857		Under Jurisdiction of Lead Agency Date:			
Category:	Polychlorinated biphenyls and material containing PCB's		Latitude/longitude:	38 / -122		
Disposal Method:	Not reported		Flow Rate:	0		
Contact:	BERKELEY DEV ASSOCIATES		Flow Date:			
Telephone:	(510) 845-1500		Percent of Contaminants Contained:	0		
Mailing Address:	2700 7TH ST BERKELEY, CA 94710		Contaminant Type:			
County	1		EPA ID:			
Gepaid:	CAD981168883		Stages of Site Investigation Process Initiated:			
Tepaid:	NVT330010000		Begun Characterization :	Not reported		
Gen County:	1		Completed Characterization :	Not reported		
Tsd County:	99		Begun Remediation:	Not reported		
Tons:	.4408		Completed Remediation:	Not reported		
Category:	Polychlorinated biphenyls and material containing PCB's		Submitted Remediation Plan:	Not reported		
Disposal Method:	Disposal, Land Fill		Approved Remediation Plan:	Not reported		
Contact:	BERKELEY DEV ASSOCIATES		Begun Final Remedial Action:	Not reported		
Telephone:	(510) 845-1500		Completed Final Remedial Action:	Not reported		
Mailing Address:	2700 7TH ST BERKELEY, CA 94710		Facility Desc:	WAS COLGATE PALMOLIVE		
County	1		Comment:	FINAL CLOSURE GIVEN 8/5/97		
SLIC Region 2:			UST HIST:			
Facility ID:	01S0107		Facility ID:	48029		
			Tank Num:	1	Container Num:	1
			Tank Capacity:	6500	Year Installed:	Not reported
			Tank Used for:	PRODUCT	Tank Construction:	1/4 Inches
			Type of Fuel:	Not Reported		
			Leak Detection:	Stock Inventor	Telephone:	(415) 845-1500
			Contact Name:	RALPH TIERNEY	Region:	STATE
			Total Tanks:	4	Other Type:	INDUSTRIAL PLANT
			Facility Type:	2		
			Facility ID:	48028	Container Num:	2
			Tank Num:	2		

Map ID	MAP FINDINGS	EDR ID Number	Map ID	MAP FINDINGS	EDR ID Number
Direction		EPA ID Number	Direction		EPA ID Number
Distance			Distance		
Elevation	Site		Elevation	Site	
Database(s)			Database(s)		
COLGATE PALMOLIVE CO (Continued)		1000233074	ELECTRO-COATING INC - PLANT 21 (Continued)		8102008198
Tank Capacity: 6600	Year Installed: Not reported		Lat/Mong Method:	Not reported	
Tank Used for: PRODUCT	Tank Construction: 1/4 inches		State Assembly District Code:	Not reported	
Type of Fuel: Not Reported			State Senate District:	Not reported	
Leak Detection: Stock Inventor			The CAL-SITES database may contain additional details for this site.		
Contact Name: RALPH TIERNEY	Telephone: (415) 845-1500		Please contact your EDR Account Executive for more information.		
Total Tanks: 4	Region: STATE				
Facility Type: 2	Other Type: INDUSTRIAL PLANT				
Facility ID: 48029	Container Num: 3	BB214	ELECTRO-COATINGS	FINDS 1000181777	
Tank Num: 3	Year Installed: Not reported	NNW	893 CARLETON STREET	HAZNET CAD000116211	
Tank Capacity: 1000		1/2-1	BERKELEY, CA 94710	Contesse	
Tank Used for: PRODUCT	Tank Construction: Not reported	3023 ft.		RCRIS-LQG	
Type of Fuel: UNLEADED		Lower		CA SLIC	
Leak Detection: Stock Inventor				CA FID UST	
Contact Name: RALPH TIERNEY	Telephone: (415) 845-1500			CERC-NFRAP	
Total Tanks: 4	Region: STATE			HIST UST	
Facility Type: 2	Other Type: INDUSTRIAL PLANT				
Facility ID: 48029	Container Num: 4	BB214	ELECTRO-COATINGS	FINDS 1000181777	
Tank Num: 4	Year Installed: Not reported	NNW	893 CARLETON STREET	HAZNET CAD000116211	
Tank Capacity: 12300		1/2-1	BERKELEY, CA 94710	Contesse	
Tank Used for: PRODUCT	Tank Construction: Not reported	3023 ft.		RCRIS-LQG	
Type of Fuel: DIESEL		Lower		CA SLIC	
Leak Detection: Stock Inventor				CA FID UST	
Contact Name: RALPH TIERNEY	Telephone: (415) 845-1500			CERC-NFRAP	
Total Tanks: 4	Region: STATE			HIST UST	
Facility Type: 2	Other Type: INDUSTRIAL PLANT				
BB213 ELECTRO-COATING INC - PLANT 21	Cal-Sites 8102008198	N/A	CERCUS-NFRAP Classification Data:		
NNW 893 CARLETON STREET			Site Incident Category: Not reported	Federal Facility:	Not a Federal Facility
1/2-1 BERKELEY, CA 94710			Non NPL Code: NFRAP	NPL Status:	Not on the NPL
3023 ft.			Ownership Status: Unknown		
Lower	Site 3 of 4 in cluster BB		CERCLIS-NFRAP Assessment History:		
			Assessment: DISCOVERY	Completed:	11/01/1984
			Assessment: ARCHIVE SITE	Completed:	12/01/1987
			Assessment: PRELIMINARY ASSESSMENT	Completed:	12/01/1987
CAL-SITES:			RCRIS:		
Facility ID: 01340001			Owner: MECHANICS BANK OF RICHMOND		
Status: REFDA - DOES NOT REQUIRE DTSC ACTION OR OVERTSITE ACTIVITY. REFERRED TO OTHER AGENCY LEAD			(415) 232-5253		
Status Date: 10/21/1987			EPA ID: CAD000116211		
Lead: Not reported			Contact: ENVIRONMENTAL MANAGER		
Region: 2 - BERKELEY			(415) 428-1303		
Branch: NC - NORTH COAST			Classification: Large Quantity Generator		
File Name: Not reported			Used Oil Recyc: No		
Status Name: PROPERTY/SITE REFERRED TO ANOTHER AGENCY			TSDF Activities: Not reported		
Lead Agency: N/A	Not reported		BIENNIAL REPORTS:		
NPL: Not reported			Last Biennial Reporting Year: 1989		
SIC: 34 MANU - FABRICATED METAL PRODUCTS			Waste .Quantity (Lbs)	Waste .Quantity (Lbs)	
Facility Type: N/A			D001 500.00	D002 150706.82	
Type Name: Not reported			D004 16305.25	D006 5733.94	
Staff Member Responsible for Site: Not reported			D007 282129.94	D008 16305.25	
Supervisor Responsible for Site: Not reported					
Region Water Control Board: SF - SAN FRANCISCO BAY			Violation Status: Violations exist		
Access: Not reported			Regulation Violated: 262.1D-12.A		
Contesse: Not reported			Area of Violation: GENERATOR-ALL REQUIREMENTS (OVERSIGHT)		
Hazardous Ranking Score: Not reported			Date Violation Determined: 06/21/2001		
Date Site Hazard Ranked: Not reported			Actual Date Achieved Compliance: Not reported		
Groundwater Contamination: Not reported			Regulation Violated: 262.3D-34.C		
No. of Contamination Sources: 0			Area of Violation: GENERATOR-ALL REQUIREMENTS (OVERSIGHT)		
Lat/Long: 0° 0' 0.00" / 0° 0' 0.00"			Date Violation Determined: 06/21/2001		
			Actual Date Achieved Compliance: Not reported		
			Regulation Violated: 262.5D-80		
			Area of Violation: GENERATOR-ALL REQUIREMENTS (OVERSIGHT)		
			Date Violation Determined: 10/30/1990		
			Actual Date Achieved Compliance: 11/19/1990		
			Enforcement Action: WRITTEN INFORMAL		
			Enforcement Action Date: 10/30/1990		

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

ELECTRO-COATINGS (Continued)

Penalty Type: Not reported

There are 3 violation record(s) reported at this site:

Evaluation	Area of Violation	Date of Compliance
Compliance Evaluation Inspection	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	
	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	
Other Evaluation	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19901119

FINDS:

Other Pertinent Environmental Activity Identified at Site:
 Biennial Reporting System (BRS)
 Facility Registry System (FRS)
 Resource Conservation and Recovery Act Information system (RCRAINFO)

HAZNET:

Gepaid: CAD009116211
 Tepaid: CAD009452657
 Gen County: 1
 Tsd County: San Mateo
 Tons: .0625
 Category: Off-specification, aged, or surplus organics
 Disposal Method: Recycler
 Contact: ELECTRO-COATINGS INC
 Telephone: (510) 849-4075
 Mailing Address: 893 CARLETON ST
 BERKELEY, CA 94710 - 2609
 County 1
 Gepaid: CAD009116211
 Tepaid: NVD980895338
 Gen County: 1
 Tsd County: 99
 Tons: 50.0398
 Category: Aqueous solution with metals (restricted levels and Alkaline solution (pH <UN> 12.5) with metals (antimony, arsenic, barium, beryllium, cadmium, chromium, cobalt, copper, lead, mercury, molybdenum, nickel, selenium, silver, thallium, vanadium, and zinc))
 Disposal Method: Treatment, Tank
 Contact: ELECTRO-COATINGS INC
 Telephone: (510) 849-4075
 Mailing Address: 893 CARLETON ST
 BERKELEY, CA 94710 - 2609
 County 1
 Gepaid: CAD009116211
 Tepaid: NVD980895338
 Gen County: 1
 Tsd County: 99
 Tons: 8.0896
 Category: Liquids with nickel > 134 mg/l
 Disposal Method: Treatment, Tank
 Contact: ELECTRO-COATINGS INC
 Telephone: (510) 849-4075
 Mailing Address: 893 CARLETON ST
 BERKELEY, CA 94710 - 2609
 County 1

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

ELECTRO-COATINGS (Continued)

Gepaid: CAD009116211
 Tepaid: NVD980895338
 Gen County: 1
 Tsd County: 99
 Tons: .2500
 Category: Other Inorganic solid waste
 Disposal Method: Disposal, Land Fill
 Contact: ELECTRO-COATINGS INC
 Telephone: (510) 849-4075
 Mailing Address: 893 CARLETON ST
 BERKELEY, CA 94710 - 2609
 County 1

Gepaid: CAD009116211
 Tepaid: NVD980895338
 Gen County: 1
 Tsd County: 99
 Tons: 12.9685
 Category: Liquids with chromium (VI) > 500 mg/l
 Disposal Method: Treatment, Tank
 Contact: ELECTRO-COATINGS INC
 Telephone: (510) 849-4075
 Mailing Address: 893 CARLETON ST
 BERKELEY, CA 94710 - 2609
 County 1

The CA HAZNET database contains 69 additional records for this site.
 Please contact your EDR Account Executive for more information.

CORTESE:
 Reg Id: 01340001
 Region: CORTESE
 Reg By: CALSI

FID:
 Facility ID: 01000002 Regulate ID: 00003412
 Reg By: Active Underground Storage Tank Location
 Corfase Code: Not reported SIC Code: Not reported
 Status: Active Facility Tel: (415) 849-4075
 Mail To: Not reported
 SAME
 BERKELEY, CA 94710

Contact: Not reported Contact Tel: Not reported
 DUNS No: Not reported NPDES No: Not reported
 Creation: 10/22/93 Modified: 00/00/00
 EPA ID: Not reported
 Comments: Not reported

SLIC Region 2:
 Facility ID: 01S0311
 Region: 2
 Facility Status: Inactive
 Start: BG
 Last Site Update: 08/04/19
 NPL Status: Not an NPL site
 Case List: SLIC
 Date Closed: Not reported
 Abate Method: Not reported
 Case Type: NI
 Discovery Date: Not reported
 Imaged: No
 Cost Recovery: No
 Substance: Not reported
 Sample Date: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

ELECTRO-COATINGS (Continued)

1000181777

Contamination: Not reported
Lead: RWQCB
Contamination Level:
Number of Municipal Wells Contaminated by Site: 0
Number of Private Wells Contaminated by Site: 0
Soil Removal Action Taken/Needed: 0
Soil Removal or Contaminant Action Started:
Soil Removal or Contaminant Action Completed: 0
On-Site Groundwater Extraction or Containment is Needed: 0
On-Site Groundwater Extraction or Containment Started:
Off-Site Groundwater Extraction or Containment is Needed:
Off-Site Groundwater Extraction or Containment Started:
Length of Contamination Plume (Feet): 0
Depth of Contamination Plume (Feet): 0
Wells Closed Due To Contamination of Site:
Date of Wells Closure:
Nearest Public or Private Drinking Water Well (Feet): 0
Under Jurisdiction of Lead Agency Date:
Latitude/Longitude: 38 / -122
Flow Rate: 0
Flow Date:
Percent of Contaminants Contained: 0
Contaminant Type:
EPA ID:
Stages of Site Investigation Process Initiated:
 Begun Characterization: Not reported
 Completed Characterization: Not reported
 Begun Remediation: Not reported
 Completed Remediation: Not reported
 Submitted Remediation Plan: Not reported
 Approved Remediation Plan: Not reported
 Begun Final Remedial Action: Not reported
 Completed Final Remedial Action: Not reported
Facility Desc: Not reported
Comment: Not reported

UST HIST:

Facility ID: 3412
Tank Num: 1 Container Num: 1
Tank Capacity: 2088 Year Installed: 1984
Tank Used for: WASTE
Type of Fuel: Not Reported
Leak Detection: Visual
Contact Name: WALTER LUND.
Total Tanks: 9
Facility Type: 2

Facility ID: 3412
Tank Num: 2 Container Num: 2
Tank Capacity: 3055 Year Installed: 1975
Tank Used for: PRODUCT
Type of Fuel: Not Reported
Leak Detection: Visual, Stock Inventor
Contact Name: WALTER LUND.
Total Tanks: 9
Facility Type: 2

Facility ID: 3412

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

Database(s) EDR ID Number
EPA ID Number

MAP FINDINGS

1000181777

ELECTRO-COATINGS (Continued)

Tank Num: 3 Container Num: 3
Tank Capacity: 2060 Year Installed: 1976
Tank Used for: PRODUCT
Type of Fuel: Not Reported
Leak Detection: Visual, Stock Inventor
Contact Name: WALTER LUND.
Total Tanks: 9
Facility Type: 2

Facility ID: 3412 Tank Num: 4 Container Num: 4
Tank Capacity: 3991 Year Installed: 1982
Tank Used for: PRODUCT
Type of Fuel: Not Reported
Leak Detection: Visual, Stock Inventor
Contact Name: WALTER LUND.
Total Tanks: 9
Facility Type: 2

Facility ID: 3412 Tank Num: 5 Container Num: 8
Tank Capacity: 790 Year Installed: 1970
Tank Used for: PRODUCT
Type of Fuel: Not Reported
Leak Detection: Visual, Stock Inventor
Contact Name: WALTER LUND.
Total Tanks: 9
Facility Type: 2

Facility ID: 3412 Tank Num: 6 Container Num: MURIATIC 1
Tank Capacity: 582 Year Installed: 1983
Tank Used for: PRODUCT
Type of Fuel: Not Reported
Leak Detection: Visual, Stock Inventor
Contact Name: WALTER LUND.
Total Tanks: 9
Facility Type: 2

Facility ID: 3412 Tank Num: 7 Container Num: 7
Tank Capacity: 1176 Year Installed: 1971
Tank Used for: PRODUCT
Type of Fuel: Not Reported
Leak Detection: Visual, Stock Inventor
Contact Name: WALTER LUND.
Total Tanks: 9
Facility Type: 2

Facility ID: 3412 Tank Num: 8 Container Num: ELECTR-STR
Tank Capacity: 582 Year Installed: 1970
Tank Used for: PRODUCT
Type of Fuel: Not Reported
Leak Detection: Visual, Stock Inventor
Contact Name: WALTER LUND.
Total Tanks: 9
Region: STATE
Other Type: METAL FINISHING

Map ID Direction Distance Distance (ft.) Elevation	MAP FINDINGS	Map ID Direction Distance Distance (ft.) Elevation	MAP FINDINGS	
	Database(s)	EDR ID Number EPA ID Number	Database(s)	EDR ID Number EPA ID Number
ELECTRO-COATINGS (Continued)				
Facility Type:	2	Other Type:	METAL FINISHING	1000161777
Facility ID:	3412	Container Num:	CAUSTIC t	
Tank Num:	9	Year Installed:	1970	
Tank Capacity:	582	Tank Used for:	PRODUCT	
Type of Fuel:	Not Reported	Tank Construction:	3/16 inches	
Leak Detection:	Visual, Stock Inventor	Telephone:	(415) 549-4075	
Contact Name:	WALTER LUND	Region:	STATE	
Total Tanks:	9	Other Type:	METAL FINISHING	
Facility Type:	2			
215 South 1/2-1 Lower	WESTVACO ENVELOPE DIV 5650 HOLLIB ST EMERYVILLE, CA 94608	HAZNET Cortese	1000422792 N/A	
HAZNET:				
Gepaid:	CAD981658040			
Tepaid:	CAD000633164			
Gen County:	1			
Tsd County:	Imperial			
Tons:	16.8560			
Category:	Adhesives			
Disposal Method:	Disposal, Land Fill			
Contact:	WESTVACO CORP			
Telephone:	(212) 688-5000			
Mailing Address:	PO BOX 3300 SPRINGFIELD, MA 01102 - 3300			
County	1			
Gepaid:	CAD981658040			
Tepaid:	CAT080031628			
Gen County:	1			
Tsd County:	Kern			
Tons:	.2293			
Category:	Waste oil and mixed oil			
Disposal Method:	Not reported			
Contact:	WESTVACO CORP			
Telephone:	(212) 688-5000			
Mailing Address:	PO BOX 3300 SPRINGFIELD, MA 01102 - 3300			
County	1			
CORTESE:				
Reg Id:	2848			
Region:	CORTESE			
Reg By:	Leaking Underground Storage Tanks			
216 SSW 1/2-1 Lower	EBMD-EAST BAY MUNICIPAL DISTRICT 5770 SHELLMOUND DR EMERYVILLE, CA 94608	HAZNET Cortese	5103962228 N/A	
EBMD-EAST BAY MUNICIPAL DISTRICT (Continued)				
HAZNET:				
Gepaid:	CAC001167616			
Tepaid:	CAT000646117			
Gen County:	1			
Tsd County:	Kings			
Tons:	12.6420			
Category:	Other organic solids			
Disposal Method:	Treatment, Tank			
Contact:	EMUD			
Telephone:	(510) 287-1512			
Mailing Address:	375 11TH STREET OAKLAND, CA 94607			
County	1			
CORTESE:				
Reg Id:	1308			
Region:	CORTESE			
Reg By:	Leaking Underground Storage Tanks			
BC217 South 1/2-1 Lower	WESTINGHOUSE ELECTRIC CO - EMERYVILLE 5899 PELADEAU STREET EMERYVILLE, CA 94608	BC217 South 1/2-1 Lower	WESTINGHOUSE ELECTRIC CO - EMERYVILLE 5899 PELADEAU STREET EMERYVILLE, CA 94608	Cal-Sites N/A
Site 1 of 3 in cluster BC				
CAL-SITES:				
Facility ID:	01360057			
Status:	REFRW - DOES NOT REQUIRE DTSC ACTION. REFERRED TO REGIONAL WATER QUALITY CONTROL BOARD (RWQCB) LEAD			
Status Date:	11/14/1994			
Lead:	RWCBC			
Region:	2 - BERKELEY			
Branch:	NC - NORTH COAST			
Fts Name:	Not reported			
Status Name:	PROPERTY/SITE REFERRED TO RWQCB			
Lead Agency:	REGIONAL WATER QUALITY CONTROL BOARD			Not reported
NPL:	Not Listed			
SIC:	38 MANU - ELECTRONIC & OTHER ELECTRIC EQUIP			
Facility Type:	N/A			
Type Name:	Not reported			
Staff Member Responsible for Site:	Not reported			
Supervisor Responsible for Site:	Not reported			
Region Water Control Board:	SF - SAN FRANCISCO BAY			
Access:	Controlled			
Cortese:	C			
Hazardous Ranking Score:	Not reported			
Date Site Hazard Ranked:	Not reported			
Groundwater Contamination:	Unknown			
No. of Contamination Sources:	0			
Lat/Long:	0° 0' 0.00" / 0° 0' 0.00"			
Lat/long Method:	Not reported			
State Assembly District Code:	Not reported			
State Senate District:	Not reported			

The CAL-SITES database may contain additional details for this site.
Please contact your EDR Account Executive for more information.

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance		EPA ID Number	Distance (ft.)		EPA ID Number
Elevation	Site		Elevation	Site	
MACAULAY FOUNDRY (Continued)				1002851261	
Lead Agency:	Local Agency		Entered Date:	04/17/1990	
Local Agency:	01020		Facility Status:	Signed off, remedial action completed or deemed unnecessary	
Case Type:	Soil only		Maximum Soil Concentration:	75	
Status:	Signed off, remedial action completed or deemed unnecessary		Maximum Groundwater Impact:	0	
County:	Alameda		County:	Alameda	
Abate Method:	No Action Taken - no action has as yet been taken at the site		Current Benzene:	Not reported	
Review Date:	4/17/1990	Confirm Leak:	4/17/1990	MTBE Detected in GW:	No
Workplan:	Not reported	Prelim Assess:	Not reported	MTBE Detected in Soil:	Not reported
Pollution Char:	Not reported	Remed Plan:	Not reported	MTBE:	0
Remed Action:	Not reported	Monitoring:	Not reported	MTBE Quality:	Not reported
Close Date:	8/24/1994				
Release Date:	2/10/1987		CORTESE:		
Cleanup Fund Id:	Not reported		Reg Id:	01-0932	
Discover Date:	2/10/1987		Region:	CORTESE	
Enforcement Dt:	Not reported		Reg By:	Leaking Underground Storage Tanks	
Env Type:	Not reported				
Enter Date:	4/17/1990				
Funding:	Federal Funds				
Staff Initials:	UNK				
How Discovered:	Tank Closure				
How Stopped:	Close Tank				
Interim:	No				
Leak Cause:	Structure Failure				
Leak Source:	Tank				
MTBE Date:	Not reported				
Max MTBE GW:	Not reported				
MTBE Tested:	Not Required to be Tested.				
Priority:	Not reported				
Local Case #:	01-0932				
Beneficial:	Not reported				
Staff:	CTH				
GW Qualifies:	Not reported				
Max MTBE Soil:	Not reported				
Soil Qualifies:	Not reported				
Hydr Basin #:	Not reported				
Operator:	Not reported				
Oversight Prgm:	Local Implementing Agency UST (includes non-LOP cases within LOP jurisdiction)				
Oversight Prgm:	LIA				
Review Date:	8/23/1994				
Stop Date:	2/10/1987				
Work Suspended:	N				
Responsible Party:	BLANK RP				
RP Address:	Not reported				
Global Id:	T0800100857				
Org Name:	Not reported				
Contact Person:	Not reported				
MTBE Conc:	0				
Miba Fuel:	0				
Water System Name:	Not reported				
Well Name:	Not reported				
Distance To Lust:	6952.2200602774219347086717287				
Waste Discharge Global ID:	Not reported				
Waste Disch Assigned Name:	Not reported				
LUST Region 2:					
Region:	2				
Facility Id:	01-0932				
MACAULAY FOUNDRY (Continued)				1002851261	
Entered Date:	04/17/1990				
Facility Status:	Signed off, remedial action completed or deemed unnecessary				
Maximum Soil Concentration:	75				
Maximum Groundwater Impact:	0				
County:	Alameda				
Current Benzene:	Not reported				
MTBE Detected in GW:	No				
MTBE Detected in Soil:	Not reported				
MTBE:	0				
MTBE Quality:	Not reported				
CORTESE:					
Reg Id:	01-0932				
Region:	CORTESE				
Reg By:	Leaking Underground Storage Tanks				
CONSOLIDATED PRINTERS INC				RCRIS-SQG	
222	NNW	2630 8TH ST		FINDS	1000685850
12-1		BERKELEY, CA 94710		HAZNET	CAD983825138
3338 ft.				Cortese	
Higher					
RCRIS:					
Owner:	CONSOLIDATED PRINTERS				
(510) 843-8524					
EPA ID:	CAD983825138				
Contact:	MOYES BALDIZAN				
(510) 843-8524					
Classification:	Small Quantity Generator				
Used Oil Recyc:	No				
TSDF Activities:	Not reported				
Violation Status:	No violations found				
FINDS:					
Other Pertinent Environmental Activity Identified at Site:					
AIRS Facility System (AIRS/AFS)					
Facility Registry System (FRS)					
National Emissions Trends (NET)					
National Toxics Inventory (NTI)					
Resource Conservation and Recovery Act Information system (RCRAINFO)					
HAZNET:					
Gepid:	CAD983825138				
Tepid:	CAD981161367				
Gen County:	1				
Ted County:	Marin				
Tons:	1.4386				
Category:	Photochemicals/photoprocessing waste				
Disposal Method:	Recycler				
Contact:	LARRY HAWKINS				
Telephone:	(510) 843-8524				
Mailing Address:	2630 8TH ST BERKELEY, CA 94710 - 2514				
County	1				

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS				Map ID	MAP FINDINGS								
Direction	Database(s)	EDR ID Number	EPA ID Number	Distance (ft.)	Database(s)	EDR ID Number	EPA ID Number	Elevation	Site	Direction	Database(s)	EDR ID Number	EPA ID Number	Elevation	Site	Direction	Database(s)	EDR ID Number	EPA ID Number
Site										Site						Site			
CONSOLIDATED PRINTERS INC (Continued)		1000685850			223	1X IVAN WILLIAMS				HAZNET						CHMIRS			
Gepaid:	CAL000019549			SW	6262 CHRISTIE					Gepaid:	CAC000242881					CHMIRS			
Tepaid:	CAD881161367			12-1	EMMERYVILLE, CA 94608					Tepaid:	CAL000190080					Cortese	S104564854		
Gen County:	1			3459 ft.						Gen County:	1					Region:	N/A		
Tad County:	Marin			Lower						Tad County:	San Joquin								
Tons:	1.4386									Tons:	67.424								
Category:	Photochemicals/photoprocessing waste									Category:	Asbestos-containing waste								
Disposal Method:	Recycler									Disposal Method:	Not reported								
Contact:	Not reported									Contact:	IVAN WILLIAMS								
Telephone:	(000) 000-0000									Telephone:	(000) 000-0000								
Mailing Address:	2630 8TH ST BERKELEY, CA 94710									Mailing Address:	SAN ALSELMO, CA 94660								
County	1									County	1								
Gepaid:	CAD983825138									CORTES:									
Tepaid:	CAD044003556									Reg Id:	01-0817								
Gen County:	1									Region:	CORTESE								
Tad County:	Yolo									Reg By:	Leaking Underground Storage Tanks								
Tons:	1.1487																		
Category:	Waste oil and mixed oil																		
Disposal Method:	Transfer Station																		
Contact:	LARRY HAWKINS																		
Telephone:	(510) 843-8524																		
Mailing Address:	2630 8TH ST BERKELEY, CA 94710 - 2514																		
County	1																		
Gepaid:	CAD983625138																		
Tepaid:	CAD059494310																		
Gen County:	1																		
Tad County:	Santa Clara																		
Tons:	3.0231																		
Category:	Waste oil and mixed oil																		
Disposal Method:	Transfer Station																		
Contact:	LARRY HAWKINS																		
Telephone:	(510) 843-8524																		
Mailing Address:	2630 8TH ST BERKELEY, CA 94710 - 2514																		
County	1																		
Gepaid:	CAD983625138																		
Tepaid:	CAD981429673																		
Gen County:	1																		
Tad County:	Marin																		
Tons:	2.2392																		
Category:	Photochemicals/photoprocessing waste																		
Disposal Method:	Recycler																		
Contact:	LARRY HAWKINS																		
Telephone:	(510) 843-8524																		
Mailing Address:	2630 8TH ST BERKELEY, CA 94710 - 2514																		
County	1																		
The CA HAZNET database contains 8 additional records for this site. Please contact your EDR Account Executive for more information.																			
CORTESE: Reg Id: 2970 Region: CORTESE Reg By: Leaking Underground Storage Tanks																			
HAZNET: Gepaid: CAC000242881 Tepaid: CAL000190080 Gen County: 1 Tad County: San Joquin Tons: 67.424 Category: Asbestos-containing waste Disposal Method: Not reported Contact: IVAN WILLIAMS Telephone: (000) 000-0000 Mailing Address: SAN ALSELMO, CA 94660 County: 1																			
CORTES:																			
Reg Id: 01-0817 Region: CORTESE Reg By: Leaking Underground Storage Tanks																			
CHMIRS: OES Control Number: Not reported DOT Hazard Class: Not Reported Chemical Name: Not reported Extent of Release: Not reported CAS Number: Not reported Environmental Contamination: None Reported Incident Date: Not reported Time Completed: 1730 Physical State Stored: Not reported Physical State Released: Not reported Release Unit: Not reported Container Description: Not reported Container Type: Not reported Container Material: Not reported Level Of Container: Not reported Container Capacity: Not reported Container Capacity Units (code): Not reported Extent Of Release (code): Not reported Agency Id Number: 1015 Agency Incident Number: 91538 OES Incident Number: Not reported Time Notified: 1507 Surrounding Area: 961 Estimated Temperature: 45 Property Management: C More Than Two Substances Involved?: Not reported Special Studies 1: Not reported Special Studies 2: Not reported Special Studies 3: Not reported Special Studies 4: Not reported																			

Mep ID	Direction	Distance	Distance (ft.)	Elevation	Site	MAP FINDINGS
100-0000000000000000	NE	100	330	1000	Site A	Map Findings

(Continued)

Special Studies 5 :	Not reported
Special Studies 8 :	Not reported
Responding Agency Personnel # Of Injuries :	0
Responding Agency Personnel # Of Fatalities :	0
Resp Agency Personnel # Of Decontaminated :	0
Others Number Of Decontaminated :	0
Others Number Of Injuries :	0
Others Number Of Fatalities :	0
Vehicle Make/year :	PEERLESS TANK TRAILER/1982
Vehicle License Number :	1UB9293
Vehicle State :	CA
Vehicle Id Number :	IPLJ02321CTA57520
CADOT/PUC/ICC Number :	CALT 28496
Company Name :	SABEC INC
Reporting Officer Name/ID :	R. STEELE C-14
Report Date :	03-MAR-89
Comments :	Not reported
Facility Telephone Number :	415 644-6510

225 **FACILITY 6015-1**
BSE **1212 POWELL**
1/2-1 **OAKLAND, CA 94608**
3503 ft.
Higher

CORTESE:
Reg Id: 2599
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

**MILES INC CUTTER BIOLOGICAL FACILITY #36
4TH / PARKER STREETS
BERKELEY, CA 94710**

CAL-SITES:

Facility ID	01280085
Status:	REFOA - DOES NOT REQUIRE DTSC ACTION OR OTHER AGENCY LEAD
Status Date:	03/13/1995
Lead:	Not reported
Region:	2 - BERKELEY
Branch:	NC - NORTH COAST
File Name:	Not reported
Status Name:	PROPERTY/SITE REFERRED TO ANOTHER AGENCY
Lead Agency:	N/A
NPL:	Not reported
SIC:	26 MANU - CHEMICALS & ALLIED PRODUCTS
Facility Type:	NUA
Type Name:	Not reported
Staff Member Responsible for Sits:	Not reported
Supervisor Responsible for Site:	Not reported
Region Water Control Board:	SF - SAN FRANCISCO BAY
Access:	Not reported
Cortese:	Not reported
Hazardous Ranking Score:	Not reported
Data Site Hazard Rank:	Not reported

Database(s) EDR ID Number
EPA ID Number

3100274919

Map ID	Direction	Distance	Distance (ft.)	Elevation	Site	MAP FINDINGS	EDR ID Number EPA ID Number
						Database(s)	

MILES INC CUTTER BIOLOGICAL FACILITY #29 (Continued)

The CAL-SITES database may contain additional details for this site.
Please contact us for more information.

SUPER-7 #25670
5714 SAN PABLO AV.
OAKLAND, CA 94508

CORTESE:
Reg Id: 01-0391
Region: CORTESE
Rep By: Leaking Underground Storage Tank

CHEVRON ASPHALT PLANT & TERMINAL
1520 POWELL STREET
SACRAMENTO, CALIFORNIA

CAL-SITES:

Facility ID:	01290002
Status:	RFQ - DOES NOT REQUIRE DTSC ACTION OR OVERTSIE ACTIVITY OTHER AGENCY LEAD
Status Date:	03/06/1996
Lead:	Not reported
Region:	2 - BERKELEY
Branch:	NC - NORTH COAST
File Name:	Not reported
Status Name:	PROPERTY/SITE REFERRED TO ANOTHER AGENCY
Lead Agency:	N/A
NPL:	Not reported
SIC:	28 MANU - PETROLEUM & COAL PRODUCTS
Facility Type:	N/A
Type Name:	Not reported
Staff Member Responsible for Site:	Not reported
Supervisor Responsible for Site:	Not reported
Region Water Control Board:	SF - SAN FRANCISCO BAY
Access:	Controlled
Contess:	C
Hazardous Ranking Score:	Not reported
Date Site Hazard Ranked:	Not reported
Groundwater Contamination:	Confirmed
No. of Contamination Sources:	3
Lat/Long:	0° 0' 0.00" / 0° 0' 0.00"
Lat/long Method:	Not reported
State Assembly District Code:	Not reported
State Senate District:	Not reported

Map ID	Direction	MAP FINDINGS		Map ID	Direction	MAP FINDINGS	
Distance	Distance (ft.)	Database(s)	EDR ID Number	Distance	Distance (ft.)	Database(s)	EDR ID Number
Elevation	Site		EPA ID Number	Elevation	Site		EPA ID Number
CHEVRON ASPHALT PLANT & TERMINAL (Continued)		5102008174		GARY STEEL COMPANY (Continued)		8101580558	
The CAL-SITES database may contain additional details for this site. Please contact your EDR Account Executive for more information.							
229 SSW 1/2-1 3718 ft. Lower	EMERYVILLE MARKETPLACE BTW 54TH / POWELL ST ON N & S, BY HWY 80 EMERYVILLE, CA 94608	Cal-Sites Cortese DEED	5102008174 N/A				
CA DEEDS: Facility Id: 129002† Number of Deeds: 1							
CAL-SITES: Facility ID: 01290021 Status: NFA - NO FURTHER ACTION FOR DTSC Status Date: 11/07/1995 Lead: DTSC Region: 2 - BERKELEY Branch: NC - NORTH COAST File Name: Not reported Status Name: NO FURTHER ACTION FOR DTSC Lead Agency: DEPT OF TOXIC SUBSTANCES CONTROL NPL: Not Listed SIC: 29 MANU - PETROLEUM & COAL PRODUCTS Facility Type: RESPONSIBLE PARTY Type Name: RP Staff Member Responsible for Site: RGHOSH Supervisor Responsible for Site: DTSUJI Region Water Control Board: SF - SAN FRANCISCO BAY Access: Cortese: Hazardous Ranking Score: Date Site Hazard Ranked: Groundwater Contamination: No. of Contamination Sources: 0 Lat/Long: 37° 50' 28.00" / 122° 17' 33.00" Lat/long Method: TEALE State Assembly District Code: 14 State Senate District: 09		Not reported					
The CAL-SITES database may contain additional details for this site. Please contact your EDR Account Executive for more information.							
CORTESE: Reg Id: 01290021 Region: CORTESE Reg By: CALSI							
230 NNW 1/2-1 3784 ft. Lower	GARY STEEL COMPANY 2560 7TH BT BERKELEY, CA 94710	LUST Cortese CA RID UST	5101580558 N/A				
State LUST: Cross Street: Not reported Qty Leaked: Not reported Case Number: 01-0683				LUST Region 2: Region: 2			

Map ID Direction Distance Distance (ft.) Elevation	MAP FINDINGS		Map ID Direction Distance Distance (ft.) Elevation	MAP FINDINGS	
Site	Database(s)	EDR ID Number EPA ID Number	Site	Database(s)	EDR ID Number EPA ID Number
GARY STEEL COMPANY (Continued)		S10158058	232 SW 1/2-1 3874 ft. Lower	BAY STREET EXTENSION 64TH / POWELL STREETS EMERYVILLE, CA 94608	Cal-Sites DEED N/A
Facility Id: 01-0683 Entered Date: 09/03/1990 Facility Status: Signed off, remedial action completed or deemed unnecessary Maximum Soil Concentration: 2200 Maximum Groundwater Impact: 0 County: Alameda Current Benzene: Not reported MTBE Detected In GW: No MTBE Detected In Soil: Not reported MTBE: 0 MTBE Quality: Not reported			CA DEEDS: Facility Id: 1330046 Number of Deeds: 1		
CORTESE: Reg Id: 01-0683 Region: CORTESE Reg By: Leaking Underground Storage Tanks			CAL-SITES: Facility ID: 01330046 Status: COM - CERTIFIED OPERATION AND MAINTENANCE, ALL PLANNED ACTIVITIES IMPLEMENTED/REMEDIATION CONTINUES Status Date: 07/09/1997 Lead: DTSC Region: 2 - BERKELEY Branch: NC - NORTH COAST File Name: BAY STREET EXTENSION Status Name: CERTIFIED / OPERATION & MAINTENANCE Lead Agency: DEPT OF TOXIC SUBSTANCES CONTROL NPL: Not Listed SIC: 33 MANU - PRIMARY METAL INDUSTRIES Facility Type: VOLUNTARY CLEANUP PROGRAM Type Name: VCP Staff Member Responsible for Site: AANTONIO Supervisor Responsible for Site: DTSUJI Region Water Control Board: SF - SAN FRANCISCO BAY Access: Not reported Corse: Not reported Hazardous Ranking Score: Not reported Data Site Hazard Ranked: Not reported Groundwater Contamination: Not reported No. of Contamination Sources: 0 Lat/Long: 37° 50' 40.00" / 122° 17' 33.00" Lat/Long Method: TEALE State Assembly District Code: 14 State Senate District: 09		Not reported
FID: Facility ID: 01003169 Regulate ID: Not reported Reg By: Active Underground Storage Tank Location Corse Code: Not reported SIC Code: Not reported Status: Active Facility Tel: (415) 644-0900 Mail To: 2201 BROADWAY BERKELEY, CA 94710 Contact: Not reported Contact Tel: Not reported DUNS No: Not reported NPDES No: Not reported Creation: 10/22/93 Modified: 00/00/00 EPA ID: Not reported Comments: Not reported					
231 NNW 1/2-1 3831 ft. Higher	WEST COAST PROPERTY MGMT/ 2547 8TH ST BERKELEY, CA 94710	Cortese S101580201 CA FID UST N/A	233 SW 1/2-1 3889 ft. Lower	EBMUD 4300 EASTSHORE HIGHWAY EMERYVILLE, CA 94608	Cal-SRes CA SLIC 1000725681 N/A
CORTESE: Reg Id: 01-1659 Region: CORTESE Reg By: Leaking Underground Storage Tanks			The CAL-SITES database may contain additional details for this site. Please contact your EDR Account Executive for more information.		
FID: Facility ID: 01001773 Regulate ID: Not reported Reg By: Inactive Underground Storage Tank Location Corse Code: Not reported SIC Code: Not reported Status: Inactive Facility Tel: (415) 885-8970 Mail To: 710 VAN NESS AVE BERKELEY, CA 94710 Contact: Not reported Contact Tel: Not reported DUNS No: Not reported NPDES No: Not reported Creation: 10/22/93 Modified: 00/00/00 EPA ID: Not reported Comments: Not reported			CAL-SITES: Facility ID: 01330043 Status: CERT - CERTIFIED AS HAVING BEEN REMEDIED SATISFACTORILY UNDER DTSC Status Date: 06/20/1996 Lead: DTSC Region: 2 - BERKELEY Branch: NC - NORTH COAST File Name: CYPRESS RECONSTRUCTION Status Name: CERTIFIED Lead Agency: DEPT OF TOXIC SUBSTANCES CONTROL NPL: Not Listed SIC: 33 MANU - PRIMARY METAL INDUSTRIES		Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

EBMUD (Continued)

Facility Type: VOLUNTARY CLEANUP PROGRAM
Type Name: VCP
Staff Member Responsible for Site: AANTONIO
Supervisor Responsible for Site: SCIMPERM
Region Water Control Board: SF - SAN FRANCISCO BAY
Access: Not reported
Cortese: Not reported
Hazardous Ranking Score: Not reported
Date Site Hazard Ranked: Not reported
Groundwater Contamination: Unknown
No. of Contamination Sources: 0
Lat/Long: 37° 50' 00" / 122° 17' 30.00"
LaMong Method: TEALE
State Assembly District Code: 14
State Senate District: 9

The CAL-SITES database may contain additional details for this site.
Please contact your EDR Account Executive for more information.

SLIC Region 2:

Facility ID:	01S0207	
Region:	2	
Facility Status:	Inactive	Not reported
Staff:	BG	Not reported
Last Site Update:	04/06/19	
NPL Status:	Not an NPL site	Discovery Date: Not reported
Case List:	SLC	Imaged: No
Date Closed:	Not reported	Cost Recovery: No
Abate Method:	Not reported	Substance: Not reported
Case Type:	NT	Sample Date: Not reported
Contamination:	Not reported	
Lead:	RWQCB	
Contamination Level:		
Number of Municipal Wells Contaminated by Site:	0	
Number of Private Wells Contaminated by Site:	0	
Soil Removal Action Taken/Needed:	0	
Soil Removal or Contaminant Action Started:		
Soil Removal or Contaminant Action Completed:	0	
On-Site Groundwater Extraction or Containment is Needed:	0	
On-Site Groundwater Extraction or Containment Started:		
Off-Site Groundwater Extraction or Containment is Needed:		
Off-Site Groundwater Extraction or Containment Started:		
Length of Contamination Plume (Feet):	0	
Depth of Contamination Plume (Feet):	0	
Wells Closed Due To Contamination of Site:		
Data of Wells Closure:		
Nearest Public or Private Drinking Water Well (Feet):	0	
Under Jurisdiction of Lead Agency Date:		
Latitude/Longitude:	38 / -122	
Flow Rate:	0	
Flow Dots:		
Percent of Contaminants Contained:	0	
Contaminant Type:		
EPA ID:		
Stages of Site Investigation Process Initiated:		
Begin Characterization:		Not reported
Completed Characterization:		Not reported
Begin Remediation:		Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation **Site**

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

EBMUD (Continued)

Completed Remediation:	Not reported
Submitted Remediation Plan:	Not reported
Approved Remediation Plan:	Not reported
Began Final Remedial Action:	Not reported
Completed Final Remedial Action:	Not reported
Facility Desc:	Not reported
Comment:	Not reported
Facility ID:	01S0319
Region:	2
Facility Status:	Referred to another RWCQB division or agency
Staff:	BG
Last Site Update:	06/09/19
NPL Status:	Not an NPL site
Case List:	SLIC
Date Closed:	Not reported
Abate Method:	Not reported
Case Type:	NT
Contamination:	Not reported
Lead:	RWQCB
Contamination Level:	
Number of Municipal Wells Contaminated by Site:	0
Number of Private Wells Contaminated by Site:	0
Soil Removal Action Taken/Needed:	0
Soil Removal or Contaminant Action Started:	
Soil Removal or Contaminant Action Completed:	0
On-Site Groundwater Extraction or Containment Is Needed:	0
On-Site Groundwater Extraction or Containment Started:	
Off-Site Groundwater Extraction or Containment Is Needed:	
Off-Site Groundwater Extraction or Containment Started:	
Length of Contamination Plume (Feet):	0
Depth of Contamination Plume (Feet):	0
Wells Closed Due To Contamination of Site:	
Date of Wells Closure:	
Nearest Public or Private Drinking Water Well (Feet):	0
Under Jurisdiction of Lead Agency Date:	
Latitude/Longitude:	38 / -122
Flow Rate:	0
Flow Date:	
Percent of Contaminants Contained:	0
Contaminant Type:	
EPA ID:	
Stages of Site Investigation Process Initiated:	
Began Characterization :	Not reported
Completed Characterization :	Not reported
Began Remediation:	Not reported
Completed Remediation:	Not reported
Submitted Remediation Plan:	Not reported
Approved Remediation Plan:	Not reported
Began Final Remedial Action:	Not reported
Completed Final Remedial Action:	Not reported
Facility Desc:	Not reported
Comment:	G

887 GRACE AVENUE
OAKLAND, CA 94601

CHMIRS 8100260090
N/A

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS				
Direction	Database(s)	EDR ID Number	EPA ID Number	Site	Direction	Database(s)	EDR ID Number	EPA ID Number	Site	
Distance (ft.)	(Continued)					S100280098				
Elevation						CM SERVICE STATION (Continued)				
Site					S101293393					
CHMIRS:	OES Control Number:	9100012	DOT ID:	Not reported	BD236	Meadows PROPERTY	LUST	S102433240		
DOT Hazard Class:	Not Reported				ENE	1440 ASHBY AVE	Cortese	N/A		
Chemical Name:	N/A				1/2-1	BERKELEY, CA 94703				
Extent of Release:	Not reported				3964 ft.					
CAS Number:	Not reported	Quantity Released:	0		Higher					
Environmental Contamination:	None Reported	Property Use:	Vacant Lot							
Incident Date:	21-JAN-91	Date Completed:	21-JAN-91							
Time Completed:	1035									
Physical State Stored:	Not reported									
Physical State Released:	Not reported									
Release Unit:	Not reported									
Container Description:	Not reported									
Container Type:	Not reported									
Container Material:	Not reported									
Level Of Container:	Not reported									
Container Capacity:	0									
Container Capacity Units (code):	Not reported									
Extent Of Release (code):	Not reported									
Agency Id Number:	1075									
Agency Incident Number:	9102078									
OES Incident Number:	9100012									
Time Notified:	1023									
Surrounding Area:	400									
Estimated Temperature:	75									
Property Management:	P									
More Than Two Substances Involved?:	Not reported									
Special Studies 1:	Not reported									
Special Studies 2:	Not reported									
Special Studies 3:	Not reported									
Special Studies 4:	Not reported									
Special Studies 5:	Not reported									
Special Studies 6:	Not reported									
Responding Agency Personnel # Of Injuries:	0									
Responding Agency Personnel # Of Fatalities:	0									
Resp Agency Personal # Of Decontaminated:	0									
Others Number Of Decontaminated:	0									
Others Number Of Injuries:	0									
Others Number Of Fatalities:	0									
Vehicle Make/year:	Not reported									
Vehicle License Number:	Not reported									
Vehicle State:	Not reported									
Vehicle Id Number:	Not reported									
CA/DOT/PUC/ICC Number:	Not reported									
Company Name:	Not reported									
Reporting Officer Name/ID:	CAPTAIN WAYNE GASKIN									
Report Date:	22-JAN-91									
Comments:	Yes									
Facility Telephone Number:	415 273-3856									
BD235	CM SERVICE STATION				Cortese	S101293393				
ENE	1441 ASHBY AVE					N/A				
1/2-1	BERKELEY, CA 94703									
3964 ft.										
Higher	Site 1 of 2 in cluster BD									
CORTSE:	Reg Id:	01-0250								

Map ID	MAP FINDINGS
Direction	
Distance	
Distance (ft.)	
Elevation	Site
<hr/>	
MEADOWS PROPERTY (Continued)	
Org Name:	Not reported
Contact Person:	Not reported
MTBE Conc:	0
Mtbe Fuel:	1
Water System Name:	Not reported
Well Name:	Not reported
Distance To Lust:	3757.9852468409223689381070557
Waste Discharge Global ID:	Not reported
Waste Disch Assigned Name:	Not reported
LUST Region 2:	
Region:	2
Facility Id:	01-2366
Entered Date:	03/06/1987
Facility Status:	Signed off, remedial action completed or deemed un
Maximum Soil Concentration:	0
Maximum Groundwater Impact:	0
County :	Alameda
Current Benzene:	Not reported
MTBE Detected in GW:	No
MTBE Detected in Soil:	Not reported
MTBE:	0
MTBE Quality:	Not reported
CORTESE:	
Reg Id:	01-2366
Region:	CORTESE
Reg By:	Leaking Underground Storage Tanks

Database(s)	EDR ID Number EPA ID Number	Map ID Direction Distance Distance (ft.) Elevation	MAP FINDINGS		Database(s)	EDR ID Number EPA ID Number
			Site			
S102433240		238 SSW 1/2-1 4002 ft. Lower	BP OIL CO FAC SITE NO 11126 1700 POWELL ST EMERYVILLE, CA 94608		LUST CORTESE CA FID UST	S101579973 N/A
necessary			LUST Alameda County: Region : ALAMEDA Facility ID : RO0000088		CORTESE: Reg Id: 01-0222 Region: CORTESE Reg By: Leaking Underground Storage Tanks	
			FID: Facility ID: 01000356 Reg By: Active Underground Storage Tank Location Corlese Code: Not reported Status: Active Mail To: Not reported 2688 PROSPECT DR EMERYVILLE, CA 94608 Contact: Not reported DUNS No: Not reported Creation: 10/22/93 EPA ID: Not reported Comments: Not reported		Regulate ID: 00039595 SIC Code: Not reported Facility Tel: (415) 655-0909 Contact Tel: Not reported NPDES No: Not reported Modified: 00/00/00	

237	A & J TRUCKING CO., INC.		
BSW	5600 SHELLMOUND ST		
12/1	EMERYVILLE, CA 94608		
3991 ft.			
Lower			
LUST Alameda County:			
Region :	ALAMEDA		
Facility ID :	RO0000236		
CORTESE:			
Reg Id:	04-0012		
Region:	CORTESE		
Reg By:	Leaking Underground Storage Tanks		
FDI:			
Facility ID:	01000131	Regulate ID:	0001264
Reg By:	Inactive Underground Storage Tank Location		
Cortese Code:	Not reported	SIC Code:	Not repor
Status:	Inactive	Facility Tel:	Not repo
Mat To:	Not reported		
	P O BOX		
	EMERYVILLE, CA 94608		
Contact:	Not reported	Contact Tel:	Not repo
DUNs No:	Not reported	NPDES No:	Not repo
Creation:	10/22/93	Modified:	00/00/000
EPA ID:	Not reported		
Comments:	Not reported		

LUST	5101579931	South	5733 PELLEDEAU	Service	N/A
Cortese	N/A	1/2-1	EMERYVILLE, CA		
CA FID UST		4013 ft.			
		Lower			
			CORTESE:		
			Reg Id: 01-1307		
			Region: CORTESE		
			Reg By: Leaking Underground Storage Tanks		
		240	WEATHERFORD BMW, INC.		
		SSW	9903 CHRISTIE AVE E BAY	Notify ES	1000409178
		1/2-1	EMERYVILLE, CA 94608	HAZNET	N/A
		4027 ft.		Cortese	
		Lower		CA FID UST	
				HIST UST	
			HAZNET:		
			Geopid: CALD000078141		
			Tepaid: CAD070146432		
			Gen County: 1		
			Tad County: 1		
			Tons: .0447		
			Category: Metal sludge - Alkaline solution (pH <UN>- 12.5) with metals (antimony, arsenic, barium, beryllium, cadmium, chromium, cobalt, copper, lead, mercury, molybdenum, nickel, selenium, silver, thallium, vanadium, and zinc)		
			Disposal Method: Treatment, Incineration		
			Contact: ZIFF-DAVIS		
			Telephone: (000) 000-0000		
			Mailing Address: 5903 CHRISTIE AVE		
			EMERYVILLE, CA 94608-1825		

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

WEATHERFORD BMW, INC. (Continued)

1000409178

County 1
Gepaid: CAL000078141
Tepaid: CAD070148432
Gen County: 1
Tad County: 1
Tons: .0634
Category: Photochemicals/photoprocessing waste
Disposal Method: Treatment, Incineration
Contact: ZIFF-DAVIS
Telephone: (000) 000-0000
Mailing Address: 5903 CHRISTIE AVE
EMERYVILLE, CA 94608 - 1925
County 1
Gepaid: CAL000078141
Tepaid: CAD070148432
Gen County: 1
Tad County: 1
Tons: .0005
Category: Metal sludge - Alkaline solution (pH <UN-> 12.5) with metals (antimony, arsenic, barium, beryllium, cadmium, chromium, cobalt, copper, lead, mercury, molybdenum, nickel, selenium, silver, thallium, vanadium, and zinc)
Disposal Method: Treatment, Incineration
Contact: ZIFF-DAVIS
Telephone: (000) 000-0000
Mailing Address: 5903 CHRISTIE AVE
EMERYVILLE, CA 94608 - 1925
County 1
Gepaid: CAL000078141
Tepaid: CAT000613976
Gen County: 1
Tad County: Orange
Tons: .1251
Category: Photochemicals/photoprocessing waste
Disposal Method: Transfer Station
Contact: ZIFF-DAVIS
Telephone: (000) 000-0000
Mailing Address: 5903 CHRISTIE AVE
EMERYVILLE, CA 94608 - 1925
County 1
Gepaid: CAL000078141
Tepaid: CAD003983592
Gen County: 1
Tad County: Santa Clara
Tons: .0208
Category: Photochemicals/photoprocessing waste
Disposal Method: Recycler
Contact: ZIFF-DAVIS
Telephone: (000) 000-0000
Mailing Address: 5903 CHRISTIE AVE
EMERYVILLE, CA 94608 - 1925
County 1

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

WEATHERFORD BMW, INC. (Continued)

1000409178

The CA HAZNET database contains 3 additional records for this site.
Please contact your EDR Account Executive for more information.

NOTIFY 65:
Date Reported: Not reported Staff Initials: Not reported
Board File Number: Not reported
Facility Type: Not reported
Discharge Date: Not reported
Incident Description: 92633
CORTESE:
Reg Id: D1-1851
Region: CORTESE
Reg By: Leaking Underground Storage Tanks
FID:
Facility ID: 01002264 Regulate ID: 00006513
Reg By: Inactive Underground Storage Tank Location
Corse Code: Not reported SIC Code: Not reported
Status: Inactive Facility Tel: Not reported
Mail To: Not reported
5903 CHRISTIE AVE E BAY P
EMERYVILLE, CA 94608
Contact: Not reported Contact Tel: Not reported
DUNS No: Not reported NPDES No: Not reported
Creation: 10/22/93 Modified: 00/00/00
EPA ID: Not reported
Comments: Not reported
UST HIST:
Facility ID: 88513
Tank Num: 1 Container Num: 2
Tank Capacity: 2000 Year Installed: 1978
Tank Used for: WASTE
Type of Fuel: Not Reported
Leak Detection: None
Contact Name: LEROY MCGINNIS Telephone: (415) 654-8280
Total Tanks: 1 Region: STATE
Facility Type: 2 Other Type: AUTO DEALER

241
SE
1/2-1
4035 ft.
Higher

F/O 867 GRACE STREET
OAKLAND, CA 94608

CHMIRS 8100220241
N/A

CHMIRS:
OES Control Number: 9012173 DOT ID: 9189
DOT Hazard Class: Miscellaneous hazardous material
Chemical Name: HAZARDOUS WASTE
Extent of Release: Not reported
CAS Number: Not reported Quantity Released: 5
Environmental Contamination: Ground Property Use: County/City Road
Incident Date: 01-AUG-90 Date Completed: 01-AUG-90
Time Completed: 2015
Physical State Stored: Liquid
Physical State Released: Liquid
Release Unit: Gallons
Container Description: 2
Container Type: 02
Container Material: Iron Steel and Other Iron Alloys

Map ID	Direction	MAP FINDINGS		Map ID	Direction	MAP FINDINGS	
Distance	Distance (ft.)	Database(s)	EDR ID Number	Distance	Distance (ft.)	Database(s)	EDR ID Number
Elevation	Site			Elevation	Site		
(Continued)						S100220241	\$101630391
Level Of Container :	Ground Level						
Container Capacity :	30						
Container Capacity Units (code) :	2						
Extent Of Release (code) :	Not reported						
Agency Id Number :	1075						
Agency Incident Number :	9022682						
OES Incident Number :	9012173						
Time Notified :	1402						
Surrounding Area :	600						
Estimated Temperature :	70						
Property Management :	C						
More Than Two Substances Involved? :	Not reported						
Special Studies 1 :	Not reported						
Special Studies 2 :	Not reported						
Special Studies 3 :	Not reported						
Special Studies 4 :	Not reported						
Special Studies 5 :	Not reported						
Special Studies 6 :	Not reported						
Responding Agency Personnel # Of Injuries :	0						
Responding Agency Personnel # Of Fatalities :	0						
Resp Agncy Personel # Of Decontaminated :	0						
Others Number Of Decontaminated :	0						
Others Number Of Injuries :	0						
Others Number Of Fatalities :	0						
Vehicle Make/year :	Not reported						
Vehicle License Number :	Not reported						
Vehicle State :	Not reported						
Vehicle Id Number :	Not reported						
CA/DOT/PUC/ICC Number :	Not reported						
Company Name :	Not reported						
Reporting Officer Name/ID :	LT. EUGENE M. DICK						
Report Date :	01-AUG-90						
Comments :	Yes						
Facility Telephone Number :	415 444-3322						
BE242	CONSOLIDATED FREIGHTWAYS	LUST	S101630391	CORTES	N/A	243	CHMRS S100221801
NNW	2515 9TH ST.					NNW	N/A
1/2-1	BERKELEY, CA 94710						
4035 ft.							
Higher	Site 1 of 2 in cluster BE						
Site LUST:							
Cross Street:	Not reported						
City Leaked:	Not reported						
Case Number:	01-0448						
Reg Board:	San Francisco Bay Region						
Chemical:	Diesel						
Lead Agency:	Local Agency						
Local Agency:	01020						
Case Type:	Other ground water affected						
Status:	Signed off, remedial action completed or deemed unnecessary						
County:	Alameda						
Abate Method:	Excavate and Dispose - remove contaminated soil and dispose in approved site, Excavate and Treat - remove contaminated soil and treat (includes spreading or land farming)						
Review Date:	3/22/1991	Confirm Leak:	3/22/1991				
Workplan:	7/28/1993	Prelim Assess:	7/26/1993				
Pollution Char:	Not reported	Remed Plan:	Not reported				
Remed Action:	Not reported	Monitoring:	Not reported				
CORTES:							
Reg Id:	01-0448						
Region:	CORTESE						
Reg By:	Leaking Underground Storage Tanks						
CORTESE:							
Reg Id:	01-0448						
Region:	CORTESE						
Reg By:	Leaking Underground Storage Tanks						

Map ID	MAP FINDINGS			Map ID	MAP FINDINGS		
Direction				Direction			
Distance				Distance			
Distance (ft.)				Elevation (ft.)			
Elevation	Site	Database(s)	EDR ID Number	Elevation	Site	Database(s)	EDR ID Number
(Continued)			S100221801				BERKELEY UNIFIED SCHOOL DISTRICT (Continued)
CHMIRS:							
QES Control Number:	9990030	DOT ID:	Not reported				
DOT Hazard Class:	Not Reported						
Chemical Name:	DIBUTYL PHthalATE						
Extent of Release:	Not reported						
CAS Number:	Not reported	Quantity Released:	5				
Environmental Contamination:	Ground	Property Use:	Storage				
Incident Date:	18-APR-88	Data Completed:	18-APR-88				
Time Completed:	Not reported						
Physical State Stored:	Liquid						
Physical State Released:	Liquid						
Release Unit:	Gallons						
Container Description:	2						
Container Type:	02						
Container Material:	Plastic , Flexible						
Level Of Container:	Ground Level						
Container Capacity:	5						
Container Capacity Units (code):	2						
Extent Of Release (code):	0						
Agency Id Number:	1015						
Agency Incident Number:	82773						
QES Incident Number:	9990030						
Time Notified:	1228						
Surrounding Area :	800						
Estimated Temperature :	Not reported						
Property Management :	U						
More Than Two Substances Involved? :	Not reported						
Special Studies 1 :	Not reported						
Special Studies 2 :	Not reported						
Special Studies 3 :	Not reported						
Special Studies 4 :	Not reported						
Special Studies 5 :	Not reported						
Special Studies 6 :	Not reported						
Responding Agency Personnel # Of Injuries :	Not reported						
Responding Agency Personnel # Of Fatalities :	Not reported						
Resp Agcy Personnel # Of Decontaminated :	Not reported						
Others Number Of Decontaminated :	Not reported						
Others Number Of Injuries :	Not reported						
Others Number Of Fatalities :	Not reported						
Vehicle Make/year :	Not reported						
Vehicle License Number :	Not reported						
Vehicle State :	Not reported						
Vehicle Id Number :	Not reported						
CADOT/PUC/ICC Number :	Not reported						
Company Name :	Not reported						
Reporting Officer Name/ID :	LT. O REILLY						
Report Date :	18-APR-88						
Comments :	Yes						
Facility Telephone Number :	415 644-8789						
244	BERKELEY UNIFIED SCHOOL DISTRICT	HAZNET	S103952381				
NE	1500 DERBY STREET	Cortese	N/A				
1/2-1	BERKELEY, CA 94703						
4122 R.							
Higher							

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

BERKELEY UNIFIED SCHOOL DISTRICT (Continued)

S103952391

Gepaid: CAC001081936
Tepaid: CAD028409019
Gen County: 1
Tad County: Los Angeles
Tons: 0.165
Category: Laboratory waste chemicals
Disposal Method: Transfer Station
Contact: BERKELEY UNIFIED SCHOOL DIST
Telephone: (510) 844-4594
Mailing Address: 1720 OREGON ST
BERKELEY, CA 94703
County 1

CORTESE:
Reg Id: 01-2453
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

BE245
NNW 2501 TENTH STREET
1/2-1 BERKELEY, CA 94703
4137 ft.
Higher Site 2 of 2 In cluster BE

CHMIRS S100221257
N/A

CHMIRS:
OES Control Number: 9099237 DOT ID: 9189
DOT Hazard Class: Flammable liquid
Chemical Name: OIL NOS
Extent of Release: Not reported
CAS Number: Not reported Quantity Released: 100
Environmental Contamination: Ground Property Use: Mercantile, Business
Incident Date: 30-MAY-90 Date Completed: 30-MAY-90
Time Completed: 1846
Physical State Stored: Liquid
Physical State Released: Liquid
Release Unit: Gallons
Container Description: 2
Container Type: 01
Container Material: Not reported
Level Of Container: Ground Level
Container Capacity: 0
Container Capacity Units (code): Not reported
Extent Of Release (code): 7
Agency Id Number: 1015
Agency Incident Number: 04183
OES Incident Number: 9099237
Time Notified: 1434
Surrounding Area: 400
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Special Studies 1: Not reported
Special Studies 2: Not reported
Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
Responding Agency Personnel # Of Injuries: 0
Responding Agency Personnel # Of Fatalities: 0

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

(Continued)

Resp Agency Personnel # Of Decontaminated: 0
Others Number Of Decontaminated: 0
Others Number Of Injuries: 0
Others Number Of Fatalities: 0
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA/DOT/PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: LT. CHRISTOPHER J. PINTO
Report Date: 30-MAY-90
Comments: Yes
Facility Telephone Number: 415 844-6789

246
SSW
1/2-1
4207 ft.
Lower

SHELL
1800 POWELL
EMERYVILLE, CA 94608

HAZNET S100226346
Corse N/A

HAZNET:
Gepaid: CAL000194074
Tepaid: CAD009466392
Gen County: 1
Tad County: 7
Tons: 1.5000
Category: Empty containers less than 30 gallons
Disposal Method: Recycler
Contact: EQUILON ENTERPRISES LLC
Telephone: (713) 241-2258
Mailing Address: P O BOX 4453
HOUSTON, TX 77210 - 4453
County 1

CORTESE:
Reg Id: 01-1336
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

BF247
East
1/2-1
4258 ft.
Higher

3100 KING STREET
BERKELEY, CA 94703

CHMIRS S100277477
N/A

Site 1 of 2 In cluster BF

CHMIRS:
OES Control Number: 9116412 DOT ID: Not reported
DOT Hazard Class: Not Reported
Chemical Name: UNKNOWN ORGANIC LIQUID
Extent of Release: Not reported
CAS Number: Not reported Quantity Released: 5
Environmental Contamination: Air Property Use: Residential
Incident Date: 09-APR-91 Date Completed: 09-APR-91
Time Completed: 1747
Physical State Stored: Liquid
Physical State Released: Gas
Release Unit: Cu. Ft
Container Description: 2

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

(Continued)

Container Type : 02
Container Material : Iron Steel and Other Iron Alloys
Level Of Container : Ground Level
Container Capacity : 40
Container Capacity Units (code) : 2
Extent Of Release (code) : 6
Agency Id Number : 1015
Agency Incident Number : 02758
OES Incident Number : 9118412
Time Notified : 1417
Surrounding Area : 400
Estimated Temperature : 65
Property Management : P
More Than Two Substances Involved? : Not reported
Special Studies 1 : Not reported
Special Studies 2 : Not reported
Special Studies 3 : Not reported
Special Studies 4 : Not reported
Special Studies 5 : Not reported
Special Studies 6 : Not reported
Responding Agency Personnel # Of Injuries : 0
Responding Agency Personnel # Of Fatalities : 0
Resp Agency Personnel # Of Decontaminated : 2
Others Number Of Decontaminated : 0
Others Number Of Injuries : 1
Others Number Of Fatalities : 0
Vehicle Make/year : Not reported
Vehicle License Number : Not reported
Vehicle State : Not reported
Vehicle Id Number : Not reported
CADOT/PUC/ICC Number : Not reported
Company Name : Not reported
Reporting Officer Name/ID : LT. C. MILLER
Report Date : 09-APR-91
Comments : No
Facility Telephone Number : 415 844-6789

S100277477

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

(Continued)

Container Capacity : 20
Container Capacity Units (code) : 2
Extent Of Release (code) : 2
Agency Id Number : 1075
Agency Incident Number : 119442
OES Incident Number : 9100614
Time Notified : 1220
Surrounding Area : 700
Estimated Temperature : 75
Property Management : P
More Than Two Substances Involved? : Not reported
Special Studies 1 : Not reported
Special Studies 2 : Not reported
Special Studies 3 : Not reported
Special Studies 4 : Not reported
Special Studies 5 : Not reported
Special Studies 6 : Not reported
Responding Agency Personnel # Of Injuries : 0
Responding Agency Personnel # Of Fatalities : 0
Resp Agency Personnel # Of Decontaminated : 0
Others Number Of Decontaminated : 0
Others Number Of Injuries : 0
Others Number Of Fatalities : 0
Vehicle Make/year : Not reported
Vehicle License Number : Not reported
Vehicle State : Not reported
Vehicle Id Number : Not reported
CADOT/PUC/ICC Number : Not reported
Company Name : Not reported
Reporting Officer Name/ID : CAPT. WAYNE GASKIN
Report Date : 08-JUL-91
Comments : Yes
Facility Telephone Number : 415 273-3858

S100280165

248
ESE
1/2-1
4288 ft.
Higher

900 STANFORD AVENUE
OAKLAND, CA 94606

CHMIRS S100280165
N/A

BG248
South
1/2-1
4366 ft.
Higher

RESIDENCE
2160 LAKE STREET
.CA

HAZNET 1000297605
Cortese N/A
UST UST
HIST UST

Site 1 of 4 in cluster BG

HAZNET:
Gepid: CAD981455074
Teplid: Not reported
Gen County: 1
Tel County: 0
Tons: 2,0850
Category: Unspecified oil-containing waste
Disposal Method: Recycle
Contact: Not reported
Telephone: (000) 000-0000
Mailing Address: 2177 JERROLD AVE
SAN FRANCISCO, CA 94124
County 1

CORTESE:
Reg Id: 01-1306
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

CHMIRS:
OES Control Number: 9100614 DOT ID: 2874
DOT Hazard Class: Flammable liquid
Chemical Name: FUFURLY ALCOHOL
Extent of Release: Not reported
CAS Number: Not reported Quantity Released: 12
Environmental Contamination: Ground Property Use: Manufacturing
Incident Date: 08-JUL-91 Date Completed: 08-JUL-91
Time Completed: 1420
Physical State Stored: Liquid
Physical State Released: Liquid
Release Unit: Gallons
Container Description: 2
Container Type: 21
Container Material: Aluminum and Aluminium alloys
Level Of Container: Ground Level

Map ID	Direction	MAP FINDINGS		
Distance	Distance (ft.)	Database(s)	EDR ID Number	
Elevation	Site		EPA ID Number	
RESIDENCE (Continued)				1000297605
UST HIST:				
Facility ID:	45104			
Tank Num:	1	Container Num:	002	
Tank Capacity:	6000	Year Installed:	1985	
Tank Used for:	PRODUCT			
Type of Fuel:	REGULAR	Tank Construction:	Not reported	
Leak Detection:	Visual, Stock Inventor, GW Monitoring Well			
Contact Name:	VINCENT FINIGAN	Telephone:	(415) 547-3838	
Total Tanks:	2	Region:	STATE	
Facility Type:	2	Other Type:	EQUIPMENT RENTAL	
Facility ID:	45104			
Tank Num:	2	Container Num:	001	
Tank Capacity:	6000	Year Installed:	1984	
Tank Used for:	PRODUCT			
Type of Fuel:	DIESEL	Tank Construction:	Not reported	
Leak Detection:	Visual, Stock Inventor, GW Monitoring Well			
Contact Name:	VINCENT FINIGAN	Telephone:	(415) 547-3838	
Total Tanks:	2	Region:	STATE	
Facility Type:	2	Other Type:	EQUIPMENT RENTAL	
UST San Francisco County:				
Facility ID:	1886	Case Number:	Not reported	
Tank ID:	Not reported	Tank Capacity:	Not reported	
Manufacturer:	Not reported	Date Installed:	Not reported	
Other Interior Lining:	Not reported			
Receive Date:	4/26/94 0:00:00	Close Date:	5/5/94 0:00:00	
Owner Name:	Not reported			
Certified Date:	6/7/94 0:00:00			
Flag:	CLOSED			
Other Corrosion Protection:	Not reported			
Drop Tube:	Not reported			
Striker Plate:	Not reported	Dispenser:	Not reported	
Contents A:	Not reported			
Contents B:	Not reported			
Contents C:	Not reported			
Mailing Name:	Not reported			
Mailing Address:	Not reported			
Other Substance:	Not reported			
Tank Construction Type:	Not reported			
Tank Material:	Not reported			
Interior Lining:	Not reported			
Corrosion Protection:	Not reported			
Spill Contamination Installed Date:	Not reported			
Overflow Prevention Installed Date:	Not reported			
Piping Type:	Not reported			
Piping Aboveground:	Not reported			
Piping Underground:	Not reported			
Piping Construction:	Not reported			
Piping Construction Aboveground:	Not reported			
Piping Construction Underground:	Not reported			
Piping Material:	Not reported			
Other Piping Material:	Not reported			
Piping Material Aboveground:	Not reported			
Piping Material Underground:	Not reported			
Pipe Leak Detection:	Not reported			
Estimated Last Date Used:	Not reported			

Map ID	Direction	Distance	Distance (ft.)	Elevation	Site	Database(s)	EDR ID Number	EPA ID Number
RESIDENCE (Continued)								1000297805
Estimated Quantity Remaining:		Not reported						
Initial Filing:		Not reported						
Jurisdiction:		Not reported						
Other Tank System:		Not reported						
Other Tank Leak Detection:		Not reported						
Other Pipe Leak Detection:		Not reported						
Methanol Compatible:		Not reported						
<hr/>								
250 SSW 1/2-1 4315 ft. Lower	A & J TRUCKING, INC 5600 SHELLMOND AVENUE EMERYVILLE, CA 94633					Notify 65	U000657368 N/A	
<hr/>								
NOTIFY 65:								
Data Reported:		Not reported	Staff Initials:	Not reported				
Board File Number:		Not reported						
Facility Type:		Not reported						
Discharge Date:		Not reported						
Incident Description:		92833						
<hr/>								
BG251 South 1/2-1 4325 ft. Higher	FORDHAM PROPERTIES 5515 DOYLE ST. EMERYVILLE, CA 94608					HAZNET Cortese	S162436118 N/A	
<hr/>								
Site 2 of 4 In cluster BG								
HAZNET:								
Gepaid:		CAC000927840						
Tepaid:		CAD009466392						
Gen County:		1						
Ted County:		7						
Tons:		.3750						
Category:		Other empty containers 30 gallons or more						
Disposal Method:		Recycler						
Contact:		CONTACT JOE PIERI						
Telephone:		(415) 547-7177						
Mailing Address:		5743 LANDREGAN ST.						
County		EMERYVILLE, CA 94608						
CORTESE:								
Reg Id:		01-2071						
Region:		CORTESE						
Reg By:		Leaking Underground Storage Tanks						
<hr/>								
BF252 ENE 1/2-1 4355 ft. Higher	MALCOM X SCHOOL 1734 PRINCE ST BERKELEY, CA 94784					LUST Cortese	S102432932 N/A	
<hr/>								
Site 2 of 2 In cluster BF								
State LUST:								
Cross Street:		Not reported						
City Leaked:		Not reported						
Case Number:		01-1983						
Reg Board:		San Francisco Bay Region						
Chemical:		Misc. Motor Vehicle Fuels						

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

MALCOM X SCHOOL (Continued)

S102432932

Lead Agency: Regional Board
Local Agency: 01020
Case Type: Undefined
Status: Signed off, remedial action completed or deemed unnecessary
County: Alameda
Abate Method: No Action Taken - no action has as yet been taken at the site
Review Date: 1/25/1996 Confirm Leak: 1/25/1996
Workplan: Not reported Prelim Assess: Not reported
Pollution Char: Not reported Remed Plan: Not reported
Remed Action: Not reported Monitoring: Not reported
Close Date: 1/25/1996
Release Date: 7/18/1991
Cleanup Fund Id: Not reported
Discover Date: 7/19/1991
Enforcement Dt: Not reported
Enf Type: Not reported
Enter Date: 9/29/1994
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank
Interim: No
Leak Cause: Structure Failure
Leak Source: Tank
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Not Required to be Tested.
Priority: Not reported
Local Case #: 01-1983
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgm: RB Lead Underground Storage Tank
Oversight Prgm: UST
Review Date: 1/25/1996
Stop Date: 7/19/1991
Work Suspended: N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T0600101832
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mibe Fuel: 0
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 3442.080411916477506979175328
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

LUST Region 2:

Region: 2
Facility Id: 01-1983
Entered Data: 09/29/1994

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

MALCOM X SCHOOL (Continued)

S102432932

Facility Status: Signed off, remedial action completed or deemed unnecessary
Maximum Soil Concentration: 0
Maximum Groundwater Impact: 0
County: Alameda
Current Benzene: Not reported
MTBE Detected in GW: No
MTBE Detected in Soil: Not reported
MTBE: 0
MTBE Quality: Not reported
CORTESE:
Reg Id: 01-1983
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

BG253 CALIFORNIA SYRUP & EXTRAC
South 1355 55TH
1/2-1 EMERYVILLE, CA 94608
Higher

LUST S104162460
Cortese N/A

Site 3 of 4 in cluster BG
State LUST:
Cross Street: Not reported
Qty Leaked: Not reported
Case Number: 01-1754
Reg Board: San Francisco Bay Region
Chemical: Diesel
Lead Agency: Local Agency
Local Agency: 01000
Case Type: Undefined
Status: Preliminary site assessment underway
County: Alameda
Abate Method: No Action Taken - no action has as yet been taken at the site

Review Date: 8/22/1996 Confirm Leak: 8/22/1996
Workplan: 1/2/1995 Prelim Assess: 1/2/1995
Pollution Char: Not reported Remed Plan: Not reported
Remed Action: Not reported Monitoring: Not reported
Close Date: Not reported
Release Date: 7/20/1993
Cleanup Fund Id: Not reported
Discover Date: 7/21/1993
Enforcement Dt: Not reported
Enf Type: Not reported
Enter Date: 8/22/1993
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Remove Contents
Interim: No
Leak Cause: Unknown
Leak Source: Not reported
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Not Required to be Tested.
Priority: Not reported
Local Case #: 01-4592
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported

Map ID	Direction	MAP FINDINGS		Map ID	Direction	MAP FINDINGS	
Distance	Distance (ft.)	Database(s)	EDR ID Number	Distance	Distance (ft.)	Database(s)	EDR ID Number
Elevation	Site		EPA ID Number	Elevation	Site		EPA ID Number
CALIFORNIA SYRUP & EXTRAC (Continued)						THOROUGHBRED BUILDING (Continued)	
		S104182460					U003301037
Max MTBE Soil:	Not reported			Pollution Char:	Not reported	Remed Plan:	Not reported
Soil Qualifies:	Not reported			Remed Action:	Not reported	Monitoring:	Not reported
Hydr Basin #:	Not reported			Close Date:	Not reported		
Operator:	Not reported			Release Date:	7/24/1997		
Oversight Prgm:	Local Oversight Program UST			Cleanup Fund Id:	Not reported		
Oversight Prgm:	LOP			Discover Date:	2/14/1997		
Review Date:	2/23/2000			Enforcement DI:	Not reported		
Stop Date:	7/21/1993			Env Type:	Not reported		
Work Suspended:	N			Enter Date:	3/16/1998		
Responsible Party:	BLANK RP			Funding:	Not reported		
RP Address:	Not reported			Staff Initials:	UNK		
Global Id:	T0600101623			How Discovered:	Tank Closure		
Org Name:	Not reported			How Stopped:	Close Tank		
Contact Person:	Not reported			Interim:	Not reported		
MTBE Conc:	0			Leak Cause:	Unknown		
MTBE Fuel:	0			Leak Source:	Unknown		
Water System Name:	Not reported			MTBE Date:	Not reported		
Well Name:	Not reported			Max MTBE GW:	Not reported		
Distance To Lust:	9591.585369750075907892636443			MTBE Tested:	Not Required to be Tested.		
Waste Discharge Global ID:	Not reported			Priority:	Not reported		
Waste Disch Assigned Name:	Not reported			Local Case #:	6080		
LUST Region 2:				Beneficial:	Not reported		
Region:	2			Staff:	CTH		
Facility Id:	01-1754			GW Qualifies:	Not reported		
Entered Date:	06/22/1993			Max MTBE Soil:	Not reported		
Facility Status:	Preliminary site assessment underway			Soil Qualifies:	Not reported		
Maximum Soil Concentration:	0			Hydr Basin #:	Not reported		
Maximum Groundwater Impact:	0			Operator:	Not reported		
County:	Alameda			Oversight Prgm:	Local Oversight Program UST		
Current Benzene:	Not reported			Review Date:	9/11/1997		
MTBE Detected in GW:	No			Stop Date:	2/14/1997		
MTBE Detected in Soil:	Not reported			Work Suspended:	N		
MTBE:	0			Responsible Party:	BLANK RP		
MTBE Qualify:	Not reported			RP Address:	Not reported		
CORTESE:				Global Id:	T0800102100		
Reg Id:	01-1754			Org Name:	Not reported		
Region:	CORTESE			Contact Person:	Not reported		
Reg By:	Leaking Underground Storage Tanks			MTBE Conc:	0		
MTBE Fuel:	0			Water System Name:	Not reported		
Water System Name:	Not reported			Well Name:	Not reported		
Well Name:	Not reported			Distance To Lust:	9787.251488410913255878454222		
Distance To Lust:	Not reported			Waste Discharge Global ID:	Not reported		
Waste Disch Assigned Name:	Not reported			Waste Disch Assigned Name:	Not reported		
BG254	THOROUGHBRED BUILDING		LUST	U003301037	LUST Region 2:		
South	1397 55TH ST	Cortese	N/A	Region:	2		
1/2-1	EMERYVILLE, CA 94608			Facility Id:	01-2284		
4365 ft.				Entered Date:	03/16/1998		
Higher	Site 4 of 4 in cluster BG			Facility Status:	Preliminary site assessment workplan submitted		
State LUST:				Maximum Soil Concentration:	0		
Cross Street:	DOYLE			Maximum Groundwater Impact:	0		
City Leaked:	Not reported			County:	Alameda		
Case Number:	01-2284			Current Benzene:	Not reported		
Reg Board:	San Francisco Bay Region			MTBE Detected in GW:	No		
Chemical:	Kerosene			MTBE Detected in Soil:	Not reported		
Lead Agency:	Local Agency			MTBE:	0		
Local Agency:	01000						
Case Type:	Undefined						
Status:	Preliminary site assessment workplan submitted						
County:	Alameda						
Review Date:	3/16/1998	Confirm Leak:	3/16/1998				
Workplan:	Not reported	Prelim Assess:	Not reported				

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

THOROUGHBRED BUILDING (Continued)

MTBE Qualify: Not reported

CORTESE:
Reg Id: 01-2284
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

255 NNE
1/2-1
4404 ft.
Higher
KEITH PROPERTY
2598 SACRAMENTO ST
BERKELEY, CA

State LUST:

Cross Street: Not reported
Qty Leaked: Not reported
Case Number: 01-0855
Reg Board: San Francisco Bay Region
Chemical: Gasoline
Lead Agency: Local Agency
Local Agency: 01020
Case Type: Soil only
Status: Post remedial action monitoring in progress
County: Alameda
Abate Method: No Action Taken - no action has as yet been taken at the site
Review Date: Not reported Confirm Leak: Not reported
Workplan: Not reported Prelim Assess: Not reported
Pollution Char: Not reported Remed Plan: Not reported
Remed Action: 1/2/1985 Monitoring: 1/2/1985
Close Date: Not reported
Release Date: 2/3/1986
Cleanup Fund Id: Not reported
Discover Date: 2/3/1986
Enforcement Dt: Not reported
Enf Type: Not reported
Enter Date: 2/3/1986
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank
Interim: No
Leak Cause: Structure Failure
Leak Source: Tank
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.
Priority: Not reported
Local Case #: 01-0855
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hyd. Basin #: Not reported
Operator: Not reported
Oversight Prgm: Local Implementing Agency UST (includes non-LOP cases within LOP jurisdiction)
Oversight Prgm: LIA
Review Date: 4/4/1990

U063301037

LUST S101306325
Corse N/A

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

KEITH PROPERTY (Continued)

Stop Date: 2/3/1986
Work Suspended: N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T080100789
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mtbe Fuel: 1
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 2619.0919489004097895074649964
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

LUST Region 2:
Region: 2
Facility Id: 01-0855
Entered Date: 02/03/1986
Facility Status: Post remedial action monitoring in progress
Maximum Soil Concentration: 1000
Maximum Groundwater Impact: 0
County: Alameda
Current Benzene: Not reported
MTBE Detected in GW: No
MTBE Detected in Soil: Not reported
MTBE: 0
MTBE Qualify: Not reported

CORTESE:
Reg Id: 01-0855
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

256 SSE
1/2-1
4421 ft.
Higher
PARINA ENTERPRISES
5433 SAN PABLO AVE
OAKLAND, CA 94608

State LUST:

Cross Street: Not reported
Qty Leaked: Not reported
Case Number: 01-1138
Reg Board: San Francisco Bay Region
Chemical: Xylene
Lead Agency: Local Agency
Local Agency: 01000
Case Type: Soil only
Status: Leak being confirmed
County: Alameda
Abate Method: No Action Taken - no action has as yet been taken at the site
Review Date: 4/30/1990 Confirm Leak: 4/30/1990
Workplan: Not reported Prelim Assess: Not reported
Pollution Char: Not reported Remed Plan: Not reported
Remed Action: Not reported Monitoring: Not reported
Close Date: Not reported
Release Date: 4/30/1990
Cleanup Fund Id: Not reported
Discover Date: 4/30/1990

LUST S100455575
Corse N/A

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

PARINA ENTERPRISES (Continued)

Enforcement Dt: Not reported
Env Type: Not reported
Enter Date: 5/22/1990
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank
Interim: No
Leak Cause: Structure Failure
Leak Source: Tank
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Not Required to be Tested.
Priority: Not reported
Local Case #: 01-1138
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgm: Local Oversight Program UST
Oversight Prgm: LOP
Review Date: 8/13/1994
Stop Date: 4/30/1990
Work Suspended N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T0800101048
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mibe Fuel: 0
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 8999.593241607827886815079538
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

CORTESE:

Reg Id: 01-1138
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

257
SSE F/O 5425 SAN PABLO
1/2-1 OAKLAND, CA 94608
4465 ft.
Higher

CHMIRS S100277131
N/A

CHMIRS:
OES Control Number: 9114981 DOT ID: 1701
DOT Hazard Class: Radioactive material
Chemical Name: THALLIUM 201
Extent of Release: Not reported
CAS Number: 7440280 Quantity Released: 4.4
Environmental Contamination: None Reported Property Use: Residential
Incident Date: 17-JAN-91 Date Completed: 17-JAN-91

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

(Continued)

Time Completed: 630
Physical State Stored: Liquid
Physical State Released: Not reported
Release Unit: Not reported
Container Description: 2
Container Type: Box Or Carton
Container Material: Plastic, Flexible
Level Of Container: Ground Level
Container Capacity: 4.4
Container Capacity Units (code): Not reported
Extent Of Release (code): 0
Agency Id Number: 1075
Agency Incident Number: 910856
OES Incident Number: 9114981
Time Notified: 133
Surrounding Area: 400
Estimated Temperature: 50
Property Management: P
More Than Two Substances Involved: Not reported
Special Studies 1: Not reported
Special Studies 2: Not reported
Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
Responding Agency Personnel # Of Injuries: 0
Responding Agency Personnel # Of Fatalities: 0
Resp Agency Personnel # Of Decontaminated: 0
Others Number Of Decontaminated: 0
Others Number Of Injuries: 0
Others Number Of Fatalities: 0
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA/DOT/PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: LT. E.M. DICK
Report Date: 17-JAN-91
Comments: Yes
Facility Telephone Number: 415 273-3858

CHMIRS S100279435
N/A

1321 DWIGHT
BERKELEY, CA 94702

CHMIRS:
OES Control Number: 8909456 DOT ID: 1830
DOT Hazard Class: Corrosives
Chemical Name: ACID, SULFURIC
Extent of Release: Not reported
CAS Number: 7664-93-9 Quantity Released: 60
Environmental Contamination: None Reported Property Use: Residential
Incident Date: 28-DEC-89 Date Completed: 28-DEC-89
Time Completed: 1730
Physical State Stored: Liquid
Physical State Released: Liquid

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

(Continued)

Release Unit : Lbs.
Container Description : 2
Container Type : 04
Container Material : Glass , Pottery and Clay
Level Of Container : Ground Level
Container Capacity : 9
Container Capacity Units (code) : 1
Extent Of Release (code) : 8
Agency Id Number : 1015
Agency Incident Number : 10071
OES Incident Number : 8909458
Time Notified : 1608
Surrounding Area : 400
Estimated Temperature : 50
Property Management : P
More Than Two Substances Involved? : Not reported
Special Studies 1 : Not reported
Special Studies 2 : Not reported
Special Studies 3 : Not reported
Special Studies 4 : Not reported
Special Studies 5 : Not reported
Special Studies 6 : Not reported
Responding Agency Personnel # Of Injuries : 0
Reporting Agency Personnel # Of Fatalities : 0
Resp Agency Personnel # Of Decontaminated : 0
Others Number Of Decontaminated : 0
Others Number Of Injuries : 0
Others Number Of Fatalities : 0
Vehicle Make/year : Not reported
Vehicle License Number : Not reported
Vehicle State : Not reported
Vehicle Id Number : Not reported
CA/DOT/PUC/ICC Number : Not reported
Company Name : Not reported
Reporting Officer Name/ID : RON FALSTAD
Report Date : 26-DEC-89
Comments : Not reported
Facility Telephone Number : 415 644-6789

259 SSW
1700 POWELL STREET
EMERYVILLE, CA 94633
1/2-1
4581 ft.
Lower

NOTIFY 85:
Date Reported: Not reported Staff Initials: Not reported
Board File Number: Not reported
Facility Type: Not reported
Discharge Date: Not reported
Incident Description: 92633

260 North
2995 SAN PABLO AVE
BERKELEY, CA 94702
1/2-1
4562 ft.
Higher

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

90194 (Continued)

CORTESE:
Reg Id: 01-0353
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

BH261
BSE
1/2-1
4698 ft.
Higher

Site 1 of 2 In cluster BH

CHMIRS S100277132
N/A

CHMIRS:
OES Control Number: 9114983 DOT ID: 1707
DOT Hazard Class: Radioactive material
Chemical Name: THALLIUM 201
Extent of Release: Not reported
CAS Number: 7440280 Quantity Released: 4.4
Environmental Contamination: None Reported Property Use: Residential
Incident Date: 07-JAN-91 Date Completed: 17-JAN-91
Time Completed: 1430
Physical State Stored: Liquid
Physical State Released: Not reported
Release Unit: Not reported
Container Description: 2
Container Type: Box Or Carton
Container Material: Plastic, Flexible
Level Of Container: Ground Level
Container Capacity: 4.4
Container Capacity Units (code) : Not reported
Extent Of Release (code) : 8
Agency Id Number : 1075
Agency Incident Number : 9101685
OES Incident Number : 9114983
Time Notified : 1201
Surrounding Area : 400
Estimated Temperature : 65
Property Management : C
More Than Two Substances Involved? : Not reported
Special Studies 1 : Not reported
Special Studies 2 : Not reported
Special Studies 3 : Not reported
Special Studies 4 : Not reported
Special Studies 5 : Not reported
Special Studies 6 : Not reported
Responding Agency Personnel # Of Injuries : 0
Reporting Agency Personnel # Of Fatalities : 0
Resp Agency Personnel # Of Decontaminated : 0
Others Number Of Decontaminated : 0
Others Number Of Injuries : 0
Others Number Of Fatalities : 0
Vehicle Make/year : Not reported
Vehicle License Number : Not reported
Vehicle State : Not reported
Vehicle Id Number : Not reported
CA/DOT/PUC/ICC Number : Not reported
Company Name : Not reported
Reporting Officer Name/ID : LT. E.M. DICK
Report Date : 17-JAN-91

Map ID	MAP FINDINGS				Map ID	MAP FINDINGS			
Direction		Database(s)	EDR ID Number	EPA ID Number	Direction		Database(s)	EDR ID Number	EPA ID Number
Distance (ft.)					Distance (ft.)				
Elevation	Site				Elevation	Site			
(Continued)									
Comments :									
Facility Telephone Number :	Yes								
415 273-3856									
BH262									
SSE	R/O 1084 63RD STREET								
1/2-1	OAKLAND, CA 94609								
4700 ft.									
Higher	Site 2 of 2 In cluster BH								
CHMIRS:									
OES Control Number:	9115043	DOT ID:	1707						
DOT Hazard Class:	Radioactive material								
Chemical Name:	THALLIUM - 201								
Extent of Release:	Not reported								
CAS Number:	7440280	Quantity Released:	6.6						
Environmental Contamination:	None Reported	Property Use:	Residential						
Incident Date:	17-JAN-91	Date Completed:	17-JAN-91						
Time Completed:	1700								
Physical State Stored:	Liquid								
Physical State Released:	Not reported								
Release Unit:	Not reported								
Container Description:	2								
Container Type:	Box Or Carton								
Container Material:	Plastic, Flexible								
Level Of Container:	Ground Level								
Container Capacity:	6.6								
Container Capacity Units (code):	Not reported								
Extent Of Release (code):	B								
Agency Id Number:	1075								
Agency Incident Number:	910703N								
OES Incident Number:	9115043								
Time Notified:	1503								
Surrounding Area:	400								
Estimated Temperature:	65								
Property Management:	P								
More Than Two Substances Involved?:	Not reported								
Special Studies 1:	Not reported								
Special Studies 2:	Not reported								
Special Studies 3:	Not reported								
Special Studies 4:	Not reported								
Special Studies 5:	Not reported								
Special Studies 6:	Not reported								
Responding Agency Personnel # Of Injuries:	0								
Responding Agency Personnel # Of Fatalities:	0								
Resp Agency Personnel # Of Decontaminated:	0								
Others Number Of Decontaminated:	0								
Others Number Of Injuries:	0								
Others Number Of Fatalities:	0								
Vehicle Make/year:	Not reported								
Vehicle License Number:	Not reported								
Vehicle State:	Not reported								
Vehicle Id Number:	Not reported								
CA/DOT/PUC/ICC Number:	Not reported								
Company Name:	Not reported								
Reporting Officer Name/ID:	LT. E.M. DICK								
Report Date:	17-JAN-91								
Comments:	Yes								
Facility Telephone Number:	415 273-3856								
CHMIRS:									
264									
ENE									
1/2-1									
4878 ft.									
Higher									
ASHBY/MARTIN LUTHER KING-W OF									
BERKELEY, CA									
CHMIRS:									
OES Control Number:	8809054	DOT ID:	Not reported						
DOT Hazard Class:	Not Reported								
Chemical Name:	SAFROTIN (PROPETAMPHOS)								
Extent of Release:	Not reported								
CAS Number:	Not reported	Quantity Released:	Not reported						
Environmental Contamination:	Ground	Property Use:	County/City Road						
Incident Date:	28-NOV-89	Date Completed:	29-NOV-89						
Time Completed:	1057								
Physical State Stored:	Liquid								
Physical State Released:	Liquid								
Release Unit:	Not reported								
Container Description:	2								
Container Type:	04								
Container Material:	Plastic, Flexible								
Level Of Container:	Ground Level								
Container Capacity:	Not reported								
Container Capacity Units (code):	Not reported								
HAZNET:									
Gepid:	CAC001060984								
Tepid:	CAD008452857								
Gen County:	1								
Tsd County:	San Mateo								
Tons:	.4500								
Category:	Contaminated soil from site clean-up								
Disposal Method:	Disposal, Land Fill								
Contact:	KEITH RUTLAGE								
Telephone:	(000) 000-0000								
Mailing Address:	SUB SURFACE CONSULTANTS								
	LAFAYETTE, CA 94549								
County	1								
Gepid:	CAC001060984								
Tepid:	CAD008452857								
Gen County:	1								
Tsd County:	San Mateo								
Tons:	.2293								
Category:	Aqueous solution with less than 10% total organic residues								
Disposal Method:	Recycler								
Contact:	KEITH RUTLAGE								
Telephone:	(000) 000-0000								
Mailing Address:	SUB SURFACE CONSULTANTS								
	LAFAYETTE, CA 94549								
County	1								
CORTESE:									
Reg Id:	01-1239								
Region:	CORTESE								
Reg By:	Leaking Underground Storage Tanks								
CHMIRS:									
CHMIRS:									
264									
ENE									
1/2-1									
4878 ft.									
Higher									

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

(Continued)

Extent Of Release (code): 7
Agency Id Number: 1015
Agency Incident Number: 99204
OES Incident Number: 8909054
Time Notified: 458
Surrounding Area: 400
Estimated Temperature: 35
Property Management: S
More Than Two Substances Involved?: Not reported
Special Studies 1: Not reported
Special Studies 2: Not reported
Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
Responding Agency Personnel # Of Injuries: 0
Responding Agency Personal # Of Fatalities: 0
Rsp Agncy Personnel # Of Decontaminated: 1
Others Number Of Decontaminated: 0
Others Number Of Injuries: 0
Others Number Of Fatalities: 0
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA/DOT/PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: RON FALSTAD
Report Date: 28-NDV-89
Comments: Not reported
Facility Telephone Number: 415 644-6789

265 JOE'S UNOCAL 76
HNE 2501 SACRAMENTO
1/2-1 BERKELEY, CA 92661
4888 ft.
Higher

NOTIFY 65:
Data Reported: Not reported Staff Initials: Not reported
Board File Number: Not reported
Facility Type: Not reported
Discharge Date: Not reported
Incident Description: 92681

CORTESE:
Reg Id: 01-1584
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

61266 POWELL STREET PLAZA
SSW 5500 EASTSHORE HIGHWAY
1/2-1 EMERYVILLE, CA 94608
4889 ft.
Lower

Site 1 of 2 in cluster BI

CAL-SITES:
Facility ID: 01470001
Status: REFOA - DOES NOT REQUIRE DTSC ACTION OR OVERTSITE ACTIVITY. REFERRED TO

Notify 65 S100179188
Cortese N/A

Cal-Sites S102008228
Cortese N/A

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

POWELL STREET PLAZA (Continued)

Status Date: 05/10/1994
Lead: DTSC
Region: 2 - BERKELEY
Branch: NC - NORTH COAST
File Name: Not reported
Status Name: PROPERTY/SITE REFERRED TO ANOTHER AGENCY
Lead Agency: DEPT OF TOXIC SUBSTANCES CONTROL
NPL: Not Listed
SIC: 47 TRANSPORTATION SERVICES
Facility Type: RESPONSIBLE PARTY
Type Name: RP
Staff Member Responsible for Site: Not reported
Supervisor Responsible for Site: LNAKASHI
Region Water Control Board: SF - SAN FRANCISCO BAY
Access: Uncontrolled
Cortese: U
Hazardous Ranking Score: Not reported
Data Site Hazard Ranked: Not reported
Groundwater Contamination: Confirmed
No. of Contamination Sources: 1
Lat/Long: 0° 0' 0.00" / 0° 0' 0.00"
Lat/Long Method: Not reported
State Assembly District Code: 14
State Senate District: 9

The CAL-SITES database may contain additional details for this site.
Please contact your EDR Account Executive for more information.

CORTESE:

Reg Id: 01470001
Region: CORTESE
Reg By: CALSI

Reg Id: 01-1176
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

BI267
SSW
1/2-1
4889 ft.
Lower

POWELL STREET PLAZA
UNKNOWN POWELL ST / SHELLMOUND
EMERYVILLE, CA 94608

Site 2 of 2 in cluster BI

State LUST:
Cross Street: Not reported
Qty Leaked: Not reported
Case Number: 01-2034
Reg Board: San Francisco Bay Region
Chemical: Gasoline
Lead Agency: Local Agency
Local Agency: 01000
Case Type: Other ground water affected
Status: Leak being confirmed
County: Alameda
Review Date: 2/28/1995
Workplan: Not reported
Pollution Char: Not reported
Remed Action: Not reported

Confirm Leak: 2/28/1995
Preim Assess: Not reported
Remed Plan: Not reported
Monitoring: Not reported

LUST S102435438
Cortese N/A

Map ID	MAP FINDINGS		Map ID	MAP FINDINGS	
Direction	Database(s)	EDR ID Number	Direction	Database(s)	EDR ID Number
Distance		EPA ID Number	Distance (ft.)		EPA ID Number
Distance (ft.)			Elevation	Site	
Elevation			Site		
POWELL STREET PLAZA (Continued)		8102435439	ST ALBANS SENIOR CENTER (Continued)		8102008252
Close Date:	Not reported		Status Date:	05/01/1992	
Release Date:	2/28/1995		Lead:	Not reported	
Cleanup Fund Id:	Not reported		Region:	2 - BERKELEY	
Discover Date:	2/28/1995		Branch:	NC - NORTH COAST	
Enforcement Dt:	Not reported		File Name:	Not reported	
Enf Type:	Not reported		Status Name:	PROPERTY/SITE REFERRED TO ANOTHER AGENCY	
Enter Date:	2/28/1995		Lead Agency:	N/A	Not reported
Funding:	Federal Funds		NPL:	Not reported	
Staff Initials:	UNK		SIC:	58 RETAIL - EATING & DRINKING PLACES	
How Discovered:	Tank Closure		Facility Type:	N/A	
How Stopped:	Close Tank		Type Name:	Not reported	
Interim:	Not reported		Staff Member Responsible for Site:	Not reported	
Leak Cause:	Unknown		Supervisor Responsible for Site:	Not reported	
Leak Source:	Unknown		Region Water Control Board:	SF - SAN FRANCISCO BAY	
MTBE Date:	Not reported		Access:	Uncontrolled	
Max MTBE GW:	Not reported		Cortese:	U	
MTBE Tested:	Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.		Hazardous Ranking Score:	Not reported	
Priority:	Not reported		Date Site Hazard Ranked:	Not reported	
Local Case #:	01-2034		Groundwater Contamination:	Confirmed	
Beneficial:	Not reported		No. of Contamination Sources:	1	
Staff:	CTH		Lat/Long:	0° 0' 0.00" / 0° 0' 0.00"	
GW Qualifies:	Not reported		Lat/Long Method:	Not reported	
Max MTBE Soil:	Not reported		State Assembly District Code:	Not reported	
Soil Qualifies:	Not reported		State Senate District:	Not reported	
Hydr Basin #:	Not reported		The CAL-SITES database may contain additional details for this site. Please contact your EDR Account Executive for more information.		
Operator:	Not reported				
Oversight Prgm:	Local Oversight Program UST				
Oversight Prgm:	LOP				
Review Date:	2/28/1995				
Stop Date:	2/28/1995				
Work Suspended N					
Responsible Party/BLANK RP					
RP Address:	Not reported				
Global Id:	T0600101879				
Org Name:	Not reported				
Contact Person:	Not reported				
MTBE Conc:	0				
Mtbe Fuel:	1				
Water System Name:	Not reported				
Well Name:	Not reported				
Distance To Lust:	Not reported				
Waste Discharge Global ID:	Not reported				
Waste Disch Assigned Name:	Not reported				
CORTESE:					
Reg Id:	01-2034				
Region:	CORTESE				
Reg By:	Leaking Underground Storage Tanks				
268 SW 1/2-1 4933 R. Lower	ST ALBANS SENIOR CENTER 1-80 FRONTAGE ROAD, NORTH OF POWELL EMERYVILLE, CA 94608	Cal-Sites 8102008252 N/A	CHAPMAN PROPERTY 1400 53RD ST EMERYVILLE, CA 94608	LUST Cortese	8102858741 N/A
CAL-SITES: Facility ID: 01580001 Status: REFOA - DOES NOT REQUIRE DTSC ACTION OR OVERTSIE ACTIVITY. REFERED TO OTHER AGENCY LEAD					

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

CHAPMAN PROPERTY (Continued)

How Stopped: Close Tank
Interim: Not reported
Leak Cause: Unknown
Leak Source: Unknown
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.
Priority: Not reported
Local Case #: 801
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgm: Local Oversight Program UST
Oversight Prgm: LOP
Review Date: 10/14/1997
Stop Date: 9/5/1996
Work Suspended: N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T0600102062
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mtbe Fuel: 1
Water System Name: Not reported
Well Name: Not reported
Distance To Lst: 10691.9788835489571184294685
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

CORTESE:

Reg Id: 01-2246
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

BJ270
NW 2427 4TH ST.
1/2-1 BERKELEY, CA
5058 ft.
Lower Site 1 of 2 In cluster BJ

CHMIRS:

DES Control Number:	9990027	DOT ID:	Not reported
DOT Hazard Class:	Not Reported		
Chemical Name:	ALUMINUM SHAVINGS		
Extent of Release:	Not reported		
CAS Number:	Not reported	Quantity Released:	2.5
Environmental Contamination:	Ground	Property Use:	Industrial, Utility
Incident Date:	21-JAN-88	Date Completed:	21-JAN-88
Time Completed:			
Physical State Stored:	Solid		
Physical State Released:	Solid		
Release Unit:	Lbs.		
Container Description:	Not reported		
Container Type:	08		

CHMIRS S100260518
N/A

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

(Continued)

Container Material: No Container
Level Of Container: 10
Container Capacity: Not reported
Container Capacity Units (code): Not reported
Extent Of Release (code): 5
Agency Id Number: 1015
Agency Incident Number: 80517
OES Incident Number: 9990027
Time Notified: 1119
Surrounding Area: 600
Estimated Temperature: 55
Property Management: P
More Than Two Substances Involved?: Not reported
Special Studies 1: Not reported
Special Studies 2: Not reported
Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
Responding Agency Personnel # Of Injuries: Not reported
Responding Agency Personnel # Of Fatalities: Not reported
Resp Agency Personnel # Of Decontaminated: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicles Id Number: Not reported
CA/DOT/PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: JOHN ANDERSON
Report Date: 21-JAN-88
Comments: No
Facility Telephone Number: 415 644-8789

271
North
1/2-1
5081 ft.
Higher

CHASE PROPERTY
2368 78 SAN PABLO AVE
BERKELEY, CA 94704

LUST S101306330
Corse N/A

State LUST:
Cross Street: Not reported
Qty Leaked: Not reported
Case Number: 01-0305
Reg Board: San Francisco Bay Region
Chemical: Diesel
Lead Agency: Local Agency
Local Agency: 01020
Case Type: Other ground water affected
Status: Preliminary site assessment workplan submitted
County: Alameda
Abate Method: No Action Taken - no action has as yet been taken at the site
Review Date: 2/1/1990 Confirm Leak: 2/1/1990
Workplan: Not reported Prelim Assess: Not reported
Pollution Char: Not reported Remed Plan: Not reported
Remed Action: Not reported Monitoring: Not reported
Close Date: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

CHASE PROPERTY (Continued)

Release Date: 4/13/1988
Cleanup Fund Id: Not reported
Discover Date: 4/13/1988
Enforcement Ct: Not reported
Enf Type: Not reported
Enter Date: 7/21/1991
Funding: Federal Funds
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank
Interim: No
Leak Cause: Structure Failure
Leak Source: Tank
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Not Required to be Tested.
Priority: Not reported
Local Case #: 01-0305
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgm: Local Implementing Agency UST (includes non-LOP cases within LOP jurisdiction)
Oversight Prgm: LIA
Review Date: 7/28/1988
Stop Date: 4/13/1988
Work Suspended: N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T0600100283
Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mtbe Fuel: 0
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 5409.9750499813427385041825036
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

LUST Region 2:

Region: 2
Facility Id: 01-0305
Entered Date: 07/21/1991
Facility Status: Preliminary site assessment workplan submitted
Maximum Soil Concentration: 0
Maximum Groundwater Impact: 140
County: Alameda
Current Benzene: Not reported
MTBE Detected in GW: 140
MTBE Detected in Soil: Not reported
MTBE: 0
MTBE Qualify: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

CHASE PROPERTY (Continued)

CORTESE:
Reg Id: 01-0305
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

BJ272
NW
12-1
5089 R.
Lower

CHMIRS S100274848
N/A

Site 2 of 2 In cluster BJ

CHMIRS:
OES Control Number: 6905306 DOT ID: Not reported
DOT Hazard Class: Not Reported
Chemical Name: PROPYLENE GLYCOL
Extent of Release: Not reported
CAS Number: 57-55-6 Quantity Released: 1
Environmental Contamination: Ground Property Use: Hazmat Chemical Manufacturing
Incident Date: 18-MAR-89 Date Completed: 18-MAR-89
Time Completed: 1035
Physical State Stored: Liquid
Physical State Released: Liquid
Release Unit: Gallons
Container Description: 2
Container Type: 04
Container Material: Plastic Fiberglass , Rigid
Level Of Container: Ground Level
Container Capacity: 5
Container Capacity Units (code): 2
Extent Of Release (code): 7
Agency Id Number: 1015
Agency Incident Number: 92138
OES Incident Number: 6905306
Time Notified: 706
Surrounding Area: 982
Estimated Temperature: 50
Property Management: P
More Than Two Substances Involved?: Not reported
Special Studies 1: Not reported
Special Studies 2: Not reported
Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
Responding Agency Personnel # Of Injuries: 0
Responding Agency Personnel # Of Fatalities: 0
Resp Agcy Personnel # Of Decontaminated: 0
Others Number Of Decontaminated: 0
Others Number Of Injuries: 0
Others Number Of Fatalities: 0
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA/DOT/PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: BRITT JOHNSON
Report Date: 18-MAR-89

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

(Continued)

Comments : Not reported
Facility Telephone Number : 415 844-6789

S100274848

273 MAXWELL CAMERON
NNE 1338 CHANNING WAY
1/2-1 BERKELEY, CA 94702
5191 ft. Higher

HAZNET S103879644
LUST N/A
Cortese

State LUST:
Cross Street: Not reported
City Leaked: Not reported
Case Number: 01-2478
Reg Board: San Francisco Bay Region
Chemical: Gasoline
Lead Agency: Local Agency
Local Agency: 01020
Case Type: Undefined
Status: Signed off, remedial action completed or deemed unnecessary
County: Alameda
Review Date: Not reported Confirm Leak: Not reported
Workplan: Not reported Prelim Assess: Not reported
Pollution Char: Not reported Remed Plan: Not reported
Remed Action: Not reported Monitoring: Not reported

Closure Date: 6/29/1999
Release Date: 1/1/1999
Cleanup Fund Id: Not reported
Discover Date: 4/1/1999
Enforcement Dt: Not reported
Enf Type: Not reported
Enter Date: 9/8/1999
Funding: Not reported
Staff Initials: UNK
How Discovered: Tank Closure
How Stopped: Close Tank
Interim: Not reported
Leak Cause: Unknown
Leak Source: Unknown
MTBE Date: Not reported
Max MTBE GW: Not reported
MTBE Tested: Site NOT Tested for MTBE. Includes Unknown and Not Analyzed.
Priority: Not reported
Local Case #: 01-2478
Beneficial: Not reported
Staff: CTH
GW Qualifies: Not reported
Max MTBE Soil: Not reported
Soil Qualifies: Not reported
Hydr Basin #: Not reported
Operator: Not reported
Oversight Prgm: Local Implementing Agency UST (Includes non-LOP cases within LOP jurisdiction)
Oversight Prgm: LIA
Review Date: 9/8/1999
Stop Date: 4/1/1999
Work Suspended N
Responsible Party: BLANK RP
RP Address: Not reported
Global Id: T0800102281

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

MAXWELL CAMERON (Continued)

Org Name: Not reported
Contact Person: Not reported
MTBE Conc: 0
Mitbe Fuel: 1
Water System Name: Not reported
Well Name: Not reported
Distance To Lust: 4014.2420881198244839989855067
Waste Discharge Global ID: Not reported
Waste Disch Assigned Name: Not reported

LUST Region 2:
Region: 2
Facility Id: 01-2478
Entered Date: 09/08/1999
Facility Status: Signed off, remedial action completed or deemed unnecessary
Maximum Soil Concentration: 0
Maximum Groundwater Impact: 0
County: Alameda
Current Benzene: Not reported
MTBE Detected in GW: No
MTBE Detected in Soil: Not reported
MTBE: 0
MTBE Qualify: Not reported

HAZNET:
Gepaid: CAC001411224
Tepaid: CAD009460392
Gen County: 1
Tsd County: 7
Tons: .5000
Category: Other empty containers 30 gallons or more
Dispose Method: Recycler
Contact: MAXWELL CAMERON
Telephone: (000) 000-0000
Mailing Address: 153 NO 78TH ST
SEATTLE, WA 98103
County: 1

Gepaid: CAC001411224
Tepaid: CAD009452857
Gen County: 1
Tsd County: San Mateo
Tons: .6255
Category: Unspecified oil-containing waste
Dispose Method: Recycler
Contact: MAXWELL CAMERON
Telephone: (000) 000-0000
Mailing Address: 153 NO 78TH ST
SEATTLE, WA 98103
County: 1

CORTESE:
Reg Id: 01-2478
Region: CORTESE
Reg By: Leaking Underground Storage Tanks

274
SSW
1/2-1
5191 ft.
Lower

SHELLMOUND VENTURE PROJECT
SHELLMOUND STREET
EMERYVILLE, CA 94608

Cal-Sites S102008193
DEED N/A

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

SHELLMOUND VENTURE PROJECT (Continued)

S102668193

CA DEEDS:
Facility Id: 1330039
Number of Deeds: 1

CAL-SITES:
Facility ID 01330039
Status: CERT - CERTIFIED AS HAVING BEEN REMEDIED SATISFACTORILY UNDER DTSC
OVERSIGHT
Status Date: 04/17/1998
Lead: DTSC
Region: 2 - BERKELEY
Branch: NC - NORTH COAST
File Name: Not reported
Status Name: CERTIFIED
Lead Agency: DEPT OF TOXIC SUBSTANCES CONTROL Not reported
NPL: Not Listed
SIC: 33 MANU - PRIMARY METAL INDUSTRIES
Facility Type: VOLUNTARY CLEANUP PROGRAM
Type Name: VCP
Staff Member Responsible for Site: Not reported
Supervisor Responsible for Site: UNAKASHI
Region Water Control Board: SF - SAN FRANCISCO BAY
Access: Controlled
Cortese: C
Hazardous Ranking Score: Not reported
Date Site Hazard Ranked: Not reported
Groundwater Contamination: Confirmed
No. of Contamination Sources: 3
Lat/Long: 0° 0' 0.00" / 0° 0' 0.00"
Lat/long Method: Not reported
State Assembly District Code: 14
State Senate District: 09

The CAL-SITES database may contain additional details for this site.
Please contact your EDR Account Executive for more information.

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

INTERSTATE HIGHWAY 80/EMERYVILLE (Continued)

S102564432

Access: Controlled
Cortese: C
Hazardous Ranking Score: Not reported
Date Site Hazard Ranked: Not reported
Groundwater Contamination: Confirmed
No. of Contamination Sources: 0
Lat/Long: 0° 0' 0.00" / 0° 0' 0.00"
Lat/long Method: Not reported
State Assembly District Code: 14
State Senate District: 09

The CAL-SITES database may contain additional details for this site.
Please contact your EDR Account Executive for more information.

275 INTERSTATE HIGHWAY 80/EMERYVILLE
SSW INTERSTATE 80
1/2-1 EMERYVILLE, CA 94608
5270 ft.
Lower

Cali-Sites S102564432
W/A

CAL-SITES:
Facility ID 01990020
Status: VCP - VOLUNTARY CLEANUP PROGRAM (VCP)
Status Date: 06/01/1993
Lead: DTSC
Region: 2 - BERKELEY
Branch: NC - NORTH COAST
File Name: CYPRESS FREEWAY/CONTRACT "G"
Status Name: VOLUNTARY CLEANUP PROGRAM
Lead Agency: DEPT OF TOXIC SUBSTANCES CONTROL Not reported
NPL: Not Listed
SIC: 99 NONCLASSIFIABLE ESTABLISHMENTS
Facility Type: VOLUNTARY CLEANUP PROGRAM
Type Name: VCP
Staff Member Responsible for Site: Not reported
Supervisor Responsible for Site: UNAKASHI
Region Water Control Board: SF - SAN FRANCISCO BAY

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
COUNTY	U003713415	IDEAL PAINT CO., INC	2479 MARIN STREET	94608	LUST, UST
ALBANY	S103622177	METRIC MOTION	1085 B EASTSHORE HIGHWAY	94710	HAZNET
ALBANY	S103622181	D&M AUTO BODY SHOP	1085 EASTSHORE HIGHWAY # A	94710	HAZNET
ALBANY	S104583065		1081 B5 EASTSHORE HIGHWAY	94710	LUST
ALBANY	S104579804	STEVES AUTO CARE	1057 EAST SHORE HWY	94710	HAZNET
ALBANY	S105085802	TERRANOVA INDUSTRIES	1025 E SHORE HWY	94710	HAZNET
BERKELEY	1000857020	CALTRANS BERKELEY	180 8TH ASHBY AVE AND GILMAN	94710	RCRIS-SOG, FINDS
BERKELEY	U001599657	O.C. JONES AND SONS (BACK YARD	JONES STREET	94710	HIST UST
BERKELEY	S103643488	EXXON CO USA #78465	2300 SAN PABLO AVE/BANCROFT	94702	HAZNET
BERKELEY	S104233044	BERKELEY BUSINESS CENTER	2900 42 SAN PABLO AVE	94702	LUST, Corse
BERKELEY	S105194169	SHELL	1580 SAN PABLO AVE	94702	LUST
EMERYVILLE	S103770856	13RD STREET TRUNK SEWER PROJECT	63RD STREET	94608	Cal-Sites
EMERYVILLE	S104585971	CITY OF EMERYVILLE /PUBLICWORKS	64TH STREET / ALCOSTE	94608	HAZNET
EMERYVILLE	S104241794	UNKNOWN	64TH / 65TH ST		CA SLIC
EMERYVILLE	U001599266	DELTA LINES.	65TH	94608	HIST UST
EMERYVILLE	S105194689	UNKNOWN	3707 BAY ST		LUST
EMERYVILLE	S105482380		5801 BAY ST		LUST
EMERYVILLE	S105483276		6707 BAY ST		LUST
EMERYVILLE	S103681492	MARKET PLACE MARTIN COMPANY	CHRISTIE AVE		LUST, CA SLIC
EMERYVILLE	S102008194	SHELLMOULD STREET	4300 EASTSHORE HIGHWAY	94608	Cal-Sites, Corse, DEED
EMERYVILLE	S103393753	IKEA (FORMER BARBARY COAST)	4300 EASTSHORE HIGHWAY	94608	Cal-Sites, DEED
EMERYVILLE	S105483208		4300 EASTSHORE HWY	94608	LUST
EMERYVILLE	U001599287	JUDSON STEEL CORPORATION	4200 EASTSHORE HWY	94608	HIST UST
EMERYVILLE	U001599302	PITTS NATIONWIDE, INC.	5500 EASTSHORE HWY	94608	HIST UST
EMERYVILLE	U001599310	RYDERPIE NATIONWIDE, INC.	5500 EASTSHORE HWY	94608	HIST UST
EMERYVILLE	1001115414	CHIRON CORPORATION	HOLLIS STREET	94608	RCRIS-SOG, FINDS, HAZNET
EMERYVILLE	S105085390	CITY OF EMERYVILLE	HOLLIS ST BETWEEN 53RD / 45T	94608	HAZNET
EMERYVILLE	S105483369		5060 HOLLIS ST		LUST
EMERYVILLE	S103678638	CALTRANS POWELL ST PROJECT	EB 18TH BTWN POWELL / ASHBY	94608	HAZNET
EMERYVILLE	1003073276	SOUTHERN PACIFIC RAILWAY-EMERYVILL	WEST OF 4525 HOLLIS STREET	94608	CERCUS
EMERYVILLE	S104398737	ELECTRO COATINGS INC	1401 21 PARK AVE	94608	LUST, Corse
EMERYVILLE	U003063632	DAYS INN HOTEL	1603 POWELL ST	94608	Corse, LOS ANGELES CO. HMS
EMERYVILLE	S104733702	GOLDSMITH LATHROP	5813 15 SHELLMOULD ST	94608	LUST, Corse
EMERYVILLE	S105482394		5813 15 SHELLMOULD ST	94608	LUST
EMERYVILLE	S103978747	MYERS CONTAINER CORP	4300 E SHORE HWY	94608	HAZNET
EMERYVILLE	S104233653	EMERY BAY MARKETPLACE	UNKNOWN 84TH / CHRISTIE	94608	LUST, Corse
EMERYVILLE	S105194680	ANOTHER TREE EMERYVILLE PROJECT	UNKNOWN POWELL ST / SHELLMOU	94608	LUST, Corse
EMERYVILLE	S105194686	UNKNOWN	UNKNOWN 84TH / 85TH ST	94608	LUST
OAKLAND	S103654169	EQUILON ENTERPRISES LLC	3420 SAN PABLO AVE/85TH	94608	HAZNET
OAKLAND	S103993009	UC BERKELEY MERCHANT BLDG	6701 SAN PABLO AVE 2ND FLOOR	94608	HAZNET
OAKLAND	S104579109	UC BERKELEY-MERCHANT	6701 SAN PABLO AVE 1ST FL	94608	HAZNET
OAKLAND	S105483702		2901 SAN PABLO AVE	94608	LUST
OAKLAND	1004642263	OLIVER RUBBER COMPANY	1200 65TH ST	94608	LUST, FTTS

TC834561.1s Page 277

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
OAKLANDS	S100274838		3455 ETIE STREET	94608	HAZNET, CHMIRS
OROVILLE	U000075899	OROVILLE TEXACO	2639 ORO DAM	94608	Notify 85, LUST, Corse
SAN LEANDRO	S102621091	DTSC/SAN LEANDRO PLUME	SAN LEANDRO PLUME	94710	HAZNET

TC834561.1s Page 278

EPA Waste Codes Addendum

Code	Description
D001	IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.
D002	A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
D004	ARSENIC
D006	CADMIUM
D007	CHROMIUM
D008	LEAD

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Elapsed ASTM days: Provides confirmation that this EDR report meets or exceeds the 90-day updating requirement of the ASTM standard.

FEDERAL ASTM STANDARD RECORDS

NPL: National Priority List

Source: EPA
Telephone: N/A

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 04/22/02
Date Made Active at EDR: 08/21/02
Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 05/08/02
Elapsed ASTM days: 46
Date of Last EDR Contact: 05/08/02

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-584-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 6
Telephone: 214-655-6659

EPA Region 3
Telephone 215-814-5418

EPA Region 8
Telephone: 303-312-6774

EPA Region 4
Telephone 404-562-8033

Proposed NPL: Proposed National Priority List Sites

Source: EPA
Telephone: N/A

Date of Government Version: 02/26/02
Date Made Active at EDR: 08/21/02
Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 05/08/02
Elapsed ASTM days: 46
Date of Last EDR Contact: 05/08/02

CERCLIS: Comprehensive Environmental Response, Compensation, and Liability Information System

Source: EPA
Telephone: 703-413-0223

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 05/15/02
Date Made Active at EDR: 08/08/02
Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 08/24/02
Elapsed ASTM days: 45
Date of Last EDR Contact: 08/24/02

CERCLIS-NFRAP: CERCLIS No Further Remedial Action Planned

Source: EPA
Telephone: 703-413-0233

As of February 1995, CERCLIS sites designated "No Further Remedial Action Planned" (NFRAP) have been removed from CERCLIS. NFRAP sites may be sites where, following an initial investigation, no contamination was found, contamination was removed quickly without the need for the site to be placed on the NPL, or the contamination was not serious enough to require Federal Superfund action or NPL consideration. EPA has removed approximately 25,000 NFRAP sites to lift the unintended barriers to the redevelopment of these properties and has archived them as historical records so EPA does not necessarily repeat the investigations in the future. This policy change is part of the EPA's Brownfields Redevelopment Program to help cities, states, private investors and affected citizens to promote economic redevelopment of unproductive urban sites.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 05/15/02
 Date Made Active at EDR: 08/06/02
 Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 06/24/02
 Elapsed ASTM days: 45
 Date of Last EDR Contact: 06/24/02

CORRACTS: Corrective Action Report
 Source: EPA
 Telephone: 800-424-9346

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 05/02/02
 Date Made Active at EDR: 07/15/02
 Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 05/06/02
 Elapsed ASTM days: 70
 Date of Last EDR Contact: 06/10/02

RCRIS: Resource Conservation and Recovery Information System
 Source: EPA/NTIS
 Telephone: 800-424-9346

Resource Conservation and Recovery Information System. RCRIS includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA).

Date of Government Version: 06/10/02
 Date Made Active at EDR: 07/15/02
 Database Release Frequency: Varies

Date of Data Arrival at EDR: 06/20/02
 Elapsed ASTM days: 25
 Date of Last EDR Contact: 06/20/02

ERNS: Emergency Response Notification System
 Source: EPA/NTIS
 Telephone: 202-280-2342

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 12/31/01
 Date Made Active at EDR: 07/15/02
 Database Release Frequency: Varies

Date of Data Arrival at EDR: 07/02/02
 Elapsed ASTM days: 13
 Date of Last EDR Contact: 04/29/02

FEDERAL ASTM SUPPLEMENTAL RECORDS

BRS: Biennial Reporting System
 Source: EPA/NTIS
 Telephone: 800-424-9346

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/99
 Database Release Frequency: Biennially

Date of Last EDR Contact: 06/17/02
 Date of Next Scheduled EDR Contact: 09/16/02

CONSENT: Superfund (CERCLA) Consent Decrees

Source: EPA Regional Offices
 Telephone: N/A

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: N/A
 Database Release Frequency: Varies

Date of Last EDR Contact: N/A
 Date of Next Scheduled EDR Contact: N/A

ROD: Records Of Decision

Source: EPA
 Telephone: 703-416-0223

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 12/21/01
 Database Release Frequency: Annually

Date of Last EDR Contact: 07/08/02
 Date of Next Scheduled EDR Contact: 10/07/02

DELISTED NPL: National Priority List Deletions

Source: EPA
 Telephone: N/A

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 04/22/02
 Database Release Frequency: Quarterly

Date of Last EDR Contact: 05/08/02
 Date of Next Scheduled EDR Contact: 08/05/02

FINDS: Facility Index System/Facility Identification Initiative Program Summary Report

Source: EPA
 Telephone: N/A

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Dockets used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 03/21/02
 Database Release Frequency: Quarterly

Date of Last EDR Contact: 07/08/02
 Date of Next Scheduled EDR Contact: 10/07/02

HMIRS: Hazardous Materials Information Reporting System

Source: U.S. Department of Transportation
 Telephone: 202-368-4555

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 12/31/01
 Database Release Frequency: Annually

Date of Last EDR Contact: 04/22/02
 Date of Next Scheduled EDR Contact: 07/22/02

MLTS: Material Licensing Tracking System

Source: Nuclear Regulatory Commission
 Telephone: 301-415-7189

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/12/02
 Database Release Frequency: Quarterly

Date of Last EDR Contact: 07/08/02
 Date of Next Scheduled EDR Contact: 10/07/02

MINES: Mines Master Index File

Source: Department of Labor, Mine Safety and Health Administration
 Telephone: 303-231-5959

Date of Government Version: 08/05/02
 Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 07/01/02
 Date of Next Scheduled EDR Contact: 09/30/02

NPL LIENS: Federal Superfund Liens

Source: EPA
 Telephone: 205-584-4287

Federal Superfund Liens. Under the authority granted the USEPA by the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA) of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner receives notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/15/91
 Database Release Frequency: No Update Planned

PADS: PCB Activity Database System
 Source: EPA
 Telephone: 202-564-3887
 PCB Activity Database. PADS identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 03/01/02
 Database Release Frequency: Annually

Date of Last EDR Contact: 05/28/02
 Date of Next Scheduled EDR Contact: 08/26/02

RAATS: RCRA Administrative Action Tracking System

Source: EPA
 Telephone: 202-564-4104
 RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/95
 Database Release Frequency: No Update Planned

Date of Last EDR Contact: 05/14/02
 Date of Next Scheduled EDR Contact: 08/12/02

TRIS: Toxic Chemical Release Inventory System

Source: EPA
 Telephone: 202-260-1531
 Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/99
 Database Release Frequency: Annually

Date of Last EDR Contact: 06/10/02
 Date of Next Scheduled EDR Contact: 09/09/02

TSCA: Toxic Substances Control Act

Source: EPA
 Telephone: 202-260-5521
 Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/98
 Database Release Frequency: Every 4 Years

Date of Last EDR Contact: 06/24/02
 Date of Next Scheduled EDR Contact: 09/23/02

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

Source: EPA
 Telephone: 202-564-2501
 Date of Government Version: 04/25/02
 Database Release Frequency: Quarterly

Date of Last EDR Contact: 07/03/02
 Date of Next Scheduled EDR Contact: 09/23/02

SSTS: Section 7 Tracking Systems

Source: EPA
 Telephone: 202-564-5008
 Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/00
 Database Release Frequency: Annually

Date of Last EDR Contact: 07/19/02
 Date of Next Scheduled EDR Contact: 10/21/02

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
 Source: EPA/Office of Prevention, Pesticides and Toxic Substances
 Telephone: 202-564-2501

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/25/02
 Database Release Frequency: Quarterly

Date of Last EDR Contact: 07/03/02
 Date of Next Scheduled EDR Contact: 09/23/02

STATE OF CALIFORNIA ASTM STANDARD RECORDS

AWP: Annual Workplan Sites
 Source: California Environmental Protection Agency
 Telephone: 916-323-3400

Known Hazardous Waste Sites. California DTSC's Annual Workplan (AWP), formerly BEP, identifies known hazardous substance sites targeted for cleanup.

Date of Government Version: 07/05/02
 Date Made Active at EDR: 08/12/02
 Database Release Frequency: Annually

Date of Data Arrival at EDR: 07/08/02
 Elapsed ASTM days: 35
 Date of Last EDR Contact: 07/08/02

CAL-SITES: Calsites Database
 Source: Department of Toxic Substance Control
 Telephone: 916-323-3400

The Calsites database contains potential or confirmed hazardous substance release properties. In 1996, California EPA reevaluated and significantly reduced the number of sites in the Calsites database.

Date of Government Version: 10/01/00
 Date Made Active at EDR: 11/22/00
 Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 10/30/00
 Elapsed ASTM days: 23
 Date of Last EDR Contact: 07/08/02

CHMIRS: California Hazardous Material Incident Report System

Source: Office of Emergency Services
 Telephone: 916-845-8400
 California Hazardous Material Incident Reporting System. CHMIRS contains information on reported hazardous material incidents (accidental releases or spills).

Date of Government Version: 12/31/94
 Date Made Active at EDR: 04/24/95
 Database Release Frequency: No Update Planned

Date of Data Arrival at EDR: 03/13/95
 Elapsed ASTM days: 42
 Date of Last EDR Contact: 05/26/02

CORTESE: "Cortese" Hazardous Waste & Substances Sites List

Source: CAL EPA/Office of Emergency Information
 Telephone: 916-323-8100
 The sites for the list are designated by the State Water Resource Control Board (LUST), the Integrated Waste Board (SWFLS), and the Department of Toxic Substances Control (Cal-Sites).

Date of Government Version: 04/01/01
 Date Made Active at EDR: 07/26/01
 Database Release Frequency: Varies

Date of Data Arrival at EDR: 05/29/01
 Elapsed ASTM days: 58
 Date of Last EDR Contact: 04/30/02

NOTIFY 65: Proposition 65 Records

Source: State Water Resources Control Board
 Telephone: 916-445-3848
 Proposition 65 Notification Records. NOTIFY 65 contains facility notifications about any release which could impact drinking water and thereby expose the public to a potential health risk.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/21/93
 Date Made Active at EDR: 11/19/93
 Database Release Frequency: No Update Planned

TOXIC PITS: Toxic Pits Cleanup Act Sites
 Source: State Water Resources Control Board
 Telephone: 916-227-4384

Toxic PITS Cleanup Act Sites. TOXIC PITS identifies sites suspected of containing hazardous substances where cleanup has not yet been completed.

Date of Government Version: 07/01/95
 Date Made Active at EDR: 09/26/95
 Database Release Frequency: No Update Planned

SWF/LF (SWIS): Solid Waste Information System
 Source: Integrated Waste Management Board
 Telephone: 916-341-6320

Active, Closed and Inactive Landfills. SWF/LF records typically contain an inventory of solid waste disposal facilities or landfills. These may be active or inactive facilities or open dumps that failed to meet RCRA Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 06/14/02
 Date Made Active at EDR: 07/19/02
 Database Release Frequency: Quarterly

WMUDS/SWAT: Waste Management Unit Database
 Source: State Water Resources Control Board
 Telephone: 916-227-4448

Waste Management Unit Database System. WMUDS is used by the State Water Resources Control Board staff and the Regional Water Quality Control Boards for program tracking and inventory of waste management units. WMUDS is composed of the following databases: Facility Information, Scheduled Inspections Information, Waste Management Unit Information, SWAT Program Information, SWAT Report Summary Information, SWAT Report Summary Data, Chapter 15 (formerly Subchapter 15) Information, Chapter 15 Monitoring Parameters, TPCA Program Information, RCRA Program Information, Closure Information, and Interested Parties Information.

Date of Government Version: 04/01/00
 Date Made Active at EDR: 05/10/00
 Database Release Frequency: Quarterly

LUST: Leaking Underground Storage Tank Information System
 Source: State Water Resources Control Board
 Telephone: 916-341-5740

Leaking Underground Storage Tank Incident Reports. LUST records contain an inventory of reported leaking underground storage tank incidents. Not all states maintain these records, and the information stored varies by state.

Date of Government Version: 01/17/02
 Date Made Active at EDR: 02/12/02
 Database Release Frequency: Quarterly

CA BOND EXP. PLAN: Bond Expenditure Plan
 Source: Department of Health Services
 Telephone: 916-255-2118

Department of Health Services developed a site-specific expenditure plan as the basis for an appropriation of Hazardous Substance Cleanup Bond Act funds. It is not updated.

Date of Government Version: 01/01/89
 Date Made Active at EDR: 08/02/94
 Database Release Frequency: No Update Planned

Date of Data Arrival at EDR: 11/01/93
 Elapsed ASTM days: 16
 Date of Last EDR Contact: 04/22/02

Date of Data Arrival at EDR: 08/30/95
 Elapsed ASTM days: 27
 Date of Last EDR Contact: 05/06/02

Date of Data Arrival at EDR: 06/17/02
 Elapsed ASTM days: 32
 Date of Last EDR Contact: 06/17/02

Date of Data Arrival at EDR: 04/10/00
 Elapsed ASTM days: 30
 Date of Last EDR Contact: 06/10/02

Date of Data Arrival at EDR: 01/21/02
 Elapsed ASTM days: 22
 Date of Last EDR Contact: 07/09/02

Date of Data Arrival at EDR: 07/27/94
 Elapsed ASTM days: 8
 Date of Last EDR Contact: 05/31/94

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CA UST:

UST: Active UST Facilities
 Source: SWRCB
 Telephone: 916-341-5700
 Active UST facilities gathered from the local regulatory agencies

Date of Government Version: 01/17/02
 Date Made Active at EDR: 02/12/02
 Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 01/21/02
 Elapsed ASTM days: 22
 Date of Last EDR Contact: 07/09/02

CA FID UST: Facility Inventory Database
 Source: California Environmental Protection Agency
 Telephone: 916-445-8532

The Facility Inventory Database (FID) contains a historical listing of active and inactive underground storage tank locations from the State Water Resource Control Board. Refer to local/county source for current data.

Date of Government Version: 10/31/94
 Date Made Active at EDR: 09/29/95
 Database Release Frequency: No Update Planned

Date of Data Arrival at EDR: 09/05/95
 Elapsed ASTM days: 24
 Date of Last EDR Contact: 12/28/96

HIST UST: Hazardous Substance Storage Container Database
 Source: State Water Resources Control Board
 Telephone: 916-341-5700

The Hazardous Substance Storage Container Database is a historical listing of UST sites. Refer to local/county source for current data.

Date of Government Version: 10/15/90
 Date Made Active at EDR: 02/12/91
 Database Release Frequency: No Update Planned

Date of Data Arrival at EDR: 01/25/91
 Elapsed ASTM days: 18
 Date of Last EDR Contact: 07/26/01

STATE OF CALIFORNIA ASTM SUPPLEMENTAL RECORDS

AST: Aboveground Petroleum Storage Tank Facilities
 Source: State Water Resources Control Board
 Telephone: 916-227-4382
 Registered Aboveground Storage Tanks.

Date of Government Version: 05/21/02
 Database Release Frequency: Quarterly

Date of Last EDR Contact: 05/06/02
 Date of Next Scheduled EDR Contact: 08/05/02

CLEANERS: Cleaner Facilities
 Source: Department of Toxic Substance Control
 Telephone: 916-225-0873
 A list of drycleaner related facilities that have EPA ID numbers. These are facilities with certain SIC codes:
 power laundries, family and commercial; garment pressing and cleaner's agents; linen supply; coin-operated laundries and cleaning; drycleaning plants, except rugs; carpet and upholster cleaning; industrial laundries; laundry and garment services.

Date of Government Version: 03/18/02
 Database Release Frequency: Annually

Date of Last EDR Contact: 07/06/02
 Date of Next Scheduled EDR Contact: 10/07/02

CA WDS: Waste Discharge System
 Source: State Water Resources Control Board
 Telephone: 916-657-1571
 Sites which have been issued waste discharge requirements.

Date of Government Version: 08/17/02
 Database Release Frequency: Quarterly

Date of Last EDR Contact: 06/24/02
 Date of Next Scheduled EDR Contact: 09/23/02

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

DEED: List of Deed Restrictions
Source: Department of Toxic Substances Control
Telephone: 916-323-3400

The use of recorded land use restrictions is one of the methods the DTSC uses to protect the public from unsafe exposures to hazardous substances and wastes.

Date of Government Version: 07/05/02
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 07/06/02
Date of Next Scheduled EDR Contact: 10/07/02

HAZNET: Hazardous Waste Information System
Source: California Environmental Protection Agency
Telephone: 916-255-1136

Facility and Manifest Data. The data is extracted from the copies of hazardous waste manifests received each year by the DTSC. The annual volume of manifests is typically 700,000 - 1,000,000 annually, representing approximately 360,000 - 500,000 shipments. Data are from the manifests submitted without correction, and therefore many contain some invalid values for data elements such as generator ID, TSD ID, waste category, and disposal method.

Date of Government Version: 12/31/00
Database Release Frequency: Annually

Date of Last EDR Contact: 05/16/02
Date of Next Scheduled EDR Contact: 08/12/02

LOCAL RECORDS

ALAMEDA COUNTY:

Local Oversight Program Listing of UGT Cleanup Sites
Source: Alameda County Environmental Health Services
Telephone: 510-567-6700

Date of Government Version: 07/12/02
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 05/01/02
Date of Next Scheduled EDR Contact: 07/29/02

Underground Tanks
Source: Alameda County Environmental Health Services
Telephone: 510-567-6700

Date of Government Version: 06/01/02
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 05/01/02
Date of Next Scheduled EDR Contact: 07/29/02

CONTRA COSTA COUNTY:

Site List
Source: Contra Costa Health Services Department
Telephone: 925-646-2286

List includes sites from the underground tank, hazardous waste generator and business plan/2185 programs.

Date of Government Version: 06/05/02
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 06/03/02
Date of Next Scheduled EDR Contact: 09/02/02

FRESNO COUNTY:

CUPA Resources List
Source: Dept. of Community Health
Telephone: 559-445-3271

Certified Unified Program Agency. CUPA's are responsible for implementing a unified hazardous materials and hazardous waste management regulatory program. The agency provides oversight of businesses that deal with hazardous materials, operate underground storage tanks or aboveground storage tanks.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 04/01/02
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 04/30/02
Date of Next Scheduled EDR Contact: 06/12/02

KERN COUNTY:

Underground Storage Tank Sites & Tanks Listing
Source: Kern County Environment Health Services Department
Telephone: 661-862-8700

Kern County Sites and Tanks Listing.

Date of Government Version: 06/01/02
Database Release Frequency: Quarterly

Date of Last EDR Contact: 06/03/02
Date of Next Scheduled EDR Contact: 09/02/02

LOS ANGELES COUNTY:

List of Solid Waste Facilities
Source: La County Department of Public Works
Telephone: 818-458-5185

Date of Government Version: 11/09/99
Database Release Frequency: Varies

Date of Last EDR Contact: 05/20/02
Date of Next Scheduled EDR Contact: 06/19/02

City of El Segundo Underground Storage Tank
Source: City of El Segundo Fire Department
Telephone: 310-607-2239

Date of Government Version: 03/01/02
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 05/20/02
Date of Next Scheduled EDR Contact: 06/19/02

City of Long Beach Underground Storage Tank
Source: City of Long Beach Fire Department
Telephone: 562-570-2543

Date of Government Version: 05/30/02
Database Release Frequency: Annually

Date of Last EDR Contact: 05/30/02
Date of Next Scheduled EDR Contact: 06/26/02

City of Torrance Underground Storage Tank
Source: City of Torrance Fire Department
Telephone: 310-818-2973

Date of Government Version: 04/01/02
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 05/20/02
Date of Next Scheduled EDR Contact: 06/19/02

City of Los Angeles Landfills
Source: Engineering & Construction Division
Telephone: 213-473-7869

Date of Government Version: 03/01/02
Database Release Frequency: Varies

Date of Last EDR Contact: 06/19/02
Date of Next Scheduled EDR Contact: 09/16/02

HMS: Street Number List
Source: Department of Public Works
Telephone: 626-458-3517

Industrial Waste and Underground Storage Tank Sites.

Date of Government Version: 01/31/02
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 05/20/02
Date of Next Scheduled EDR Contact: 06/19/02

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Site Mitigation List
 Source: Community Health Services
 Telephone: 323-890-7806
 Industrial sites that have had some sort of spill or complaint.

Date of Government Version: 02/26/02
 Database Release Frequency: Annually

San Gabriel Valley Areas of Concern
 Source: EPA Region 8
 Telephone: 415-744-2407

San Gabriel Valley areas where VOC contamination is at or above the MCL as designated by region 8 EPA office.
 Date of Government Version: 12/31/98
 Database Release Frequency: No Update Planned

Date of Last EDR Contact: 05/20/02
 Date of Next Scheduled EDR Contact: 06/19/02

MARIN COUNTY:

Underground Storage Tank Sites
 Source: Public Works Department Waste Management
 Telephone: 415-490-6847

Currently permitted USTS in Marin County.
 Date of Government Version: 03/08/02
 Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 05/06/02
 Date of Next Scheduled EDR Contact: 06/05/02

NAPA COUNTY:

Sites With Reported Contamination
 Source: Napa County Department of Environmental Management
 Telephone: 707-253-4269

Date of Government Version: 04/01/02
 Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 07/01/02
 Date of Next Scheduled EDR Contact: 09/30/02

Closed and Operating Underground Storage Tank Sites
 Source: Napa County Department of Environmental Management
 Telephone: 707-253-4269

Date of Government Version: 04/01/02
 Database Release Frequency: Annually

Date of Last EDR Contact: 07/01/02
 Date of Next Scheduled EDR Contact: 09/30/02

ORANGE COUNTY:

List of Underground Storage Tank Cleanups
 Source: Health Care Agency
 Telephone: 714-834-3446

Orange County Underground Storage Tank Cleanups (LUST).
 Date of Government Version: 11/27/01
 Database Release Frequency: Quarterly

Date of Last EDR Contact: 06/10/02
 Date of Next Scheduled EDR Contact: 09/09/02

List of Underground Storage Tank Facilities
 Source: Health Care Agency
 Telephone: 714-834-3446

Orange County Underground Storage Tank Facilities (UST).

Date of Last EDR Contact: 06/10/02
 Date of Next Scheduled EDR Contact: 08/08/02

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 11/27/01
 Database Release Frequency: Quarterly

Date of Last EDR Contact: 06/10/02
 Date of Next Scheduled EDR Contact: 09/09/02

List of Industrial Site Cleanups
 Source: Health Care Agency
 Telephone: 714-834-3446
 Petroleum and non-petroleum spills.

Date of Government Version: 10/24/00
 Database Release Frequency: Annually

Date of Last EDR Contact: 06/10/02
 Date of Next Scheduled EDR Contact: 09/09/02

PLACER COUNTY:

Master List of Facilities
 Source: Placer County Health and Human Services
 Telephone: 530-899-7312

List includes aboveground tanks, underground tanks and cleanup sites.

Date of Government Version: 01/31/02
 Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 06/24/02
 Date of Next Scheduled EDR Contact: 09/23/02

RIVERSIDE COUNTY:

Listing of Underground Tank Cleanup Sites
 Source: Department of Public Health
 Telephone: 909-358-5055

Riverside County Underground Storage Tank Cleanup Sites (LUST).

Date of Government Version: 03/27/02
 Database Release Frequency: Quarterly

Date of Last EDR Contact: 04/22/02
 Date of Next Scheduled EDR Contact: 07/22/02

Underground Storage Tank Tank List
 Source: Health Services Agency
 Telephone: 909-358-5055

Date of Government Version: 03/01/02
 Database Release Frequency: Quarterly

Date of Last EDR Contact: 04/22/02
 Date of Next Scheduled EDR Contact: 07/22/02

SACRAMENTO COUNTY:

CS - Contaminated Sites
 Source: Sacramento County Environmental Management
 Telephone: 916-875-8406

Date of Government Version: 06/11/02
 Database Release Frequency: Quarterly

Date of Last EDR Contact: 05/06/02
 Date of Next Scheduled EDR Contact: 08/05/02

ML - Regulatory Compliance Master List
 Source: Sacramento County Environmental Management
 Telephone: 916-875-8406

Any business that has hazardous materials on site - hazardous material storage sites, underground storage tanks, waste generators.

Date of Government Version: 06/11/02
 Database Release Frequency: Quarterly

Date of Last EDR Contact: 05/06/02
 Date of Next Scheduled EDR Contact: 08/05/02

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SAN BERNARDINO COUNTY:

Hazardous Material Permits

Source: San Bernardino County Fire Department Hazardous Materials Division
Telephone: 909-387-3041

This listing includes underground storage tanks, medical waste handlers/generators, hazardous materials handlers, hazardous waste generators, and waste oil generators/handlers.

Date of Government Version: 06/27/02

Database Release Frequency: Quarterly

Date of Last EDR Contact: 06/10/02

Date of Next Scheduled EDR Contact: 09/09/02

SAN DIEGO COUNTY:

Solid Waste Facilities

Source: Department of Health Services
Telephone: 619-338-2209

San Diego County Solid Waste Facilities.

Date of Government Version: 08/01/00
Database Release Frequency: Varies

Date of Last EDR Contact: 05/29/02

Date of Next Scheduled EDR Contact: 08/26/02

Hazardous Materials Management Division Database

Source: Hazardous Materials Management Division
Telephone: 619-338-2268

The database includes: HE58 - This report contains the business name, site address, business phone number, establishment #1 permit number, type of permit, and the business status. HE17 - In addition to providing the same information provided in the HE58 listing, HE17 provides inspection dates, violations received by the establishment, hazardous waste generated, the quantity, method of storage, treatment/disposal of waste and the hauler, and information on underground storage tanks. Unauthorized Release List - Includes a summary of environmental contamination cases in San Diego County (underground tank cases, non-tank cases, groundwater contamination, and soil contamination are included.)

Date of Government Version: 03/31/02
Database Release Frequency: Quarterly

Date of Last EDR Contact: 07/08/02

Date of Next Scheduled EDR Contact: 10/07/02

SAN FRANCISCO COUNTY:

Local Oversight Facilities

Source: Department Of Public Health San Francisco County
Telephone: 415-252-3920

Date of Government Version: 06/12/02
Database Release Frequency: Quarterly

Date of Last EDR Contact: 06/10/02

Date of Next Scheduled EDR Contact: 09/09/02

Underground Storage Tank Information

Source: Department of Public Health
Telephone: 415-252-3920

Date of Government Version: 06/12/02
Database Release Frequency: Quarterly

Date of Last EDR Contact: 06/10/02

Date of Next Scheduled EDR Contact: 09/09/02

SAN MATEO COUNTY:

Fuel Leak List

Source: San Mateo County Environmental Health Services Division
Telephone: 650-363-1921

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 04/04/02
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 04/29/02
Date of Next Scheduled EDR Contact: 07/29/02

Business Inventory

Source: San Mateo County Environmental Health Services Division
Telephone: 650-363-1921

List includes Hazardous Materials Business Plan, hazardous waste generators, and underground storage tanks.

Date of Government Version: 05/01/02
Database Release Frequency: Annually

Date of Last EDR Contact: 07/15/02
Date of Next Scheduled EDR Contact: 10/14/02

SANTA CLARA COUNTY:

Fuel Leak Site Activity Report

Source: Santa Clara Valley Water District
Telephone: 408-265-2600

Date of Government Version: 01/03/02
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 07/01/02
Date of Next Scheduled EDR Contact: 09/30/02

Hazardous Material Facilities

Source: City of San Jose Fire Department
Telephone: 408-277-4659

Date of Government Version: 01/03/02
Database Release Frequency: Annually

Date of Last EDR Contact: 06/10/02
Date of Next Scheduled EDR Contact: 08/09/02

SOLANO COUNTY:

Leaking Underground Storage Tanks

Source: Solano County Department of Environmental Management
Telephone: 707-421-6770

Date of Government Version: 06/01/02
Database Release Frequency: Quarterly

Date of Last EDR Contact: 06/18/02
Date of Next Scheduled EDR Contact: 09/18/02

Underground Storage Tanks

Source: Solano County Department of Environmental Management
Telephone: 707-421-6770

Date of Government Version: 06/01/02
Database Release Frequency: Quarterly

Date of Last EDR Contact: 06/18/02
Date of Next Scheduled EDR Contact: 09/18/02

BONOMA COUNTY:

Leaking Underground Storage Tank Sites

Source: Department of Health Services
Telephone: 707-565-6585

Date of Government Version: 11/29/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 04/29/02
Date of Next Scheduled EDR Contact: 07/29/02

SUTTER COUNTY:

Underground Storage Tanks

Source: Sutter County Department of Agriculture
Telephone: 530-822-7500

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 07/01/01
 Database Release Frequency: Semi-Annually

VENTURA COUNTY:

Inventory of Illegal Abandoned and Inactive Sites
 Source: Environmental Health Division
 Telephone: 805-654-2813
 Ventura County Inventory of Closed, Illegal Abandoned, and Inactive Sites.
 Date of Government Version: 04/02/01
 Database Release Frequency: Annually

Listing of Underground Tank Cleanup Sites
 Source: Environmental Health Division
 Telephone: 805-654-2813
 Ventura County Underground Storage Tank Cleanup Sites (LUST).
 Date of Government Version: 05/08/02
 Database Release Frequency: Quarterly

Underground Tank Closed Sites List
 Source: Environmental Health Division
 Telephone: 805-654-2813
 Ventura County Operating Underground Storage Tank Sites (UST)/Underground Tank Closed Sites List.
 Date of Government Version: 05/24/01
 Database Release Frequency: Quarterly

Business Plan, Hazardous Waste Producers, and Operating Underground Tanks
 Source: Ventura County Environmental Health Division
 Telephone: 805-654-2813
 The BWVT list indicates by site address whether the Environmental Health Division has Business Plan (B), Waste Producer (W), and/or Underground Tank (T) information.
 Date of Government Version: 02/19/02
 Database Release Frequency: Quarterly

YOLO COUNTY:

Underground Storage Tank Comprehensive Facility Report
 Source: Yolo County Department of Health
 Telephone: 530-868-8646
 Date of Government Version: 05/01/02
 Database Release Frequency: Annually

California Regional Water Quality Control Board (RWQCB) LUST Records

LUST REG 1: Active Toxic Site Investigation
 Source: California Regional Water Quality Control Board North Coast (1)
 Telephone: 707-576-2220
 Del Norte, Humboldt, Lake, Mendocino, Modoc, Siskiyou, Sonoma, Trinity counties. For more current information, please refer to the State Water Resources Control Board's LUST database.
 Date of Government Version: 02/01/01
 Database Release Frequency: No Update Planned

Date of Last EDR Contact: 07/08/02
 Date of Next Scheduled EDR Contact: 10/07/02

Date of Last EDR Contact: 05/29/02
 Date of Next Scheduled EDR Contact: 08/26/02

Date of Last EDR Contact: 06/18/02
 Date of Next Scheduled EDR Contact: 09/18/02

Date of Last EDR Contact: 07/15/02
 Date of Next Scheduled EDR Contact: 10/14/02

Date of Last EDR Contact: 06/18/02
 Date of Next Scheduled EDR Contact: 09/18/02

Date of Last EDR Contact: 07/15/02
 Date of Next Scheduled EDR Contact: 10/14/02

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

LUST REG 2: Fuel Leak List
 Source: California Regional Water Quality Control Board San Francisco Bay Region (2)
 Telephone: 510-288-0457
 Date of Government Version: 07/01/02
 Database Release Frequency: Quarterly

LUST REG 3: Leaking Underground Storage Tank Database
 Source: California Regional Water Quality Control Board Central Coast Region (3)
 Telephone: 805-549-3147
 Date of Government Version: 05/22/02
 Database Release Frequency: Quarterly

LUST REG 4: Underground Storage Tank Leak List
 Source: California Regional Water Quality Control Board Los Angeles Region (4)
 Telephone: 213-266-8600
 Los Angeles, Ventura counties. For more current information, please refer to the State Water Resources Control Board's LUST database.
 Date of Government Version: 06/09/01
 Database Release Frequency: No Update Planned

LUST REG 5: Leaking Underground Storage Tank Database
 Source: California Regional Water Quality Control Board Central Valley Region (5)
 Telephone: 916-255-3125
 Date of Government Version: 07/01/02
 Database Release Frequency: Quarterly

LUST REG 6: Leaking Underground Storage Tank Case Listing
 Source: California Regional Water Quality Control Board Lahontan Region (6)
 Telephone: 916-542-5424
 For more current information, please refer to the State Water Resources Control Board's LUST database.
 Date of Government Version: 01/02/02
 Database Release Frequency: No Update Planned

LUST REG 6V: Leaking Underground Storage Tank Case Listing
 Source: California Regional Water Quality Control Board Victorville Branch Office (6)
 Telephone: 760-346-7491
 Date of Government Version: 01/02/02
 Database Release Frequency: Quarterly

LUST REG 7: Leaking Underground Storage Tank Case Listing
 Source: California Regional Water Quality Control Board Colorado River Basin Region (7)
 Telephone: 760-346-7491
 Date of Government Version: 07/02/02
 Database Release Frequency: Semi-Annually

LUST REG 8: Leaking Underground Storage Tanks
 Source: California Regional Water Quality Control Board Santa Ana Region (8)
 Telephone: 909-782-4496
 California Regional Water Quality Control Board Santa Ana Region (8). For more current information, please refer to the State Water Resources Control Board's LUST database.
 Date of Government Version: 07/23/01
 Database Release Frequency: No Update Planned

Date of Last EDR Contact: 07/08/02
 Date of Next Scheduled EDR Contact: 10/07/02

Date of Last EDR Contact: 07/01/02
 Date of Next Scheduled EDR Contact: 09/30/02

Date of Last EDR Contact: 07/12/02
 Date of Next Scheduled EDR Contact: 10/07/02

Date of Last EDR Contact: 07/08/02
 Date of Next Scheduled EDR Contact: 10/07/02

Date of Last EDR Contact: 07/01/02
 Date of Next Scheduled EDR Contact: 09/30/02

Date of Last EDR Contact: 05/13/02
 Date of Next Scheduled EDR Contact: 08/12/02

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

LUST REG 8: Leaking Underground Storage Tank Report

Source: California Regional Water Quality Control Board San Diego Region (9)
Telephone: 858-467-2980

Orange, Riverside, San Diego counties. For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 03/01/01

Database Release Frequency: No Update Planned

Date of Last EDR Contact: 04/22/02

Date of Next Scheduled EDR Contact: 07/22/02

California Regional Water Quality Control Board (RWQCB) SLIC Records

SLIC REG 1: Active Toxic Site Investigations

Source: California Regional Water Quality Control Board, North Coast Region (1)
Telephone: 707-578-2220

Date of Government Version: 02/01/01

Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 05/31/02

Date of Next Scheduled EDR Contact: 08/26/02

SLIC REG 2: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

Source: Regional Water Quality Control Board San Francisco Bay Region (2)
Telephone: 510-288-0457

Any contaminated site that impacts groundwater or has the potential to impact groundwater.

Date of Government Version: 12/01/01

Database Release Frequency: Quarterly

Date of Last EDR Contact: 07/15/02

Date of Next Scheduled EDR Contact: 10/14/02

SLIC REG 3: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

Source: California Regional Water Quality Control Board Central Coast Region (3)
Telephone: 805-549-3147

Any contaminated site that impacts groundwater or has the potential to impact groundwater.

Date of Government Version: 05/22/02

Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 05/20/02

Date of Next Scheduled EDR Contact: 08/19/02

SLIC REG 4: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

Source: Region Water Quality Control Board Los Angeles Region (4)
Telephone: 213-576-6600

Any contaminated site that impacts groundwater or has the potential to impact groundwater.

Date of Government Version: 09/13/01

Database Release Frequency: Quarterly

Date of Last EDR Contact: 05/01/02

Date of Next Scheduled EDR Contact: 07/29/02

SLIC REG 5: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

Source: Regional Water Quality Control Board Central Valley Region (5)
Telephone: 916-855-3075

Unregulated sites that impact groundwater or have the potential to impact groundwater.

Date of Government Version: 07/01/02

Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 07/08/02

Date of Next Scheduled EDR Contact: 10/07/02

SLIC REG 6V: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

Source: Regional Water Quality Control Board, Victorville Branch
Telephone: 619-241-6583

Date of Government Version: 07/19/01

Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 07/08/02

Date of Next Scheduled EDR Contact: 10/07/02

SLIC REG 6: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

Source: California Region Water Quality Control Board Santa Ana Region (8)
Telephone: 909-782-3298

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 07/31/01

Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 07/08/02

Date of Next Scheduled EDR Contact: 10/07/02

SLIC REG 9: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

Source: California Regional Water Quality Control Board San Diego Region (9)

Telephone: 858-467-2980

Date of Government Version: 03/01/02

Database Release Frequency: Annually

Date of Last EDR Contact: 06/03/02

Date of Next Scheduled EDR Contact: 09/02/02

EDR PROPRIETARY HISTORICAL DATABASES

Former Manufactured Gas (Coal Gas) Sites: The existence and location of Coal Gas sites is provided exclusively to EDR by Real Property Scan, Inc. ©Copyright 1993 Real Property Scan, Inc. For a technical description of the types of hazards which may be found at such sites, contact your EDR customer service representative.

Disclaimer Provided by Real Property Scan, Inc.

The information contained in this report has predominantly been obtained from publicly available sources produced by entities other than Real Property Scan. While reasonable steps have been taken to insure the accuracy of this report, Real Property Scan does not guarantee the accuracy of this report. Any liability on the part of Real Property Scan is strictly limited to a refund of the amount paid. No claim is made for the actual existence of toxins at any site. This report does not constitute a legal opinion.

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 1999 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 from the U.S. Fish and Wildlife Service.

STREET AND ADDRESS INFORMATION

© 2001 Geographic Data Technology, Inc., Rev. 07/2001. This product contains proprietary and confidential property of Geographic Data Technology, Inc. Unauthorized use, including copying for other than testing and standard backup procedures, of this product is expressly prohibited.



"Linking Technology with Tradition"

Sanborn® Map Report

Ship to: Caryn Kelly Geomatrix Consultants 2101 Webster Street Oakland, CA 94612	Order Date: 8/20/2002 Completion Date: 08/22/2002
	Inquiry #: 834561.2S
	P.O. #: NA
	Site Name: 1249 67th Street
	Address: 1249 67th Street
	City/State: Emeryville, CA 94608
1034455RJC	Cross Streets: San Pablo Avenue 510-663-4200

Based on client-supplied information, fire insurance maps for the following years were identified

1911 - 1 - map
1950 - 1 - map
1952 - 1 - map
1967 - 1 - map
1980 - 1 - map

Total Maps: 5

Limited Permission to Photocopy

Geomatrix Consultants (the client) is permitted to make up to THREE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

All maps provided pursuant to a Sanborn® Map Report are currently reproducible of fire insurance maps owned or licensed by Environmental Data Resources, Inc. NO WARRANTY, EXPRESSED OR IMPLIED IS MADE WHATSOEVER. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, WARRANTIES AS TO ACCURACY, VALIDITY, COMPLETENESS, SUITABILITY, CONDITION, QUALITY, MERCHANTABILITY, OR FITNESS FOR A PARTICULAR USE OR PURPOSE WITH RESPECT TO THE REPORT, THE MAPS, THE INFORMATION CONTAINED THEREIN, OR THE RESULTS OF A SEARCH OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. Environmental Data Resources, Inc. assumes no liability to any party for any loss or damage whether arising out of errors or omissions, negligence, accident or any other cause. In no event shall Environmental Data Resources, Inc., its affiliates or agents, be liable to anyone for special, incidental, consequential or exemplary damages.

Electronic Sanborn Map Images

USER'S GUIDE

Thank you for your interest in electronic Sanborn Map images. The following are guidelines for accessing the images and for transferring them to your system. If you have any questions about the use of electronic Sanborn Map images, contact your EDR Account Executive at 1-800-352-0050.

Organization of Electronic Sanborn Image File

- First Page Sanborn Map Report, listing years of coverage
- Second Page Electronic Sanborn Map Images USER'S GUIDE
- Third Page Oldest Sanborn Map Image
- Last Page Most recent Sanborn Map Image

Navigating the Electronic Sanborn Image File

- Open file on screen.
- Identify TP (Target Property) on the most recent map.
- Find TP on older printed images.
- Using Acrobat, zoom to 250% in order to view more clearly.
 - 200-250% is the approximate equivalent scale of hardcopy Sanborn Maps.
- Zooming in on an image:
 - On the menu bar, click "View" and then zoom.
 - Use the magnifying tool and drag a box around the TP area.

Printing a Sanborn Map from the Electronic File

- EDR recommends printing all images at 300 dpi (300 dpi prints faster than 600 dpi).
- To print only the TP area, cut and paste the area from Adobe Acrobat to your word processor.

Acrobat Version 4

- Go to the Menu bar
- Press and hold the "T" button
- Choose the Graphics Select Tool
- Draw a box around the area selected
- Go to "Menu"
- Highlight "Edit"
- Highlight "Copy"
- Go to a word processor such as Microsoft Word, paste and print.



Graphics Select Tool (G)

Acrobat Version 5


- Go to the Menu Bar.
- Click the "Graphics Select Tool"
- Draw a box around the area selected
- Go to "Menu"
- Highlight "Edit"
- Highlight "Copy"
- Go to a word processor such as Microsoft Word, paste and print.



Graphics Select Tool (G)

Important Information about Email Delivery of Electronic Sanborn Map Images

- Images are grouped into one file, up to 2MB.
- In cases where in excess of 6-7 map years are available, the file size typically exceeds 2MB. In these cases, you will receive multiple files, labeled as 1 of 3, 2 of 3, etc. including all available map years.
- Due to file size limitations, certain ISPs, including AOL, may occasionally delay or decline to deliver files. Please contact your ISP to identify their specific file size limitations.

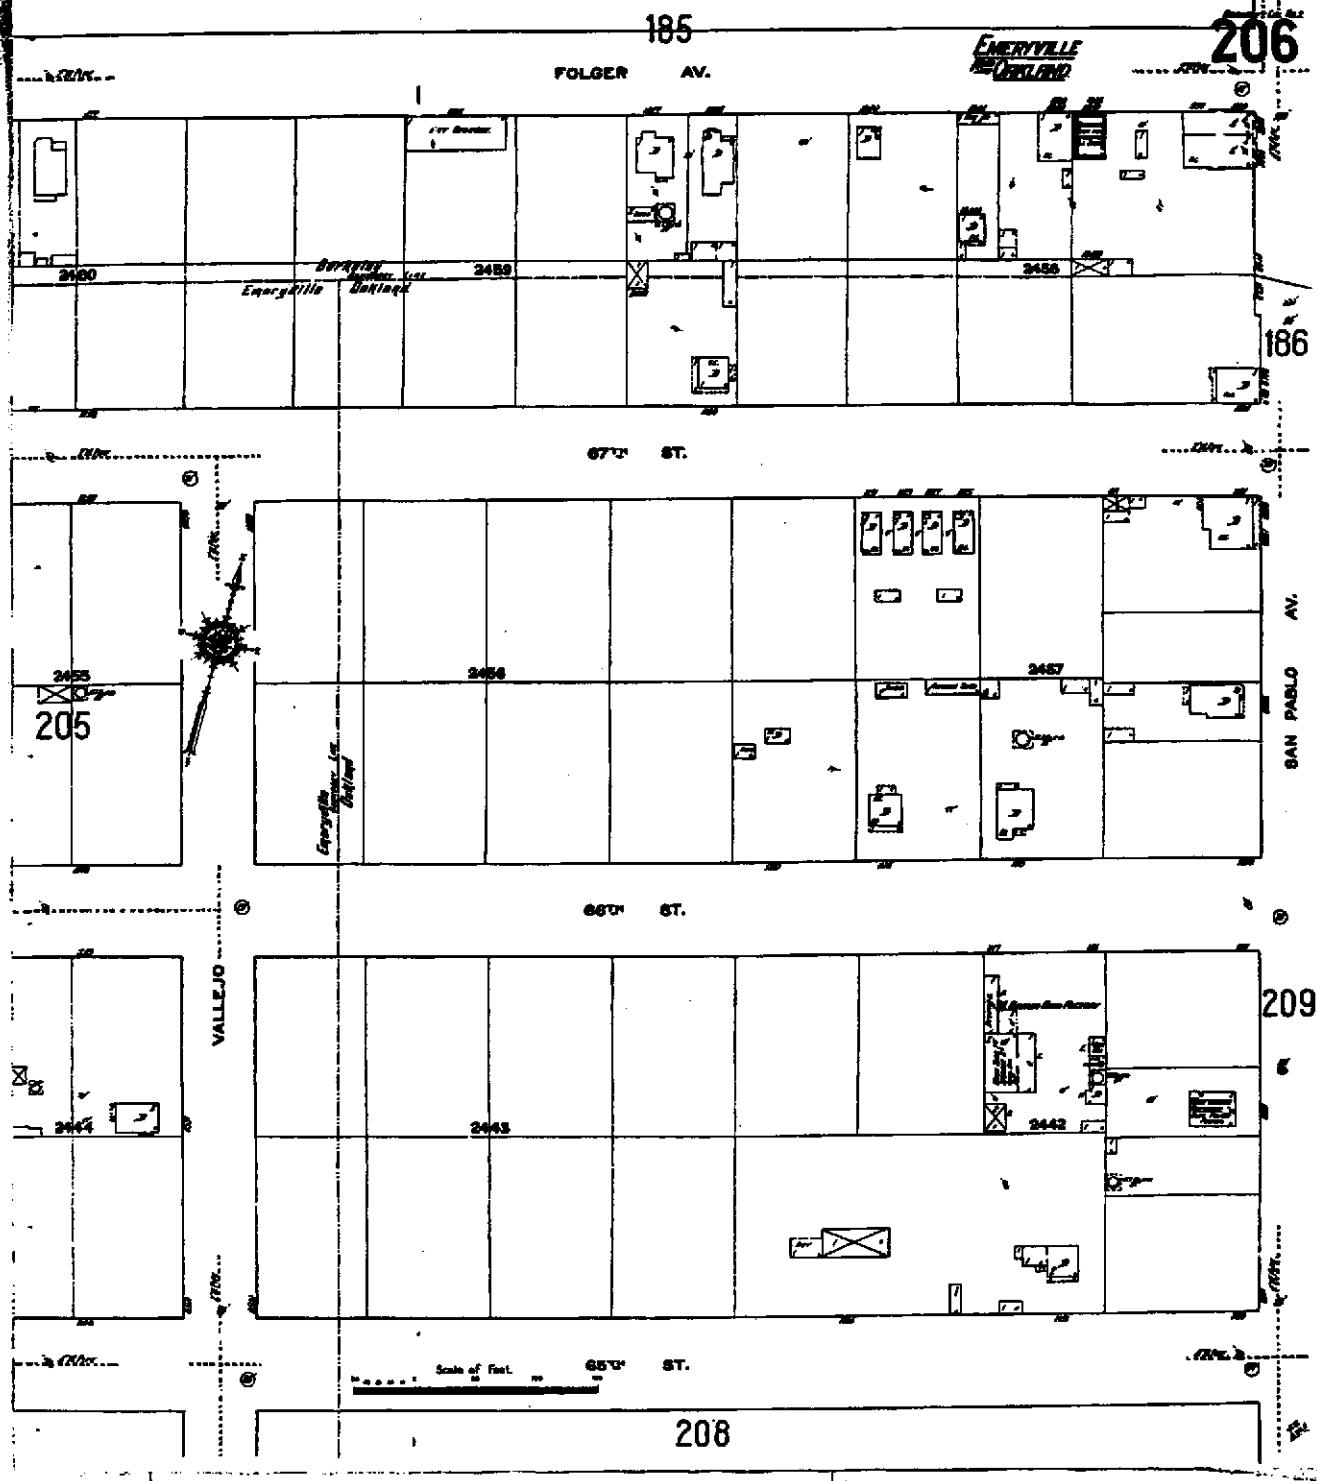



The Sanborn Library, LLC

This Sanborn® map is a certified copy produced by Environmental Data Resources, Inc. under arrangement with The Sanborn Library, LLC. Information on this Sanborn® Map is derived from Sanborn field surveys conducted in

Copyright © 1911 The Sanborn Library, LLC

KJT
EDR Research Associate

Reproduction in whole or in part of any map of The Sanborn Library, LLC may be prohibited without prior written permission from The Sanborn Library, LLC.

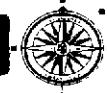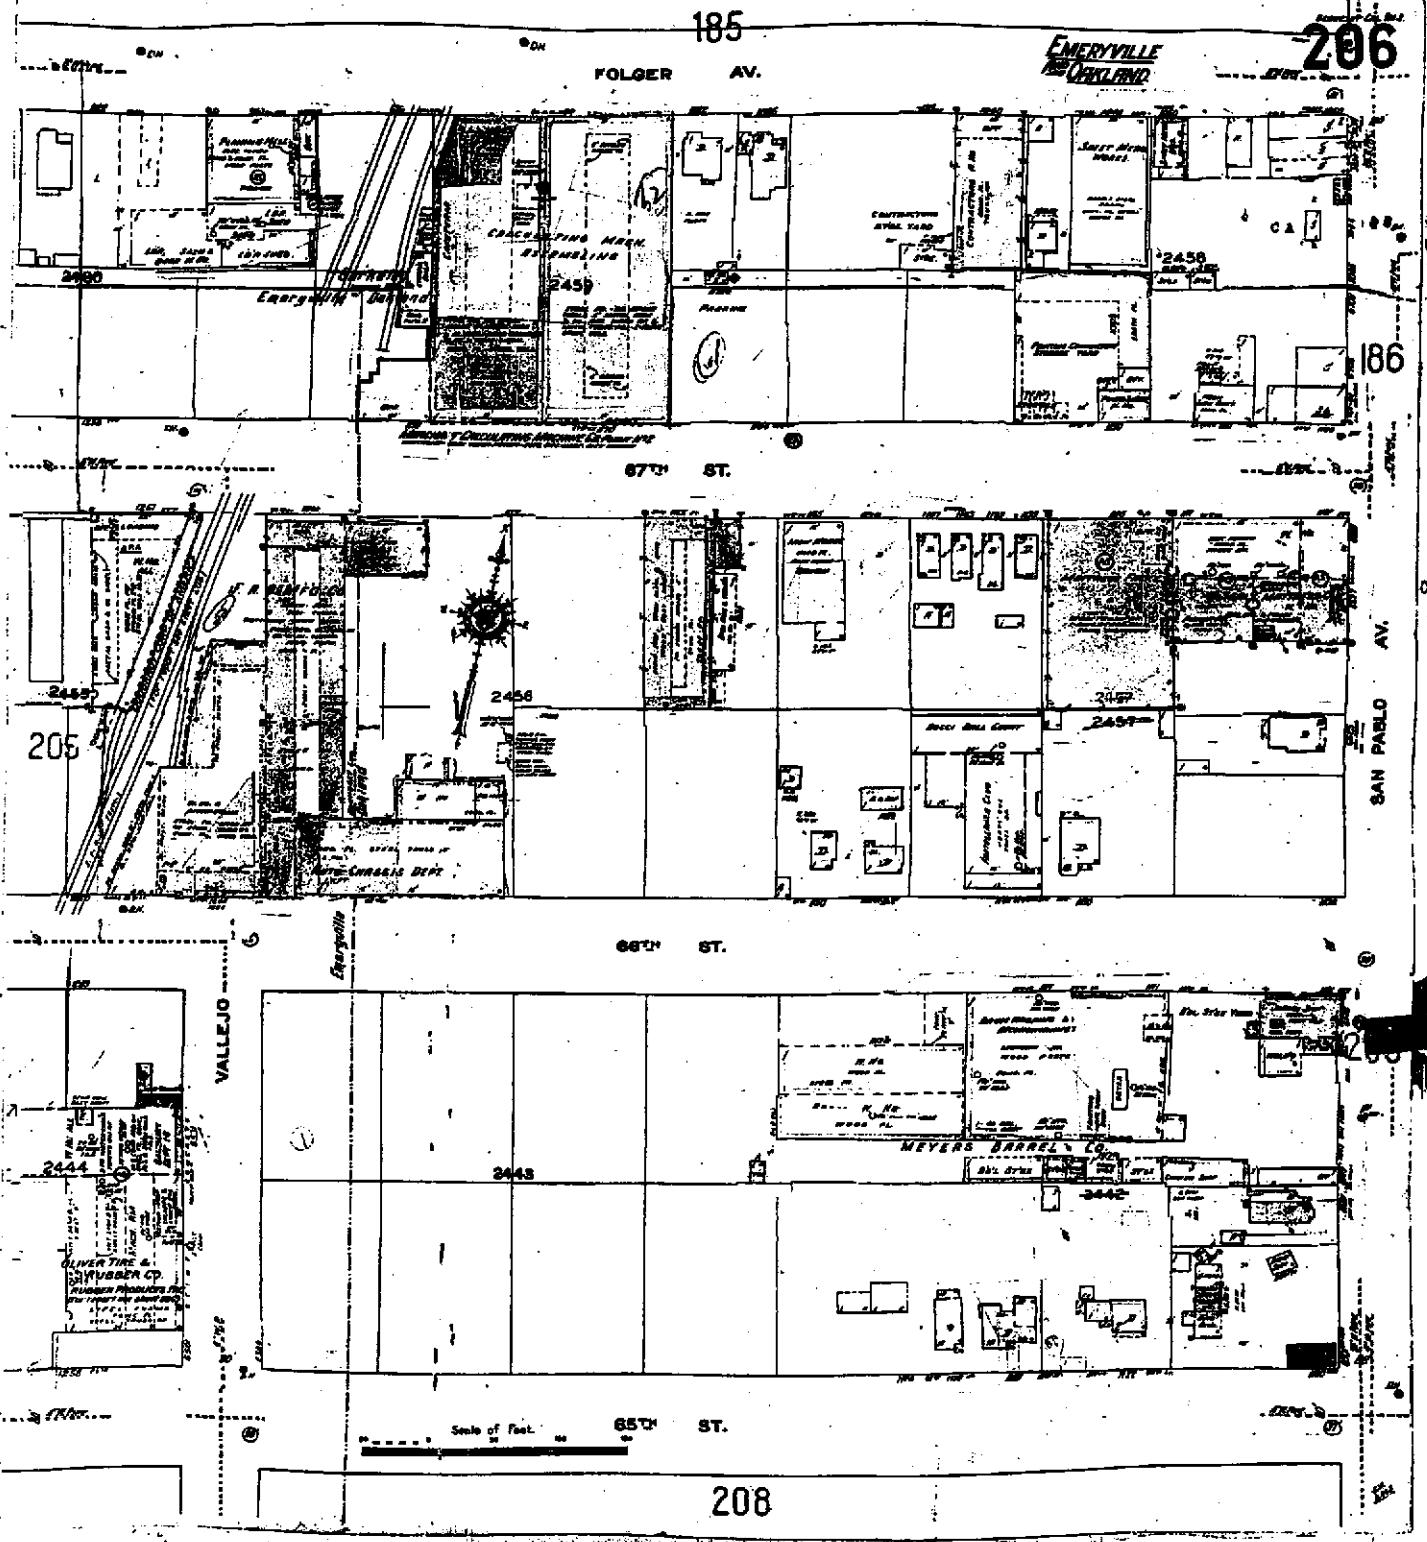

The Sanborn Library, LLC

This Sanborn® Map is a certified copy produced by Environmental Data Resources, Inc. under arrangement with The Sanborn Library, LLC. Information on this Sanborn® Map is derived from Sanborn field surveys conducted in

Copyright © 1950

The Sanborn Library, LLC

KLT

EDR Research Associates


Reproduction in whole or in part of any map of The Sanborn Library, LLC may be prohibited without prior written permission from The Sanborn Library, LLC.

SEE MAP OF BERKELEY VOL. TWO

FOLGER AV.

BERKELEY &
EMERYVILLE

304
(200-BERKELEY VOL. 2)

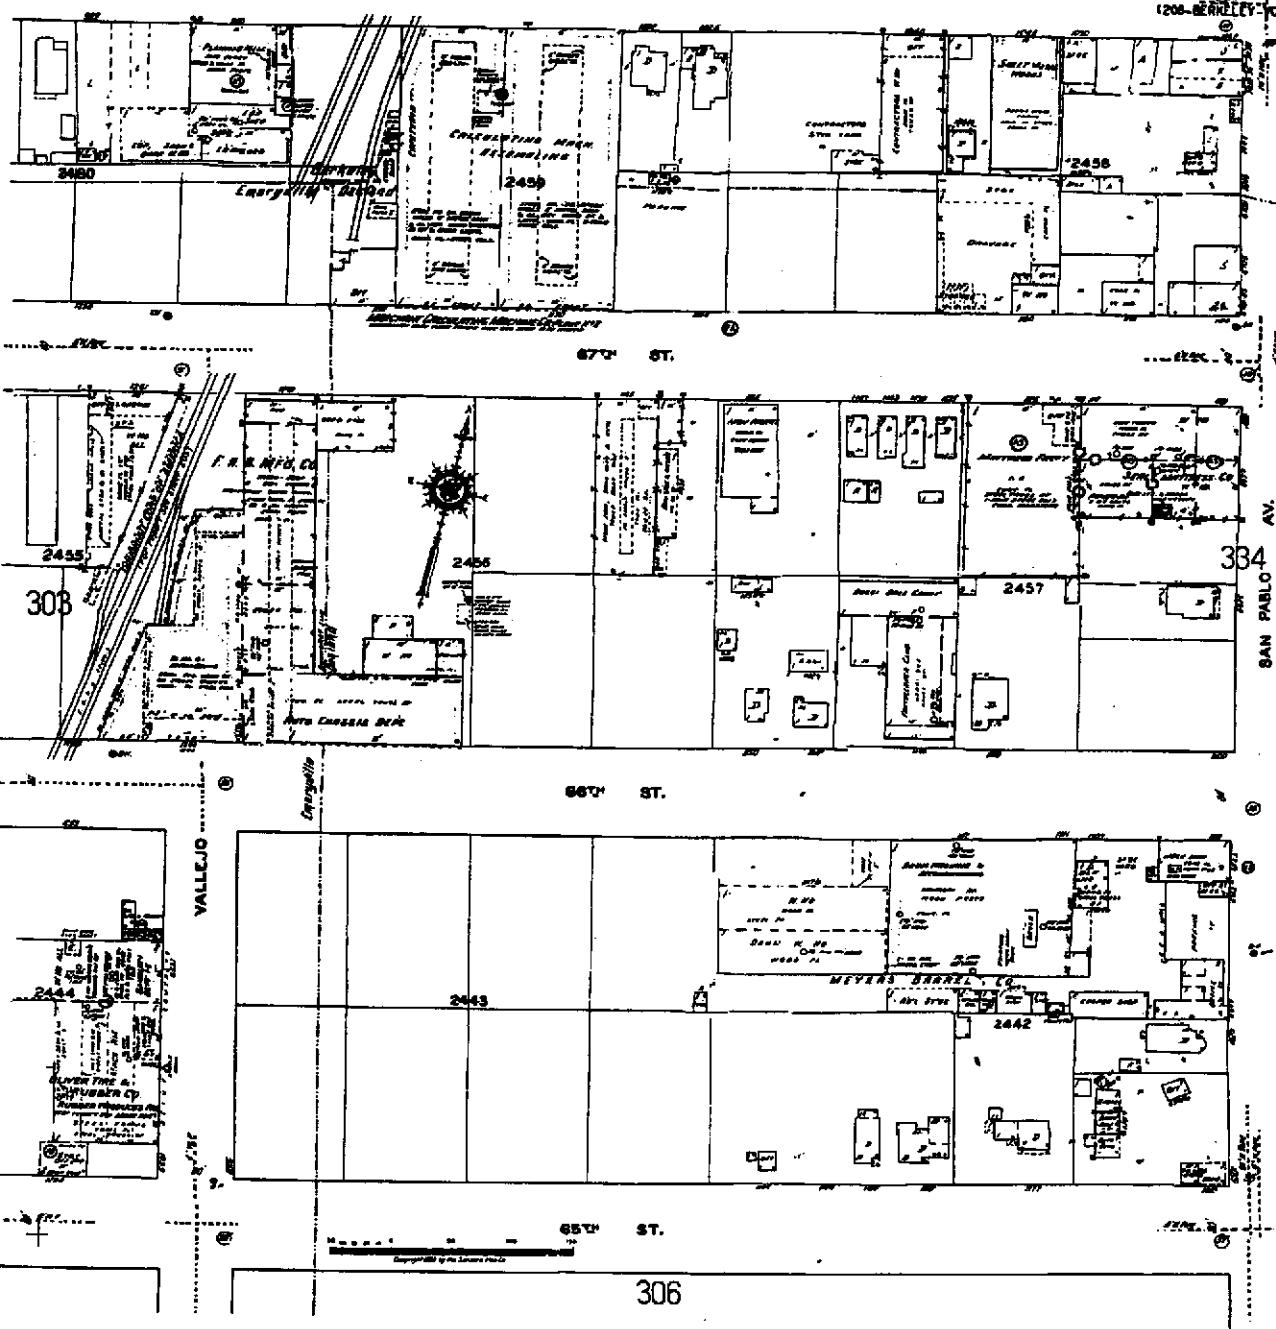

69

The Sanborn Library, LLC

This Sanborn® Map is a certified copy produced by Environmental Data Resources, Inc. under arrangement with The Sanborn Library, LLC. Information on this Sanborn® Map is derived from Sanborn field surveys conducted in:



Copyright © 1952


The Sanborn Library, LLC

Year

KJT

EDR Research Associates

Reproduction in whole or in part of any map of The Sanborn Library, LLC may be prohibited without prior written permission from The Sanborn Library, LLC.

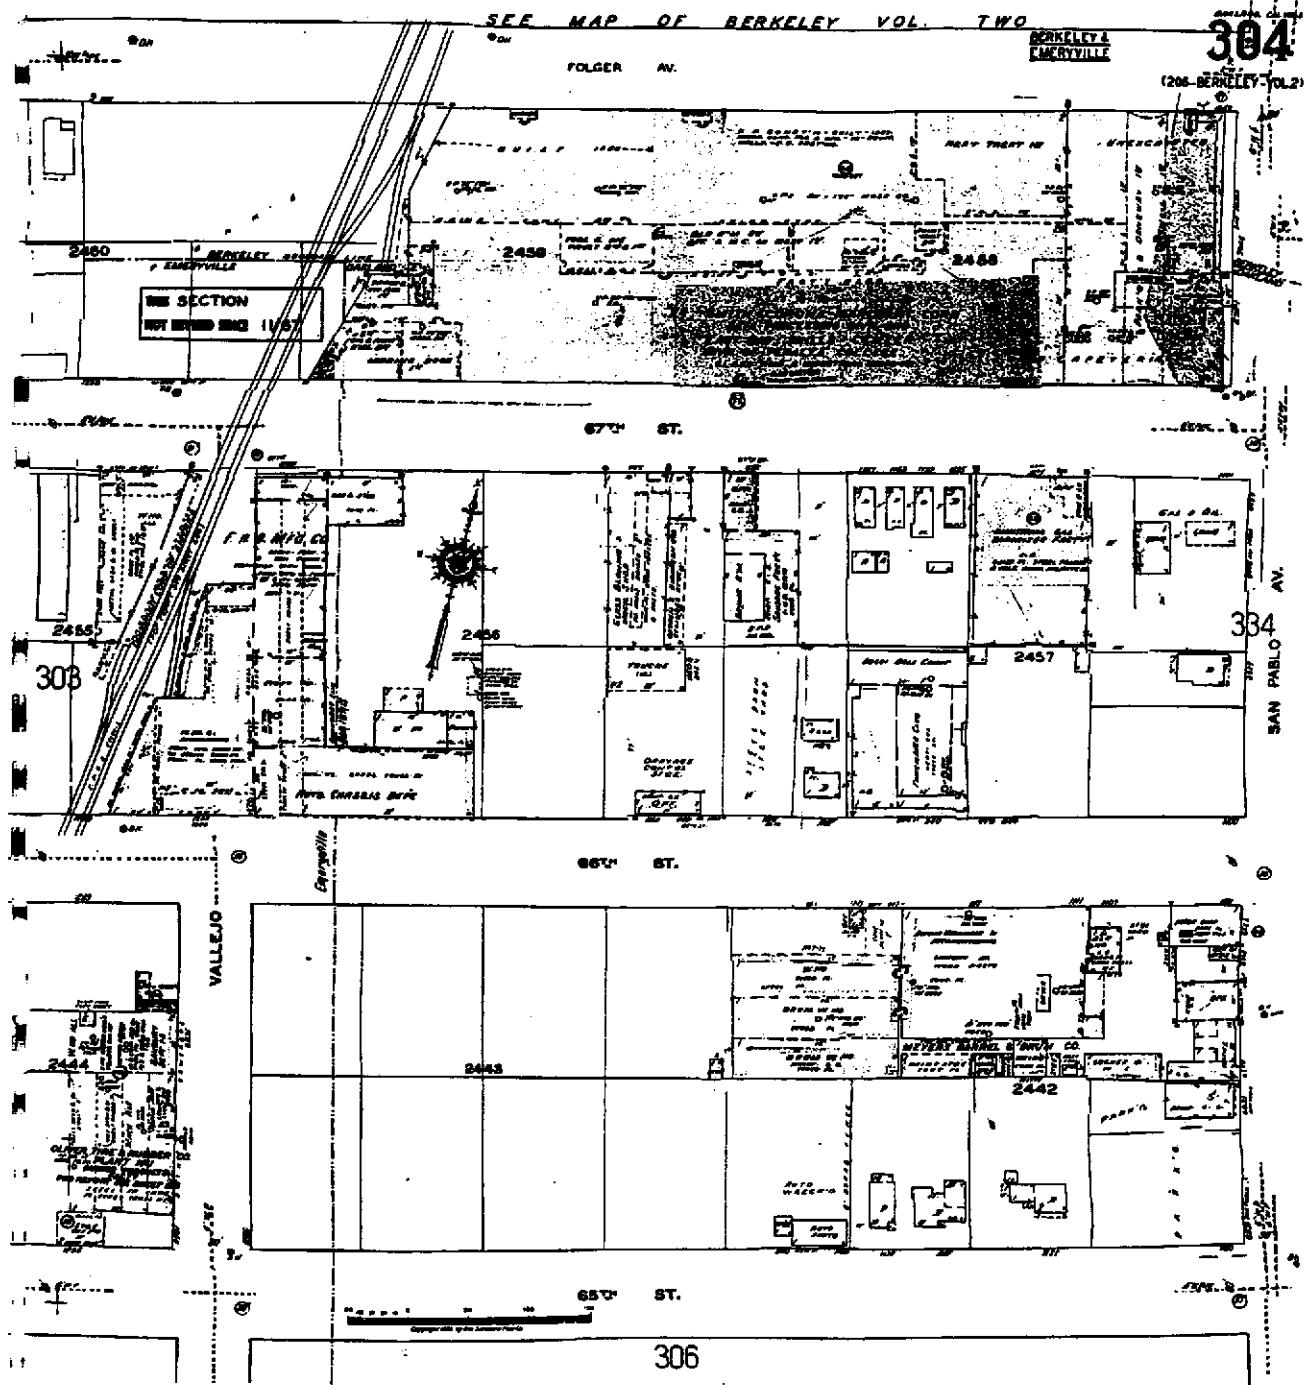

66




The Sanborn Library, LLC

This Sanborn® Map is a certified copy produced by Environmental Data Resources, Inc. under arrangement with The Sanborn Library, LLC. Information on this Sanborn® Map is derived from Sanborn field surveys conducted in

Copyright © 1967 The Sanborn Library, LLC IJU EDN Research Associates

Reproduction in whole or in part of any map of The Sanborn Library, LLC may be prohibited without prior written permission from The Sanborn Library, LLC.

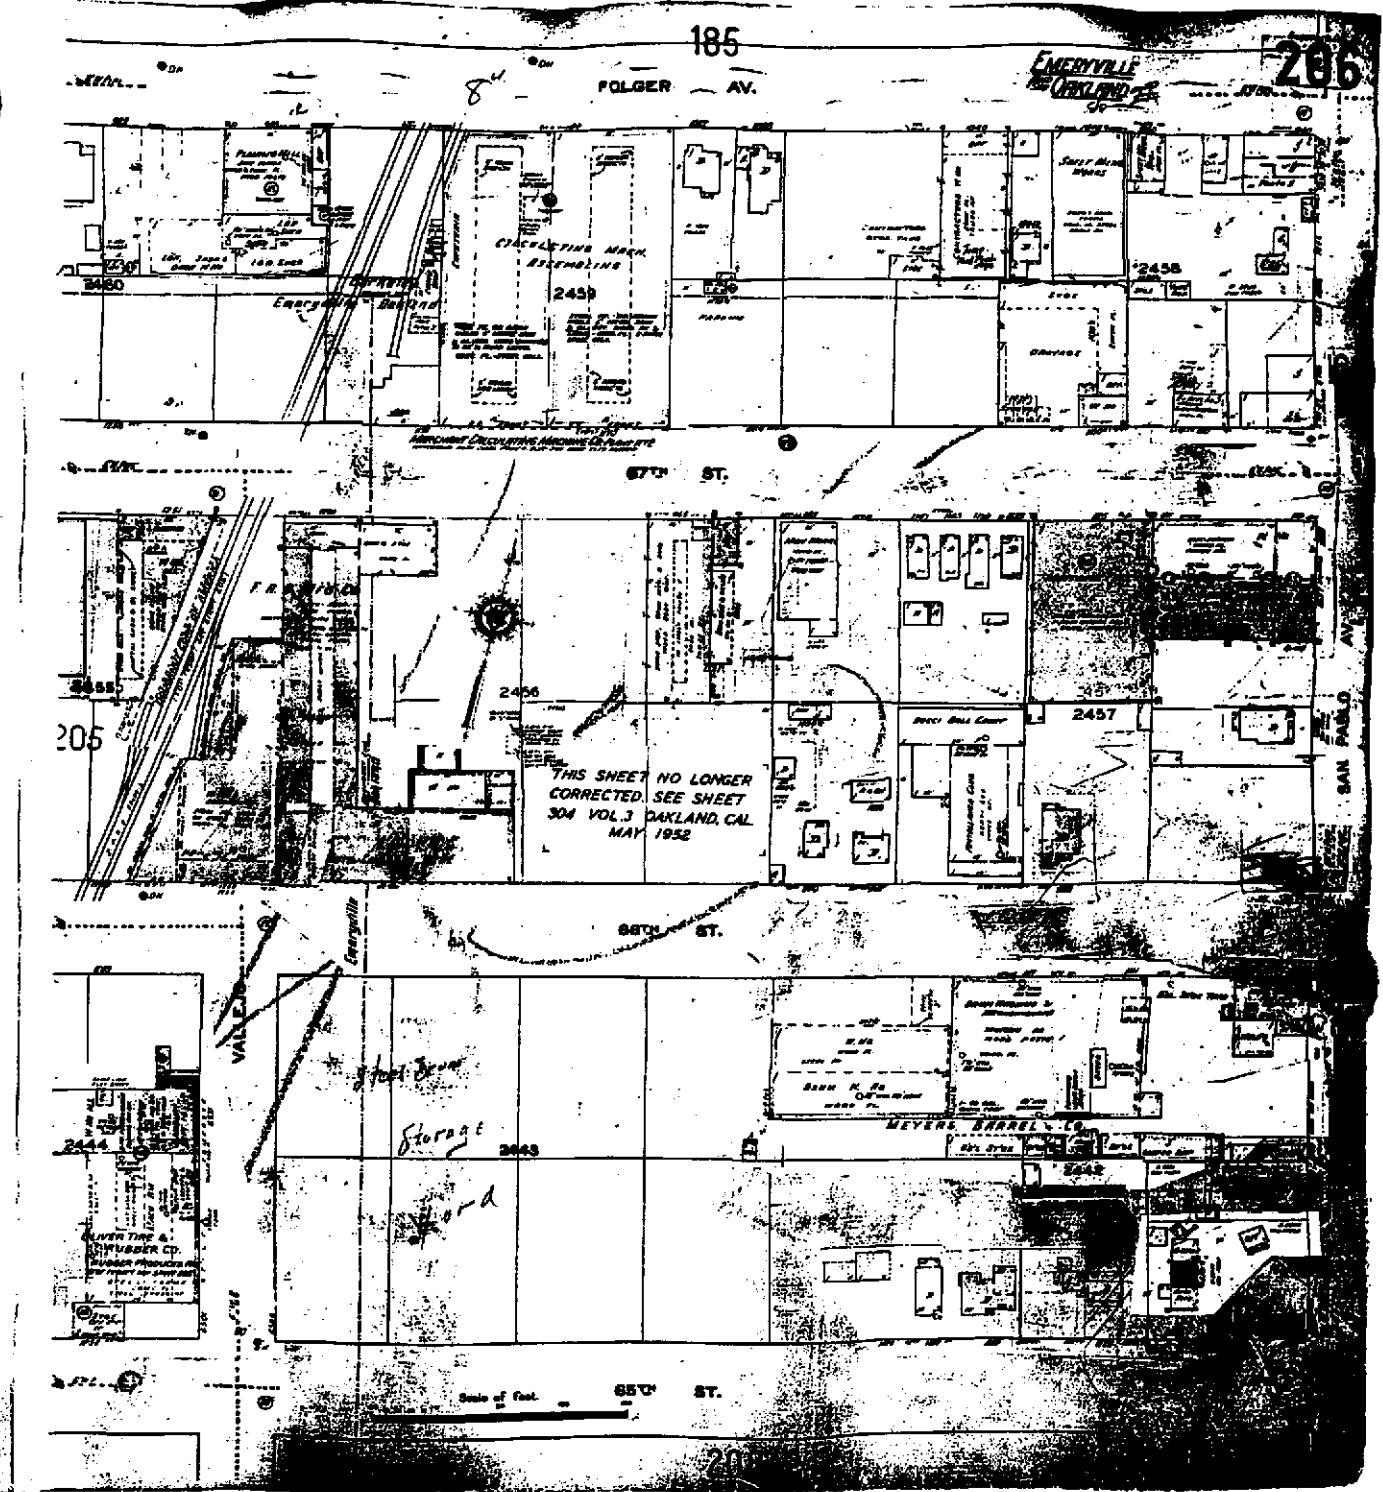

The Sanborn Library, LLC

This Sanborn® Map is a cartified copy produced by Environmental Data Resources, Inc. under arrangement with The Sanborn Library, LLC. Information on this Sanborn® Map is derived from Sanborn field surveys conducted in:

Copyright © 1980 The Sanborn Library, LLC

JLT
EDR Research Associate

Reproduction in whole or in part of any data of The Sanborn Library, LLC may be prohibited without prior written permission from The Sanborn Library, LLC.



Appendix B

Pulte Home Corporation Environmental Checklist

**PULTE HOME CORPORATION
LAND DEVELOPMENT**

ENVIRONMENTAL CHECKLIST

II. Present Uses of the Parcel and Surrounding Land

Diagram the site, or include an aerial photograph and indicate the present uses of the parcel and surrounding land within a quarter mile of the parcel (i.e., farm, residential, mining, manufacturing, vacant land, timber, etc.):

See attached Figure 2 in body of report. Parcel is located in a mixed commercial, light industrial and residential area.

Is any land within 1/4-mile of the site proposed for a permitted landfill or hazardous waste facility? No

If necessary, supplement personal information with telephone conversations with agency personnel. Document your conversations in an attachment to the checklist including any additional information with regard to the proposed site and potential risk to the proposed site.

Walking Inspection of Parcel

Were any of the following noted during on-site inspection?

- | | | |
|----|---|-----|
| 1. | Discolored or disturbed soil areas | No |
| 2. | Areas of sparse, sick, or dead vegetation | No |
| 3. | Drums or storage tanks (note type) | Yes |
| 4. | Discolored/polluted water | No |
| 5. | Unusual or noxious odors | Yes |
| 6. | Groundwater monitoring wells | No |
| 7. | Road or two-tracks with no apparent outlet or purpose | No |

If YES, describe:

3. *Fabco store synthetic oils and oil solutions on site; they keep up to 12 55-gallon drums of waste oil solutions (90% H₂O, 10% oil) and 2 55-gallon steel drums of virgin synthetic oil. There were drums filled with oiled rags.*
5. *Faint industrial-type smell or petroleum smell within the manufacturing area.*

**PULTE HOME CORPORATION
LAND DEVELOPMENT**

ENVIRONMENTAL CHECKLIST

Check and explain the past uses of the parcel and surrounding land. Check all that apply.

	Parcel	Within 1/4-Mile of Parcel
1. Vacant land		
2. Agricultural land		
3. Pasture/range land		
4. Tank/drum/equipment storage		X
5. Industrial/manufacturing facility	X	X
6. Mining, quarries, sand/gravel extraction		
7. Oil/Gas exploration		
8. Chemical, petroleum, or waste storage/ processing/injection well		
9. Military installation, including bases, armories, arsenals, test ranges		
10. Abandoned gas stations – have tanks been removed or sand filled? Check with fire marshal		X
11. Fill areas		
12. Other: <i>Printing</i>		

IF ITEMS 4 - 11 ARE CHECKED – contact environmental engineer for technical assistance in further evaluation.

Are there/have there been any liquid storage tanks on the parcel?

	Yes	No	Above/Below Ground	Quantity	Capacity
1. Heating fuel (home or building)					
2. Vehicle fuel (gasoline)	X		Below	1	1000-gallon
3. Waste Oil	X		Below	1	4000-gallon

Explain: *Tanks removed from property in 1988 and received site closure from Alameda County Department of Environmental Health.*

IF ANY OF THE ABOVE ARE CHECKED – contact environmental engineer for technical assistance in evaluating potential impact.

**PULTE HOME CORPORATION
LAND DEVELOPMENT**
ENVIRONMENTAL CHECKLIST

IV. Water Sources

Indicate if any bodies or streams of surface water are present on or in close proximity to the parcel.

	Name
1. Ponds/lake	No _____
2. Wetlands or swamps	No _____
3. Rivers, creeks, or streams	No _____

What is the proposed method of supplying drinking water to the parcel?

- | | |
|--------------------------------|-----|
| 1. Private wells | No |
| 2. Community/subdivision wells | No |
| 3. Public water supply | Yes |

IF DRINKING WATER IS TO BE SUPPLIED BY COMMUNITY OR PRIVATE WELLS,
contact the environmental engineer for assistance in evaluating the proposed drinking water supply.

V. Soil and Subsurface Investigation

Were any unusual conditions noted in the soil boring logs? *Not applicable*

If yes, explain:

A Soil Boring Evaluation Form must be completed for every soil boring taken on behalf of the Company.

Copies of all Evaluation Forms must be attached to this Checklist.

**PULTE HOME CORPORATION
LAND DEVELOPMENT**
ENVIRONMENTAL CHECKLIST

VI. Other

Are there any environmental factors, associated with the past, present, or proposed uses of the parcel or surrounding properties which would have an adverse environmental impact on the planned development of the parcel? Yes

If yes, explain:

Underground storage tanks have been removed from the site. A cutting oil spill occurred on site resulting in a remediation effort. General history of industrial use since 1918. Oil stains, located in the manufacturing facility, in concrete surface.

If no, explain what leads you to this conclusion:

If maybe, what additional tests need to be performed to form an opinion?

Limited soil and groundwater investigation both on and off site borings. Focus on TPH, VOCs, PNAs, and metals.

VI. Signoff

I have used my best efforts to complete this checklist or have a consultant who has completed the checklist to my satisfaction. Based upon the information contained herein, I do not believe there is any need for additional investigation except as noted.
