

Consulting Engineers

P.O. BOX 996 • BENICIA, CA 94510 (707) 746-6915 • (707) 746-6916 • FAX: (707) 746-5581

KEI-P89-0111.QR9 August 29, 1991

RECEIVED

9:45 am, Jun 09, 2009

Alameda County
Environmental Health

Unocal Corporation 2000 Crow Canyon Place, Suite 400 P.O. Box 5155 San Ramon, California 94583

Attention: Mr. Ron Bock

RE: Quarterly Report

Unocal Service Station #5487 28250 Hesperian Boulevard Hayward, California

Dear Mr. Bock:

This report presents the results of the most recent quarter of monitoring and sampling of the monitoring wells at the referenced site by Kaprealian Engineering, Inc. (KEI), per KEI's proposal KEI-P89-0111.P3 dated June 4, 1990. The wells are currently monitored and sampled on a quarterly basis. This report covers the work performed by KEI from June through August, 1991.

SITE DESCRIPTION AND BACKGROUND

The subject site is presently used as a gasoline station. The vicinity of the site is characterized by gently sloping, south-southwest trending topography, and is located approximately 0.8 miles northwest of Alameda Creek and approximately four miles northeast of the present shoreline of San Francisco Bay. A Location Map and Site Plans are attached to this report.

KEI's initial work at the site began on January 30, 1989, when KEI was asked to collect soil samples following the removal of two 10,000 gallon underground fuel storage tanks and one 280 gallon waste oil tank at the site. The tanks were made of steel and no apparent holes or cracks were observed in the fuel tanks; however, the waste oil tank was corroded. Water was encountered in the excavation at a depth of 10.5 feet, thus prohibiting the collection of any soil samples from beneath the tanks.

Ten soil samples, labeled SW1 through SW6 and SW2A, SW3A, SW5A, and SW6A, were collected from the sidewalls of the fuel tank pit at depths of approximately six inches above the water table. Three of these soil samples (samples SW2, SW3, and SW6) were never analyzed. Samples SW2A, SW3A, SW5A, and SW6A were collected from the sidewalls after additional excavation (see the attached Site Plan,

Figure 2). One soil sample, labeled WO1, was collected from beneath the waste oil tank at a depth of 9 feet (see the attached Site Plan, Figure 2). After the soil sampling was completed, approximately 2,000 gallons of ground water was pumped from the fuel tank pit.

On February 1, 1989, the waste oil tank pit was excavated laterally on all sides. The side nearest the existing building was excavated approximately 1 foot laterally, while the other three sides were each excavated approximately 10 feet laterally. The pit was excavated to an area of approximately 21 feet x 29 feet. Four sidewall samples (labeled SWA, SWB, SWC, and SWD) were collected (see the attached Site Plan, Figure 3). In addition, three soil samples were collected from the pipe trenches (labeled P1, P2, and P3), also shown on the attached Site Plan, Figure 3.

On February 14, 1989, in preparation for installation of the new fuel tanks, approximately 17,500 gallons of water were pumped from the fuel tank pit. On this date, after pumping, water samples W1A and W1B were collected.

On February 17, 1989, KEI returned to the site to observe additional excavation of the northeast sidewall of the waste oil tank pit (where sample SWC had previously been collected) for a distance of approximately 3 feet. Sample SWC2 was then collected. Also on this date, water sample WO-W1 was collected from the waste oil tank pit. The water sample was taken after having pumped 4,500 gallons from the waste oil excavation. Based on the analytical results from SWC2 (680 ppm of total oil and grease [TOG]), KEI returned to the site on February 24, 1989 to observe excavation of an additional 5 feet of soil. Soil sample SWC3 was then collected. Soil sample point locations are shown on the attached Site Plan, Figure 4.

On March 9, 1989, KEI collected four duplicate waste oil excavation sidewall soil samples. The samples, labeled SW-AX, SW-BX, SW-C3X, and SW-DX, were collected at sample point locations SWA, SWB, SWC3, and SWD, respectively. Soil sample point locations are as indicated on the attached Site Plan, Figure 5.

Soil and water samples were analyzed by Sequoia Analytical Laboratory in Redwood City, California, for total petroleum hydrocarbons (TPH) as gasoline, and benzene, toluene, xylenes and ethylbenzene (BTX&E). The waste oil tank pit samples were analyzed for TPH as gasoline, BTX&E, TPH as diesel, and TOG, except samples SW-AX, SW-BX, SW-C3X, and SW-DX, which were analyzed for EPA method 8010 and 8270 constituents, and the metals cadmium, chromium, lead and zinc. All pipe trench samples were analyzed for TPH as gasoline and

BTX&E. After additional excavation, analytical results of soil samples from the fuel tank pit showed less than 1.4 ppm of TPH as gasoline for all samples representing the final pit excavation. After additional excavation in the waste oil pit, the final soil sample analytical results showed low residual levels of contamination. These final results indicate that the majority of contaminated soil had been removed from the site. Laboratory analyses for soil and water samples collected during the tank replacement are summarized in Tables 3, 4, and 5.

Based on the results of the laboratory analyses, and in order to comply with the requirements of the regulatory agencies, KEI proposed the installation of five monitoring wells. Documentation of sample collection techniques and sample results of the soil and ground water samples collected in January and February, 1989, are summarized in KEI's reports (KEI-J89-0111.R2) dated March 1, 1989, and (KEI-J89-0111.R3) dated March 29, 1989. Results of soil sample analyses are summarized in Tables 4 and 5, and water sample analyses in Table 3 of this report.

Five two-inch diameter monitoring wells (designated as MW1 through MW5 on the attached Site Plan, Figure 1) were installed on April 20 and 21, 1989. The five wells were drilled and completed to total depths ranging from 24 to 28 feet below grade. Ground water was encountered at depths ranging from 7 to 10 feet beneath the surface during drilling. The wells were developed on April 25, 1989, and were initially sampled on April 26, 1989.

Water and selected soil samples were analyzed at Sequoia Analytical Laboratory in Redwood City, California, for TPH as gasoline and In addition, the soil samples collected from MW1 and MW2, and all the water samples, were analyzed for TPH as diesel, TOG, and EPA method 8010 compounds. Analytical results of soil samples collected from the borings for monitoring wells MW1 through MW4 showed non-detectable levels of TPH as gasoline and BTX&E in all samples, except for sample MW4(9), collected at a depth of 9 feet, which showed 1.4 ppm of TPH as gasoline. The soil sample collected from MW5 at a depth of 5 feet showed 900 ppm of TPH as gasoline, and 3.1 ppm of benzene. Analytical results of water samples, collected from MW1 and MW4, showed benzene levels of 2.1 ppb and 0.33 ppb, respectively. Analytical results for all other water samples indicated non-detectable levels for all constituents Documentation of the well installation protocol, analyzed. development, and sampling techniques of the monitoring wells is presented in KEI's report (KEI-P89-0111.R5) dated May 18, 1989. Soil sample analyses from that report are summarized in Table 6, and water sample analyses in Table 2 of this report.

Subsequently, KEI proposed a monthly monitoring and quarterly sampling program of existing wells, which was initiated in June 1989. This program has been modified to quarterly monitoring and sampling as of January 1991, as recommended in KEI's quarterly report (KEI-P89-0111.QR6) dated January 4, 1991.

RECENT FIELD ACTIVITIES

The five wells were monitored and sampled once during the quarter. During monitoring, the wells were checked for depth to water and presence of free product and sheen. No free product or sheen was noted in any of the wells during the quarter. Monitoring data are summarized in Table 1.

Water samples were collected from the wells on August 2, 1991. Prior to sampling, the wells were each purged of between 15 and 16 gallons using a surface pump. Samples were then collected using a clean Teflon bailer. Samples were decanted into clean VOA vials and/or one-liter amber bottles, as appropriate, which were sealed with Teflon-lined screw caps, and stored in a cooler on ice until delivery to the state certified laboratory.

All wells have been surveyed to Mean Sea Level (MSL) by Kier & Wright of Pleasanton, California.

A review of Regional Water Quality Control Board (RWQCB) files was conducted in June 1991, in order to locate and gain information on nearby underground tank sites. A review of ground water elevation data from three monitoring wells at the Rotten Robbie Service Station at 27814 Hesperian Boulevard, located approximately 1,800 feet northwest of Unocal, indicates a ground water flow direction to the southwest. Results of ground water analysis from the three wells showed high levels of TPH as gasoline and BTX&E as well as free product being observed in one of the wells. No other underground fuel tank sites within a one-half mile radius of the subject site are known to KEI.

HYDROLOGY AND GEOLOGY

Based on the water level data gathered during the quarter, ground water flow direction appeared to be toward the southwest on August 2, 1991, with a hydraulic gradient of 0.0054. The ground water flow direction has remained relatively unchanged from the previous quarters. Water levels have shown a net decrease of between 0.56 and 0.72 feet in all of the wells since the previous quarter. The measured depth to ground water at the site on August 2, 1991, ranged between 7.35 and 8.51 feet.

Based on review of regional geologic maps (U.S. Geological Survey Professional Paper 943 "Flatland Deposits - Their Geology and Engineering Properties and Their Importance to Comprehensive Planning" by E.J. Helley and K.R. Lajoie, 1979), the subject site is underlain by Holocene-age coarse-grained alluvium (Qhac). The coarse-grained alluvium typically consists of unconsolidated, moderated sorted sand and silt materials with local gravel lenses. In addition, the site is situated closely adjacent to a mapped geologic contact with Holocene-age medium-grained alluvium (Qham), which is described as typically consisting of unconsolidated fine sand, silt, and clayey silt, with a trace of coarse sand.

The results of our previous subsurface investigation (the borings for MW1 through MW5) indicate that the site is predominantly underlain by sandy to silty clay materials. However, in the vicinity of MW1 and MW4, the relatively thick sequence of clay materials are underlain by a clayey sand bed at a depth of about 24 feet in MW1 and about 23 feet in MW4, and extend to the maximum depth explored (28 feet). Clayey sand materials were not encountered in MW2, MW3, or MW5.

ANALYTICAL RESULTS

Ground water samples were analyzed at Sequoia Analytical Laboratory in Concord, California, and were accompanied by properly executed Chain of Custody documentation. The samples were analyzed for TPH as gasoline using EPA method 5030 in conjunction with modified 8015, and BTX&E using EPA method 8020.

Analytical results of the ground water samples collected from monitoring wells MW1 through MW4 indicate non-detectable levels of TPH as gasoline and BTX&E. The analytical results of the water sample collected from well MW5 indicate a level of TPH as gasoline at 100 ppb, and benzene at 43 ppb. Results of the analyses are summarized in Table 2. Copies of the analytical results and Chain of Custody documentation are attached to this report.

DISCUSSION AND RECOMMENDATIONS

Based on the analytical results collected and evaluated to date and no evidence of free product or sheen in any of the wells, KEI recommends the continuation of the current monitoring and sampling program of the existing wells per KEI's proposal (KEI-P89-0111.P3) dated June 4, 1990. KEI recommends that the wells be monitored and sampled for one additional quarter. Recommendations for continuing, altering or terminating the current monitoring and sampling program will be made after reviewing the analytical results from the next quarterly sampling.

DISTRIBUTION

A copy of this report should be sent to the Alameda County Health Care Services Agency, to the City of Hayward, and to the RWQCB, San Francisco Bay Region.

LIMITATIONS

Environmental changes, either naturally-occurring or artificiallyinduced, may cause changes in ground water levels and flow paths, thereby changing the extent and concentration of any contaminants.

Our studies assume that the field and laboratory data are reasonably representative of the site as a whole, and assume that subsurface conditions are reasonably conducive to interpolation and extrapolation.

The results of this study are based on the data obtained from the field and laboratory analyses obtained from a state certified laboratory. We have analyzed this data using what we believe to be currently applicable engineering techniques and principles in the Northern California region. We make no warranty, either expressed or implied, regarding the above, including laboratory analyses, except that our services have been performed in accordance with generally accepted professional principles and practices existing for such work.

If you have any questions regarding this report, please do not hesitate to call me at (707) 746-6915.

Sincerely,

Kaprealian Engineering, Inc.

Thomas of Beckene

Thomas J. Berkins

Senior Environmental Engineer

Don R. Braun

Certified Engineering Geologist

License No. 1310 Exp. Date 6/30/92

Timothy R. Ross

Timothy R. Ross Project Manager

\bam

Attachments:

Tables 1 through 6

Location Map

Site Plans - Figures 1 through 5

Laboratory Analyses

Chain of Custody documentation

TABLE 1
SUMMARY OF MONITORING DATA

Well No.	Ground Water Elevation (feet)	Depth to Water (feet)	Product <u>Thickness</u>	<u>Sheen</u>	Gallons <u>Pumped</u>
	(Monitored	and Sampled	on May 10,	1991)	
MW1	4.54	8.03	0	No	16
MW2	4.38	8.51	O	No	15
MW3	4.42	8.04	0	No	15
MW4	4.32	7.77	0	No	15
MW5	3.83	7.35	0	No	16

Well #	Surface Elevation*
MW1	12.57
MW2	12.89
MW3	12.46
MW4	12.09
MW5	11.18

^{*} Elevation of top of well covers surveyed to MSL.

TABLE 2
SUMMARY OF LABORATORY ANALYSES
WATER

<u>Date</u>	Sample Well #	TPH as <u>Diesel</u>	TPH as <u>Gasoline</u>	<u>Benzene</u>	<u>Toluene</u>	<u>Xylenes</u>	Ethyl- <u>benzene</u>
8/02/91	MW1		ND	ND	ND	ND	ND
-	MW2		ND	ND	ND	ND	ND
	MW3		ND	ND	ND	ND	ND
	MW4		ND	ND	ND	ND	ND
	MW5		100	43	0.33	5.2	12
5/10/91	MW1		ND	ND	ND	ND	ND
	MW2		ND	ND	ND	ND	ND
	MW3		ND	ND	ND	ND	ND
	MW4		ND	ND	ND	ND	ND
	MW5		ND	ND	ND	ND	ND
	MWD+		ND	ND	ND	ND	ND
2/11/91	MW1*	ND	ND	ND	ND	ND	ND
	MW2		ND	ND	ND	ND	ND
	MW3		ND	ND	ND	ND	ND
	MW4		ND	ИD	ND	ND	ND
	MW5		58	23	ND	1.3	2.9
11/15/90	MW1*	ND	ND	ND	ND	ND	ND
	MW2		ND	ND	ND	ND	ND
	MW3		ND	ND	ND	ND	ND
	MW4		ND	ND	ND	ND	ND
	MW5		ND	ND	ND	0.47	ND
8/29/90	MW1*	ND	ND	ND	ND	0.74	ND
	MW2		ND	ND	ND	ND	ND
	MW3		ND	ND	0.52	ND	ND
	MW4		ND	ND	ND	ND	ND
	MW5		ND	0.70	ND	1.1	0.57
5/16/90	MW1*	ND	ND	ND	ND	ND	ND
	MW2*	ND	ND	ND	ND	ND	ND
	MW3		ND	ND	ND	ND	ND
	MW4		ND	ND	ND	ND	ND
	MW5		1,100	310	2.8	110	70
2/16/90		ND	ND	ND	ND	ND	ND
	MW2		ND	ND	ND	ND	ND
	MW3		ND	ND	ND	ND	ND
	MW4		ND	ND	ND	ND	ND
	MW5		ND	ND	ND	ND	ND

TABLE 2 (Continued)

SUMMARY OF LABORATORY ANALYSES WATER

<u>Date</u>	Sample <u>Well #</u>	TPH as <u>Diesel</u>	TPH as <u>Gasoline</u>	<u>Benzene</u>	Toluene	<u>Xylenes</u>	Ethyl- <u>benzene</u>
11/14/89	MW1*	ND	ND	ND	ND	ND	ND
	MW2*	ИD	ND	ND	ND	ND	ND
	MW3		ND	ND	ND	ND	ND
	MW4		ND	ND	ND	ND	ND
	MW5		73	4.7	0.97	16	2.9
8/16/89	MW1**	ND	ND	ND	ND	ND	ND
• •	MW2**	ND	ND	ND	ND	ND	ND
	MW3		ND	ND	ND	ND	ND
	MW4		ND	ND	ND	ND	ND
	MW5		4,400	1,400	84	950	200
8/31/89	MW5		910	120	7.1	53	50
4/26/89	MW1***	ND	ND	2.1	ND	ND	ND
	MW2***	ND	ИD	ND	ND	ND	ND
	WM3***	ND	ND	ND	ND	ND	ND
	MW4***	ND	ND	0.33	ND	ND	ND
	MW5***	ND	ND	ND	ND	ND	ND
Detection	n						
Limits		50	30	0.3	0.3	0.3	0.3

⁺ MWD is a quality assurance duplicate water sample collected from well MW5.

ND = Non-detectable.

Results in parts per billion (ppb), unless otherwise indicated.

^{*} TOG and all EPA method 8010 constituents were non-detectable.

^{**} TOG for these samples were 23 ppm and 7.4 ppm, respectively. All EPA method 8010 constituents were non-detectable for both samples.

^{***} TPH as diesel, TOG, and all EPA method 8010 constituents were nondetectable.

⁻⁻ Indicates analysis not performed.

TABLE 3
SUMMARY OF LABORATORY ANALYSES
WATER

<u>Date</u>		TPH as <u>Diesel</u>	TPH as <u>Gasoline</u>	<u>Benzene</u>	<u>Toluene</u>	<u>Xylenes</u>	Ethyl- <u>benzene</u>
2/14/89	W1A W1B*	110		2.2	0.55 	12 	<0.5
2/17/89	WO-W1+	1,300	500	52	8.6	100	9.2

- -- Indicates analysis not performed.
- * All EPA method 601 constituents were non-detectable.
- + TOG and all EPA method 601 constituents were non-detectable.

 Results in parts per billion (ppb), unless otherwise indicated.

TABLE 4
SUMMARY OF LABORATORY ANALYSES
SOIL

(Collected on January 30, and February 2, 14 & 17, 1989)

Sample #	Depth (feet)	TPH as <u>Gasoline</u>	TPH as <u>Diesel</u>	<u>Benzene</u>	<u>Toluene</u>	Xylenes	Ethyl- benzene
SW1	10.0	1.4		0.14	<0.1	<0.1	<0.1
SW2A	10.0	1.1		<0.05	<0.1	<0.1	<0.1
SW3A	10.0	<1.0		<0.05	<0.1	<0.1	<0.1
SW4	10.0	<1.0		<0.05	<0.1	<0.1	<0.1
SW5	10.0	130		1.1	4.6	18	3.7
SW5A	10.0	<1.0		<0.05	<0.1	<0.1	<0.1
SW6A	10.0	<1.0		<0.05	<0.1	<0.1	<0.1
P1	3.5	7.8		2.0	<0.1	2.4	0.53
P2	3.5	12		1.9	0.91	0.70	3.0
P3	3.5	11		0.37	0.36	0.29	1.7
SWA*	10.0	<1.0	1.0	<0.05	<0.1	<0.1	<0.1
SWB*	10.0	1.1	2.4	<0.05	<0.1	<0.1	<0.1
SWC*	10.0	110	180	0.68	<0.1	5.6	1.9
SWC2*	10.0	89	57	<0.05	<0.1	0.42	0.76
SWC3*	10.0	<1.0	<1.0	<0.05	<0.1	<0.1	<0.1
SWD*	10.0	<1.0	<1.0	<0.05	<0.1	<0.1	<0.1
WO1**	9.0	60	800	3.6	9.2	9.5	2.5

^{*} TOG for SWA was 35 ppm, SWB was 44 ppm, SWC was 500 ppm, SWC2 was 680 ppm, SWC3 was <30 ppm, and SWD was 77 ppm.

Results in parts per million (ppm), unless otherwise indicated.

^{**} TOG for WO1 was 1,900 ppm; cadmium was 0.3 ppm; chromium was 39 ppm; lead was 10 ppm, and zinc was 42 ppm. Seventeen EPA method compounds and two EPA method compounds were detected at concentrations ranging from 100 ppb to 10,000 ppb.

⁻⁻ Indicates analysis not performed.

TABLE 5
SUMMARY OF LABORATORY ANALYSES
SOIL

<u>Date</u>	Sample <u>Number</u>	Cadmium	<u>Chromium</u>	<u>Lead</u>	<u>Zinc</u>
3/09/89	SW-AX*	0.2	96	4.7	3 5
	SW-BX*	0.16	91	5.1	29
	SW-C3X*	0.33	140	6.8	41
	SW-DX*	0.19	92	4.8	32
Detecti Limits	on	0.1	0.05	0.05	0.1

^{*} All EPA method 8010 and 8270 constituents were non-detectable. Results in parts per billion (ppb), unless otherwise indicated.

TABLE 6
SUMMARY OF LABORATORY ANALYSES
SOIL

<u>Date</u>	Sample <u>Number</u>	Depth (feet)	TPH as <u>Gasoline</u>	<u>Benzene</u>	<u>Toluene</u>	Xylenes	Ethyl- <u>benzene</u>
4/20/89	MW1*	5	ND	ND	ND	ND	ND
	MW2*	5	ND	ND	ND	ND	ND
	MW3 MW3	5 9	ND ND	ND ND	ND ND	ND ND	ND ND
	MW4 MW4	5 9	ND 1.4	ND ND	ND ND	ND ND	ND ND
	MW5 MW5	5 9	900 ND	3.1 ND	3.1 ND	110 ND	30 ND
Detection Limits	n		1.0	0.05	0.1	0.1	0.1

^{*} TPH as diesel, TOG, and all EPA method 8010 constituents were non-detectable.


ND = Non-detectable.

Results in parts per million (ppm), unless otherwise indicated.



Consulting Engineers

P.O. BOX 996 • BENICIA, CA 94510 (707) 746-6915 • (707) 746-6916 • FAX: (707) 746-5581

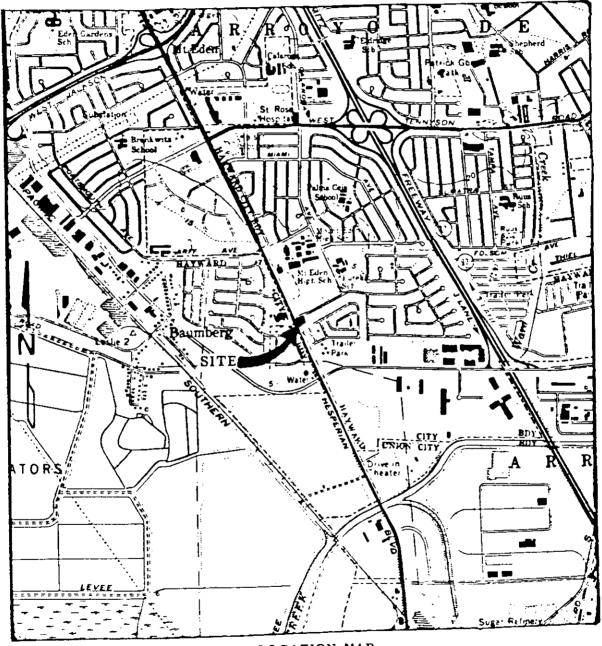


LOCATION MAP



Consulting Engineers

P.O. BOX 996 • BENICIA, CA 94510 (707) 746-6915 • (707) 746-6916 • FAX: (707) 746-5581

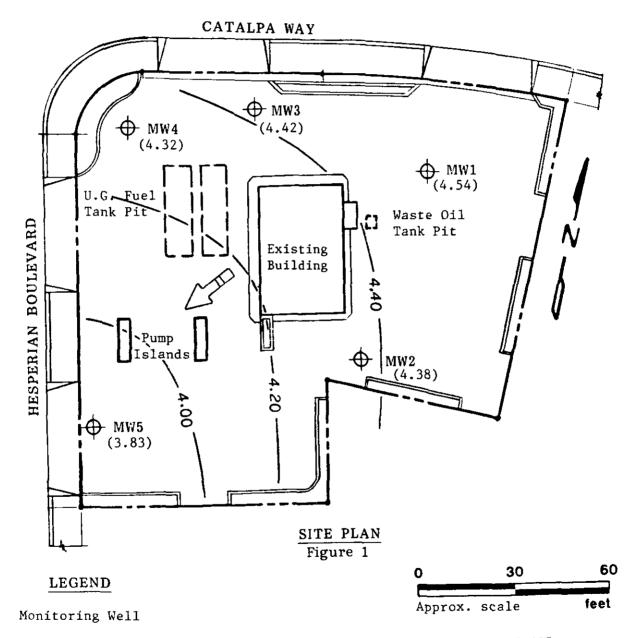

Direction of Ground Water Flow


() Water Table elevation in feet on 8/02/91

 Contours of ground water surface in feet



Consulting Engineers


P.O. BOX 996 • BENICIA, CA 94510 (707) 746-6915 • (707) 746-6916 • FAX: (707) 746-5581

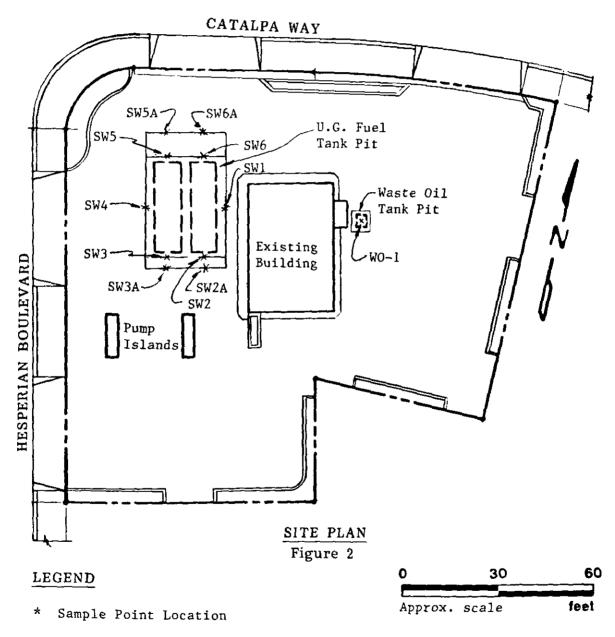



Consulting Engineers

P.O. BOX 996 • BENICIA, CA 94510 (707) 746-6915 • (707) 746-6916 • FAX: (707) 746-5581

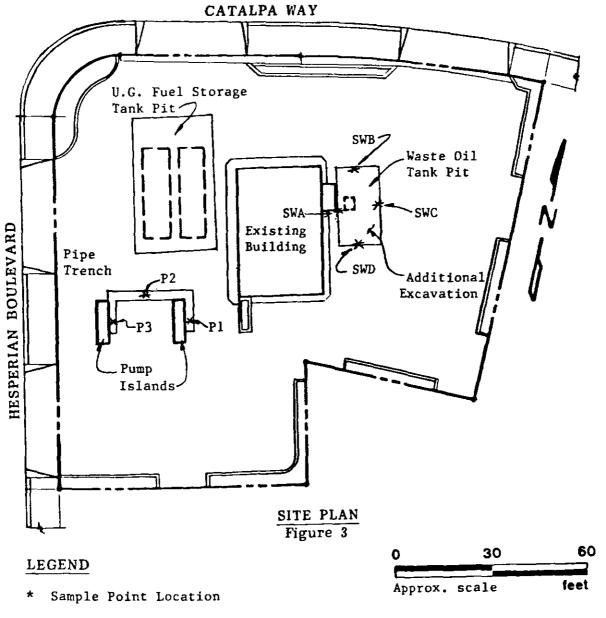


Unocal S/S #5487 28250 Hesperian Boulevard Hayward, CA



Consulting Engineers


P.O. BOX 996 • BENICIA, CA 94510 (707) 746-6915 • (707) 746-6916 • FAX: (707) 746-5581

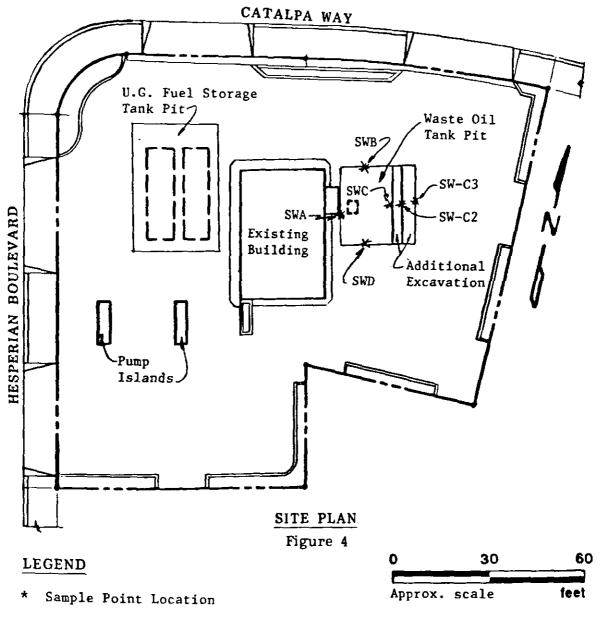



Consulting Engineers

P.O. BOX 996 • BENICIA, CA 94510 (707) 746-6915 • (707) 746-6916 • FAX: (707) 746-5581

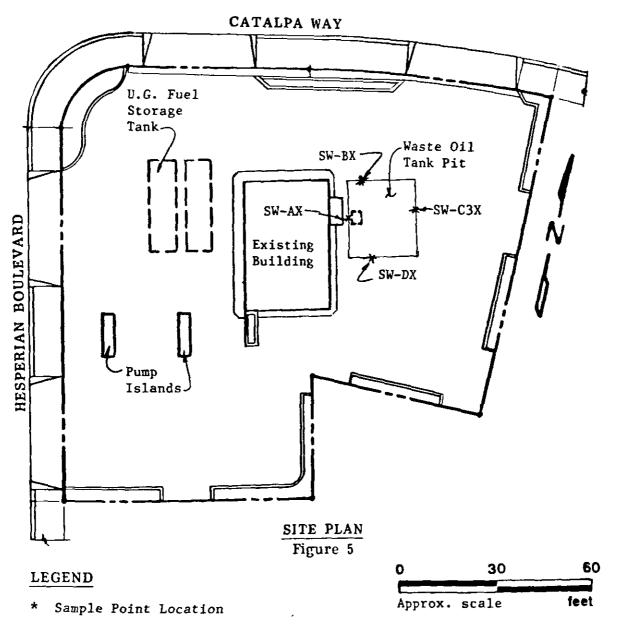

Unocal S/S #5487 28250 Hesperian Boulevard Hayward, CA



Kaprealian Engineering, Inc.

P.O. Box 996

Benicia, CA 94510

Attention: Mardo Kaprealian, P.E.

Client Project ID: Matrix Descript:

First Sample #:

ct ID: Unocal, 28250 Hesperian, Hayward

Matrix Descript: Water Analysis Method: EPA 50

EPA 5030/8015/8020 108-0175 AB Sampled:

Aug 2, 1991 Aug 2, 1991

Received: Analyzed: Reported:

8/9,13/91 Aug 14, 1991

TOTAL PETROLEUM FUEL HYDROCARBONS with BTEX DISTINCTION (EPA 8015/8020)

Sample Number	Sample Description	Low/Medium B.P. Hydrocarbons µg/L (ppb)	Benzene μg/L (ppb)	Toluene μg/L (ppb)	Ethyl Benzene μg/L (ppb)	Xylenes μg/L (ppb)
108-0175	MW1	N.D.	N.D.	N.D.	N.D.	N.D.
108-0176	MW2	N.D.	N.D.	N.D.	N.D.	N.D.
108-0177	MW3	N.D.	N.D.	N.D.	N.D.	N.D.
108-0178	MW4	N.D.	N.D.	N.D.	N.D.	N.D.
108-0179	MW5	100	43	0.33	12	5.2

Detection Limits:	30	0.30	0.30	0.30	0.30	

Low to Medium Boiling Point Hydrocarbons are quantitated against a gasoline standard. Analytes reported as N.D. were not present above the stated limit of detection.

SEQUOIA ANALYTICAL

Belinda C. Vega Laboratory Director

Kaprealian Engineering, Inc.

Client Project ID: Unocal, 28250 Hesperian, Hayward

P.O. Box 996

Benicia, CA 94510

Attention: Mardo Kaprealian, P.E. QC Sample Group: 1080175-79

Reported: Aug 14, 1991

QUALITY CONTROL DATA REPORT

ANALYTE	<u> </u>		Ethyl	<u> </u>
	Benzene	Toluene	Benzene	Xylenes
NA alcodo			55100 (5000	- CD 400 4 5 /0000
Method: Analyst:	EPA8015/8020	EPA8015/8020	R.H./J.F.	EPA8015/8020 R.H./J.F.
Reporting Units:	R.H./J.F.	R.H./J.F.	н.п./з.г. μg/L	μg/L
Date Analyzed:	μg/L	μg/L		μg/L Aug 9, 1991
	Aug 9, 1991	Aug 9, 1991	Aug 9, 1991	_
QC Sample #:	BLK080991	BLK080991	BLK080991	BLK080991
Sample Conc.:	N.D.	N.D.	N.D.	N.D.
0.41.5.05.5				
Spike Conc.	0.5	••		
Added:	20	20	20	6 0
Conc. Matrix				
Spike:	23	22	23	70
-				
Matrix Spike				
% Recovery:	120	110	120	120
Conc. Matrix				
Spike Dup.:	23	22	23	69
Matrix Spike				
Duplicate				
% Recovery:	120	110	120	120
Relative				
% Difference:	0	0	0	1.4

Laboratory blank contained the following analytes:

None Detected

SEQUOIA ANALYTICAL

Belinda C. Vega **Laboratory Director**

x 100 % Recovery: Conc. of M.S. - Conc. of Sample Spike Conc. Added x 100 Conc. of M.S. - Conc. of M.S.D. Relative % Difference: (Conc. of M.S. + Conc. of M.S.D.) / 2

1080175.KEI <2>

Kaprealian Engineering, Inc.

Client Project ID: Unocal, 28250 Hesperian, Hayward

P.O. Box 996

Benicia, CA 94510

Attention: Mardo Kaprealian, P.E. QC Sample Group: 1080175-79

Reported: Aug 14, 1991

QUALITY CONTROL DATA REPORT

ANALYTE	<u> </u>		Ethyl	
<u> </u>	Benzene	Toluene	Benzene	Xylenes
Method: Analyst: Reporting Units:	EPA8015/8020 R.H./J.F. #g/L	EPA8015/8020 R.H./J.F. μg/L	EPA8015/8020 R.H./J.F. µg/L	EPA8015/8020 R.H./J.F. μg/L
Date Analyzed: QC Sample #:	Aug 13, 1991 BLK081391	Aug 13, 1991 BLK081391		Aug 13, 1991 BLK081391
Sample Conc.:	N.D.	N.D.	N.D.	N.D.
Spike Conc. Added:	20	20	20	60
Conc. Matrix Spike:	25	24	25	75
Matrix Spike % Recovery:	130	120	130	130
Conc. Matrix Spike Dup.:	27	25	27	80
Matrix Spike Duplicate % Recovery:	140	130	140	130
Relative % Difference:	7.7	4.1	7.7	6.5

Laboratory blank contained the following analytes: None Detected

SEQUOIA ANALYTICAL

Belinda C. Vega Laboratory Director

% Recovery:	Conc. of M.S Conc. of Sample Spike Conc. Added	x 100	<u> </u>
 Relative % Difference:	Conc. of M.S Conc. of M.S.D. (Conc. of M.S. + Conc. of M.S.D.) / 2	x 100	

1080175.KEI <3>



CHAIN OF CUSTODY

SAMPLER AU (NE) WITHESSING AGENCY		Ì	20250 MECREDIANI					<u> </u>	A	NALYSE	S REQUE	STED	TURN AROUND TIME:		
		-						0		; ; ;		!	j	REGULAR_	
SAMPLE ID NO.	DATE	TIME	SOIL	 WATER	 GRAB	COMP	NO.	SAMPLING LOCATION	Fd/	1991		 	 	REMARKS	
MW/	8-2			X	X	 	2	VOA	×	X	—— 	- -			1080175 AB
mwz	Ł _ł		l	X	X	 	1,		X	x			i	i	176
MW3	ч			X	×	 	u		X	X			<u> </u>	<u>'</u>] 177
mw4	4			<u> </u> <u> </u>	X		4		×	X	i	1	<u> </u>		178
MUS	5	 		K	×	-	14		×	x				ļ i_] 179 /
[ļ	<u> </u>				<u> </u>	·
						1				,			i		
]			 				 	
!!!				!	!	ļ .	!	ļ	!						
Relinquished by: (Signature) Date/Time						Received by: (Signature)			The following MUST BE completed by for analysis: 1. Have all samples received for					analysis been stored in ice?	
Seich berent 8/2/11/50				+ * *	1			2. Will samples remain refrigerated until analyzed?							
Relinguished by: (Signature) pate/Time			j	Received by: (Signature)			3. Did any samples received for analysis have head space?								
				42	Received by: (Signature)				4. Were samples in appropriate containers and properly packaged? Company Company						