

DEPARTMENT OF ENVIRONMENTAL HEALTH

Facility Name	: N/A	Owner	: N/A
Site Address	: 170 WOODLAND WAY	Owner Address	: 170 WOODLAND WAY
Facility Phone	:	Owner Phone	:
Type of Facility	: 5520 FACILITY CLOSUREDEH OVERSIGHTDEPT HOURLY RATE		

Facility ID	: FA0324727	Inspector	: EE0000180 - BARBARA JAKUB
Record ID	: PR0524703	Inspector Phone	: (510) 567-6737 Ext. 36737
License/Permit Number	: PT0318959	Inspection Start Time	: Not Specified
Person in Charge	: N/A	Inspection Stop Time	: Not Specified
Inspection Date	: 2/14/2017	Total Inspection Time	: 40 min.
Inspection Number	: DA7GDMLQD	Travel Start Time	: Not Specified
Purpose of Inspection	: B87 - SITE CLOSURE DEH REVIEW	Travel Stop Time	: Not Specified
Result	: 00 - NOT APPLICABLE	Total Travel Time	: 30 min.
Re-Inspection Date	: Not Specified		
Total Score	: 0.00		

Inspection Violations

No violations cited.

Overall Inspection Comments

BARBARA JAKUB ON-SITE FOR OVEREXCAVATION SAMPLING OF 300 GALLON SINGLE WALL STEEL HOME HEATING OIL TANK. TANK WAS DISCOVERED AFTER OWNER OBSERVED FUEL OIL ENTERING CORNER OF BASEMENT CLOSEST TO THE GARAGE. OWNER HAD REPLACED EXISTING CONCRETE DRIVEWAY WITH PAVERS. GGTR DETERMINED THAT IT WAS A UST CAUSING THE RELEASE. SPECULATION THAT THE RELEASE WAS CAUSED BY WATER ENTERING THROUGH THE PAVERS AND FILLING THE TANK CAUSED THE RELEASE IN THIS YEAR OF RECORD RAIN. NO HOLES WERE OBSERVED IN THE TANK DURING REMOVAL. THE TANK WAS REMOVED BY GGTR PRIOR TO ACDEH'S INVOLVEMENT SINCE A PERMIT WAS NOT REQUIRED BY ACDEH DUE TO THE SIZE, CONTENTS OF THE TANK.

ASUNCION MORA OF GOLDEN GATE TANK REMOVAL PERFORMED SAMPLING. TWO SOIL SAMPLES WERE COLLECTED, THE FIRST, 9609-E, WAS STATED AS THE FILL END OF THE TANK. THE SOIL/ROCK IN THIS AREA WAS STAINED GRAY AND HAD A STRONG HYDROCARBON ODOR. THE SECOND SAMPLE WAS 9609-W TOWARDS THE GARAGE- SEE MAP. THE SOIL NEAR SAMPLE 9609-W HAD A LESS STRONG HYDROCARBON ODOR THAN THE ONE ON THE FILL SIDE OF THE TANK PIT. BOTH SAMPLES WERE COLLECTED AT 4 FEET BELOW GRADE IN BEDROCK.

WATER IN TANK PIT IS FROM RECENT RAINS NOT FROM GROUNDWATER. THIS WATER WAS PUMPED INTO DRUMS FOR DISPOSAL PRIOR TO SAMPLING.

ACDEH APPROVED CLOSING TANK PIT AFTER SAMPLING TO PREVENT ADDITIONAL RAINWATER FROM ENTERING TANK PIT AND POSSIBLY MOBILIZING CONTAMINANTS.



Barbara Jakub
Hazardous Materials Specialist

Drain



9609-W
9609-E

tank pit location



170 Woodland Way

Woodland Way


La Salle Av



170 Woodland Ave., Piedmont
300 gallon heating oil tank removal



170 Woodland Ave., Piedmont
300 gallon heating oil tank removal
Previous sample collected at large puddle

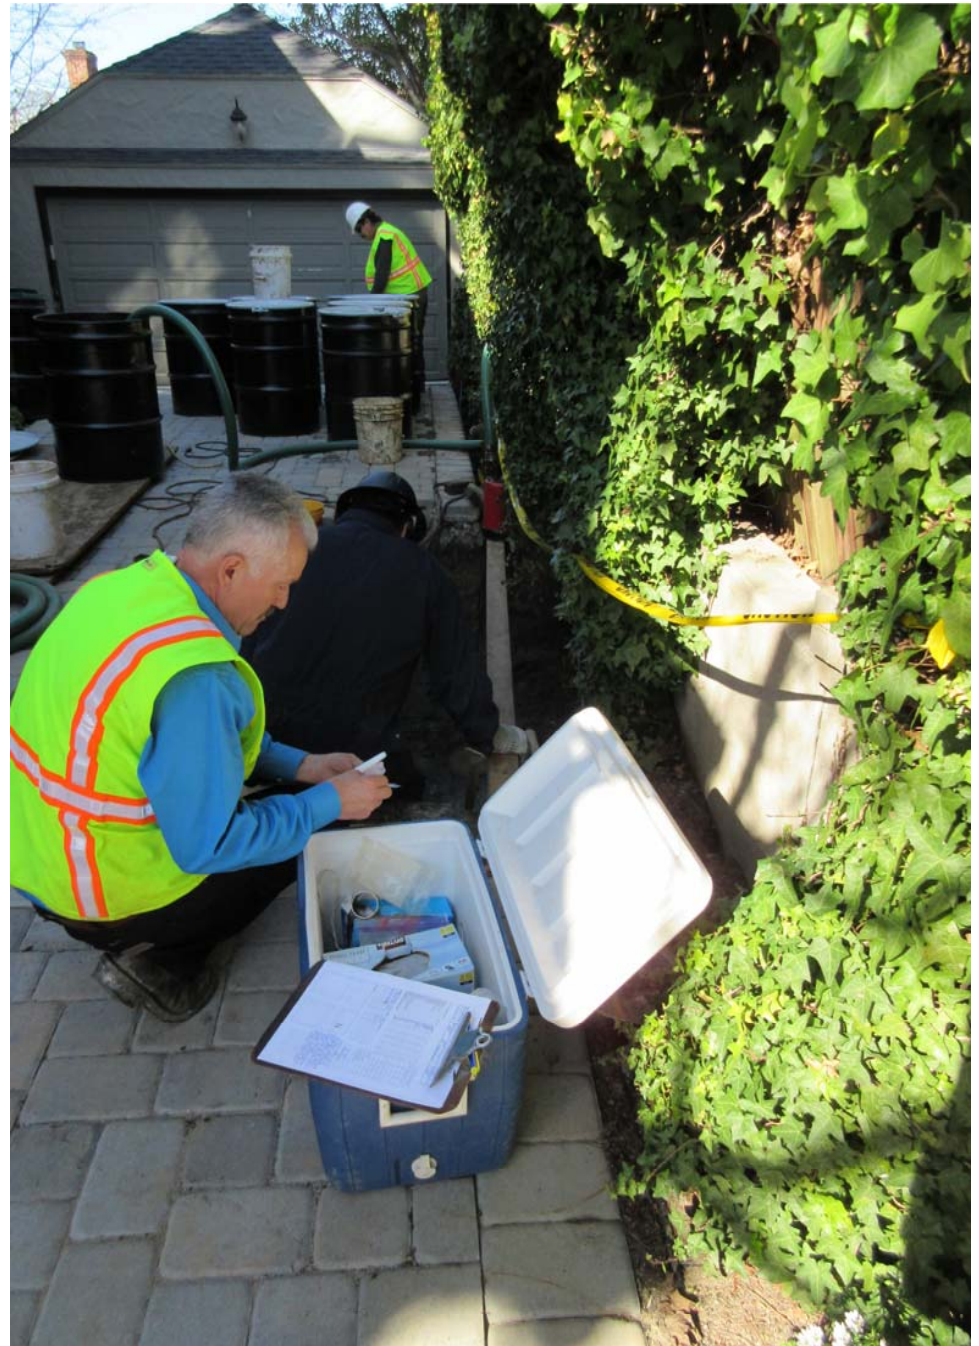



170 Woodland Ave., Piedmont
300 gallon heating oil tank removal
Driveway showing location of tank
pit



170 Woodland Ave., Piedmont
300 gallon heating oil tank removal
East sample collected this side of
tank pit



170 Woodland Ave., Piedmont
300 gallon heating oil tank removal
Soil staining. hydrocarbon odor
detected.

